

Report No.: HA970203-03B



HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : 2ABZ2-EE133

Equipment: Smart Phone

Brand Name : ONEPLUS

Model Name : HD1905

T-Rating : T3

Applicant : OnePlus Technology (Shenzhen) Co., Ltd

18C02, 18C03, 18C04 and 18C05, Shum Yip Terra Building,

Binhe Avenue North, Futian District, Shenzhen

Manufacturer: OnePlus Technology (Shenzhen) Co., Ltd

18C02, 18C03, 18C04 and 18C05, Shum Yip Terra Building,

Binhe Avenue North, Futian District, Shenzhen

Standard : FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received on Jul. 09, 2019 and testing was started from Aug. 05, 2019 and completed on Aug. 07, 2019. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The report must not be used by the client to claim product certification, approval, or endorsement by TAF or any agency of government.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Cona Huang / Deputy Manager

Gua Guang

SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 26 FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

Table of Contents

Report No.: HA970203-03B

Page: 2 of 26

Issued Date : Sep. 25, 2019

1.	Attest	tation of Test Results	2
2.	Gener	ral Information	[
3.	Testin	ng Location	б
4.	Applie	ed Standards	б
5.	Air Int	terface and Operating Mode	7
6.			
	6.1	Frequency Response	8
	6.2	T-Coil Signal Quality Categories	8
7.	T-Coil	l Test Procedure	🤉
	7.1	Test Flow Chart	10
	7.2	Test Setup Diagram	11
	7.3	Description of EUT Test Position	14
8.	Test E	Equipment List	15
9.	T-Coil	I testing for CMRS Voice	16
	9.1	GSM Tests Results	16
	9.2	UMTS Tests Results	17
	9.3	CDMA Tests Results	17
10.	T-Coil	I testing for CMRS IP Voice	18
	-		
11.	T-Coil	I testing for OTT VoIP Application	22
3. Testing Location			
13.	Refere	ences.	26

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

History of this test report

Report No.: HA970203-03B

Report No.	Version	Description	Issued Date
HA970203-03B	Rev. 01	Initial issue of report	Sep. 25, 2019

TEL: 886-3-327-3456 Page: 3 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency	Magnetic
			Response	Intensity
OOM OMBO Vaire	GSM850	T3	Pass	Pass
SSM CMRS Voice	GSM1900	T3	Pass	Pass
OTT	EDGE850	T3	Pass	Pass
OTT over EDGE	EDGE1900	T3	Pass	Pass
	Band 2	T4	Pass	Pass
MTS CMRS Voice	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 2	T4	Pass	Pass
OTT over UMTS	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	BC0	T4	Pass	Pass
DMA CMRS Voice	BC1	T4	Pass	Pass
	BC10	T4	Pass	Pass
	BC0	T4	Pass	Pass
OTT over CDMA	BC1	T4	Pass	Pass
	BC10	T4	Pass	Pass
	Band 2	T4	Pass	Pass
	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 7	T4	Pass	Pass
	Band 12	T4	Pass	Pass
	Band 13	T4	Pass	Pass
	Band 17	T4	Pass	Pass
VoLTE	Band 25	T4	Pass	Pass
	Band 26	T4	Pass	Pass
	Band 30	T4	Pass	Pass
	Band 66	T4	Pass	Pass
	Band 71	T4	Pass	Pass
	Band 38	T4	Pass	Pass
	Band 41	T4	Pass	Pass
	Band 48	T4	Pass	Pass
OTT over LTE	Band 25	T4	Pass	Pass
OTT OVER LIL	Band 41	T4	Pass	Pass
	2450	T3	Pass	Pass
	5200	T3	Pass	Pass
VoWiFI	5300	T4	Pass	Pass
	5500	T4	Pass	Pass
	5800	T4	Pass	Pass
OTT over WiFi	2450	T4	Pass	Pass
OFF OVER VVIFT	5200	T4	Pass	Pass

Report No.: HA970203-03B

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

Reviewed by: <u>Jason Wang</u> Report Producer: <u>Wan Liu</u>

TEL: 886-3-327-3456 Page: 4 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

2. General Information

	Product Feature & Specification
Applicant Name	OnePlus Technology (Shenzhen) Co., Ltd
Equipment Name	Smart Phone
Brand Name	ONEPLUS
Model Name	HD1905
FCC ID	2ABZ2-EE133
EUT Stage	Production Unit
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz CDMA2000 BC0: 824.7 MHz ~ 848.31 MHz CDMA 2000 BC10: 817.9 MHz ~ 1908.75 MHz CDMA 2000 BC10: 817.9 MHz ~ 823.1 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 715.3 MHz LTE Band 12: 699.7 MHz ~ 714.3 MHz LTE Band 12: 699.7 MHz ~ 784.5 MHz LTE Band 30: 730.7 MHz ~ 848.3 MHz LTE Band 30: 320.7 5 MHz ~ 2312.5 MHz LTE Band 38: 2572.5 MHz ~ 2617.5 MHz LTE Band 48: 3552.5 MHz ~ 2617.5 MHz LTE Band 48: 3552.5 MHz ~ 2697.5 MHz LTE Band 47: 665.5 MHz ~ 2687.5 MHz LTE Band 47: 665.5 MHz ~ 2697.5 MHz LTE Band 5: 716.0 MHz ~ 1779.3 MHz LTE Band 66: 1710.7 MHz ~ 2779.3 MHz LTE Band 71: 665.5 MHz ~ 2695.5 MHz WLAN 5.4GHz Band: 5260 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5500 MHz ~ 5720 MHz WLAN 5.8GHz Band: 5745 MHz ~ 5825 MHz Bluetoott: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz
Mode	GSM/GPRS/EGPRS AMR / RMC 12.2Kbps HSDPA HSUPA DC-HSDPA HSPA+ (16QAM uplink) CDMA2000: 1xRTT/1xEv-Do(Rel.0)/1xEv-Do(Rev.A) LTE: QPSK, 16QAM, 64QAM 802.11a/b/g/n/ac HT20/HT40/VHT40/VHT80 Bluetooth BR/EDR/LE NFC:ASK

Report No.: HA970203-03B

TEL: 886-3-327-3456 Page : 5 of 26 FAX: 886-3-328-4978 Issued Date : Sep. 25, 2019

This is a variant report to enable dual SIM slot and change model name, and the changes didn't affect the test results, all the test cases are referred from Sporton HAC report, report number HA970203B (FCC ID: 2ABZ2-EE133)

3. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Report No.: HA970203-03B

Testing Laboratory				
Test Site	SPORTON INTERNATIONAL INC.			
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978			
Test Site No.	Sporton Site No.: SAR04-HY			

4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

TEL: 886-3-327-3456 Page: 6 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

5. Air Interface and Operating Mode

Air	5 1400	_	C63.19	Simultaneous	Name of Voice	Power																
Interface	Band MHz	Туре	Tested	Transmitter	Service	Reduction																
	GSM850	V/O	Vaa	WLAN, BT	CMDC \/siss	No																
	GSM1900	VO	Yes	WLAN, BT		No																
GSM	EDGE850	\/D	V	MAN DT	SIP calling ^(1,2)																	
	EDGE1900	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	INO																
	850			WLAN, BT	3	No																
	1750	VO	Yes	WLAN, BT	CMRS Voice	No																
UMTS	1900			WLAN, BT		No																
	HSPA	VD	Yes	WLAN, BT	/	No																
	850	\/O	V	WLAN, BT	Service Reduction																	
	1900	VO	Yes	WLAN, BT		No																
CDMA	EVDO	VD	Yes	WLAN, BT	/	No																
	Band 2			WLAN, BT	Google Duo	No																
	Band 4			WLAN, BT																		
	Band 5			WLAN, BT																		
	Band 7			WLAN, BT		No																
	Band 12				WLAN, BT	VoLTE	No															
LTE	Band 13		\/5		WLAN, BT	/	No															
(FDD)	Band 17	VD	Yes	WLAN, BT	SIP calling(')-/	No																
	Band 25				WLAN, BT	Google Duo ⁽¹⁾	No															
	Band 26			WLAN, BT		No																
	Band 30																			WLAN, BT		No
	Band 66					WLAN, BT		No														
	Band 71			WLAN, BT		No																
	Band 38			WLAN, BT	1	No																
LTE (TDD)	Band 41	VD	Yes	WLAN, BT	SIP calling ^(1,2)	No																
(.55)	Band 48			WLAN, BT	Google Duo ⁽¹⁾	No																
	2450				_	No																
	5200				/	No																
Wi-Fi	5300	VD	Yes	GSM,WCDMA,CDMA,LTE,BT	SIP calling ^(1,2)	No																
	5500				Google Duo ⁽¹⁾	No																
	5800				Soogie Bas	No																
BT Type Transr	2450	DT	No	GSM,WCDMA,CDMA,LTE,WLAN	NA	No																

Report No.: HA970203-03B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)
VD= CMRS and IP Voice Service over Digital Transport

- For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of -20 dBm0 should be used.
- The SIP calling is android internal auxiliary functions under the dialing program.
- The device have similar frequency in some LTE bands: LTE B12/17, 5/26, 4/66, 2/25, 38/41, since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.


TEL: 886-3-327-3456 Page: 7 of 26 FAX: 886-3-328-4978 Issued Date : Sep. 25, 2019

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA970203-03B

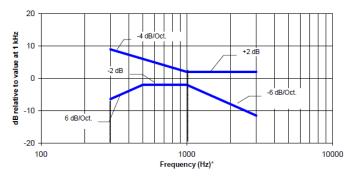

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

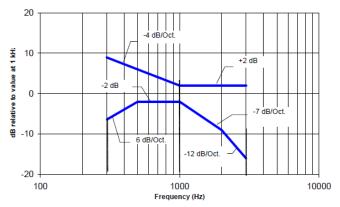

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

TEL: 886-3-327-3456 Page: 8 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA970203-03B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,


Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 9 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

7.1 Test Flow Chart

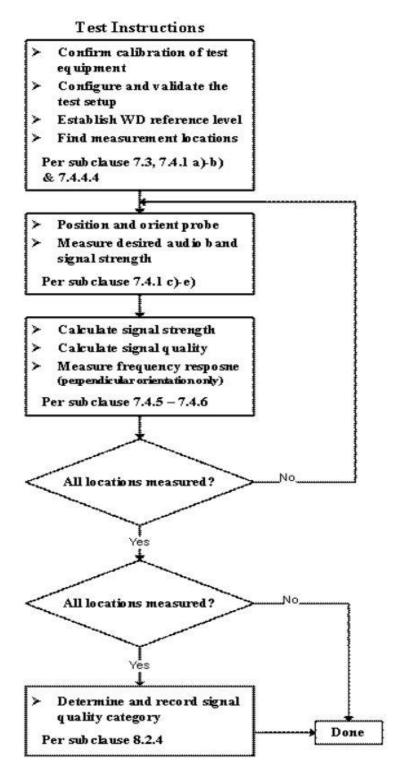


Report No.: HA970203-03B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 10 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

7.2 Test Setup Diagram

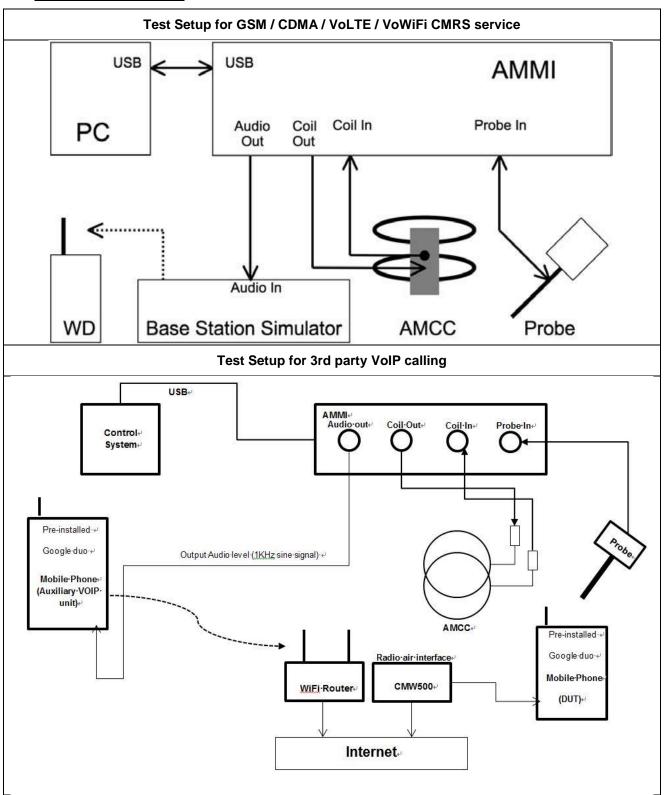

Report No.: HA970203-03B

TEL: 886-3-327-3456 Page: 11 of 26 Issued Date : Sep. 25, 2019 FAX: 886-3-328-4978

HAC T-COIL TEST REPORT

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - GSM input level: -16dBm0
 UMTS input level: -16dBm0
 CDMA input level: -18dBm0
 VoLTE input level: -16dBm0
 - VoWiFi input level: -20dBm0OTT VoIP input Level: -20dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.

Report No.: HA970203-03B

- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. Voice over Long-Term Evolution (VoLTE) is a standard for high-speed wireless communication for mobile phones and data terminals including IoT devices and wearables. It is based on the IP Multimedia Subsystem (IMS) network, with specific profiles for control and media planes of voice service on LTE defined by GSMA in PRD IR.92. This approach results in the voice service (control and media planes) being delivered as data flows within the LTE data bearer. This means that there is no dependency on the legacy circuit-switched voice network to be maintained
- 5. For Voice over Wi-Fi (VoWiFi) is a term typically employed to describe the delivery of commercial telephony services using Voice over IP (VoIP) technologies from mobile devices connected across Wi-Fi. This is typically counter to alternatives, predominantly Voice over LTE (VoLTE), in which a mobile network operator's (MNO's) licensed spectrum (i.e. 4G LTE) is used to carry packetized voice. Broadly speaking, VoWiFi terminology is assigned to all core IMS services accessed from unlicensed spectrum and across untrusted access infrastructures, such as public Wi-Fi access points
- 6. The test setup used for VoLTE over IMS and VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- 7. Voice over Internet Protocol (VoIP) such as google duo application, also called IP telephony, is a methodology and group of technologies for the delivery of voice communications and multimedia sessions over Internet Protocol (IP) networks, such as the Internet. The terms Internet telephony, broadband telephony, and broadband phone service specifically refer to the provisioning of communications services (voice, fax, SMS, voice-messaging) over the public Internet, rather than via the public switched telephone network (PSTN)
- 8. The test setup used for Google DUO VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.
- 9. The test setup used for SIP Calling is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and can be determined the audio input level of -20dBm0

TEL: 886-3-327-3456 Page: 12 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019



SPORTON LAB. HAC T-COIL TEST REPORT

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA970203-03B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Calculation formula:

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level			
(linear)	dB	(dBv RMS)	dBm0			
		-2.47	3.14			
10	20	-19.85	-14.24			
8.17	18.24	-21.61	-16			

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

TEL: 886-3-327-3456 Page: 13 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA970203-03B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

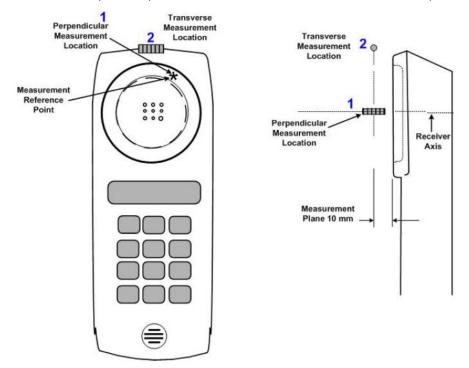


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 14 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

8. Test Equipment List

Manufacturer	Name of Equipment	Type/Medel	Serial Number	Calib	ration
Manufacturer	Name of Equipment	Type/Model	Serial Number	May. 21, 2019 May. 20, 2020 NCR NCR NCR NCR NCR NCR NCR NCR NCR NCR	
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 20, 2018	Nov. 19, 2019
SPEAG	Data Acquisition Electronics	DAE4	854	May. 21, 2019	May. 20, 2020
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR
RCPTWN	Thermometer	HTC-1	TM685-1	Nov. 12, 2018	Nov. 11, 2019
R&S	Base Station	CMW500	115793	Jun. 04, 2019	Jun. 03, 2020
R&S	Base Station	CMU200	103937	Jan. 17, 2019	Jan. 16, 2020

Report No.: HA970203-03B

Note:

TEL: 886-3-327-3456 Page: 15 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

^{1.} NCR: "No-Calibration Required"

9. T-Coil testing for CMRS Voice

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.

2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.

Report No.: HA970203-03B

b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

9.1 GSM Tests Results

<Codec Investigation>

Codec	FR_V1	HR_V1	Orientation	Band / Channel	
ABM 1 (dBA/m)	-2.56	-0.6			
ABM 2 (dBA/m)	-24.94	-28.59	Axial	CCM050 / 400	
Signal Quality (dB)	22.38	27.99	Axiai	GSM850 / 189	
Freq. Response	Pass	Pass			

Remark: According to codec investigation, the worst codec is FR_V1

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response								
1	GSM850	Voice	189	Axial (Z)	-2.56	-24.94	22.38	Т3	-50.32	2	Pass								
'	GSIVIOSO	voice	109	Transversal (Y)	-15.13	-44.13	29.00	T3	-50.23	2	Fd55								
2	GSM1900	Voice	661	Axial (Z)	-1.63	-24.83	23.20	T3	-50.35	1.95	Pass								
	G3W1900	voice	Voice	Voice	Voice	Voice	Voice	Voice	Voice	Voice	001	Transversal (Y)	-15.13	-44.74	29.61	T3	-50.21	1.90	F a 5 5

TEL: 886-3-327-3456 Page: 16 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

9.2 UMTS Tests Results

<Codec Investigation>

Codec	AMR 4.75Kbps	AMR 7.95Kbps	AMR 12.2Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	-0.7	-0.5	-0.79		
ABM 2 (dBA/m)	-43.14	-43.03	-41.45	Axial	UMTS B2 / 9400
Signal Quality (dB)	42.44	42.53	40.66	Axiai	OW15 B27 9400
Freq. Response	Pass	Pass	Pass		

Report No.: HA970203-03B

Remark: According to codec investigation, the worst codec is AMR 12.2Kbps

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response
3	WCDMA II	Voice	9400	Axial (Z)	-0.79	-41.45	40.66	T4	-50.33	2	Pass
3	WCDIVIA II	voice	9400	Transversal (Y)	-8.74	-47.18	38.44	T4	-50.18	2	Fd55
4	WCDMA IV	Voice	1413	Axial (Z)	-0.71	-43.26	42.55	T4	-50.34	1.53	Pass
4	WCDIVIA IV	voice	1413	Transversal (Y)	-9.30	-48.51	39.21	T4	-50.20	1.53	Pass
5	WCDMA V	Voice	4182	Axial (Z)	-0.63	-42.97	42.34	T4	-50.31	1.92	Pass
5	VVCDIVIA V	voice	4102	Transversal (Y)	-8.99	-47.72	38.73	T4	-50.22	1.92	rass

9.3 CDMA Tests Results

<Codec Investigation>

Codec	RC1 SO68	RC3 SO68	RC4 SO68	Orientation	Band / Channel
ABM 1 (dBA/m)	-0.88	-2.18	-1.32		
ABM 2 (dBA/m)	-40.57	-41.53	-42.19	Axial	BC0 / 384
Signal Quality (dB)	39.69	39.35	40.87	Axiai	BC0 / 364
Freq. Response	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is RC3 SO68

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	dB	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
6	CDMA BC0	RC3+SO68 Voice	384	Axial (Z)	-2.18	-41.53	39.35	T4	-50.30	2	Pass
0	CDIVIA BC0	codec8K Enhanced low	304	Transversal (Y)	-10.54	-47.84	37.30	T4	-50.24	2	F 455
7	CDMA BC1	RC3+SO68 Voice	600	Axial (Z)	-3.05	-42.40	39.35	T4	-50.32	2	Pass
'	CDIVIA BCT	codec8K Enhanced low	600	Transversal (Y)	-9.48	-47.48	38.00	T4	-50.24		F455
	CDMA BC10	RC3+SO68 Voice		Axial (Z)	-1.56	-42.07	40.51	T4	-50.35	0	Door
8	CDIVIA BC 10	codec8K Enhanced low		Transversal (Y)	-9.67	-47.93	38.26	T4	-50.26	2	Pass

TEL: 886-3-327-3456 Page: 17 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

10. T-Coil testing for CMRS IP Voice

10.1 VoLTE Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.

Report No.: HA970203-03B

- b. Select LTE FDD / TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
- c. The TDD LTE power class 3 supports uplink-downlink configuration 0 and 6 and power class 2 supports uplink-downlink configuration1 to 5 for this device, an investigation was performed to determine the worst-case uplink-downlink configuration to be used for the testing for the handset.
- d. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

LTE FDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	-3.65	-5.65	-3.68	-3.6	-6.3	-6.15	-6.19	-6.18	-5.18	-6.13		
ABM 2 (dBA/m)	-42.36	-42.54	-43.21	-42.3	-44.08	-43.44	-43.57	-43.62	-43.17	-43.57		B25 / 20M /
Signal Quality (dB)	38.71	36.89	39.53	38.7	37.78	37.29	37.38	37.44	37.99	37.44	Axial	26340
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

LTE TDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	-1.07	-2.25	-0.68	-1.14	-0.71	-1.1	-1.16	-0.67	-0.61	-0.62		
ABM 2 (dBA/m)	-37.39	-36.96	-36.82	-37.28	-37.05	-37.16	-37.06	-36.86	-36.96	-36.89	Avial	B41 / 20M /
Signal Quality (dB)	36.32	34.71	36.14	36.14	36.34	36.06	35.9	36.19	36.35	36.27	Axial	40620
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 18 of 26 FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

<Air Interface Investigation>

Air	Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B25	20	QPSK	1	0	26340	-	-6.18	-43.03	36.85
	LTE B25	20	QPSK	50	0	26340	-	-6.05	-42.98	36.93
	LTE B25	20	QPSK	100	0	26340	-	-6.10	-43.18	37.08
	LTE B25	20	16QAM	1	0	26340	-	-5.76	-42.96	37.20
FDD	LTE B25	20	64QAM	1	0	26340	-	-5.35	-43.01	37.66
FDD	LTE B25	15	QPSK	1	0	26340	-	-5.55	-42.95	37.40
	LTE B25	10	QPSK	1	0	26340	-	-5.79	-43.13	37.34
	LTE B25	5	QPSK	1	0	26340	-	-6.09	-42.95	36.86
	LTE B25	3	QPSK	1	0	26340	-	-5.86	-43.27	37.41
	LTE B25	1.4	QPSK	1	0	26340	-	-5.64	-43.14	37.50
	LTE B41_PC3	20	QPSK	1	0	40620	0	-3.13	-37.56	34.43
	LTE B41_PC3	20	QPSK	50	0	40620	0	-2.95	-37.50	34.55
	LTE B41_PC3	20	QPSK	100	0	40620	0	-2.91	-37.39	34.48
	LTE B41_PC3	20	16QAM	1	0	40620	0	-2.74	-37.50	34.76
	LTE B41_PC3	20	64QAM	1	0	40620	0	-2.64	-37.30	34.66
	LTE B41_PC3	15	QPSK	1	0	40620	0	-2.55	-37.41	34.86
	LTE B41_PC3	10	QPSK	1	0	40620	0	-2.88	-37.42	34.54
TDD	LTE B41_PC3	5	QPSK	1	0	40620	0	-2.87	-37.41	34.54
	LTE B41_PC3	20	QPSK	1	0	40620	6	-2.58	-37.48	34.90
	LTE B41_PC2	20	QPSK	1	0	40620	1	-2.64	-37.31	34.67
	LTE B41_PC2	20	QPSK	1	0	40620	2	-2.71	-37.53	34.82
	LTE B41_PC2	20	QPSK	1	0	40620	3	-3.16	-37.57	34.41
	LTE B41_PC2	20	QPSK	1	0	40620	4	-2.95	-37.31	34.36
	LTE B41_PC2	20	QPSK	1	0	40620	5	-2.87	-37.27	34.40
	UL CA B41	20	QPSK	1	0	40620	0	-2.99	-37.37	34.38

Report No.: HA970203-03B

Plot No.	Air Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response
9	LTE Band 7	20	QPSK	1	0	21100	Axial (Z)	-2.48	-41.61	39.13	T4	-50.31	2	Pass
9	LTE Ballu 7	20	QFSK		U	21100	Transversal (Y)	-10.84	-47.47	36.63	T4	-50.22	2	F d 3 5
10	LTE Band 12	10	QPSK	1	0	23095	Axial (Z)	-2.19	-41.44	39.25	T4	-50.34	2	Pass
10	LIE Ballu 12	10	QFSK		U	23095	Transversal (Y)	-10.67	-47.88	37.21	T4	-50.25	2	F d 5 5
11	LTE Band 13	10	QPSK	1	0	23230	Axial (Z)	-2.19	-41.81	39.62	T4	-50.31	2	Pass
11	LIE Banu 13	10	QFSK		U	23230	Transversal (Y)	-10.86	-47.40	36.54	T4	-50.21	2	F d 3 5
12	LTE Band 25	20	QPSK	1	0	26340	Axial (Z)	-5.65	-42.54	36.89	T4	-50.34	2	Pass
12	LTL Band 25	20	QFSK	'	0	20340	Transversal (Y)	-14.22	-48.77	34.55	T4	-50.23	2	F 055
13	LTE Band 26	15	QPSK	1	0	26865	Axial (Z)	-2.27	-41.49	39.22	T4	-50.30	2	Pass
13	LTE Banu 20	15	QFSK		U	20000	Transversal (Y)	-10.68	-47.83	37.15	T4	-50.24	2	F d 3 5
14	LTE Band 30	10	QPSK	1	0	27710	Axial (Z)	-1.98	-41.04	39.06	T4	-50.36	2	Pass
14	LTE Band 30	10	QFSK		U	27710	Transversal (Y)	-11.13	-46.78	35.65	T4	-50.21	2	F d 3 5
15	LTE Band 41	20	QPSK	1	0	40620	Axial (Z)	-2.25	-36.96	34.71	T4	-50.32	2	Pass
15	LIE Band 41	20	QPSK	l '	U	40620	Transversal (Y)	-11.08	-46.18	35.10	T4	-50.19	2	Pass
16	LTE Band 48	20	QPSK	1	0	55830	Axial (Z)	-2.43	-39.82	37.39	T4	-50.33	2	Pass
16	LTE Ballu 46	20	QFSK	'	U	55650	Transversal (Y)	-11.71	-46.88	35.17	T4	-50.20	2	F455
17	LTE Band 66	20	QPSK	1	0	132322	Axial (Z)	-2.56	-41.31	38.75	T4	-50.33	2	Pass
17	LIE Danu 66	20	UPSN		U	132322	Transversal (Y)	-10.81	-47.50	36.69	T4	-50.22		Pass
10	LTE Band 71	20	QPSK	1	_	133322	Axial (Z)	-1.84	-41.26	39.42	T4	-50.34	1.93	Door
18	LIE Danu /1	20	UPSN		0	133322	Transversal (Y)	-11.13	-46.22	35.09	T4	-50.21	1.93	Pass

TEL: 886-3-327-3456 Page: 19 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

10.2 VoWiFi Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations
(WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It
is only necessary to document this for one channel/band, the following worst investigation codec would be remarked
to be used for the testing for the handset.

Report No.: HA970203-03B

2. Air Interface Investigation:

- a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
- b. Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

Codec	NB AMR 4.75Kbps			WB AMR 23.85Kbps		EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	-4.6	-5.49	-4.08	-4.23	-6.93	-6.7	-7.77	-6.53	-4.61	-6.59		
ABM 2 (dBA/m)	-35.21	-34.9	-35.17	-35.17	-36.63	-37.24	-37.35	-37.35	-35.57	-36.94		2.4GHz
Signal Quality (dB)	30.61	29.41	31.09	30.94	29.7	30.54	29.58	30.82	30.96	30.35	Axial	WLAN / 6
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 20 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

<Air Interface Investigation>

Frequency Bands	Modulation	Bandwidth	Data Rate	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	802.11b	20	1M	6	-5.84	-34.71	28.87
	802.11b	20	11M	6	-5.53	-34.80	29.27
	802.11g	20	6M	6	-5.67	-34.83	29.16
	802.11g	20	54M	6	-5.62	-34.75	29.13
	802.11n-HT20	20	MCS0	6	-5.71	-34.65	28.94
WLAN 2.4GHz	802.11n-HT20	20	MCS7	6	-5.55	-34.63	29.08
WLAN 2.4GHZ	802.11n-HT40	40	MCS0	6	-5.66	-34.71	29.05
	802.11n-HT40	40	MCS7	6	-5.70	-34.72	29.02
	802.11ac-VHT20	20	MCS0	6	-5.81	-34.92	29.11
	802.11ac-VHT20	20	MCS7	6	-5.66	-34.82	29.16
	802.11ac-VHT40	40	MCS0	6	-5.69	-34.77	29.08
	802.11ac-VHT40	40	MCS7	6	-5.77	-34.86	29.09
	802.11a	20	6M	40	-6.19	-33.89	27.70
	802.11a	20	54M	40	-6.29	-34.98	28.69
	802.11an-HT20	20	MCS0	40	-5.94	-35.67	29.73
	802.11an-HT20	20	MCS7	40	-5.83	-34.43	28.60
	802.11an-HT40	40	MCS0	38	-6.09	-34.79	28.70
NA// ANI 5011	802.11an-HT40	40	MCS7	38	-5.95	-34.41	28.46
WLAN 5GHz	802.11ac-VHT20	20	MCS0	40	-5.94	-34.65	28.71
	802.11ac-VHT20	20	MCS8	40	-6.03	-35.33	29.30
	802.11ac-VHT40	40	MCS0	38	-5.96	-35.74	29.78
	802.11ac-VHT40	40	MCS8	38	-5.84	-36.40	30.56
	802.11ac-VHT80	80	MCS0	50	-5.83	-33.84	28.01
	802.11ac-VHT80	80	MCS8	50	-6.19	-34.13	27.94

Report No.: HA970203-03B

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response		
19	WLAN2.4GHz	802.11b 1Mbps	6	Ant 1+2	Axial (Z)	-5.49	-34.90	29.41	T3	-50.35	2	Pass		
19	WLAN2.4GHZ	602.11b TMbps	0	Ant 1+2	Transversal (Y)	-14.33	-44.78	30.45	T4	-50.24	2	F455		
20	WLAN5GHz	902 44a 6Mbna	40	Ant 1+2	Axial (Z)	-6.79	-35.49	28.70	T3	-50.34	2	Pass		
20	WLANSGHZ	802.11a 6Mbps	40	Ant 1+2	Transversal (Y)	-14.45	-45.48	31.03	T4	-50.22	2	Pass		
21	WLAN5GHz	802.11a 6Mbps	60	Ant 1+2	Axial (Z)	-5.54	-39.07	33.53	T4	-50.33	2	Pass		
21	WLANDGHZ	802. I Ta bivibps	60	Ant 1+2	Transversal (Y)	-14.27	-46.19	31.92	T4	-50.21	2	Pass		
22	WI ANECLI-	000 44a 6Mbna	104	Amt 1 . 2	Axial (Z)	-6.22	-38.09	31.87	T4	-50.35	4.00	Door		
22	WLANSGHZ	AN5GHz 802.11a 6Mbps 12	124	Ant 1+2	Transversal (Y)	-14.32	-45.95	31.63	T4	-50.24	1.98	Pass		
22	WI ANECLI-	VLAN5GHz 802.11a 6Mbps 157	157	Amt 1 . 2	Axial (Z)	-5.33	-37.99	32.66	T4	-50.36	4.20	Dana		
23	WLANSGHZ	ouz. i ia bivibps	157	157	157	Ant 1+2	Transversal (Y)	-14.42	-46.28	31.86	T4	-50.21	1.38	Pass

TEL: 886-3-327-3456 Page: 21 of 26 FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

11. T-Coil testing for OTT VoIP Application

General Notes:

- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.
- 2. The google Duo VoIP application are pre-installed on this device. According to KDB 285076 D02, all air interfaces via a data connection with VoIP application need to be considered HAC testing.

Report No.: HA970203-03B

- 3. The Google Duo only support OPUS audio codec and support 6Kbps to 75Kbps bitrate.
- 4. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 5. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 6. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VoLTE and VoWiFi test results of air interface investigation, the worst configuration and frequency band of air interface was used for OTT T-Coil testing.
 - -LTE FDD worst configuration and band: LTE Band 25/20MHz/QPSK/1RB Size
 - -LTE TDD worst configuration and band: LTE Band 41/20MHz/QPSK/1RB Size
 - -WLAN2.4GHz Ant 1+2 worst configuration: 802.11b /1Mbps
 - -WLAN5GHz Ant 1+2 worst configuration and Band: WLAN 5.2GHz /11a/6Mbps

<Codec Investigation>

EDGE

	Google	: Duo				SIP Calling				Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	3.02	3.54	2.48	-5.16	-4.7	-4.8	-4.13	-4.12		
ABM 2 (dBA/m)	-30.3	-30.01	-30.36	-27.92	-27.4	-27.58	-29.51	-29.1	Avial	GSM850 /
Signal Quality (dB)	33.32	33.55	32.84	22.76	22.7	22.78	25.38	24.98	Axial	189
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is GSM 13Kbit/s

HSPA

	Google	: Duo				SIP Calling				Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	4.34	4.19	4.36	-4.05	-4.36	-4.14	-3.86	-3.97		UMTS B2 / 9400
ABM 2 (dBA/m)	-46.42	-46.58	-46.15	-48.82	-47.27	-47.8	-48.43	-48.45	Axial	
Signal Quality (dB)	50.76	50.77	50.51	44.77	42.91	43.66	44.57	44.48		
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is GSM 13Kbit/s

TEL: 886-3-327-3456 Page: 22 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

1XEVDO Rev A

	Google	: Duo				SIP Calling				Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	4.07	4.21	4.12	-3.59	-3.97	-3.29	-3.6	-3.62		
ABM 2 (dBA/m)	-47.98	-47.58	-47.53	-47.95	-46.8	-47.6	-47.28	-47.11	Axial	BC0 / 384
Signal Quality (dB)	52.05	51.79	51.65	44.36	42.83	44.31	43.68	43.49		
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Report No.: HA970203-03B

Remark: According to codec investigation, the worst codec bitrate is GSM 13Kbit/s

LTE FDD

	Google	Duo				SIP Calling				Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	4.33	4.1	4.11	-5.07	-5.07	-5.18	-4.94	-5.17		
ABM 2 (dBA/m)	-44.31	-44.42	-43.8	-44.77	-44.56	-45.15	-44.94	-45.34		B25 / 20M / 26340
Signal Quality (dB)	48.64	48.52	47.91	39.7	39.49	39.97	40	40.17	Axial	
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is GSM 13Kbit/s

LTE TDD

	Google	Duo Duo				SIP Calling				Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	4.35	4.03	3.92	-4.42	-4.84	-4.52	-4.87	-4.48	- Axial	B41 / 20M / 40620
ABM 2 (dBA/m)	-37.26	-37.55	-37.45	-37.27	-37.53	-37.49	-38.03	-37.36		
Signal Quality (dB)	41.61	41.58	41.37	32.85	32.69	32.97	33.16	32.88		
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is GSM 13Kbit/s

WLAN

	Google	e Duo				SIP Calling				Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	4.27	3.82	3.95	-3.5	-3.89	-3.31	-3.52	-3.38		
ABM 2 (dBA/m)	-32.7	-33.6	-32.88	-34.02	-34.03	-33.92	-33.97	-33.98	- Axial	WLAN2.4G / 6
Signal Quality (dB)	36.97	37.42	36.83	30.52	30.14	30.61	30.45	30.6		
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is GSM 13Kbit/s

TEL: 886-3-327-3456 Page: 23 of 26 FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

SPORTON LAB. HAC T-COIL TEST REPORT

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response			
24	GSM850	EDGE 2 Tx slots	189	_	Axial (Z)	-4.70	-27.40	22.70	T3	-50.35	1.44	Pass			
24	G3101030	LDGL 2 1X SIOIS	109	_	Transversal (Y)	-14.33	-41.80	27.47	Т3	-50.24	1.44	F 033			
25	GSM1900	EDGE 2 Tx slots	661	_	Axial (Z)	-4.84	-28.48	23.64	Т3	-50.34	0.91	Door			
23	G3W1900	LDGL 2 1X SIOIS	001	_	Transversal (Y)	-14.98	-45.06	30.08	T4	-50.23	0.91	Pass			
26	WCDMA II	HSPA	9400	_	Axial (Z)	-4.36	-47.27	42.91	T4	-50.33	1.51	Door			
20	WCDIVIA II	пора	9400	-	Transversal (Y)	-13.28	-48.84	35.56	T4	-50.21	1.51	Pass			
27	WCDMA IV	HSPA	4.440		Axial (Z)	-4.46	-47.12	42.66	T4	-50.34	1.44	Door			
21	WCDINA IV	HSPA	1413	-	Transversal (Y)	-13.23	-49.02	35.79	T4	-50.22	1.44	Pass			
28	WCDMA V	HSPA	LICEA	11004	11004	4182		Axial (Z)	-4.26	-47.91	43.65	T4	-50.35	1.41	Pass
20	WCDIVIA V	пора	4102	-	Transversal (Y)	-13.24	-49.55	36.31	T4	-50.23	1.41	Pass			
29	ODAM DOS DEAD 450 014	384		Axial (Z)	-3.97	-46.80	42.83	T4	-50.32	0.04	Pass				
29	CDMA BC0	RTAP 153.6Kbps	384	-	Transversal (Y)	-12.26	-49.18	36.92	T4	-50.20	0.84	F 455			
20	CDMA BC1	DTAD 450 0Kb	000		Axial (Z)	-3.79	-47.68	43.89	T4	-50.31	4.05	D			
30	CDIMA BC1	RTAP 153.6Kbps	600	-	Transversal (Y)	-12.96	-48.73	35.77	T4	-50.22	1.05	Pass			
31	CDMA BC10	RTAP 153.6Kbps	580	_	Axial (Z)	-4.33	-46.57	42.24	T4	-50.33	1.17	Pass			
31	CDIVIA BC 10	KTAP 153.6Kbps	560	-	Transversal (Y)	-12.83	-48.34	35.51	T4	-50.23	1.17	Pass			
32	LTE Band 25	20M ODSK 4 0	26240	_	Axial (Z)	-5.07	-44.56	39.49	T4	-50.34	1.38	Door			
32	LTE Band 25	20M_QPSK_1_0	26340	-	Transversal (Y)	-13.93	-48.04	34.11	T4	-50.21	1.30	Pass			
33	LTE Band 41	OOM ODOK 4 O	40000		Axial (Z)	-4.84	-37.53	32.69	T4	-50.35	4.00	D			
33	LIE Band 41	20M_QPSK_1_0	40620	-	Transversal (Y)	-15.90	-46.47	30.57	T4	-50.20	1.32	Pass			
24	34 WLAN2.4GHz 802.11b 1Mbps	6	Ant 1+2	Axial (Z)	-3.89	-34.03	30.14	T4	-50.32	1.32	Door				
34		Ö	Ant 1+2	Transversal (Y)	-12.56	-44.86	32.30	T4	-50.23	1.32	Pass				
35	MI ANECLI-	000 44a CMb	40	A m 4 4 . O	Axial (Z)	-3.97	-35.77	31.80	T4	-50.33		Door			
35	5 WLAN5GHz 802.11a 6Mbps	40	Ant 1+2	Transversal (Y)	-12.78	-45.63	32.85	T4	-50.21	1.41	Pass				

Report No.: HA970203-03B

Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- The detail frequency response results please refer to appendix A.
- Test Engineer: Tom Jiang

TEL: 886-3-327-3456 Page: 24 of 26 FAX: 886-3-328-4978 Issued Date : Sep. 25, 2019

12. <u>Uncertainty Assessment</u>

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2. The judgment of conformity in the report is based on the measurement results excluding the measurement uncertainty.

Report No.: HA970203-03B

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)				
		Probe Sen	sitivity								
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %				
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %				
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %				
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %				
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %				
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %				
		Probe Sy	rstem								
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %				
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %				
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %				
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %				
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %				
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %				
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %				
		Test Siç	gnal								
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %				
		Position	ning								
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %				
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %				
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %				
External Contributions											
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %				
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %				
	Combined Star	ndard Uncertainty				± 4.1 %	± 6.1 %				
	Coverage F	actor for 95 %				K = 2					
	Expanded Uncertainty										

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 25 of 26
FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019

13. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA970203-03B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 26 of 26 FAX: 886-3-328-4978 Issued Date: Sep. 25, 2019