# HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : 2ACCJH170

**Equipment**: GSM/UMTS/LTE Mobile phone

Brand Name: TCL
Model Name: T608DL

T-Rating: T3

**Applicant**: TCL Communication Ltd.

5/F, Building 22E, 22 Science Park East Avenue, Hong

Report No.: HA2O1305B

Kong Science Park, Shatin, NT, Hong Kong

Manufacturer: TCL Communication Ltd.

5/F, Building 22E, 22 Science Park East Avenue, Hong

Cert #5145.01

Kong Science Park, Shatin, NT, Hong Kong

Standard: FCC 47 CFR §20.19

ANSI C63.19-2011

We, Sporton International Inc. (Shenzhen), would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Shenzhen), the test report shall not be reproduced except in full.

Approved by: Si Zhang

Si Zhang



1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China

 Sporton International Inc. (Shenzhen)
 Page 1 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422



## SPORTON LAB. HAC T-COIL TEST REPORT

# Table of Contents

Report No.: HA2O1305B

1.	Attestation of Test Results	4
2.	General Information	
3.	Testing Location	
4.	Applied Standards	
5.	Air Interface and Operating Mode	
6.	Measurement standards for T-Coil	
-	6.1 Frequency Response	
	6.2 T-Coil Signal Quality Categories	
	6.3 Description of EUT Test Position	
7.	T-Coil Test Procedure	10
	7.1 Test Flow Chart	11
	7.2 Test Setup Diagram for GSM/UMTS/VoLTE/VoWiFi	
8.		14
9.	T-Coil testing for CMRS Voice	15
	9.1 GSM Tests Results	15
	9.2 UMTS Tests Results	
10.	. T-Coil testing for CMRS IP Voice	17
	10.1 VoLTE Tests Results	
	10.2 VoWiFi Tests Results	20
11.	Uncertainty Assessment	22
12.	References	23

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

Page 2 of 23

Issued Date

: Dec. 27, 2022

TEL: +86-755-86379589 / FAX: +86-755-86379595

Form version. : 210422

## History of this test report

Report No.: HA2O1305B

Report No.	Version	Description	Issued Date
HA2O1305B	Rev. 01	Initial issue of report	Dec. 27, 2022

 Sporton International Inc. (Shenzhen)
 Page 3 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

## 1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency Response	Magnetic Intensity		
0014 01450 1/ :	GSM850	T4	Pass	Pass		
GSM CMRS Voice	GSM1900	T4	Pass	Pass		
	Band II	T4	Pass	Pass		
UMTS CMRS Voice	Band IV	T4	Pass	Pass		
	Band V	T4	Pass	Pass		
	Band 12	T4	Pass	Pass		
	Band 13	T4	Pass	Pass		
	Band 25/2	T4	Pass	Pass		
VoLTE	Band 26/5	T4	Pass	Pass		
	Band 66/4	T4	Pass	Pass		
	Band 71	T4	Pass	Pass		
	Band 41	T3	Pass	Pass		
	2450	T4	Pass	Pass		
	5200	T4	Pass	Pass		
VoWiFI	5300	T4	Pass	Pass		
	5500	T4	Pass	Pass		
	5800	T4	Pass	Pass		
Date Tested	2022/12/6 ~ 2022/12/11					

Report No.: HA2O1305B

Sporton International Inc. (Shenzhen) Page 4 of 23 Issued Date : Dec. 27, 2022 TEL: +86-755-86379589 / FAX: +86-755-86379595 Form version. : 210422

<sup>1.</sup> The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

<sup>2.</sup> This is partial report for CMRS voice T-Coil testing . VOIP test report will be separately submitted.

## 2. General Information

	Product Feature & Specification						
Applicant Name	TCL Communication Ltd.						
Equipment Name	GSM/UMTS/LTE Mobile phone						
Brand Name	TCL						
Model Name	T608DL						
IMEI Code	016329000012414						
FCC ID	2ACCJH170						
HW	03						
SW	4DS6						
EUT Stage	Identical Prototype						
Frequency Band	GSM850: 824 MHz ~ 849 MHz GSM1900: 1850 MHz ~ 1910 MHz WCDMA Band II: 1850 MHz ~ 1910 MHz WCDMA Band IV: 1710 MHz ~ 1755 MHz WCDMA Band V: 824 MHz ~ 849 MHz LTE Band 2: 1850 MHz ~ 1910 MHz LTE Band 4: 1710 MHz ~ 1755 MHz LTE Band 4: 1710 MHz ~ 1755 MHz LTE Band 5: 824 MHz ~ 849 MHz LTE Band 12: 699 MHz ~ 716 MHz LTE Band 13: 777 MHz ~ 787 MHz LTE Band 25: 1850 MHz ~ 1915 MHz LTE Band 26: 814 MHz ~ 849 MHz LTE Band 66: 1710 MHz ~ 1780 MHz LTE Band 71: 663 MHz ~ 698 MHz LTE Band 41: 2496 MHz ~ 2690 MHz WLAN 2.4GHz Band: 5180 MHz ~ 2462 MHz WLAN 5.3GHz Band: 5180 MHz ~ 5240 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.6GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz						
Mode	GSM/GPRS/EGPRS AMR / RMC 12.2Kbps HSDPA HSUPA DC-HSDPA HSPA+ (16QAM uplink is supported) LTE: QPSK, 16QAM, 64QAM WLAN 2.4GHz 802.11b/g/n HT20/HT40 WLAN 5GHz 802.11a/n HT20/HT40 WLAN 5GHz 802.11ac VHT20/VHT40/VHT80 Bluetooth BR/EDR/LE						

Report No.: HA2O1305B

 Sporton International Inc. (Shenzhen)
 Page 5 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

## 3. Testing Location

Sporton International Inc. (Shenzhen) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.01.

Report No.: HA2O1305B

Testing Laboratory						
Test Firm	Sporton International Inc. (Shenzhen)					
Test Site Location	People's Republic of Ch TEL: +86-755-86379589	1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China TEL: +86-755-86379589 FAX: +86-755-86379595				
Took Cita No	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.			
Test Site No.	SAR01-SZ	CN1256	421272			

## 4. Applied Standards

- FCC CFR47 Part 20.19
- · ANSI C63.19-2011
- FCC KDB 285076 D01 HAC Guidance v06r02
- FCC KDB 285076 D02 T-Coil testing v04
- FCC KDB 285076 D03 HAC FAQ v01r06

 Sporton International Inc. (Shenzhen)
 Page 6 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422



## 5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction
	GSM850	VO	Yes	WLAN, BT	CMRS Voice	No
0014	GSM1900	V	162	WLAN, BT	CIVING VOICE	No
GSM	EDGE850	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
	EDGE1900	۷D	162	WLAN, BT	Google Duo	INO
	Band II			WLAN, BT		No
UMTS	Band IV	VO	Yes	WLAN, BT	CMRS Voice	No
OWITS	Band V			WLAN, BT		No
	HSPA	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
	Band 2			WLAN, BT	VoLTE / Google Duo <sup>(1)</sup>	No
	Band 4			WLAN, BT		No
	Band 5			WLAN, BT		No
LTE	Band 12			WLAN, BT		No
(FDD)	Band 13	VD	Yes	WLAN, BT		No
(1.22)	Band 25			WLAN, BT		No
	Band 26			WLAN, BT		No
	Band 66			WLAN, BT		No
	Band 71			WLAN, BT		No
LTE (TDD)	Band 41	VD	Yes	WLAN, BT	VoLTE / Google Duo <sup>(1)</sup>	No
	2450	VD	Yes	GSM,WCDMA,LTE		No
	5200				VoWiFi <sup>(1)</sup>	No
Wi-Fi	5300	VD	Yes	GSM,WCDMA,LTE	/	No
	5500	VD	162	GGIVI,VV CDIVIA,L I L	Google Duo <sup>(1)</sup>	No
	5800					No
BT	2450	DT	No	GSM,WCDMA,LTE	NA	No

Report No.: HA2O1305B

#### Type Transport:

VO= Voice only DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

#### Remark:

- For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of -20 dBm0 should be used.
- The device have similar frequency in some LTE bands: LTE B2/B25, B4/B66, B5/B26, since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.
- This is partial report for CMRS voice T-Coil testing . VOIP test report will be separately submitted.


Sporton International Inc. (Shenzhen) Page 7 of 23 Issued Date : Dec. 27, 2022 Form version. TEL: +86-755-86379589 / FAX: +86-755-86379595 : 210422

## 6. Measurement standards for T-Coil

## 6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA2O1305B

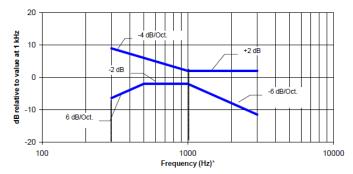

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

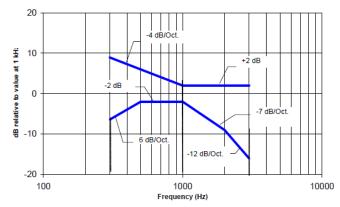

NOTE—The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

### 6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

**Table 1 T-Coil Signal Quality Categories** 

 Sporton International Inc. (Shenzhen)
 Page 8 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

## 6.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA2O1305B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

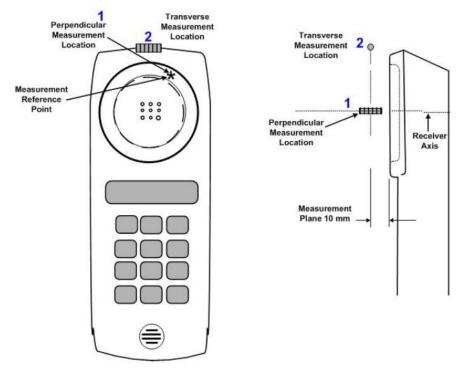


Fig.3 A typical EUT reference and plane for T-Coil measurements

 Sporton International Inc. (Shenzhen)
 Page 9 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

### SPORTON LAB. HAC T-COIL TEST REPORT

## 7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA2O1305B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

 Sporton International Inc. (Shenzhen)
 Page 10 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422


## 7.1 Test Flow Chart

# Test Instructions Confirm calibration of test eq uip ment Configure and validate the test setup Establish WD reference level Find measurement locations Per sub clause 7.3, 7.4.1 a)-b) & 7.4.4.4 Position and orient probe Measure desired aud io band signal strength Per sub clause 7.4.1 c)-e) Calculate signal strength Calculate signal quality Measure frequency resposne (perpendicular orientation only) Per sub clause 7.4.5 - 7.4.6 All locations measured? All locations measured? Determine and record signal quality category Done Per sub clause 8.2.4

Fig. 2 T-Coil Signal Test flowchart

Report No.: HA2O1305B

## 7.2 Test Setup Diagram for GSM/UMTS/VoLTE/VoWiFi

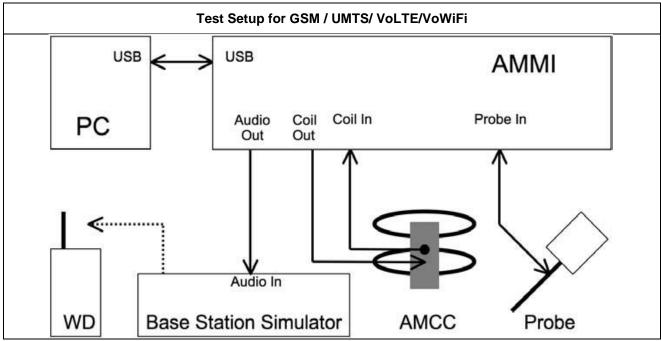

Report No.: HA2O1305B

#### **General Note:**

- Define the all applicable input audio level as below according to C63 and KDB 285076 D02v04:
  - GSM input level: -16dBm0
  - UMTS input level: -16dBm0
  - VoLTE input level: -16dBm0
  - VoWiFi input level: -20dBm0
- For GSM / UMTS test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- Voice over Long-Term Evolution (VoLTE) is a standard for high-speed wireless communication for mobile phones and data terminals — including IoT devices and wearables. It is based on the IP Multimedia Subsystem (IMS) network, with specific profiles for control and media planes of voice service on LTE defined by GSMA in PRD IR.92. This approach results in the voice service (control and media planes) being delivered as data flows within the LTE data bearer. This means that there is no dependency on the legacy circuit-switched voice network to be maintained
- The test setup used for VoLTE and VoWiFI over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- According to KDB 285076 D02, T-Coil testing for VoLTE and VoWiFi requires test instrumentation that can (1) for the system to be able to establish an IP call from/to the handset under test, (2) through an IMS (IP Multimedia Subsystem) and SIP/IP server, (3) to an analog audio adapter containing the permissible set of codecs used by the device under test, and (4) inject the necessary C63.19 test tones at the average speech level for the measurement The test setup is illustrated in Figure 3.9. The R&S CMW500 was used as system simulator for VoLTE and VoWiFi T-Coil testing. The DAU (Data Application Unit) in CMW500 integrates IMS and SIP/IP server that can establish VoLTE and Wi-Fi calling, and transport the test tones from AMMI (Audio Magnetic Measuring Instrument) to EUT.
- T-coil performance assessment for 5G FR1 was performed according to KDB 285076 D03 v01r06, Q&A 9, details are illustrated in section 7.4.

: Dec. 27, 2022 Page 12 of 23 Issued Date Form version. TEL: +86-755-86379589 / FAX: +86-755-86379595 : 210422

## SPORTON LAB. HAC T-COIL TEST REPORT

### <Define the input level for GSM/UMTS>

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA2O1305B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(\*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

#### <Example define the input level for GSM/UMTS >

Gain Value	20* log(gain)	AMCC Coil In	Level					
(linear)	dB (dBv RMS)		dBm0					
		-2.47	3.14					
10	20	-19.85	-14.24					
8.17	18.24	-21.61	-16					

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

<Example define the input level for VoLTE>

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)
	3.14	1.5		0.51	
100	5.43		40	2.8	2.95
8.48	-16		18.57		-18.48
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting
1kHz sine	-	3	0	1	8.48
48k_voice_1kHz	1	16.2	-12.7	4.33	36.73

#### <Example define the input level for VoWiFi>

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)
	3.14	1.5		0.51	
100	5.46		40	2.83	2.98
5.33	-20		14.54		-22.48
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting
1kHz sine	-	3	0	1	5.33
48k_voice_1kHz	1	16.2	-12.7	4.33	23.10
48k_voice_300-3000	2	21.6	-18.6	8.48	45.23

 Sporton International Inc. (Shenzhen)
 Page 13 of 23
 Issued Date
 Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

## 8. Test Equipment List

Manufacturer	Name of Equipment	Type/Medal	Type/Model Serial Number Calibration		ration
Manufacturer	Name of Equipment	i ype/iviodei	Serial Nulliber	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3128	2022/7/19	2023/7/18
SPEAG	Data Acquisition Electronics	DAE4	1664	2022/5/30	2023/5/29
SPEAG	Audio Magnetic Calibration Coil	AMCC	1128	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1137	NCR	NCR
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR
R&S	Base Station(Measure)	CMU200	108440	2021/12/28	2022/12/27
R&S	Base Station(Measure)	CMW500	157651	2021/12/29	2022/12/28
Anymetre	Thermo-Hygrometer	JR593	2015030904	2022/7/12	2023/7/11

#### Note:

1. NCR: "No-Calibration Required"

Sporton International Inc. (Shenzhen) Page 14 of 23 Issued Date TEL: +86-755-86379589 / FAX: +86-755-86379595 Form version. : 210422

Report No.: HA2O1305B

## 9. T-Coil testing for CMRS Voice

#### **General Note:**

- 1. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.
- 2. Air Interface Investigation:
  - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.

Report No.: HA2O1305B

b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

## 9.1 GSM Tests Results

### <Codec Investigation>

	GSM Codec										
Codec AMR NB FR AMR WB FR GSM EFR (FR V2) Orientation											
ABM 1 (dBA/m)	-1.69	-3.01	-6.23								
ABM 2 (dBA/m)	-38.04	-37.5	-49.68	Axial	0014050 / 400						
Signal Quality (dB)	36.35	34.49	43.45	Axiai	GSM850 / 189						
Freq. Response	PASS	PASS	PASS								

Remark: According to codec investigation, the worst codec is AMR WB FR.

### <Air Interface Investigation>

P	lot lo.	Air Interface	Mode	Channel		ABM1 dB (A/m)	dB	Signal Quality dB		Ambient Noise dB (A/m)	Response	Frequency Response
	1 GSM850 Voice	Voice	189	Axial (Z)	-3.01	-37.50	34.49	T4	-50.31	1.62	PASS	
	1	GSIVIOSO	Voice	103	Transversal (Y)	-6.85	-48.92	42.07	T4	-50.29	1.02	FASS
	2	0001M20	M1000 Vaine	661	Axial (Z)	4.88	-35.43	40.31	T4	-50.44	1.6	PASS
	2 GSM1900	Voice	661	Transversal (Y)	-6.47	-47.31	40.84	T4	-50.56		PASS	

 Sporton International Inc. (Shenzhen)
 Page 15 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

## 9.2 UMTS Tests Results

## <Codec Investigation>

	UMTS AMR Codec											
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel							
ABM 1 (dBA/m)	4.88	3.79	6.06	4.37								
ABM 2 (dBA/m)	-44.74	-43.62	-45.14	-44.82		B5 / 4182						
Signal Quality (dB)	49.62	47.41	51.2	49.19	Axial	D3 / 4102						
Freq. Response	PASS	PASS	PASS	PASS								

Report No.: HA2O1305B

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

## <Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	dB	ABM2 dB (A/m)	Signal Quality dB	_	Ambient Noise dB (A/m)	Response	Frequency Response
3	WCDMA V	Voice	4182	Axial (Z)	3.79	-43.62	47.41	T4	-50.78	1.9	PASS
3	WCDIVIA V	voice	4102	Transversal (Y)	-3.22	2 -53.32 50.10	T4	-50.43	1.9	FASS	
4	WCDMA IV	Voice	1413	Axial (Z)	3.53	-44.92	48.45	T4	-50.71	1.65	PASS
4	WCDIVIA IV	voice	1413	Transversal (Y)	-3.26	-53.38	50.12	T4	-50.64	1.00	PASS
_	5 WCDMA II V	Voice	0.400	Axial (Z)	2.94	-44.83	47.77	T4	-50.88	4.50	PASS
5		Voice	9400	Transversal (Y)	-3.59	-48.77	45.18	T4	-50.62	1.58	PASS

 Sporton International Inc. (Shenzhen)
 Page 16 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

## 10. T-Coil testing for CMRS IP Voice

### 10.1 VoLTE Tests Results

#### **General Note:**

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

Report No.: HA2O1305B

#### Air Interface Investigation:

- Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
- Select LTE FDD/TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration , the observed variation is very little to be within 1.5 dB which is much less than the margin from the rating threshold.
- The TDD LTE power class 3 supports uplink-downlink configuration 0 and 6 and power class 2 supports uplink-downlink configuration1 to 5 for this device, an investigation was performed to determine the worst-case uplink-downlink configuration to be used for the testing for the handset.
- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

#### <Codec Investigation>

### LTE FDD

VoLTE AMR Codec											
Codec	NB AMR 4.75Kbps	Orientation	Band / BW / Channel								
ABM 1 (dBA/m)	4.71	2.82	-2.5	-4.75							
ABM 2 (dBA/m)	-43.03	-42.72	-44.83	-45.72		B25 / 20M /					
Signal Quality (dB)	47.74	45.54	42.33	40.97	Axial	26340					
Freq. Response	PASS	PASS	PASS	PASS							

	VoLTE EVS Codec											
Codec	EVS WB 5.9Kbps	EVS WB 128Kbps	Orientation	Band / BW / Channel								
ABM 1 (dBA/m)	1.01	3.14	1.66	3.95								
ABM 2 (dBA/m)	-43.76	-45.52	-45.16	-44.67	Axial	B25 / 20M /						
Signal Quality (dB)	44.77	48.66	46.82	48.62	Axiai	26340						
Freq. Response	PASS	PASS	PASS	PASS								

Remark: According to codec investigation, the worst codec is WB AMR 23.85Kbps

: Dec. 27, 2022 Page 17 of 23 Issued Date Form version. TEL: +86-755-86379589 / FAX: +86-755-86379595 : 210422

## LTE TDD

	VoLTE AMR Codec											
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel						
ABM 1 (dBA/m)	5.79	-4.25	-0.86	-3.6								
ABM 2 (dBA/m)	-31.55	-31.64	-31.4	-31.38		B41 / 20M /						
Signal Quality (dB)	37.34	27.39	30.54	27.78	Axial	40620						
Freq. Response	PASS	PASS	PASS	PASS								

Report No.: HA2O1305B

			VoLTE EVS Codec					
Codec	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel		
ABM 1 (dBA/m)	-4.12	-2.72	-5.63	-2.83				
ABM 2 (dBA/m)	-34.27	-31.33	-34.46	-31.2		B41 / 20M /		
Signal Quality (dB)	30.15	28.61	28.83	28.37	Axial	40620		
Freq. Response	PASS	PASS	PASS	PASS				

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

## <Air Interface Investigation>

Air	· Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B25	20	QPSK	1	0	26340		-4.75	-45.72	40.97
	LTE B25	20	QPSK	50	0	26340		0.73	-43.42	44.15
	LTE B25	20	QPSK	100	0	26340		3.52	-43.68	47.20
	LTE B25	20	16QAM	1	0	26340		1.49	-40.57	42.06
FDD	LTE B25	20	64QAM	1	0	26340		4.65	-42.06	46.71
FDD	LTE B25	15	QPSK	1	0	26340		4.22	-43.48	47.70
	LTE B25	10	QPSK	1	0	26340		4.52	-43.14	47.66
	LTE B25	5	QPSK	1	0	26340		5.53	-39.79	45.32
	LTE B25	3	QPSK	1	0	26340		5.24	-39.96	45.20
	LTE B25	1.4	QPSK	1	0	26340		4.49	-42.92	47.41
	LTE B41_PC3	20	QPSK	1	0	40620	0	-4.25	-31.64	27.39
	LTE B41_PC2	20	QPSK	1	0	40620	1	0.62	-29.21	29.83
	LTE B41_PC2	20	QPSK	1	0	40620	2	1.13	-31.68	32.81
TDD	LTE B41_PC2	20	QPSK	1	0	40620	3	1.67	-28.88	30.55
	LTE B41_PC2	20	QPSK	1	0	40620	4	0.52	-29.08	29.60
	LTE B41_PC2	20	QPSK	1	0	40620	5	-0.23	-31.23	31.00
	LTE B41_PC3	20	QPSK	1	0	40620	6	0.53	-29.32	29.85

 Sporton International Inc. (Shenzhen)
 Page 18 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422



## SPORTON LAB. HAC T-COIL TEST REPORT

Plot No.	Air Interface	BW (MHz)	Modulation / Mode		RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response
6	LTE Band 12	10	QPSK	1RB	0	23095	Axial (Z)	3.67	-45.44	49.11	T4	-50.46	1.57	PASS
O	LTE Ballu 12	10	QFSK	IND	0	23093	Transversal (Y)	-3.58	-52.61	49.03	T4	-50.39	1.57	FAGG
7	LTE Band 13	10	OPSK	1RB	0	23230	Axial (Z)	3.63	-44.82	48.45	T4	-50.82	0.99	PASS
/	LIE Band 13	10	QPSK	IKB	U	23230	Transversal (Y)	-3.64	-51.97	48.33	T4	-50.37	0.99	PASS
8	LTE Band 25	20	OPSK	1RB	0	26340	Axial (Z)	-4.75	-45.72	40.97	T4	-50.68	0.25	DACC
ŏ	LTE Band 25	20	QPSK	IKB	U	26340	Transversal (Y)	-5.17	-52.09	46.92	T4	-50.32	0.25	PASS
9	LTE Dand OC	15	QPSK	4 D D	0	26865	Axial (Z)	3.09	-46.36	49.45	T4	-50.77	0.00	D4.00
9	LTE Band 26	15	QPSK	1RB	U	20000	Transversal (Y)	-3.98	-52.38	48.40	T4	-50.41	0.98	PASS
10	LTE Band 66	20	QPSK	1RB	0	132322	Axial (Z)	3.25	-45.83	49.08	T4	-50.60	1.14	PASS
10	LIE Dallu 00	20	QPSK	IKD	U	132322	Transversal (Y)	-3.80	-52.85	49.05	T4	-50.43	1.14	PASS
11	LTE Band 71	20	OPSK	1RB	0	133297	Axial (Z)	4.94	-44.41	49.35	T4	-50.69	0	DACC
11	LIE Band / I	20	QPSK	IKB	0	133297	Transversal (Y)	-5.89	-53.94	48.05	T4	-50.35	5 2	PASS
12	LTE Band 41	20	QPSK	1RB	0	40620	Axial (Z)	-4.25	-31.64	27.39	T3	-50.29	1.52	DACC
12	LIE Dano 41	20	QPSK	IKB	0	40620	Transversal (Y)	-5.01	-46.94	41.93	T4	-50.48		PASS

Report No.: HA2O1305B

 Sporton International Inc. (Shenzhen)
 Page 19 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

### 10.2 VoWiFi Tests Results

#### **General Note:**

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.

Report No.: HA2O1305B

- Air Interface Investigation:
  - Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
  - Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
  - According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

#### <Codec Investigation>

	VoWIFI AMR Codec											
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / Channel						
ABM 1 (dBA/m)	2.62	3.84	1.52	3.58	-							
ABM 2 (dBA/m)	-45.88	-46.03	-48.39	-47.09		2.4GHz WLAN /						
Signal Quality (dB)	48.5	49.87	49.91	50.67	Axial	6						
Freq. Response	PASS	PASS	PASS	PASS								

VoWIFI EVS Codec									
Codec	EVS WB 5.9Kbps	EVS WB EVS NB EVS NB 128Kbps 5.9Kbps 24.4Kbps		Orientation	Band / BW / Channel				
ABM 1 (dBA/m)	1.23	5.14	2.89	3.92					
ABM 2 (dBA/m)	-48.04	-46.35	-48.05	-47.32	Axial	2.4GHz WLAN /			
Signal Quality (dB)	49.27	51.49	50.94	51.24	Axiai	6			
Freq. Response	PASS	PASS	PASS	PASS					

Remark: According to codec investigation, the worst codec is NB AMR 4.75Kbps

Sporton International Inc. (Shenzhen) Page 20 of 23 Issued Date : Dec. 27, 2022 Form version. TEL: +86-755-86379589 / FAX: +86-755-86379595 : 210422



## <Air Interface Investigation>

Frequency Bands	Modulation	Bandwidth	Data Rate	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	802.11b	20	1M	6	2.62	-45.88	48.50
	802.11b	20	11M	6	5.05	-47.98	53.03
	802.11g	20	6M	6	5.23	-44.68	49.91
WLAN 2.4GHz	802.11g	20	54M	6	5.29	-45.39	50.68
WLAN 2.4GHZ	802.11n-HT20	20	MCS0	6	2.45	-46.47	48.92
	802.11n-HT20	20	MCS7	6	1.83	-47.24	49.07
	802.11n-HT40	40	MCS0	6	2.35	-47.18	49.53
	802.11n-HT40	40	MCS7	6	2.15	-46.70	48.85
	802.11a	20	6M	40	3.45	-47.77	51.22
	802.11a	20	54M	40	4.12	-47.20	51.32
	802.11an-HT20	20	MCS0	40	5.12	-47.60	52.72
	802.11an-HT20	20	MCS7	40	4.70	-47.95	52.65
	802.11an-HT40	40	MCS0	38	4.79	-48.37	53.16
WLAN 5GHz	802.11an-HT40	40	MCS7	38	4.80	-47.89	52.69
WLAN 5GHZ	802.11ac-VHT20	20	MCS0	40	5.08	-45.64	50.72
	802.11ac-VHT20	20	MCS8	40	4.59	-47.94	52.53
	802.11ac-VHT40	40	MCS0	38	4.85	-47.88	52.73
	802.11ac-VHT40	40	MCS8	38	4.86	-48.19	53.05
	802.11ac-VHT80	80	MCS0	42	4.74	-47.56	52.30
	802.11ac-VHT80	80	MCS8	42	5.07	-47.32	52.39

Report No.: HA2O1305B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Ougliste	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response
13	13 WLAN2.4GHz 20	20	802.11b 1Mbps	6	Axial (Z)	2.62	-45.88	48.50	T4	-50.57	0.96	Pass
13		20			Transversal (Y)	1.71	-46.62	48.33	T4	-50.43		
1.4	14 WLAN5.2GHz 20	802.11ac-VHT20	40	Axial (Z)	5.08	-45.64	50.72	T4	-50.72	1.03	Pass	
14		20	MCS 0	40	Transversal (Y)	-1.98	-49.52	47.54	T4	-50.36	1.03	F 455
45	15 WLAN5.3GHz 20	802.11ac-VHT20 MCS 0	56	Axial (Z)	5.11	-44.86	49.97	T4	-50.47	0.61	Pass	
15				Transversal (Y)	-1.55	-49.08	47.53	T4	-50.69			
40	16 WLAN5.5GHz 20	802.11ac-VHT20	440	Axial (Z)	4.15	-45.83	49.98	T4	-50.66	4.44	Dana	
16		20	MCS 0	116	Transversal (Y)	1.31	-46.71	48.02	T4	-50.32	1.14	Pass
47	47 14/1 41/5 0011	00	802.11ac-VHT20	457	Axial (Z)	5.53	-44.79	50.32	T4	-50.48	4.04	
17   WLAN5.8GHz	20	MCS 0	157	Transversal (Y)	1.66	-47.14	48.80	T4	-50.62	1.21	Pass	

#### Remark:

1. Phone Condition: Mute on; Backlight off; Max Volume

2. The detail frequency response results please refer to appendix A.

Test Engineer: Hank Huang, Kevin Xu, David Dai, Bin He

 Sporton International Inc. (Shenzhen)
 Page 21 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

## 11. Uncertainty Assessment

The evaluation of uncertainly by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2. The judgment of conformity in the report is based on the measurement results excluding the measurement uncertainty.

Report No.: HA2O1305B

Error Description	Uncertainty Value (±%)	Probability	Divisor	(Ci) ABM1	(Ci) ABM2	Standard Uncertainty (ABM1) (±%)	Standard Uncertainty (ABM2) (±%)
Probe Sensitivity							
Reference Level	3.0	N	1	1	1	3.0	3.0
AMCC Geometry	0.4	R	1.732	1	1	0.2	0.2
AMCC Current	1.0	R	1.732	1	1	0.6	0.6
Probe Positioning during Calibr.	0.1	R	1.732	1	1	0.1	0.1
Noise Contribution	0.7	R	1.732	0.014	1	0.0	0.4
Frequency Slope	5.9	R	1.732	0.1	1	0.3	3.4
Probe System							
Repeatability / Drift	1.0	R	1.732	1	1	0.6	0.6
Linearity / Dynamic Range	0.6	R	1.732	1	1	0.3	0.3
Acoustic Noise	1.0	R	1.732	0.1	1	0.1	0.6
Probe Angle	2.3	R	1.732	1	1	1.3	1.3
Spectral Processing	0.9	R	1.732	1	1	0.5	0.5
Integration Time	0.6	N	1	1	5	0.6	3.0
Field Distribution	0.2	R	1.732	1	1	0.1	0.1
Test Signal							
Ref. Signal Spectral Response	0.6	R	1.732	0	1	0.0	0.3
Positioning							
Probe Positioning	1.9	R	1.732	1	1	1.1	1.1
Phantom Thickness	0.9	R	1.732	1	1	0.5	0.5
DUT Positioning	1.9	R	1.732	1	1	1.1	1.1
External Contributions							
RF Interference	0.0	R	1.732	1	0.3	0.0	0.0
Test Signal Variation	2.0	R	1.732	1	1	1.2	1.2
Com	4.0%	6.1%					
	Coverage Factor for 95 %						
Expanded STD Uncertainty						8.1%	12.2%

Table 8.2 Uncertainty Budget of audio band magnetic measurement

: Dec. 27, 2022 Sporton International Inc. (Shenzhen) Page 22 of 23 Issued Date Form version. TEL: +86-755-86379589 / FAX: +86-755-86379595 : 210422



## 12. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA2O1305B

- [2] FCC KDB 285076 D01v06r01, "Equipment Authorization Guidance for Hearing Aid Compatibility", September 19, 2022
- [3] FCC KDB 285076 D02 v04, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Feb. 23, 2022
- [4] FCC KDB 285076 D03v01r06, "Hearing aid compatibility frequently asked questions", July 20, 2022
- [5] SPEAG DASY System Handbook

----THE END-----

 Sporton International Inc. (Shenzhen)
 Page 23 of 23
 Issued Date
 : Dec. 27, 2022

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422