



10MHz_30kHz_3545MHz_DFT-s-OFDM QPSK_RB1@0 -37.51 dBm

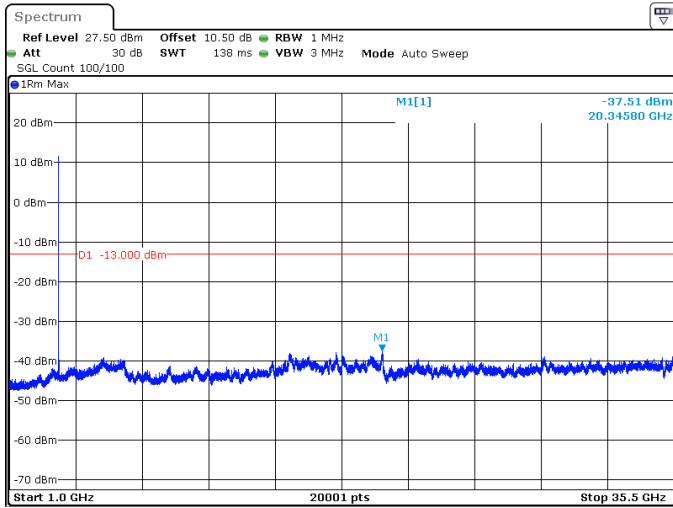


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:12:43

10MHz_30kHz_3545MHz_DFT-s-OFDM QPSK_RB1@0 -46.35 dBm

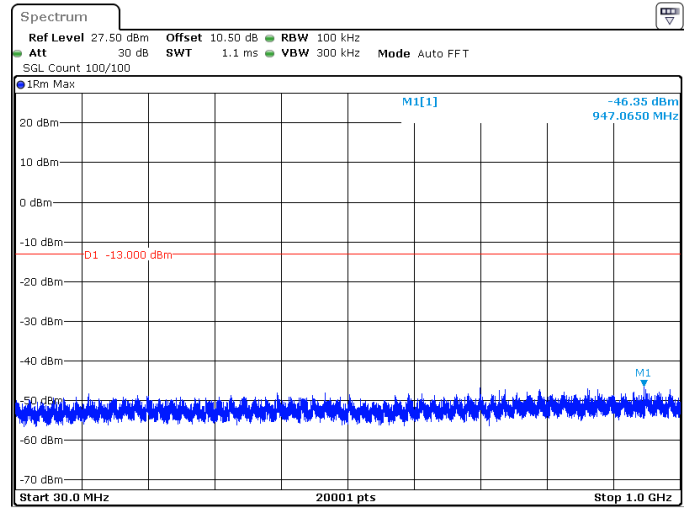


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:11:45

10MHz_30kHz_3545MHz_DFT-s-OFDM QPSK_RB1@23 -46.70 dBm

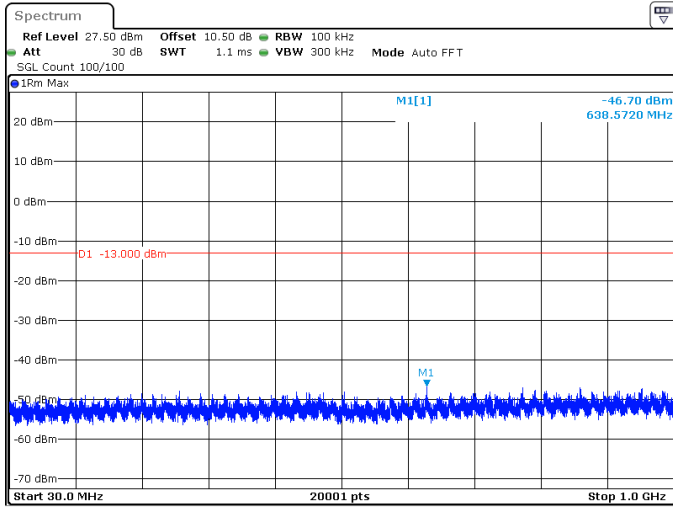


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:13:15

10MHz_30kHz_3545MHz_DFT-s-OFDM QPSK_RB1@23 -37.52 dBm

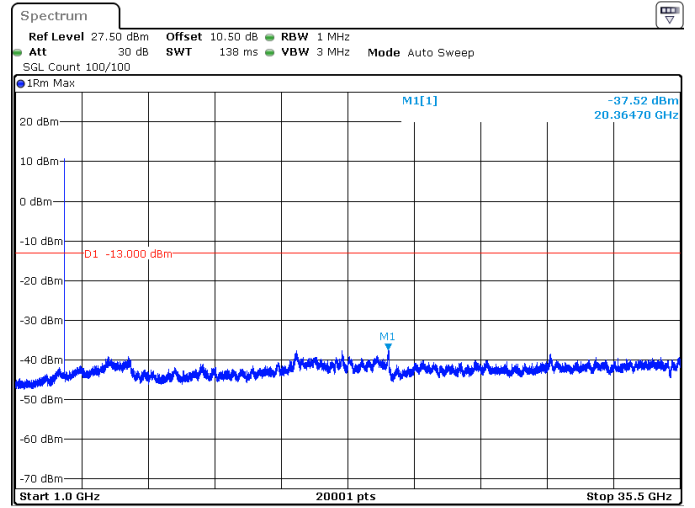


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:14:12

10MHz_30kHz_3545MHz_DFT-s-OFDM QPSK_RB24@0 -46.70 dBm

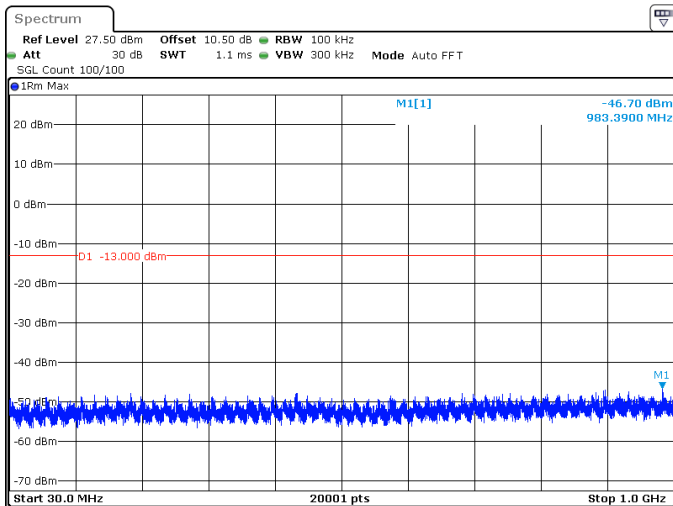


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:14:44

10MHz_30kHz_3545MHz_DFT-s-OFDM QPSK_RB24@0 -37.73 dBm

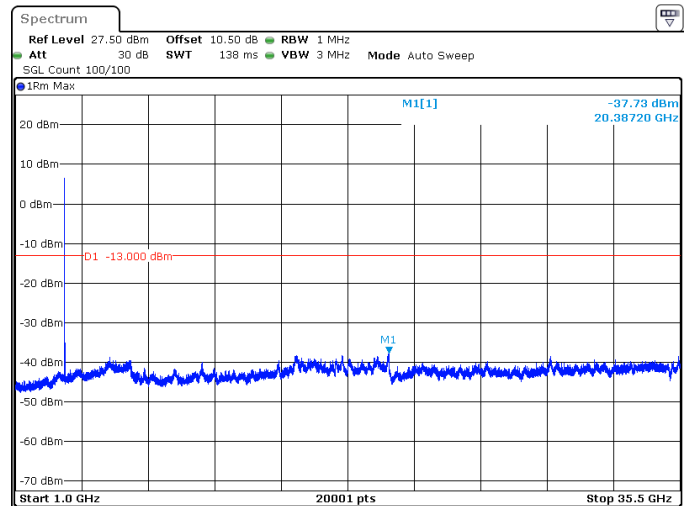


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:15:41

15MHz_30kHz_3457.5MHz_DFT-s-OFDM QPSK_RB1@0 -47.04 dBm

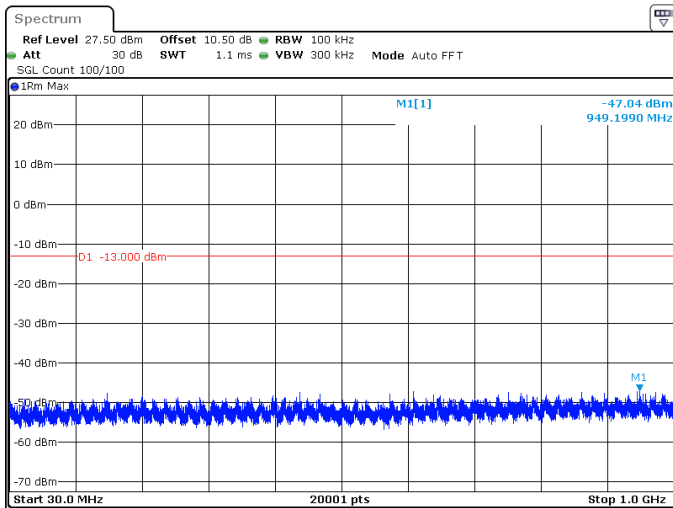


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:16:19

15MHz_30kHz_3457.5MHz_DFT-s-OFDM QPSK_RB1@0 -36.83 dBm

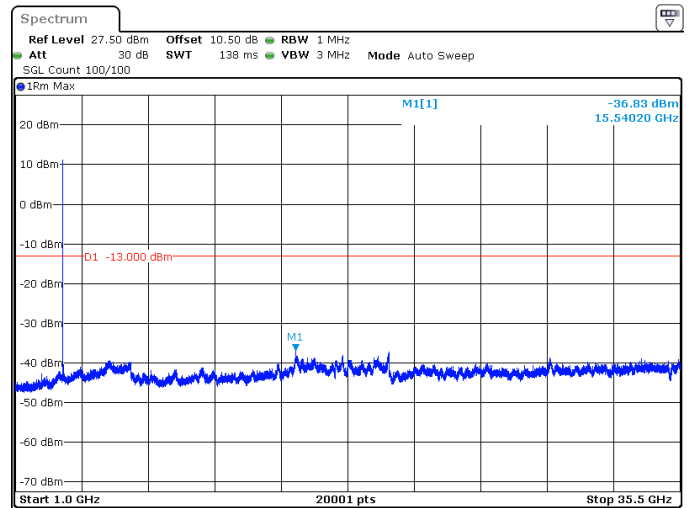


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:17:16

15MHz_30kHz_3457.5MHz_DFT-s-OFDM QPSK_RB1@37 -45.94 dBm

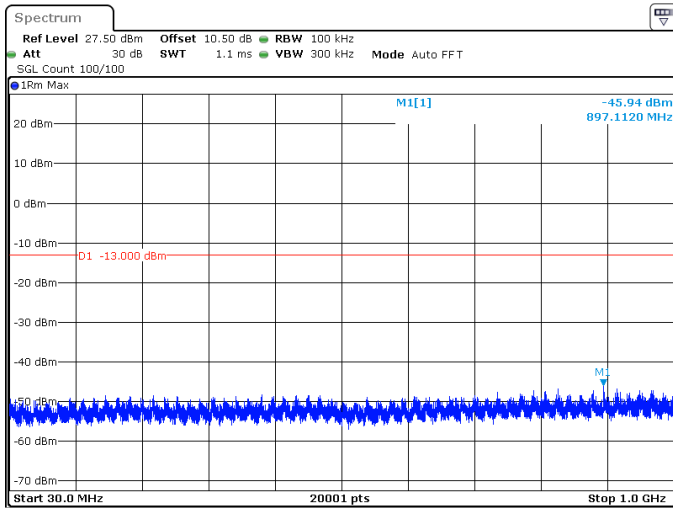


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:17:48

15MHz_30kHz_3457.5MHz_DFT-s-OFDM QPSK_RB1@37 -37.07 dBm

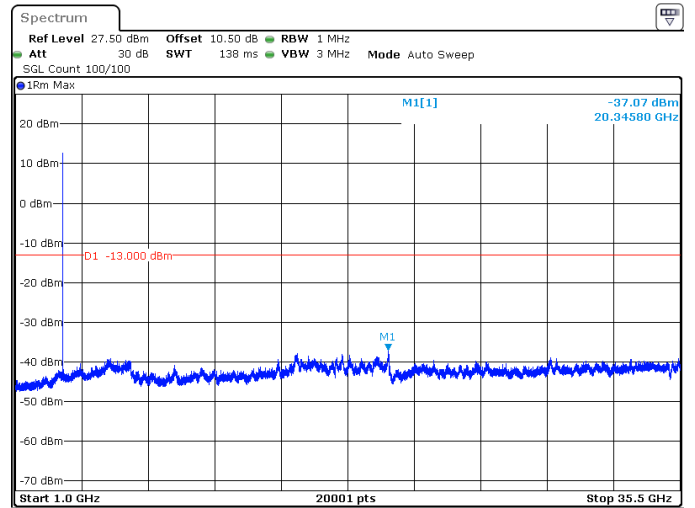


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:18:45

15MHz_30kHz_3457.5MHz_DFT-s-OFDM QPSK_RB36@0 -37.62 dBm

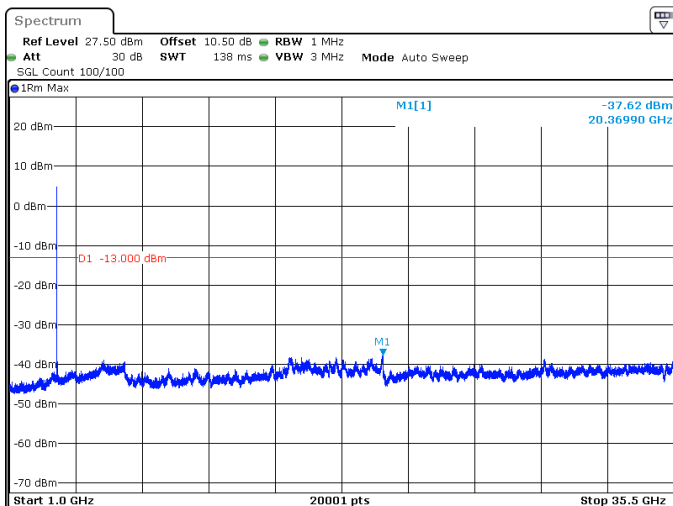


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:20:15

15MHz_30kHz_3457.5MHz_DFT-s-OFDM QPSK_RB36@0 -46.89 dBm

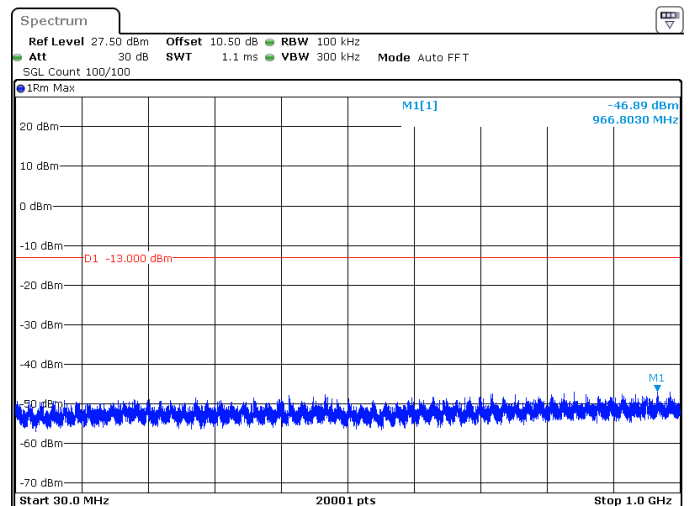


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:19:18

15MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.92 dBm

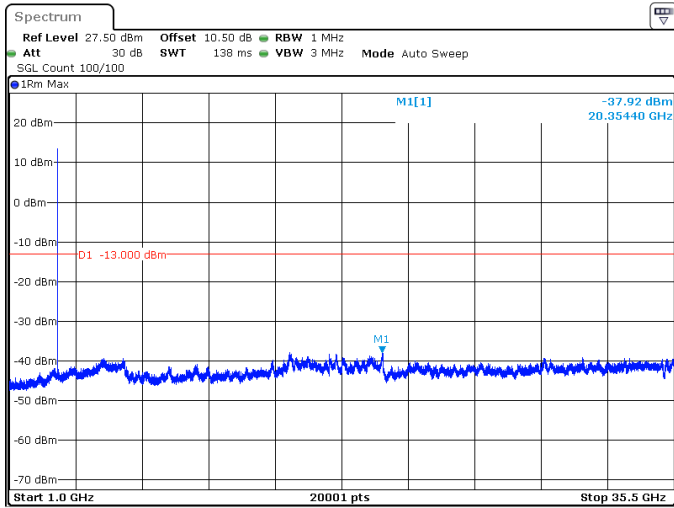


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:21:50

15MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -47.58 dBm

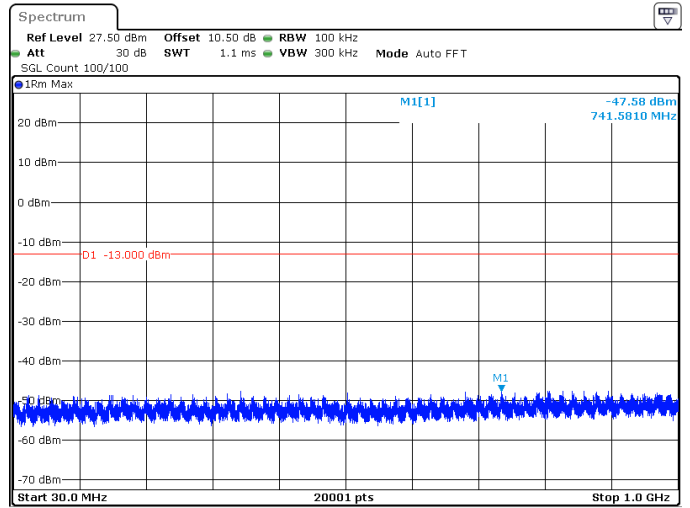


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:20:53

15MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@37 -47.10 dBm

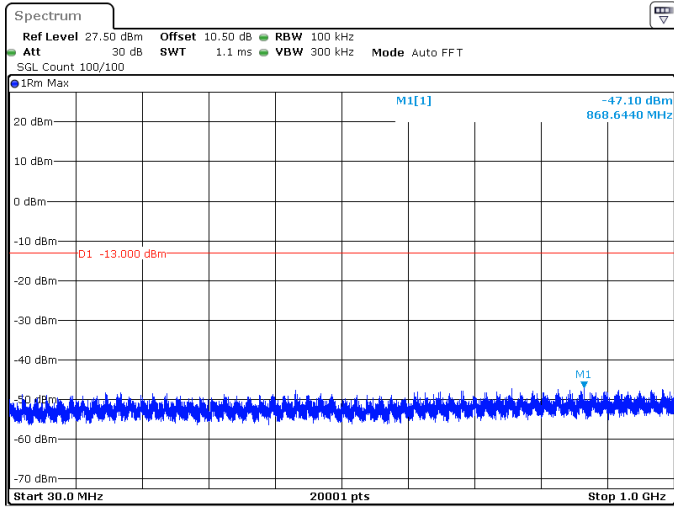


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:22:23

15MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@37 -38.03 dBm

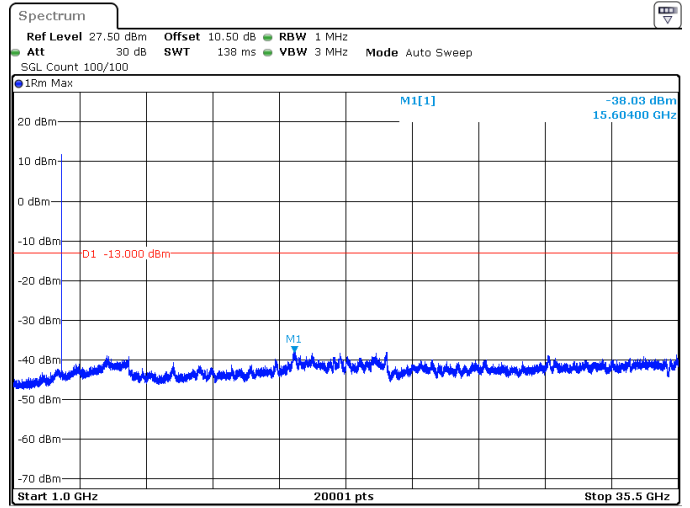


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:23:21

15MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB36@0 -37.29 dBm

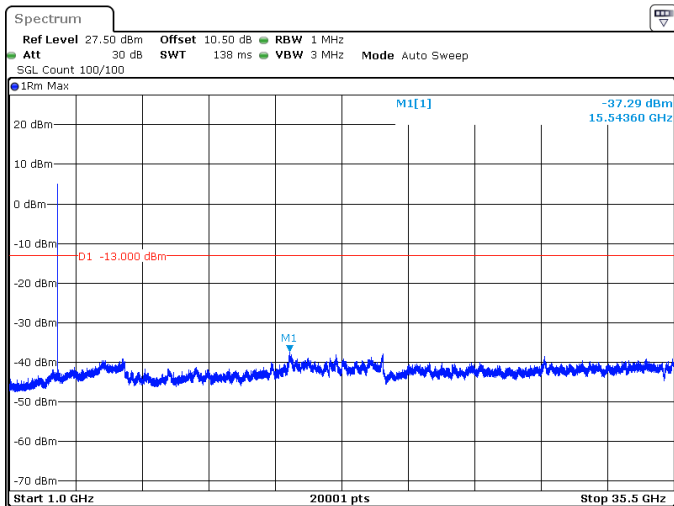


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:24:51

15MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB36@0 -47.06 dBm

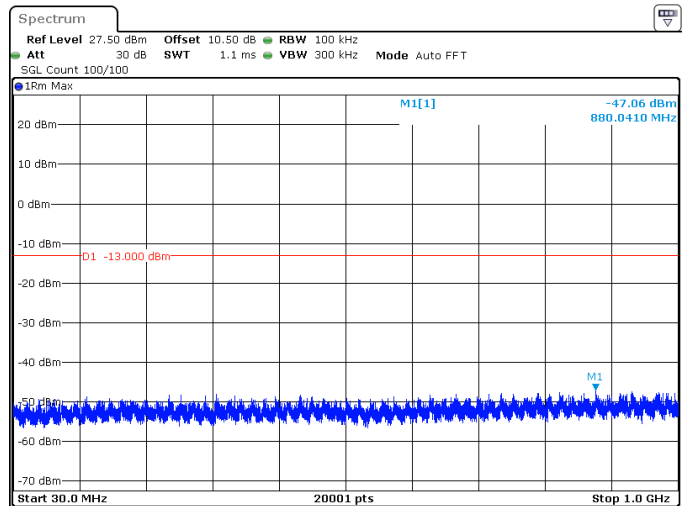


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:23:53

15MHz_30kHz_3542.5MHz_DFT-s-OFDM QPSK_RB1@0 -37.28 dBm

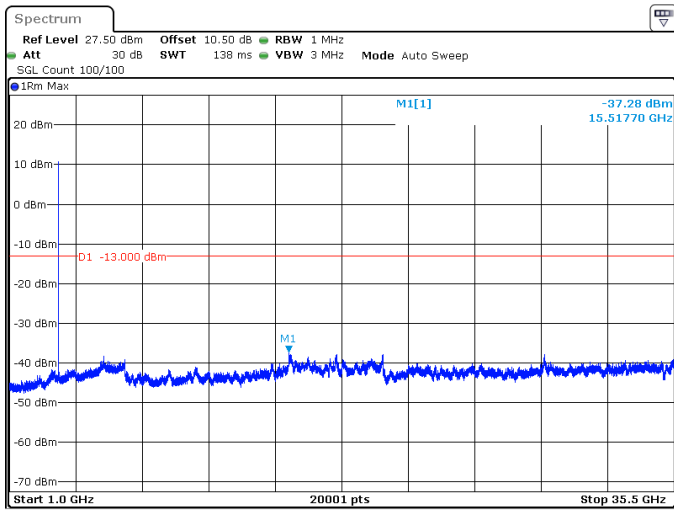


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:26:25

15MHz_30kHz_3542.5MHz_DFT-s-OFDM QPSK_RB1@0 -45.86 dBm

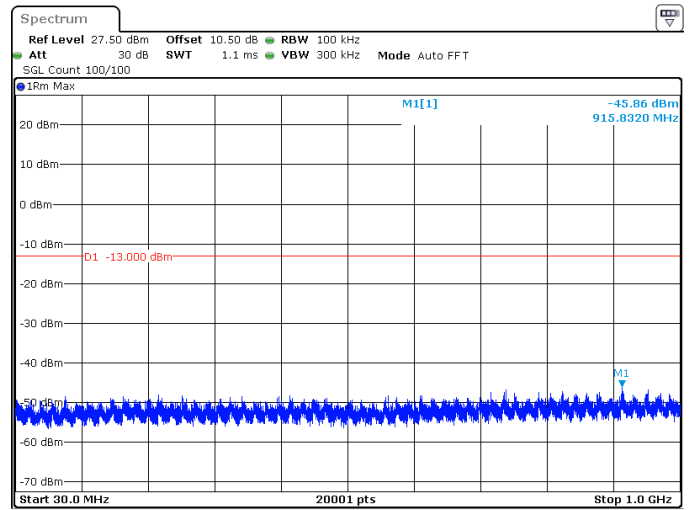


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:25:27

15MHz_30kHz_3542.5MHz_DFT-s-OFDM QPSK_RB1@37 -37.35 dBm

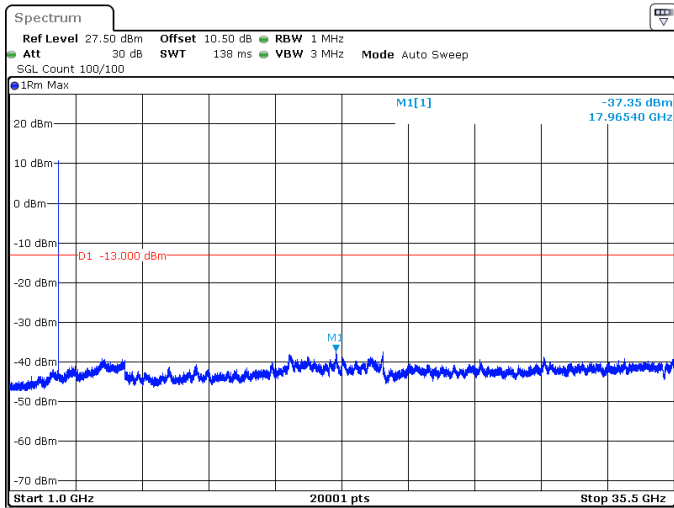


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:27:58

15MHz_30kHz_3542.5MHz_DFT-s-OFDM QPSK_RB1@37 -46.64 dBm

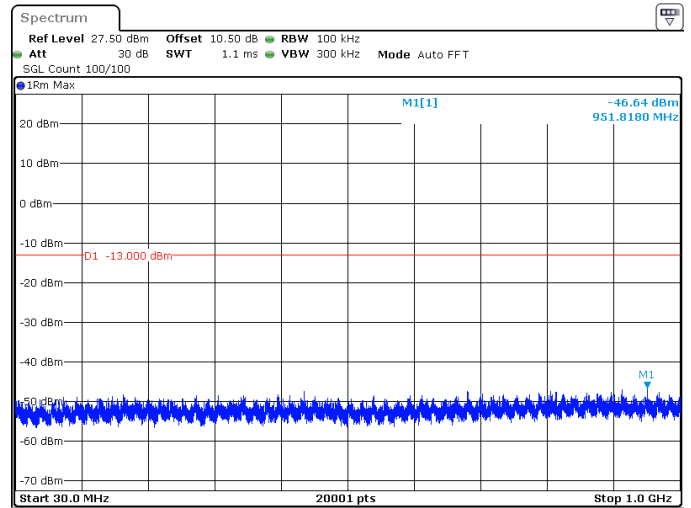


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:27:00

15MHz_30kHz_3542.5MHz_DFT-s-OFDM QPSK_RB36@0 -37.78 dBm

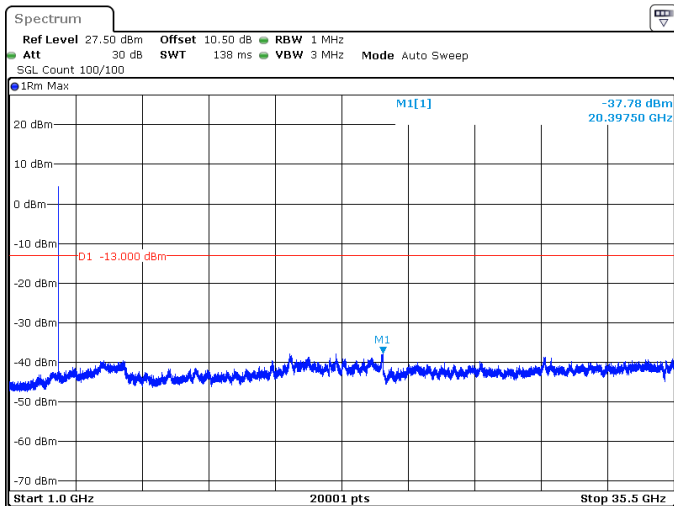


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:29:29

15MHz_30kHz_3542.5MHz_DFT-s-OFDM QPSK_RB36@0 -46.80 dBm

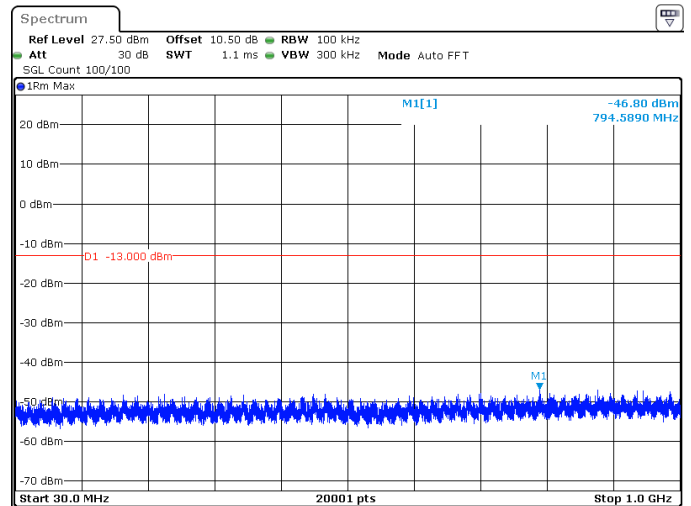


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:28:31

25MHz_30kHz_3462.5MHz_DFT-s-OFDM QPSK_RB1@0 -37.83 dBm

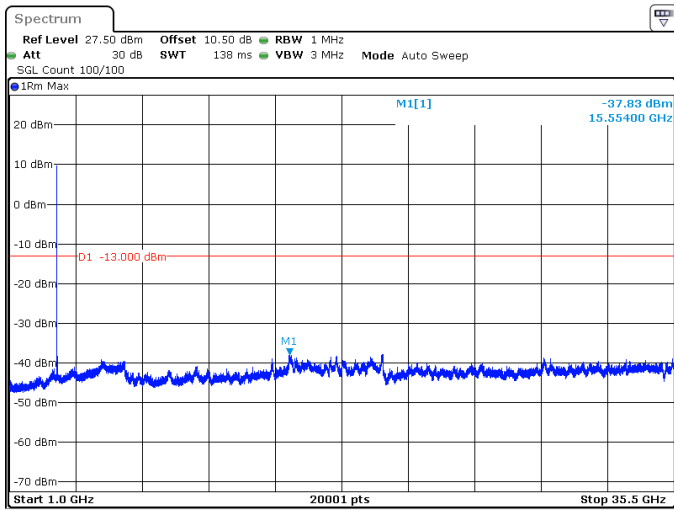


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:31:06

25MHz_30kHz_3462.5MHz_DFT-s-OFDM QPSK_RB1@0 -46.70 dBm

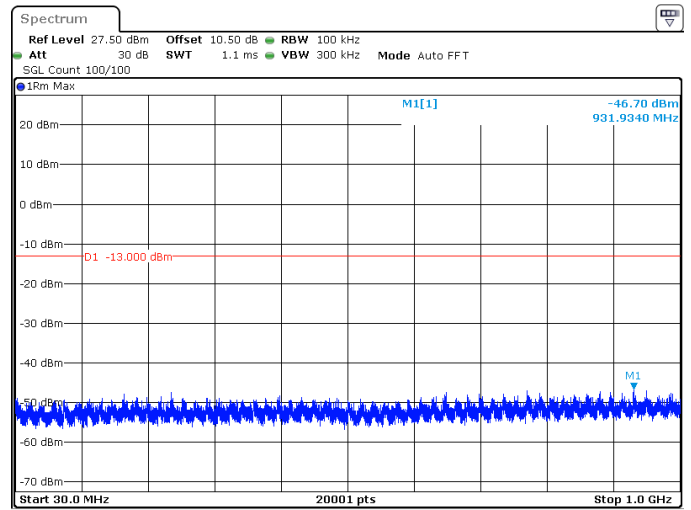


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:30:09

25MHz_30kHz_3462.5MHz_DFT-s-OFDM QPSK_RB1@64 -46.84 dBm

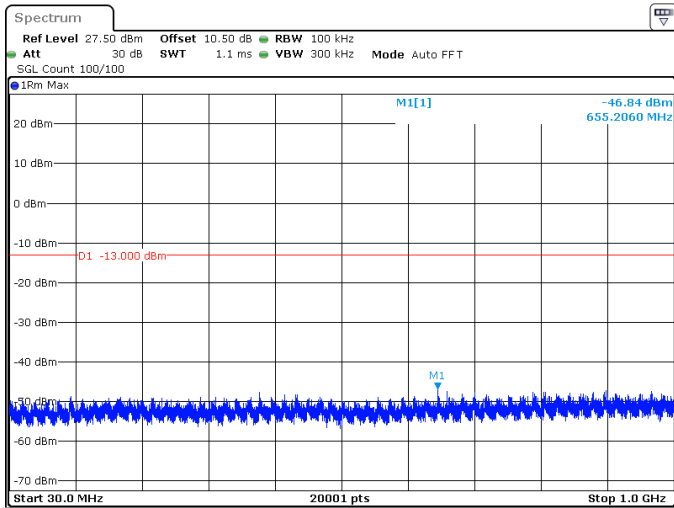


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:31:40

25MHz_30kHz_3462.5MHz_DFT-s-OFDM QPSK_RB1@64 -37.68 dBm

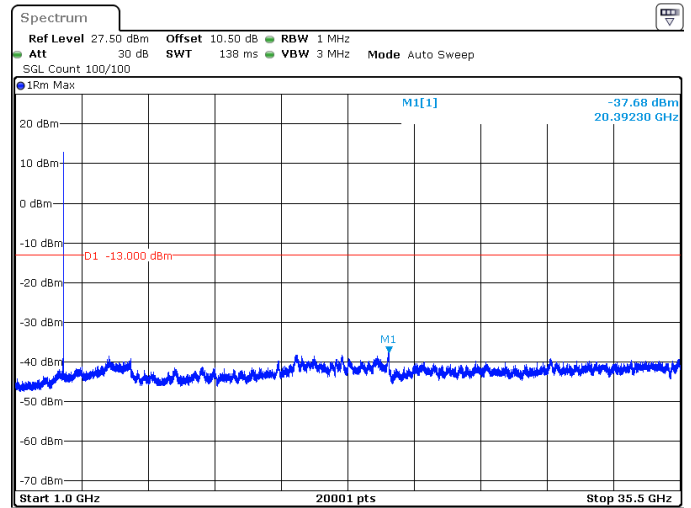


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:32:38

25MHz_30kHz_3462.5MHz_DFT-s-OFDM QPSK_RB64@0 -46.56 dBm

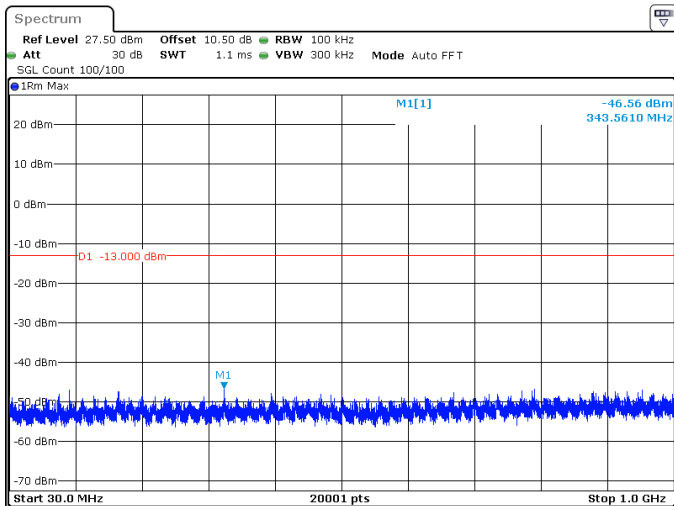


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:33:12

25MHz_30kHz_3462.5MHz_DFT-s-OFDM QPSK_RB64@0 -37.35 dBm

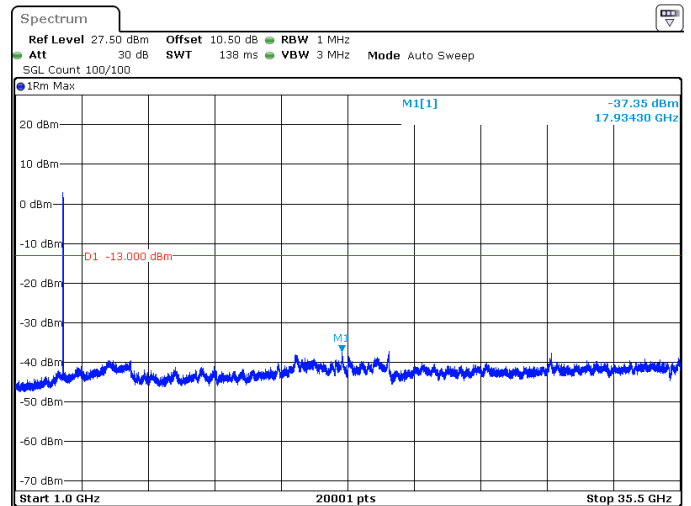


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:34:09

25MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.17 dBm

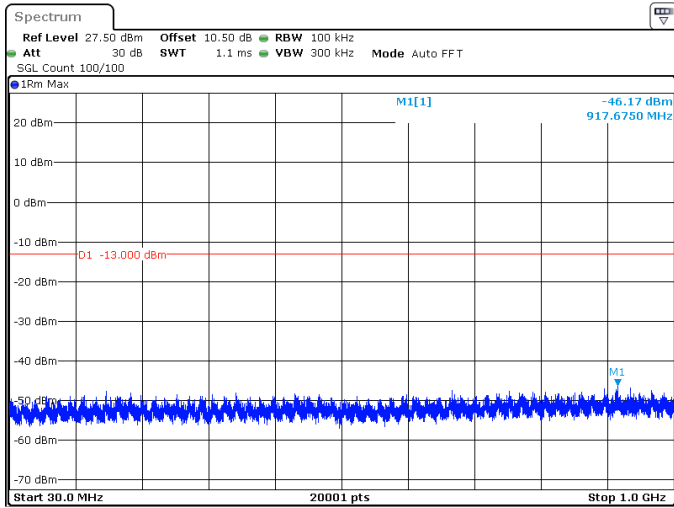


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:34:46

25MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.48 dBm

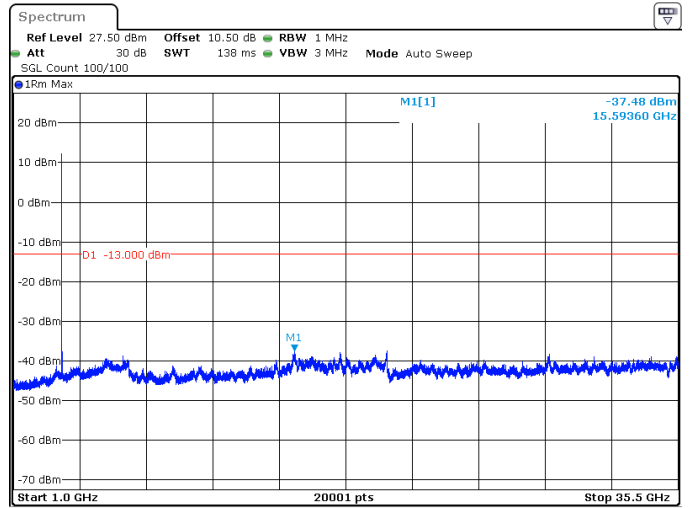


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:35:43

25MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@64 -37.27 dBm

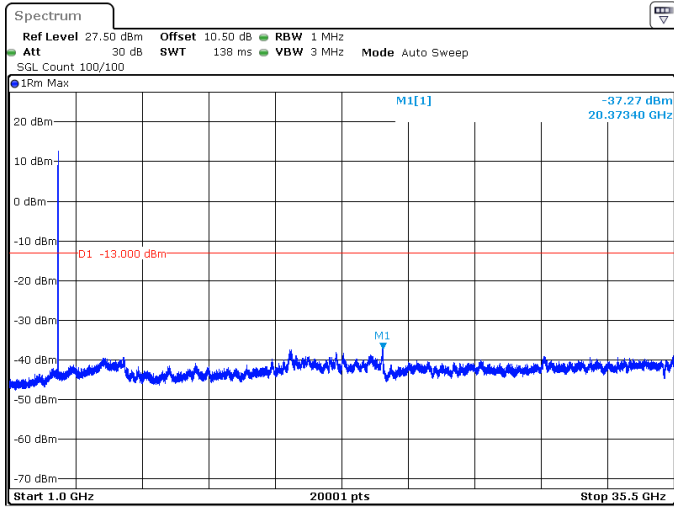


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:37:15

25MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@64 -46.90 dBm

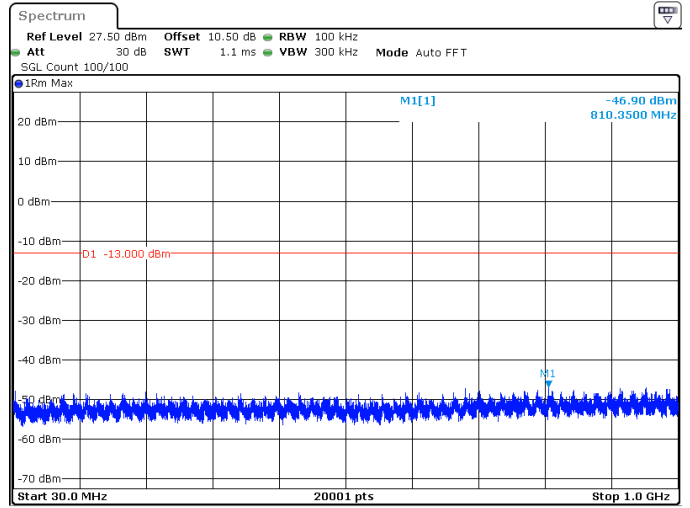


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:36:17

25MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB64@0 -37.75 dBm

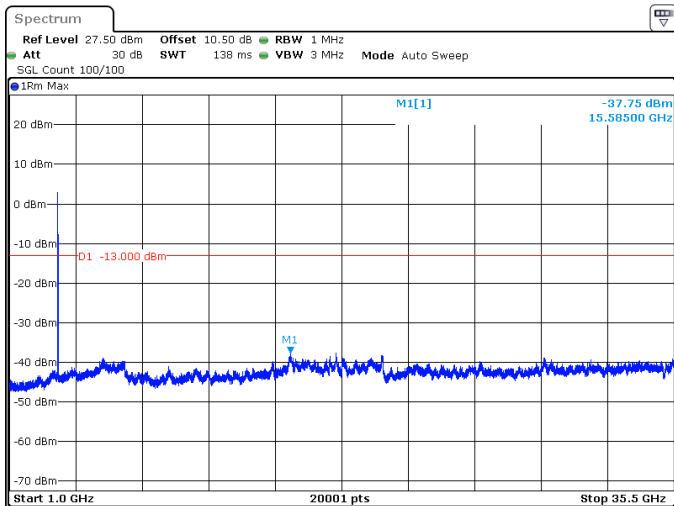


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:38:45

25MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB64@0 -45.96 dBm

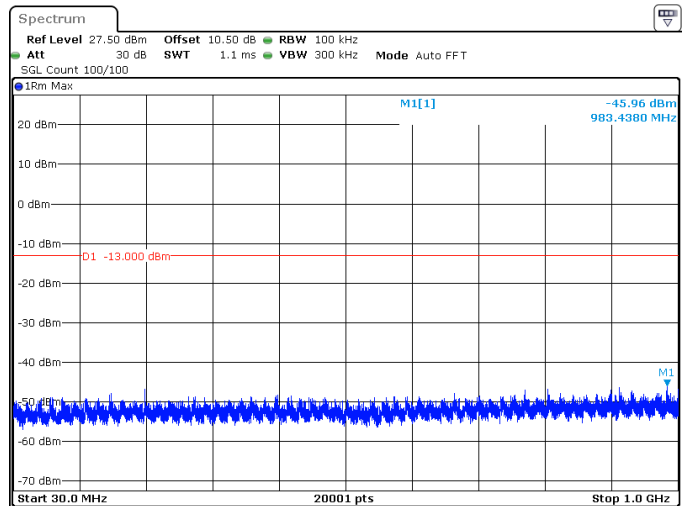


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:37:48

25MHz_30kHz_3537.5MHz_DFT-s-OFDM QPSK_RB1@0 -37.22 dBm

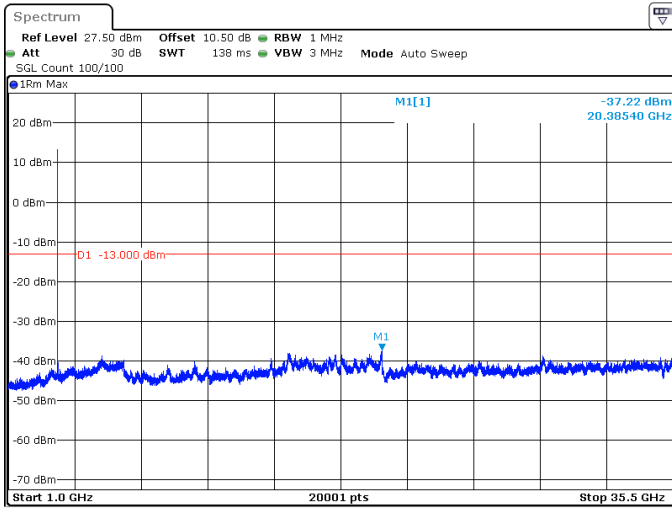


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:40:21

25MHz_30kHz_3537.5MHz_DFT-s-OFDM QPSK_RB1@0 -46.82 dBm

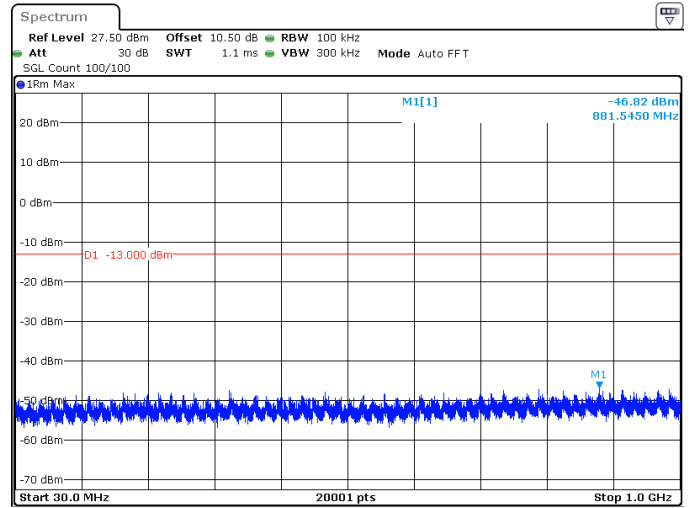


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:39:23

25MHz_30kHz_3537.5MHz_DFT-s-OFDM QPSK_RB1@64 -47.19 dBm

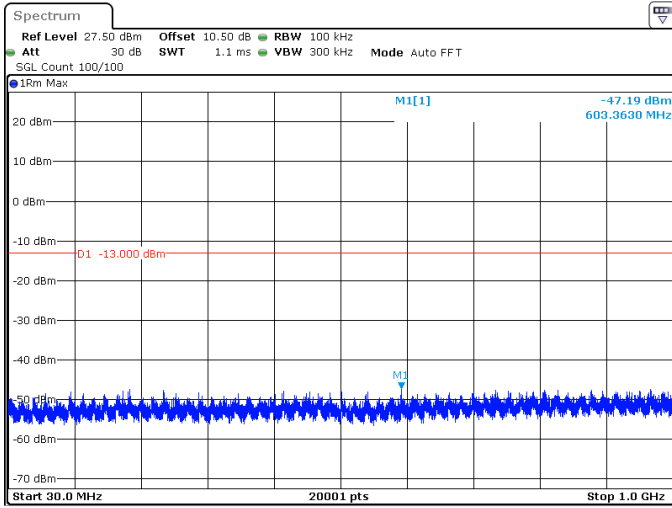


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:40:56

25MHz_30kHz_3537.5MHz_DFT-s-OFDM QPSK_RB1@64 -37.46 dBm

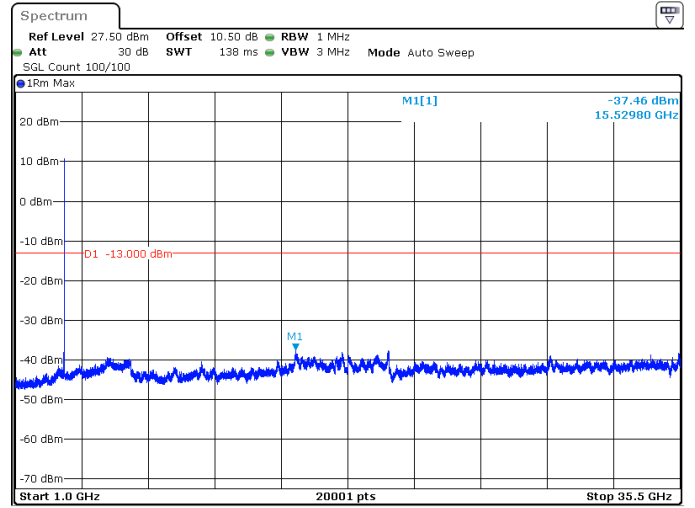


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:41:53

25MHz_30kHz_3537.5MHz_DFT-s-OFDM QPSK_RB64@0 -46.96 dBm

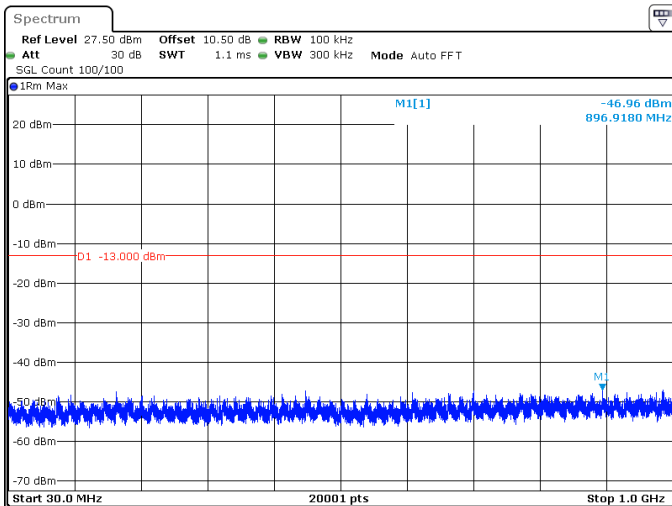


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:42:27

25MHz_30kHz_3537.5MHz_DFT-s-OFDM QPSK_RB64@0 -37.94 dBm

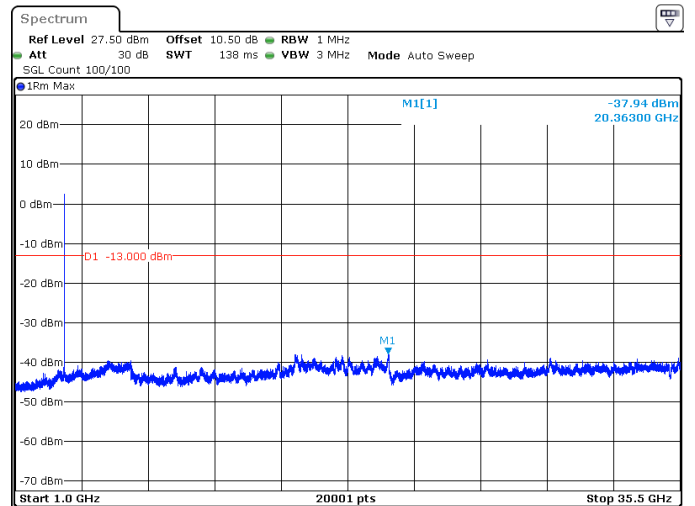


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:43:24

30MHz_30kHz_3465MHz_DFT-s-OFDM QPSK_RB1@0 -37.65 dBm

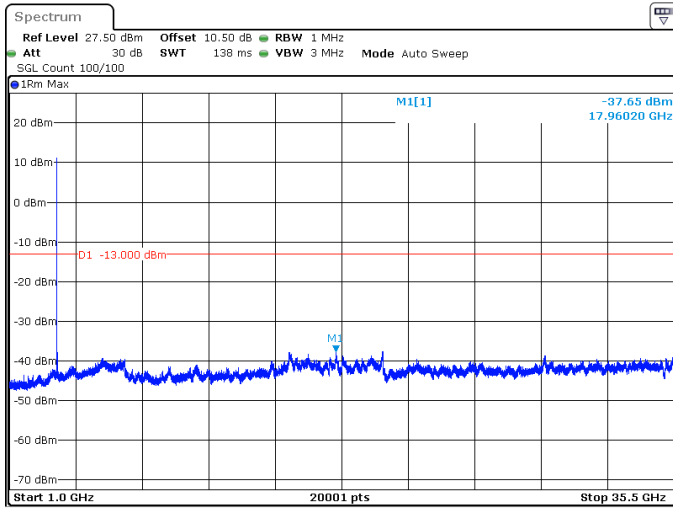


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:45:00

30MHz_30kHz_3465MHz_DFT-s-OFDM QPSK_RB1@0 -47.13 dBm

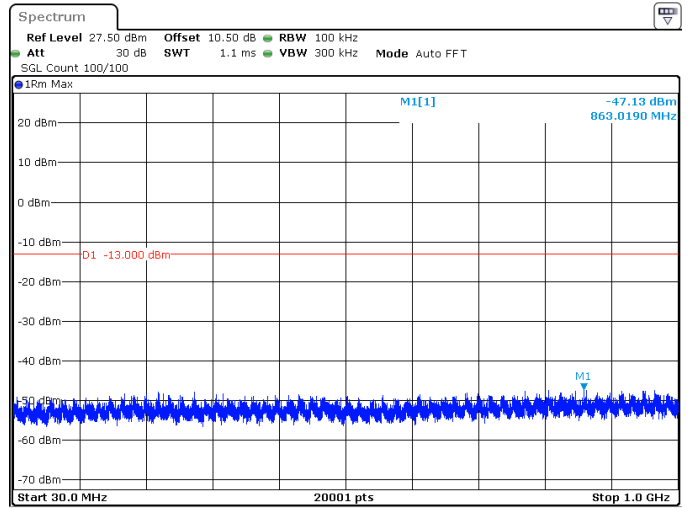


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:44:03

30MHz_30kHz_3465MHz_DFT-s-OFDM QPSK_RB1@77 -38.00 dBm

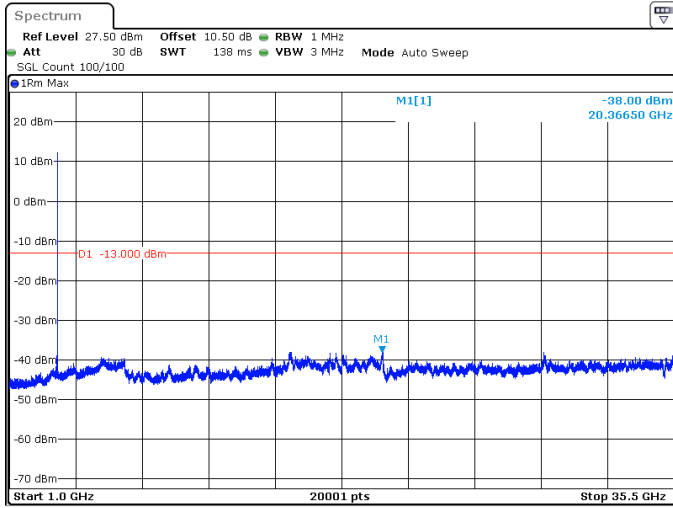


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:46:31

30MHz_30kHz_3465MHz_DFT-s-OFDM QPSK_RB1@77 -46.64 dBm

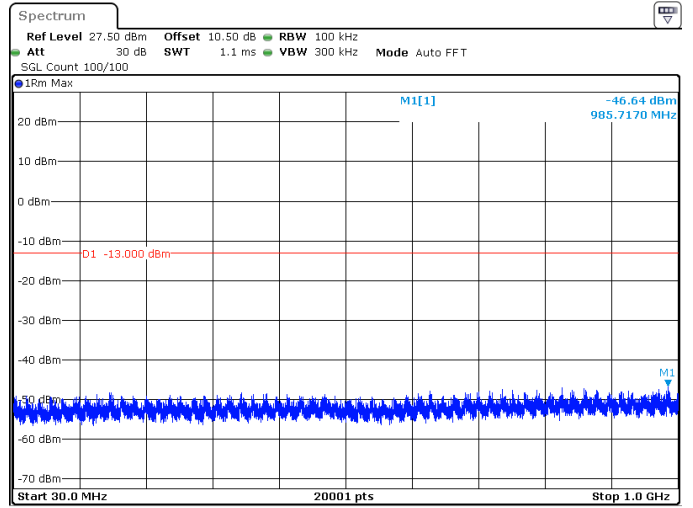


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:45:33

30MHz_30kHz_3465MHz_DFT-s-OFDM QPSK_RB75@0 -46.69 dBm

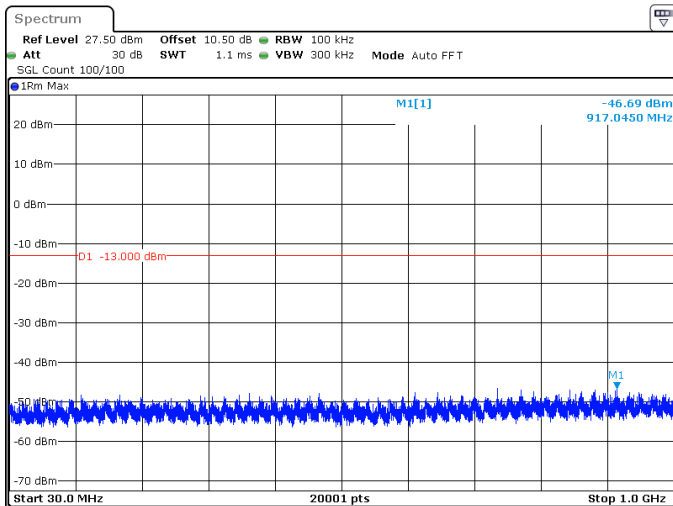


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:47:04

30MHz_30kHz_3465MHz_DFT-s-OFDM QPSK_RB75@0 -37.60 dBm

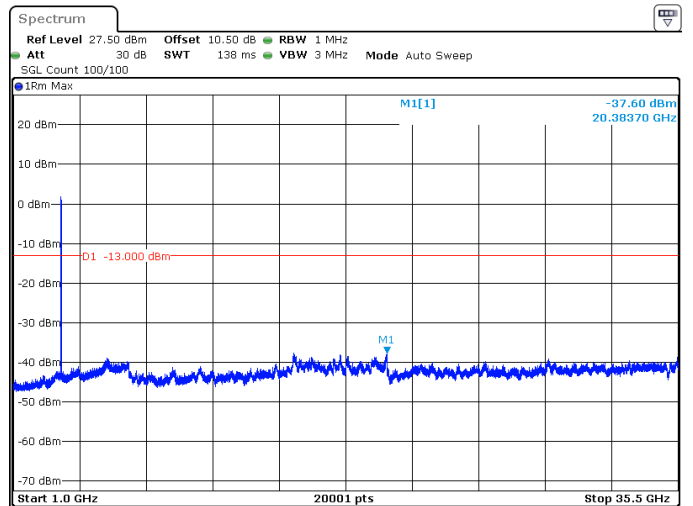


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:48:02

30MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.39 dBm

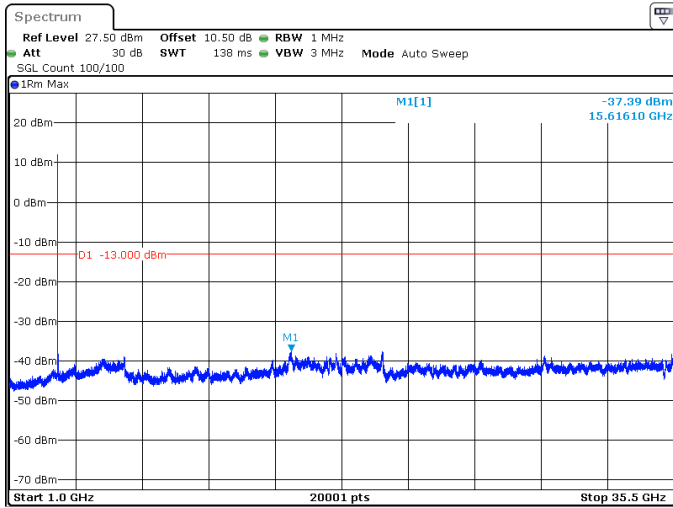


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:49:37

30MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.81 dBm

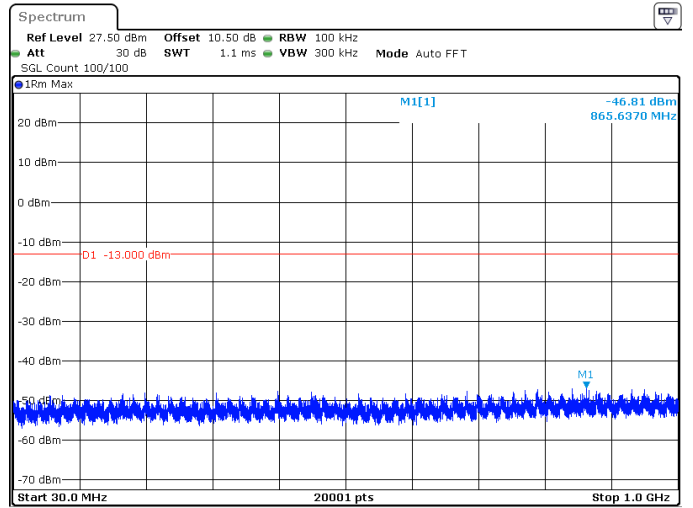


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:48:40

30MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@77 -46.63 dBm

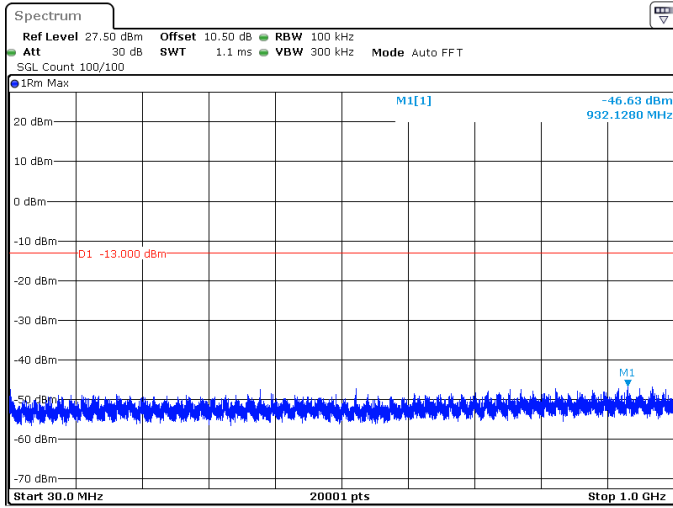


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:50:12

30MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@77 -38.08 dBm

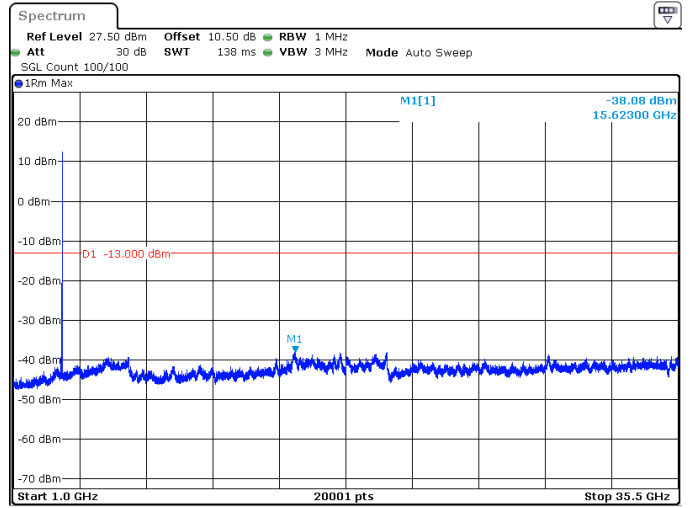


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:51:10

30MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB75@0 -37.57 dBm

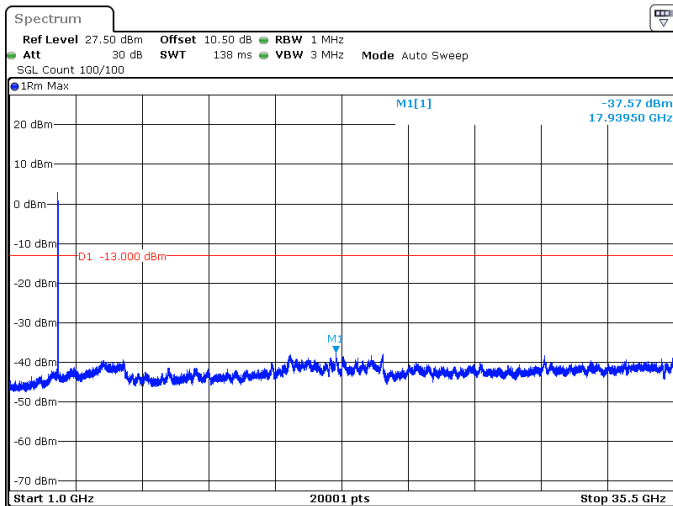


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:52:42

30MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB75@0 -46.51 dBm

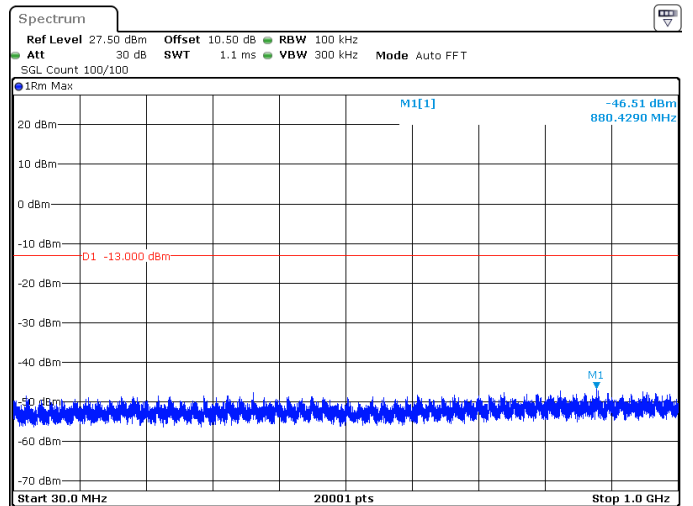


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:51:44

30MHz_30kHz_3535MHz_DFT-s-OFDM QPSK_RB1@0 -37.00 dBm

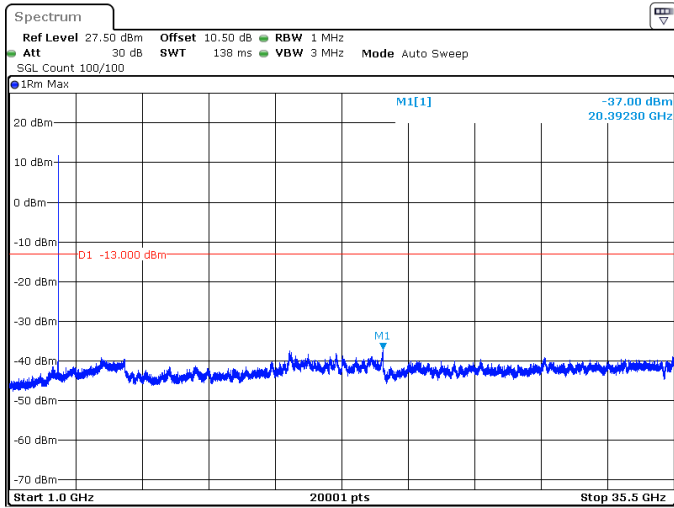


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:54:17

30MHz_30kHz_3535MHz_DFT-s-OFDM QPSK_RB1@0 -47.12 dBm

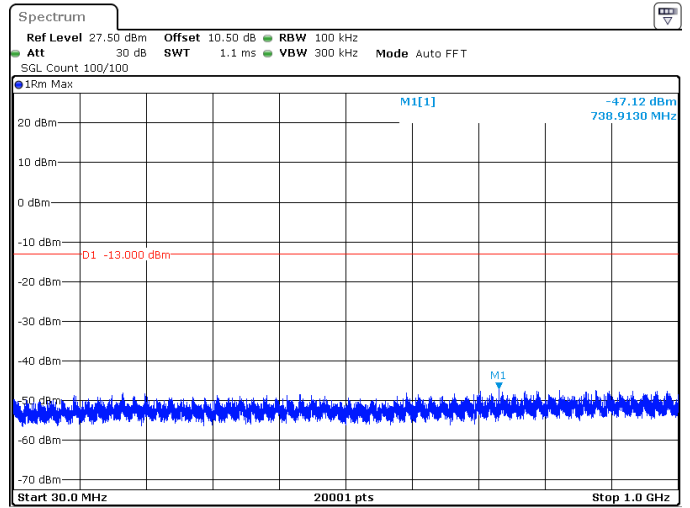


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:53:19

30MHz_30kHz_3535MHz_DFT-s-OFDM QPSK_RB1@77 -37.52 dBm

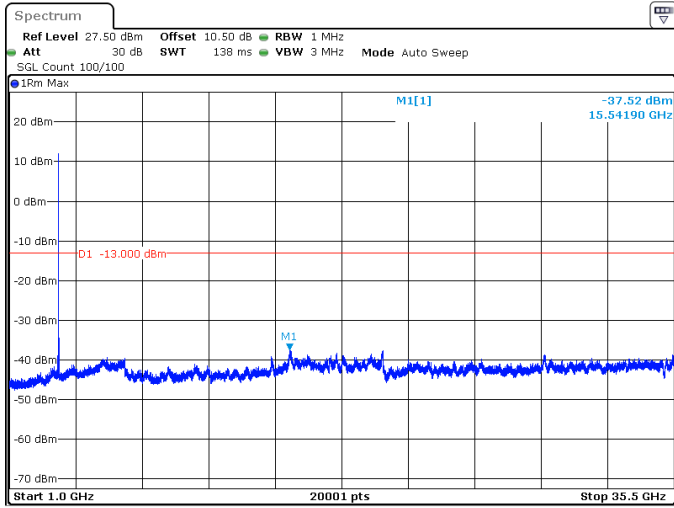


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:55:50

30MHz_30kHz_3535MHz_DFT-s-OFDM QPSK_RB1@77 -46.04 dBm

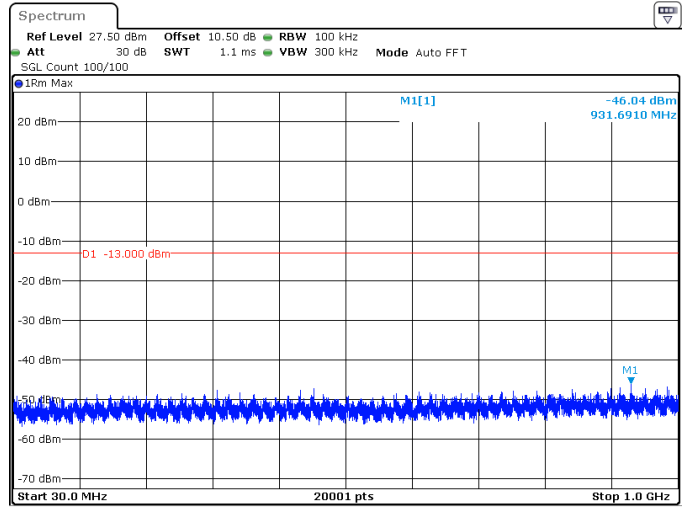


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:54:52

30MHz_30kHz_3535MHz_DFT-s-OFDM QPSK_RB75@0 -37.57 dBm

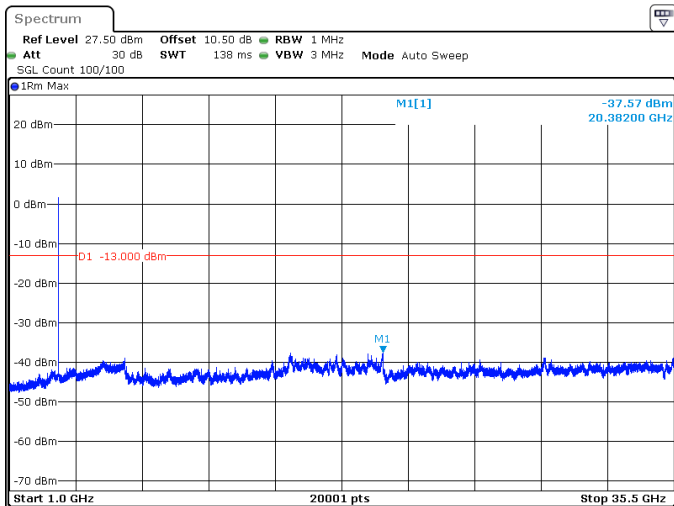


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:57:22

30MHz_30kHz_3535MHz_DFT-s-OFDM QPSK_RB75@0 -46.22 dBm

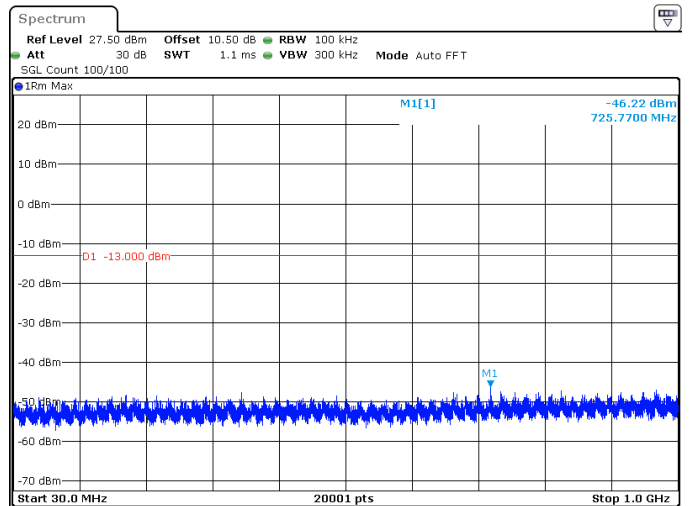


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:56:25

40MHz_30kHz_3470MHz_DFT-s-OFDM QPSK_RB1@0 -37.57 dBm

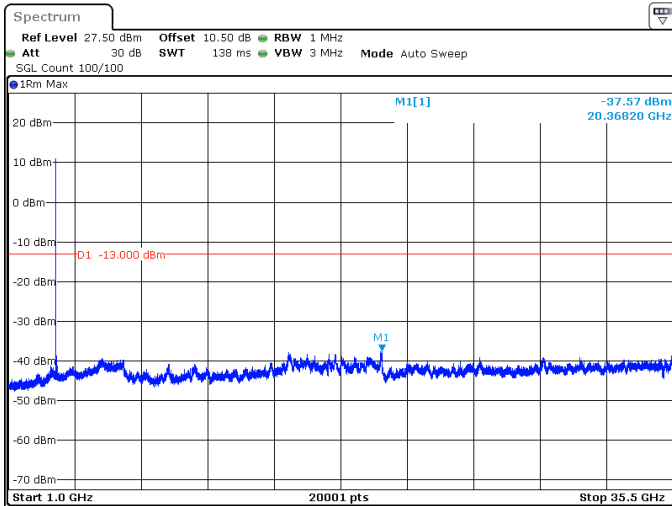


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:59:01

40MHz_30kHz_3470MHz_DFT-s-OFDM QPSK_RB1@0 -46.56 dBm

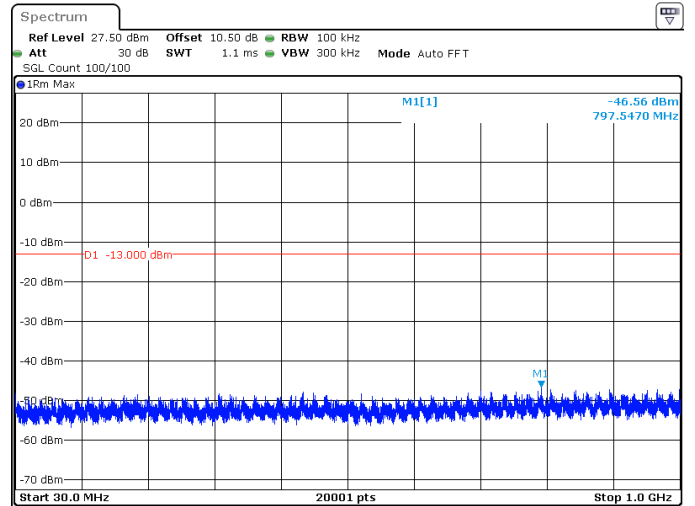


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:58:03

40MHz_30kHz_3470MHz_DFT-s-OFDM QPSK_RB1@105 -46.89 dBm

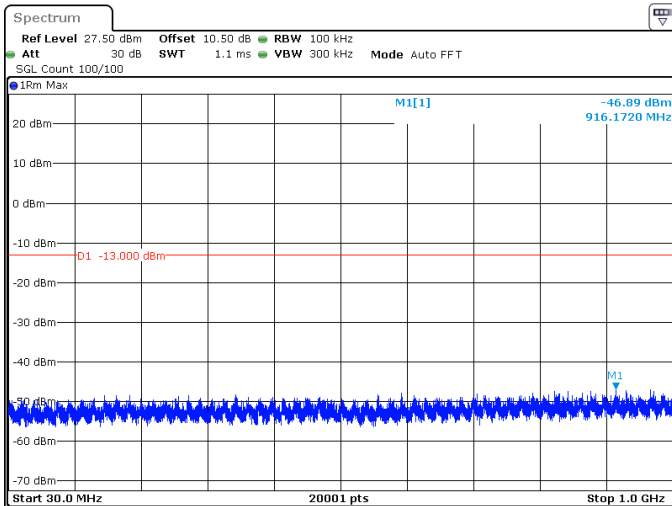


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 13:59:35

40MHz_30kHz_3470MHz_DFT-s-OFDM QPSK_RB1@105 -37.50 dBm

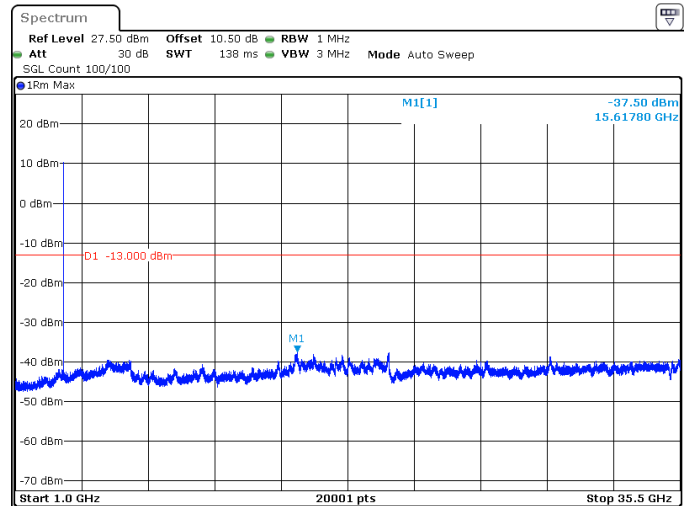


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:00:32

40MHz_30kHz_3470MHz_DFT-s-OFDM QPSK_RB100@0 -47.63 dBm

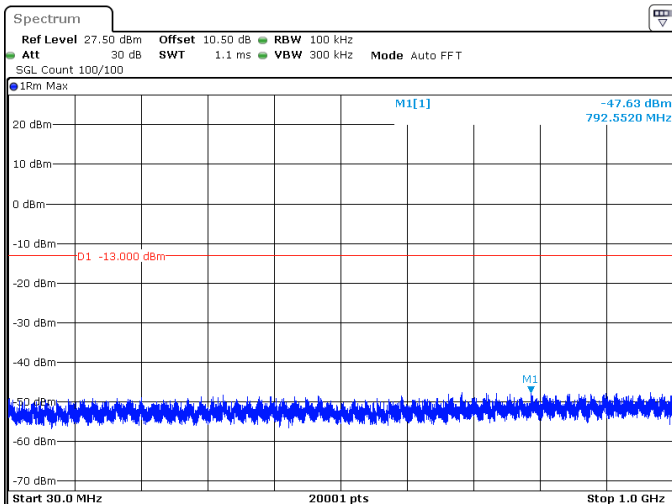


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:01:06

40MHz_30kHz_3470MHz_DFT-s-OFDM QPSK_RB100@0 -37.15 dBm

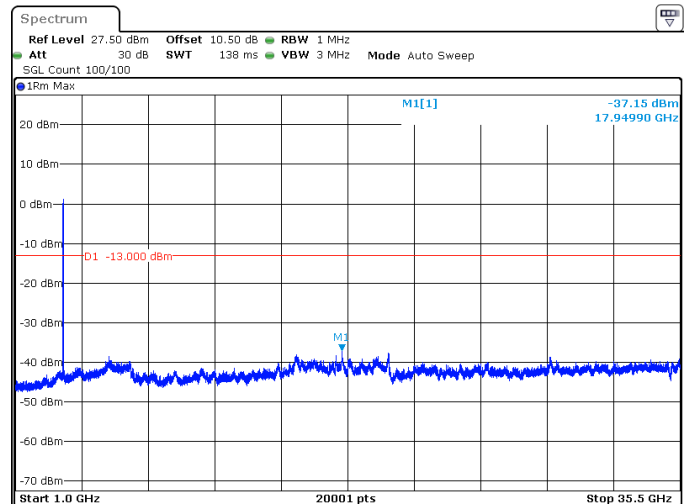


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:02:03

40MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.29 dBm

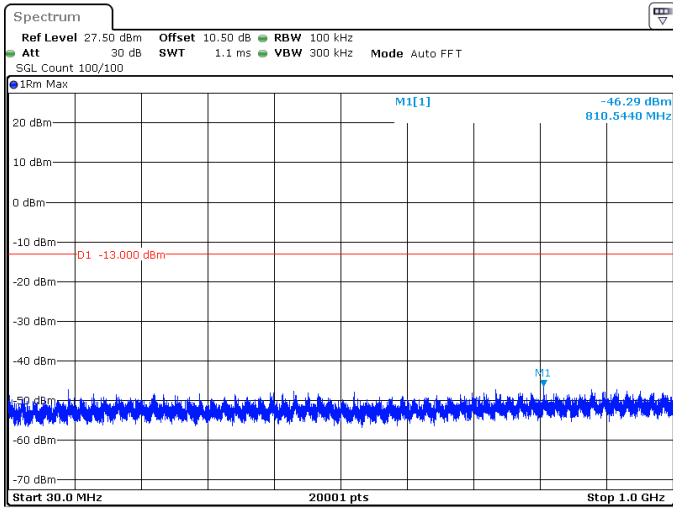


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:02:44

40MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.80 dBm

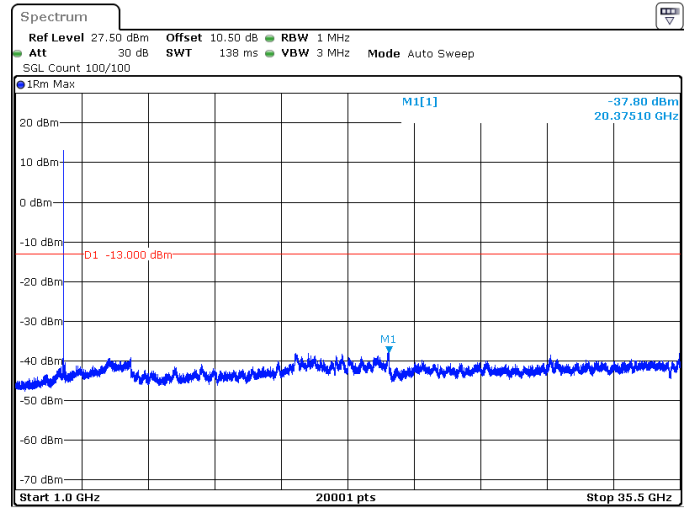


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:03:42

40MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@105 -37.54 dBm

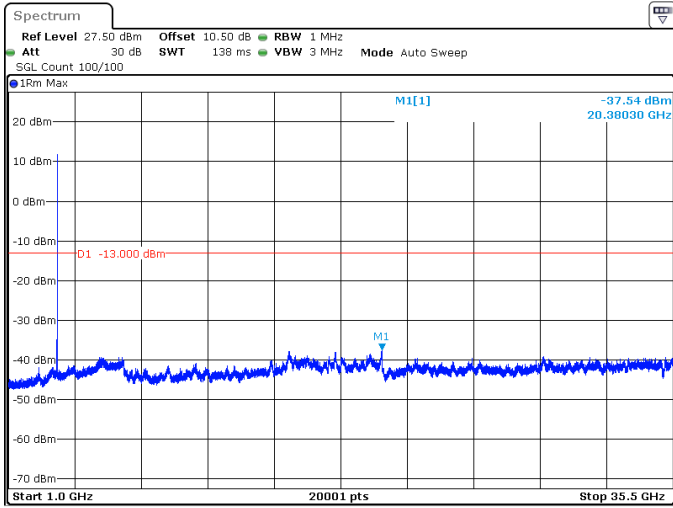


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:05:14

40MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@105 -46.88 dBm

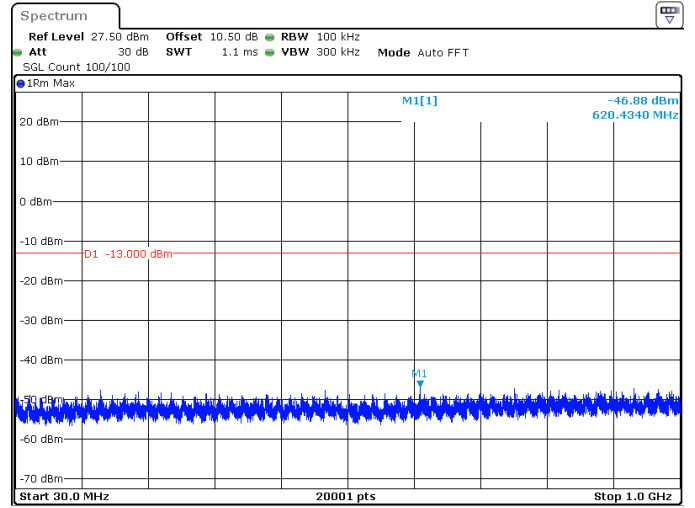


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:04:16

40MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB100@0 -37.71 dBm

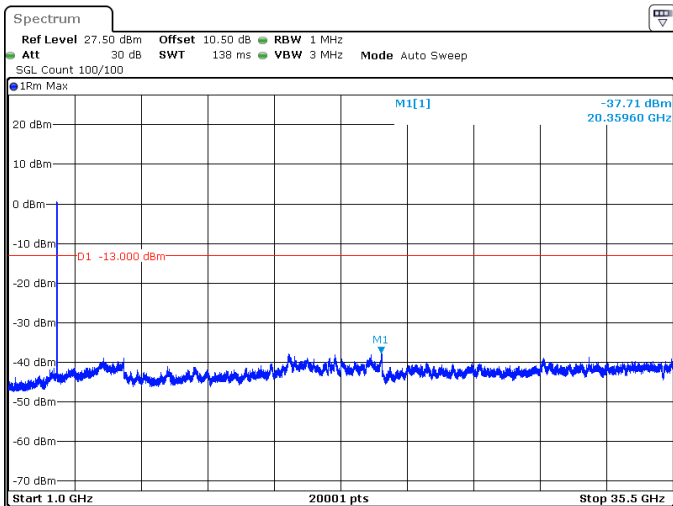


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:06:46

40MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB100@0 -45.87 dBm

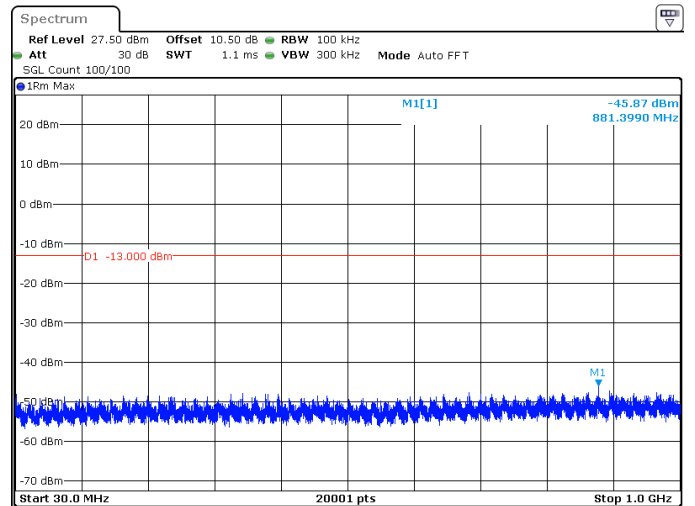


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:05:49

40MHz_30kHz_3530MHz_DFT-s-OFDM QPSK_RB1@0 -46.84 dBm

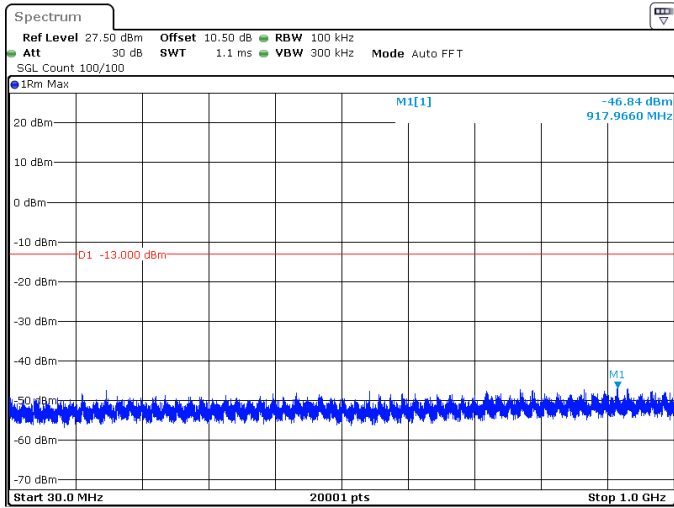


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:07:25

40MHz_30kHz_3530MHz_DFT-s-OFDM QPSK_RB1@0 -37.06 dBm

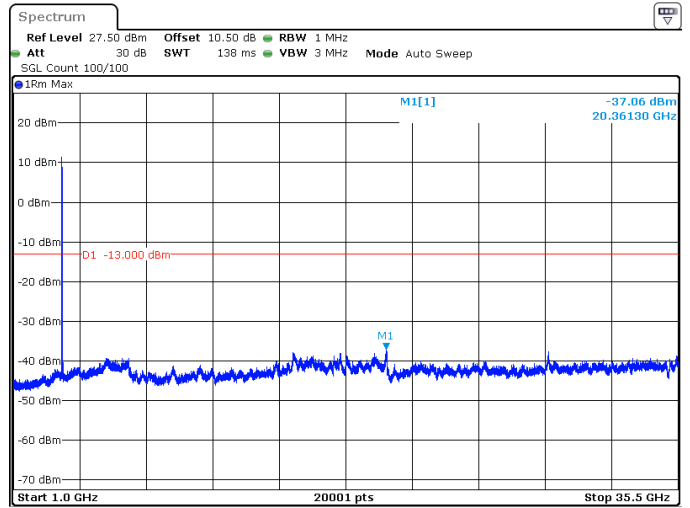


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:08:23

40MHz_30kHz_3530MHz_DFT-s-OFDM QPSK_RB1@105 -37.15 dBm

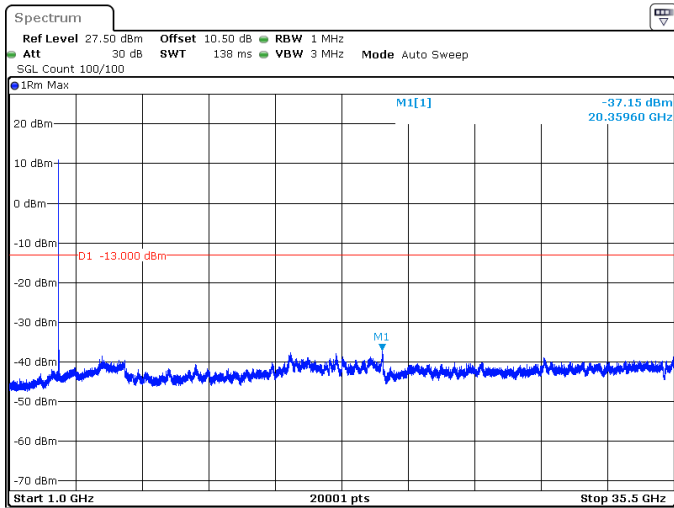


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:09:57

40MHz_30kHz_3530MHz_DFT-s-OFDM QPSK_RB1@105 -46.82 dBm

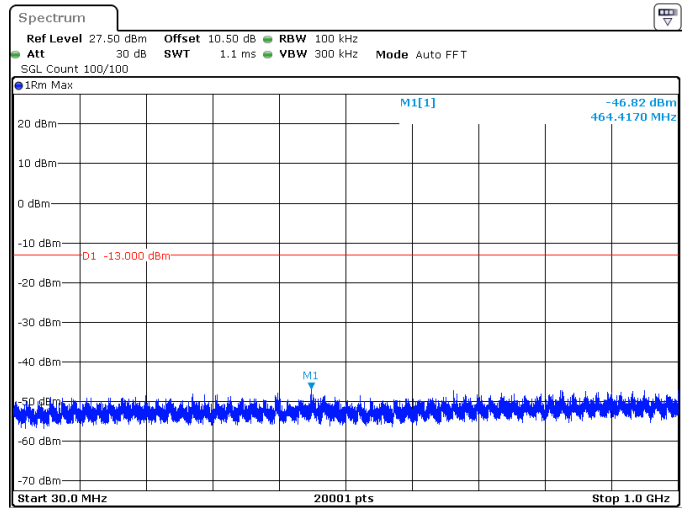


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:08:59

40MHz_30kHz_3530MHz_DFT-s-OFDM QPSK_RB100@0 -46.92 dBm

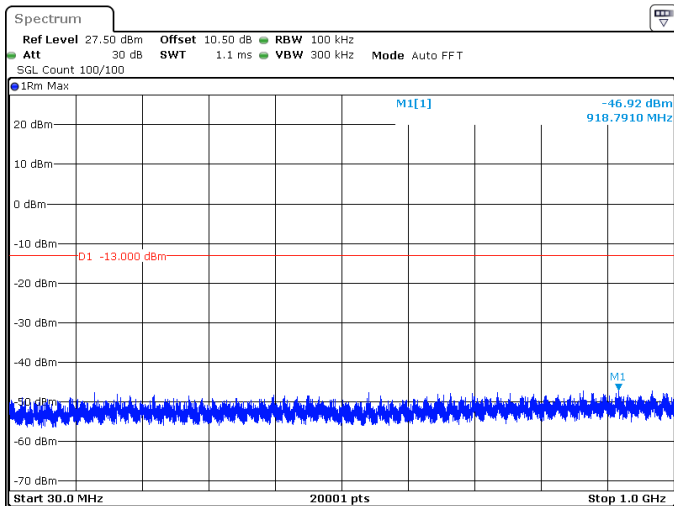


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:10:31

40MHz_30kHz_3530MHz_DFT-s-OFDM QPSK_RB100@0 -37.43 dBm

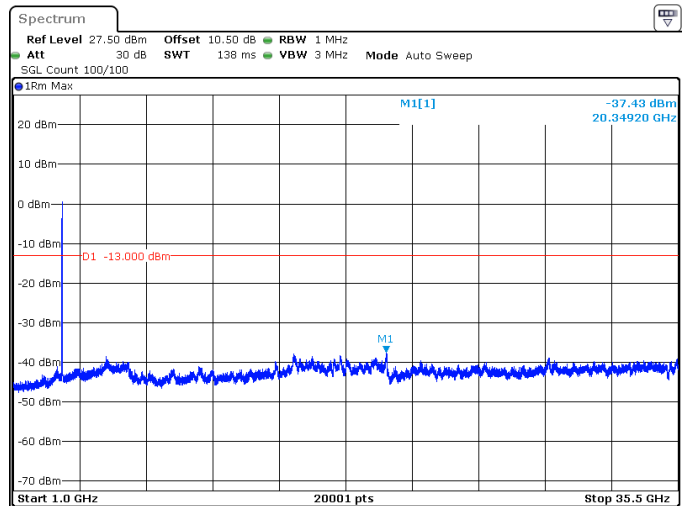


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:11:29

50MHz_30kHz_3475MHz_DFT-s-OFDM QPSK_RB1@0 -47.04 dBm

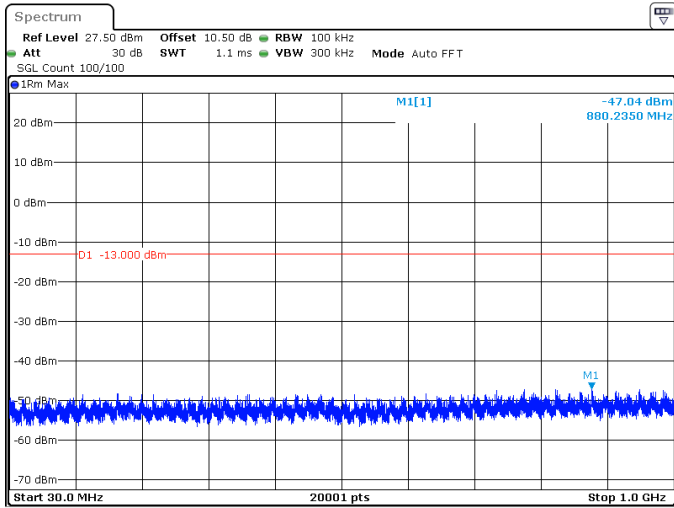


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:12:09

50MHz_30kHz_3475MHz_DFT-s-OFDM QPSK_RB1@0 -37.34 dBm

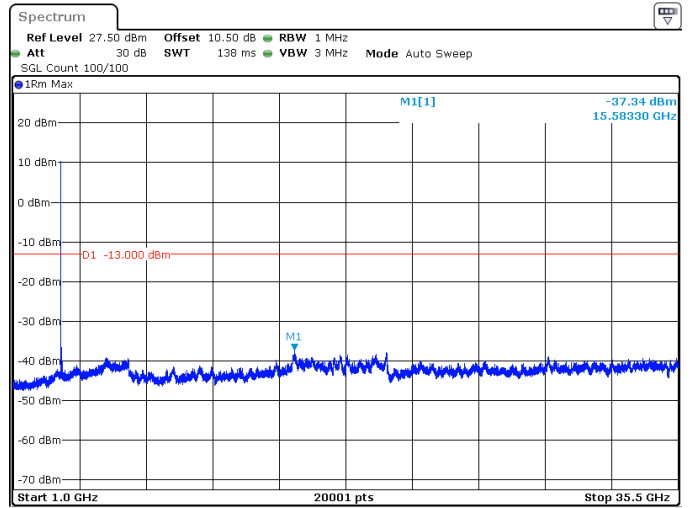


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:13:07

50MHz_30kHz_3475MHz_DFT-s-OFDM QPSK_RB1@132 -46.42 dBm

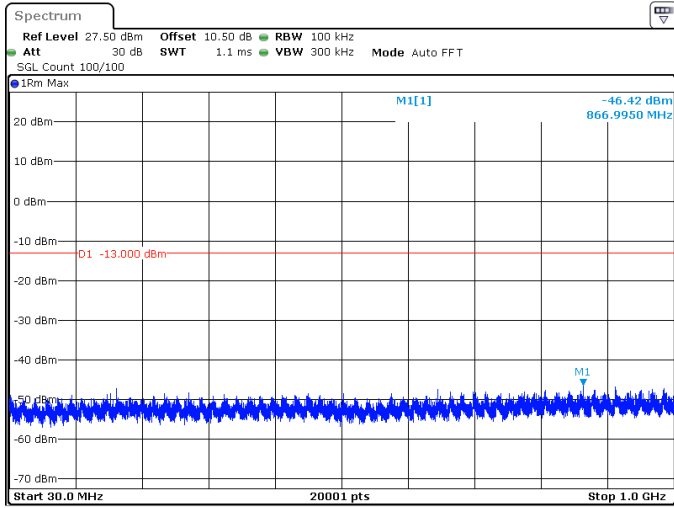


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:13:41

50MHz_30kHz_3475MHz_DFT-s-OFDM QPSK_RB1@132 -38.02 dBm

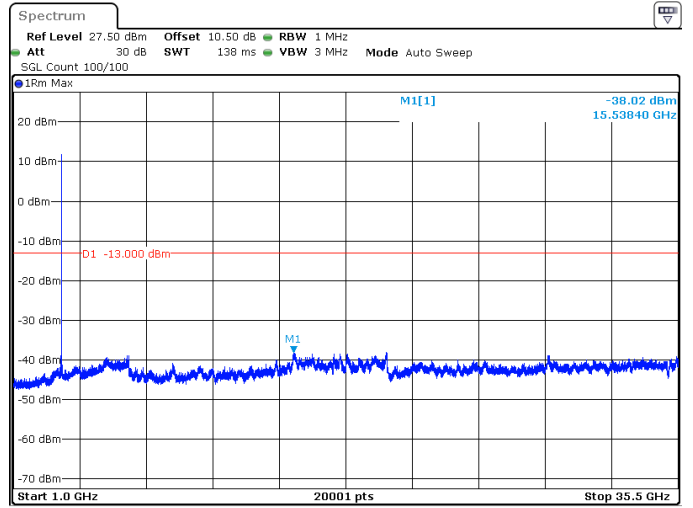


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:14:39

50MHz_30kHz_3475MHz_DFT-s-OFDM QPSK_RB128@0 -46.96 dBm

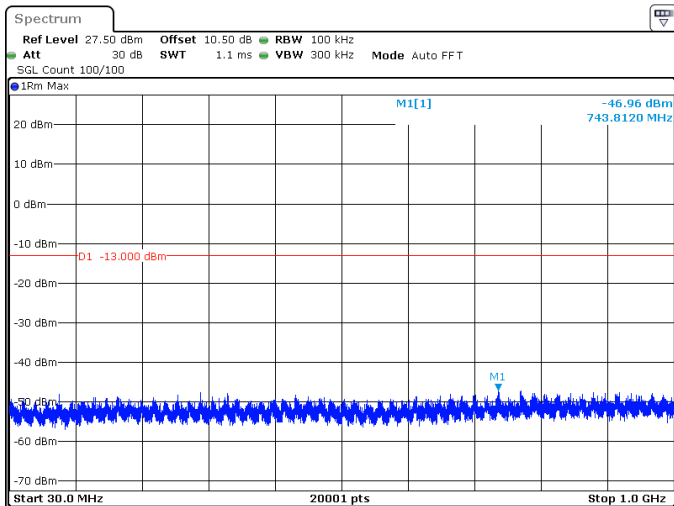


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:15:13

50MHz_30kHz_3475MHz_DFT-s-OFDM QPSK_RB128@0 -37.16 dBm

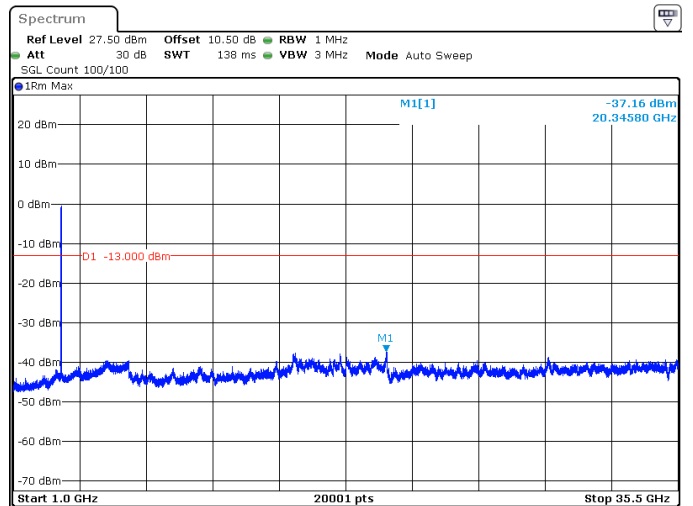


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:16:10

50MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.96 dBm

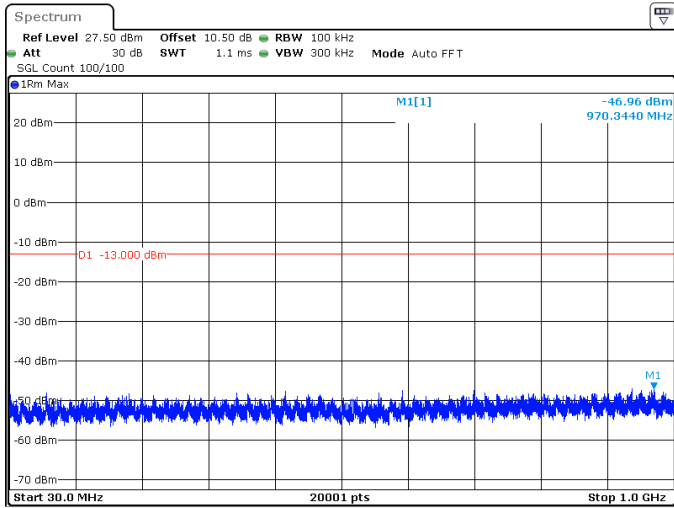


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:16:48

50MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.79 dBm

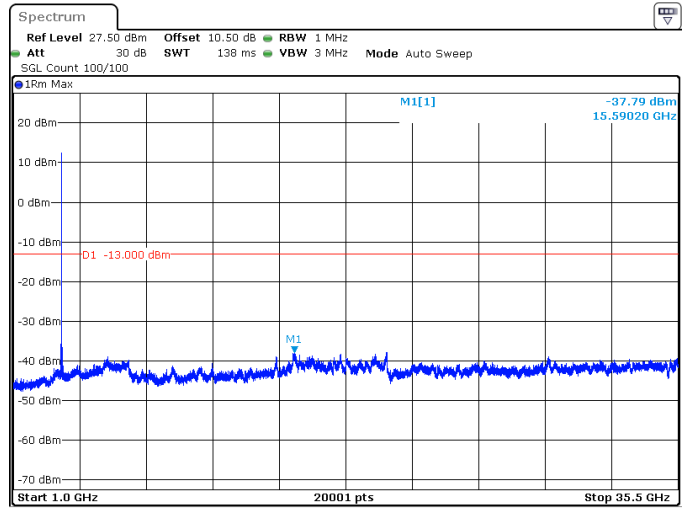


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:17:47

50MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@132 -37.71 dBm

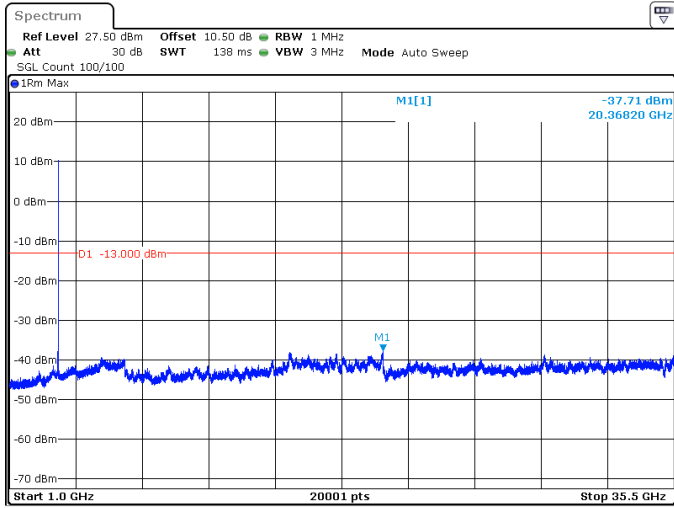


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:19:20

50MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@132 -46.74 dBm

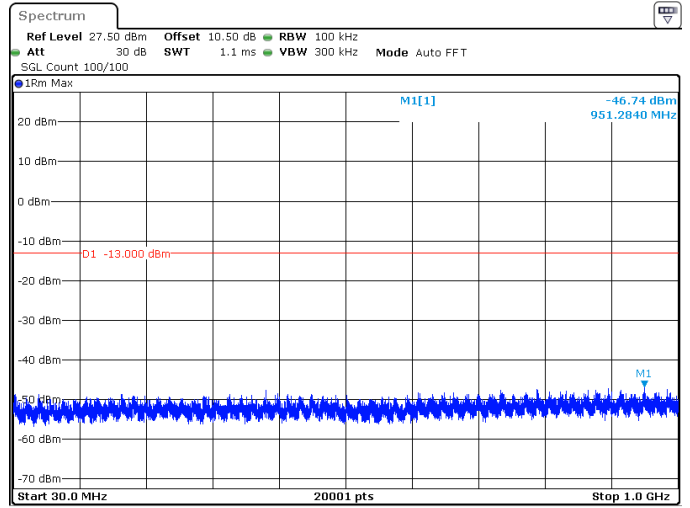


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:18:22

50MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB128@0 -46.90 dBm

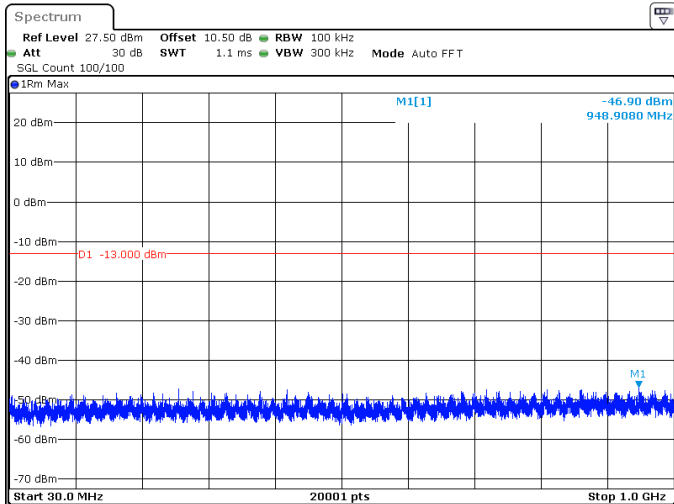


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:19:54

50MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB128@0 -37.94 dBm

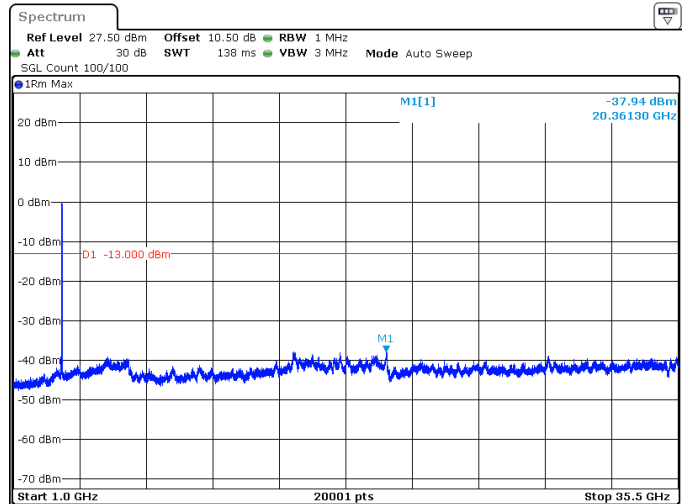


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:20:51

50MHz_30kHz_3525MHz_DFT-s-OFDM QPSK_RB1@0 -37.52 dBm

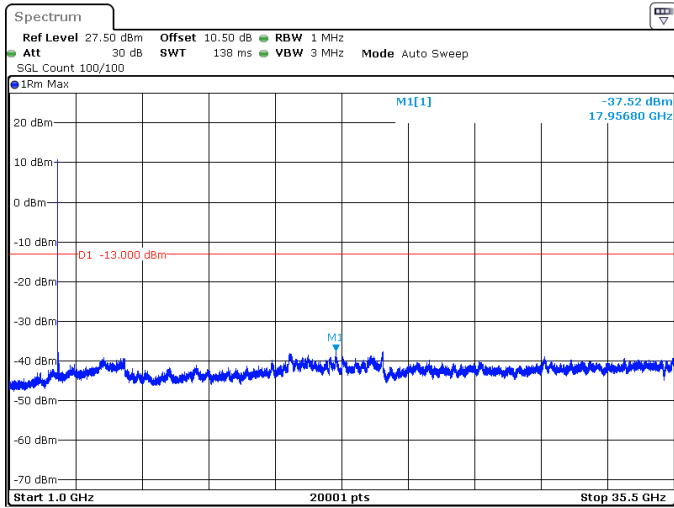


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:22:27

50MHz_30kHz_3525MHz_DFT-s-OFDM QPSK_RB1@0 -46.78 dBm

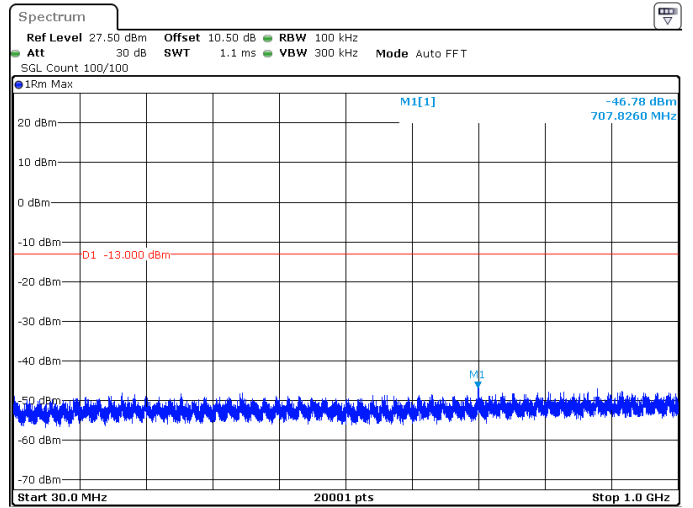


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:21:29

50MHz_30kHz_3525MHz_DFT-s-OFDM QPSK_RB1@132 -46.16 dBm

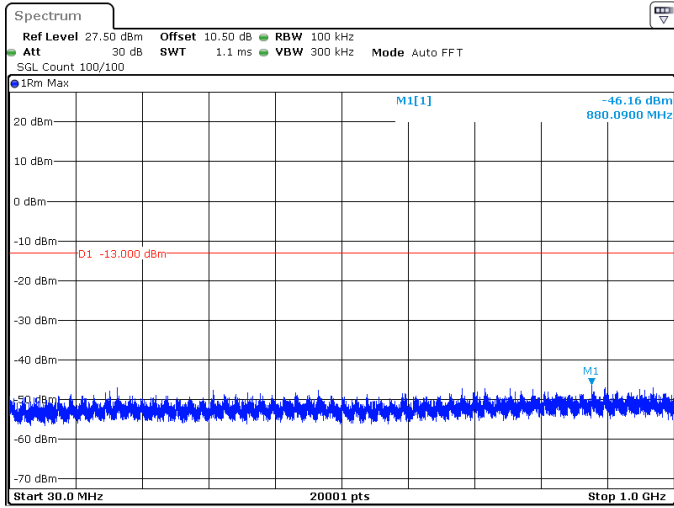


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:23:01

50MHz_30kHz_3525MHz_DFT-s-OFDM QPSK_RB1@132 -37.62 dBm

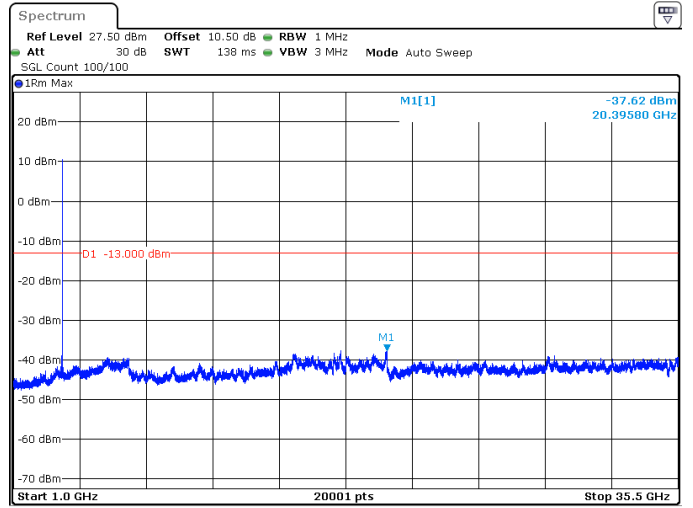


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:23:58

50MHz_30kHz_3525MHz_DFT-s-OFDM QPSK_RB128@0 -37.91 dBm

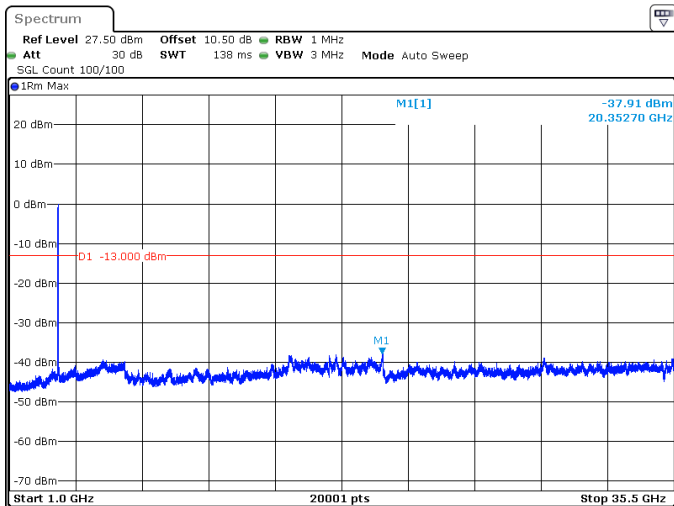


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:25:30

50MHz_30kHz_3525MHz_DFT-s-OFDM QPSK_RB128@0 -46.57 dBm

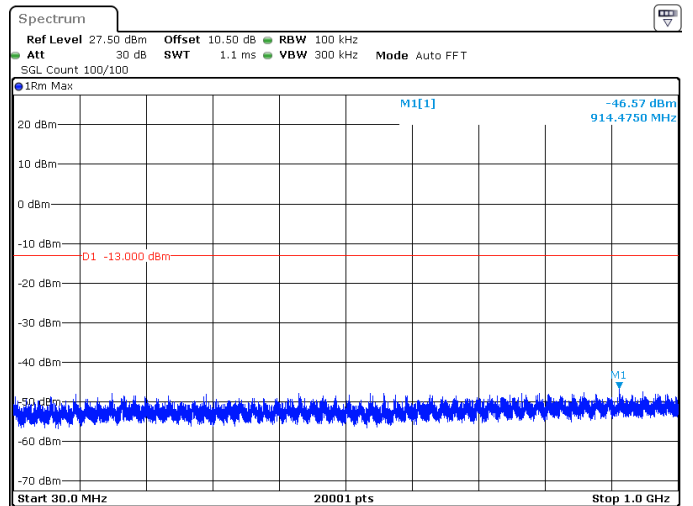


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:24:32

60MHz_30kHz_3480MHz_DFT-s-OFDM QPSK_RB1@0 -37.64 dBm

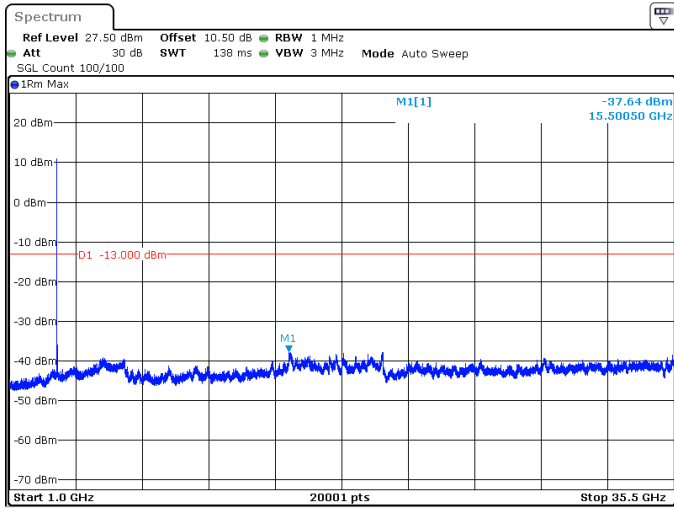


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:27:08

60MHz_30kHz_3480MHz_DFT-s-OFDM QPSK_RB1@0 -46.84 dBm

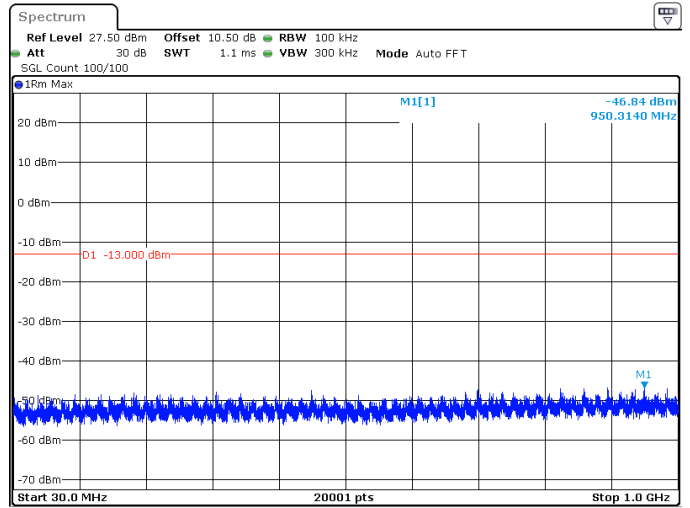


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:26:10

60MHz_30kHz_3480MHz_DFT-s-OFDM QPSK_RB1@161 -47.14 dBm

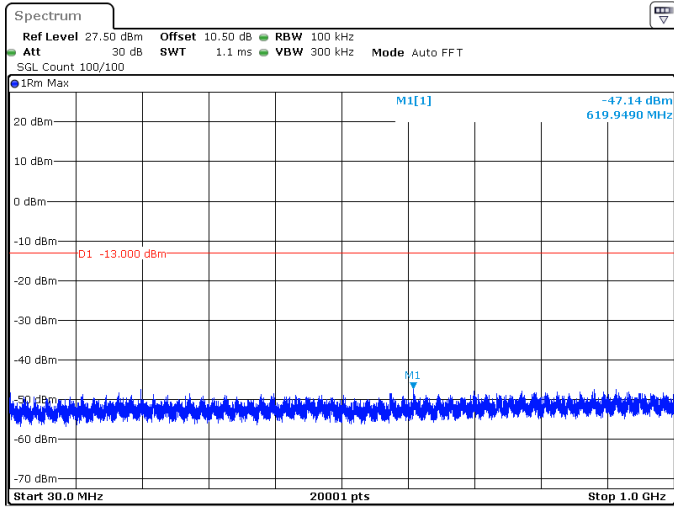


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:27:43

60MHz_30kHz_3480MHz_DFT-s-OFDM QPSK_RB1@161 -37.96 dBm

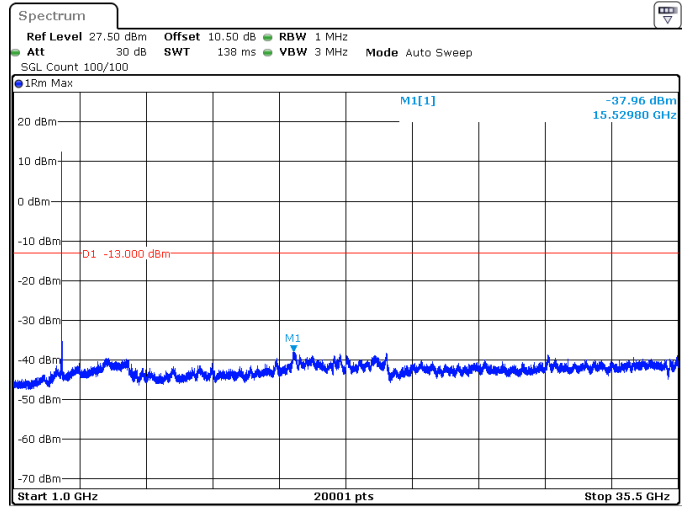


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:28:41

60MHz_30kHz_3480MHz_DFT-s-OFDM QPSK_RB162@0 -37.22 dBm

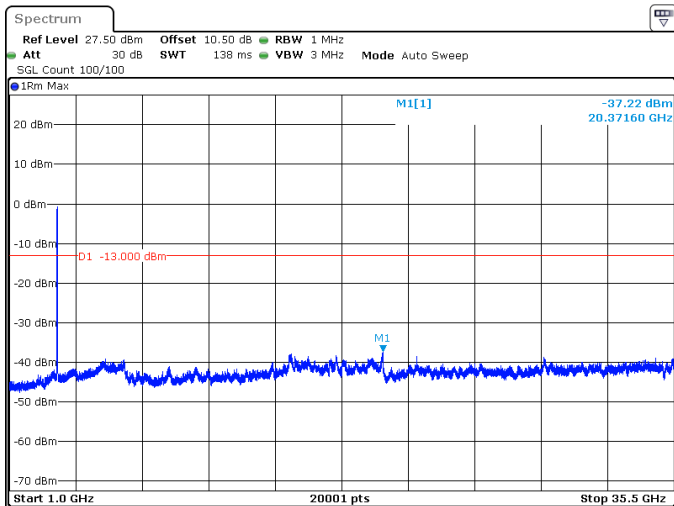


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:30:13

60MHz_30kHz_3480MHz_DFT-s-OFDM QPSK_RB162@0 -47.10 dBm

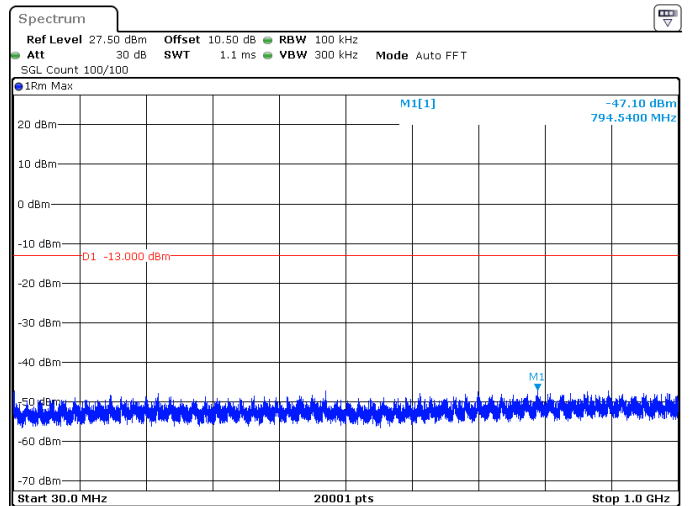


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:29:15

60MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.25 dBm

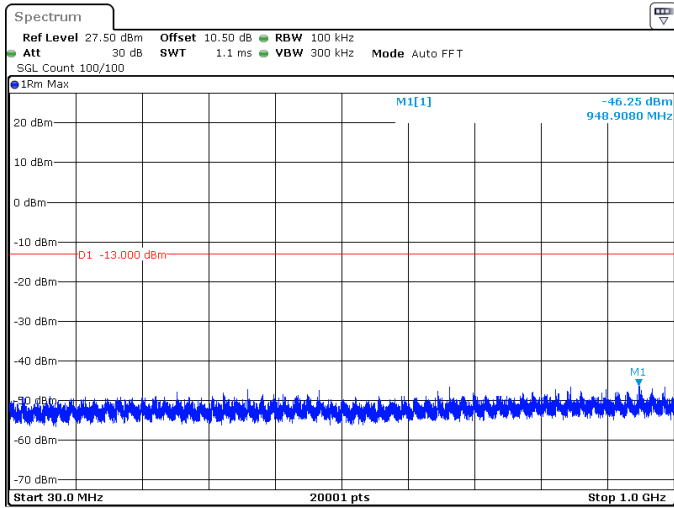


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:30:51

60MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.35 dBm

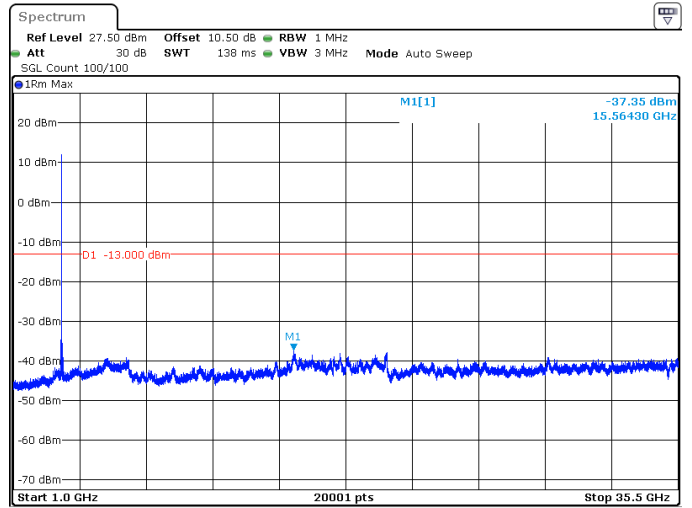


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:31:50

60MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@161 -37.46 dBm

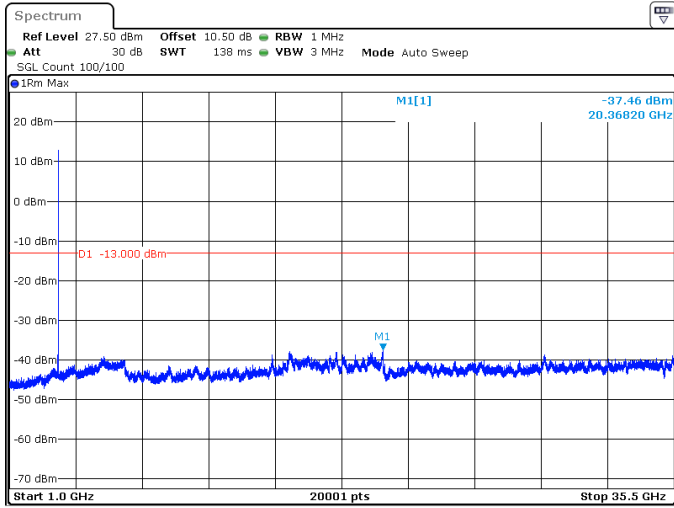


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:33:22

60MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@161 -45.98 dBm

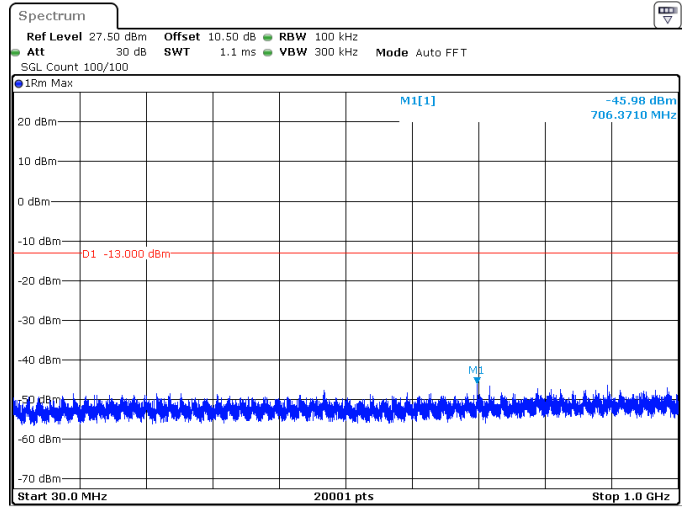


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:32:25

60MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB162@0 -37.68 dBm

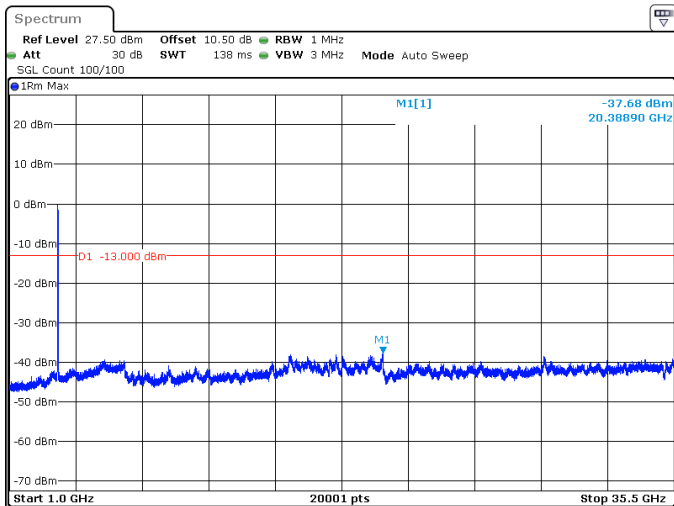


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:34:55

60MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB162@0 -46.80 dBm

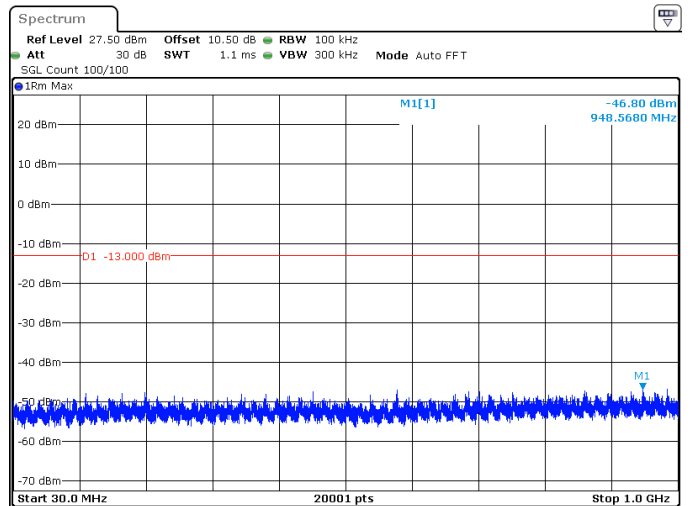


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:33:57

60MHz_30kHz_3520MHz_DFT-s-OFDM QPSK_RB1@0 -47.18 dBm

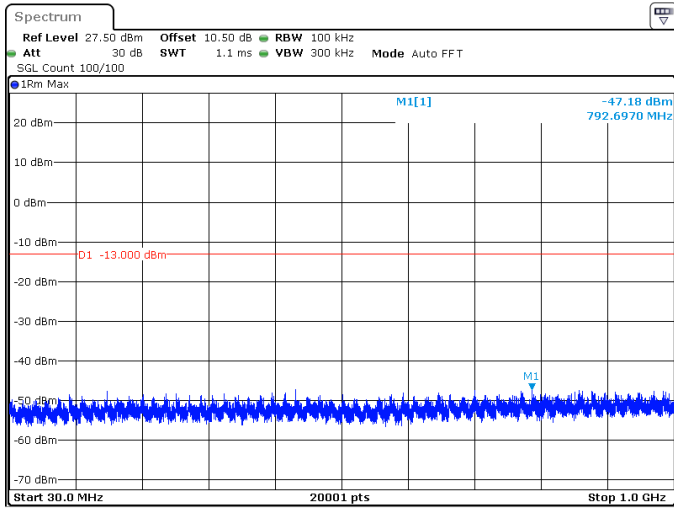


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:35:34

60MHz_30kHz_3520MHz_DFT-s-OFDM QPSK_RB1@0 -37.65 dBm

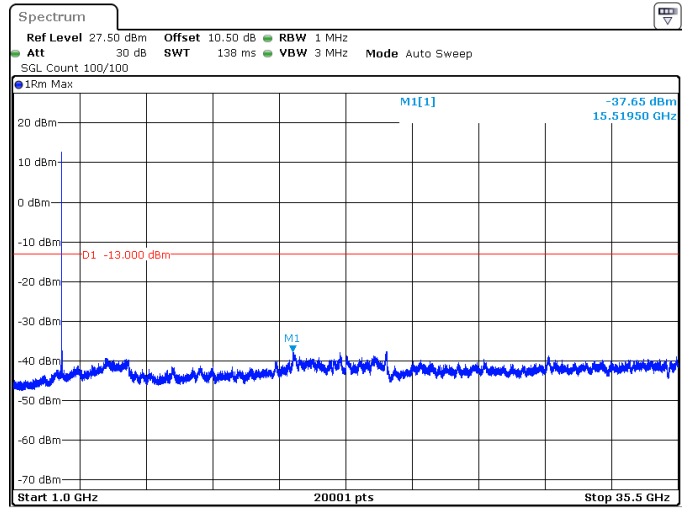


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:36:33

60MHz_30kHz_3520MHz_DFT-s-OFDM QPSK_RB1@161 -37.28 dBm

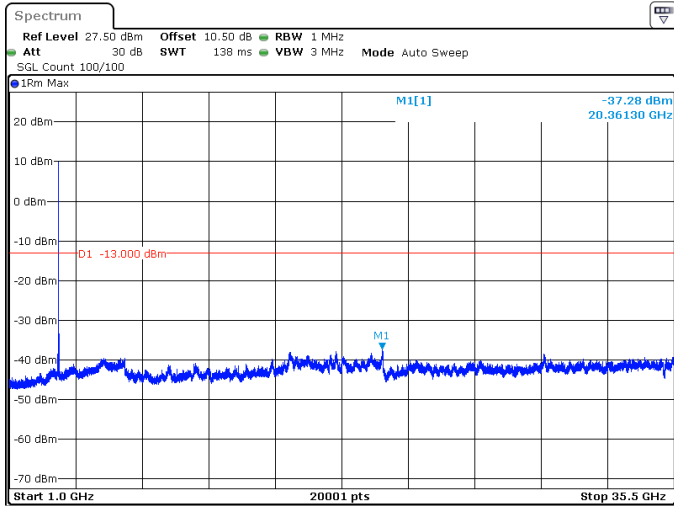


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:38:12

60MHz_30kHz_3520MHz_DFT-s-OFDM QPSK_RB1@161 -47.37 dBm

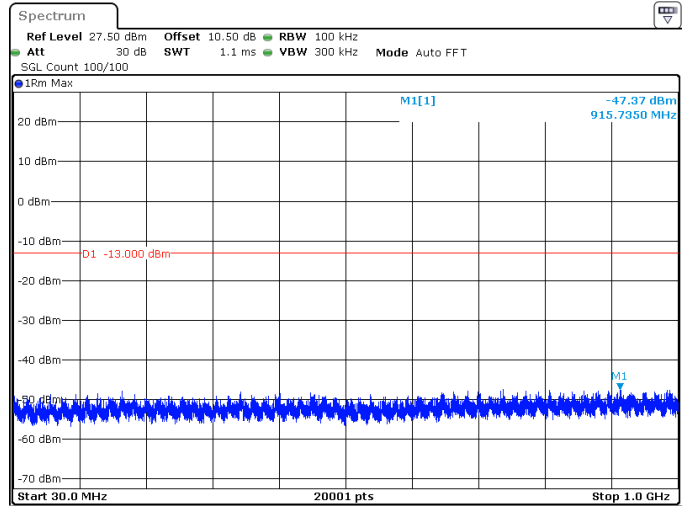


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:37:11

60MHz_30kHz_3520MHz_DFT-s-OFDM QPSK_RB162@0 -37.17 dBm

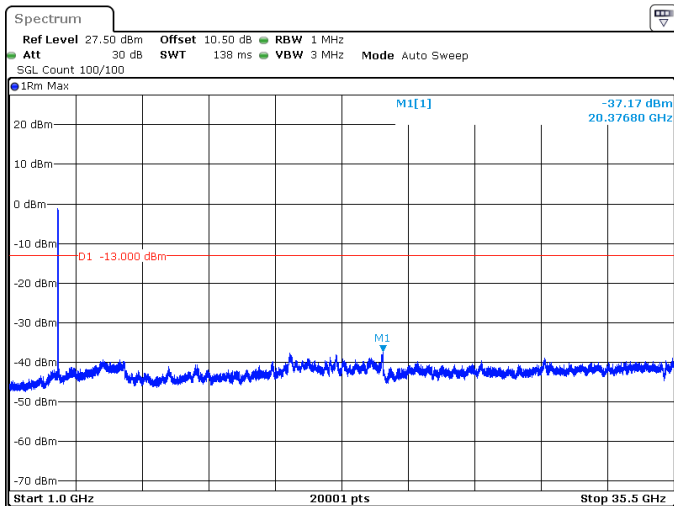


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:39:48

60MHz_30kHz_3520MHz_DFT-s-OFDM QPSK_RB162@0 -45.42 dBm

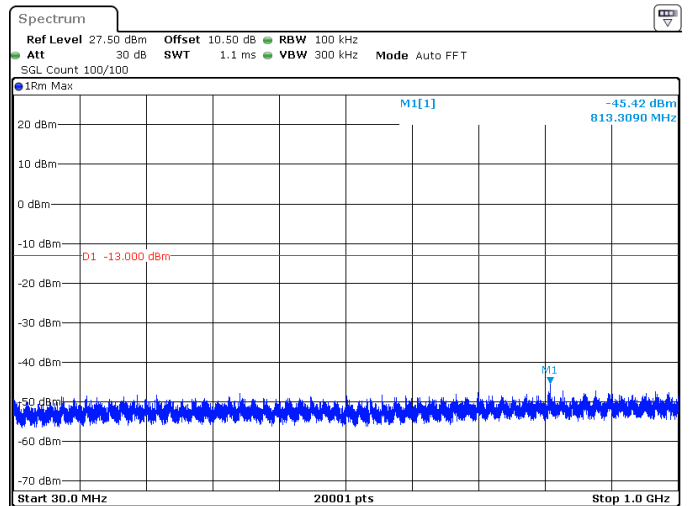


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:38:49

70MHz_30kHz_3485MHz_DFT-s-OFDM QPSK_RB1@0 -37.91 dBm

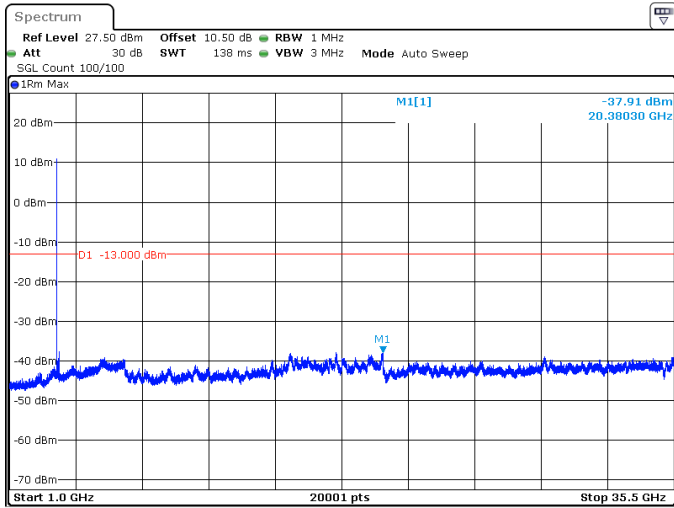


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:41:33

70MHz_30kHz_3485MHz_DFT-s-OFDM QPSK_RB1@0 -47.14 dBm

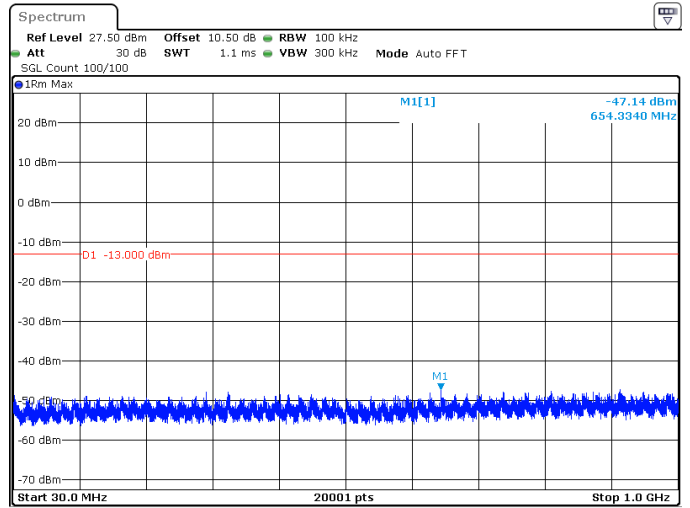


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:40:33

70MHz_30kHz_3485MHz_DFT-s-OFDM QPSK_RB1@188 -37.50 dBm

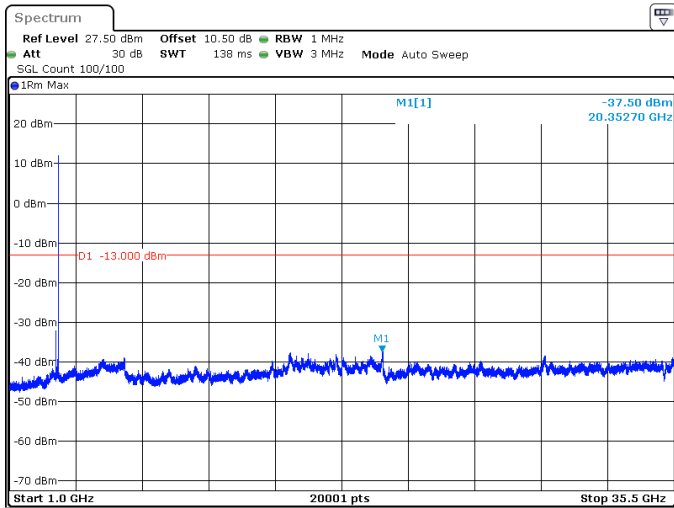


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:43:09

70MHz_30kHz_3485MHz_DFT-s-OFDM QPSK_RB1@188 -46.79 dBm

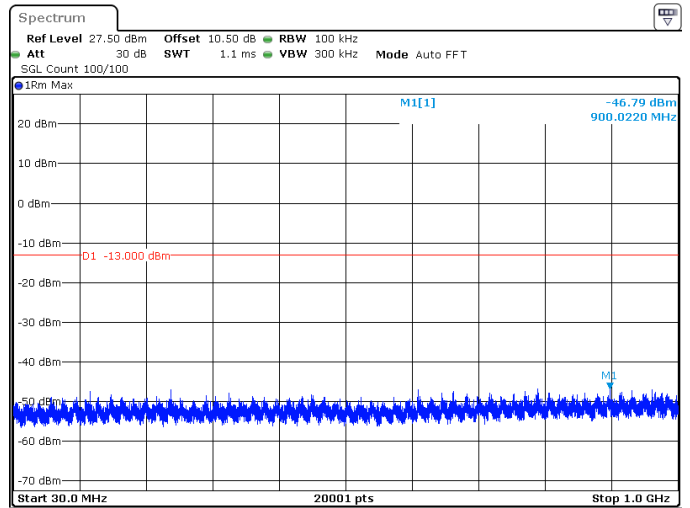


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:42:09

70MHz_30kHz_3485MHz_DFT-s-OFDM QPSK_RB180@0 -37.65 dBm

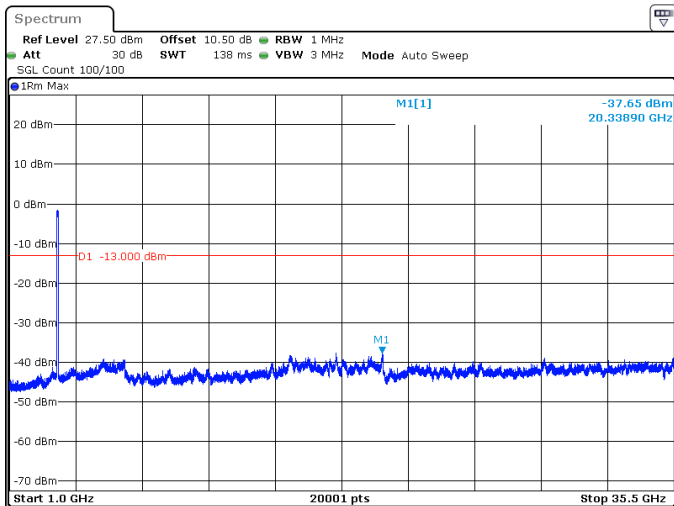


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:44:54

70MHz_30kHz_3485MHz_DFT-s-OFDM QPSK_RB180@0 -46.06 dBm

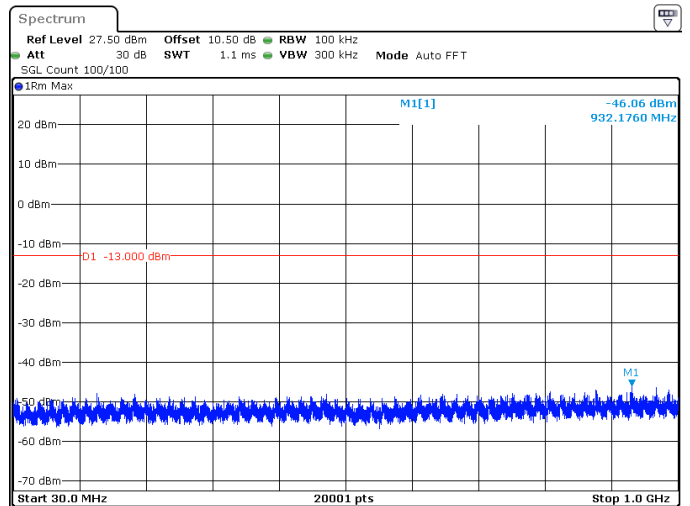


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:43:53

70MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.47 dBm

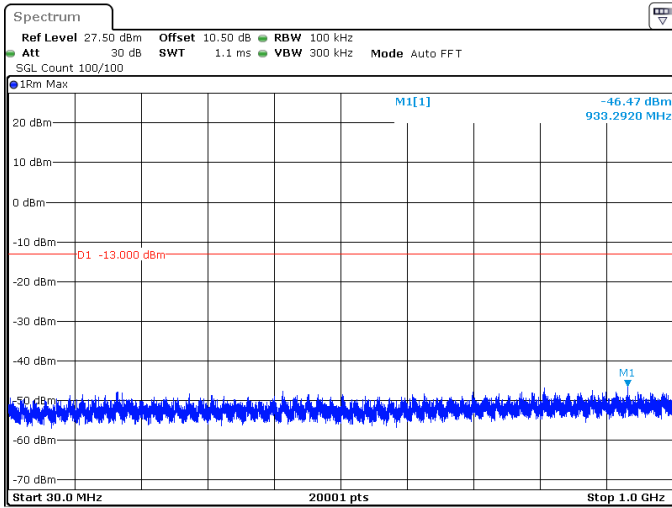


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:45:42

70MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -38.01 dBm

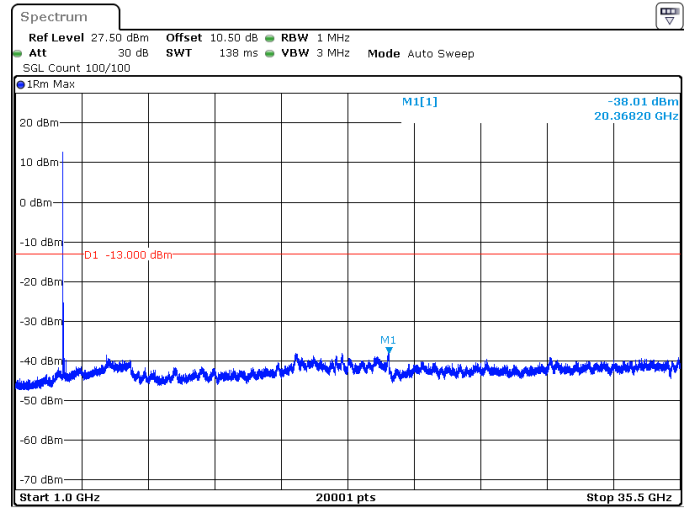


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:46:43

70MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@188 -46.72 dBm

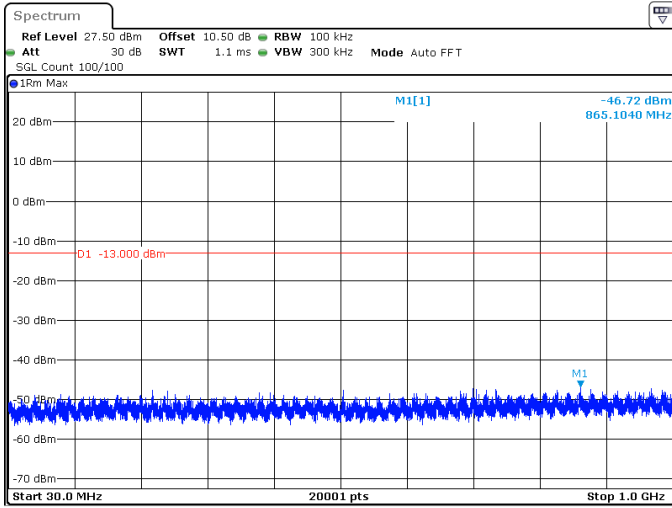


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:47:28

70MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@188 -37.61 dBm

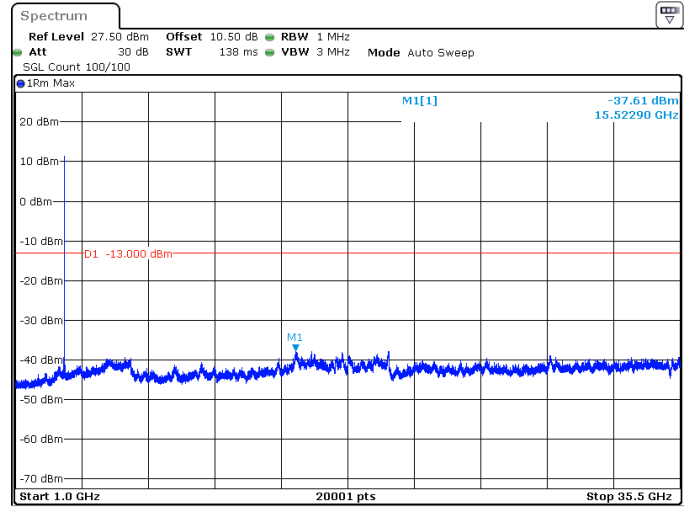


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:48:29

70MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB180@0 -37.63 dBm

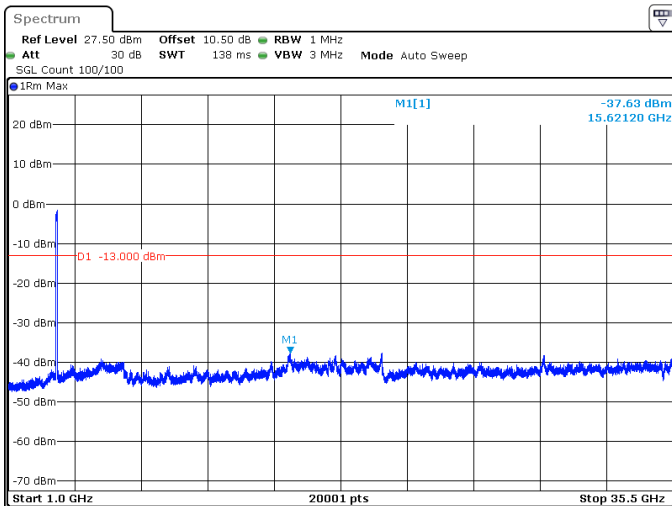


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:50:12

70MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB180@0 -46.98 dBm

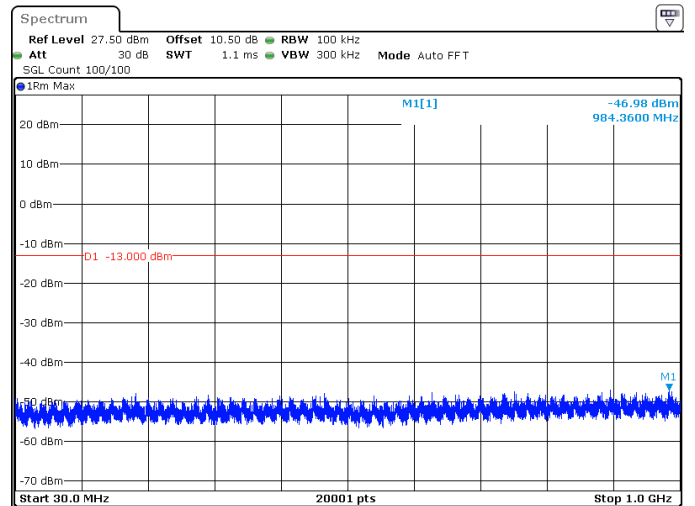


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:49:13

70MHz_30kHz_3515MHz_DFT-s-OFDM QPSK_RB1@0 -37.24 dBm

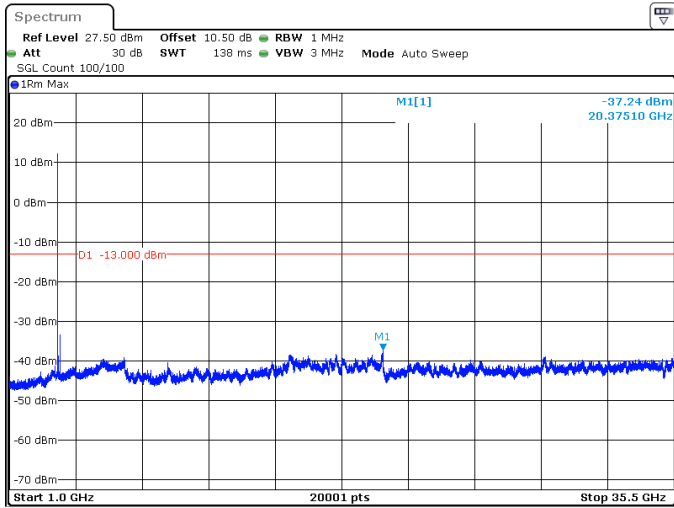


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:51:50

70MHz_30kHz_3515MHz_DFT-s-OFDM QPSK_RB1@0 -45.59 dBm

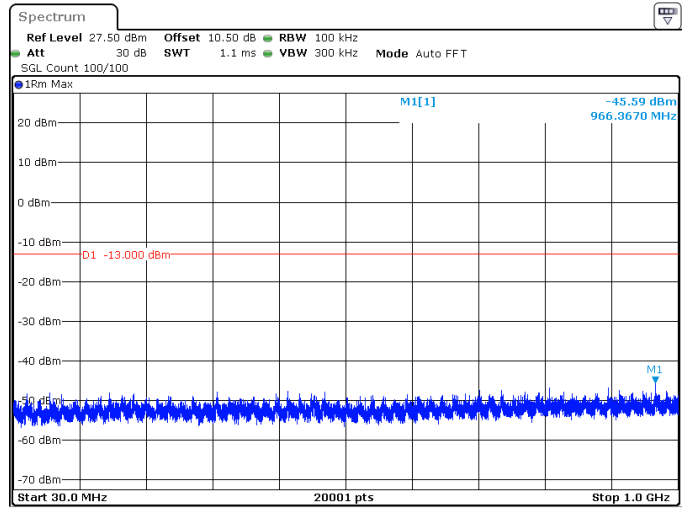


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:50:50

70MHz_30kHz_3515MHz_DFT-s-OFDM QPSK_RB1@188 -37.72 dBm

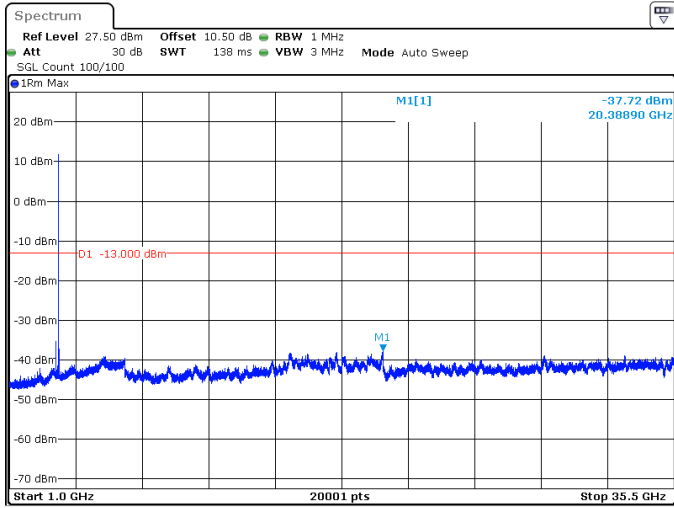


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:53:25

70MHz_30kHz_3515MHz_DFT-s-OFDM QPSK_RB1@188 -47.06 dBm

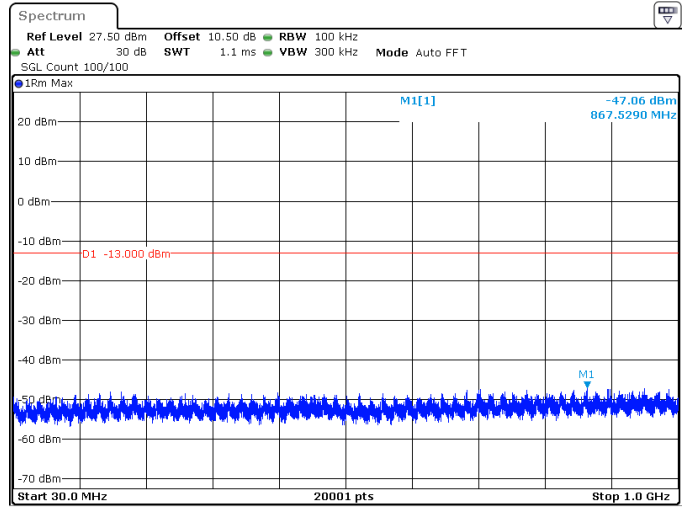


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:52:26

70MHz_30kHz_3515MHz_DFT-s-OFDM QPSK_RB180@0 -37.20 dBm

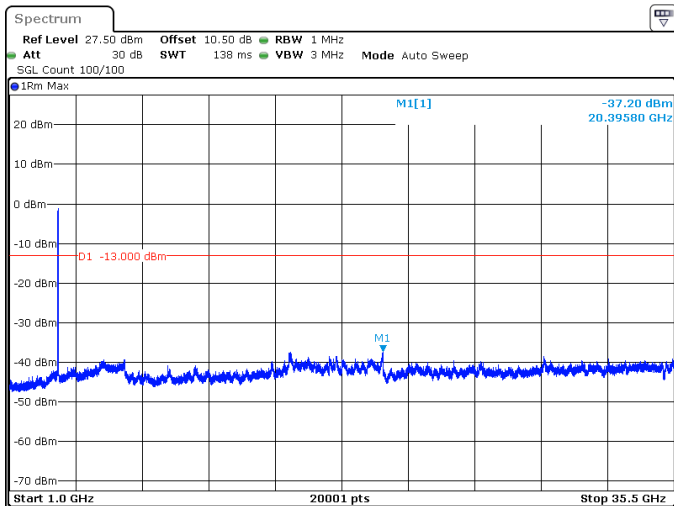


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:54:59

70MHz_30kHz_3515MHz_DFT-s-OFDM QPSK_RB180@0 -46.41 dBm

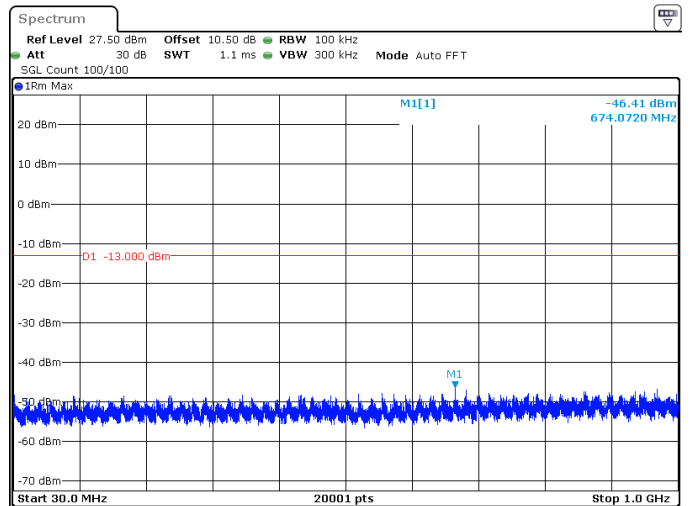


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:54:01

80MHz_30kHz_3490MHz_DFT-s-OFDM QPSK_RB1@0 -47.19 dBm

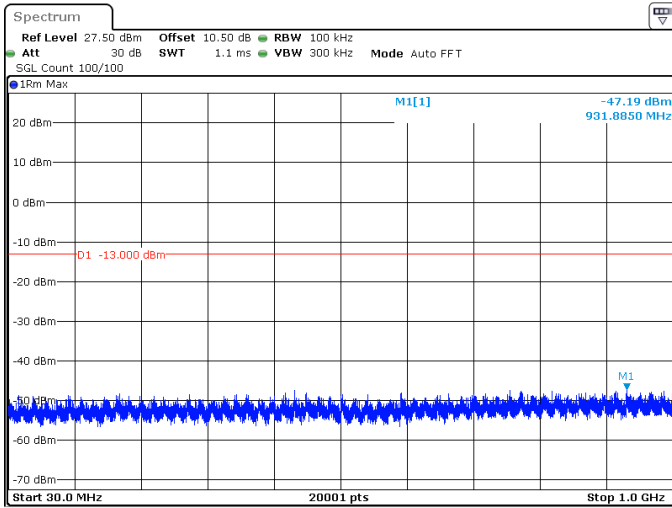


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:55:41

80MHz_30kHz_3490MHz_DFT-s-OFDM QPSK_RB1@0 -37.74 dBm

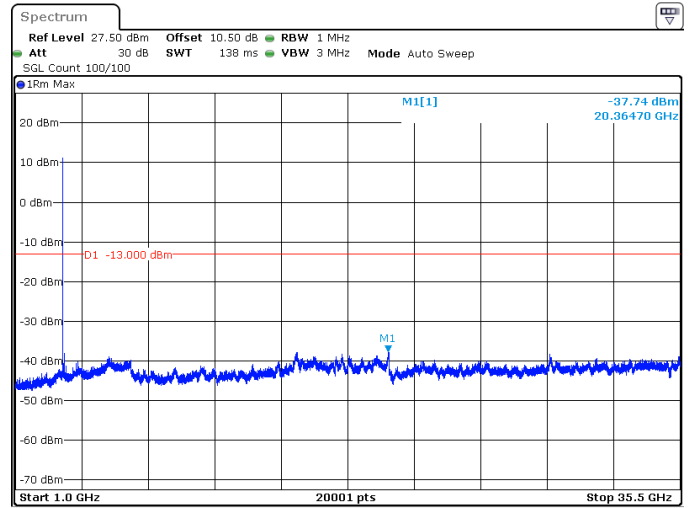


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:56:40

80MHz_30kHz_3490MHz_DFT-s-OFDM QPSK_RB1@216 -37.84 dBm

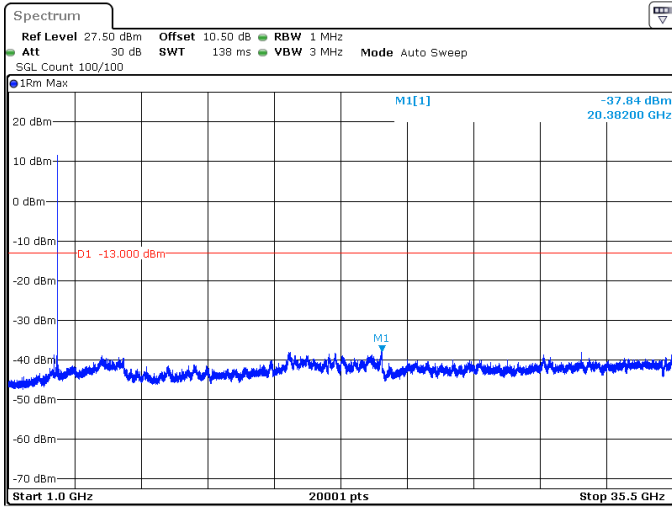


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:58:16

80MHz_30kHz_3490MHz_DFT-s-OFDM QPSK_RB1@216 -46.47 dBm

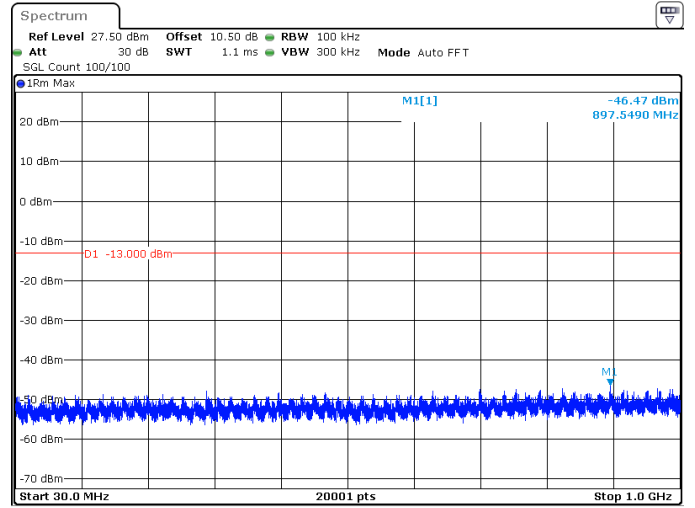


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:57:18

80MHz_30kHz_3490MHz_DFT-s-OFDM QPSK_RB216@0 -37.60 dBm

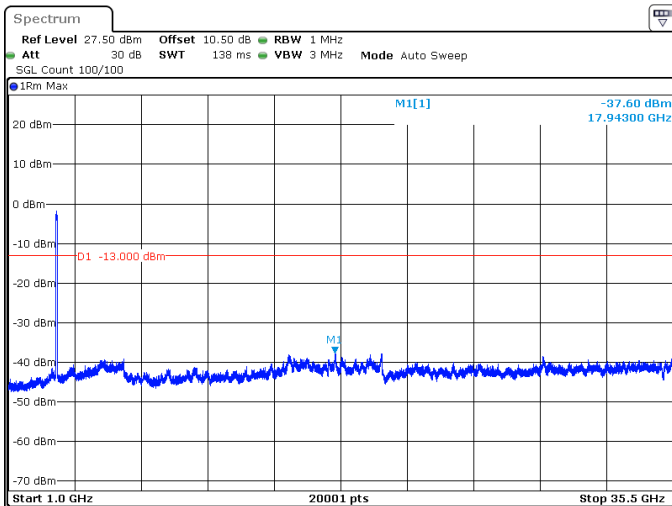


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:59:50

80MHz_30kHz_3490MHz_DFT-s-OFDM QPSK_RB216@0 -46.20 dBm

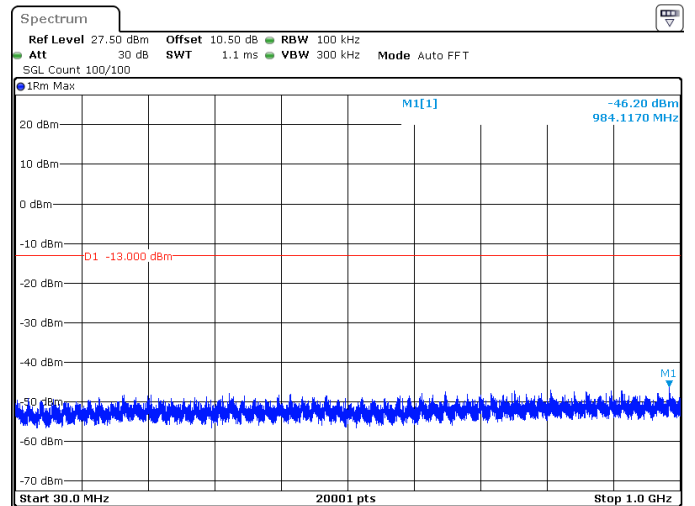


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 14:58:52

80MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.56 dBm

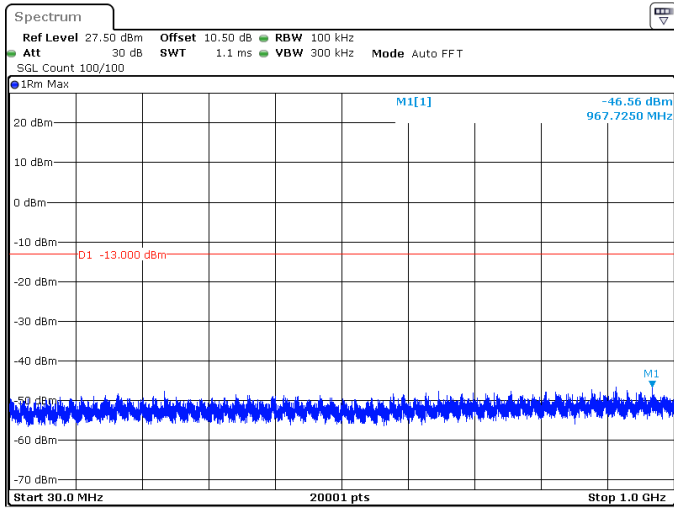


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:00:28

80MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.54 dBm

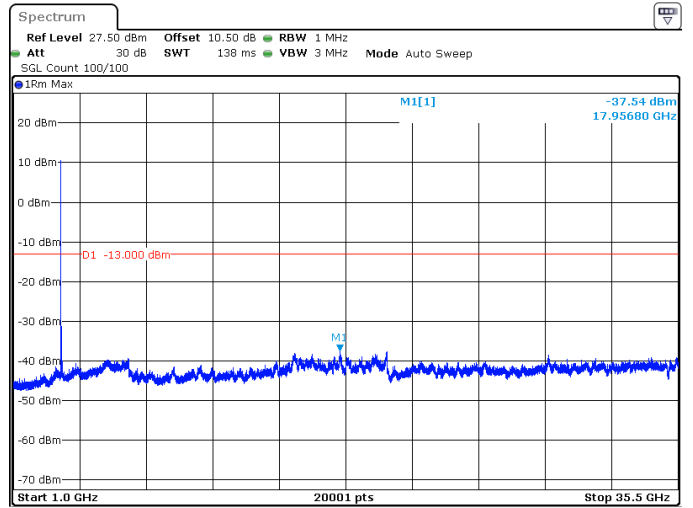


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:01:27

80MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@216 -46.38 dBm

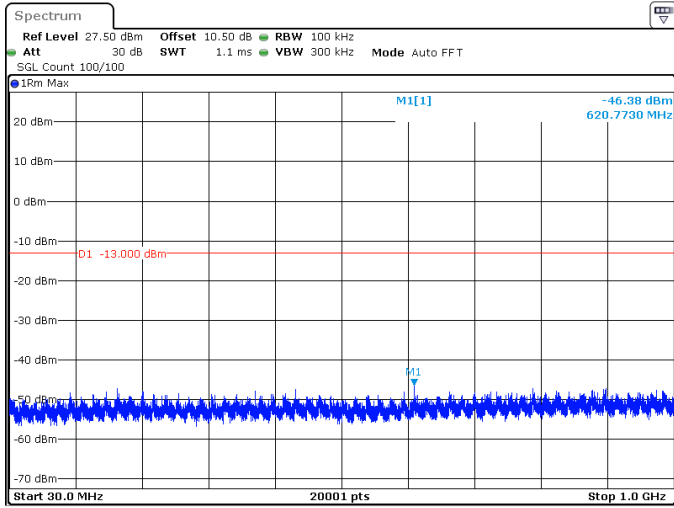


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:02:03

80MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@216 -37.84 dBm

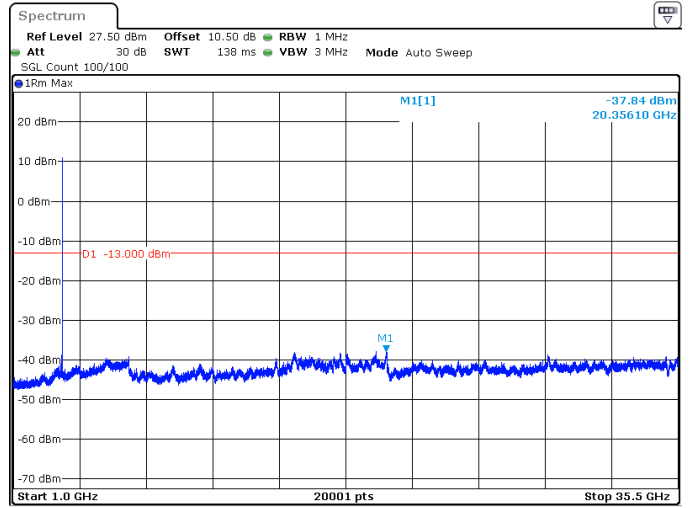


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:03:01

80MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB216@0 -37.59 dBm

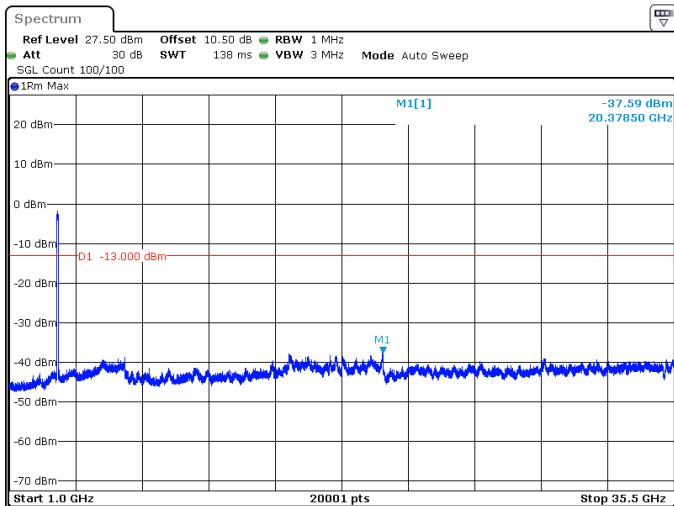


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:04:34

80MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB216@0 -46.02 dBm

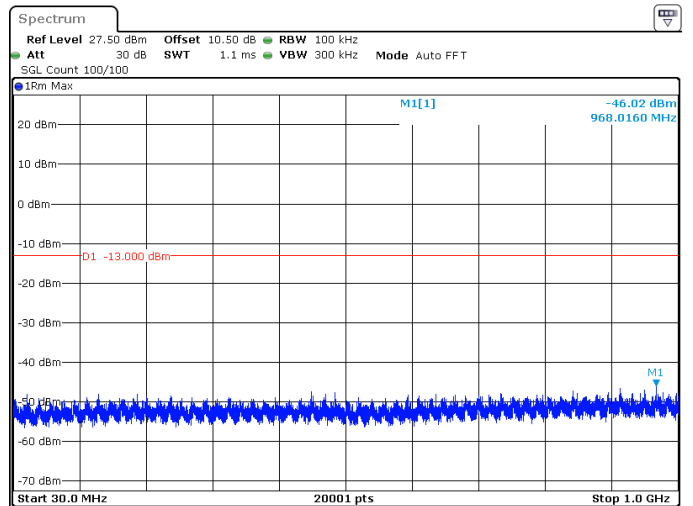


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:03:36

80MHz_30kHz_3510MHz_DFT-s-OFDM QPSK_RB1@0 -37.59 dBm

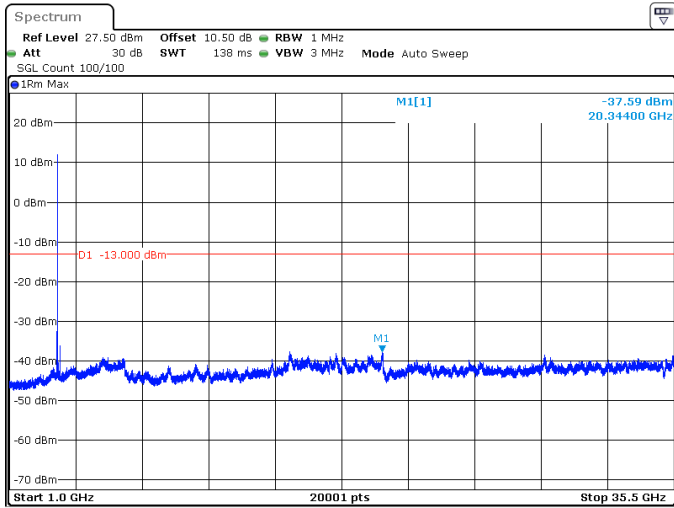


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:06:11

80MHz_30kHz_3510MHz_DFT-s-OFDM QPSK_RB1@0 -46.86 dBm

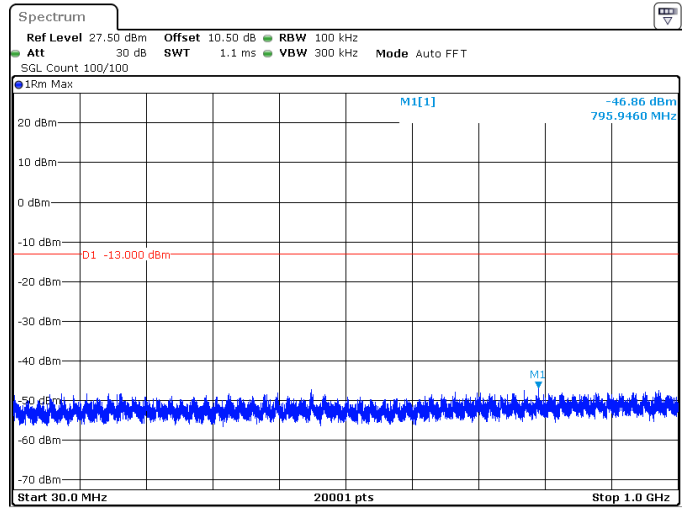


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:05:12

80MHz_30kHz_3510MHz_DFT-s-OFDM QPSK_RB1@216 -37.68 dBm

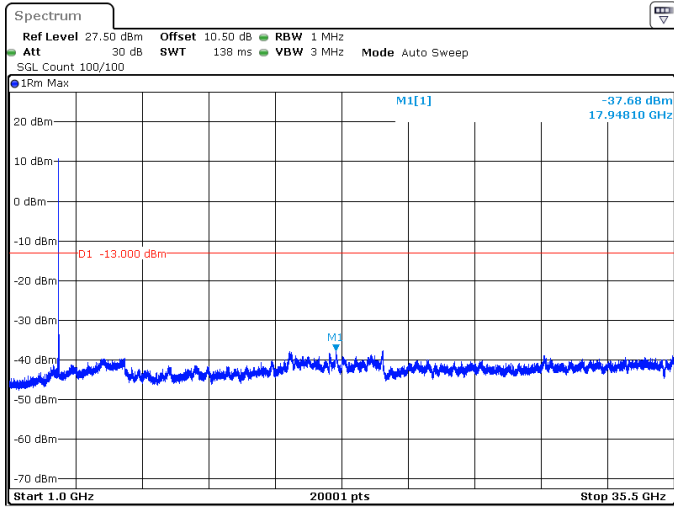


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:07:45

80MHz_30kHz_3510MHz_DFT-s-OFDM QPSK_RB1@216 -46.18 dBm

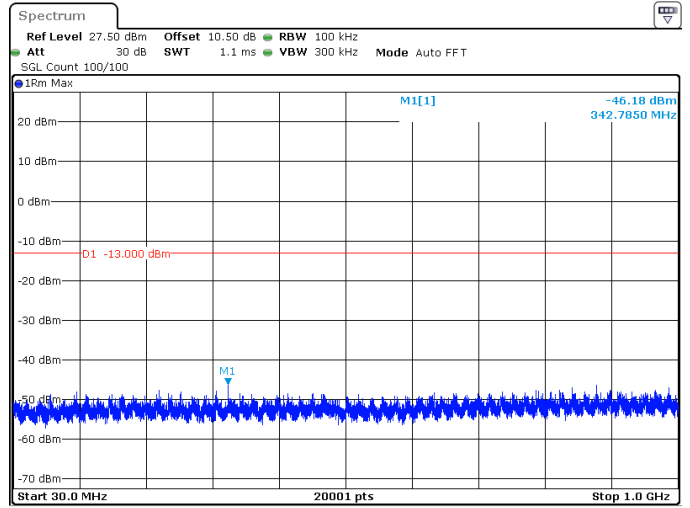


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:06:46

80MHz_30kHz_3510MHz_DFT-s-OFDM QPSK_RB216@0 -47.27 dBm

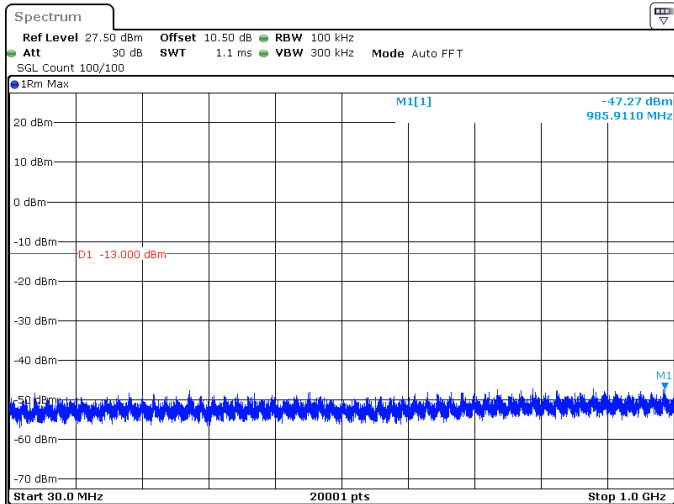


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:08:20

80MHz_30kHz_3510MHz_DFT-s-OFDM QPSK_RB216@0 -37.26 dBm

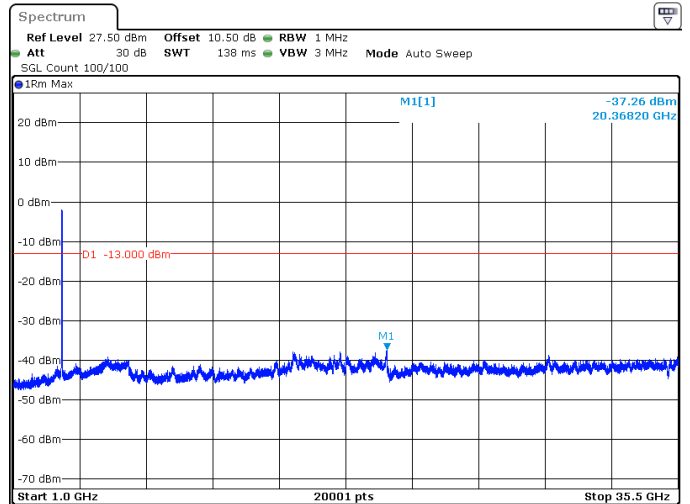


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:09:18

90MHz_30kHz_3495MHz_DFT-s-OFDM QPSK_RB1@0 -47.10 dBm

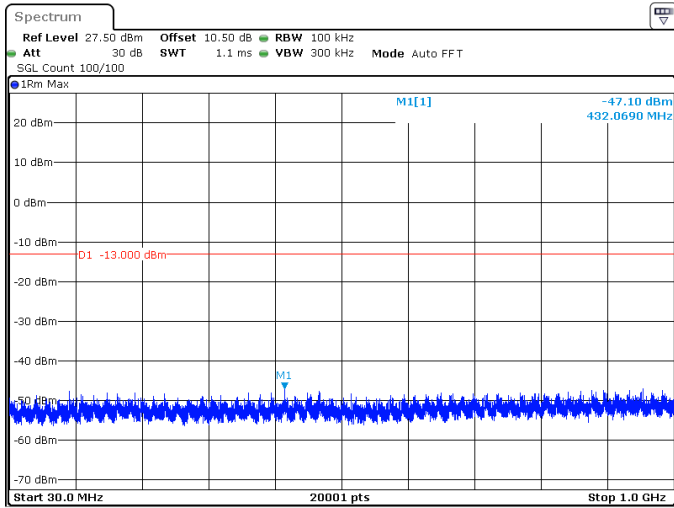


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:09:58

90MHz_30kHz_3495MHz_DFT-s-OFDM QPSK_RB1@0 -37.42 dBm

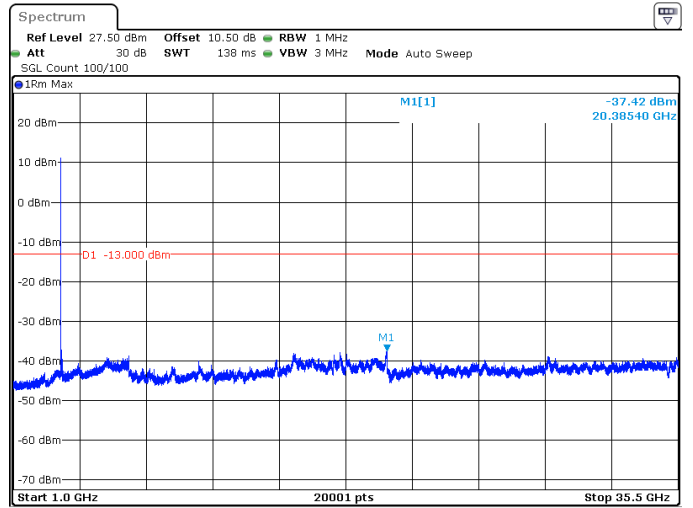


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:10:57

90MHz_30kHz_3495MHz_DFT-s-OFDM QPSK_RB1@244 -37.34 dBm

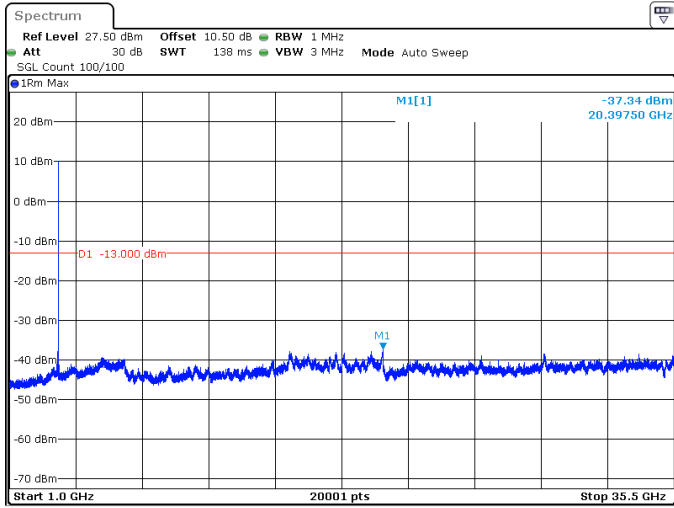


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:12:31

90MHz_30kHz_3495MHz_DFT-s-OFDM QPSK_RB1@244 -45.78 dBm

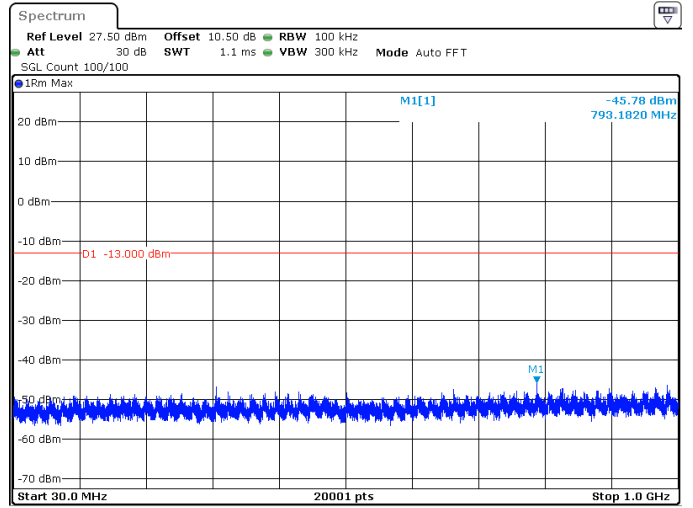


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:11:33

90MHz_30kHz_3495MHz_DFT-s-OFDM QPSK_RB243@0 -37.31 dBm

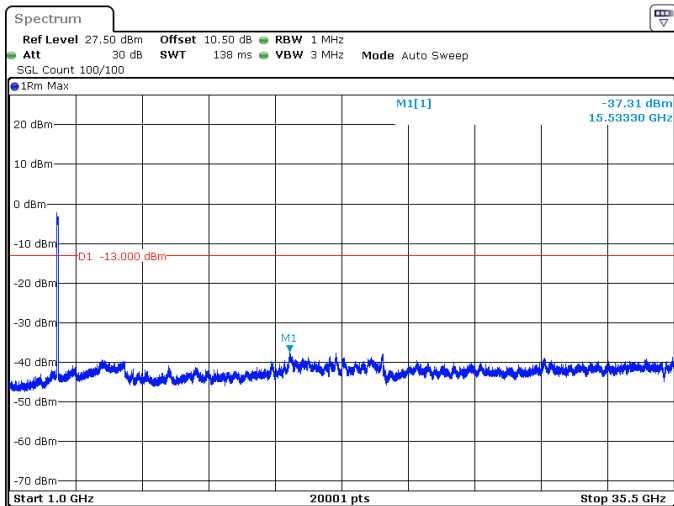


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:14:05

90MHz_30kHz_3495MHz_DFT-s-OFDM QPSK_RB243@0 -47.06 dBm

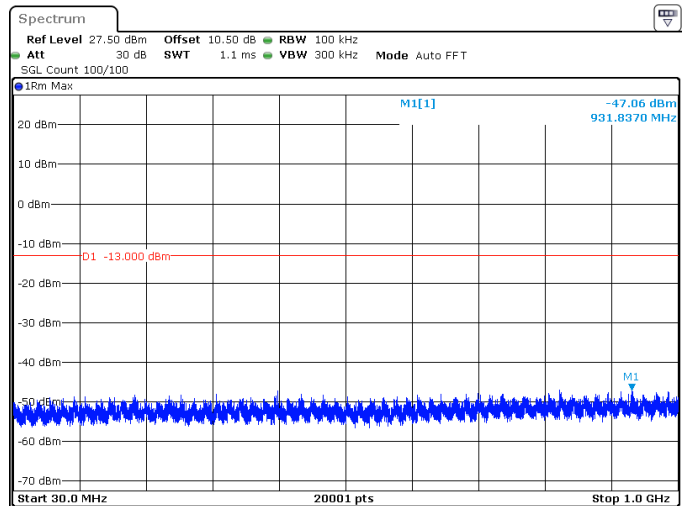


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:13:07

90MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.33 dBm

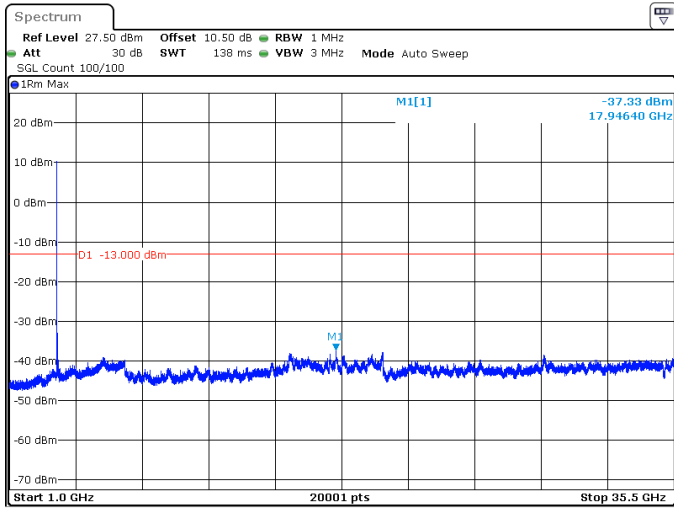


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:15:41

90MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -46.77 dBm

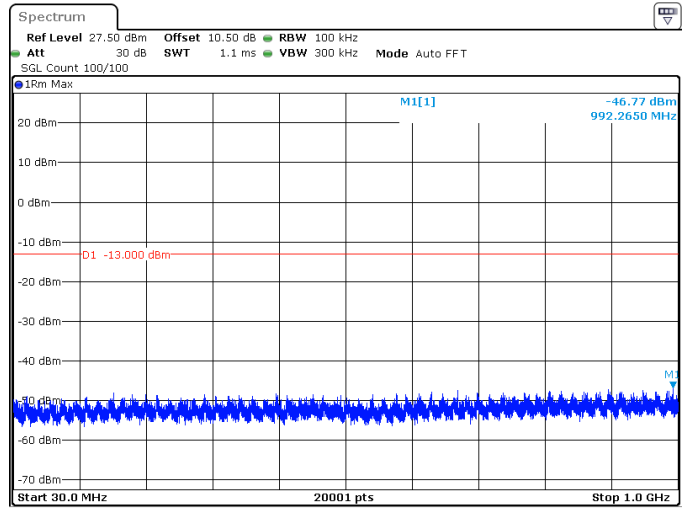


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:14:43

90MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@244 -37.64 dBm

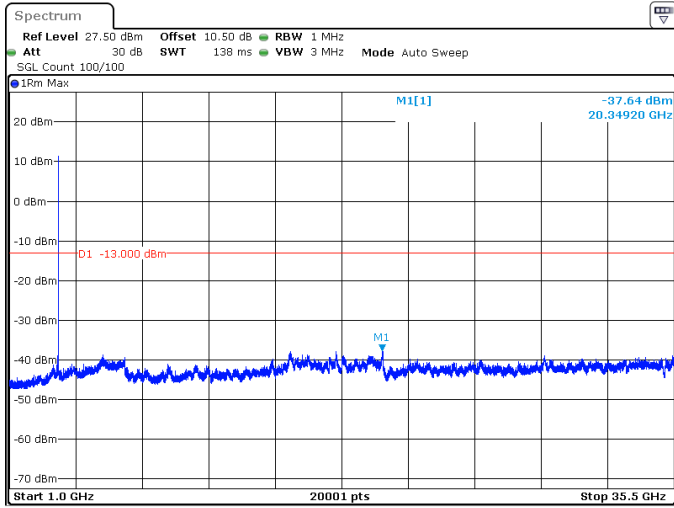


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:17:15

90MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@244 -46.85 dBm

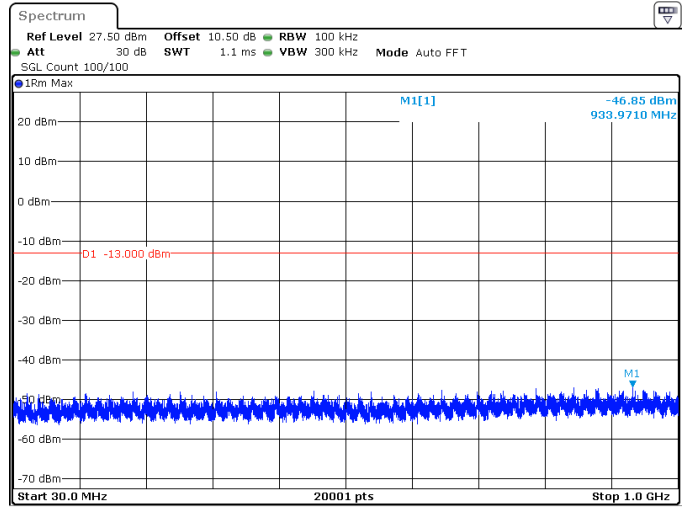


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:16:17

90MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB243@0 -36.90 dBm

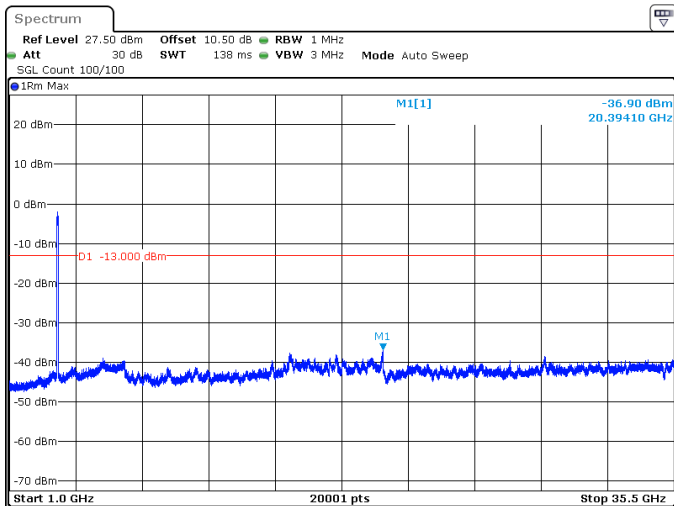


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:18:48

90MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB243@0 -45.81 dBm

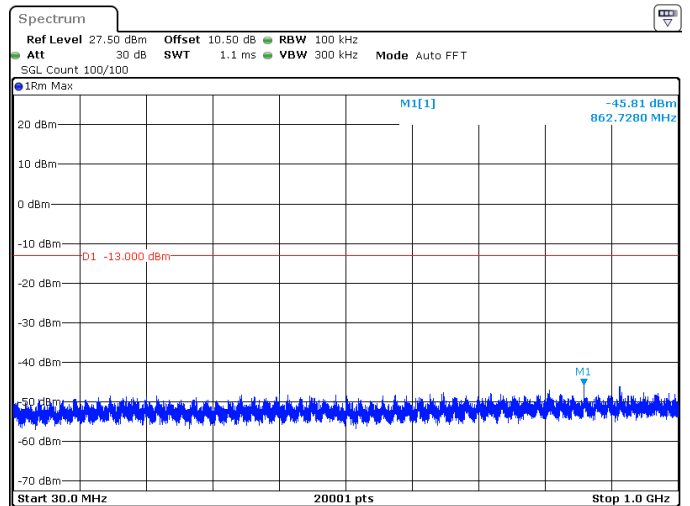


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:17:50

90MHz_30kHz_3505MHz_DFT-s-OFDM QPSK_RB1@0 -45.98 dBm

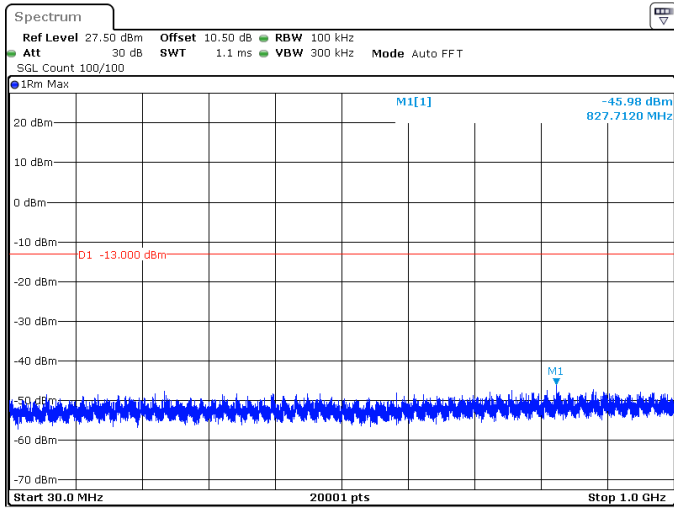


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:19:27

90MHz_30kHz_3505MHz_DFT-s-OFDM QPSK_RB1@0 -37.17 dBm

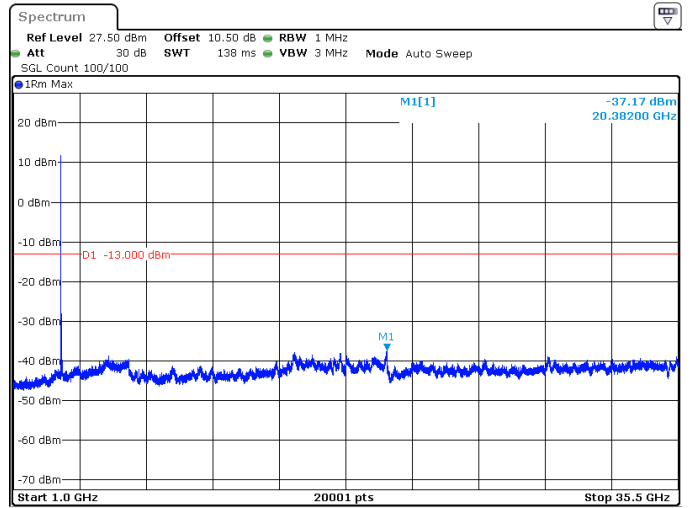


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:20:25

90MHz_30kHz_3505MHz_DFT-s-OFDM QPSK_RB1@244 -46.96 dBm

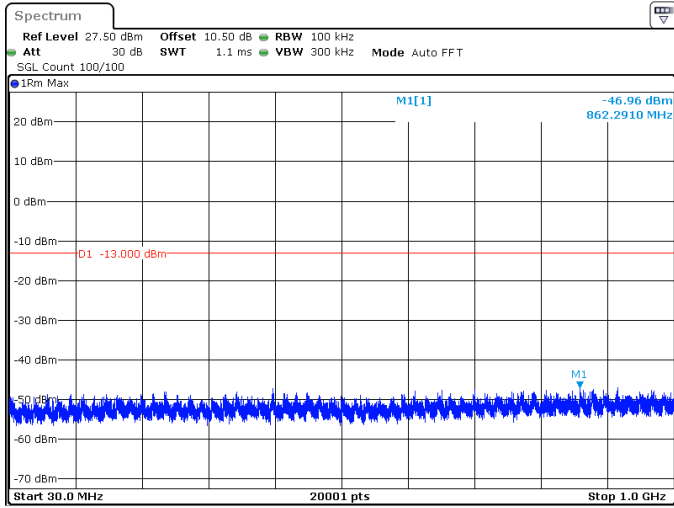


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:21:00

90MHz_30kHz_3505MHz_DFT-s-OFDM QPSK_RB1@244 -37.22 dBm

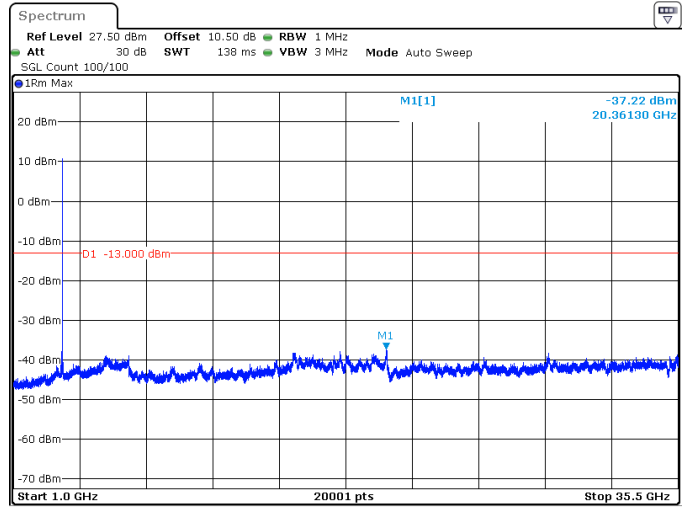


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:21:58

90MHz_30kHz_3505MHz_DFT-s-OFDM QPSK_RB243@0 -46.79 dBm

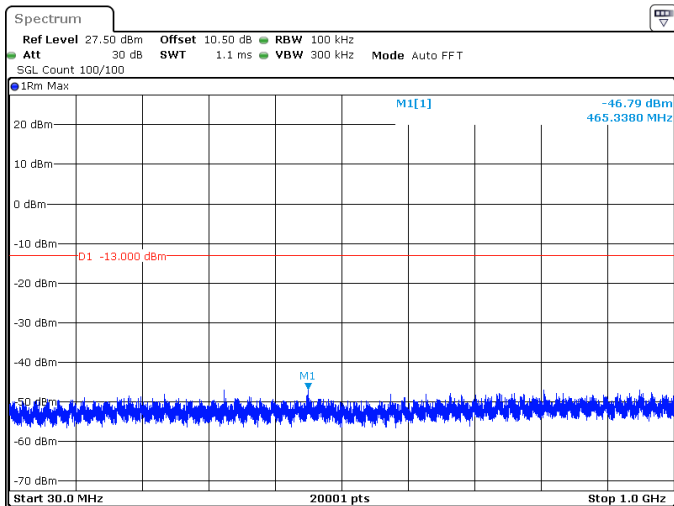


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:22:34

90MHz_30kHz_3505MHz_DFT-s-OFDM QPSK_RB243@0 -37.54 dBm

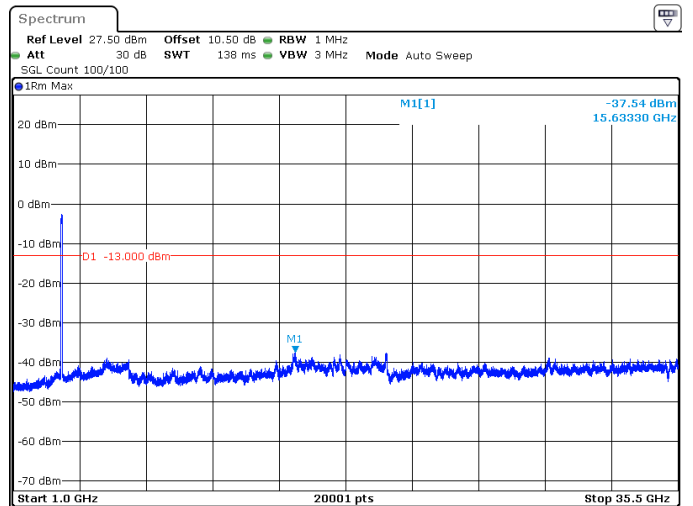


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:23:32

100MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -47.05 dBm

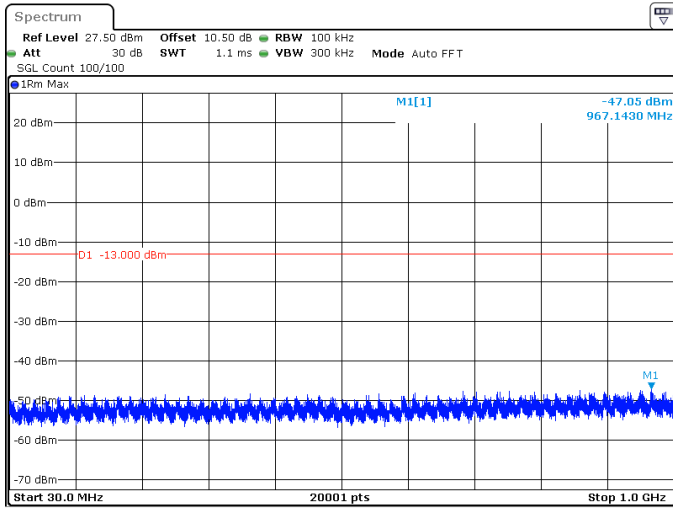


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:24:13

100MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@0 -37.70 dBm

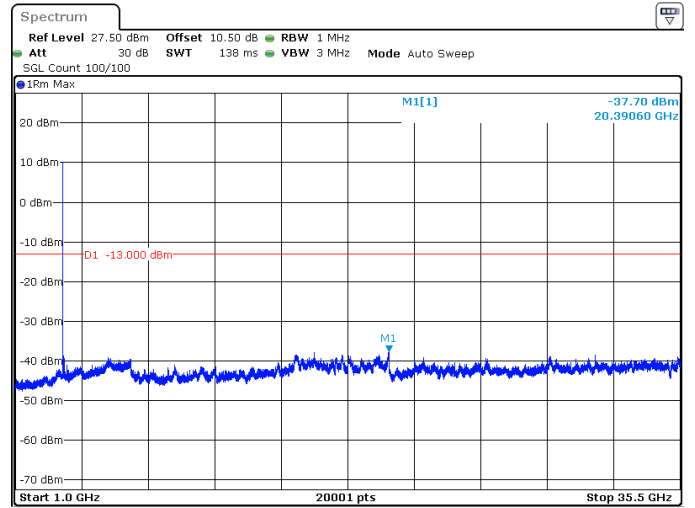


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:25:12

100MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@272 -47.24 dBm

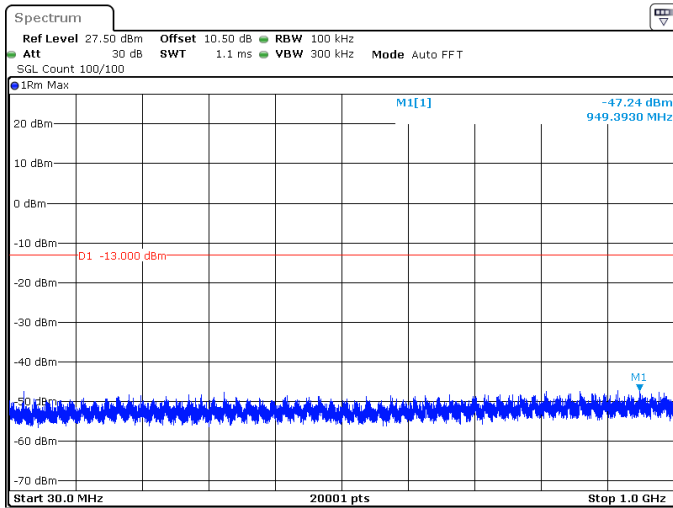


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:25:48

100MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB1@272 -37.44 dBm

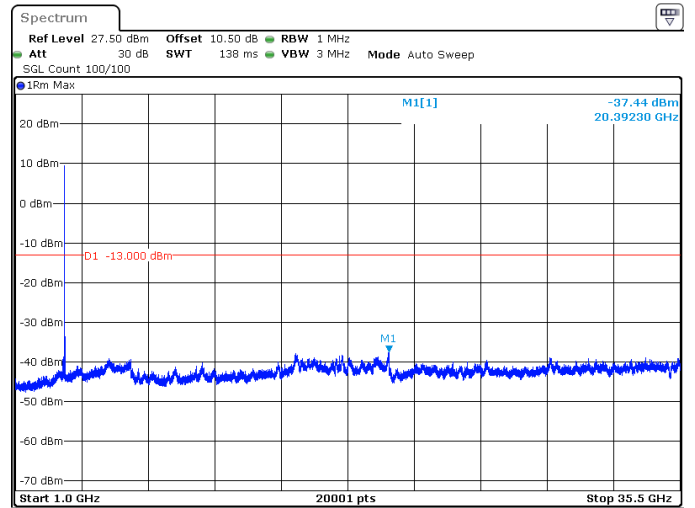


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:26:46

100MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB270@0 -46.84 dBm

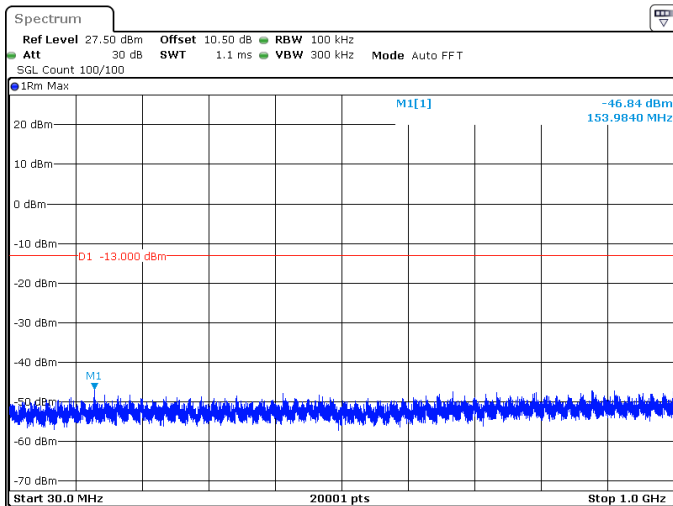

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:27:22


100MHz_30kHz_3500MHz_DFT-s-OFDM QPSK_RB270@0 -37.39 dBm

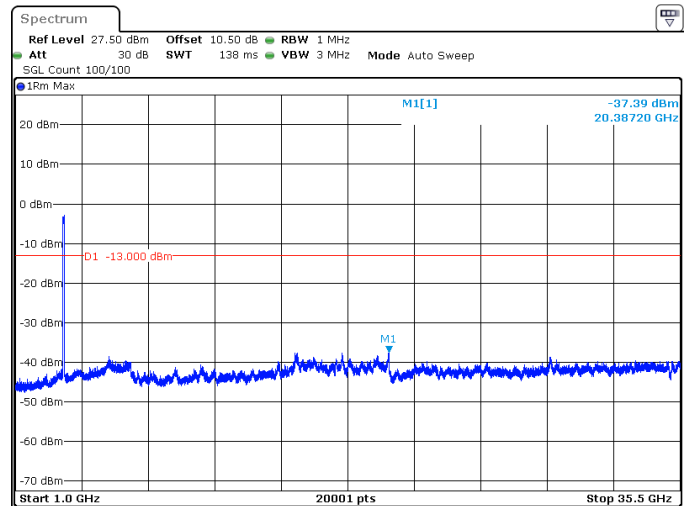

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 17.MAR.2024 15:28:20


n78_2

10MHz_15kHz_3705MHz_DFT-s-OFDM QPSK_RB1@0 -47.01 dBm

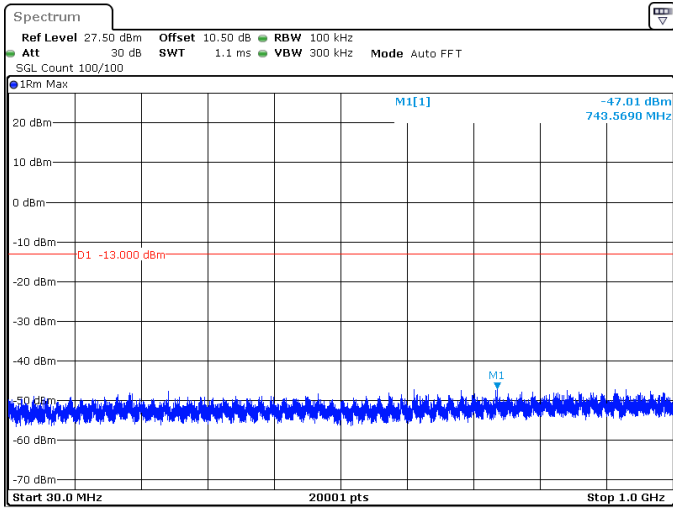


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:44:56

10MHz_15kHz_3705MHz_DFT-s-OFDM QPSK_RB1@0 -36.28 dBm

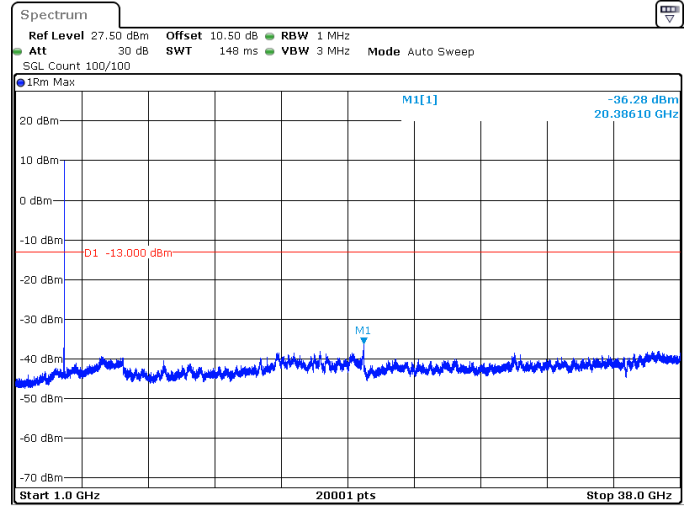


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:45:58

10MHz_15kHz_3705MHz_DFT-s-OFDM QPSK_RB1@51 -37.46 dBm

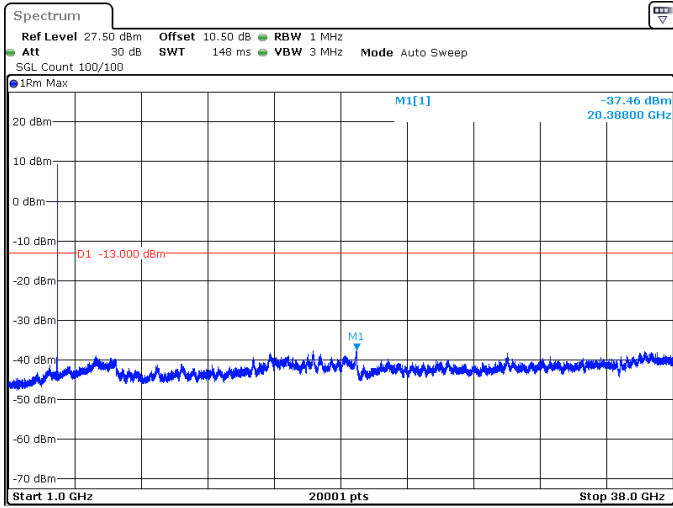


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:47:38

10MHz_15kHz_3705MHz_DFT-s-OFDM QPSK_RB1@51 -46.59 dBm

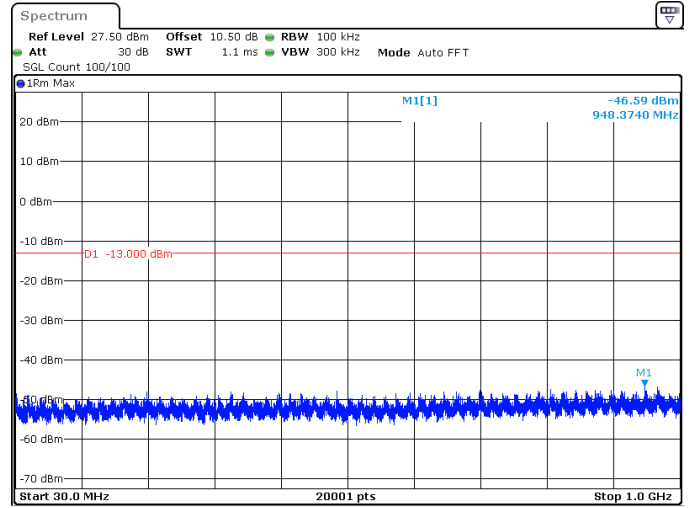


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:46:36

10MHz_15kHz_3705MHz_DFT-s-OFDM QPSK_RB50@0 -46.26 dBm

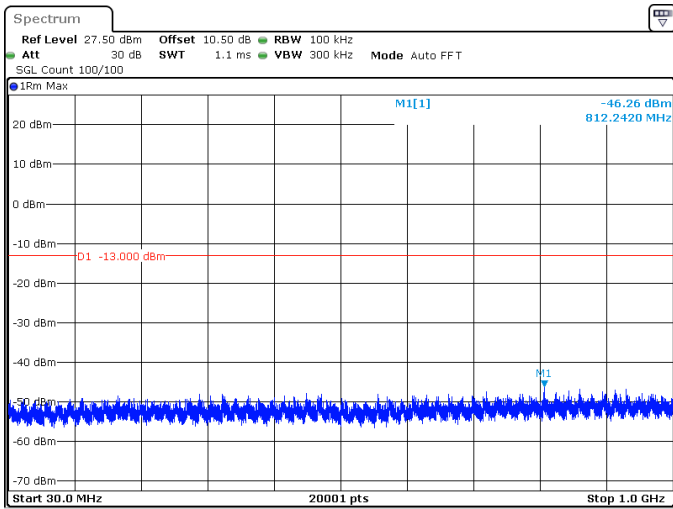


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:48:15

10MHz_15kHz_3705MHz_DFT-s-OFDM QPSK_RB50@0 -37.19 dBm

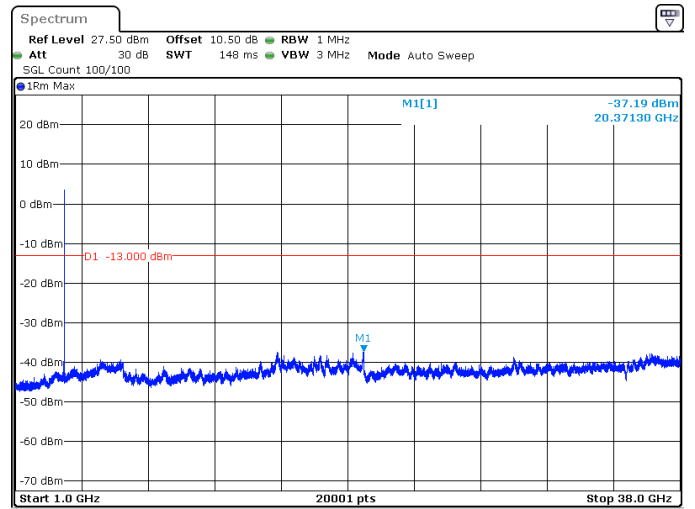


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:49:17

10MHz_15kHz_3750MHz_DFT-s-OFDM QPSK_RB1@0 -46.70 dBm

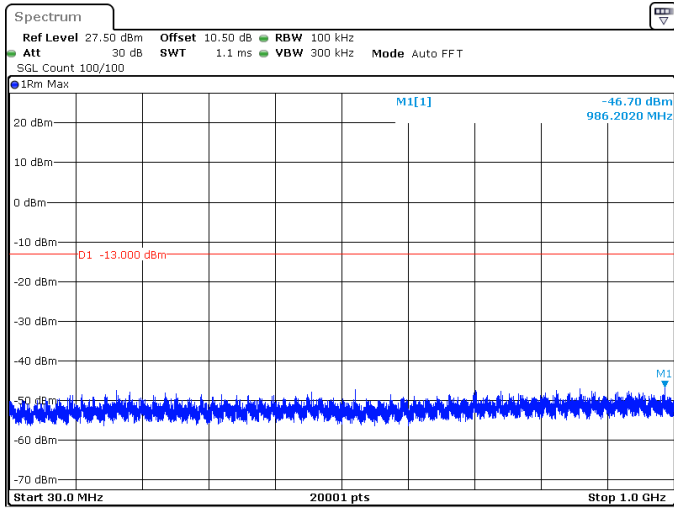


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:50:00

10MHz_15kHz_3750MHz_DFT-s-OFDM QPSK_RB1@0 -37.45 dBm

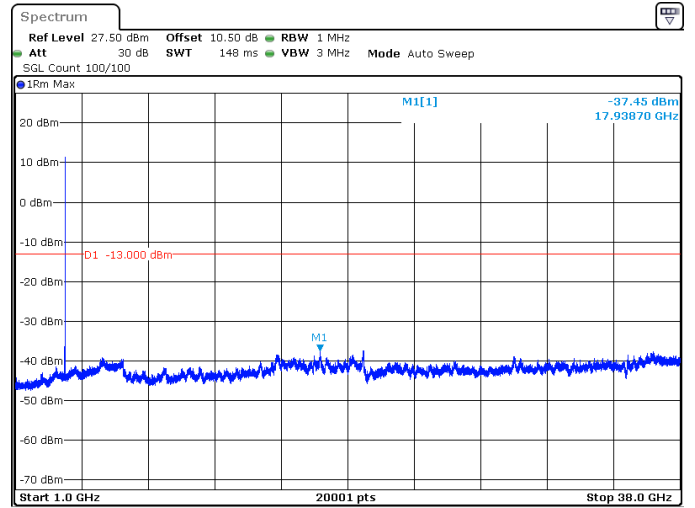


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:51:02

10MHz_15kHz_3750MHz_DFT-s-OFDM QPSK_RB1@51 -47.05 dBm

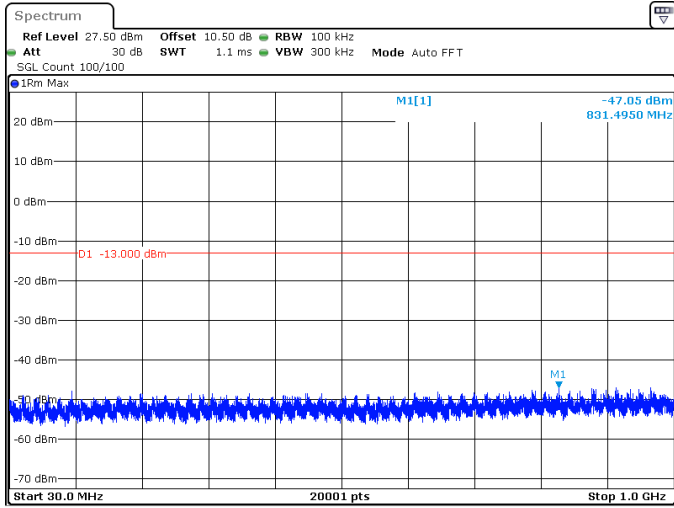


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:51:39

10MHz_15kHz_3750MHz_DFT-s-OFDM QPSK_RB1@51 -37.14 dBm

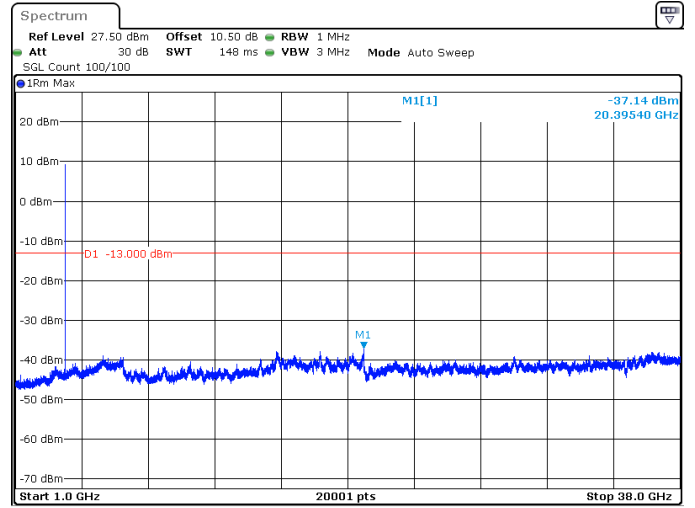


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:52:40

10MHz_15kHz_3750MHz_DFT-s-OFDM QPSK_RB50@0 -46.66 dBm

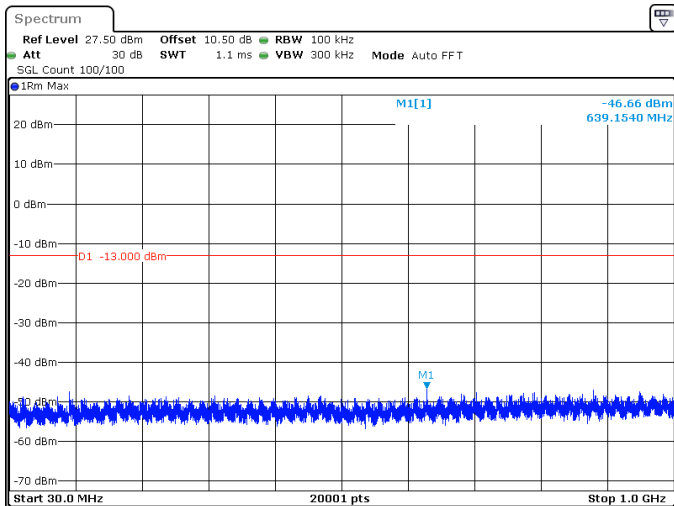


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:53:17

10MHz_15kHz_3750MHz_DFT-s-OFDM QPSK_RB50@0 -37.34 dBm

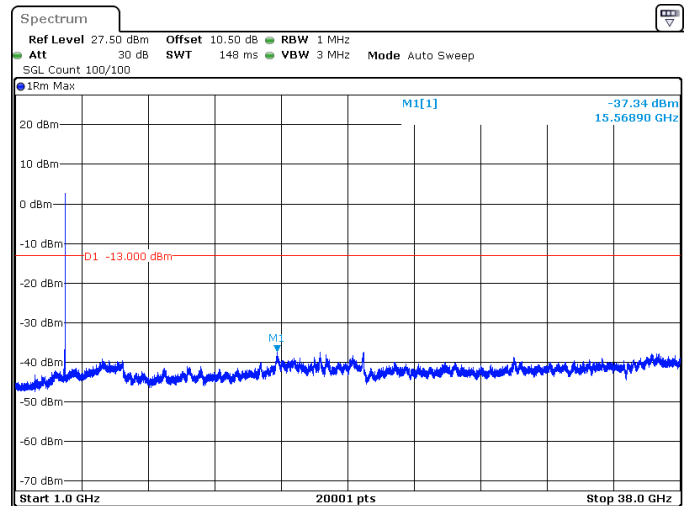


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:54:19

10MHz_15kHz_3795MHz_DFT-s-OFDM QPSK_RB1@0 -37.51 dBm

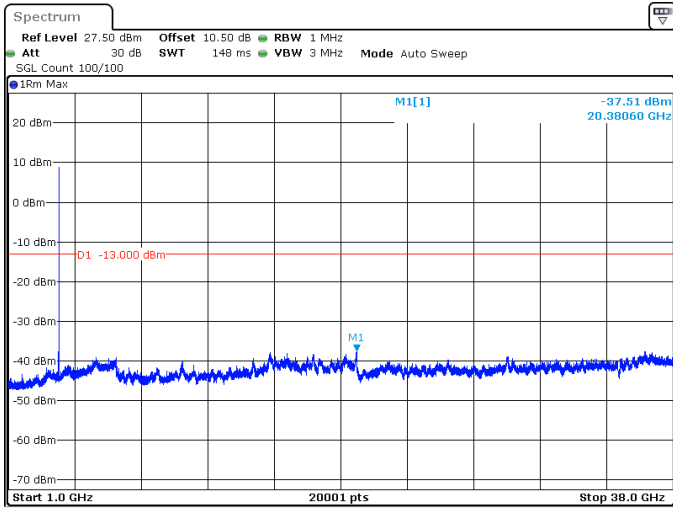


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:56:01

10MHz_15kHz_3795MHz_DFT-s-OFDM QPSK_RB1@0 -46.90 dBm

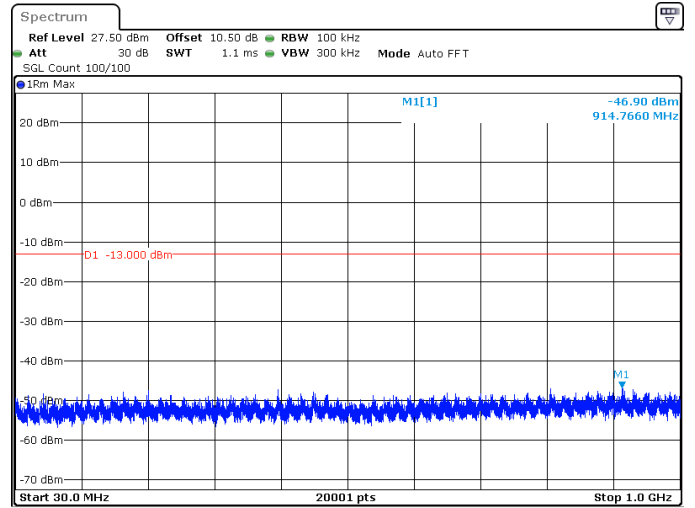


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:55:00

10MHz_15kHz_3795MHz_DFT-s-OFDM QPSK_RB1@51 -37.67 dBm

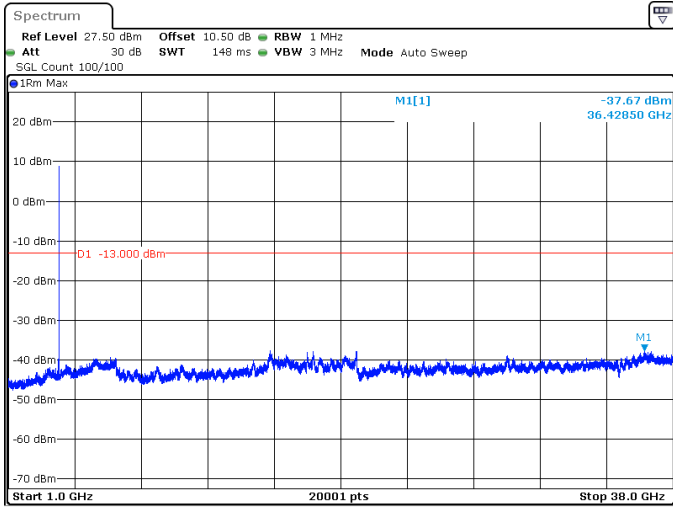


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:57:39

10MHz_15kHz_3795MHz_DFT-s-OFDM QPSK_RB1@51 -47.28 dBm

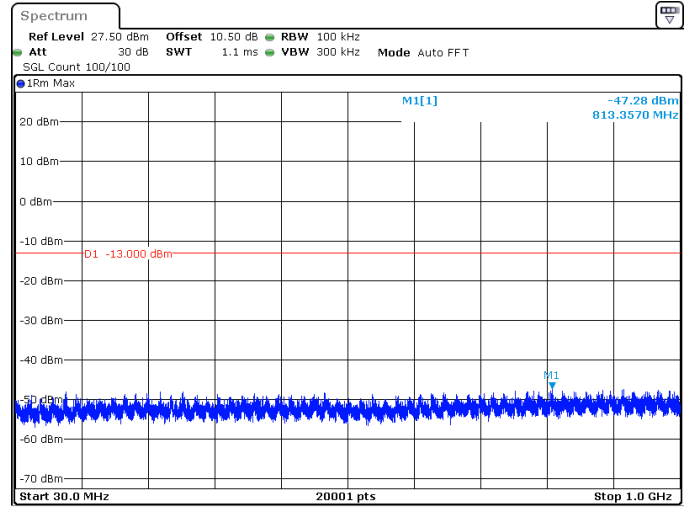


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:56:38

10MHz_15kHz_3795MHz_DFT-s-OFDM QPSK_RB50@0 -37.76 dBm

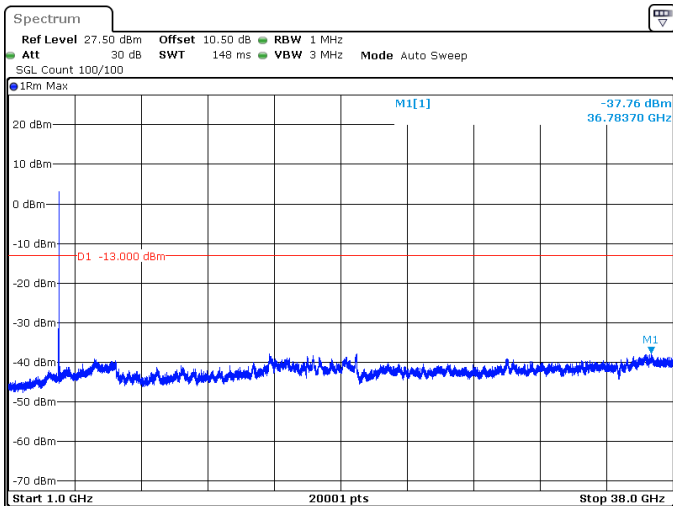


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:59:14

10MHz_15kHz_3795MHz_DFT-s-OFDM QPSK_RB50@0 -46.37 dBm

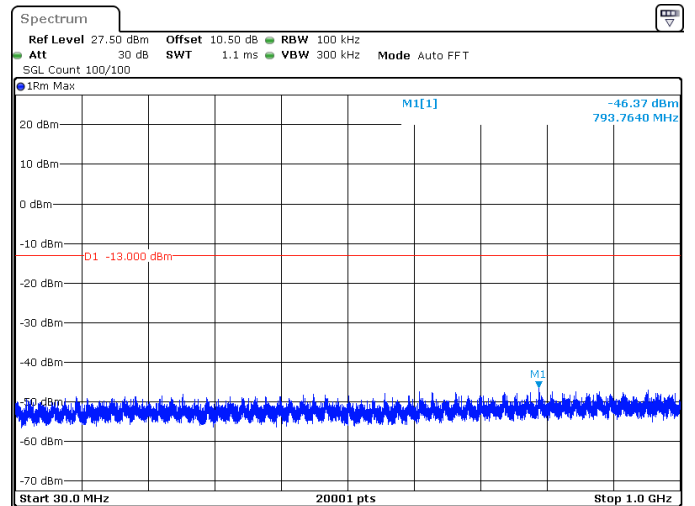


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:58:14

10MHz_30kHz_3705MHz_DFT-s-OFDM QPSK_RB1@0 -37.35 dBm

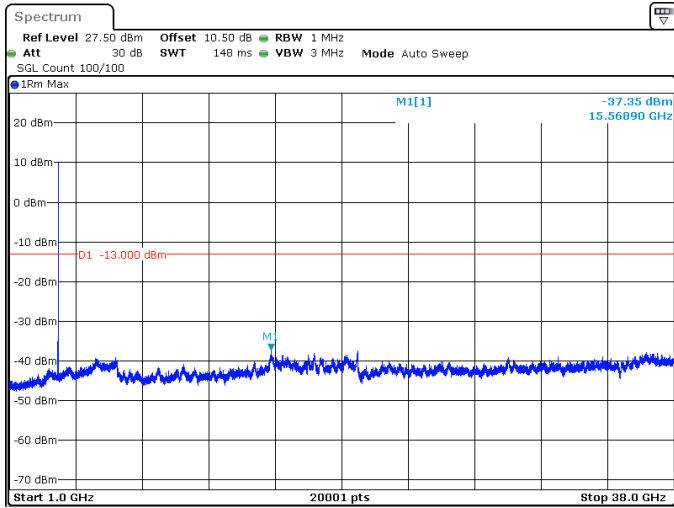


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 15:58:16

10MHz_30kHz_3705MHz_DFT-s-OFDM QPSK_RB1@0 -46.16 dBm

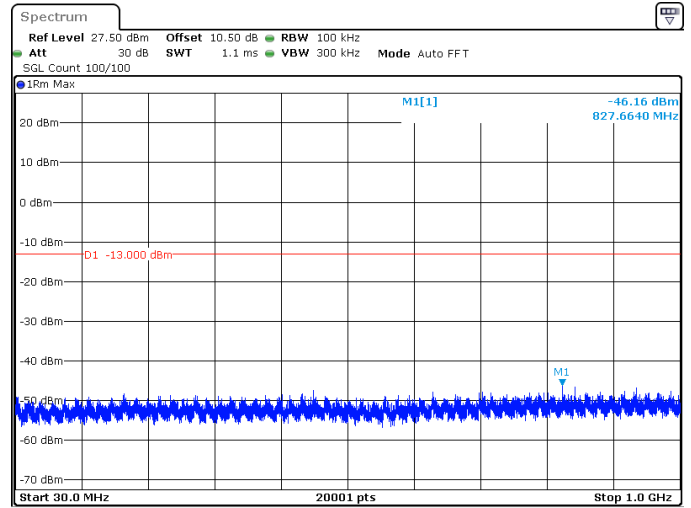


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 15:57:12

10MHz_30kHz_3705MHz_DFT-s-OFDM QPSK_RB1@23 -46.55 dBm

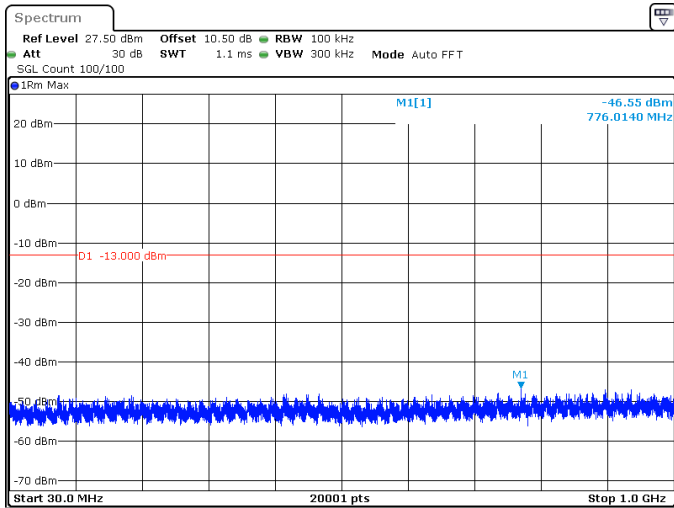


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:15:36

10MHz_30kHz_3705MHz_DFT-s-OFDM QPSK_RB1@23 -37.55 dBm

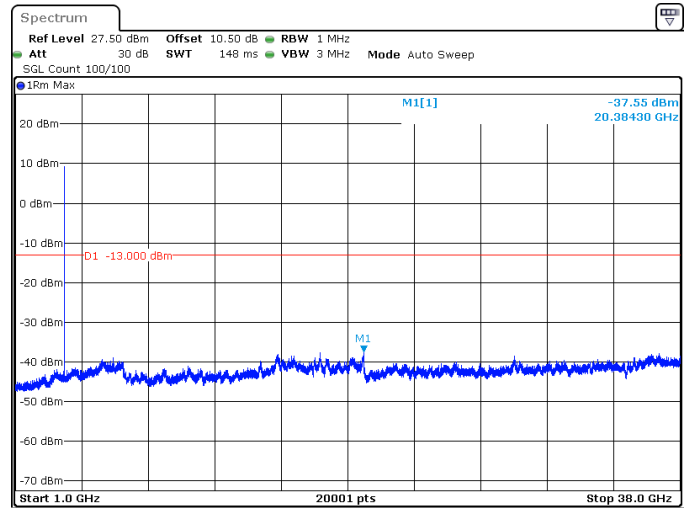


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:16:38

10MHz_30kHz_3705MHz_DFT-s-OFDM QPSK_RB24@0 -37.34 dBm

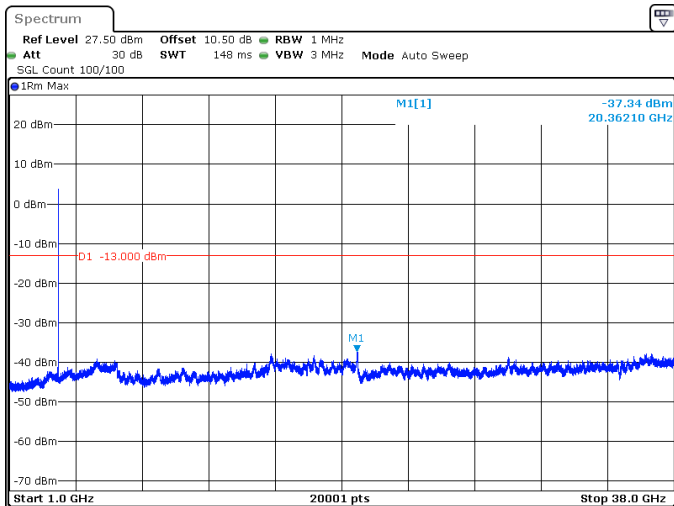


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:18:17

10MHz_30kHz_3705MHz_DFT-s-OFDM QPSK_RB24@0 -46.64 dBm

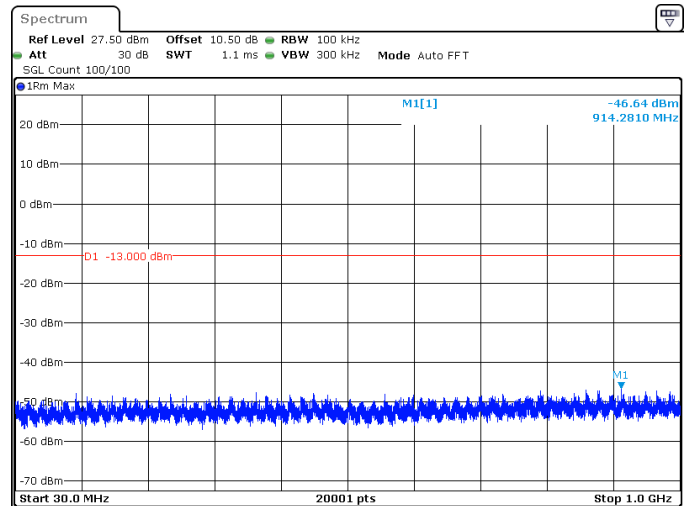


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:17:15

10MHz_30kHz_3750MHz_DFT-s-OFDM QPSK_RB1@0 -37.35 dBm

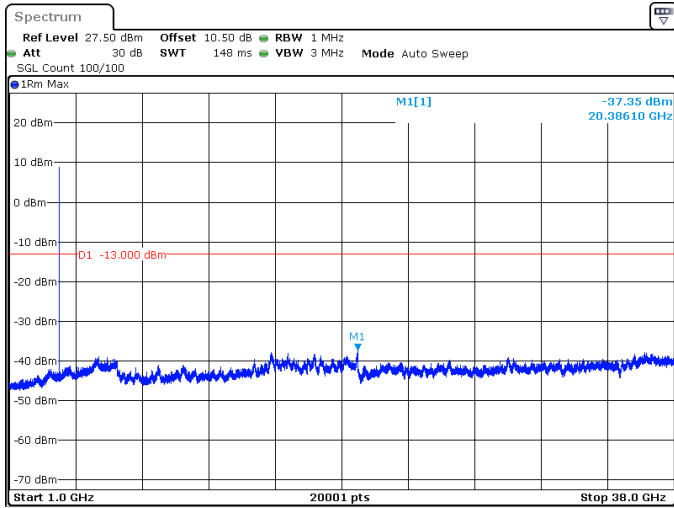


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:20:01

10MHz_30kHz_3750MHz_DFT-s-OFDM QPSK_RB1@0 -46.67 dBm

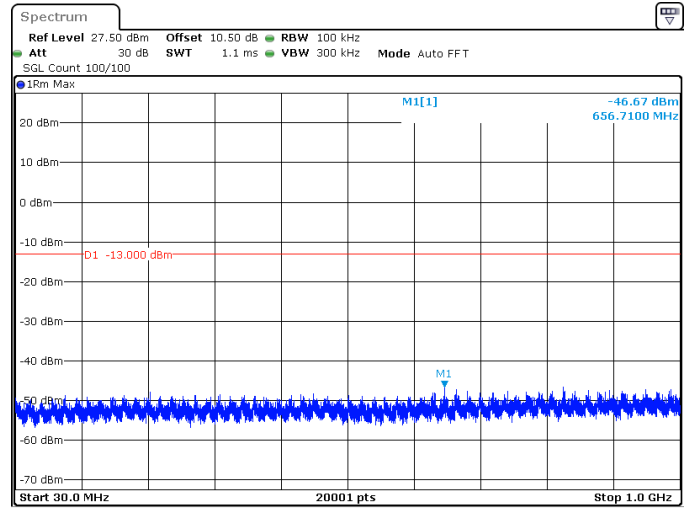


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:19:00

10MHz_30kHz_3750MHz_DFT-s-OFDM QPSK_RB1@23 -46.09 dBm

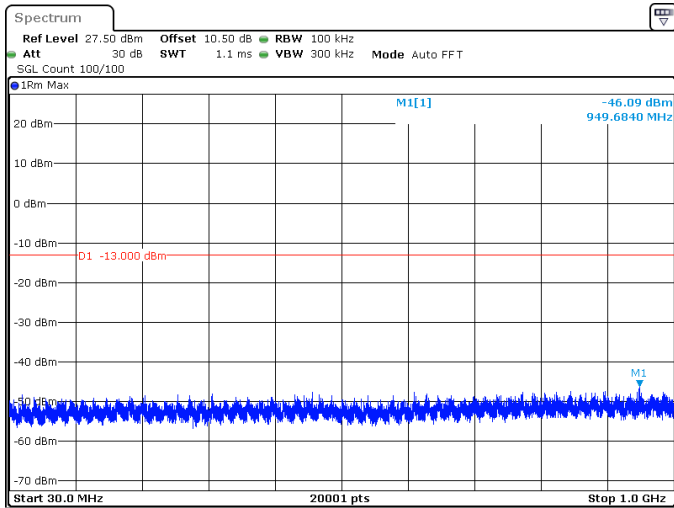


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:20:40

10MHz_30kHz_3750MHz_DFT-s-OFDM QPSK_RB1@23 -36.95 dBm

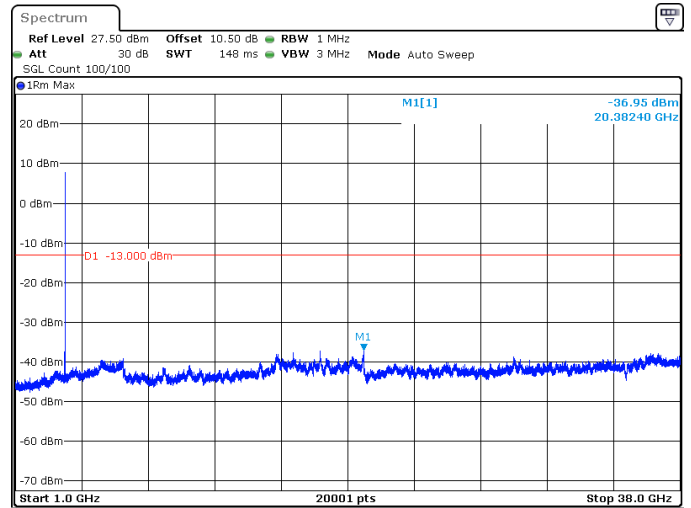


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:21:41

10MHz_30kHz_3750MHz_DFT-s-OFDM QPSK_RB24@0 -37.58 dBm

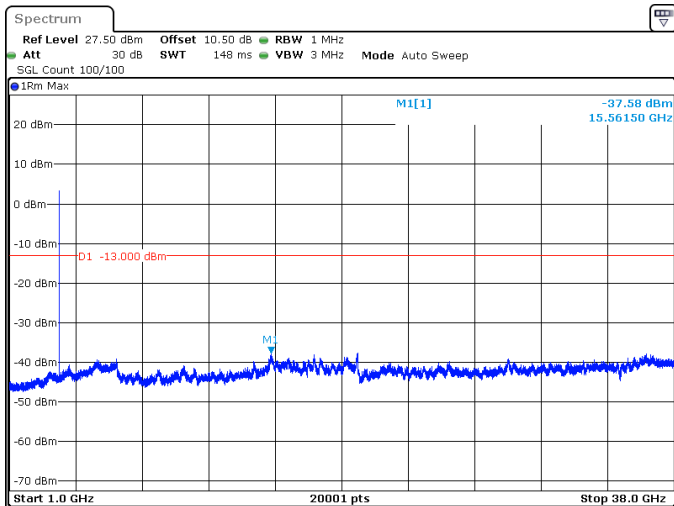


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:23:20

10MHz_30kHz_3750MHz_DFT-s-OFDM QPSK_RB24@0 -47.01 dBm

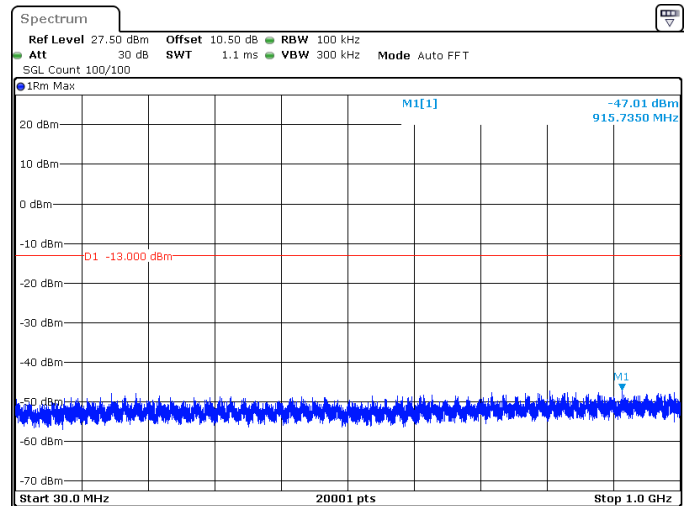


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:22:18

10MHz_30kHz_3795MHz_DFT-s-OFDM QPSK_RB1@0 -37.45 dBm

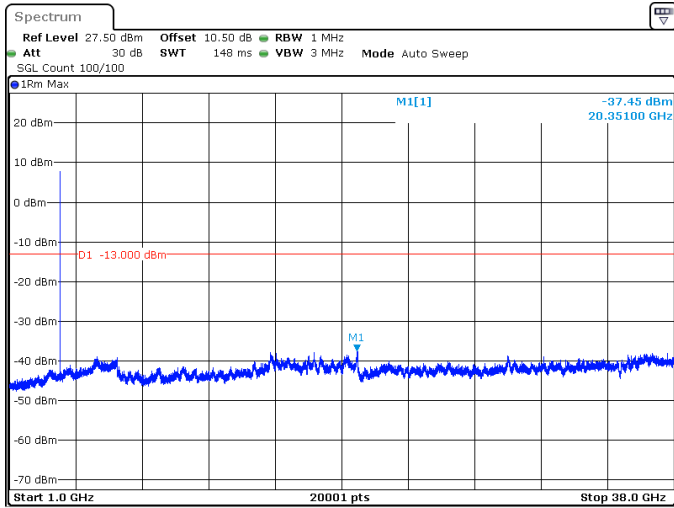


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:25:06

10MHz_30kHz_3795MHz_DFT-s-OFDM QPSK_RB1@0 -45.59 dBm

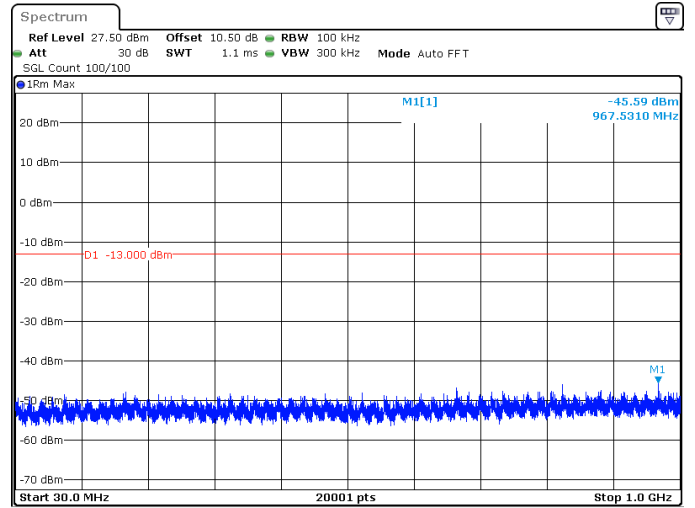


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:24:05

10MHz_30kHz_3795MHz_DFT-s-OFDM QPSK_RB1@23 -46.77 dBm

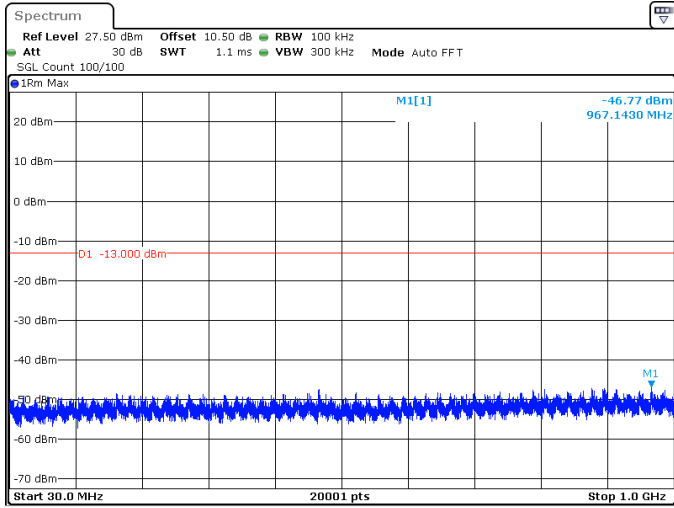


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:25:45

10MHz_30kHz_3795MHz_DFT-s-OFDM QPSK_RB1@23 -37.65 dBm

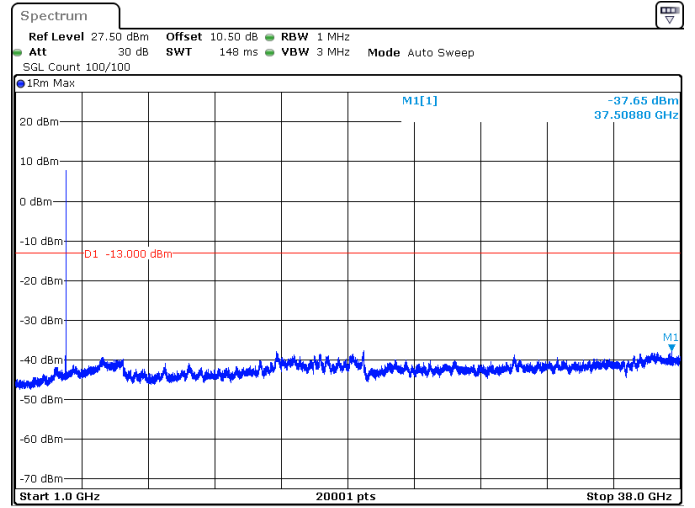


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:26:47

10MHz_30kHz_3795MHz_DFT-s-OFDM QPSK_RB24@0 -46.09 dBm

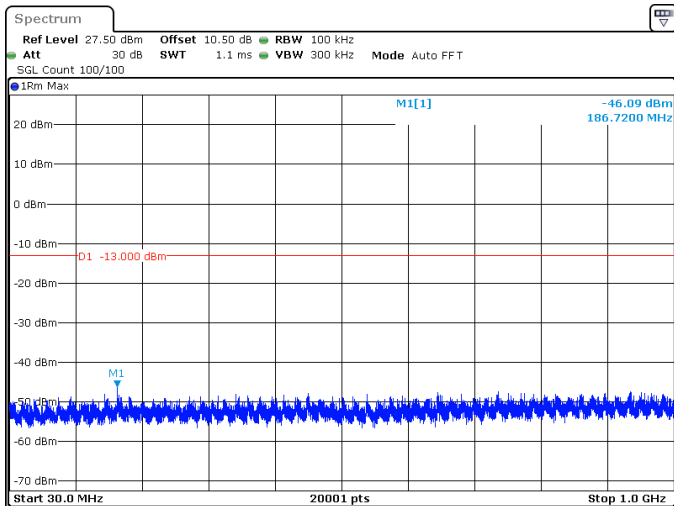


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:27:29

10MHz_30kHz_3795MHz_DFT-s-OFDM QPSK_RB24@0 -37.50 dBm

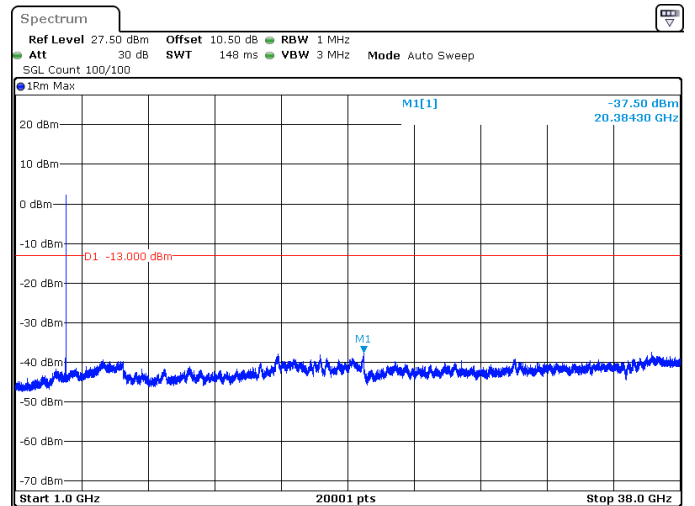


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 16:28:34

15MHz_15kHz_3707.5MHz_DFT-s-OFDM QPSK_RB1@0 -47.10 dBm

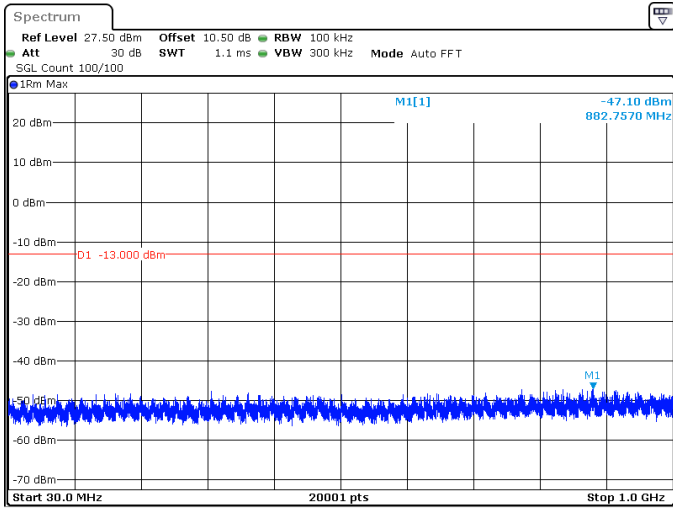


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 13:59:57

15MHz_15kHz_3707.5MHz_DFT-s-OFDM QPSK_RB1@0 -37.09 dBm

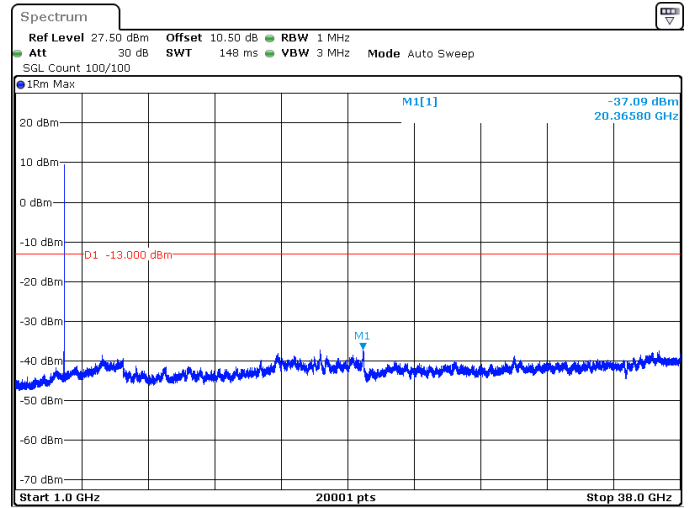


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 14:00:59

15MHz_15kHz_3707.5MHz_DFT-s-OFDM QPSK_RB1@78 -37.45 dBm

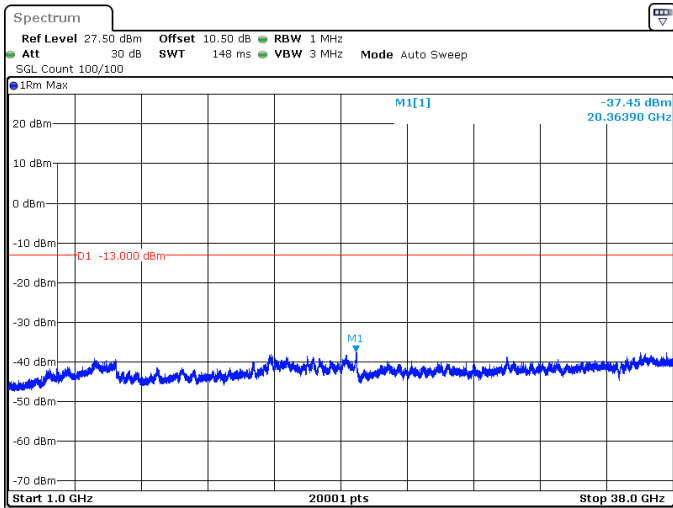


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 14:02:35

15MHz_15kHz_3707.5MHz_DFT-s-OFDM QPSK_RB1@78 -46.12 dBm

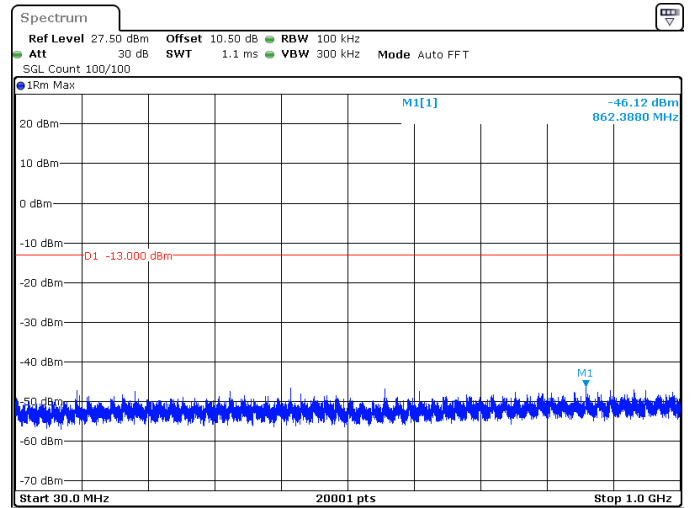


ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 14:01:34

15MHz_15kHz_3707.5MHz_DFT-s-OFDM QPSK_RB75@0 -46.47 dBm

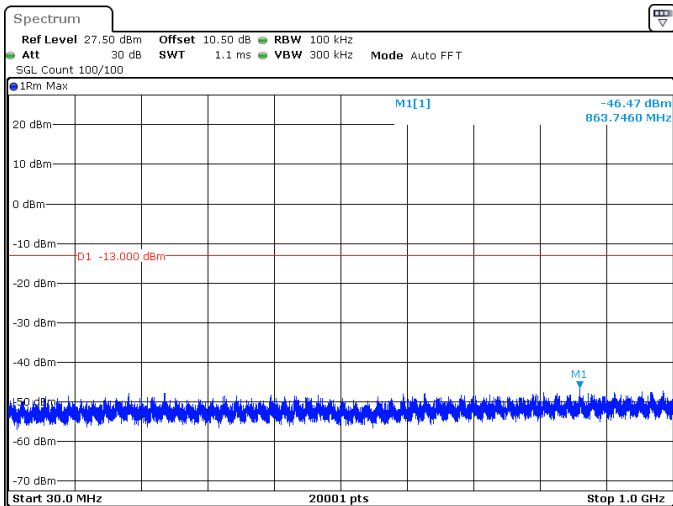

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 14:03:11

15MHz_15kHz_3707.5MHz_DFT-s-OFDM QPSK_RB75@0 -37.48 dBm

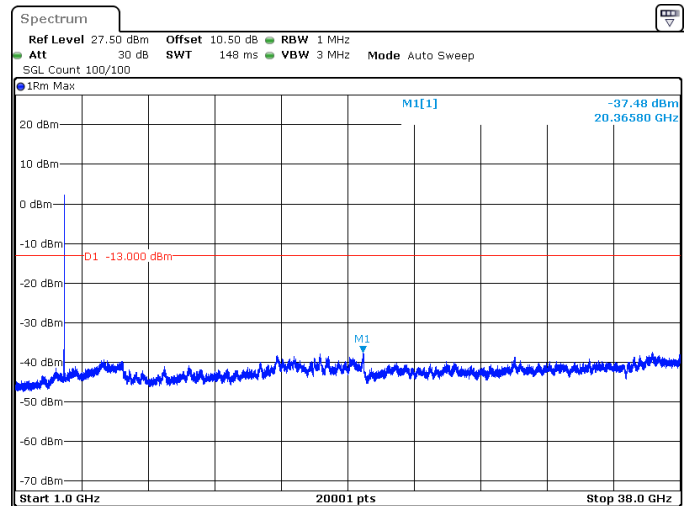

ProjectNo.:SZ1240108-01736E Tester:Jim Cheng
Date: 18.MAR.2024 14:04:12