



n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB160@0 -37.15dBm

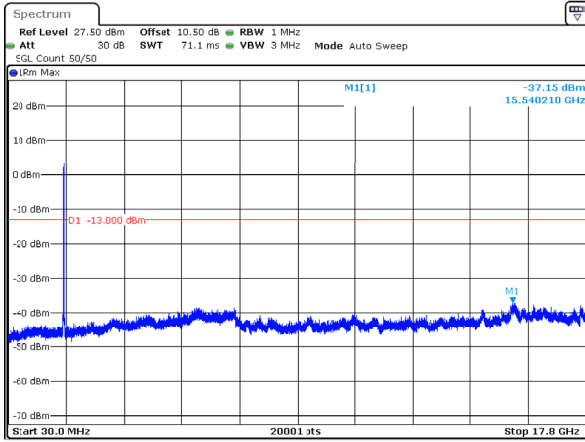


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:12:10

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB1@0 -36.24dBm

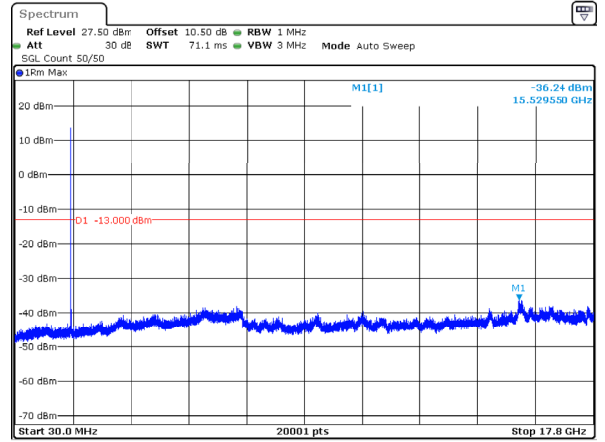


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:10:53

n66_30MHz_15kHz_1725MHz_DFT-s-OFDM
QPSK_RB1@159 -36.49dBm

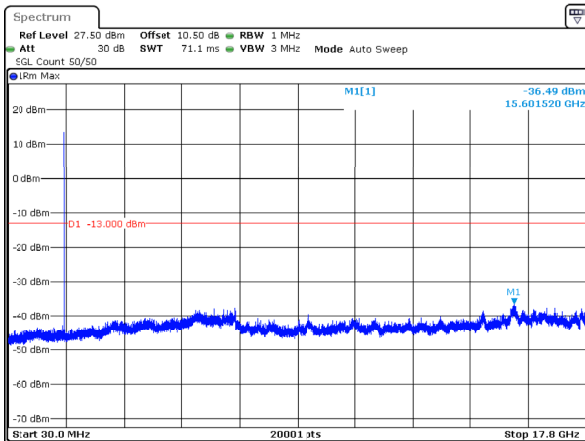


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:11:44

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB160@0 -36.21dBm

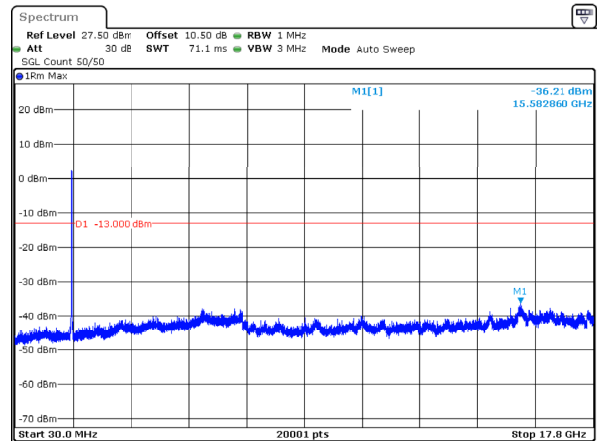


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:14:17

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -36.33dBm

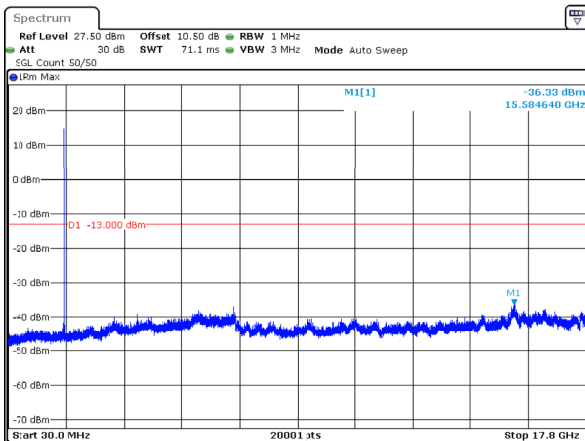


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:13:00

n66_30MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@159 -36.35dBm

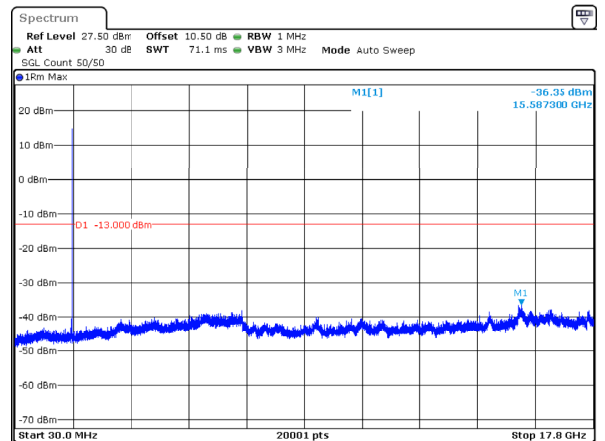


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:13:27

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB160@0 -37.05dBm

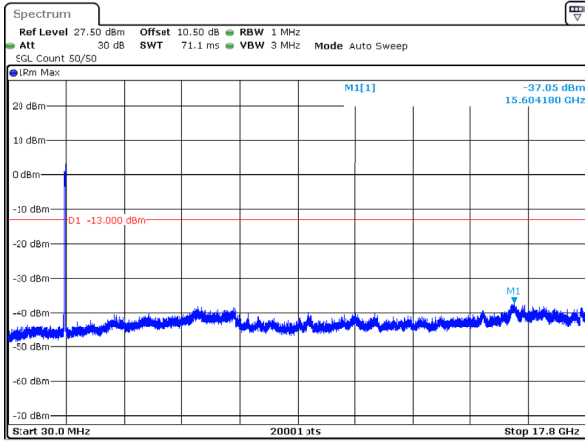


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:16:17

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB1@0 -37.15dBm

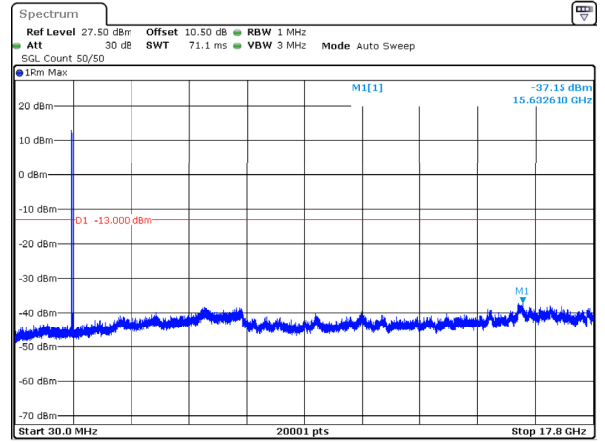


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:15:24

n66_30MHz_15kHz_1765MHz_DFT-s-OFDM
QPSK_RB1@159 -36.88dBm

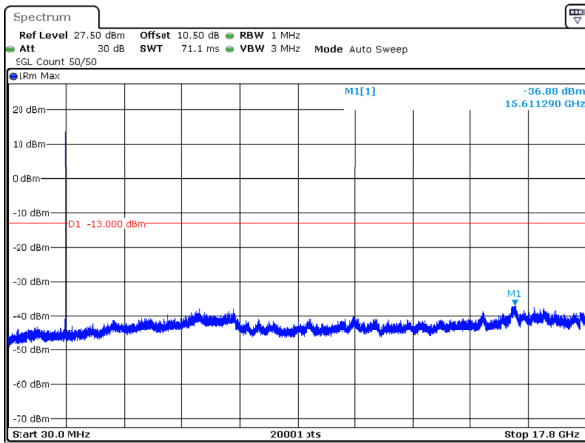


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:15:51

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB1@0 -37.21dBm

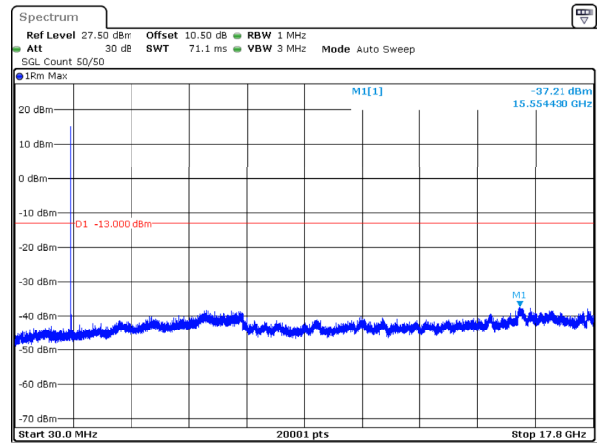


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:17:31

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB1@215 -37.04dBm

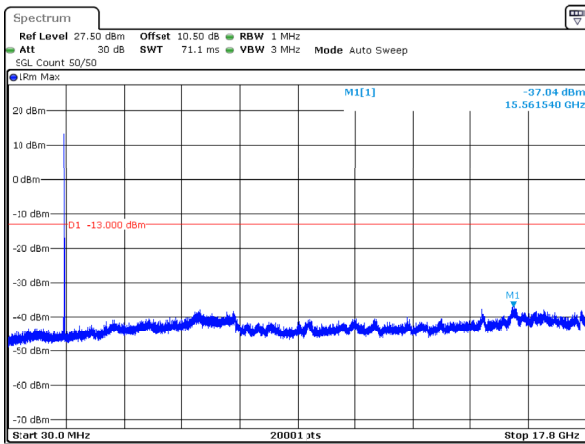


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:17:58

n66_40MHz_15kHz_1730MHz_DFT-s-OFDM
QPSK_RB216@0 -36.51dBm

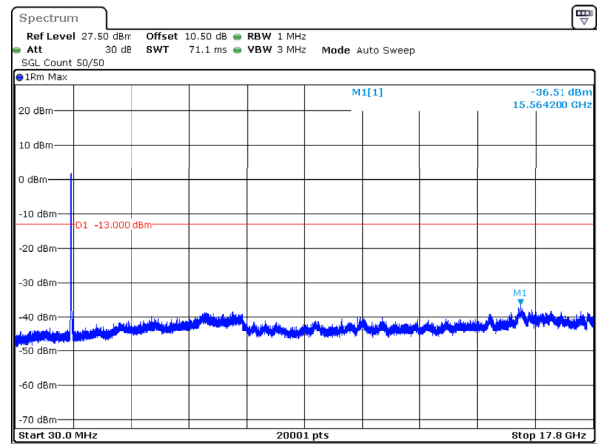


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:18:25

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@0 -35.44dBm

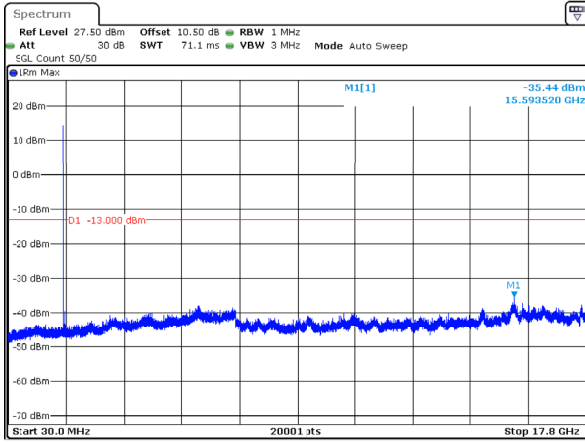


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:19:15

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB1@215 -37.12dBm

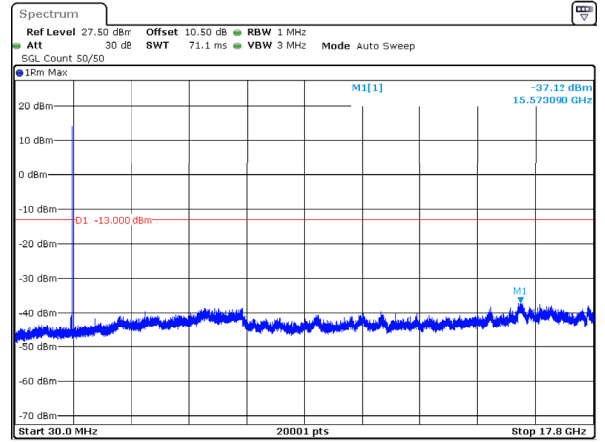


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:20:06

n66_40MHz_15kHz_1745MHz_DFT-s-OFDM
QPSK_RB216@0 -36.77dBm

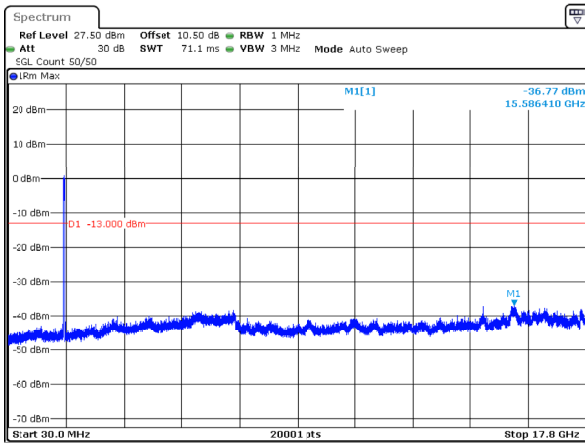


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:20:33

n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB1@0 -36.93dBm

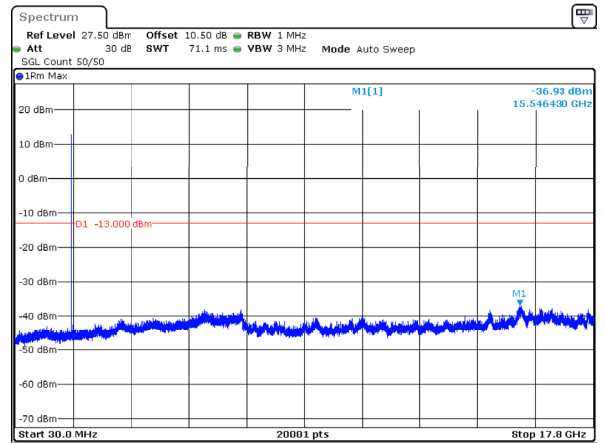


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:21:40

n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB1@215 -37.34dBm

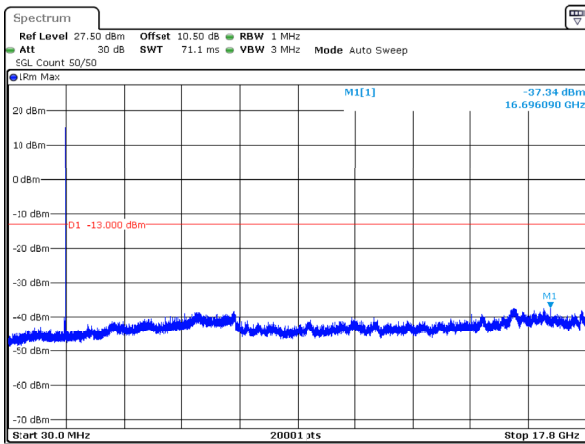

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:22:07


n66_40MHz_15kHz_1760MHz_DFT-s-OFDM
QPSK_RB216@0 -37.03dBm

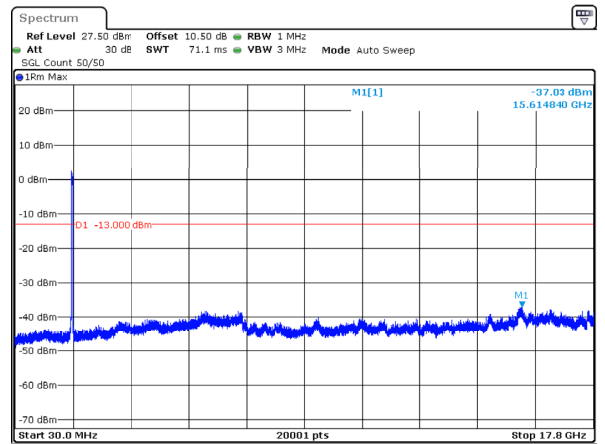

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 12:22:33


n77_1

n77_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@0 -37.76dBm

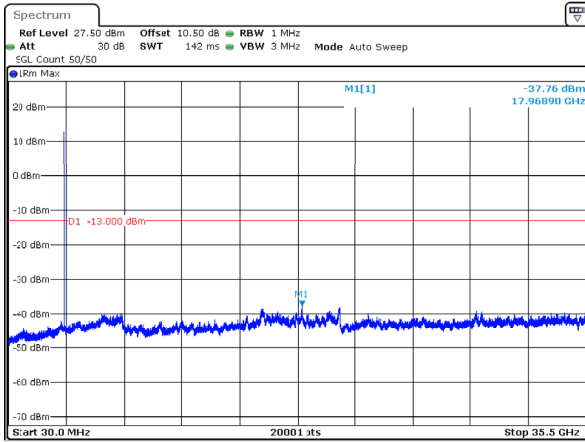


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:13:05

n77_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB1@23 -37.54dBm

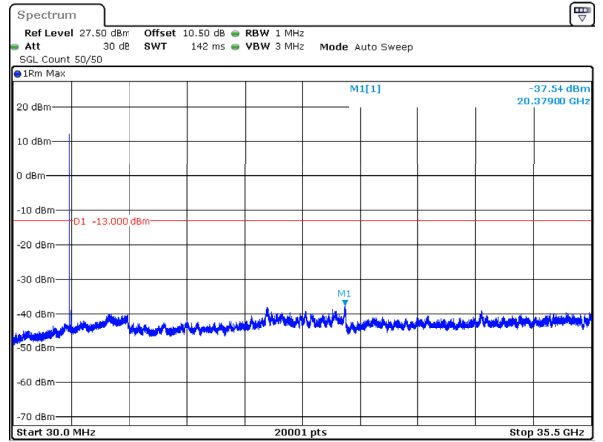


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:14:12

n77_1_10MHz_30kHz_3455MHz_DFT-s-OFDM
QPSK_RB24@0 -38.06dBm

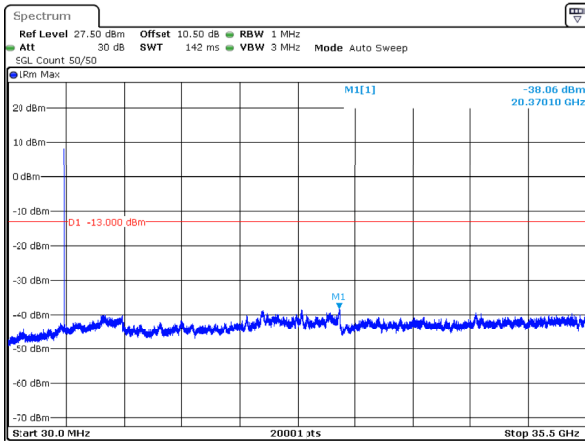


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:15:22

n77_1_10MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.83dBm

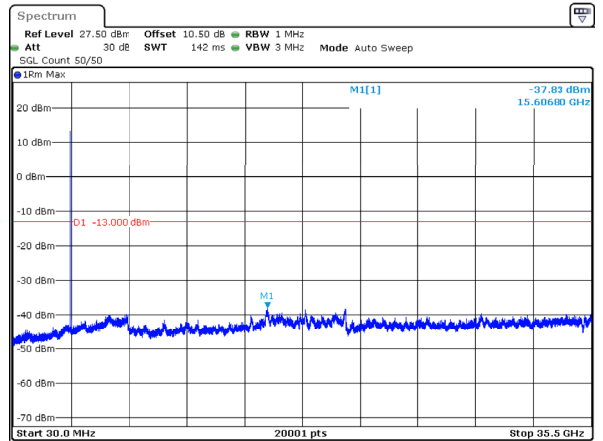


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:20:58

n77_1_10MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@23 -38.09dBm

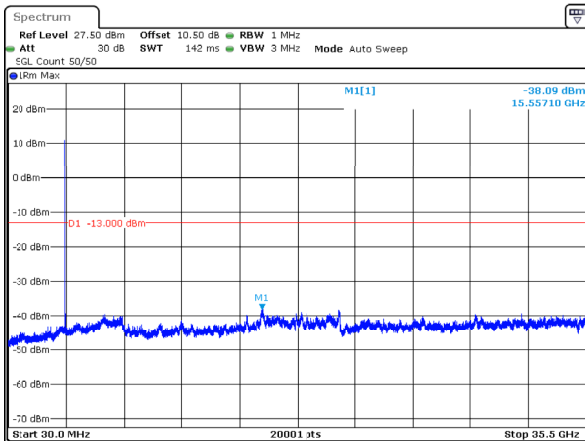


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:22:04

n77_1_10MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB24@0 -38.39dBm

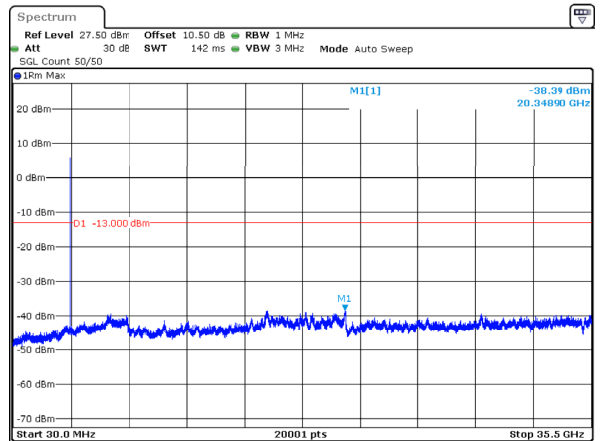


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:23:13

n77_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB1@0 -38.01dBm

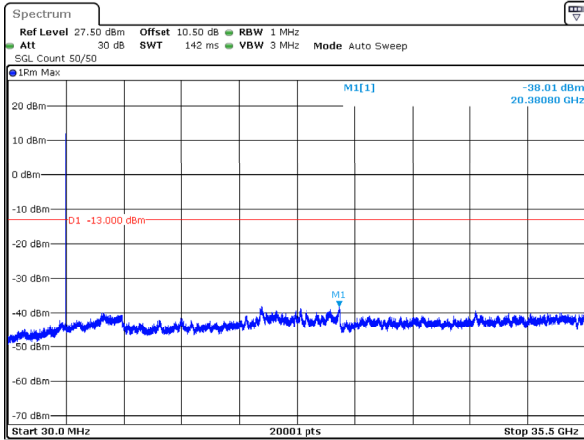


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:24:32

n77_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB1@23 -36.82dBm

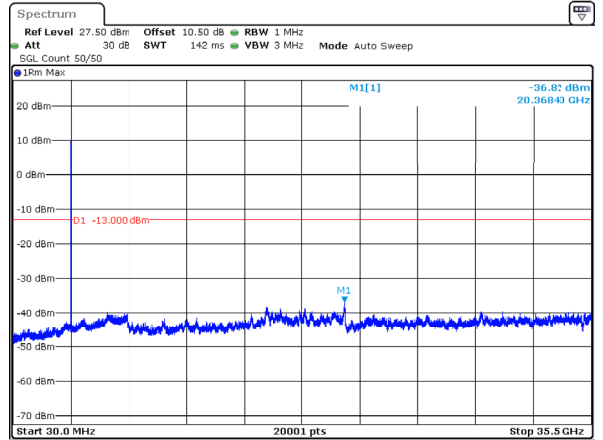


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:25:41

n77_1_10MHz_30kHz_3545MHz_DFT-s-OFDM
QPSK_RB24@0 -37.85dBm

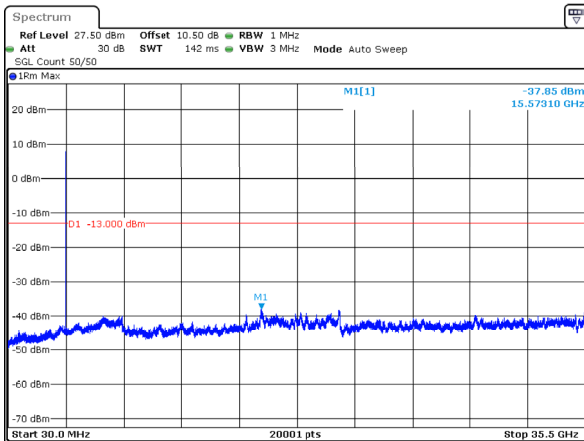


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:26:53

n77_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB1@0 -37.91dBm

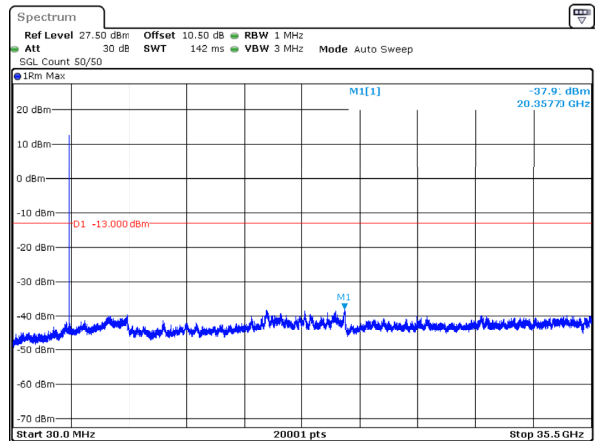


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:27:58

n77_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB1@37 -38.11dBm

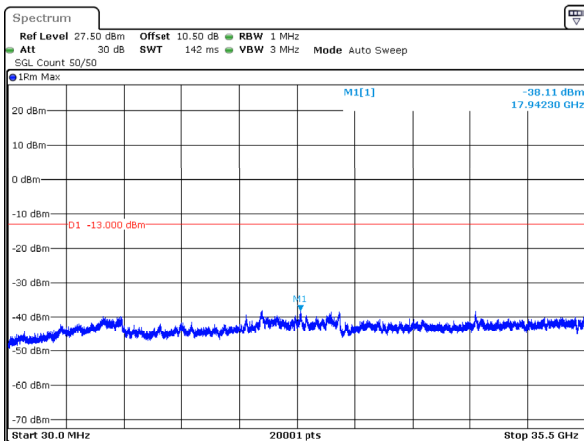


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:29:04

n77_1_15MHz_30kHz_3457.5MHz_DFT-s-OFDM
QPSK_RB36@0 -38.32dBm

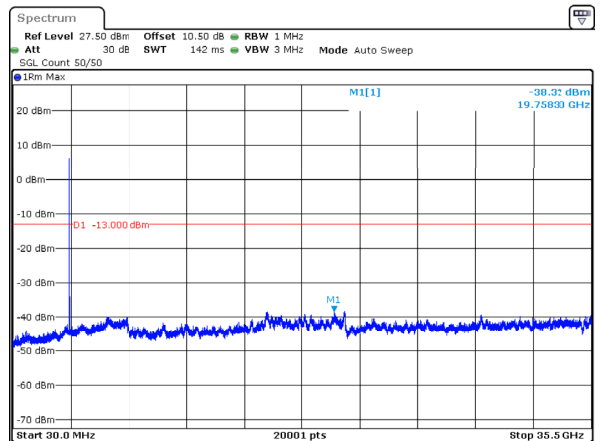


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:30:16

n77_1_15MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -38.15dBm

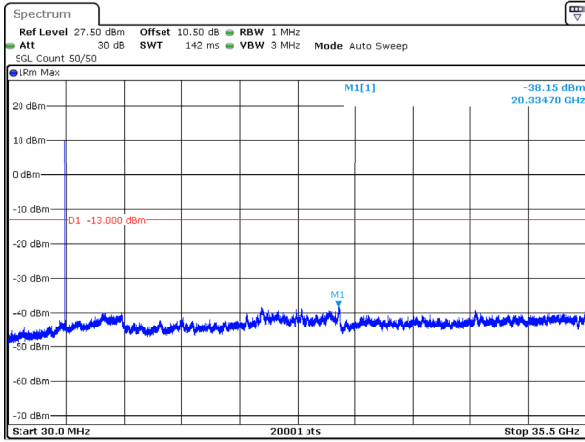


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:32:32

n77_1_15MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@37 -37.61dBm

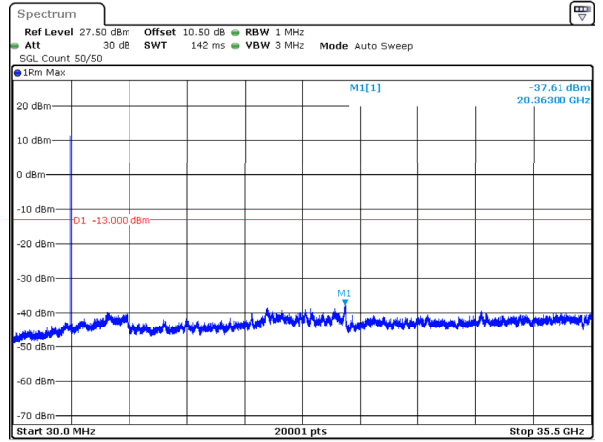


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:33:42

n77_1_15MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB36@0 -37.26dBm

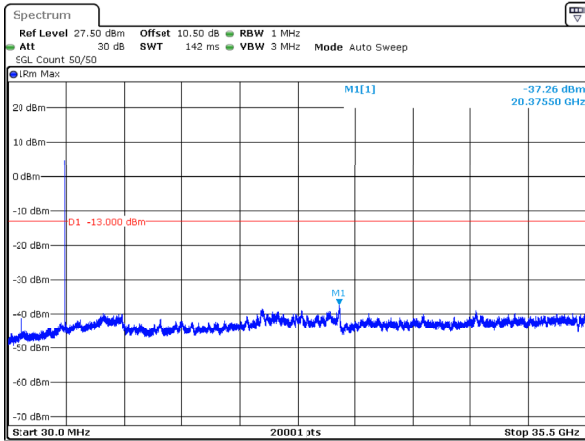


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:34:48

n77_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB1@0 -37.88dBm

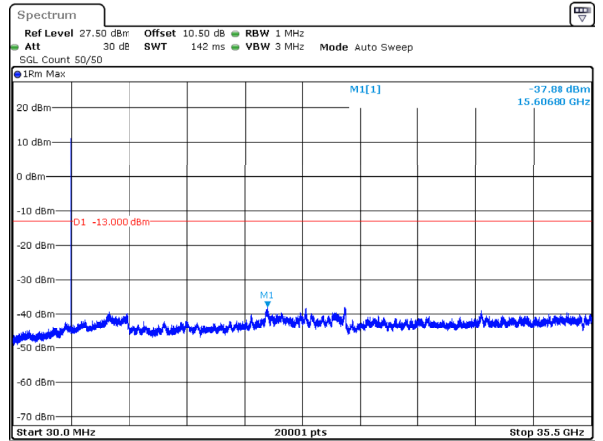


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:36:07

n77_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB1@37 -37.72dBm

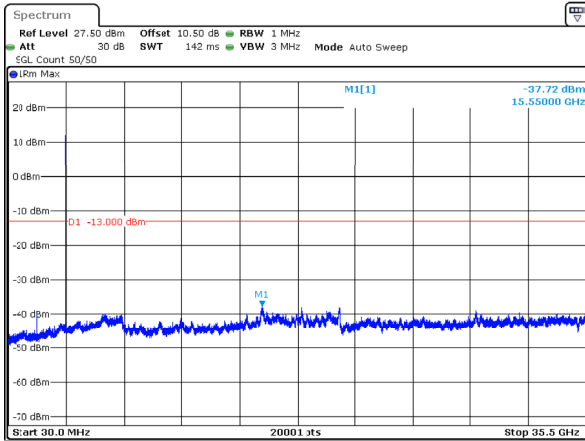


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:37:16

n77_1_15MHz_30kHz_3542.5MHz_DFT-s-OFDM
QPSK_RB36@0 -38.05dBm

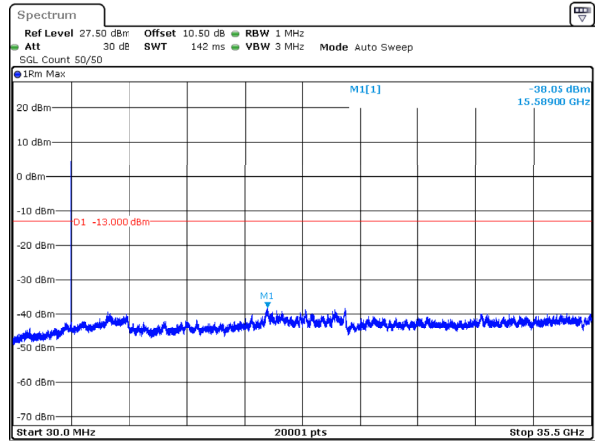


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:38:21

n77_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB1@0 -36.95dBm

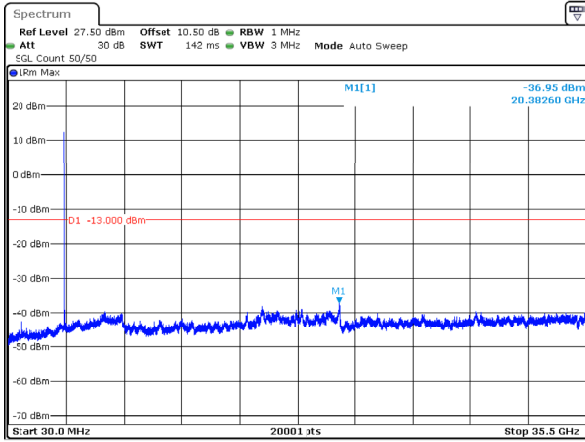


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:39:31

n77_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB1@50 -37.75dBm

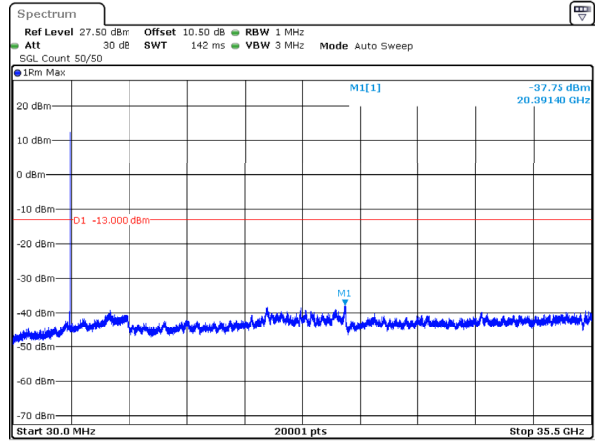


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:40:38

n77_1_20MHz_30kHz_3460MHz_DFT-s-OFDM
QPSK_RB50@0 -37.91dBm

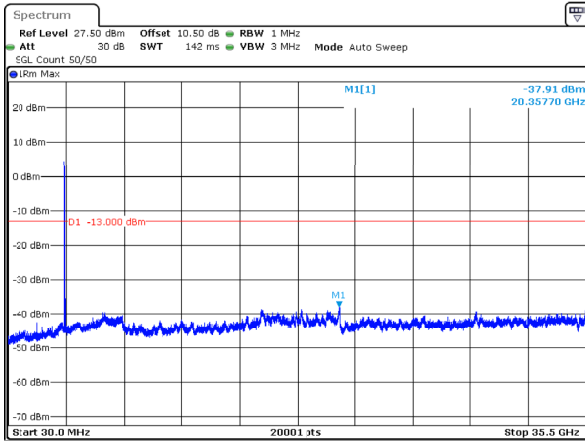


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:41:44

n77_1_20MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.93dBm

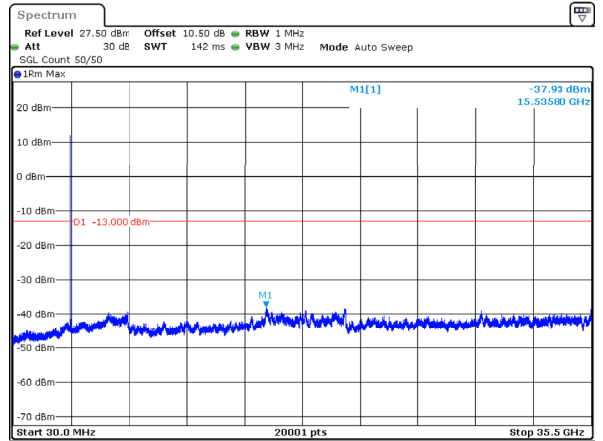


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:43:03

n77_1_20MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@50 -37.87dBm

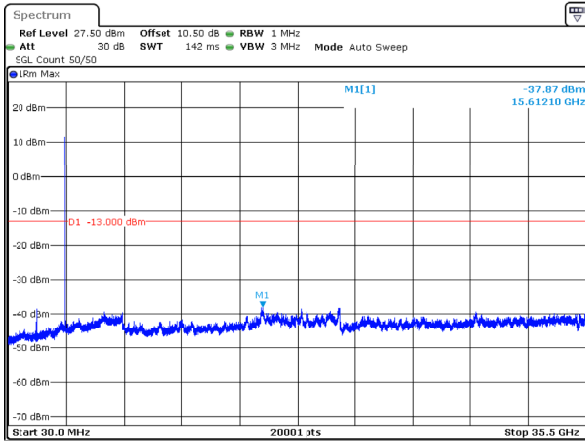


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:44:09

n77_1_20MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB50@0 -33.76dBm

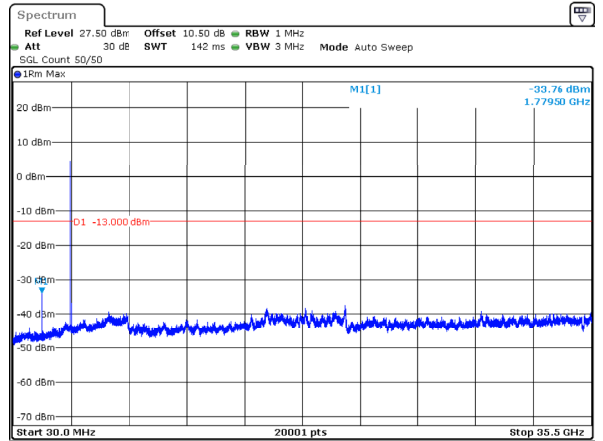


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:45:15

n77_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB1@0 -37.46dBm

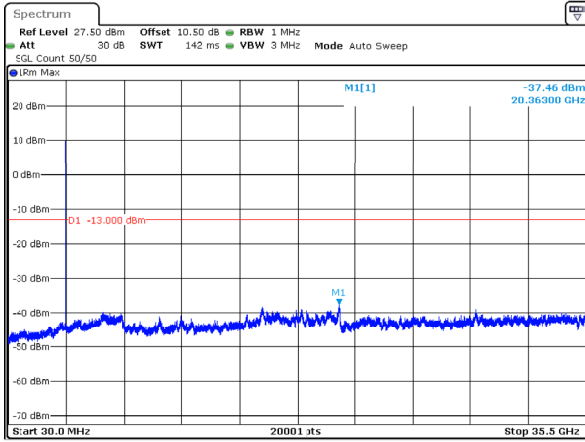


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:46:31

n77_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB1@50 -38.38dBm

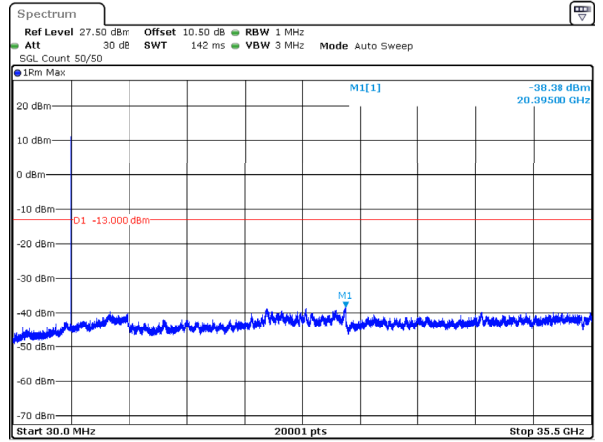


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:47:40

n77_1_20MHz_30kHz_3540MHz_DFT-s-OFDM
QPSK_RB50@0 -38.10dBm

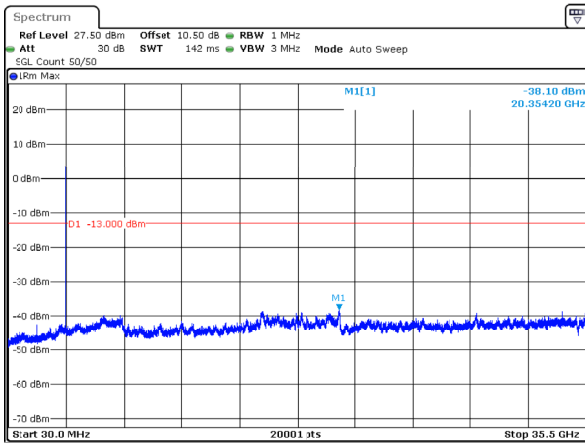


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:48:46

n77_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB1@0 -38.09dBm

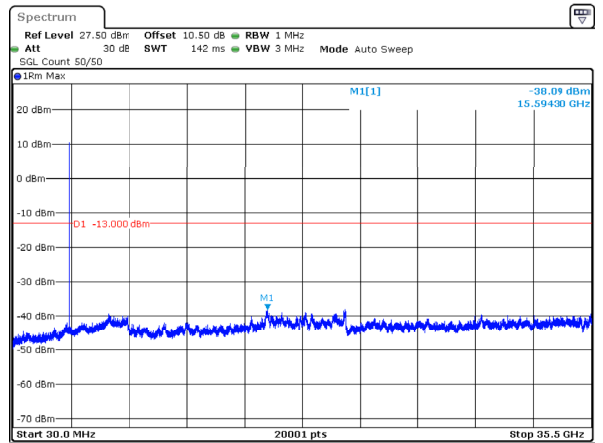


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:49:55

n77_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB1@77 -38.41dBm

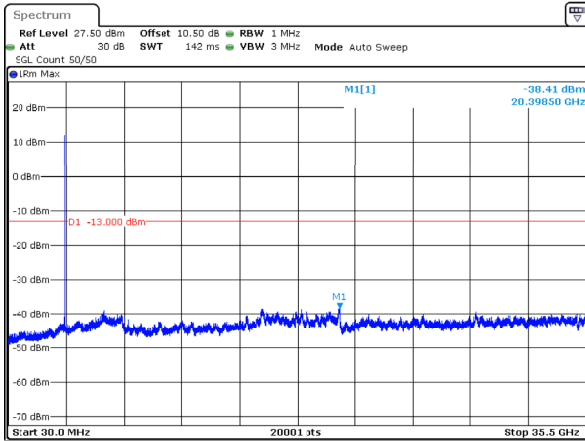


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:51:05

n77_1_30MHz_30kHz_3465MHz_DFT-s-OFDM
QPSK_RB75@0 -37.81dBm

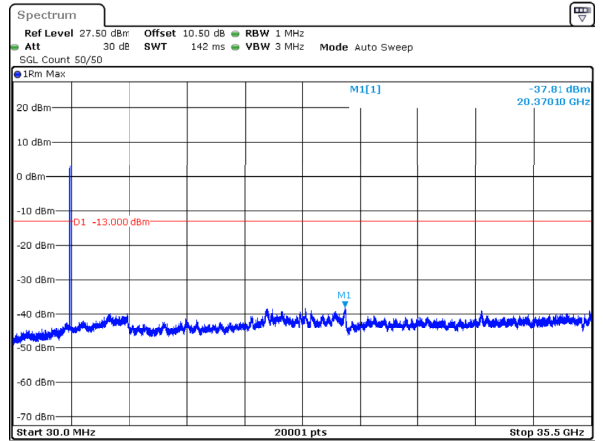


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:52:12

n77_1_30MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -38.15dBm

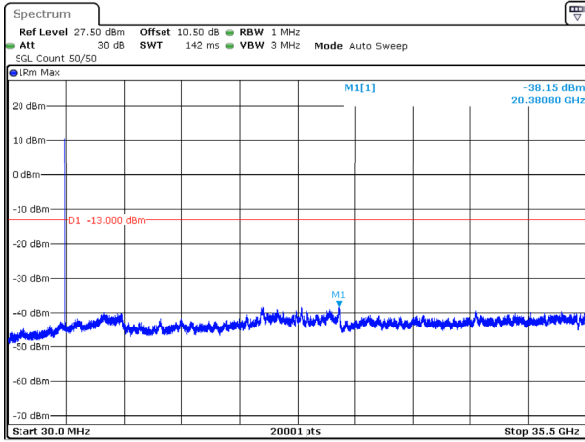


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:53:34

n77_1_30MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@77 -38.25dBm

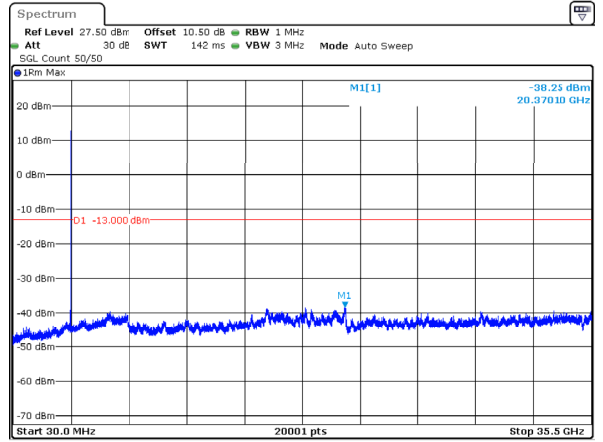


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:54:40

n77_1_30MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB75@0 -38.10dBm

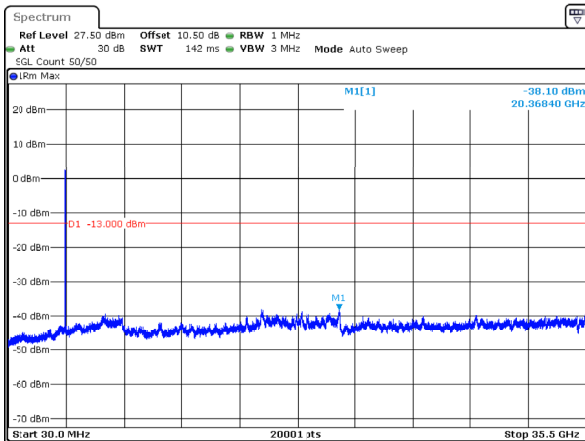


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:55:50

n77_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB1@0 -37.30dBm

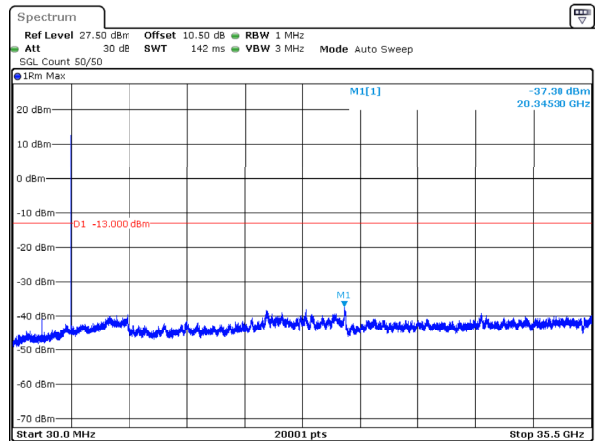


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:57:06

n77_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB1@77 -37.95dBm

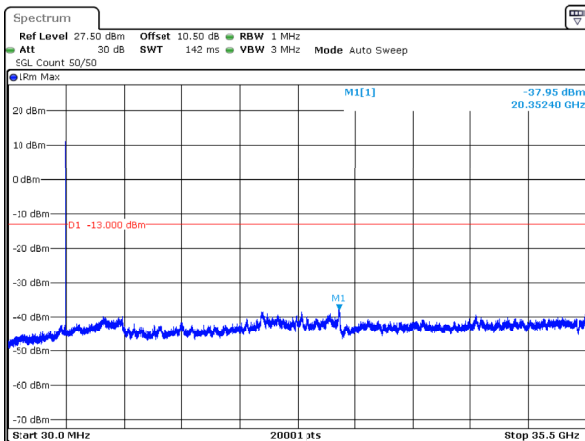


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:58:16

n77_1_30MHz_30kHz_3535MHz_DFT-s-OFDM
QPSK_RB75@0 -38.24dBm

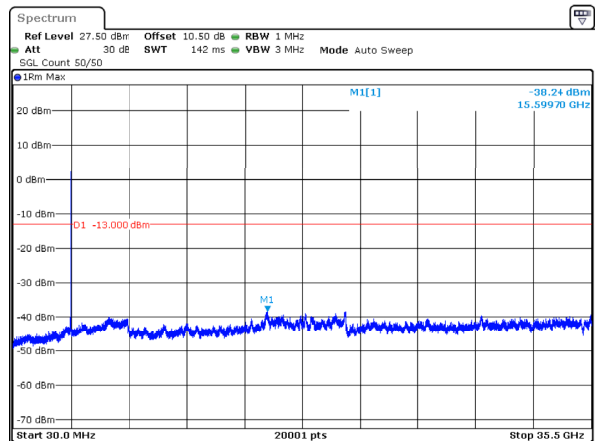


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 13:59:23

n77_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB100@0 -38.11dBm

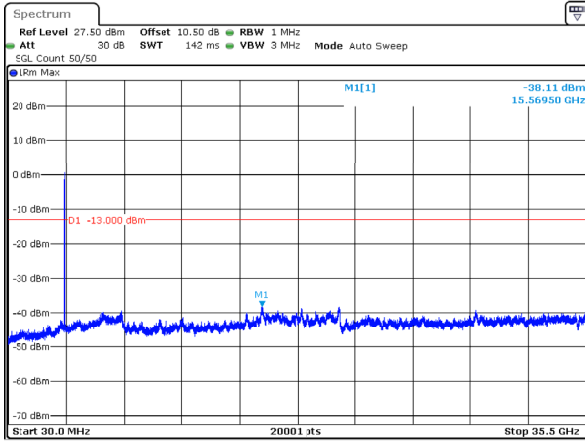


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:02:45

n77_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB1@0 -38.13dBm

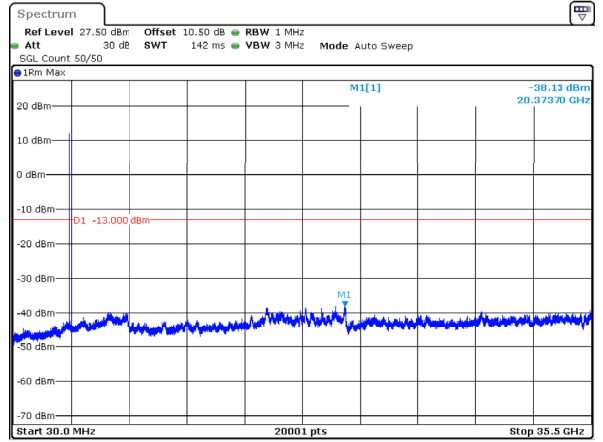


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:00:30

n77_1_40MHz_30kHz_3470MHz_DFT-s-OFDM
QPSK_RB1@105 -37.81dBm

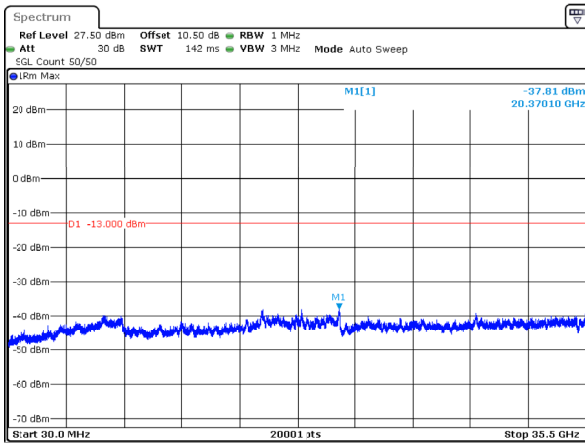


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:01:38

n77_1_40MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB100@0 -37.88dBm

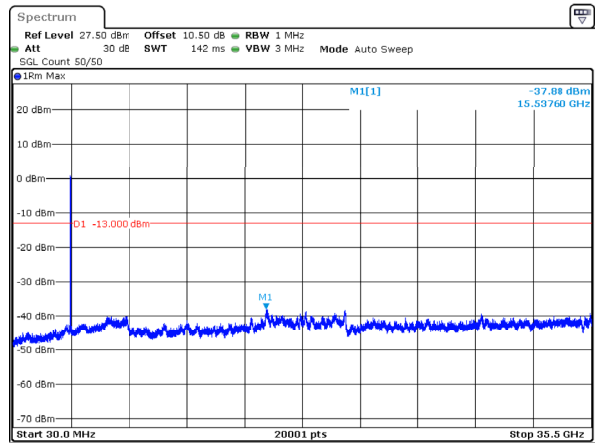


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:06:21

n77_1_40MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.49dBm

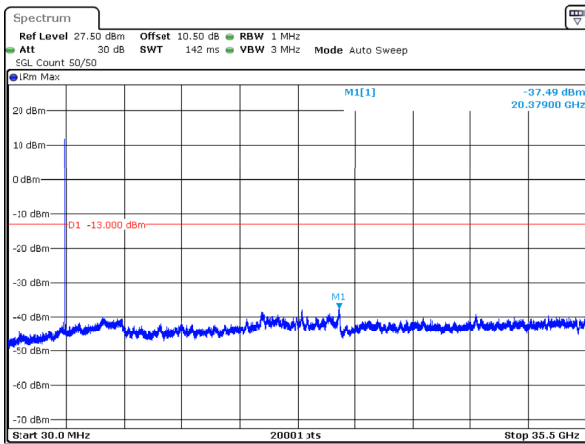


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:04:05

n77_1_40MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@105 -37.84dBm

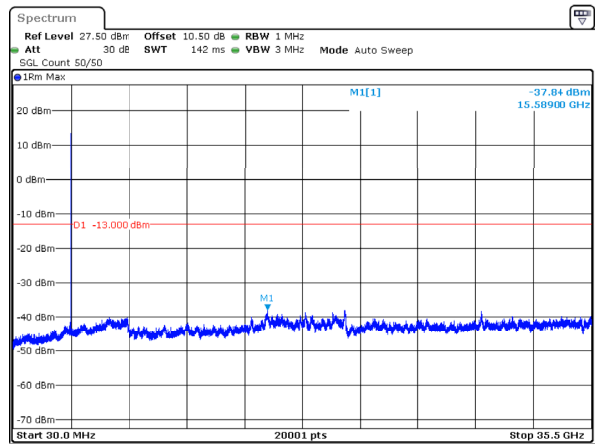


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:05:13

n77_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB100@0 -37.53dBm

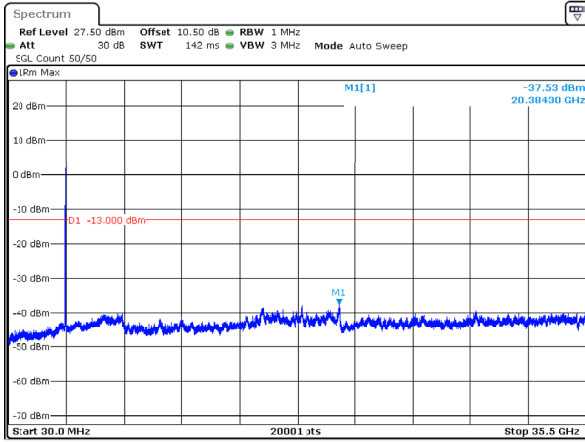


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:10:55

n77_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB1@0 -37.67dBm

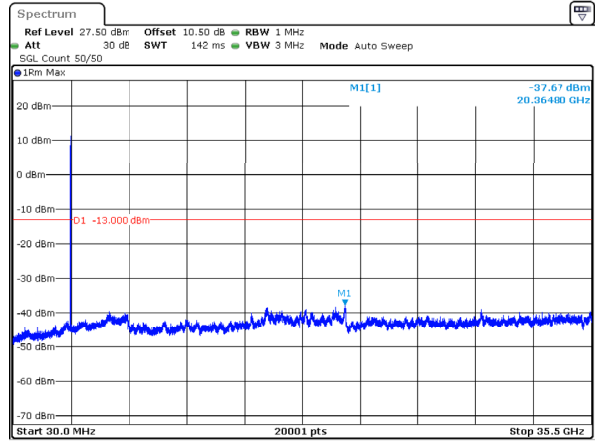


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:08:38

n77_1_40MHz_30kHz_3530MHz_DFT-s-OFDM
QPSK_RB1@105 -37.58dBm

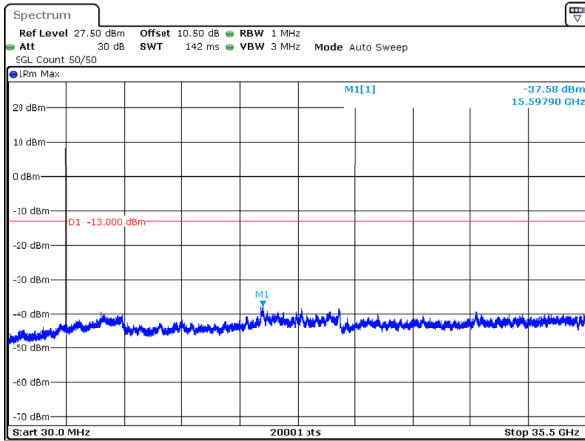


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:09:46

n77_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB128@0 -38.07dBm

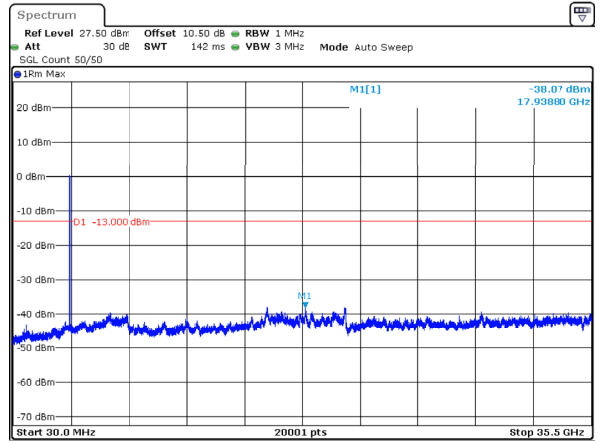


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:14:05

n77_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB1@0 -37.69dBm

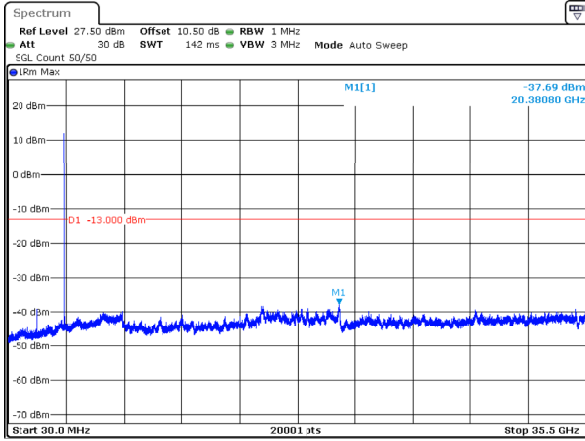


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:11:48

n77_1_50MHz_30kHz_3475MHz_DFT-s-OFDM
QPSK_RB1@132 -38.18dBm

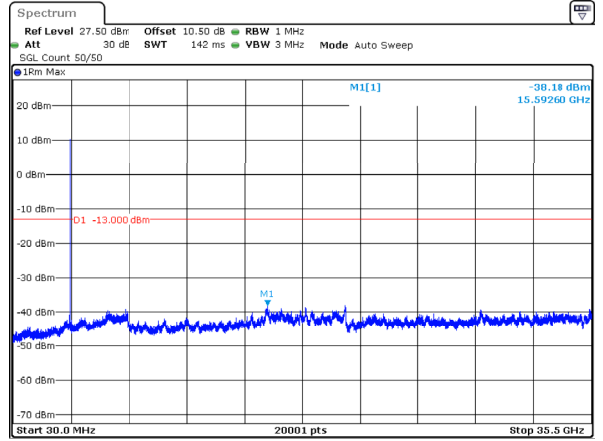


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:12:57

n77_1_50MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB128@0 -36.94dBm

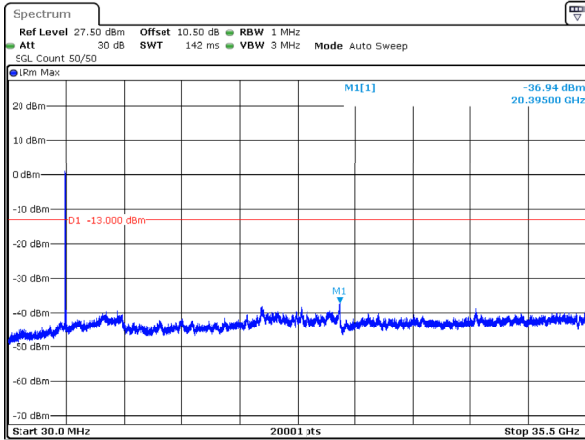


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:17:44

n77_1_50MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -38.23dBm

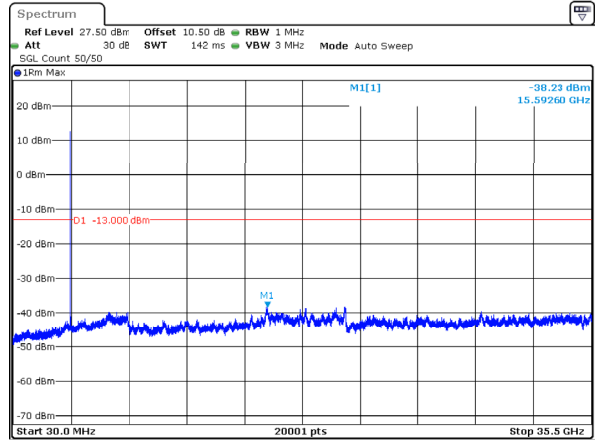


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:15:23

n77_1_50MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@132 -37.88dBm

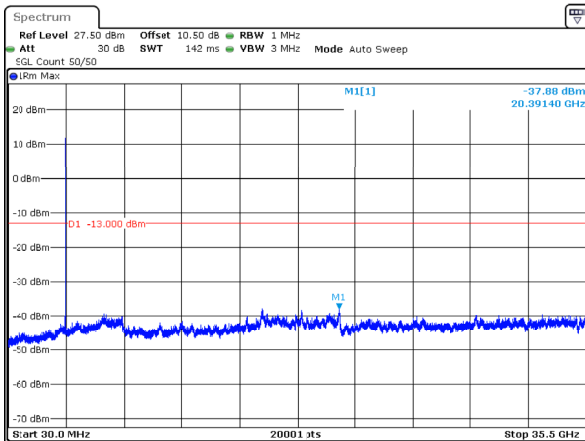


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:16:32

n77_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB128@0 -38.03dBm

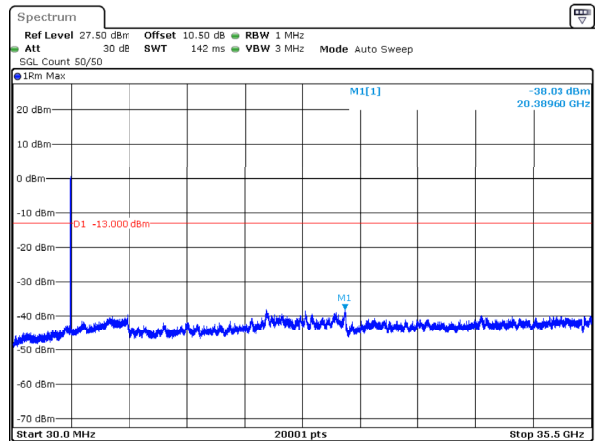


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:21:27

n77_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB1@0 -38.08dBm

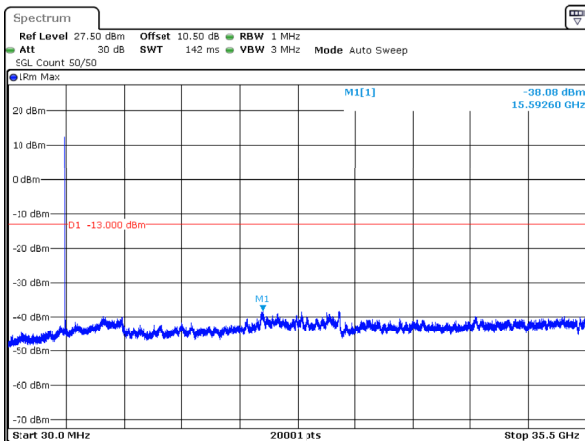


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:19:05

n77_1_50MHz_30kHz_3525MHz_DFT-s-OFDM
QPSK_RB1@132 -37.88dBm

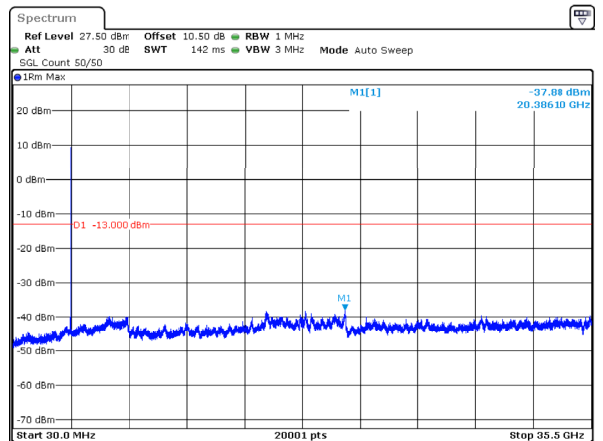


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:20:16

n77_1_60MHz_30kHz_3480MHz_DFT-s-OFDM
QPSK_RB162@0 -31.41dBm

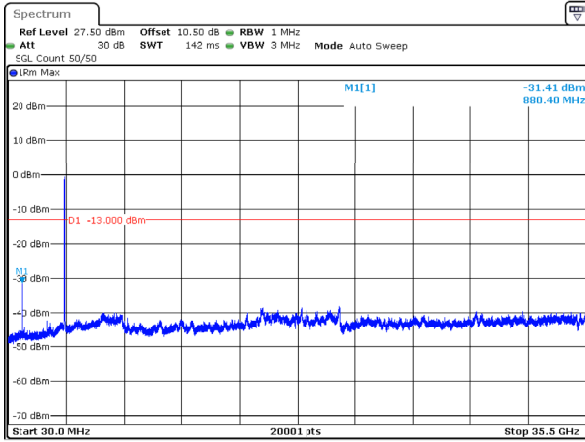


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:24:50

n77_1_60MHz_30kHz_3480MHz_DFT-s-OFDM
QPSK_RB1@0 -37.82dBm

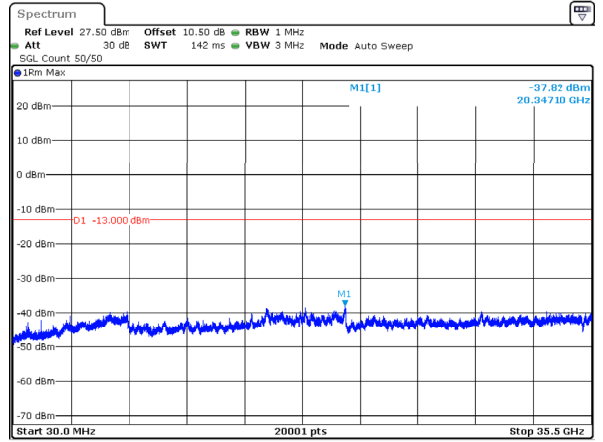


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:22:34

n77_1_60MHz_30kHz_3480MHz_DFT-s-OFDM
QPSK_RB1@161 -33.26dBm

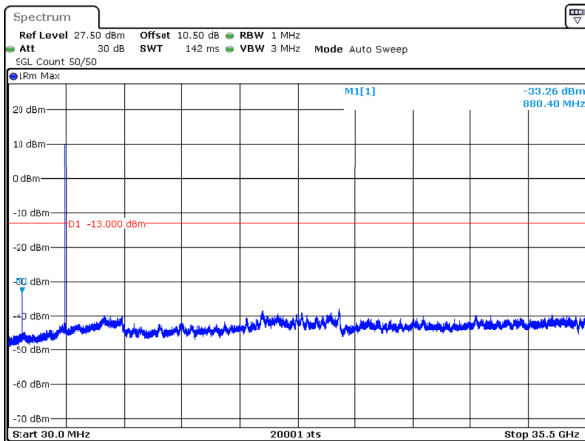


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:23:42

n77_1_60MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB162@0 -33.97dBm

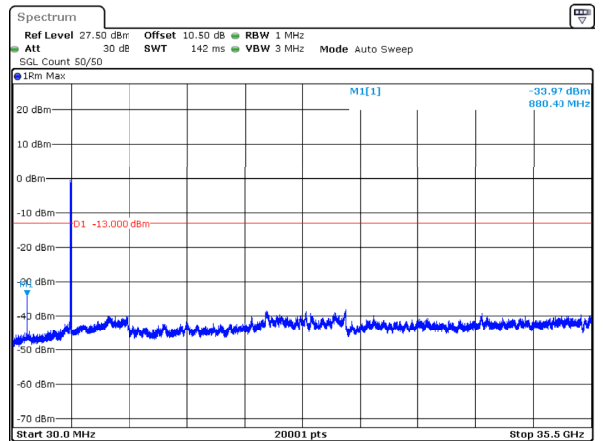


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:28:16

n77_1_60MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -32.94dBm

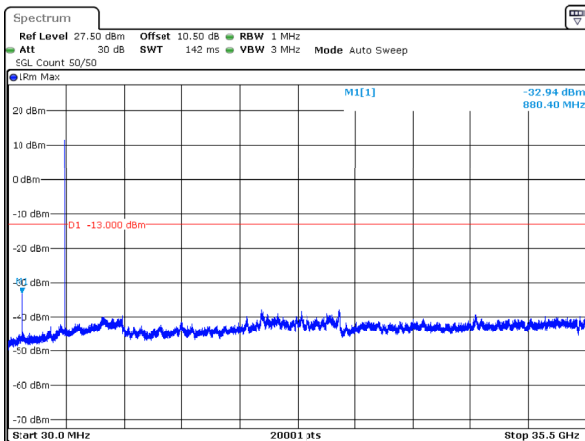


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:26:01

n77_1_60MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@161 -33.78dBm

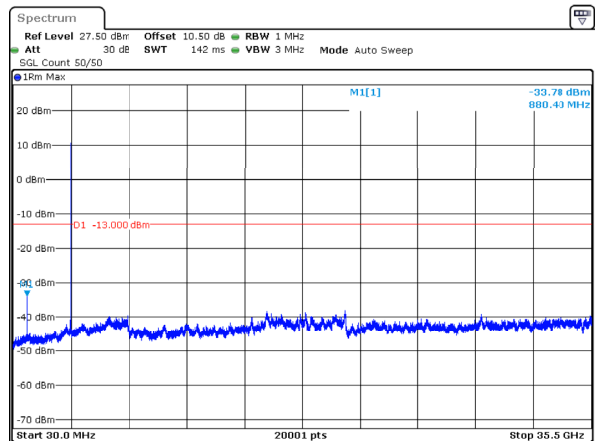


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:27:08

n77_1_60MHz_30kHz_3520MHz_DFT-s-OFDM
QPSK_RB162@0 -33.17dBm

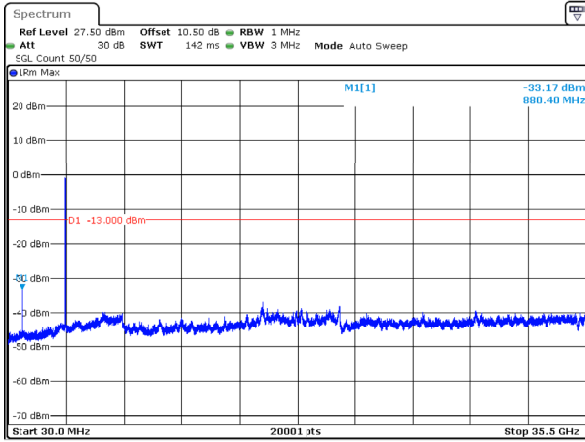


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:31:46

n77_1_60MHz_30kHz_3520MHz_DFT-s-OFDM
QPSK_RB1@0 -33.45dBm

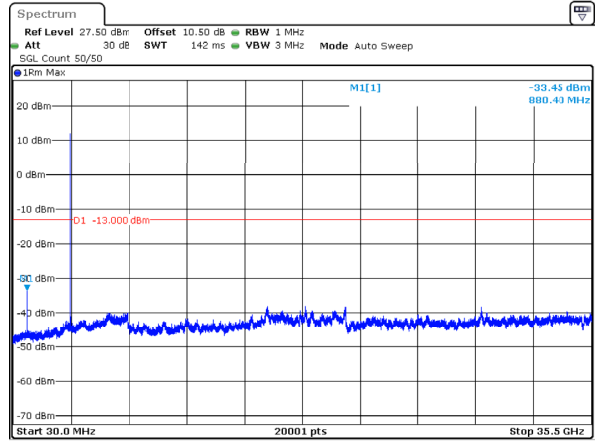


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:29:27

n77_1_60MHz_30kHz_3520MHz_DFT-s-OFDM
QPSK_RB1@161 -32.44dBm

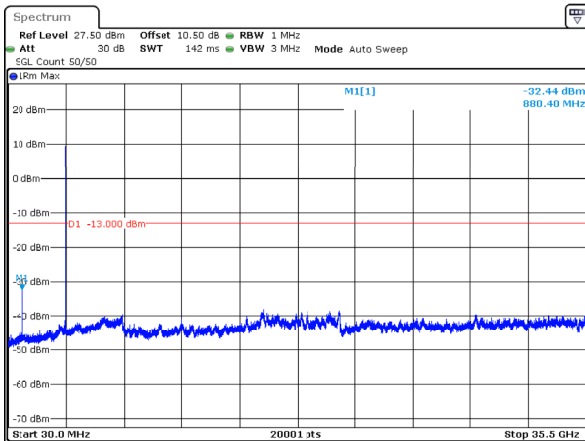


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:30:34

n77_1_70MHz_30kHz_3485MHz_DFT-s-OFDM
QPSK_RB180@0 -30.94dBm

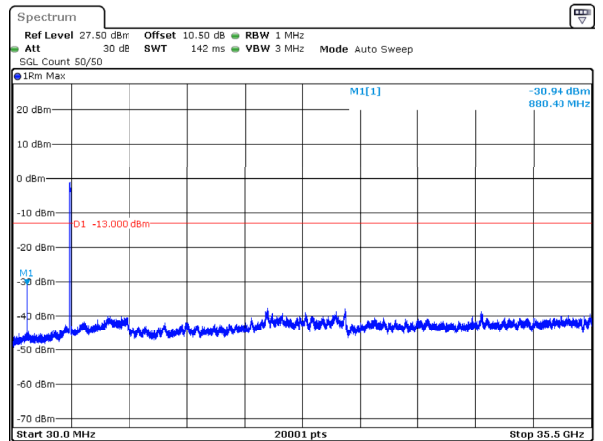


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:35:16

n77_1_70MHz_30kHz_3485MHz_DFT-s-OFDM
QPSK_RB1@0 -33.01dBm

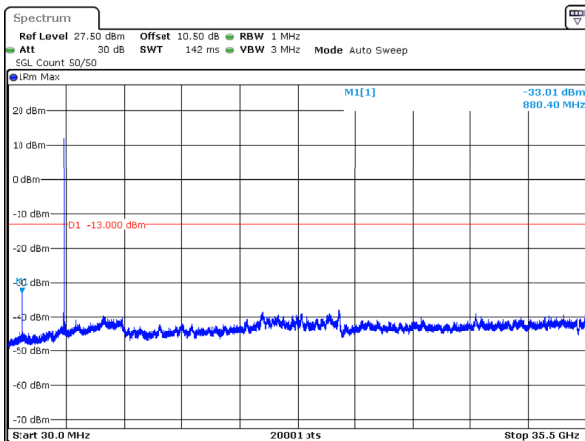


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:32:57

n77_1_70MHz_30kHz_3485MHz_DFT-s-OFDM
QPSK_RB1@188 -31.83dBm

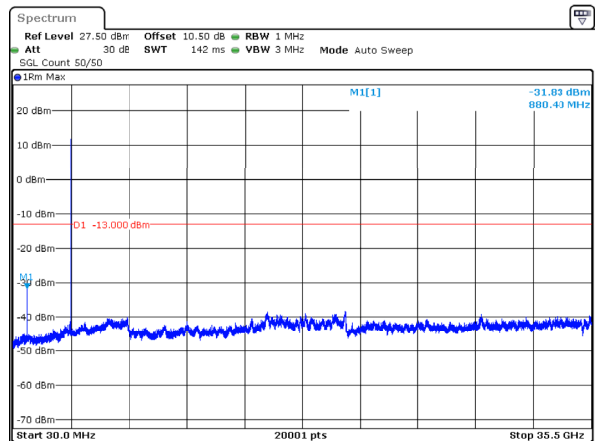


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:34:08

n77_1_70MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB180@0 -27.29dBm

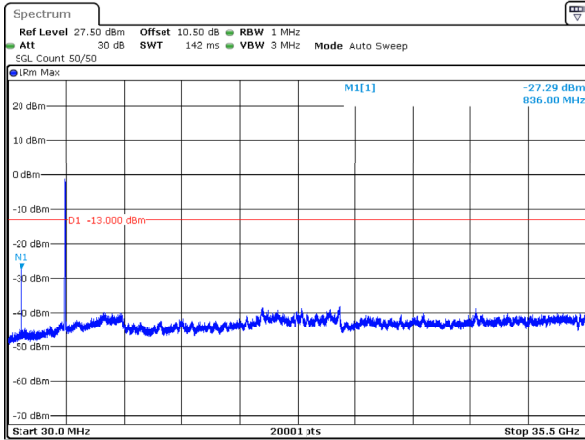


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:38:35

n77_1_70MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -32.16dBm

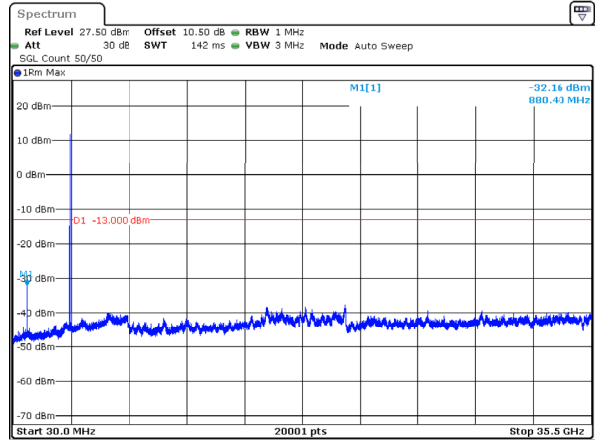


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:36:23

n77_1_70MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@188 -38.17dBm

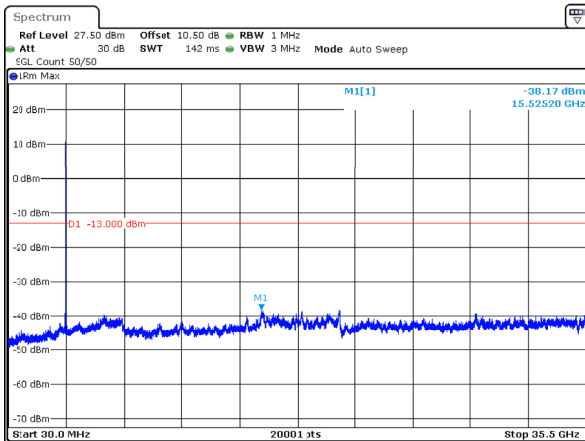


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:37:31

n77_1_70MHz_30kHz_3515MHz_DFT-s-OFDM
QPSK_RB180@0 -38.02dBm

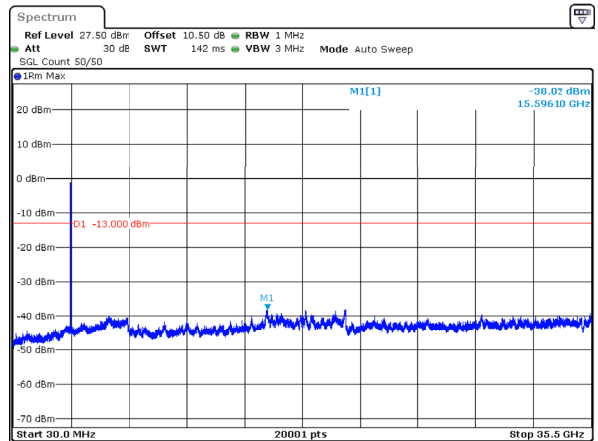


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:41:43

n77_1_70MHz_30kHz_3515MHz_DFT-s-OFDM
QPSK_RB1@0 -38.19dBm

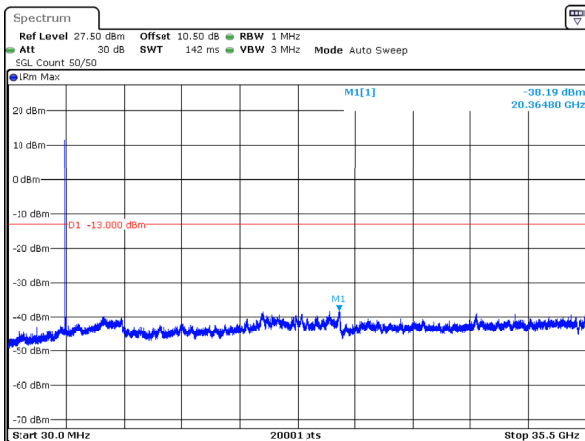


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:39:43

n77_1_70MHz_30kHz_3515MHz_DFT-s-OFDM
QPSK_RB1@188 -27.68dBm

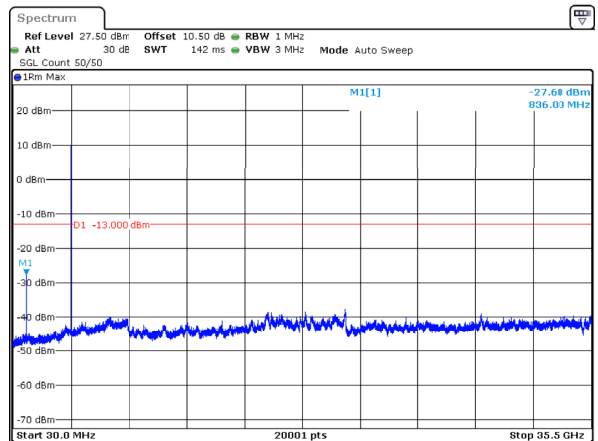


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:40:36

n77_1_80MHz_30kHz_3490MHz_DFT-s-OFDM
QPSK_RB1@0 -25.64dBm

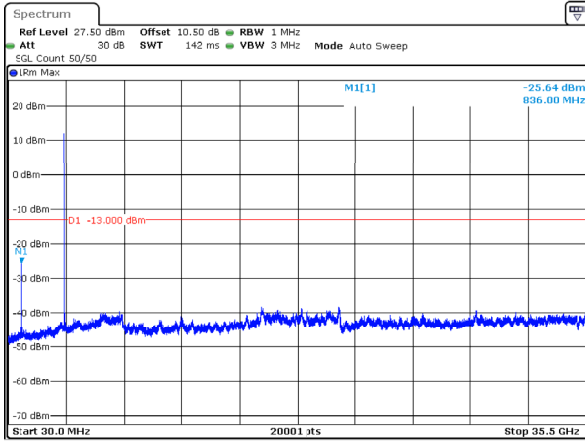


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:42:51

n77_1_80MHz_30kHz_3490MHz_DFT-s-OFDM
QPSK_RB1@216 -38.00dBm

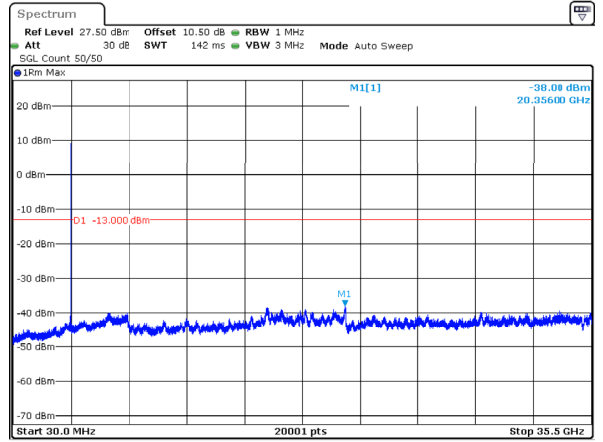


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:43:58

n77_1_80MHz_30kHz_3490MHz_DFT-s-OFDM
QPSK_RB216@0 -38.24dBm

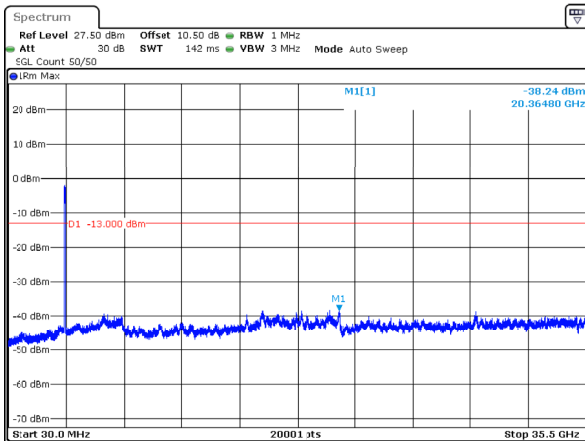


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:45:09

n77_1_80MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -37.68dBm

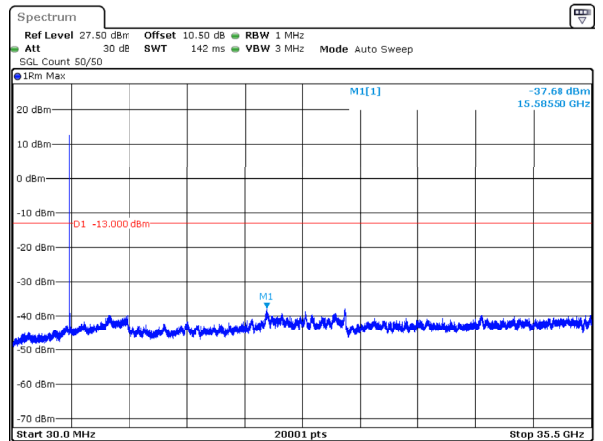


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:46:16

n77_1_80MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@216 -37.75dBm

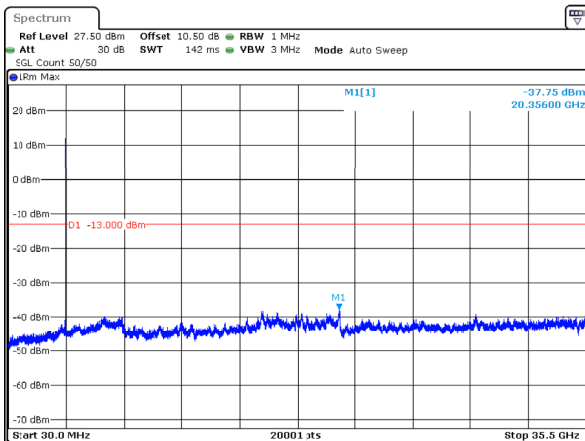


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:47:24

n77_1_80MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB216@0 -37.82dBm

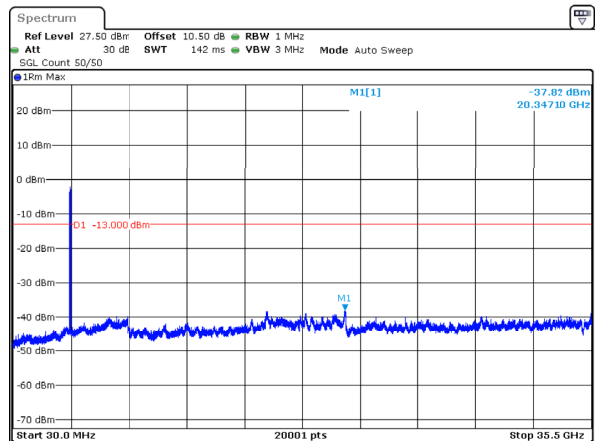


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:48:32

n77_1_80MHz_30kHz_3510MHz_DFT-s-OFDM
QPSK_RB1@0 -38.35dBm

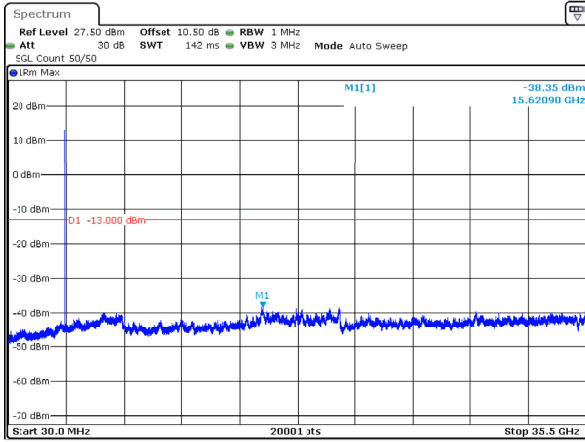


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:49:40

n77_1_80MHz_30kHz_3510MHz_DFT-s-OFDM
QPSK_RB1@216 -27.51dBm

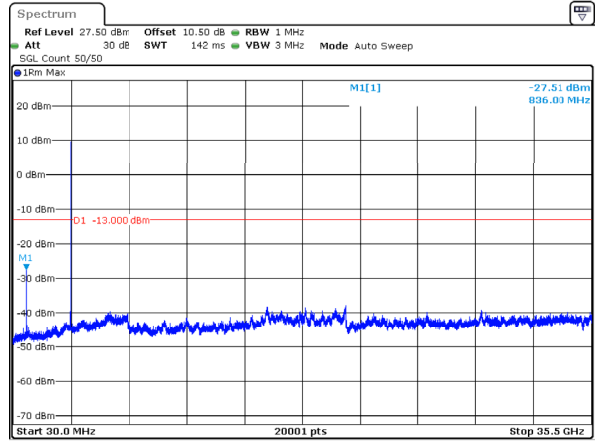


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:50:48

n77_1_80MHz_30kHz_3510MHz_DFT-s-OFDM
QPSK_RB216@0 -38.53dBm

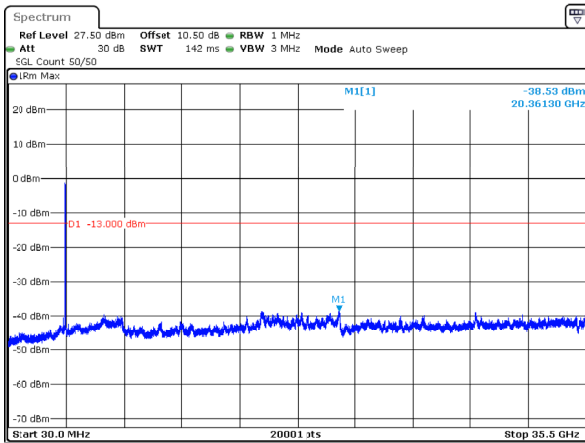


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:51:57

n77_1_90MHz_30kHz_3495MHz_DFT-s-OFDM
QPSK_RB1@0 -38.19dBm

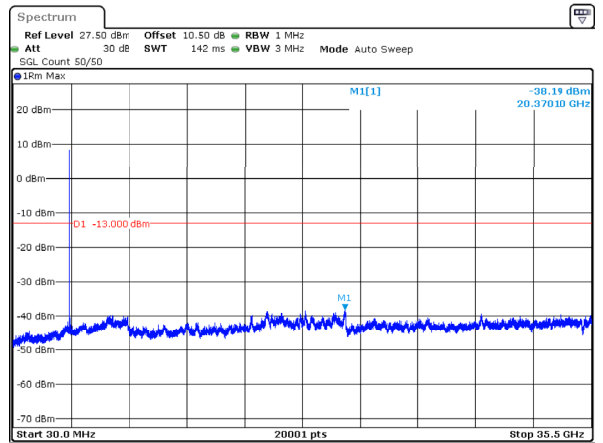


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:53:07

n77_1_90MHz_30kHz_3495MHz_DFT-s-OFDM
QPSK_RB1@244 -38.11dBm

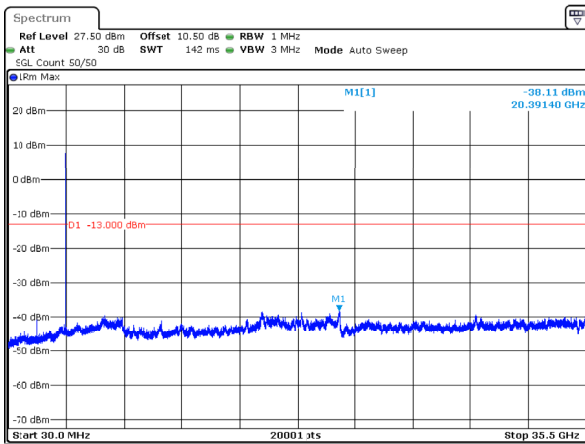


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:54:14

n77_1_90MHz_30kHz_3495MHz_DFT-s-OFDM
QPSK_RB243@0 -38.38dBm

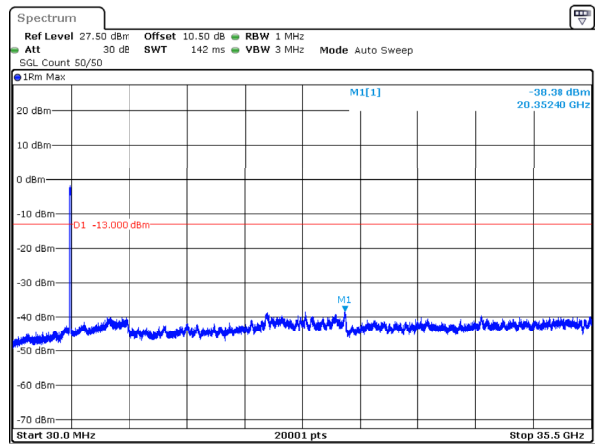


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:55:22

n77_1_90MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -38.18dBm

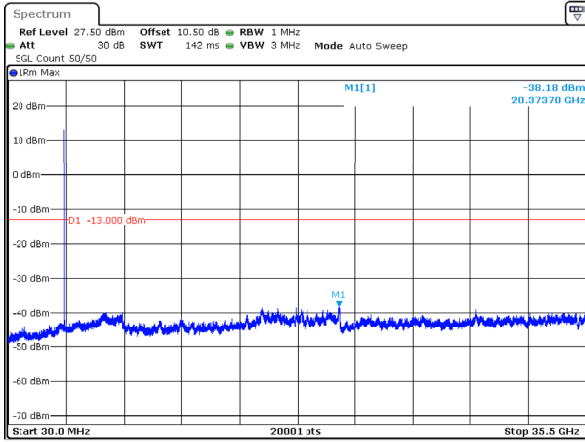


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:56:30

n77_1_90MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@244 -37.91dBm

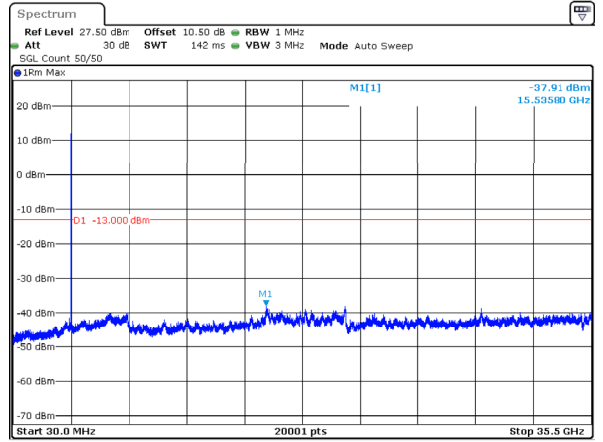


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:57:40

n77_1_90MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB243@0 -37.75dBm

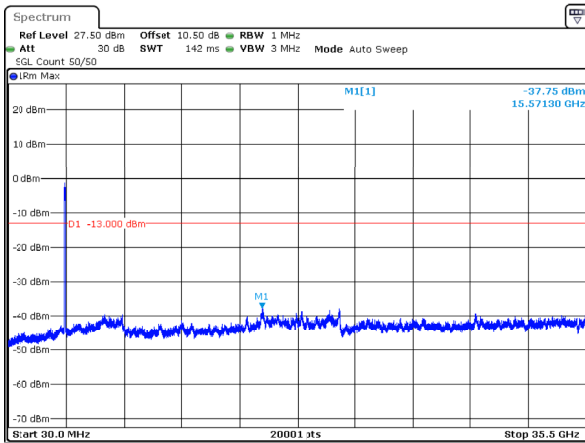


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 14:58:49

n77_1_90MHz_30kHz_3505MHz_DFT-s-OFDM
QPSK_RB1@0 -38.45dBm

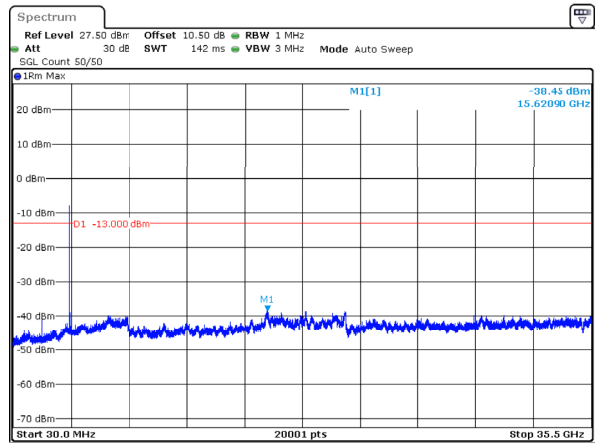


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 11:59:59

n77_1_90MHz_30kHz_3505MHz_DFT-s-OFDM
QPSK_RB1@244 -38.46dBm

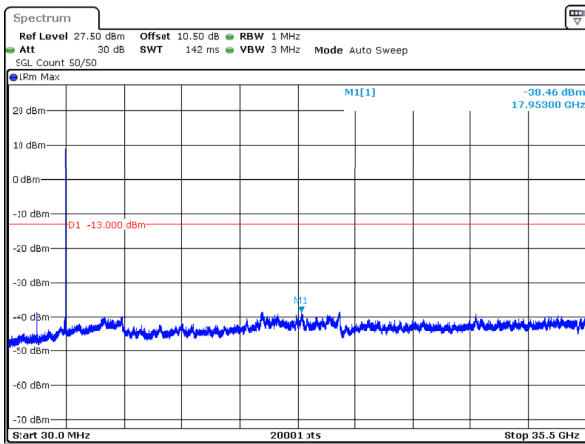


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 15:01:12

n77_1_90MHz_30kHz_3505MHz_DFT-s-OFDM
QPSK_RB243@0 -37.44dBm

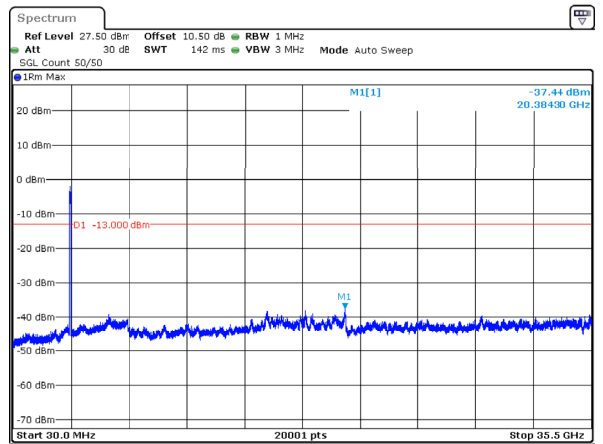


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 15:02:22

n77_1_100MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@0 -36.93dBm

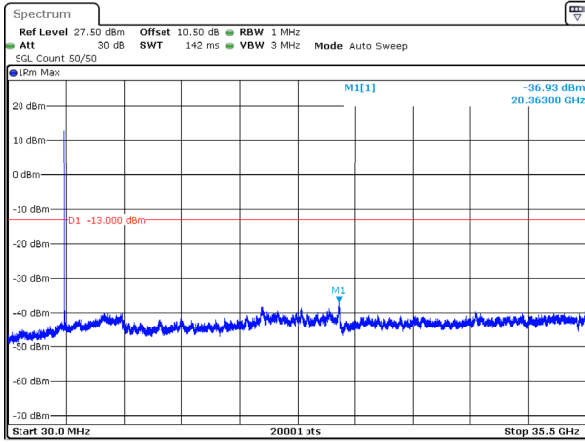

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 15:03:35


n77_1_100MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB1@272 -38.14dBm

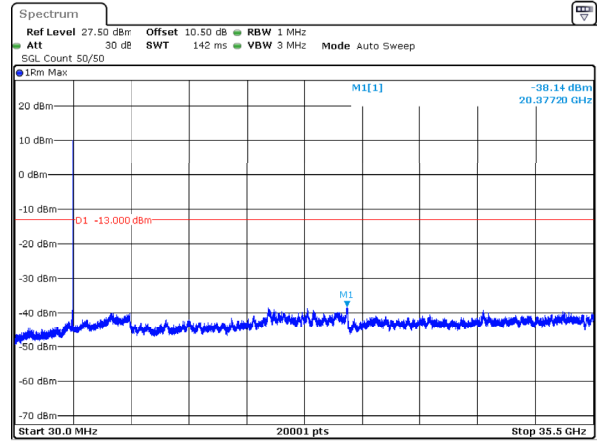

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 15:04:45


n77_3

n77_1_100MHz_30kHz_3500MHz_DFT-s-OFDM
QPSK_RB270@0 -37.36dBm

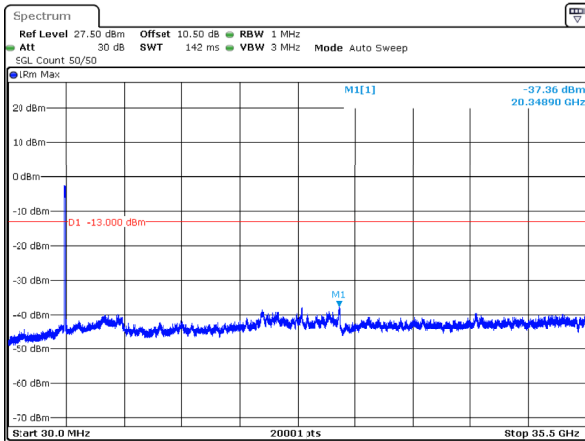


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 15:05:59

n77_3_10MHz_30kHz_3705MHz_DFT-s-OFDM
QPSK_RB1@0 -35.75dBm

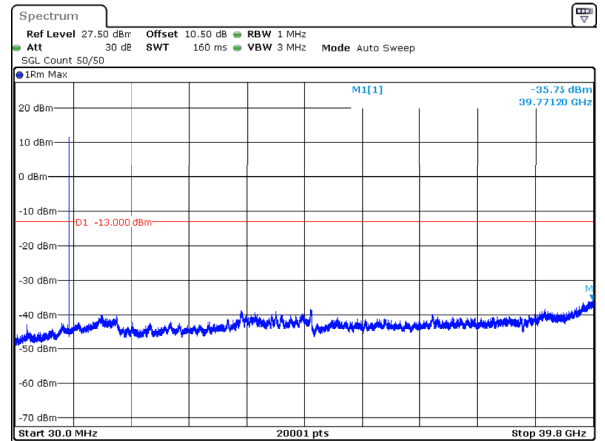


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:07:21

n77_3_10MHz_30kHz_3705MHz_DFT-s-OFDM
QPSK_RB1@23 -35.63dBm

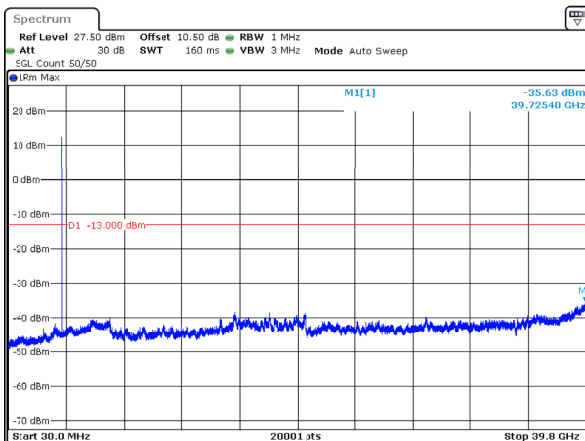


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 21:21:34

n77_3_10MHz_30kHz_3705MHz_DFT-s-OFDM
QPSK_RB24@0 -35.31dBm

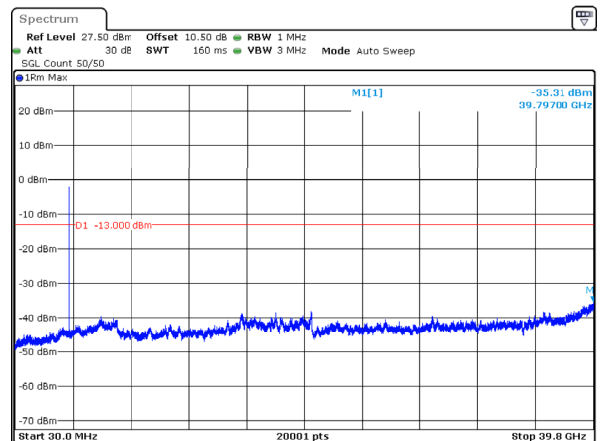


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 21:22:49

n77_3_10MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.97dBm

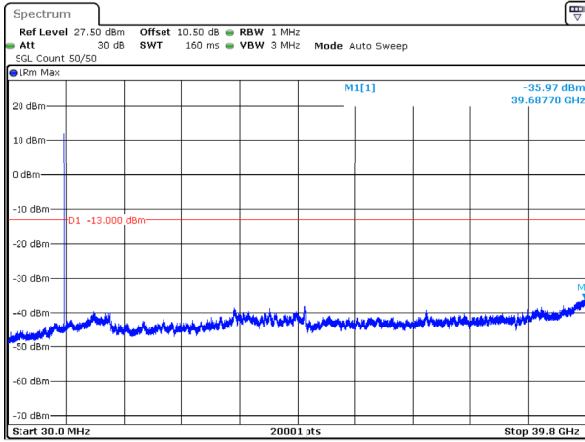


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 21:23:50

n77_3_10MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@23 -35.15dBm

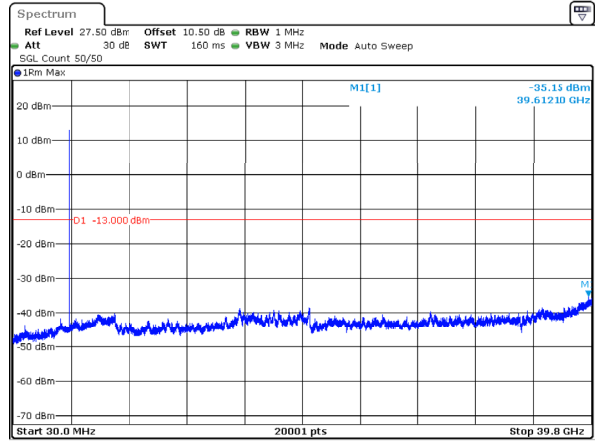


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:17:45

n77_3_10MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB24@0 -35.82dBm

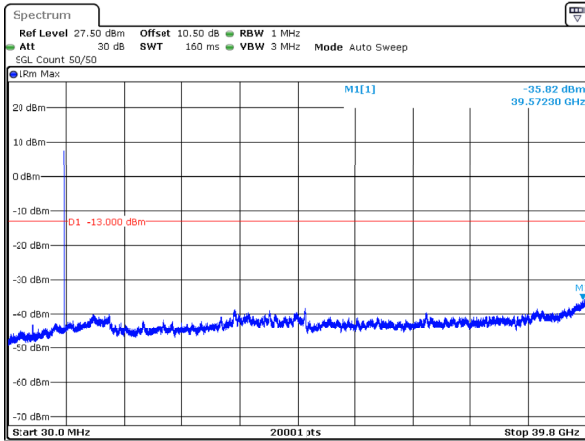


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:18:58

n77_3_10MHz_30kHz_3975MHz_DFT-s-OFDM
QPSK_RB1@0 -35.93dBm

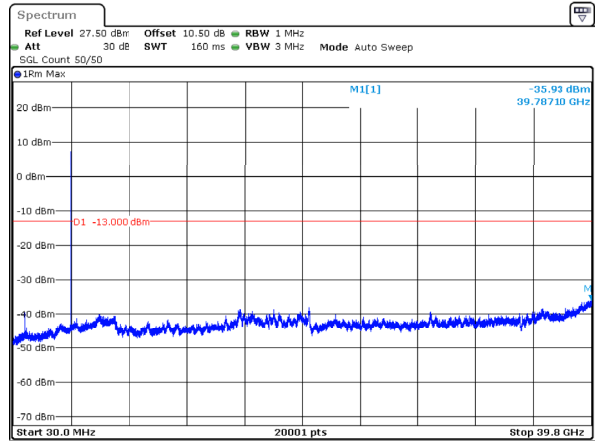


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:22:42

n77_3_10MHz_30kHz_3975MHz_DFT-s-OFDM
QPSK_RB1@23 -35.17dBm

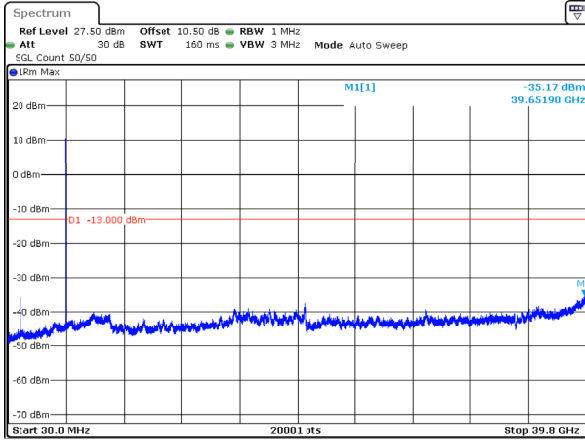


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:23:41

n77_3_10MHz_30kHz_3975MHz_DFT-s-OFDM
QPSK_RB24@0 -35.58dBm

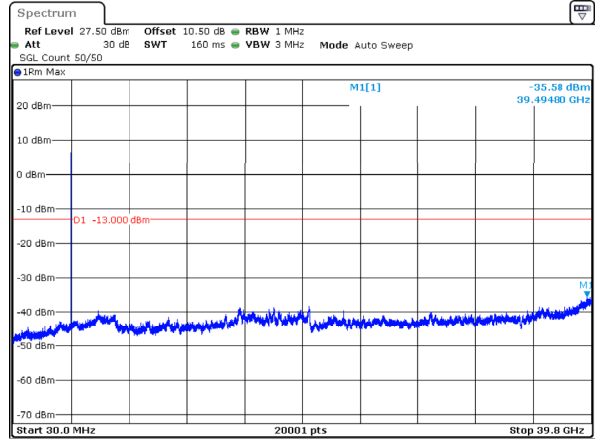


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:25:12

n77_3_15MHz_30kHz_3707.5MHz_DFT-s-OFDM
QPSK_RB1@0 -35.73dBm

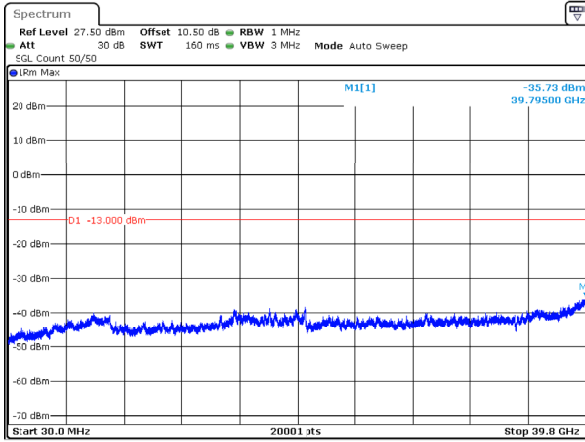


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:26:22

n77_3_15MHz_30kHz_3707.5MHz_DFT-s-OFDM
QPSK_RB1@37 -35.05dBm

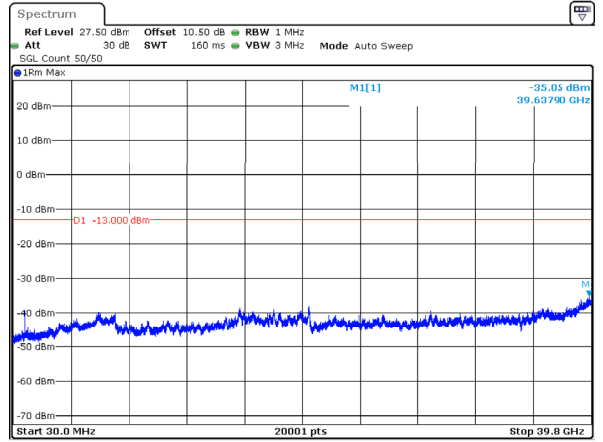


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:27:20

n77_3_15MHz_30kHz_3707.5MHz_DFT-s-OFDM
QPSK_RB36@0 -35.18dBm

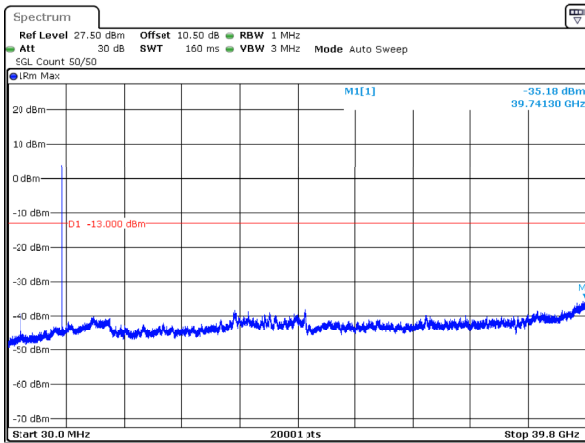


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:28:30

n77_3_15MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@0 -35.48dBm

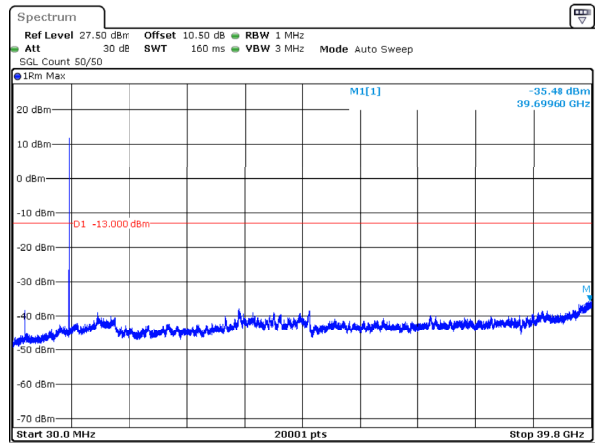


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:30:03

n77_3_15MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB1@37 -35.54dBm

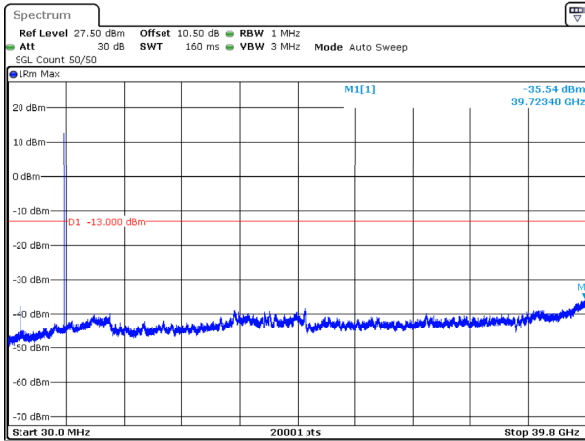


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:31:02

n77_3_15MHz_30kHz_3840MHz_DFT-s-OFDM
QPSK_RB36@0 -35.44dBm

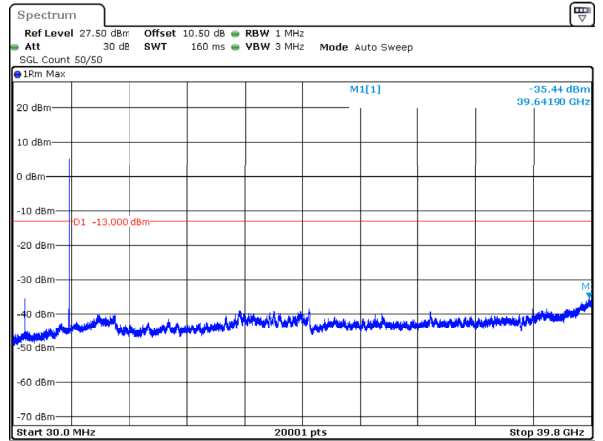


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:32:02

n77_3_15MHz_30kHz_3972.5MHz_DFT-s-OFDM
QPSK_RB1@0 -35.40dBm

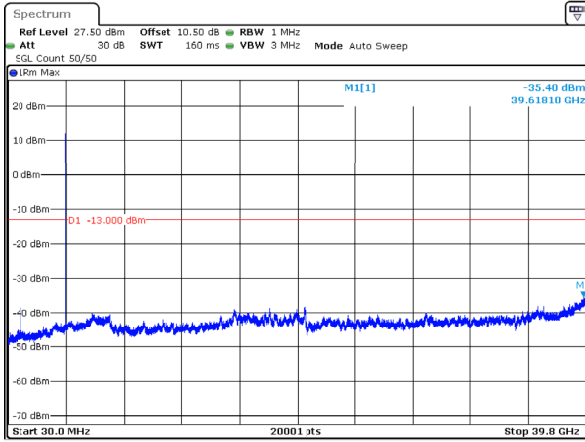


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:33:22

n77_3_15MHz_30kHz_3972.5MHz_DFT-s-OFDM
QPSK_RB1@37 -35.10dBm

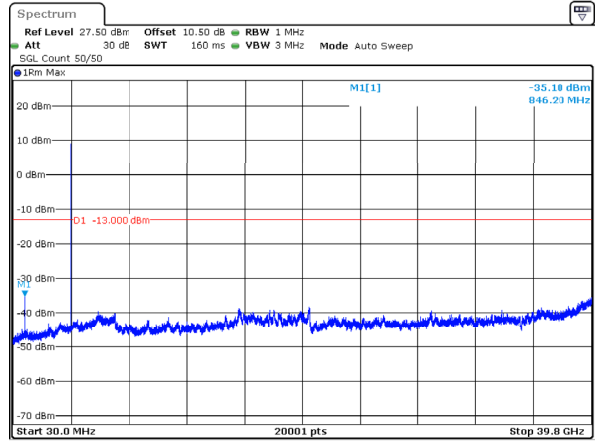


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:34:22

n77_3_15MHz_30kHz_3972.5MHz_DFT-s-OFDM
QPSK_RB36@0 -35.64dBm

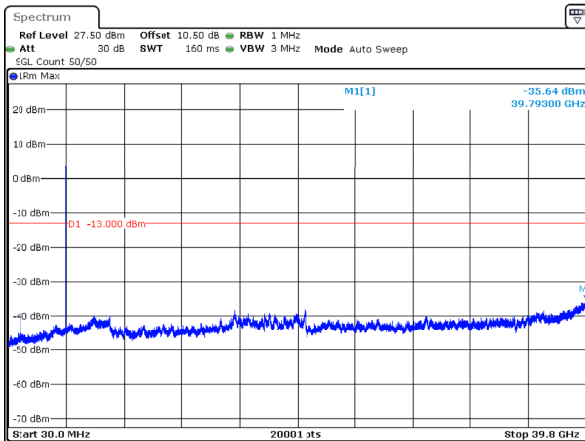


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:35:21

n77_3_20MHz_30kHz_3710MHz_DFT-s-OFDM
QPSK_RB1@0 -35.63dBm

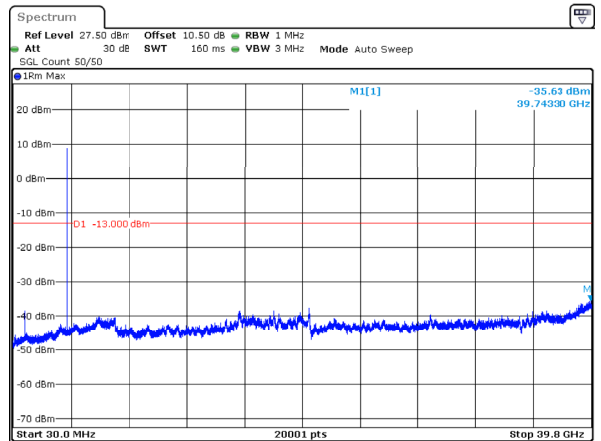


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:36:21

n77_3_20MHz_30kHz_3710MHz_DFT-s-OFDM
QPSK_RB1@50 -35.17dBm

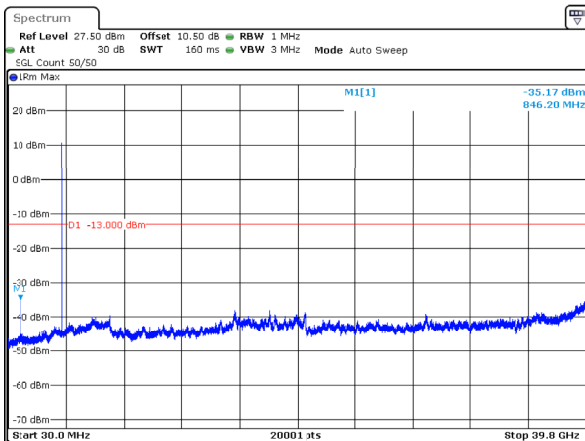

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:37:20

n77_3_20MHz_30kHz_3710MHz_DFT-s-OFDM
QPSK_RB50@0 -35.85dBm

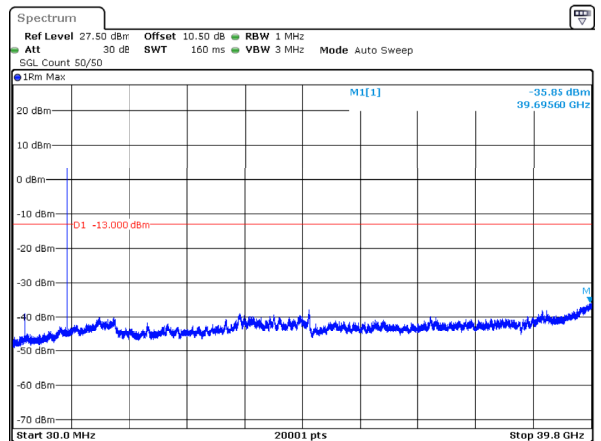

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 19.JUL.2024 17:38:20