


Mode	802.11ax(HE20)	Channel	157
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBUV)	(dB/m)	(dBUV/m)	(dBUV/m)	(dB)	
Horizontal	@	5629	40.4	19.62	60.02	68.2	-8.18	PK
		5664	39.63	19.64	59.27	78.59	-19.32	PK
		5785	82.93	20.37	103.3	N/A	N/A	PK
		5906	40.13	20.7	60.83	82.22	-21.39	PK
		5956.5	39.56	20.76	60.32	68.2	-7.88	PK
		11570	29.76	18.65	48.41	74	-25.59	PK
Vertical	@	5599	40.33	19.6	59.93	68.2	-8.27	PK
		5685.5	43.36	19.61	62.97	94.5	-31.53	PK
		5785	93.61	20.37	113.98	N/A	N/A	PK
		5887	43.29	20.69	63.98	96.29	-32.31	PK
		5942	40.43	20.75	61.18	68.2	-7.02	PK
		11570	28.72	18.65	47.37	74	-26.63	PK

TX, 802.11ax(HE20) (Ch 157)

Radiated Spurious Emission, Horizontal

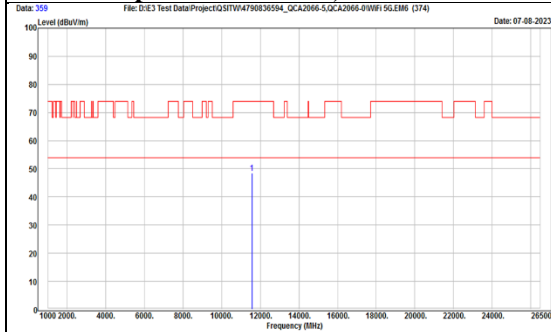


TX, 802.11ax(HE20) (Ch 157)

Radiated Spurious Emission, Vertical




TX, 802.11ax(HE20) (Ch 157)

Band Edge (Peak), Horizontal

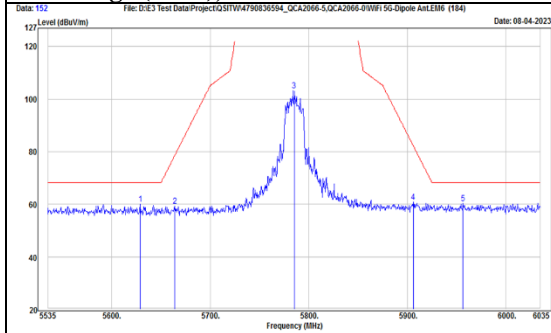


TX, 802.11ax(HE20) (Ch 157)

Band Edge (Peak), Vertical

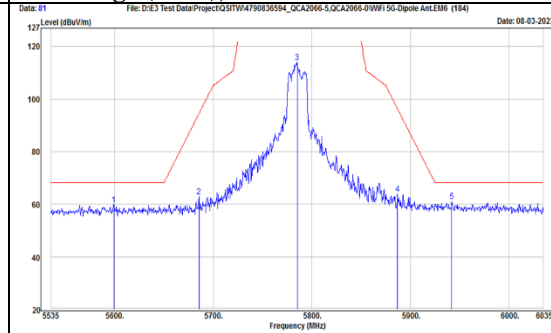

Mode	802.11ax(HE20)	Channel	165
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	82.05	20.57	102.62	N/A	N/A	PK
		5879	44.5	20.68	65.18	102.23	-37.05	PK
		5946	40.39	20.75	61.14	68.2	-7.06	PK
	*	11650	30.51	18.38	48.89	74	-25.11	PK
Vertical	@	5825	93.5	20.57	114.07	N/A	N/A	PK
		5880.5	55.72	20.69	76.41	101.11	-24.7	PK
		5926.5	46.17	20.73	66.9	68.2	-1.3	PK
	*	11650	29.78	18.38	48.16	74	-25.84	PK

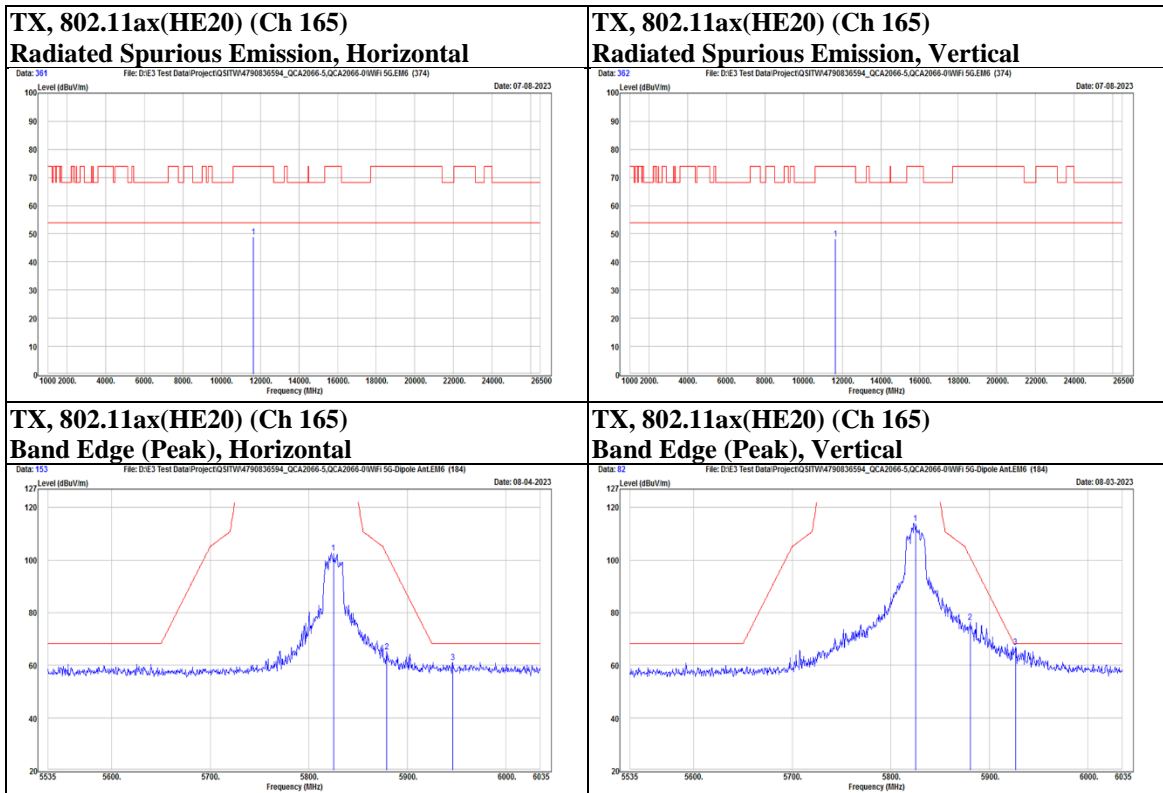

Mode	802.11ax(HE40)	Channel	38
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5061.95	41.44	19.04	60.48	74	-13.52	PK
		5098.35	29.72	19.24	48.96	54	-5.04	AVG
	@	5190	77.93	19.12	97.05	N/A	N/A	PK
	@	5190	67.29	19.12	86.41	N/A	N/A	AVG
	*	10380	31.63	17.19	48.82	68.2	-19.38	PK
Vertical		5148.4	34.2	19.22	53.42	54	-0.58	AVG
		5148.75	45.22	19.22	64.44	74	-9.56	PK
	@	5190	91.04	19.12	110.16	N/A	N/A	PK
	@	5190	81.21	19.12	100.33	N/A	N/A	AVG
	*	10380	32.63	17.19	49.82	68.2	-18.38	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

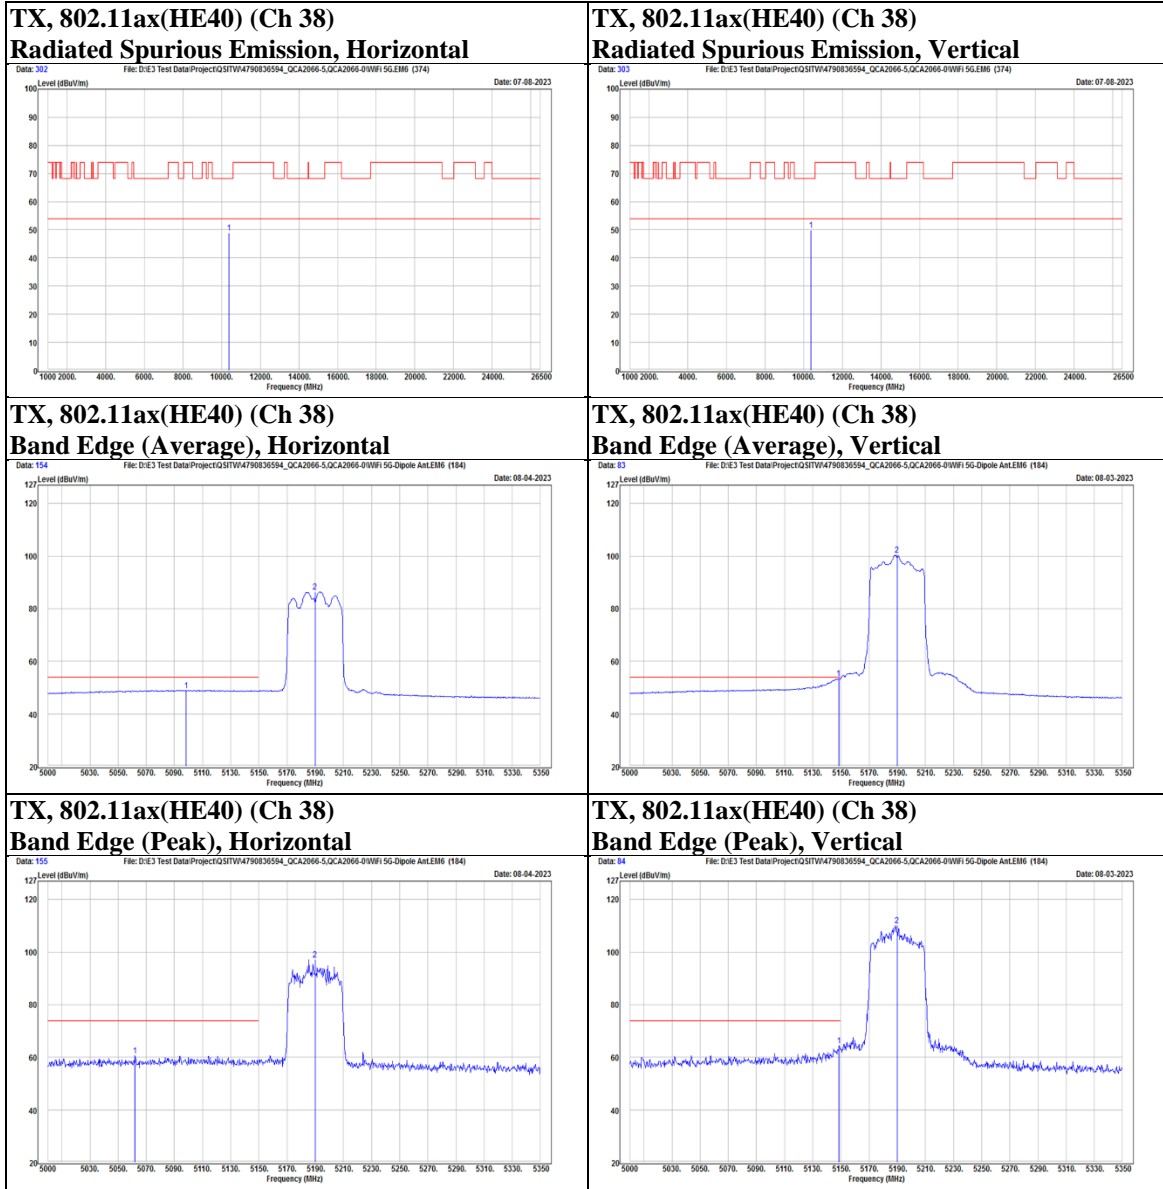

Mode	802.11ax(HE40)	Channel	46
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5080.85	41.74	19.15	60.89	74	-13.11	PK
		5102.55	29.78	19.24	49.02	54	-4.98	AVG
	@	5230	76.38	19.01	95.39	N/A	N/A	PK
	@	5230	69.25	19.01	88.26	N/A	N/A	AVG
	*	10460	31.23	17.5	48.73	68.2	-19.47	PK
Vertical		5105.7	41.91	19.25	61.16	74	-12.84	PK
		5149.8	30.02	19.22	49.24	54	-4.76	AVG
	@	5230	89.98	19.01	108.99	N/A	N/A	PK
	@	5230	81.43	19.01	100.44	N/A	N/A	AVG
	*	10460	30.65	17.5	48.15	68.2	-20.05	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

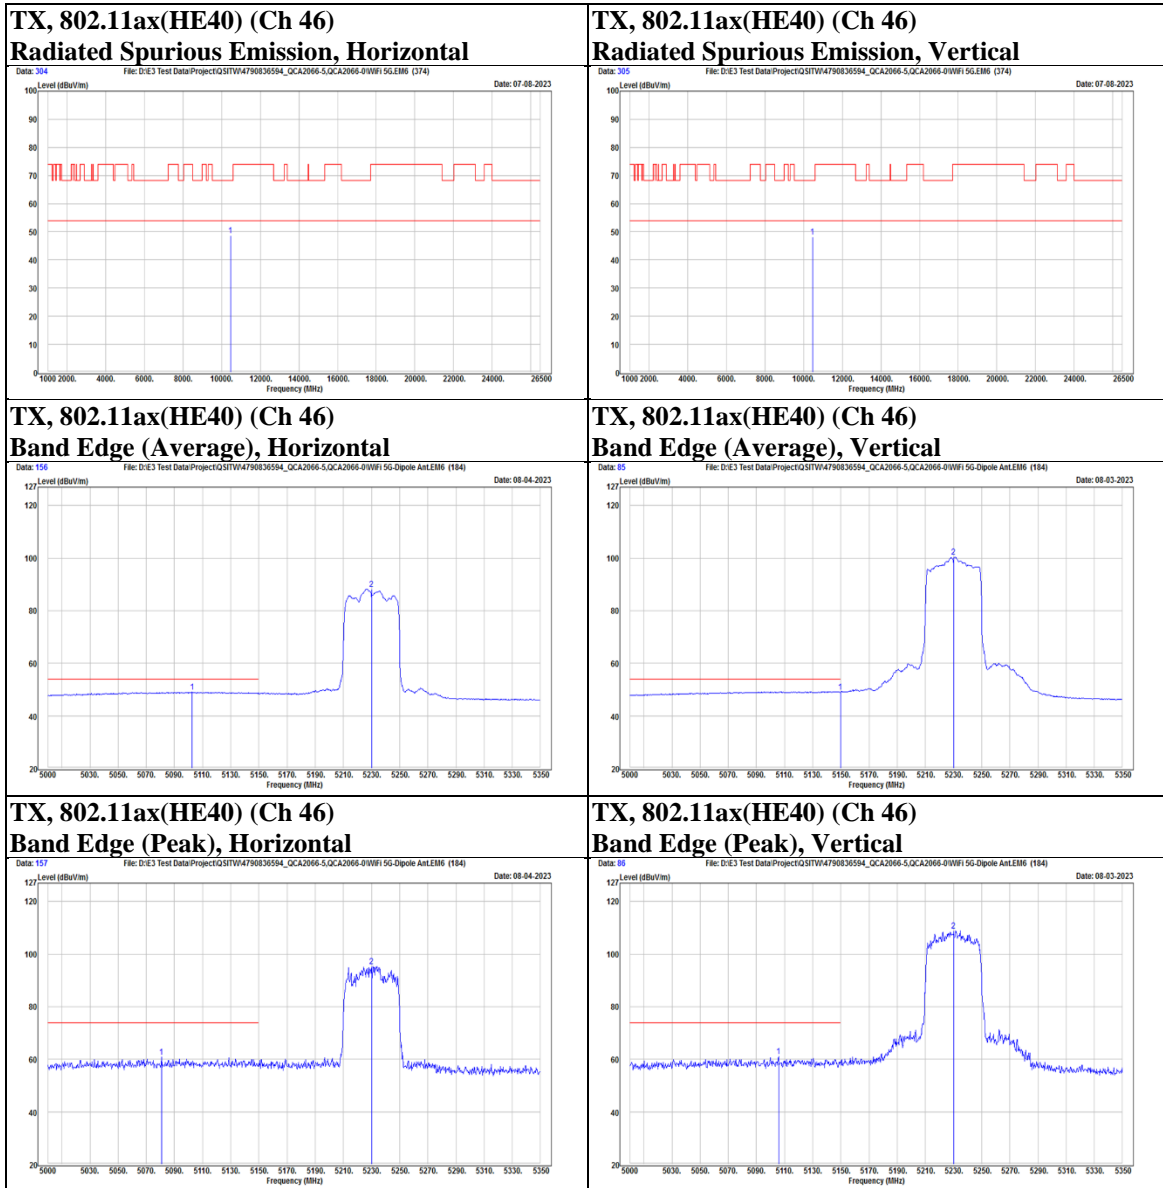

Mode	802.11ax(HE40)	Channel	54
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	76.59	18.87	95.46	N/A	N/A	PK
	@	5270	69.2	18.87	88.07	N/A	N/A	AVG
		5452.2	39.15	19.63	58.78	74	-15.22	PK
		5460	27.93	19.64	47.57	54	-6.43	AVG
	*	10540	30.76	17.65	48.41	68.2	-19.79	PK
Vertical	@	5270	92.7	18.87	111.57	N/A	N/A	PK
	@	5270	82.7	18.87	101.57	N/A	N/A	AVG
		5388.6	40.05	19.06	59.11	74	-14.89	PK
		5452.2	27.93	19.63	47.56	54	-6.44	AVG
	*	10540	30.22	17.65	47.87	68.2	-20.33	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

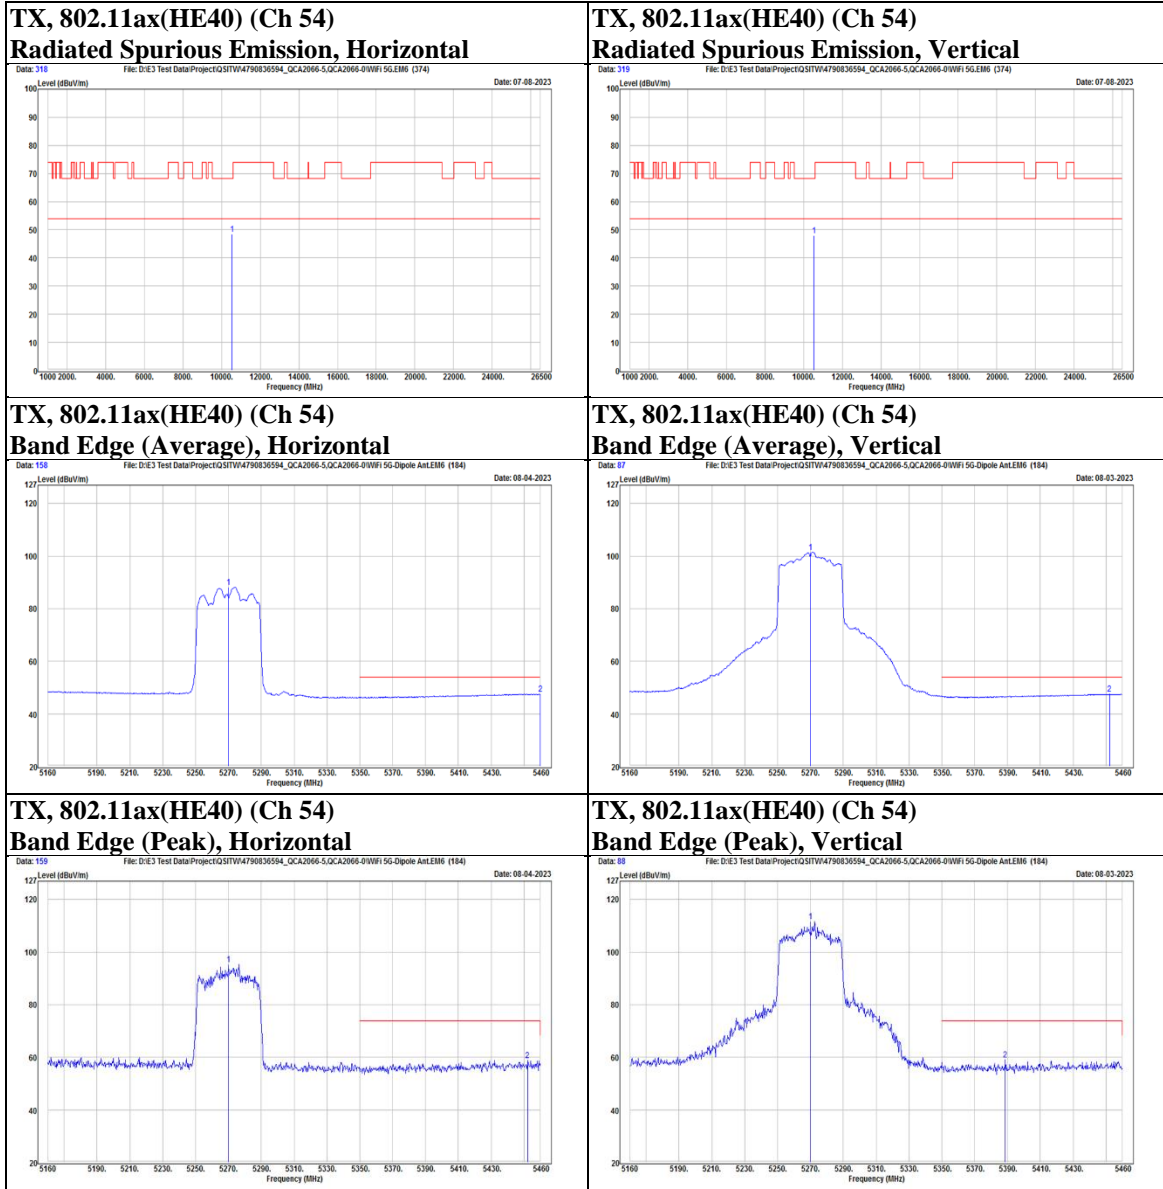

Mode	802.11ax(HE40)	Channel	62
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	78.42	18.72	97.14	N/A	N/A	PK
	@	5310	69.03	18.72	87.75	N/A	N/A	AVG
		5434.2	40.09	19.48	59.57	74	-14.43	PK
		5456.4	27.96	19.63	47.59	54	-6.41	AVG
	*	10620	30.21	17.68	47.89	74	-26.11	PK
Vertical	@	5310	88.86	18.72	107.58	N/A	N/A	PK
	@	5310	80.65	18.72	99.37	N/A	N/A	AVG
		5350.2	43.82	18.7	62.52	74	-11.48	PK
		5351.1	35.18	18.71	53.89	54	-0.11	AVG
	*	10620	31.56	17.68	49.24	74	-24.76	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

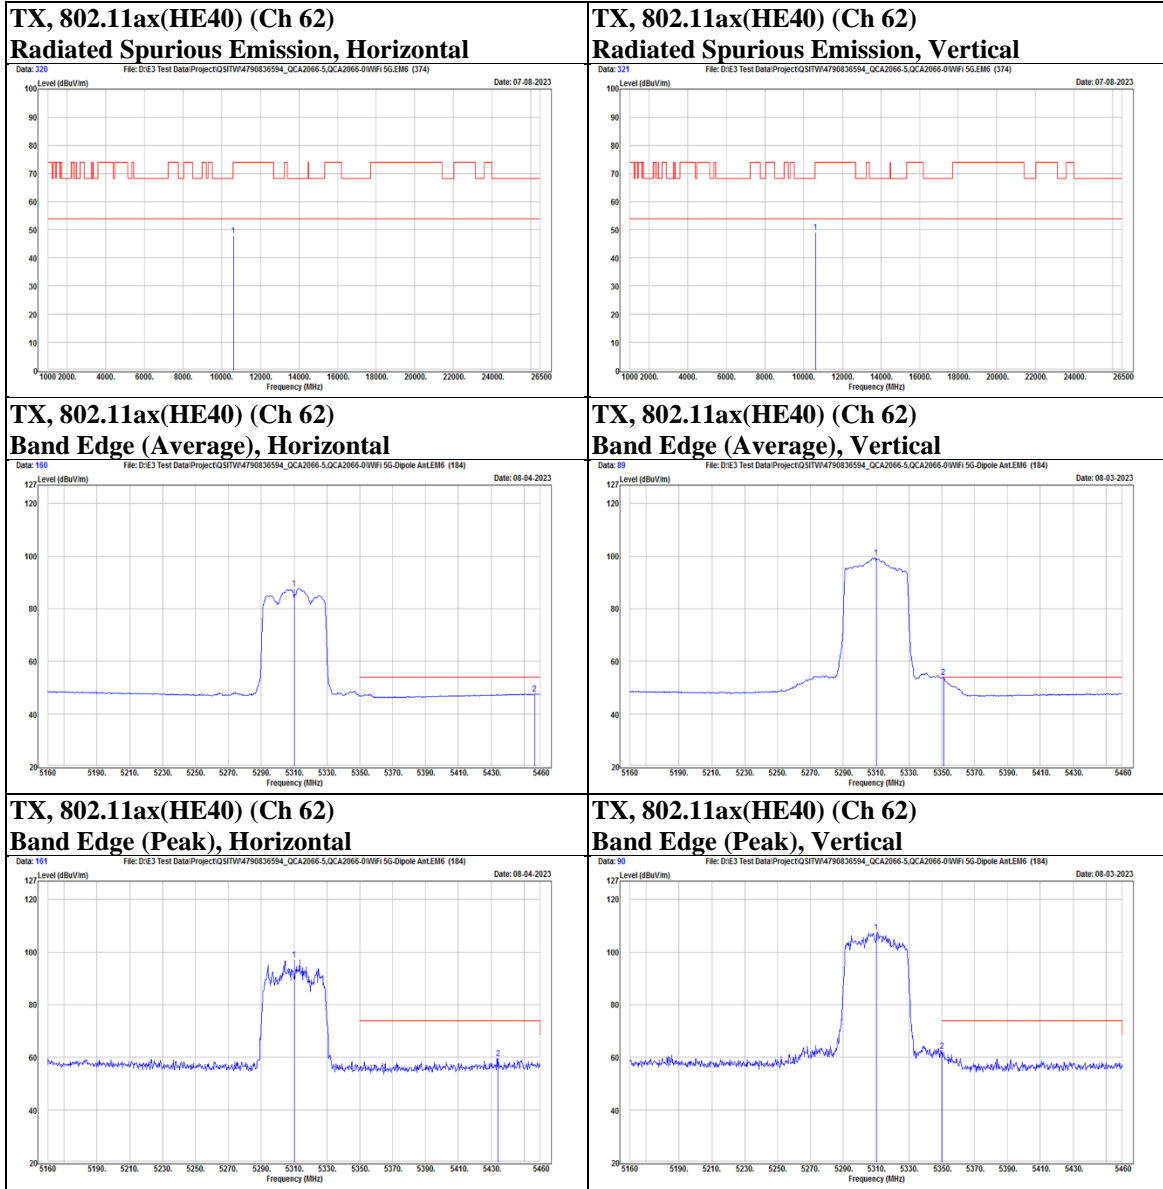

Mode	802.11ax(HE40)	Channel	102
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5406.3	40.07	19.21	59.28	74	-14.72	PK
		5457.75	28.08	19.63	47.71	54	-6.29	AVG
		5466.5	40.52	19.65	60.17	68.2	-8.03	PK
	@	5510	77.9	19.66	97.56	N/A	N/A	PK
	@	5510	67.51	19.66	87.17	N/A	N/A	AVG
	*	11020	30.1	17.97	48.07	74	-25.93	PK
Vertical		5459.5	43.49	19.64	63.13	74	-10.87	PK
		5459.85	34.08	19.64	53.72	54	-0.28	AVG
		5468.6	48.36	19.65	68.01	68.2	-0.19	PK
	@	5510	89.59	19.66	109.25	N/A	N/A	PK
	@	5510	80.76	19.66	100.42	N/A	N/A	AVG
	*	11020	30.3	17.97	48.27	74	-25.73	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

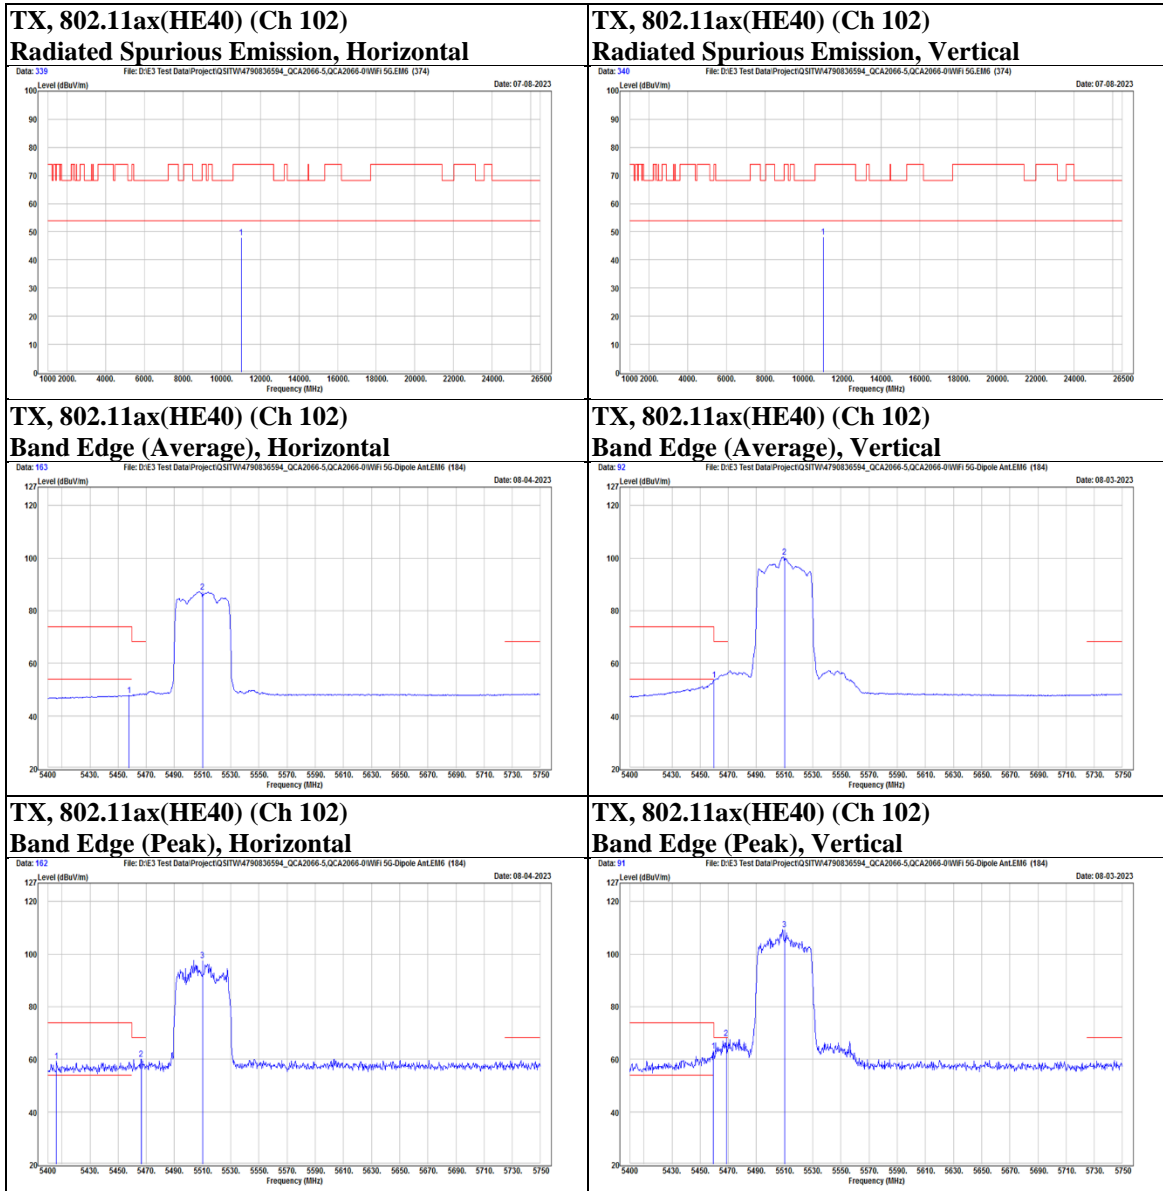

Mode	802.11ax(HE40)	Channel	110
------	----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5436.75	40.75	19.5	60.25	74	-13.75	PK
		5458.45	28.22	19.64	47.86	54	-6.14	AVG
		5464.75	38.64	19.65	58.29	68.2	-9.91	PK
	@	5550	78.05	19.54	97.59	N/A	N/A	PK
	@	5550	70.76	19.54	90.3	N/A	N/A	AVG
		5727.95	40.32	19.85	60.17	68.2	-8.03	PK
	*	11100	30.56	18.32	48.88	74	-25.12	PK
Vertical		5456.7	33.74	19.63	53.37	54	-0.63	AVG
		5459.15	44.38	19.64	64.02	74	-9.98	PK
		5463	47.41	19.64	67.05	68.2	-1.15	PK
	@	5550	92.69	19.54	112.23	N/A	N/A	PK
	@	5550	82.68	19.54	102.22	N/A	N/A	AVG
		5747.2	39.69	20.03	59.72	68.2	-8.48	PK
	*	11100	31.84	18.32	50.16	74	-23.84	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

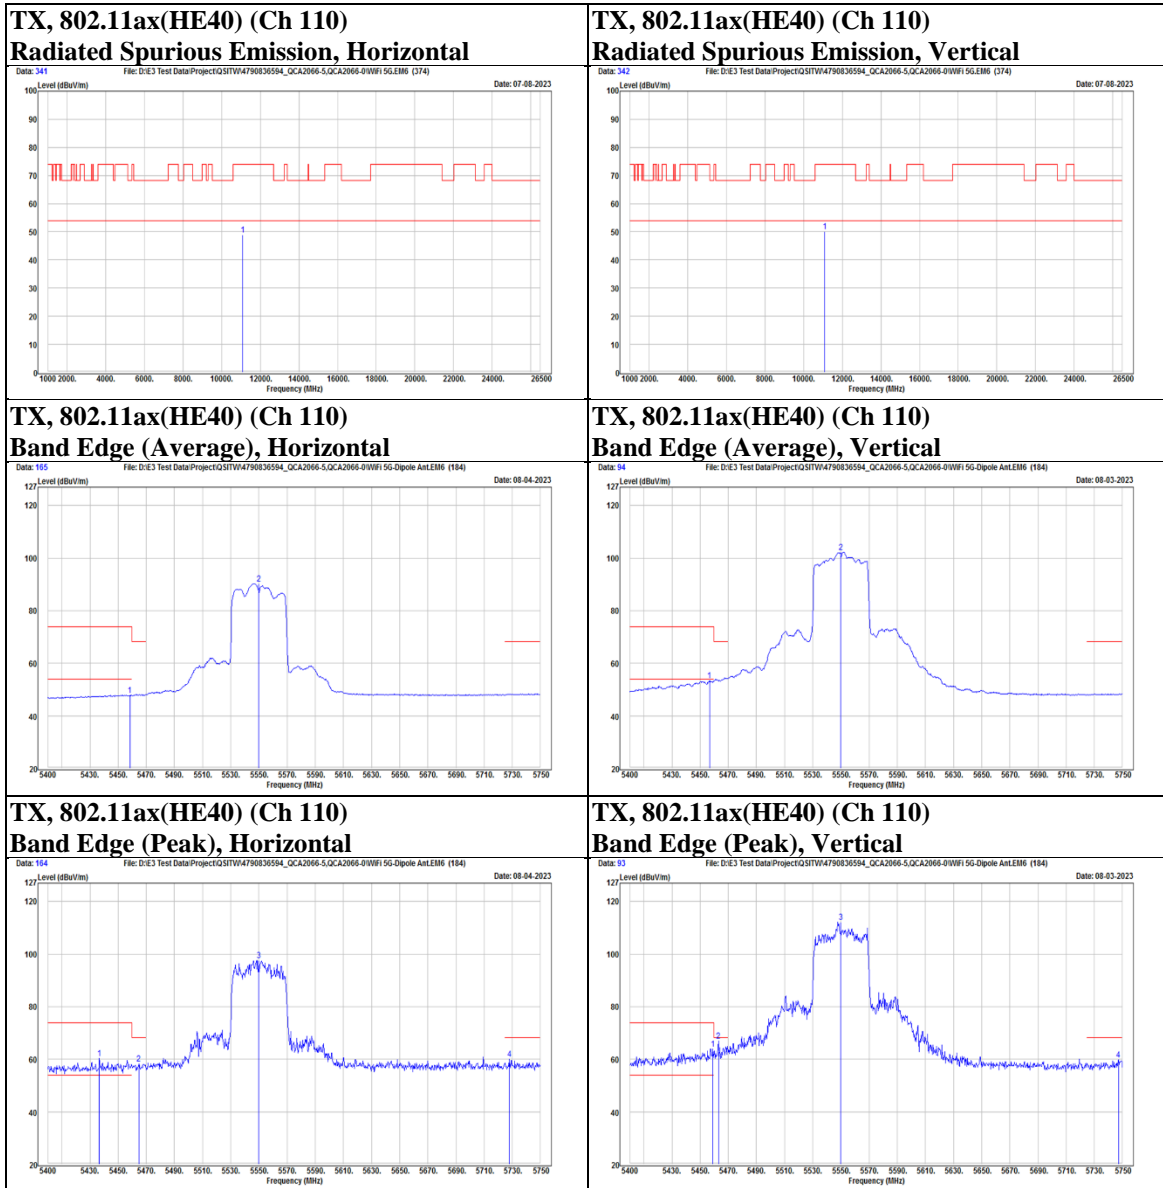

Mode	802.11ax(HE40)	Channel	134
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5409.8	39.37	19.25	58.62	74	-15.38	PK
		5456.35	27.93	19.63	47.56	54	-6.44	AVG
		5465.45	39.08	19.65	58.73	68.2	-9.47	PK
	@	5670	75.66	19.63	95.29	N/A	N/A	PK
	@	5670	66.26	19.63	85.89	N/A	N/A	AVG
		5740.2	40.05	19.96	60.01	68.2	-8.19	PK
	*	11340	28.57	18.26	46.83	74	-27.17	PK
Vertical		5436.4	39.36	19.5	58.86	74	-15.14	PK
		5457.4	27.93	19.63	47.56	54	-6.44	AVG
		5466.85	39.34	19.65	58.99	68.2	-9.21	PK
	@	5670	87.44	19.63	107.07	N/A	N/A	PK
	@	5670	78.13	19.63	97.76	N/A	N/A	AVG
		5729	43.86	19.86	63.72	68.2	-4.48	PK
	*	11340	29.46	18.26	47.72	74	-26.28	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

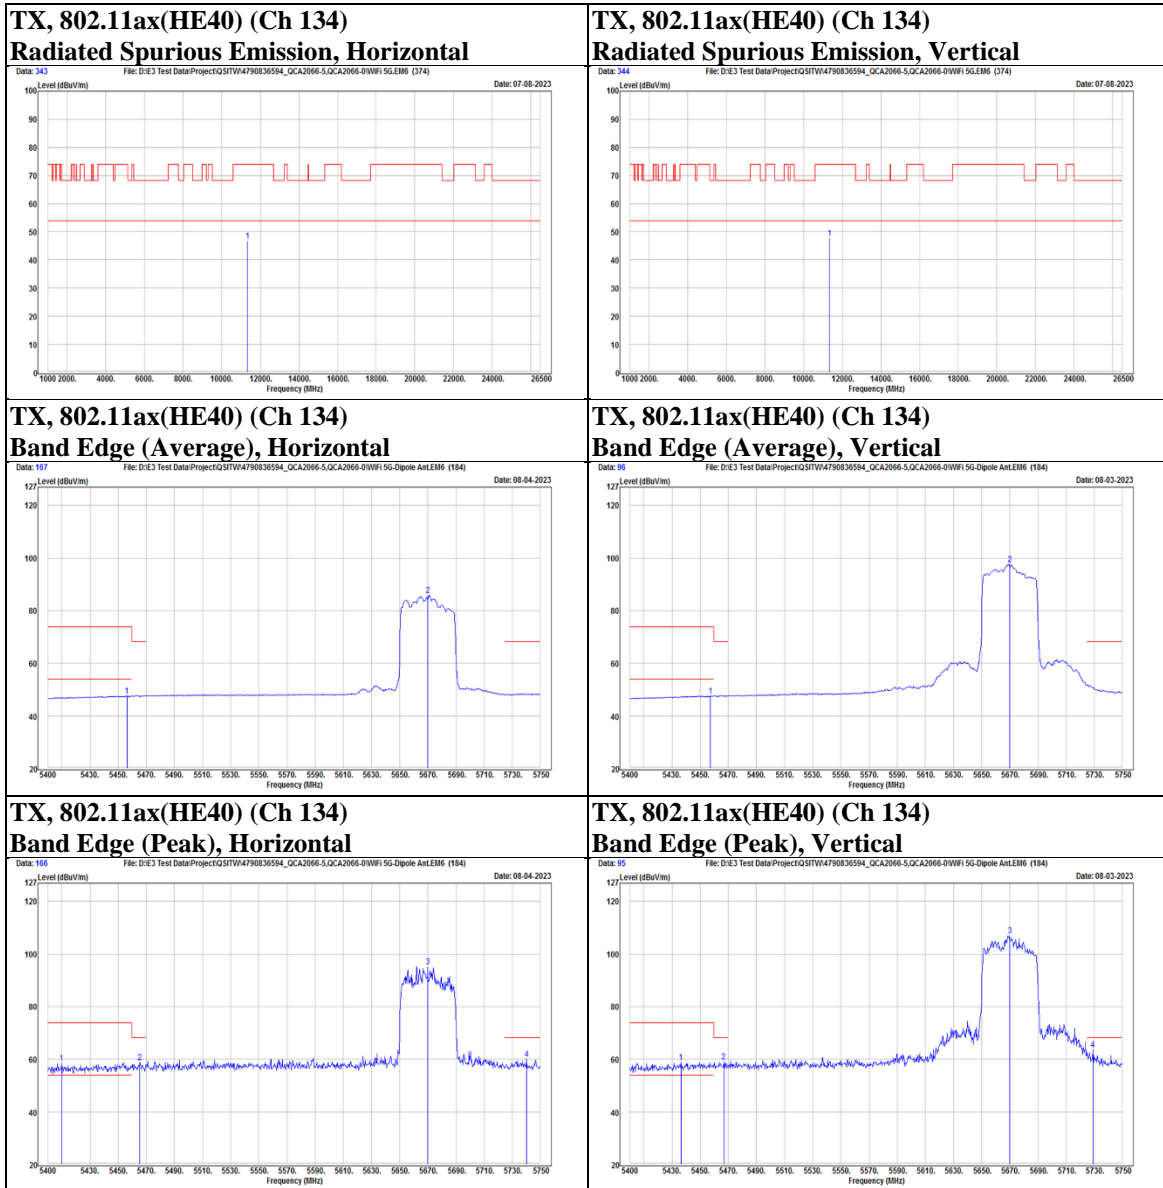


Mode	802.11ax(HE40)	Channel	142
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11420	29.33	18.55	47.88	74	-26.12	PK
Vertical	*	11420	29.03	18.55	47.58	74	-26.42	PK

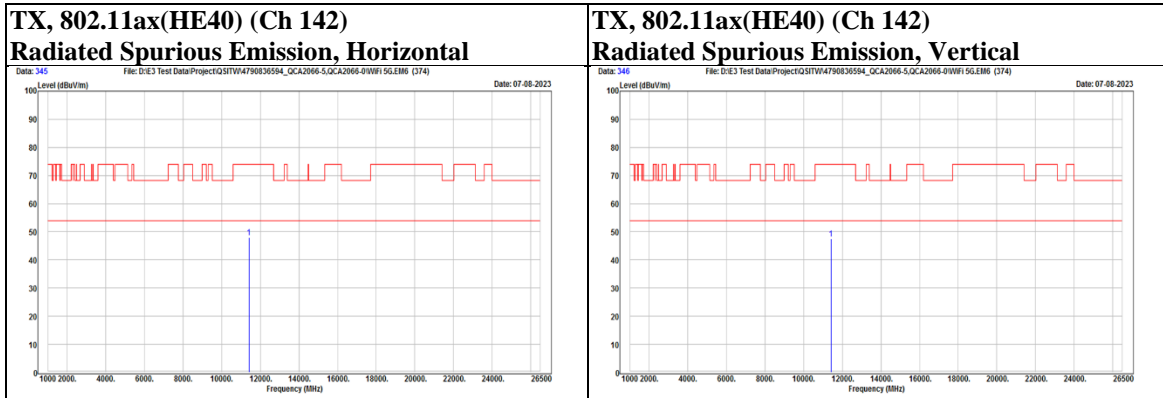

Mode	802.11ax(HE40)	Channel	151
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5616.5	40.56	19.61	60.17	68.2	-8.03	PK
		5694.5	42.39	19.6	61.99	101.15	-39.16	PK
	@	5755	77.83	20.09	97.92	N/A	N/A	PK
	*	11510	29.07	18.87	47.94	74	-26.06	PK
Vertical		5642	47.79	19.64	67.43	68.2	-0.77	PK
		5700	53.8	19.6	73.4	105.2	-31.8	PK
	@	5755	91.68	20.09	111.77	N/A	N/A	PK
	*	11510	29.38	18.87	48.25	74	-25.75	PK

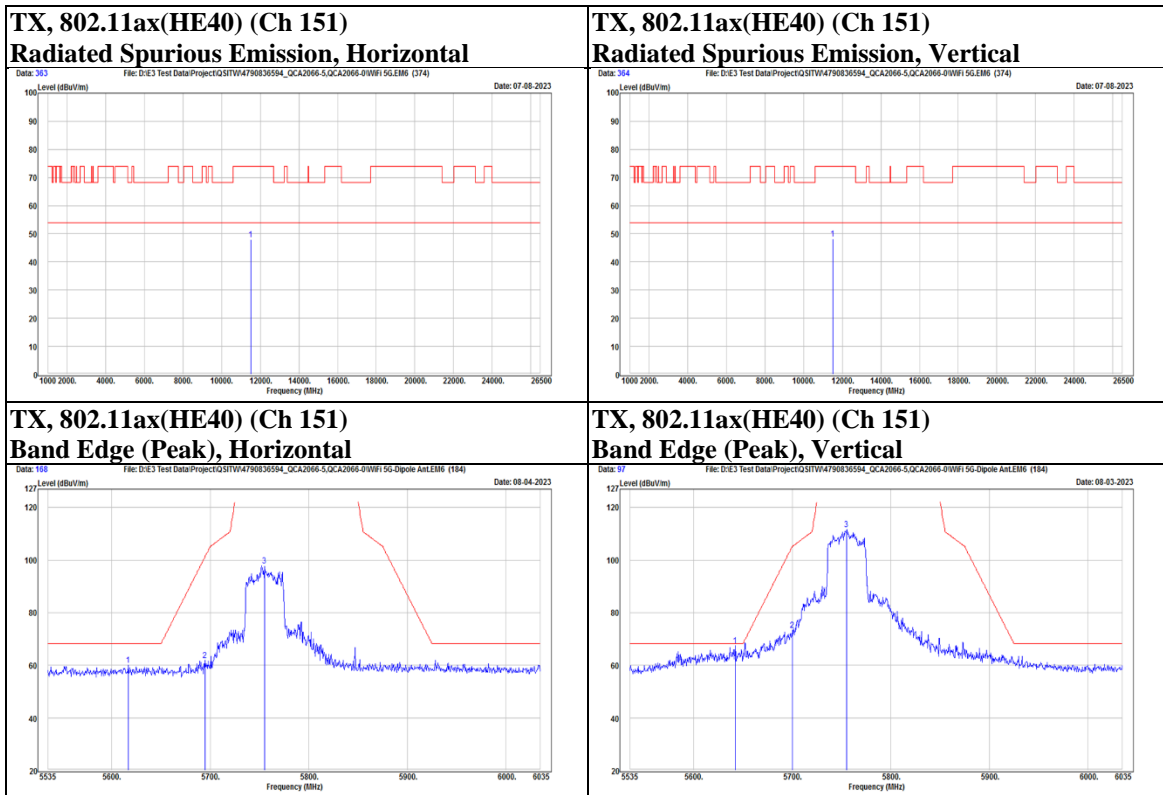

Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

Mode	802.11ax(HE40)	Channel	159
------	----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5795	78.35	20.46	98.81	N/A	N/A	PK
		5876	43.57	20.68	64.25	104.46	-40.21	PK
		5925.5	40.46	20.73	61.19	68.2	-7.01	PK
Vertical	*	11590	29.58	18.58	48.16	74	-25.84	PK
	@	5795	92.06	20.46	112.52	N/A	N/A	PK
		5878.5	52.75	20.68	73.43	102.6	-29.17	PK
		5952	47.33	20.76	68.09	68.2	-0.11	PK
	*	11590	29.26	18.58	47.84	74	-26.16	PK

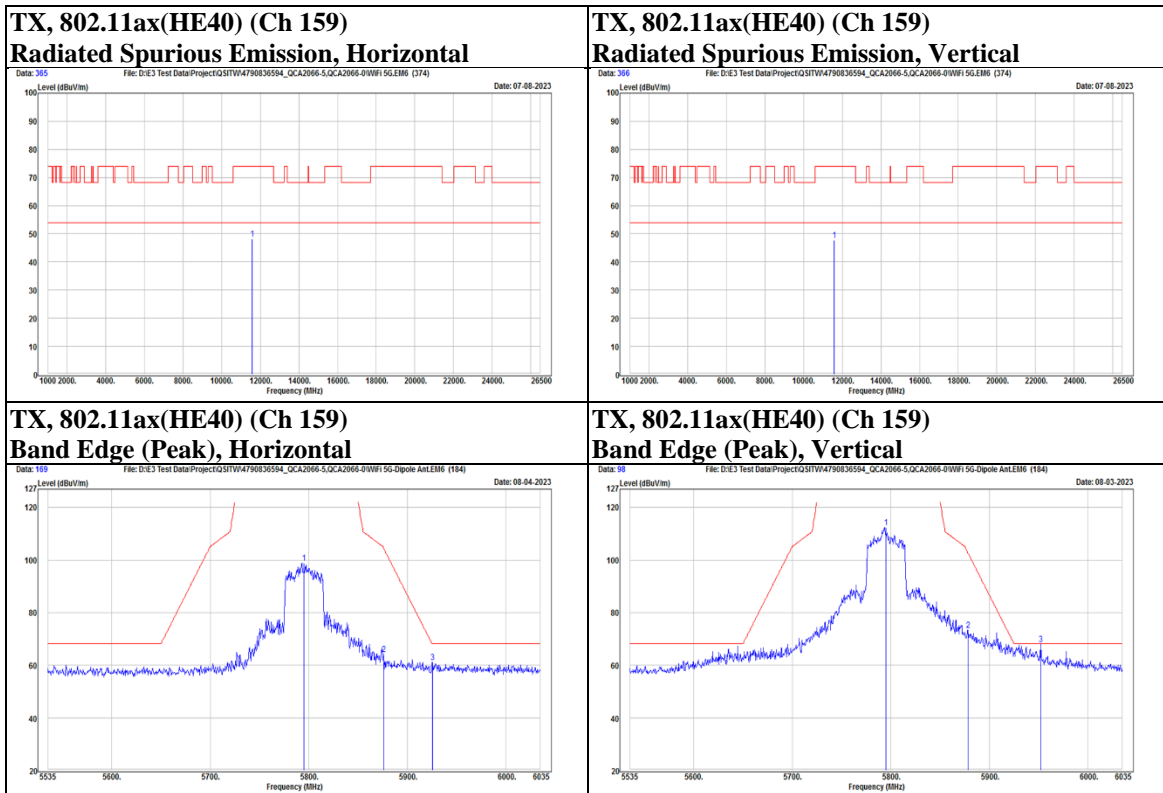

Mode	802.11ax(HE80)	Channel	42
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5088.2	41.53	19.19	60.72	74	-13.28	PK
		5144.55	29.76	19.22	48.98	54	-5.02	AVG
	@	5210	78.25	19.07	97.32	N/A	N/A	PK
	@	5210	67.36	19.07	86.43	N/A	N/A	AVG
	*	10420	30.68	17.4	48.08	68.2	-20.12	PK
Vertical		5135.8	33.93	19.23	53.16	54	-0.84	AVG
		5138.25	44.76	19.22	63.98	74	-10.02	PK
	@	5210	85.99	19.07	105.06	N/A	N/A	PK
	@	5210	77.2	19.07	96.27	N/A	N/A	AVG
	*	10420	30.67	17.4	48.07	68.2	-20.13	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

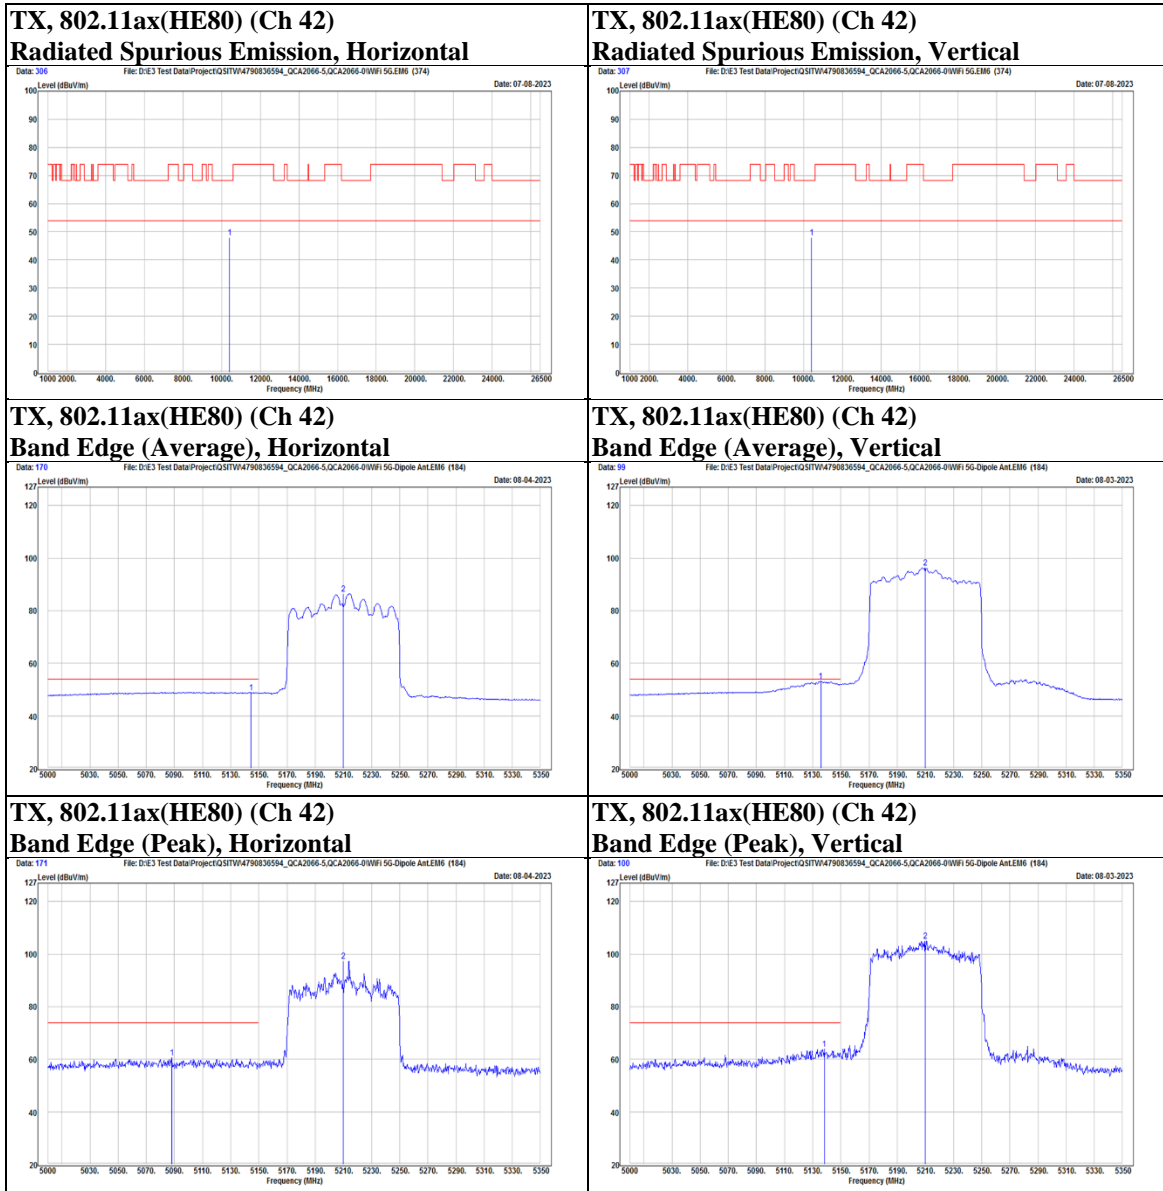

Mode	802.11ax(HE80)	Channel	58
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5290	76.46	18.77	95.23	N/A	N/A	PK
	@	5290	66.35	18.77	85.12	N/A	N/A	AVG
		5355	29.07	18.74	47.81	54	-6.19	AVG
		5420.1	39.36	19.35	58.71	74	-15.29	PK
	*	10580	31.05	17.68	48.73	68.2	-19.47	PK
Vertical	@	5290	87.8	18.77	106.57	N/A	N/A	PK
	@	5290	78.7	18.77	97.47	N/A	N/A	AVG
		5359.8	34.4	18.79	53.19	54	-0.81	AVG
		5367.3	44.15	18.85	63	74	-11	PK
	*	10580	30.31	17.68	47.99	68.2	-20.21	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

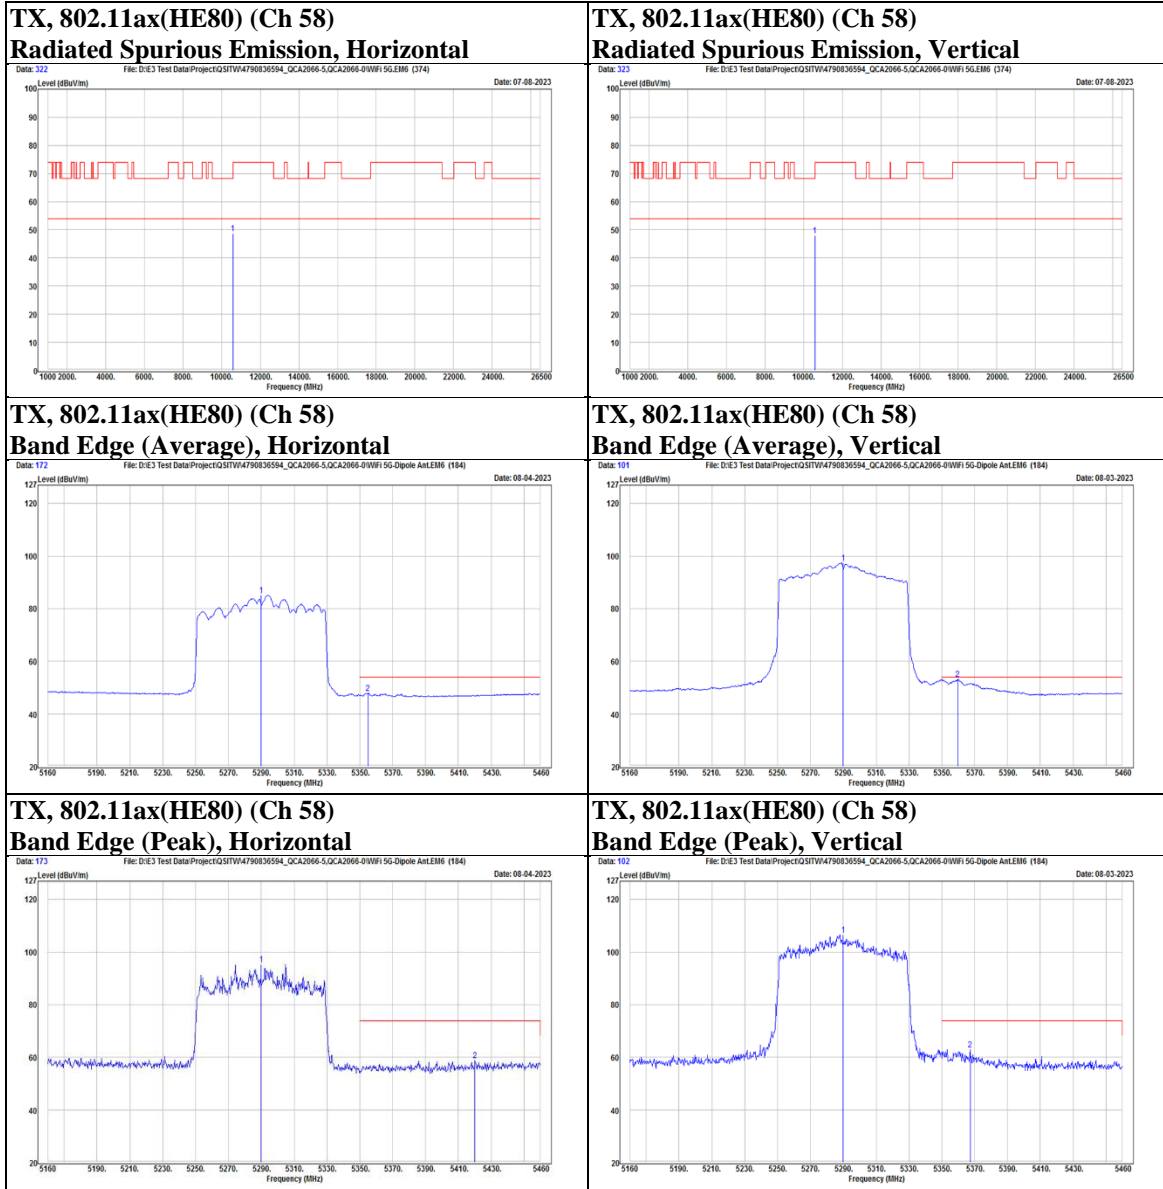

Mode	802.11ax(HE80)	Channel	106
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5449.35	38.86	19.61	58.47	74	-15.53	PK
		5456.35	28.5	19.63	48.13	54	-5.87	AVG
		5468.6	39.22	19.65	58.87	68.2	-9.33	PK
	@	5530	71.57	19.61	91.18	N/A	N/A	PK
	@	5530	62.43	19.61	82.04	N/A	N/A	AVG
	*	11060	29.95	18.15	48.1	74	-25.9	PK
Vertical		5457.05	43.8	19.63	63.43	74	-10.57	PK
		5457.75	33.93	19.63	53.56	54	-0.44	AVG
		5466.85	44.99	19.65	64.64	68.2	-3.56	PK
	@	5530	81.69	19.61	101.3	N/A	N/A	PK
	@	5530	73.57	19.61	93.18	N/A	N/A	AVG
	*	11060	31.11	18.15	49.26	74	-24.74	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

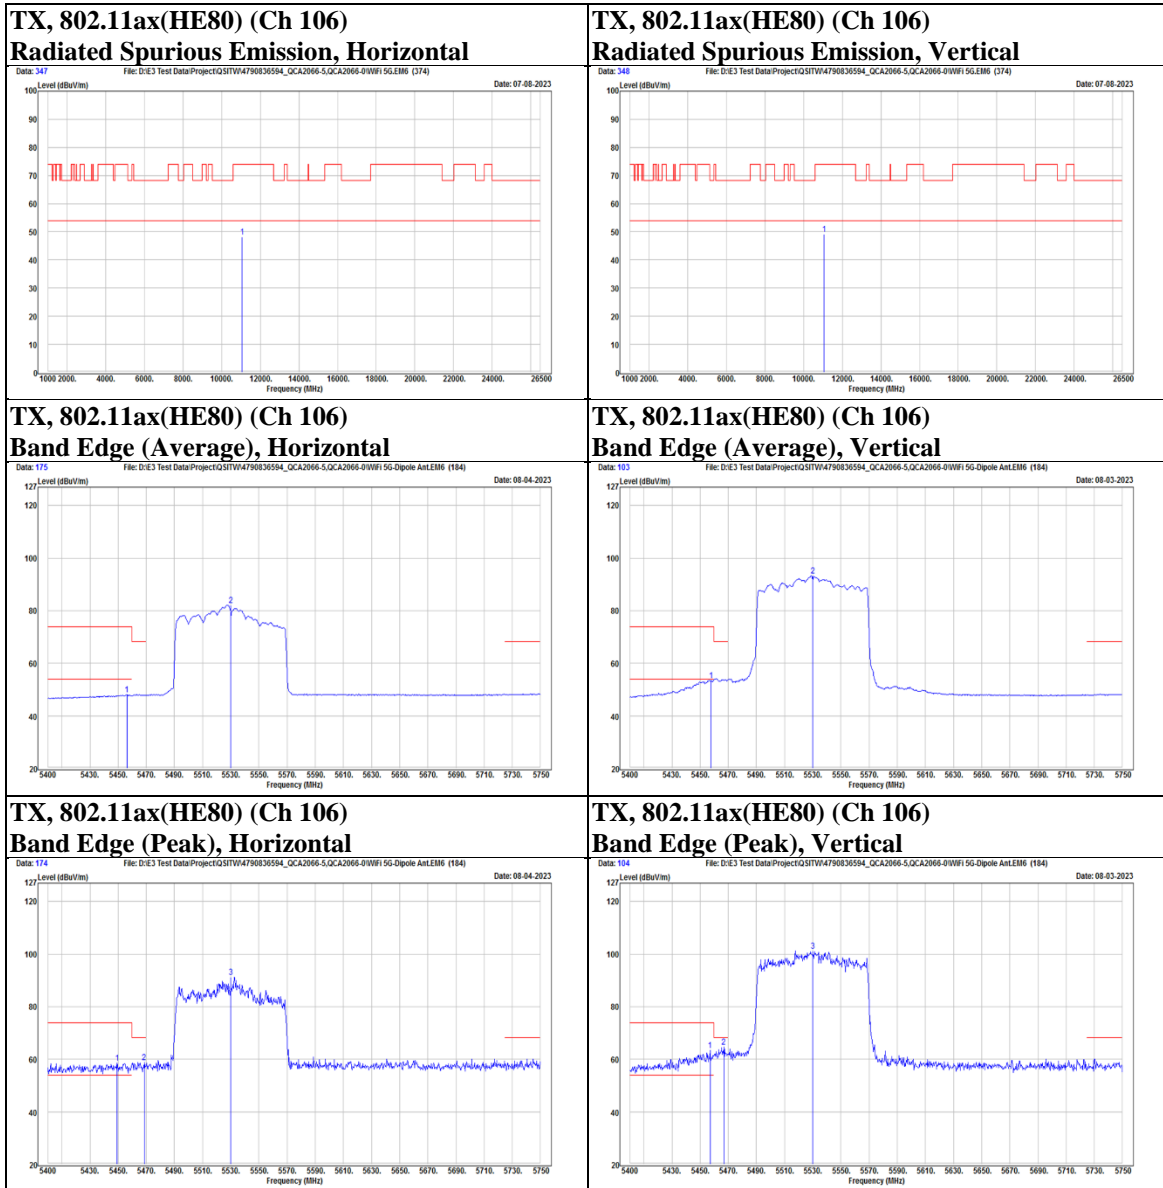

Mode	802.11ax(HE80)	Channel	122
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5415.4	39.73	19.3	59.03	74	-14.97	PK
		5452.5	28.22	19.63	47.85	54	-6.15	AVG
		5468.25	39.83	19.65	59.48	68.2	-8.72	PK
	@	5610	73.82	19.6	93.42	N/A	N/A	PK
	@	5610	63.42	19.6	83.02	N/A	N/A	AVG
		5743.7	41.56	20	61.56	68.2	-6.64	PK
	*	11220	29.02	17.92	46.94	74	-27.06	PK
Vertical		5451.45	43.61	19.62	63.23	74	-10.77	PK
		5459.85	32.75	19.64	52.39	54	-1.61	AVG
		5469.65	43.98	19.65	63.63	68.2	-4.57	PK
	@	5610	87.89	19.6	107.49	N/A	N/A	PK
	@	5610	78.24	19.6	97.84	N/A	N/A	AVG
		5738.45	41.27	19.95	61.22	68.2	-6.98	PK
	*	11220	29.48	17.92	47.4	74	-26.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

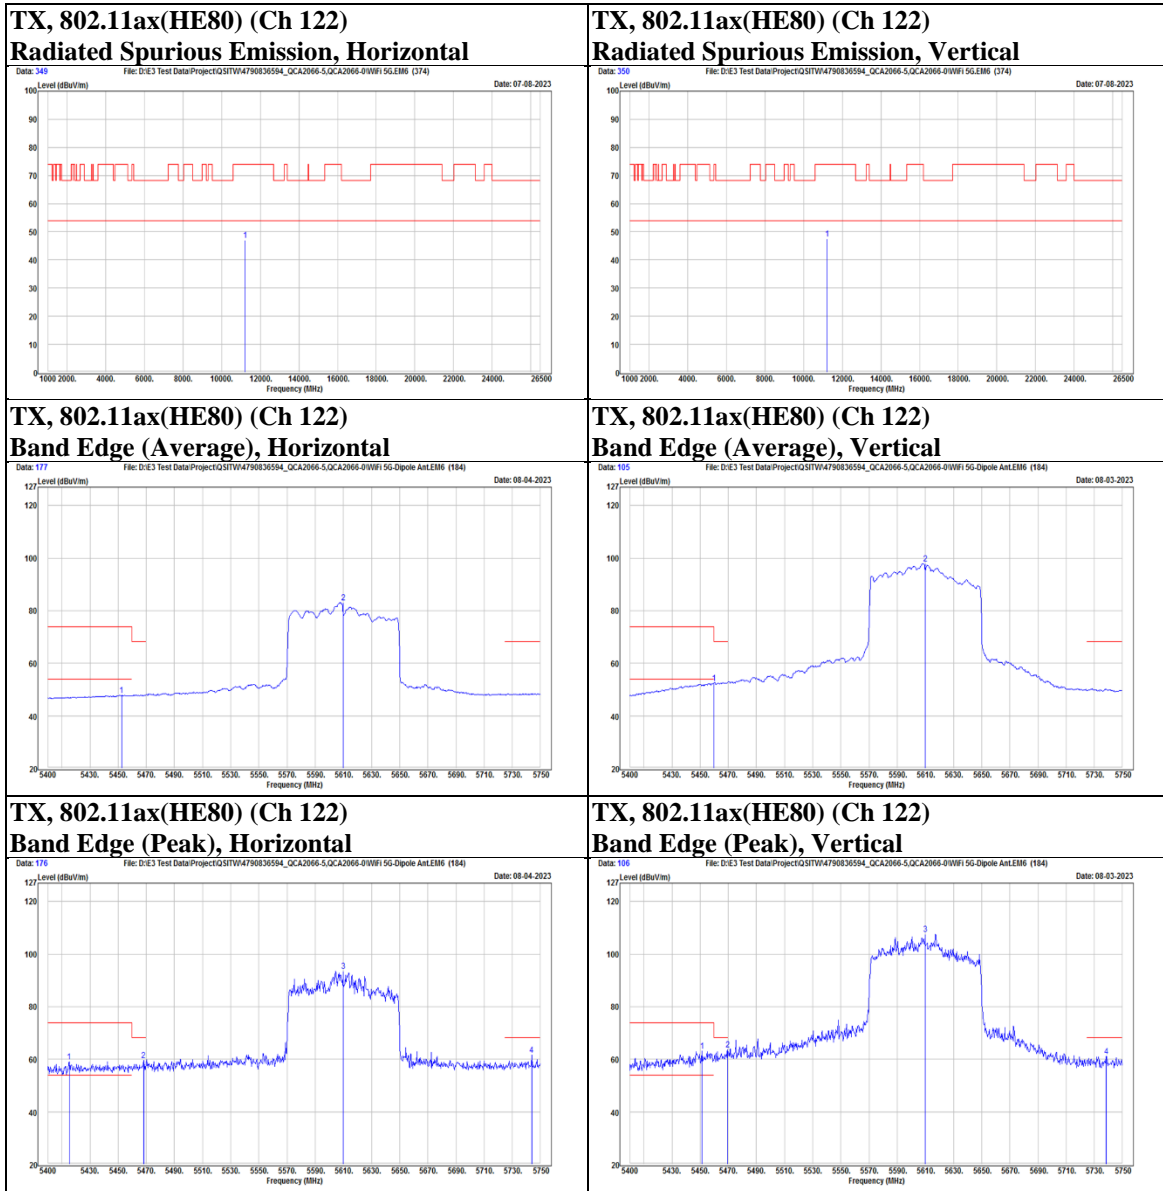

Mode	802.11ax(HE80)	Channel	138
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11380	28.91	18.39	47.3	74	-26.7	PK
Vertical	*	11380	29.42	18.39	47.81	74	-26.19	PK

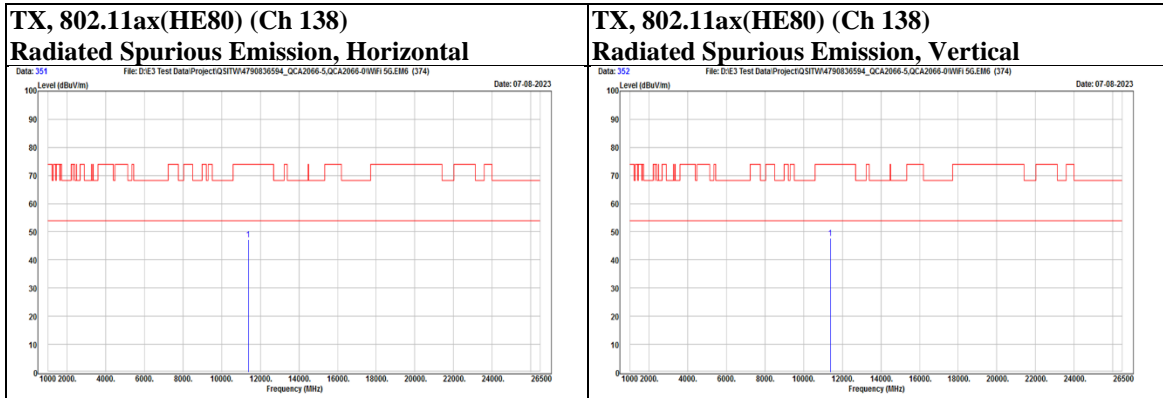


Mode	802.11ax(HE80)	Channel	155
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5547	41.15	19.55	60.7	68.2	-7.5	PK
		5695.5	41.44	19.6	61.04	101.88	-40.84	PK
		5775	78.9	20.28	99.18	N/A	N/A	PK
		5890.5	41.76	20.7	62.46	93.7	-31.24	PK
		5980	40.5	20.78	61.28	68.2	-6.92	PK
		* 11550	29.35	18.73	48.08	74	-25.92	PK
Vertical	@	5631.5	47.96	19.63	67.59	68.2	-0.61	PK
		5695	52.57	19.6	72.17	101.51	-29.34	PK
		5775	86.88	20.28	107.16	N/A	N/A	PK
		5893	46.54	20.69	67.23	91.84	-24.61	PK
		5951.5	42.82	20.76	63.58	68.2	-4.62	PK
		* 11550	28.88	18.73	47.61	74	-26.39	PK


TX, 802.11ax(HE80) (Ch 155)

Radiated Spurious Emission, Horizontal

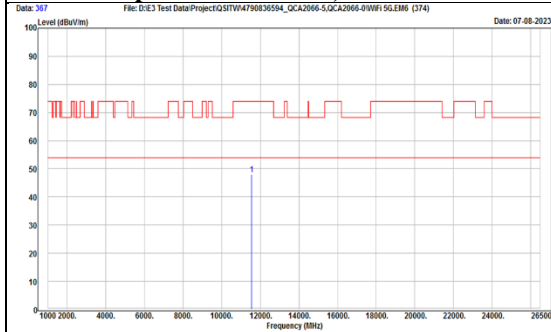


TX, 802.11ax(HE80) (Ch 155)

Radiated Spurious Emission, Vertical

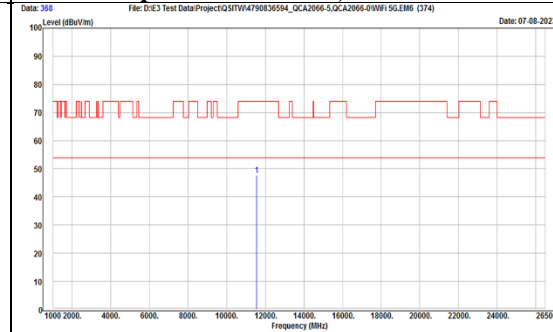


TX, 802.11ax(HE80) (Ch 155)

Band Edge (Peak), Horizontal

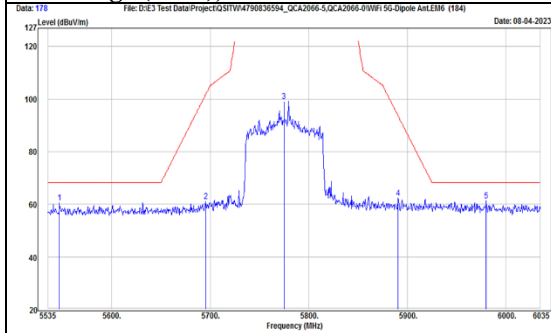

TX, 802.11ax(HE80) (Ch 155)

Band Edge (Peak), Vertical

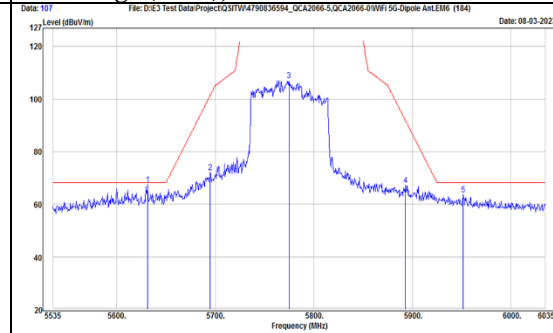

Mode	802.11ax(HE160)	Channel	50
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5075.9	41.66	19.12	60.78	74	-13.22	PK
		5102.58	29.78	19.24	49.02	54	-4.98	AVG
	@	5250	69.61	18.95	88.56	N/A	N/A	PK
	@	5250	60.08	18.95	79.03	N/A	N/A	AVG
		5452.64	27.96	19.63	47.59	54	-6.41	AVG
		5459.08	39.28	19.64	58.92	74	-15.08	PK
	*	10500	30.73	17.61	48.34	68.2	-19.86	PK
Vertical		5116.84	33.99	19.25	53.24	54	-0.76	AVG
		5138.46	44.66	19.22	63.88	74	-10.12	PK
	@	5250	82	18.95	100.95	N/A	N/A	PK
	@	5250	72.51	18.95	91.46	N/A	N/A	AVG
		5367.08	33.2	18.85	52.05	54	-1.95	AVG
		5373.52	43.14	18.91	62.05	74	-11.95	PK
	*	10500	31.51	17.61	49.12	68.2	-19.08	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

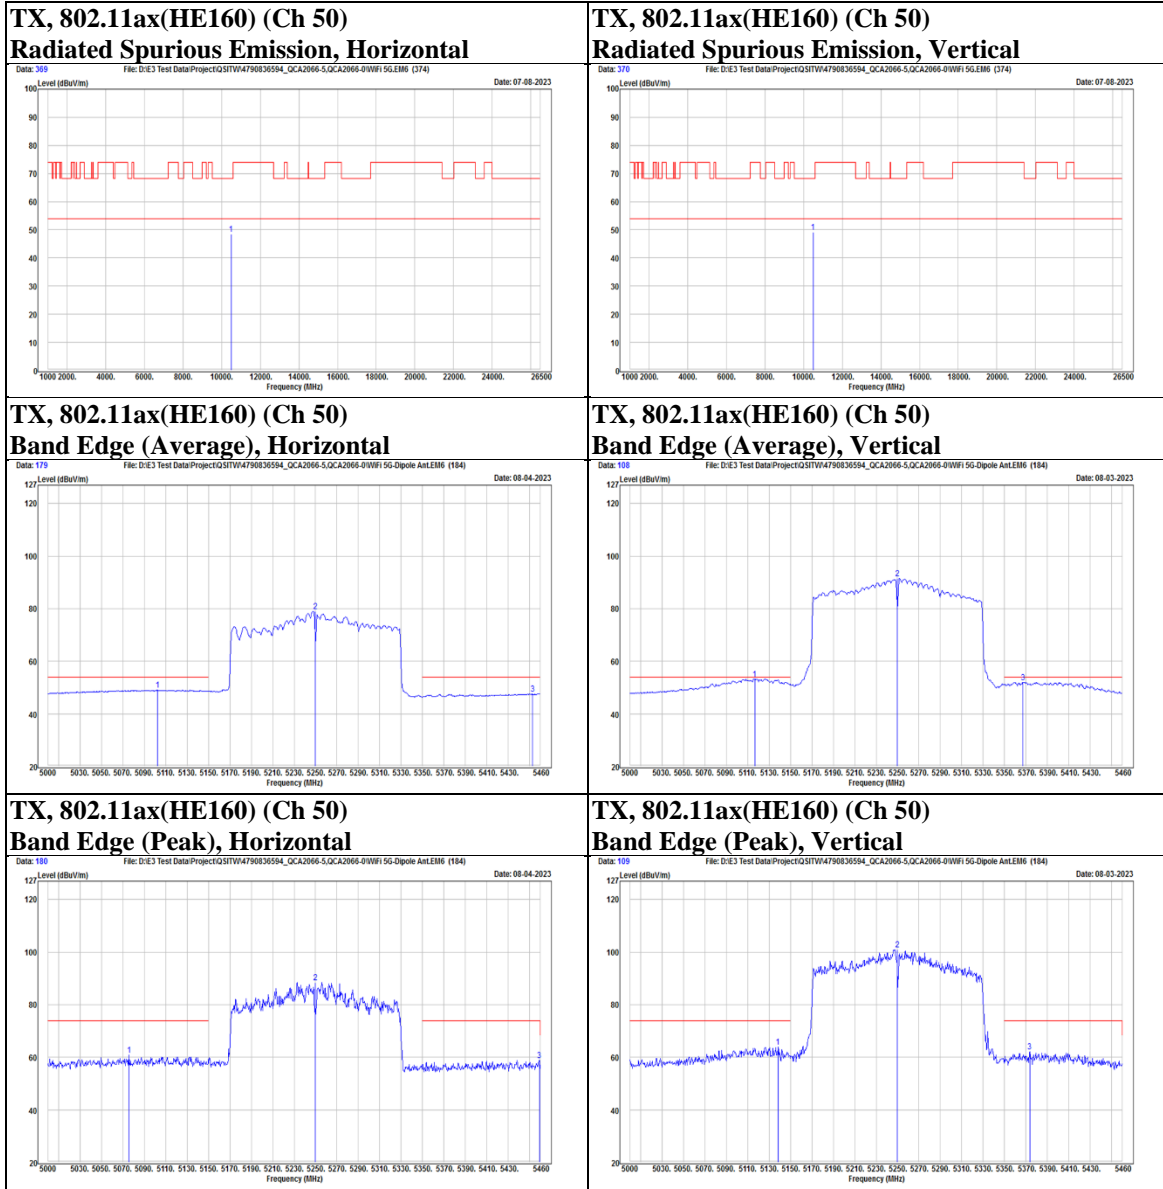

Mode	802.11ax(HE160)	Channel	114
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5407.7	39.89	19.23	59.12	74	-14.88	PK
		5426.25	28.89	19.41	48.3	54	-5.7	AVG
		5460.9	39.2	19.64	58.84	68.2	-9.36	PK
	@	5570	66.8	19.56	86.36	N/A	N/A	PK
	@	5570	57.37	19.56	76.93	N/A	N/A	AVG
		5748.25	39.75	20.04	59.79	68.2	-8.41	PK
	*	11140	30.78	18.14	48.92	74	-25.08	PK
Vertical		5437.8	44.07	19.51	63.58	74	-10.42	PK
		5439.55	33.83	19.54	53.37	54	-0.63	AVG
		5466.85	41.81	19.65	61.46	68.2	-6.74	PK
	@	5570	77.82	19.56	97.38	N/A	N/A	PK
	@	5570	69.58	19.56	89.14	N/A	N/A	AVG
		5727.25	39.93	19.85	59.78	68.2	-8.42	PK
	*	11140	30.51	18.14	48.65	74	-25.35	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

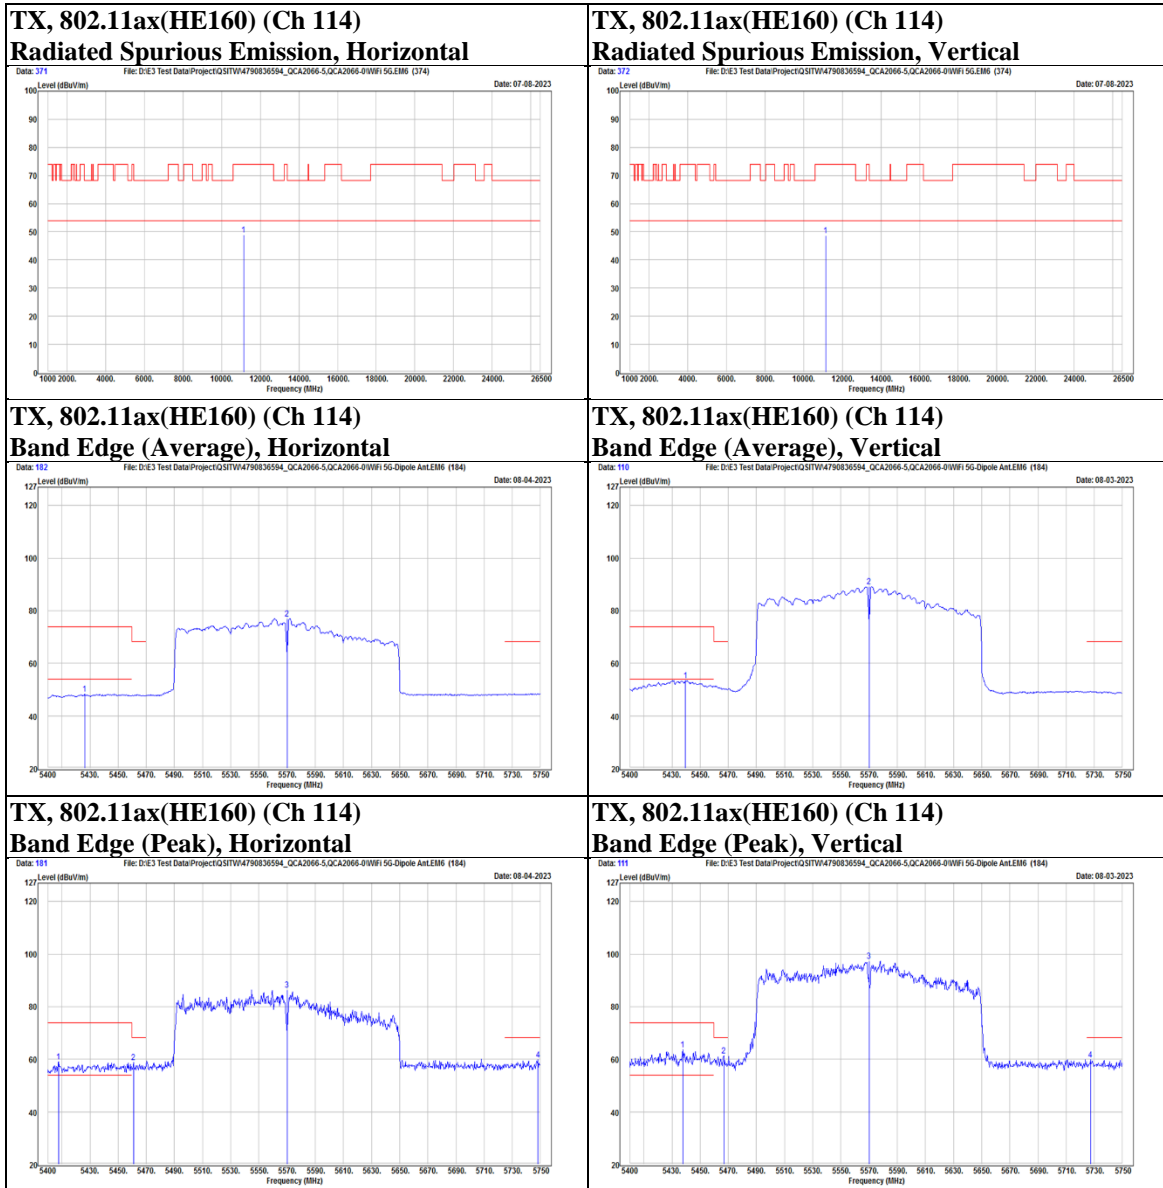

Below 1 GHz

Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		143.49	45.39	-12.31	33.08	43.5	-10.42	PK
		198.78	46.58	-14.82	31.76	43.5	-11.74	PK
		252.13	47.67	-12.38	35.29	46	-10.71	PK
		286.08	47.11	-10.93	36.18	46	-9.82	PK
		456.8	45.36	-5.86	39.5	46	-6.5	PK
		624.61	39.97	-2.08	37.89	46	-8.11	PK
Vertical		179.38	45.35	-12.84	32.51	43.5	-10.99	PK
		286.08	45.8	-10.93	34.87	46	-11.13	PK
		400.54	41.77	-7.75	34.02	46	-11.98	PK
		504.33	41.8	-5.04	36.76	46	-9.24	PK
		624.61	41.53	-2.08	39.45	46	-6.55	PK
		749.74	38	0.54	38.54	46	-7.46	PK

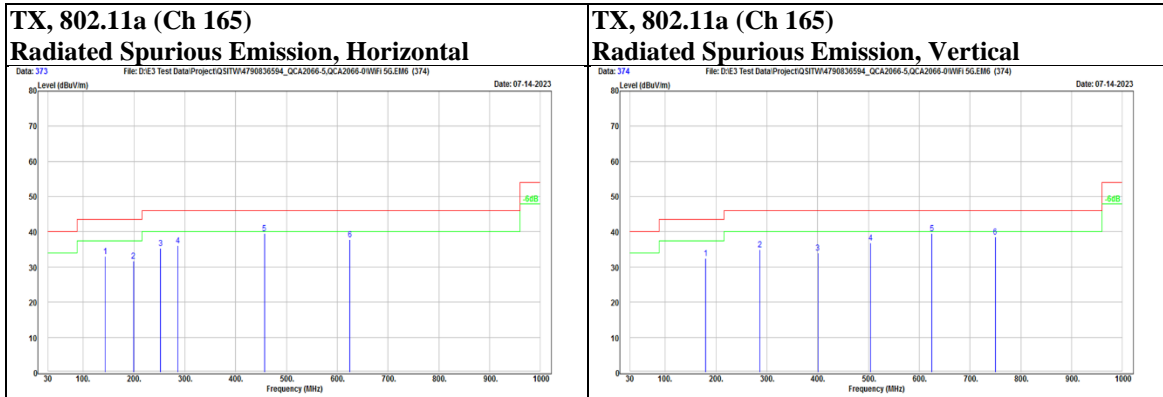

9 kHz ~ 30 MHz Data:

For 9 kHz to 30 MHz radiated emission have performed all modes of operation were investigated. The amplitude of spurious emissions attenuated more than 20 dB below the permissible value is not required to be report.

No non-compliance noted:

KDB 414788 D01 OATS and Chamber Correlation Justification

- Base on FCC 15.31 (f) (2): measurements may be performed at a distance closer than that specified in the regulations; however, an attempt should be made to avoid making measurements in the near field.

- OATs and chamber correlation testing had been performed and chamber measured test results is the worst case test result.

Although these tests were performed other than open area test site, adequate comparison measurements were confirmed against 30m open area test site. Therefore sufficient tests were made to demonstrate that the alternative site produces results that correlate with the ones of tests made in an open field based on KDB 414788.

Underwriters Laboratories Taiwan Co., Ltd.

Building A, B and E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1