

Report No.: SUZR/2022/1002201

Rev.: 02 Page: 1 of 63

Appendix B.7

LTE Band 41



South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国・苏州・中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路(号的6号厂房南部 邮编: 215000

t (86-512) 62992980

t (86-512) 62992980 www.sgsgroup.com.cn sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02 Page: 2 of 63

Effective (Isotropic) Radiated Power Output Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	EIRP (dBm)	Limit (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	26.54	28.06	33	PASS
Band41	5MHz	QPSK	39675	1RB#12	26.50	28.02	33	PASS
Band41	5MHz	QPSK	39675	1RB#24	26.51	28.03	33	PASS
Band41	5MHz	QPSK	39675	50RB#0	26.44	27.96	33	PASS
Band41	5MHz	QPSK	40620	1RB#0	26.44	27.96	33	PASS
Band41	5MHz	QPSK	40620	1RB#12	26.44	27.96	33	PASS
Band41	5MHz	QPSK	40620	1RB#24	26.31	27.83	33	PASS
Band41	5MHz	QPSK	40620	50RB#0	26.10	27.62	33	PASS
Band41	5MHz	QPSK	41565	1RB#0	26.36	27.88	33	PASS
Band41	5MHz	QPSK	41565	1RB#12	25.20	26.72	33	PASS
Band41	5MHz	QPSK	41565	1RB#24	24.86	26.38	33	PASS
Band41	5MHz	QPSK	41565	50RB#0	24.99	26.51	33	PASS
Band41	5MHz	16QAM	39675	1RB#0	25.64	27.16	33	PASS
Band41	5MHz	16QAM	39675	1RB#12	25.63	27.15	33	PASS
Band41	5MHz	16QAM	39675	1RB#24	25.69	27.21	33	PASS
Band41	5MHz	16QAM	39675	50RB#0	25.61	27.13	33	PASS
Band41	5MHz	16QAM	40620	1RB#0	25.58	27.10	33	PASS
Band41	5MHz	16QAM	40620	1RB#12	25.56	27.08	33	PASS
Band41	5MHz	16QAM	40620	1RB#24	25.34	26.86	33	PASS
Band41	5MHz	16QAM	40620	50RB#0	25.41	26.93	33	PASS
Band41	5MHz	16QAM	41565	1RB#0	25.25	26.77	33	PASS
Band41	5MHz	16QAM	41565	1RB#12	24.33	25.85	33	PASS
Band41	5MHz	16QAM	41565	1RB#24	24.03	25.55	33	PASS
Band41	5MHz	16QAM	41565	50RB#0	24.41	25.93	33	PASS
Band41	5MHz	64QAM	39675	1RB#0	24.83	26.35	33	PASS
Band41	5MHz	64QAM	39675	1RB#12	24.86	26.38	33	PASS
Band41	5MHz	64QAM	39675	1RB#24	24.88	26.40	33	PASS
Band41	5MHz	64QAM	39675	50RB#0	24.85	26.37	33	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.ags.com/en/Terms-and-Conditions.agsx and, for electronic Documents at http://www.ags.com/en/Terms-en/Documents and, for electronic Documents at http://www.ags.com/en/Terms-en/Documents advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or faisification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention.To check the authenticity of testing impsection report & certificate please contact us at telephone: (86-755) \$301 1443.

South of No. 6 Plant. No. 1, Runsheng Road, Southou Industrial Park, Suzhou Area, China (Jiangsu) Pitot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜廊(号的6号厂房南部 鄉鄉: 215000

t (86–512) 62992980 www.sgsgroup.com.cn t (86–512) 62992980 sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02 Page: 3 of 63

					Pag	e: 3	०१ ७३	
Band41	5MHz	64QAM	40620	1RB#0	24.80	26.32	33	PASS
Band41	5MHz	64QAM	40620	1RB#12	24.86	26.38	33	PASS
Band41	5MHz	64QAM	40620	1RB#24	24.68	26.20	33	PASS
Band41	5MHz	64QAM	40620	50RB#0	24.70	26.22	33	PASS
Band41	5MHz	64QAM	41565	1RB#0	24.27	25.79	33	PASS
Band41	5MHz	64QAM	41565	1RB#12	23.69	25.21	33	PASS
Band41	5MHz	64QAM	41565	1RB#24	23.38	24.90	33	PASS
Band41	5MHz	64QAM	41565	50RB#0	23.86	25.38	33	PASS
Band41	5MHz	256QAM	39675	1RB#0	21.65	23.17	33	PASS
Band41	5MHz	256QAM	39675	1RB#12	21.72	23.24	33	PASS
Band41	5MHz	256QAM	39675	1RB#24	21.69	23.21	33	PASS
Band41	5MHz	256QAM	39675	50RB#0	21.60	23.12	33	PASS
Band41	5MHz	256QAM	40620	1RB#0	21.40	22.92	33	PASS
Band41	5MHz	256QAM	40620	1RB#12	21.60	23.12	33	PASS
Band41	5MHz	256QAM	40620	1RB#24	21.57	23.09	33	PASS
Band41	5MHz	256QAM	40620	50RB#0	21.35	22.87	33	PASS
Band41	5MHz	256QAM	41565	1RB#0	21.57	23.09	33	PASS
Band41	5MHz	256QAM	41565	1RB#12	21.56	23.08	33	PASS
Band41	5MHz	256QAM	41565	1RB#24	21.41	22.93	33	PASS
Band41	5MHz	256QAM	41565	50RB#0	21.48	23.00	33	PASS
Band41	10MHz	QPSK	39700	1RB#0	26.44	27.96	33	PASS
Band41	10MHz	QPSK	39700	1RB#24	26.47	27.99	33	PASS
Band41	10MHz	QPSK	39700	1RB#49	26.40	27.92	33	PASS
Band41	10MHz	QPSK	39700	50RB#0	25.52	27.04	33	PASS
Band41	10MHz	QPSK	40620	1RB#0	26.52	28.04	33	PASS
Band41	10MHz	QPSK	40620	1RB#24	26.25	27.77	33	PASS
Band41	10MHz	QPSK	40620	1RB#49	26.24	27.76	33	PASS
Band41	10MHz	QPSK	40620	50RB#0	25.29	26.81	33	PASS
Band41	10MHz	QPSK	41540	1RB#0	26.36	27.88	33	PASS
Band41	10MHz	QPSK	41540	1RB#24	25.23	26.75	33	PASS
Band41	10MHz	QPSK	41540	1RB#49	24.68	26.20	33	PASS
Band41	10MHz	QPSK	41540	50RB#0	24.32	25.84	33	PASS
Band41	10MHz	16QAM	39700	1RB#0	25.59	27.11	33	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <a href="http://www.ags.com/en/Terms-and-Conditions.agox.and.for electronic Documents at http://www.ags.com/en/Terms-and-Conditions/Terms-en-Document.agox.Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention: To check the authenticity of testing impsection report & certificate please-center of the accument us an attention."

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国·苏州·中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86-512) 62992980

t (86-512) 62992980 www.sgsgroup.com.cn sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02 Page: 4 of 63

		1			Pag	<u>e: 4</u>	०१ ६३	
Band41	10MHz	16QAM	39700	1RB#24	25.61	27.13	33	PASS
Band41	10MHz	16QAM	39700	1RB#49	25.58	27.10	33	PASS
Band41	10MHz	16QAM	39700	50RB#0	24.48	26.00	33	PASS
Band41	10MHz	16QAM	40620	1RB#0	25.56	27.08	33	PASS
Band41	10MHz	16QAM	40620	1RB#24	25.45	26.97	33	PASS
Band41	10MHz	16QAM	40620	1RB#49	25.28	26.80	33	PASS
Band41	10MHz	16QAM	40620	50RB#0	24.25	25.77	33	PASS
Band41	10MHz	16QAM	41540	1RB#0	25.23	26.75	33	PASS
Band41	10MHz	16QAM	41540	1RB#24	24.38	25.90	33	PASS
Band41	10MHz	16QAM	41540	1RB#49	23.87	25.39	33	PASS
Band41	10MHz	16QAM	41540	50RB#0	23.47	24.99	33	PASS
Band41	10MHz	64QAM	39700	1RB#0	24.80	26.32	33	PASS
Band41	10MHz	64QAM	39700	1RB#24	24.78	26.30	33	PASS
Band41	10MHz	64QAM	39700	1RB#49	24.74	26.26	33	PASS
Band41	10MHz	64QAM	39700	50RB#0	23.51	25.03	33	PASS
Band41	10MHz	64QAM	40620	1RB#0	24.75	26.27	33	PASS
Band41	10MHz	64QAM	40620	1RB#24	24.71	26.23	33	PASS
Band41	10MHz	64QAM	40620	1RB#49	24.62	26.14	33	PASS
Band41	10MHz	64QAM	40620	50RB#0	23.24	24.76	33	PASS
Band41	10MHz	64QAM	41540	1RB#0	24.53	26.05	33	PASS
Band41	10MHz	64QAM	41540	1RB#24	23.61	25.13	33	PASS
Band41	10MHz	64QAM	41540	1RB#49	23.26	24.78	33	PASS
Band41	10MHz	64QAM	41540	50RB#0	22.59	24.11	33	PASS
Band41	10MHz	256QAM	39700	1RB#0	21.65	23.17	33	PASS
Band41	10MHz	256QAM	39700	1RB#24	21.63	23.15	33	PASS
Band41	10MHz	256QAM	39700	1RB#49	21.52	23.04	33	PASS
Band41	10MHz	256QAM	39700	50RB#0	21.53	23.05	33	PASS
Band41	10MHz	256QAM	40620	1RB#0	21.35	22.87	33	PASS
Band41	10MHz	256QAM	40620	1RB#24	21.43	22.95	33	PASS
Band41	10MHz	256QAM	40620	1RB#49	21.27	22.79	33	PASS
Band41	10MHz	256QAM	40620	50RB#0	21.26	22.78	33	PASS
Band41	10MHz	256QAM	41540	1RB#0	21.33	22.85	33	PASS
Band41	10MHz	256QAM	41540	1RB#24	21.67	23.19	33	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <a href="http://www.ags.com/en/Terms-and-Conditions.agox.and.for electronic Documents at http://www.ags.com/en/Terms-and-Conditions/Terms-en-Document.agox.Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention: To check the authenticity of testing impsection report & certificate please-center of the accument us an attention."

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国·苏州·中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 www.sgsgroup.com.cn t (86-512) 62992980

sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02 Page: 5 of 63

					Pag	<u>e: 5</u>	०१ ७३	
Band41	10MHz	256QAM	41540	1RB#49	21.02	22.54	33	PASS
Band41	10MHz	256QAM	41540	50RB#0	21.39	22.91	33	PASS
Band41	15MHz	QPSK	39725	1RB#0	26.41	27.93	33	PASS
Band41	15MHz	QPSK	39725	1RB#38	26.41	27.93	33	PASS
Band41	15MHz	QPSK	39725	1RB#74	26.25	27.77	33	PASS
Band41	15MHz	QPSK	39725	75RB#0	25.34	26.86	33	PASS
Band41	15MHz	QPSK	40620	1RB#0	26.63	28.15	33	PASS
Band41	15MHz	QPSK	40620	1RB#38	26.20	27.72	33	PASS
Band41	15MHz	QPSK	40620	1RB#74	25.75	27.27	33	PASS
Band41	15MHz	QPSK	40620	75RB#0	25.14	26.66	33	PASS
Band41	15MHz	QPSK	41515	1RB#0	26.54	28.06	33	PASS
Band41	15MHz	QPSK	41515	1RB#38	25.30	26.82	33	PASS
Band41	15MHz	QPSK	41515	1RB#74	24.59	26.11	33	PASS
Band41	15MHz	QPSK	41515	75RB#0	24.41	25.93	33	PASS
Band41	15MHz	16QAM	39725	1RB#0	25.30	26.82	33	PASS
Band41	15MHz	16QAM	39725	1RB#38	25.45	26.97	33	PASS
Band41	15MHz	16QAM	39725	1RB#74	25.34	26.86	33	PASS
Band41	15MHz	16QAM	39725	75RB#0	24.37	25.89	33	PASS
Band41	15MHz	16QAM	40620	1RB#0	25.27	26.79	33	PASS
Band41	15MHz	16QAM	40620	1RB#38	25.21	26.73	33	PASS
Band41	15MHz	16QAM	40620	1RB#74	24.98	26.50	33	PASS
Band41	15MHz	16QAM	40620	75RB#0	24.15	25.67	33	PASS
Band41	15MHz	16QAM	41515	1RB#0	25.09	26.61	33	PASS
Band41	15MHz	16QAM	41515	1RB#38	24.47	25.99	33	PASS
Band41	15MHz	16QAM	41515	1RB#74	23.82	25.34	33	PASS
Band41	15MHz	16QAM	41515	75RB#0	23.55	25.07	33	PASS
Band41	15MHz	64QAM	39725	1RB#0	24.56	26.08	33	PASS
Band41	15MHz	64QAM	39725	1RB#38	24.65	26.17	33	PASS
Band41	15MHz	64QAM	39725	1RB#74	24.60	26.12	33	PASS
Band41	15MHz	64QAM	39725	75RB#0	23.40	24.92	33	PASS
Band41	15MHz	64QAM	40620	1RB#0	24.49	26.01	33	PASS
Band41	15MHz	64QAM	40620	1RB#38	24.50	26.02	33	PASS
Band41	15MHz	64QAM	40620	1RB#74	24.27	25.79	33	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Clients instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extend to the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the substanticity of testing impsection report & certificate, pease-contact us at technone: (86-755) 8307 1443.**

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国·苏州·中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 www.sgsgroup.com.cn t (86-512) 62992980

sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02 Page: 6 of 63

					Pag	e: 6	of 63	
Band41	15MHz	64QAM	40620	75RB#0	23.13	24.65	33	PASS
Band41	15MHz	64QAM	41515	1RB#0	24.21	25.73	33	PASS
Band41	15MHz	64QAM	41515	1RB#38	23.81	25.33	33	PASS
Band41	15MHz	64QAM	41515	1RB#74	23.13	24.65	33	PASS
Band41	15MHz	64QAM	41515	75RB#0	22.66	24.18	33	PASS
Band41	15MHz	256QAM	39725	1RB#0	21.35	22.87	33	PASS
Band41	15MHz	256QAM	39725	1RB#38	21.47	22.99	33	PASS
Band41	15MHz	256QAM	39725	1RB#74	21.39	22.91	33	PASS
Band41	15MHz	256QAM	39725	75RB#0	21.37	22.89	33	PASS
Band41	15MHz	256QAM	40620	1RB#0	21.27	22.79	33	PASS
Band41	15MHz	256QAM	40620	1RB#38	21.30	22.82	33	PASS
Band41	15MHz	256QAM	40620	1RB#74	21.21	22.73	33	PASS
Band41	15MHz	256QAM	40620	75RB#0	21.14	22.66	33	PASS
Band41	15MHz	256QAM	41515	1RB#0	21.20	22.72	33	PASS
Band41	15MHz	256QAM	41515	1RB#38	21.48	23.00	33	PASS
Band41	15MHz	256QAM	41515	1RB#74	21.13	22.65	33	PASS
Band41	15MHz	256QAM	41515	75RB#0	21.18	22.70	33	PASS
Band41	20MHz	QPSK	39750	1RB#0	26.32	27.84	33	PASS
Band41	20MHz	QPSK	39750	1RB#49	26.35	27.87	33	PASS
Band41	20MHz	QPSK	39750	1RB#99	26.33	27.85	33	PASS
Band41	20MHz	QPSK	39750	100RB#0	25.28	26.80	33	PASS
Band41	20MHz	QPSK	40620	1RB#0	26.33	27.85	33	PASS
Band41	20MHz	QPSK	40620	1RB#49	26.23	27.75	33	PASS
Band41	20MHz	QPSK	40620	1RB#99	25.68	27.20	33	PASS
Band41	20MHz	QPSK	40620	100RB#0	25.17	26.69	33	PASS
Band41	20MHz	QPSK	41490	1RB#0	26.63	28.15	33	PASS
Band41	20MHz	QPSK	41490	1RB#49	25.63	27.15	33	PASS
Band41	20MHz	QPSK	41490	1RB#99	24.63	26.15	33	PASS
Band41	20MHz	QPSK	41490	100RB#0	25.11	26.63	33	PASS
Band41	20MHz	16QAM	39750	1RB#0	25.37	26.89	33	PASS
Band41	20MHz	16QAM	39750	1RB#49	25.38	26.90	33	PASS
Band41	20MHz	16QAM	39750	1RB#99	25.40	26.92	33	PASS
Band41	20MHz	16QAM	39750	100RB#0	24.34	25.86	33	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <a href="http://www.ags.com/en/Terms-and-Conditions.agox.and.for electronic Documents at http://www.ags.com/en/Terms-and-Conditions/Terms-en-Document.agox.Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention: To check the authenticity of testing impsection report & certificate please-center of the accument us an attention."

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国·苏州·中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86-512) 62992980

t (86-512) 62992980 www.sgsgroup.com.cn sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02 7 of 63 Page:

					Pag	e: /	of 63	
Band41	20MHz	16QAM	40620	1RB#0	25.45	26.97	33	PASS
Band41	20MHz	16QAM	40620	1RB#49	25.15	26.67	33	PASS
Band41	20MHz	16QAM	40620	1RB#99	24.82	26.34	33	PASS
Band41	20MHz	16QAM	40620	100RB#0	24.16	25.68	33	PASS
Band41	20MHz	16QAM	41490	1RB#0	24.91	26.43	33	PASS
Band41	20MHz	16QAM	41490	1RB#49	24.76	26.28	33	PASS
Band41	20MHz	16QAM	41490	1RB#99	23.81	25.33	33	PASS
Band41	20MHz	16QAM	41490	100RB#0	24.19	25.71	33	PASS
Band41	20MHz	64QAM	39750	1RB#0	24.53	26.05	33	PASS
Band41	20MHz	64QAM	39750	1RB#49	24.66	26.18	33	PASS
Band41	20MHz	64QAM	39750	1RB#99	24.46	25.98	33	PASS
Band41	20MHz	64QAM	39750	100RB#0	23.28	24.80	33	PASS
Band41	20MHz	64QAM	40620	1RB#0	24.39	25.91	33	PASS
Band41	20MHz	64QAM	40620	1RB#49	24.33	25.85	33	PASS
Band41	20MHz	64QAM	40620	1RB#99	24.21	25.73	33	PASS
Band41	20MHz	64QAM	40620	100RB#0	23.18	24.70	33	PASS
Band41	20MHz	64QAM	41490	1RB#0	24.23	25.75	33	PASS
Band41	20MHz	64QAM	41490	1RB#49	24.06	25.58	33	PASS
Band41	20MHz	64QAM	41490	1RB#99	23.18	24.70	33	PASS
Band41	20MHz	64QAM	41490	100RB#0	23.17	24.69	33	PASS
Band41	20MHz	256QAM	39750	1RB#0	21.41	22.93	33	PASS
Band41	20MHz	256QAM	39750	1RB#49	21.51	23.03	33	PASS
Band41	20MHz	256QAM	39750	1RB#99	21.43	22.95	33	PASS
Band41	20MHz	256QAM	39750	100RB#0	21.32	22.84	33	PASS
Band41	20MHz	256QAM	40620	1RB#0	21.34	22.86	33	PASS
Band41	20MHz	256QAM	40620	1RB#49	21.46	22.98	33	PASS
Band41	20MHz	256QAM	40620	1RB#99	21.34	22.86	33	PASS
Band41	20MHz	256QAM	40620	100RB#0	21.15	22.67	33	PASS
Band41	20MHz	256QAM	41490	1RB#0	20.94	22.46	33	PASS
Band41	20MHz	256QAM	41490	1RB#49	21.55	23.07	33	PASS
Band41	20MHz	256QAM	41490	1RB#99	21.16	22.68	33	PASS
Band41	20MHz	256QAM	41490	100RB#0	21.20	22.72	33	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Clients instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extend to the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention:To check the substanticity of testing impsection report & certificate, pease-contact us at technone: (86-755) 8307 1443.**

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国·苏州·中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000 t (86-512) 62992980 www.sgsgroup.com.cn t (86-512) 62992980

sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02 Page: 8 of 63

Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	20MHz	QPSK	39750	100RB#0	8.68	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	8.44	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	8.52	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.58	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.40	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.54	13	PASS
Band41	20MHz	64QAM	39750	100RB#0	10.14	13	PASS
Band41	20MHz	64QAM	40620	100RB#0	9.72	13	PASS
Band41	20MHz	64QAM	41490	100RB#0	9.98	13	PASS
Band41	20MHz	256QAM	39750	100RB#0	10.30	13	PASS
Band41	20MHz	256QAM	40620	100RB#0	10.44	13	PASS
Band41	20MHz	256QAM	41490	100RB#0	10.50	13	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.ags.com/en/Terms-and-Conditions.agsx and, for electronic Documents at http://www.ags.com/en/Terms-en/Documents and, for electronic Documents at http://www.ags.com/en/Terms-en/Documents advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or faisification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention.To check the authenticity of testing impsection report & certificate please contact us at telephone: (86-755) \$301 1443.




Report No.: SUZR/2022/1002201

Rev.: 02

Page: 9 of 63

Test Graphs

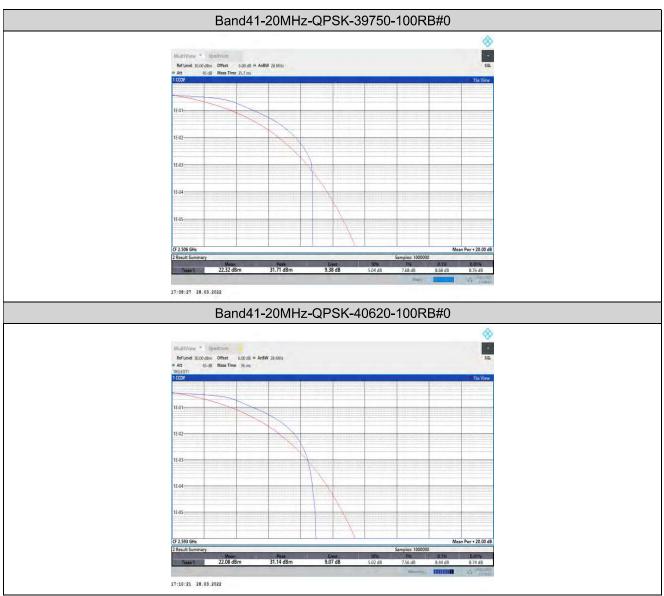






Report No.: SUZR/2022/1002201

Rev.: 02

10 of 63 Page:

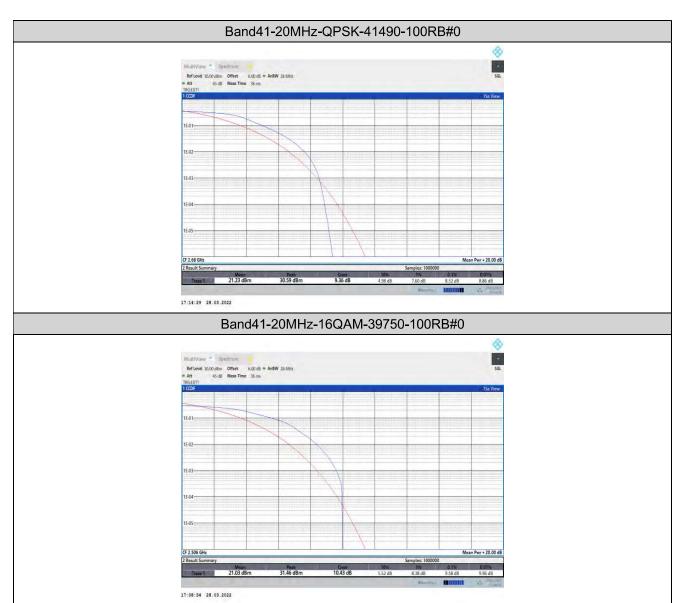






Report No.: SUZR/2022/1002201

Rev.: 02

11 of 63 Page:

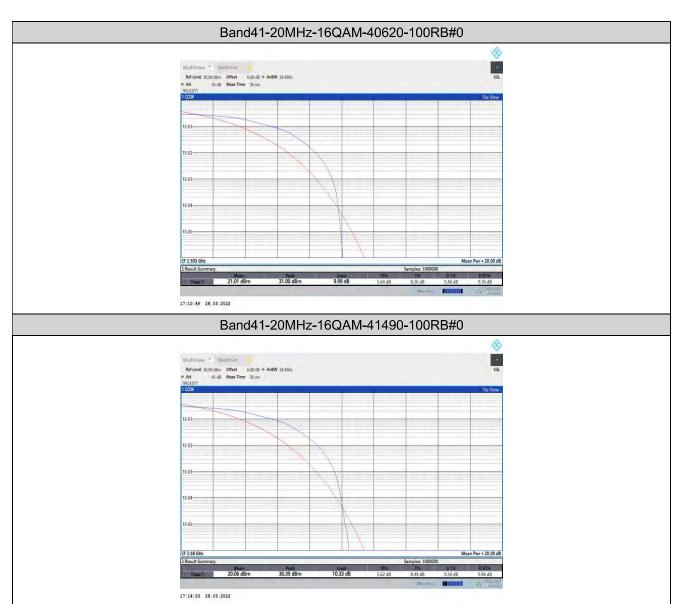






Report No.: SUZR/2022/1002201

Rev.: 02

12 of 63 Page:

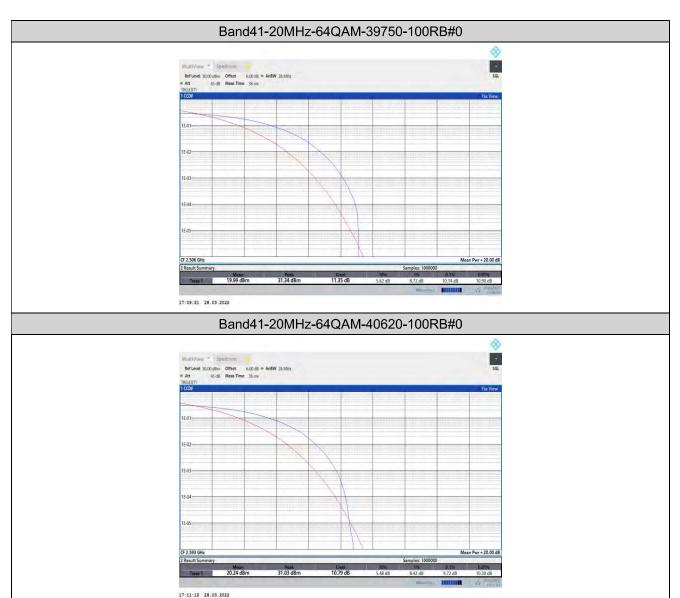






Report No.: SUZR/2022/1002201

Rev.: 02

Page: 13 of 63

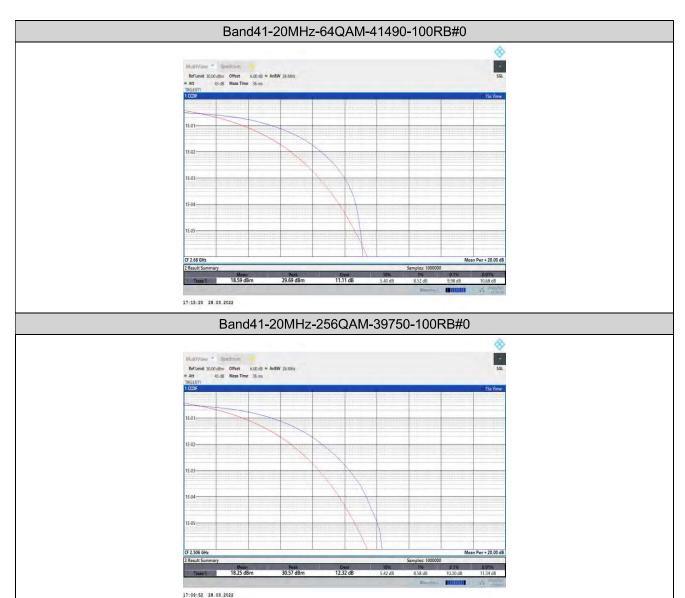






Report No.: SUZR/2022/1002201

Rev.: 02

14 of 63 Page:

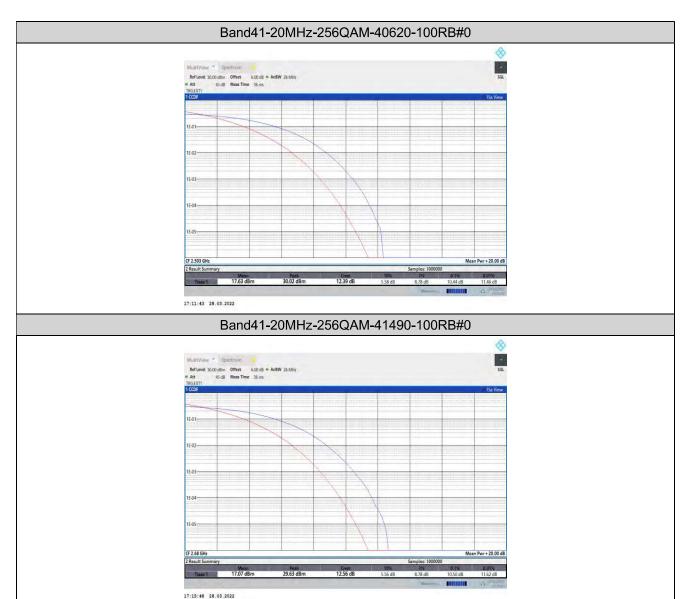





Report No.: SUZR/2022/1002201

Rev.: 02

Page: 15 of 63

Modulation Characteristics

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result	Verdict
Band41	20MHz	QPSK	40620	100RB#0	PASS	PASS
Band41	20MHz	16QAM	40620	100RB#0	PASS	PASS
Band41	20MHz	64QAM	40620	100RB#0	PASS	PASS
Band41	20MHz	256QAM	40620	100RB#0	PASS	PASS






Report No.: SUZR/2022/1002201

Rev.: 02

Page: 16 of 63

Test Graphs

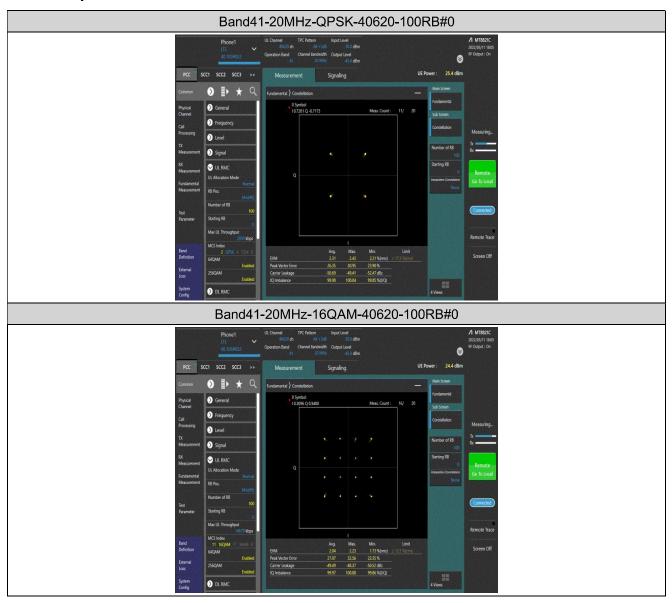



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction forcement cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or faisification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention: To check the authenticity of testing impaction report & certificate please centation to the declaration of the company. Attention: To check the authenticity of testing impaction report & certificate please centation to the adventicity of testing impaction report & certificate please centation to the sample (s) feet the declaration of the company.




Report No.: SUZR/2022/1002201


Rev.: 02

Page: 17 of 63

Band41-20MHz-64QAM-40620-100RB#0

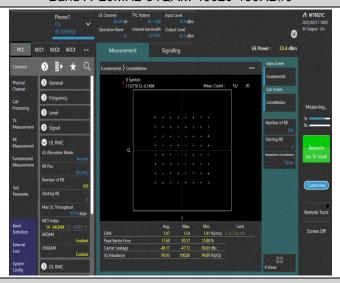

Band41-20MHz-256QAM-40620-100RB#0

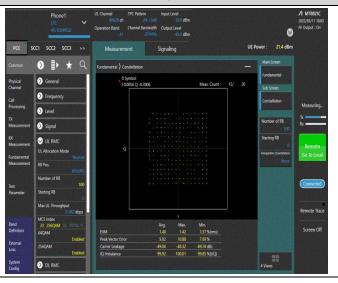





Report No.: SUZR/2022/1002201

Rev.: 02

Page: 18 of 63

26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.477	5.24	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.479	5.10	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.479	5.15	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.478	5.16	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.476	5.09	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.478	5.05	PASS
Band41	5MHz	64QAM	39675	25RB#0	4.473	5.01	PASS
Band41	5MHz	64QAM	40620	25RB#0	4.481	5.03	PASS
Band41	5MHz	64QAM	41565	25RB#0	4.482	5.01	PASS
Band41	5MHz	256QAM	39675	25RB#0	4.481	5.16	PASS
Band41	5MHz	256QAM	40620	25RB#0	4.474	5.13	PASS
Band41	5MHz	256QAM	41565	25RB#0	4.48	5.15	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.968	10.06	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.94	9.88	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.944	9.82	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.926	9.92	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.943	9.98	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.962	9.84	PASS
Band41	10MHz	64QAM	39700	50RB#0	8.942	9.82	PASS
Band41	10MHz	64QAM	40620	50RB#0	8.939	9.88	PASS
Band41	10MHz	64QAM	41540	50RB#0	8.936	10.10	PASS
Band41	10MHz	256QAM	39700	50RB#0	8.953	9.82	PASS
Band41	10MHz	256QAM	40620	50RB#0	8.952	9.84	PASS
Band41	10MHz	256QAM	41540	50RB#0	8.942	10.04	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.483	15.99	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.482	15.81	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.472	15.51	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.51	16.29	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.495	15.45	PASS



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions, aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extent of the law Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention.To check the authenticity of testing impsection reports.

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Plot Free Trade Zone 215000 中国·苏州·中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86-512) 62992980 www.sgsgroup.com.cn t (86-512) 62992980

sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02

Page: 19 of 63

Band41 15MHz 64QAM 39725 75RB#0 13.497 16.29 PASS Band41 15MHz 64QAM 40620 75RB#0 13.48 15.60 PASS Band41 15MHz 64QAM 41515 75RB#0 13.483 16.26 PASS Band41 15MHz 256QAM 39725 75RB#0 13.486 17.76 PASS Band41 15MHz 256QAM 40620 75RB#0 13.471 15.36 PASS Band41 15MHz 256QAM 40620 75RB#0 13.488 16.11 PASS Band41 20MHz QPSK 39750 100RB#0 17.89 19.84 PASS Band41 20MHz QPSK 40620 100RB#0 17.917 20.40 PASS Band41 20MHz QPSK 41490 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS						ı ago.		
Band41 15MHz 64QAM 40620 75RB#0 13.48 15.60 PASS Band41 15MHz 64QAM 41515 75RB#0 13.483 16.26 PASS Band41 15MHz 256QAM 39725 75RB#0 13.486 17.76 PASS Band41 15MHz 256QAM 40620 75RB#0 13.471 15.36 PASS Band41 15MHz 256QAM 40620 75RB#0 13.488 16.11 PASS Band41 20MHz QPSK 39750 100RB#0 17.89 19.84 PASS Band41 20MHz QPSK 40620 100RB#0 17.949 20.84 PASS Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.911 20.24 PASS	Band41	15MHz	16QAM	41515	75RB#0	13.473	15.18	PASS
Band41 15MHz 64QAM 41515 75RB#0 13.483 16.26 PASS Band41 15MHz 256QAM 39725 75RB#0 13.486 17.76 PASS Band41 15MHz 256QAM 40620 75RB#0 13.471 15.36 PASS Band41 15MHz 256QAM 41515 75RB#0 13.488 16.11 PASS Band41 20MHz QPSK 39750 100RB#0 17.89 19.84 PASS Band41 20MHz QPSK 40620 100RB#0 17.949 20.84 PASS Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 64QAM 41490 100RB#0 17.912 20.68 PASS	Band41	15MHz	64QAM	39725	75RB#0	13.497	16.29	PASS
Band41 15MHz 256QAM 39725 75RB#0 13.486 17.76 PASS Band41 15MHz 256QAM 40620 75RB#0 13.471 15.36 PASS Band41 15MHz 256QAM 41515 75RB#0 13.488 16.11 PASS Band41 20MHz QPSK 39750 100RB#0 17.89 19.84 PASS Band41 20MHz QPSK 40620 100RB#0 17.949 20.84 PASS Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS	Band41	15MHz	64QAM	40620	75RB#0	13.48	15.60	PASS
Band41 15MHz 256QAM 40620 75RB#0 13.471 15.36 PASS Band41 15MHz 256QAM 41515 75RB#0 13.488 16.11 PASS Band41 20MHz QPSK 39750 100RB#0 17.89 19.84 PASS Band41 20MHz QPSK 40620 100RB#0 17.949 20.84 PASS Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.894 20.28 PASS	Band41	15MHz	64QAM	41515	75RB#0	13.483	16.26	PASS
Band41 15MHz 256QAM 41515 75RB#0 13.488 16.11 PASS Band41 20MHz QPSK 39750 100RB#0 17.89 19.84 PASS Band41 20MHz QPSK 40620 100RB#0 17.949 20.84 PASS Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 64QAM 41490 100RB#0 17.951 20.28 PASS	Band41	15MHz	256QAM	39725	75RB#0	13.486	17.76	PASS
Band41 20MHz QPSK 39750 100RB#0 17.89 19.84 PASS Band41 20MHz QPSK 40620 100RB#0 17.949 20.84 PASS Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS <td>Band41</td> <td>15MHz</td> <td>256QAM</td> <td>40620</td> <td>75RB#0</td> <td>13.471</td> <td>15.36</td> <td>PASS</td>	Band41	15MHz	256QAM	40620	75RB#0	13.471	15.36	PASS
Band41 20MHz QPSK 40620 100RB#0 17.949 20.84 PASS Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS </td <td>Band41</td> <td>15MHz</td> <td>256QAM</td> <td>41515</td> <td>75RB#0</td> <td>13.488</td> <td>16.11</td> <td>PASS</td>	Band41	15MHz	256QAM	41515	75RB#0	13.488	16.11	PASS
Band41 20MHz QPSK 41490 100RB#0 17.917 20.40 PASS Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	QPSK	39750	100RB#0	17.89	19.84	PASS
Band41 20MHz 16QAM 39750 100RB#0 17.93 19.72 PASS Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	QPSK	40620	100RB#0	17.949	20.84	PASS
Band41 20MHz 16QAM 40620 100RB#0 17.961 19.72 PASS Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	QPSK	41490	100RB#0	17.917	20.40	PASS
Band41 20MHz 16QAM 41490 100RB#0 17.911 20.24 PASS Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	16QAM	39750	100RB#0	17.93	19.72	PASS
Band41 20MHz 64QAM 39750 100RB#0 17.912 20.68 PASS Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	16QAM	40620	100RB#0	17.961	19.72	PASS
Band41 20MHz 64QAM 40620 100RB#0 17.921 20.28 PASS Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	16QAM	41490	100RB#0	17.911	20.24	PASS
Band41 20MHz 64QAM 41490 100RB#0 17.894 20.08 PASS Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	64QAM	39750	100RB#0	17.912	20.68	PASS
Band41 20MHz 256QAM 39750 100RB#0 17.951 20.28 PASS Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	64QAM	40620	100RB#0	17.921	20.28	PASS
Band41 20MHz 256QAM 40620 100RB#0 17.93 20.64 PASS	Band41	20MHz	64QAM	41490	100RB#0	17.894	20.08	PASS
	Band41	20MHz	256QAM	39750	100RB#0	17.951	20.28	PASS
	Band41	20MHz	256QAM	40620	100RB#0	17.93	20.64	PASS
Band41 20MHz 256QAM 41490 100RB#0 17.889 20.76 PASS	Band41	20MHz	256QAM	41490	100RB#0	17.889	20.76	PASS





Report No.: SUZR/2022/1002201

Rev.: 02

Page: 20 of 63

Test Graphs








Report No.: SUZR/2022/1002201

Rev.: 02

21 of 63 Page:

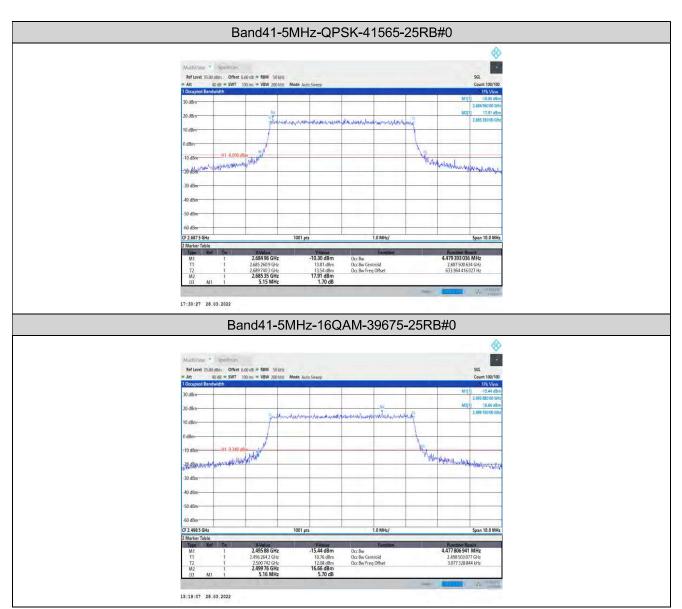



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions, aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extent of the law Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention.To check the authenticity of testing impsection reports.

South of No. 6 Plant, No. 1, Runsheng Road, Suzhou Industrial Park, Suzhou Area, China (Jiangsu) Pilot Free Trade Zone 215000 中国 - 苏州 - 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路1号的6号厂房南部 邮编: 215000

t (86-512) 62992980 www.sgsgroup.com.cn t (86-512) 62992980


sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02

Page: 22 of 63

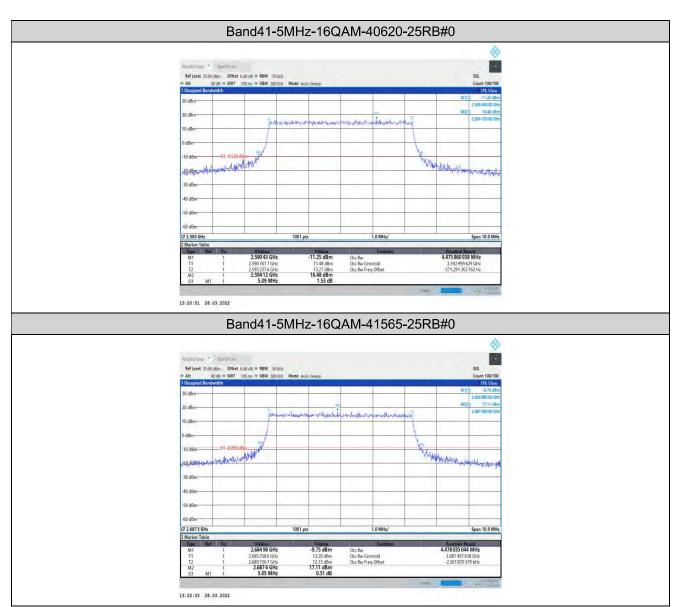






Report No.: SUZR/2022/1002201

Rev.: 02

Page: 23 of 63

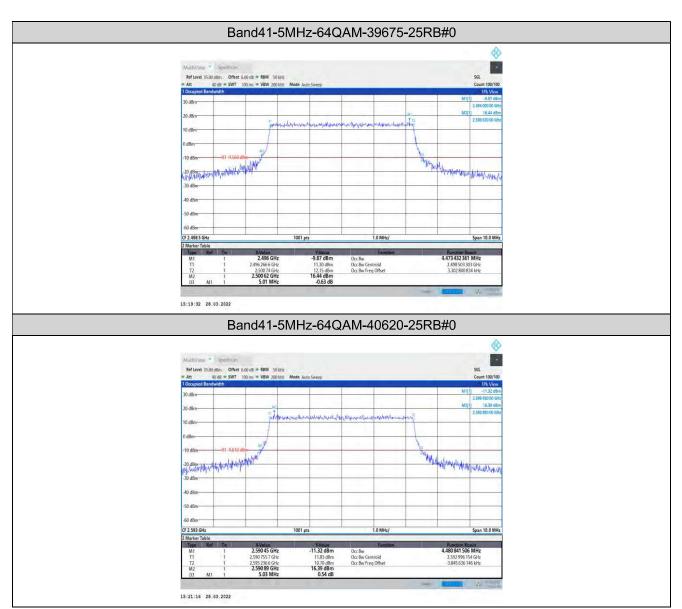






Report No.: SUZR/2022/1002201

Rev.: 02

24 of 63 Page:

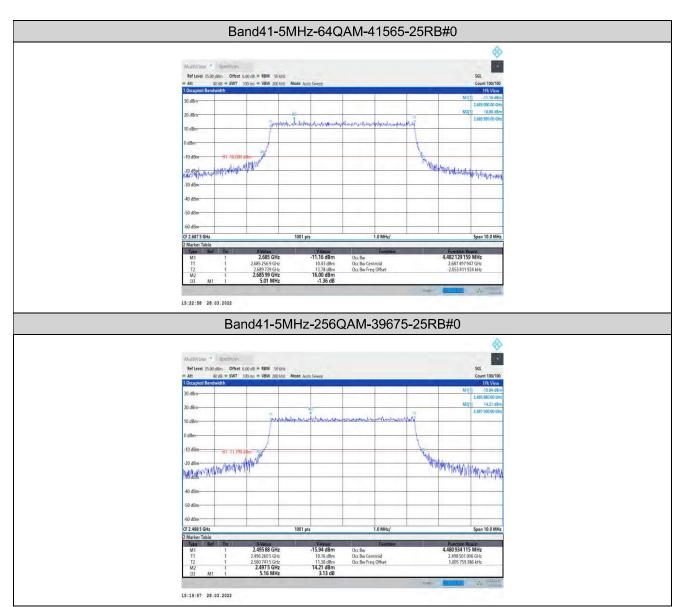






Report No.: SUZR/2022/1002201

Rev.: 02

25 of 63 Page:

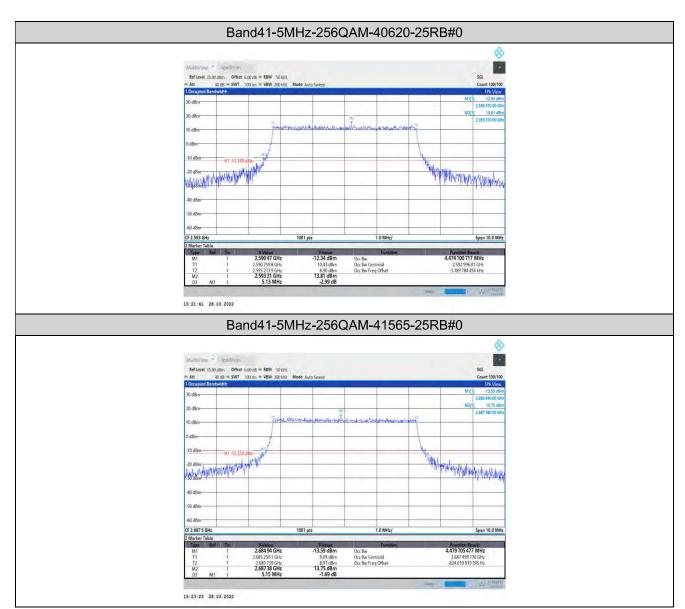






Report No.: SUZR/2022/1002201

Rev.: 02

Page: 26 of 63

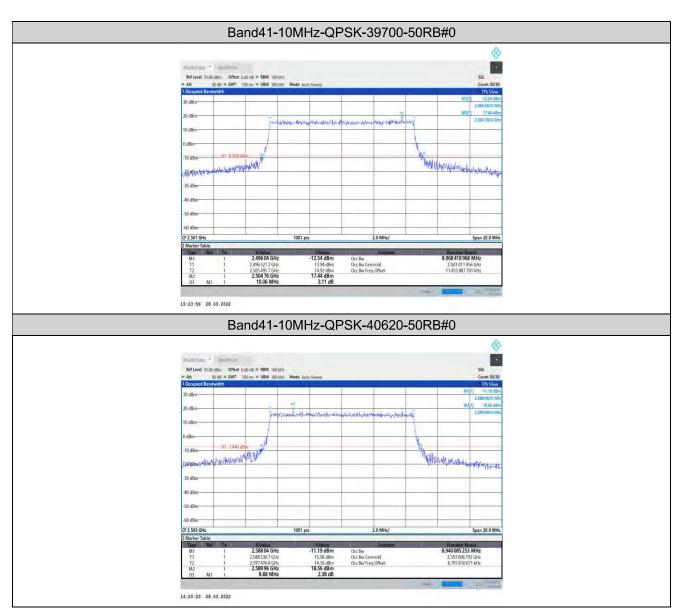






Report No.: SUZR/2022/1002201

Rev.: 02

27 of 63 Page:

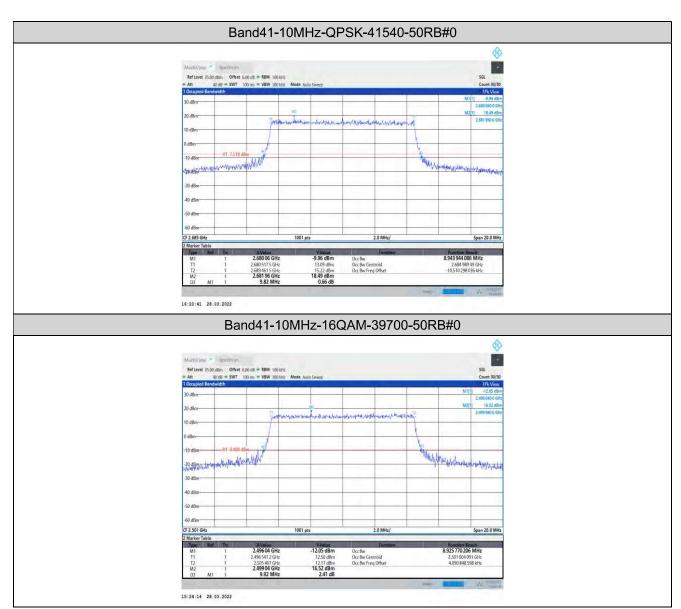






Report No.: SUZR/2022/1002201

Rev.: 02

Page: 28 of 63

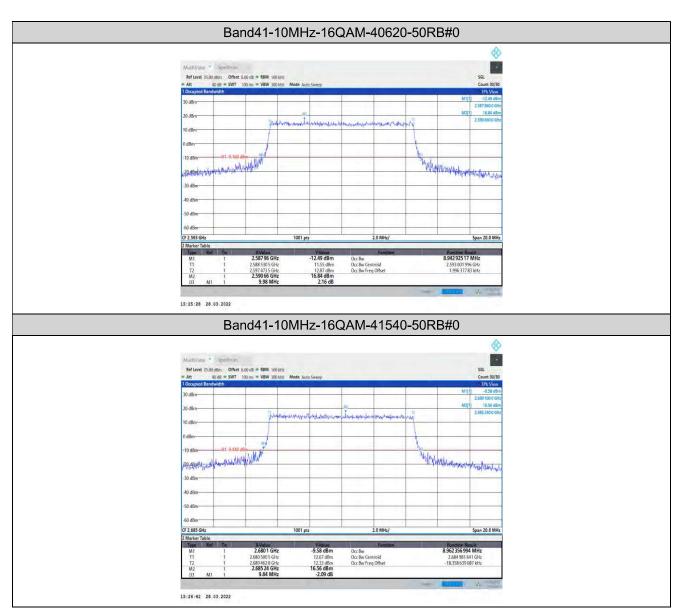






Report No.: SUZR/2022/1002201

Rev.: 02

29 of 63 Page:

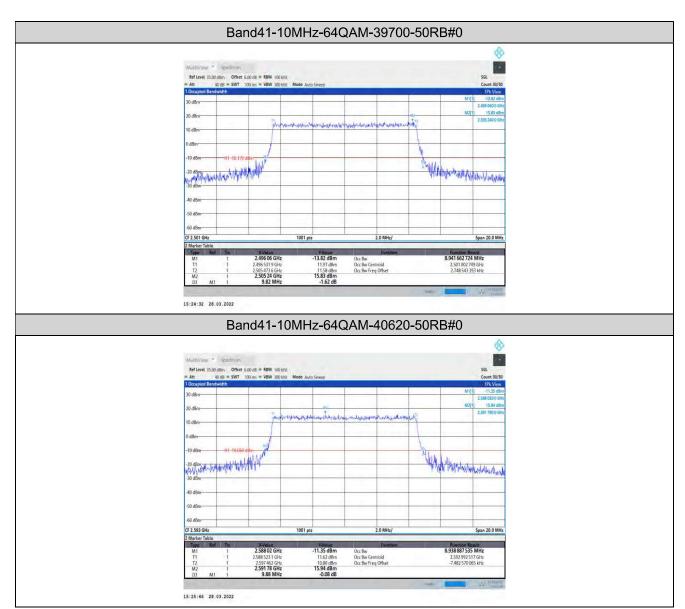



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions, aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawfull and offenders may be prosecuted to the fullest extent of the law Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention.To check the authenticity of testing impsection reports.


Member of the SGS Group (SGS SA)



Report No.: SUZR/2022/1002201

Rev.: 02

Page: 30 of 63

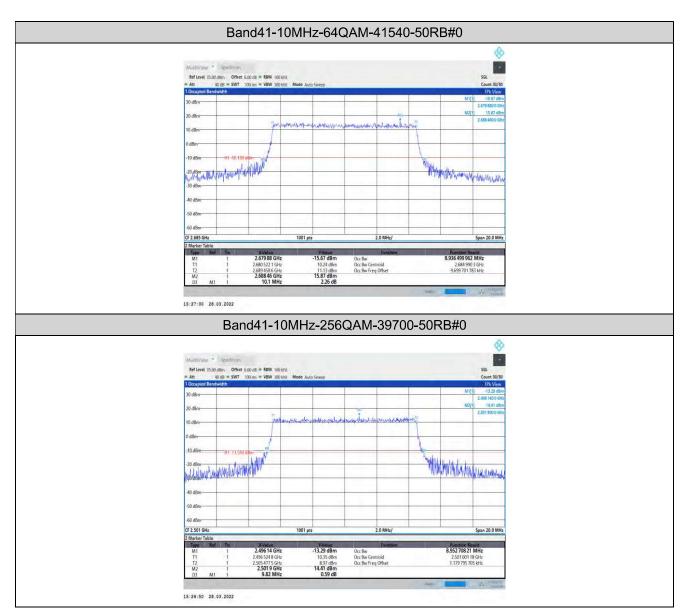






Report No.: SUZR/2022/1002201

Rev.: 02

Page: 31 of 63

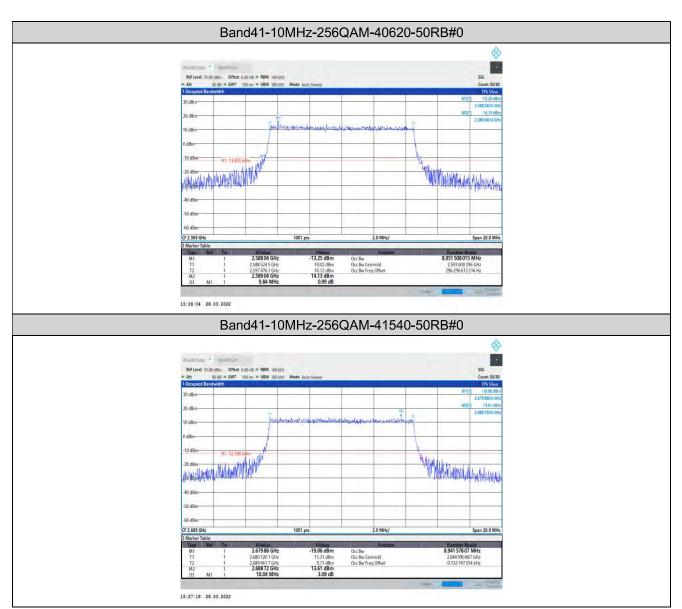






Report No.: SUZR/2022/1002201

Rev.: 02

32 of 63 Page:

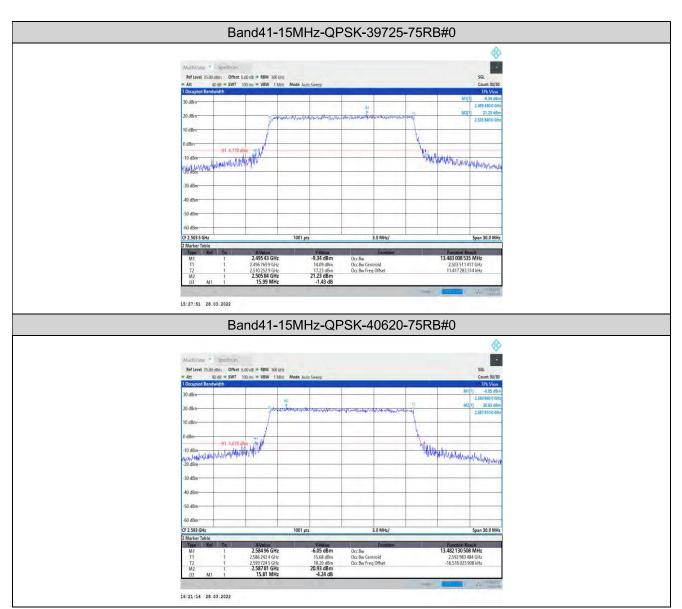






Report No.: SUZR/2022/1002201

Rev.: 02

33 of 63 Page:

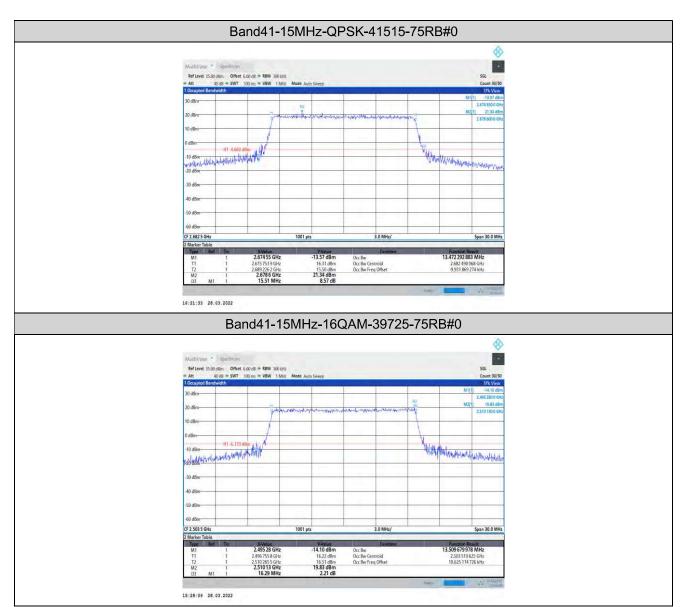






Report No.: SUZR/2022/1002201

Rev.: 02

Page: 34 of 63

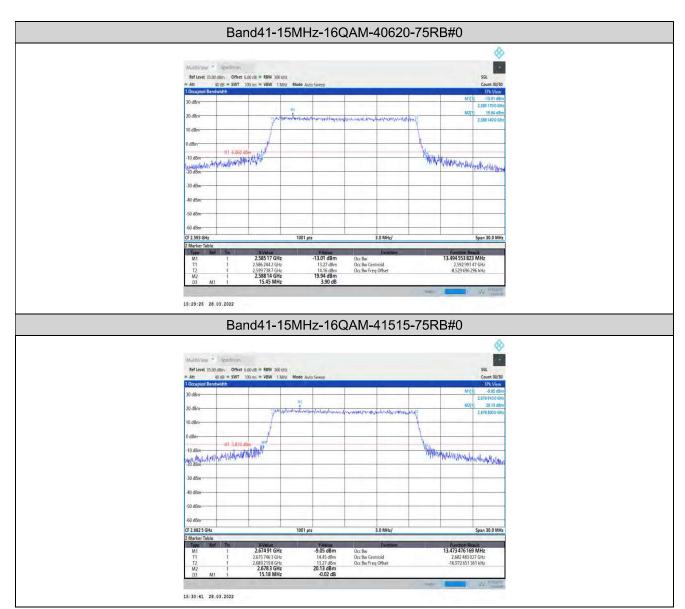



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx.and. for electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-en/Document.aspx. Attention is drawn to the limitation of liability. Indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

**Attention: To check the authenticity of testing impsection report & certificate please-cancal cut as telephone: (86-755) \$307.1443.

South of No. 6 Plans, No. 1, Runsheng Road, Suchou Industria Park, Suchou Area, China (liangsu) Pilot Free Trade Zone 215000 中国 · 苏州 · 中国(江苏)自由贸易试验区苏州片区苏州工业园区润胜路(号的6号厂房南部 鄉第:215000


t (86–512) 62992980 www.sgsgroup.com.cn t (86–512) 62992980 sgs.china@sgs.com



Report No.: SUZR/2022/1002201

Rev.: 02

Page: 35 of 63

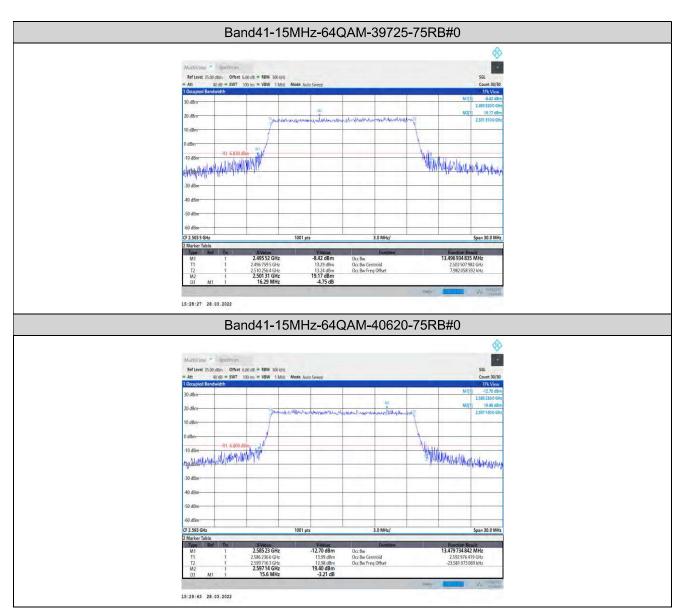





Report No.: SUZR/2022/1002201

Rev.: 02

Page: 36 of 63

