


11AC80SISO_Ant2_5775

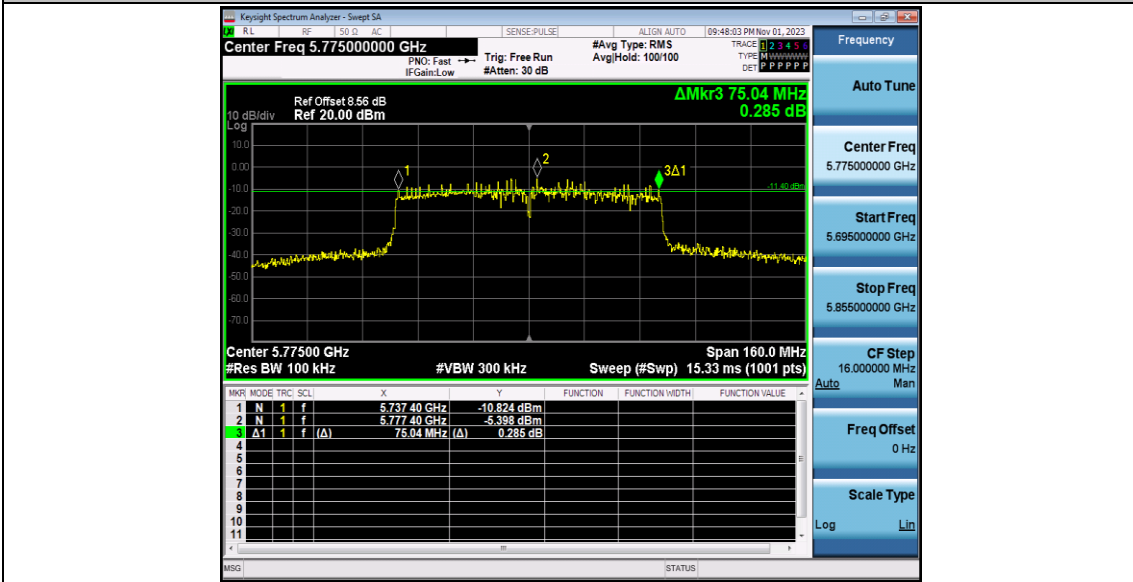



Appendix B: Duty Cycle

Test Result


TestMode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]
11A	Ant2	5180	1.30	1.37	94.89
		5220	1.31	1.37	95.62
		5240	1.31	1.37	95.62
		5260	1.31	1.37	95.62
		5300	1.31	1.37	95.62
		5320	1.30	1.37	94.89
		5500	1.30	1.36	95.59
		5580	1.31	1.37	95.62
		5700	1.30	1.36	95.59
		5745	1.31	1.37	95.62
		5785	1.31	1.37	95.62
		5825	1.31	1.37	95.62
11N20SISO	Ant2	5180	1.31	1.37	95.62
		5220	1.31	1.37	95.62
		5240	1.30	1.37	94.89
		5260	1.31	1.37	95.62
		5300	1.31	1.37	95.62
		5320	1.31	1.37	95.62
		5500	1.30	1.36	95.59
		5580	1.31	1.37	95.62
		5700	1.30	1.37	94.89
		5745	1.30	1.37	94.89
		5785	1.31	1.37	95.62
		5825	1.31	1.37	95.62
11N40SISO	Ant2	5190	0.65	0.71	91.55
		5230	0.64	0.70	91.43
		5270	0.64	0.70	91.43
		5310	0.65	0.71	91.55
		5510	0.64	0.70	91.43
		5550	0.64	0.70	91.43
		5670	0.64	0.70	91.43
		5755	0.65	0.71	91.55
		5795	0.64	0.70	91.43
11AC20SISO	Ant2	5180	1.30	1.36	95.59
		5220	1.30	1.36	95.59
		5240	1.30	1.36	95.59
		5260	1.31	1.37	95.62

		5300	1.31	1.37	95.62
		5320	1.31	1.37	95.62
		5500	1.30	1.37	94.89
		5580	1.31	1.37	95.62
		5700	1.31	1.37	95.62
		5745	1.30	1.36	95.59
		5785	1.30	1.37	94.89
		5825	1.30	1.37	94.89
11AC40SISO	Ant2	5190	0.64	0.70	91.43
		5230	0.64	0.70	91.43
		5270	0.65	0.71	91.55
		5310	0.65	0.71	91.55
		5510	0.64	0.70	91.43
		5550	0.65	0.71	91.55
		5670	0.65	0.71	91.55
		5755	0.64	0.70	91.43
		5795	0.64	0.70	91.43
11AC80SISO	Ant2	5210	1.06	1.12	94.64
		5290	1.07	1.12	95.54
		5530	1.06	1.12	94.64
		5775	1.06	1.12	94.64


Test Graphs

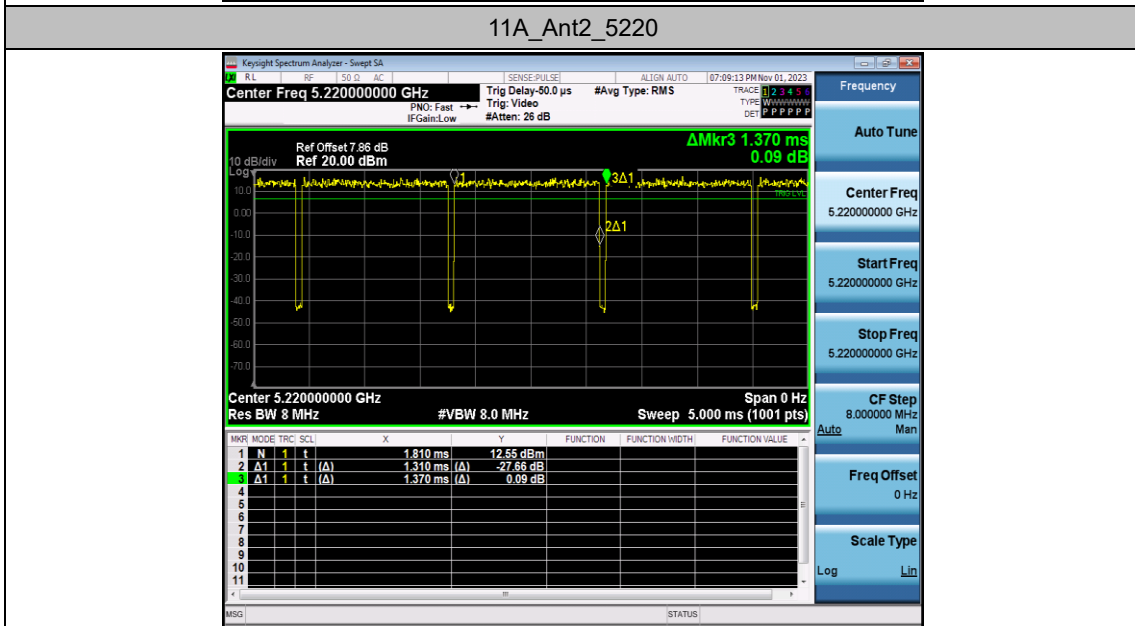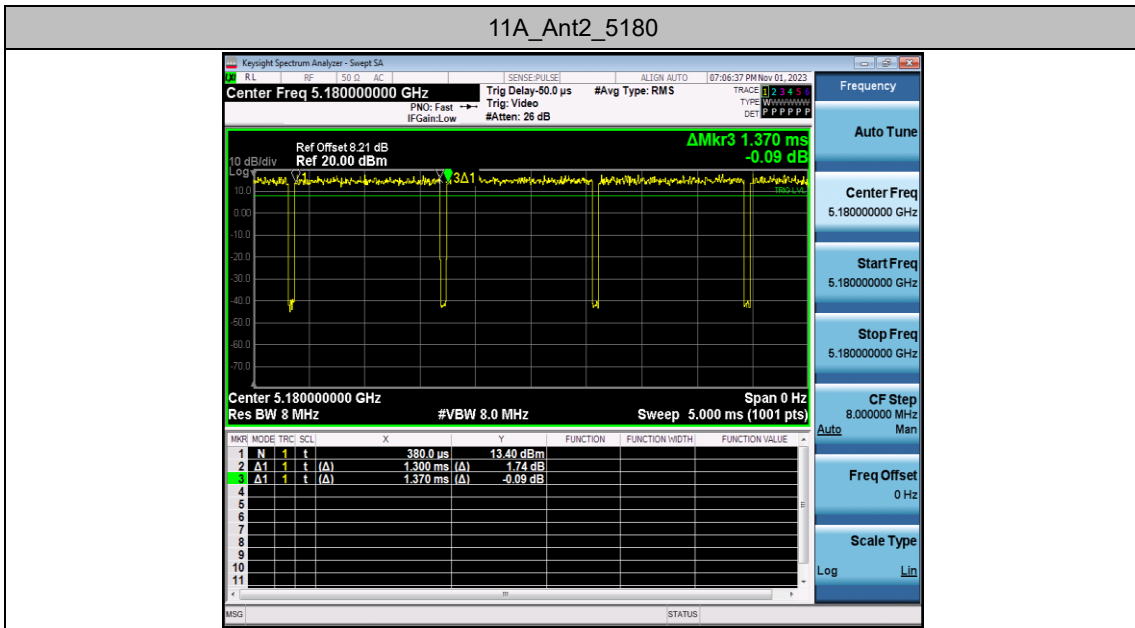


11A_Ant2_5240

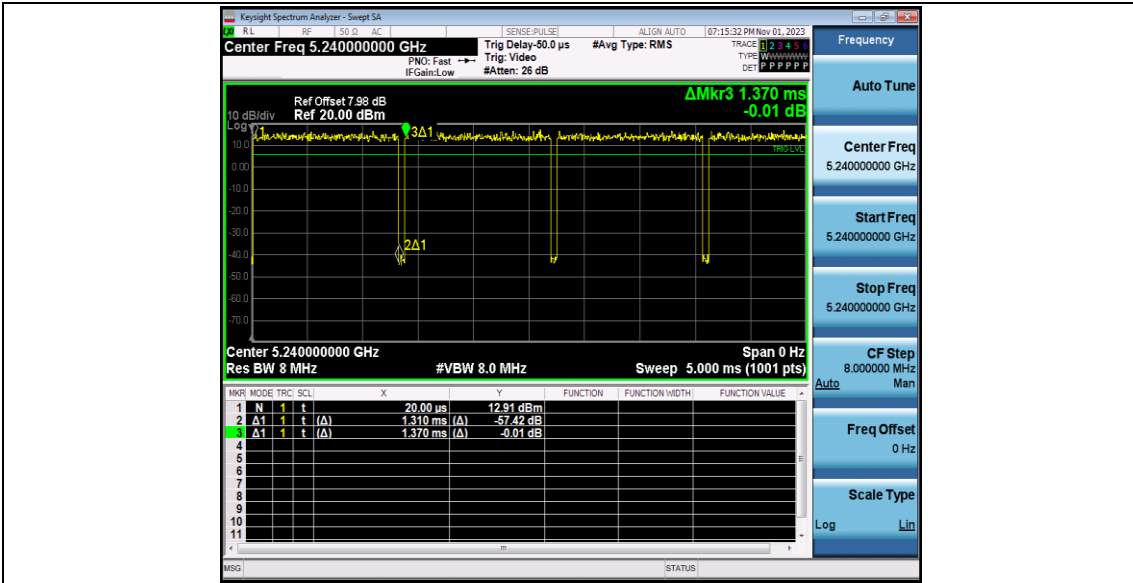


11A_Ant2_5260

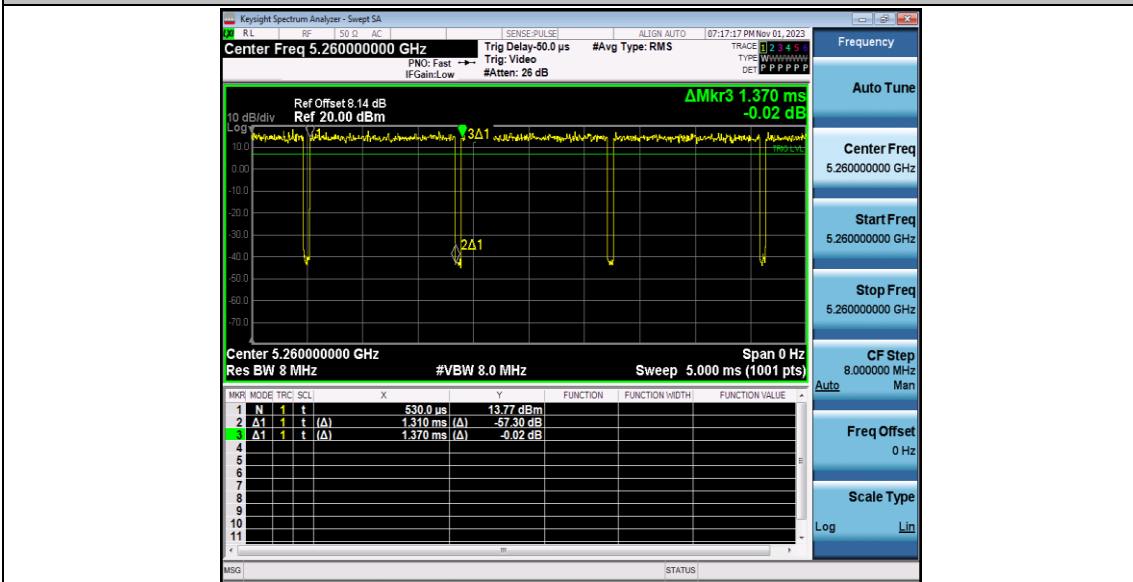


11A_Ant2_5300

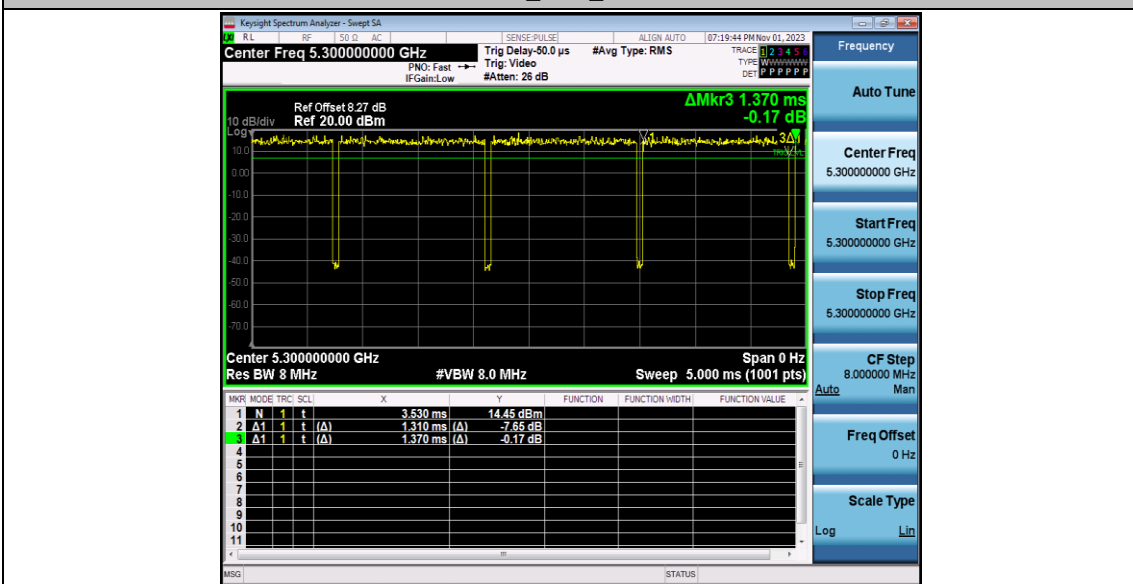


11A_Ant2_5320

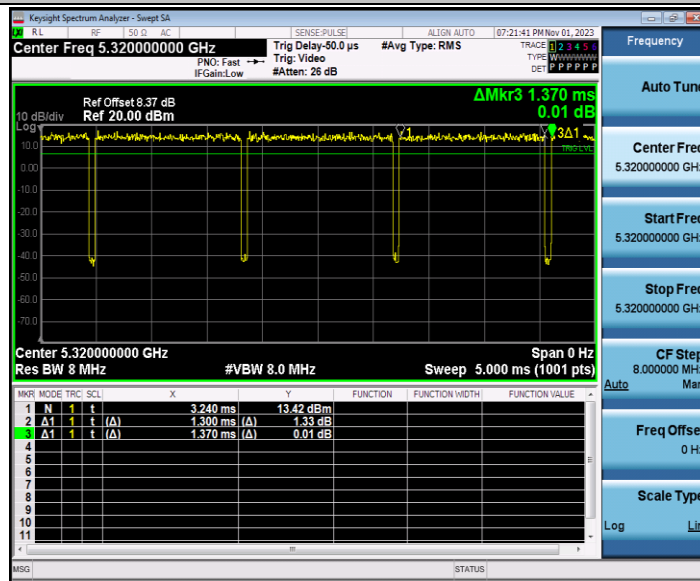


11A_Ant2_5500

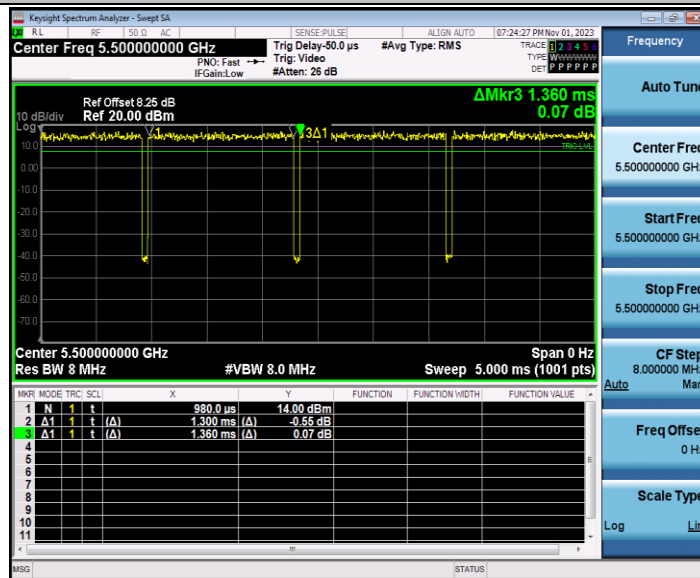


11A_Ant2_5580

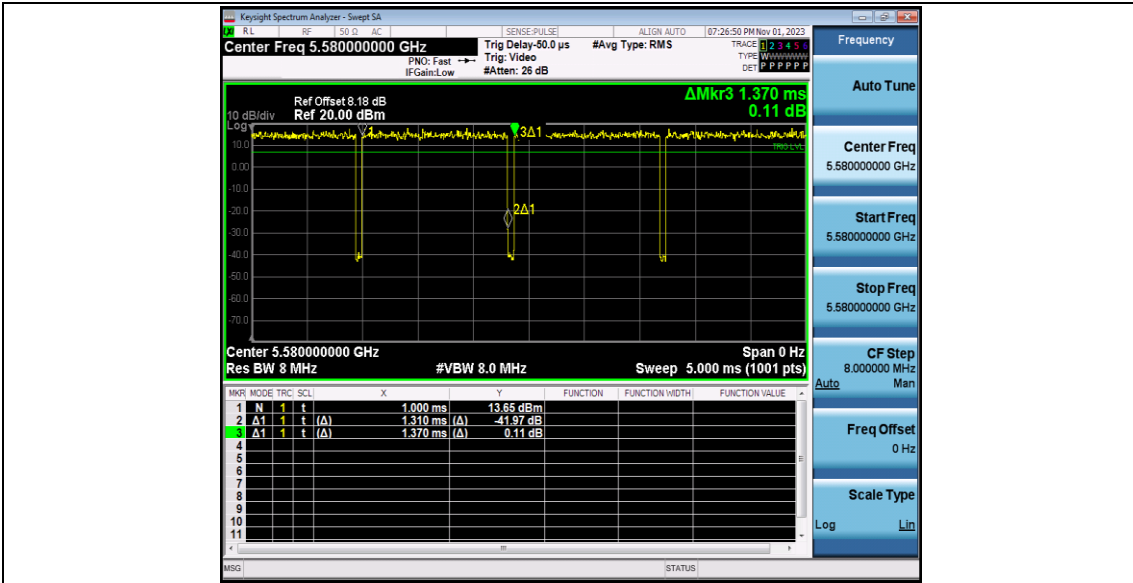


11A_Ant2_5700

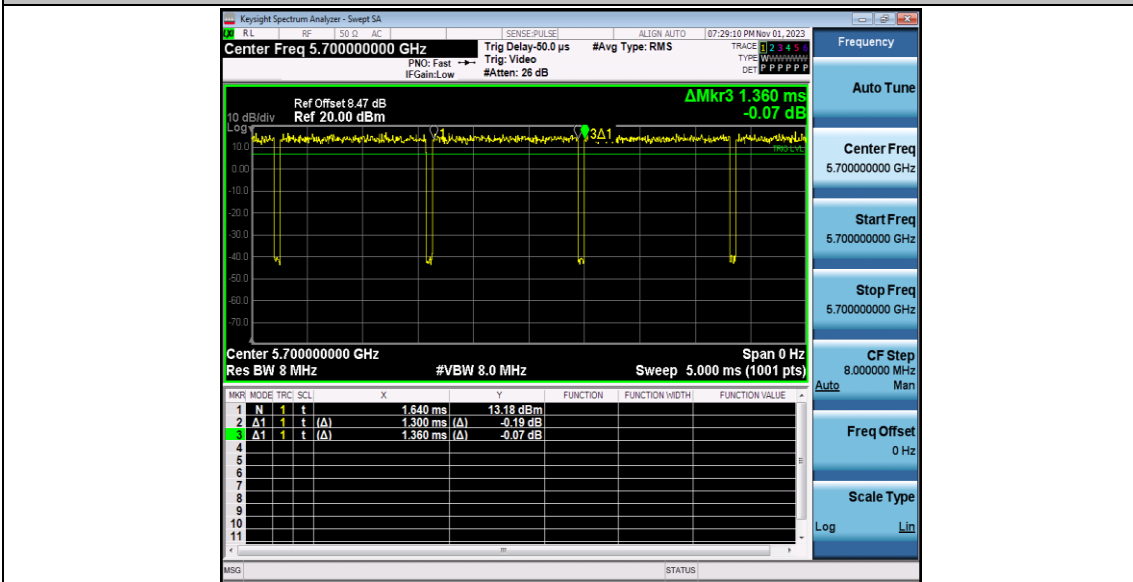


11A_Ant2_5745

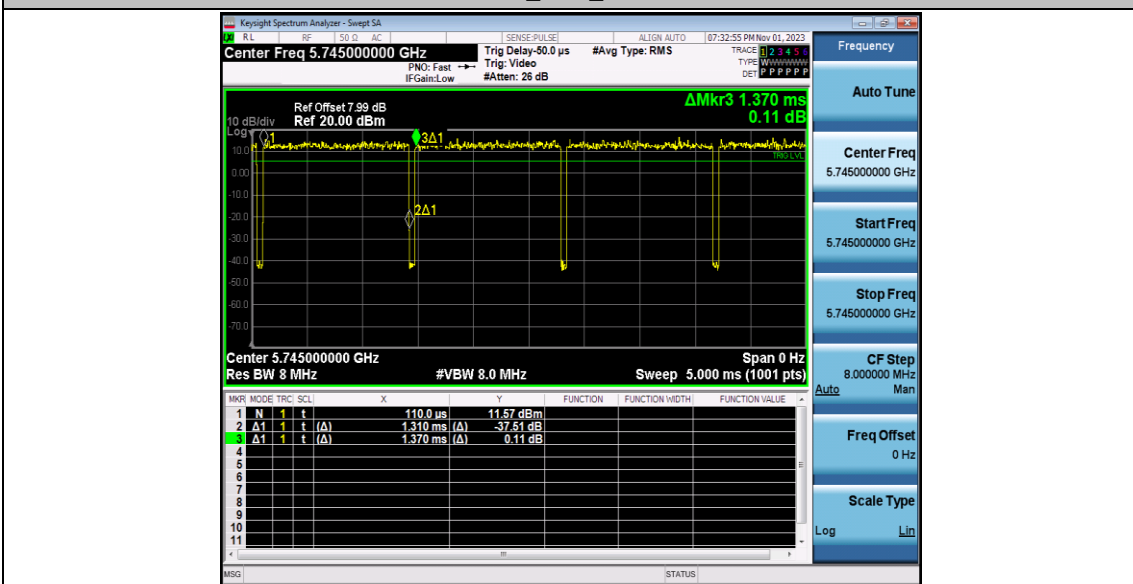


11A_Ant2_5785

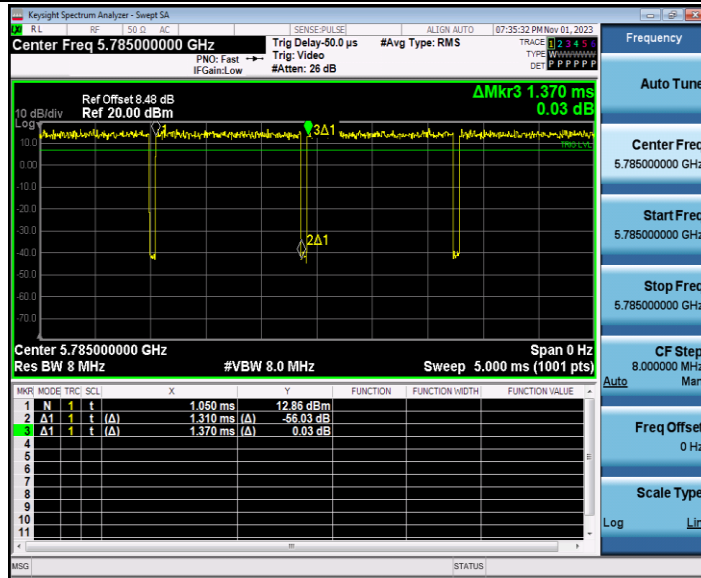


11A_Ant2_5825

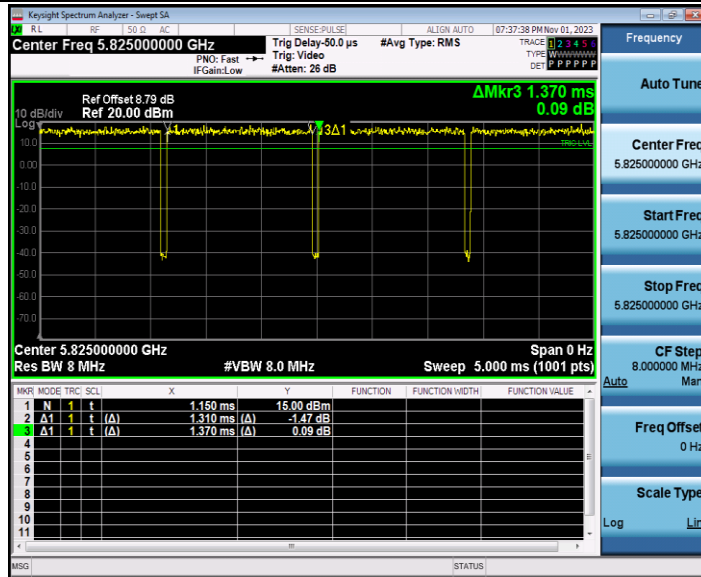


11N20SISO_Ant2_5180

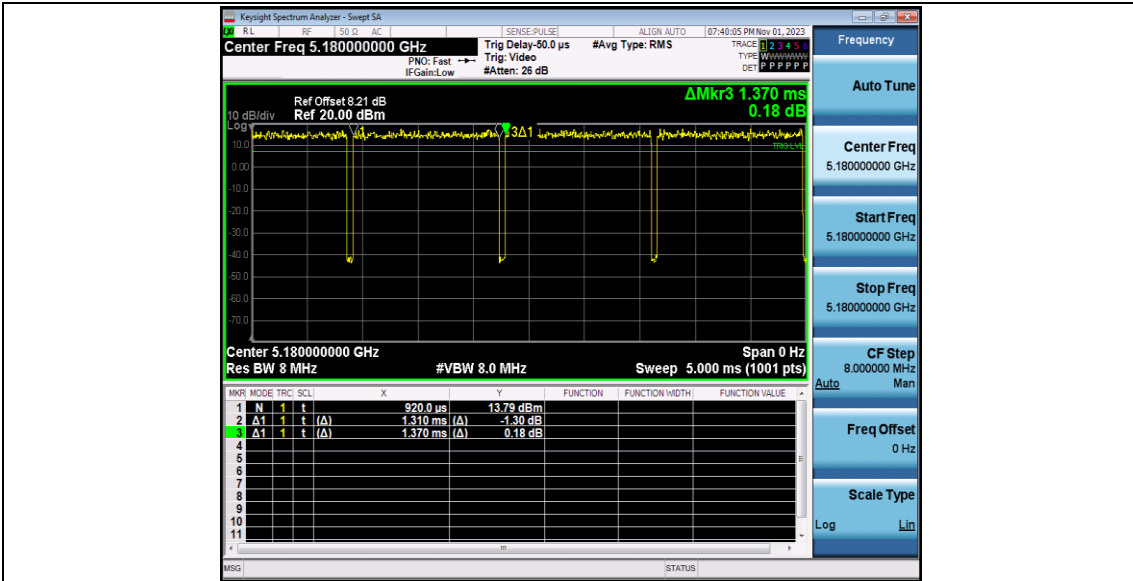


11N20SISO_Ant2_5220

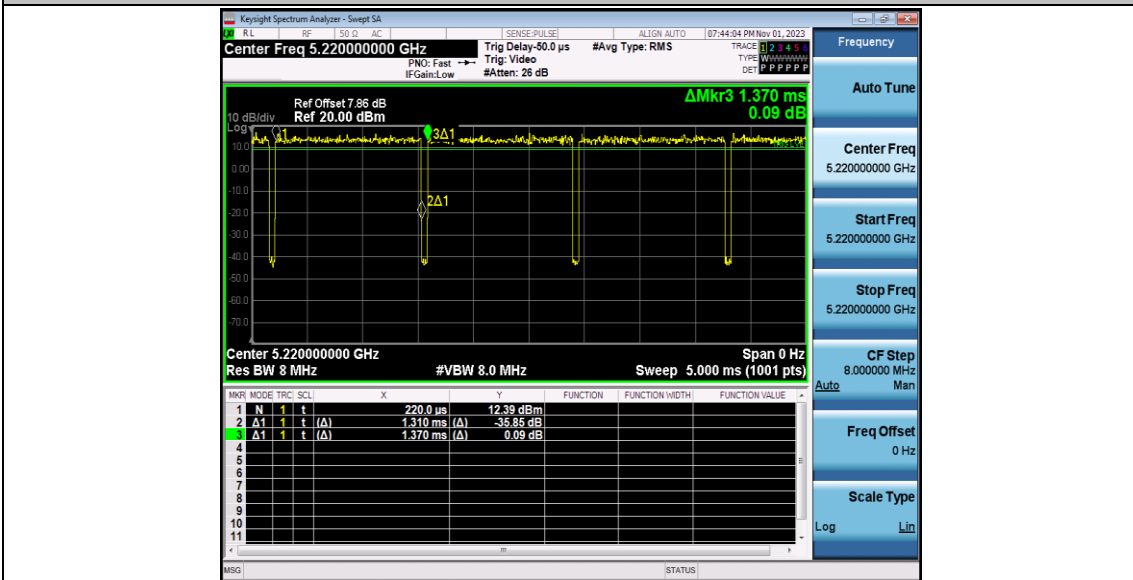


11N20SISO_Ant2_5240

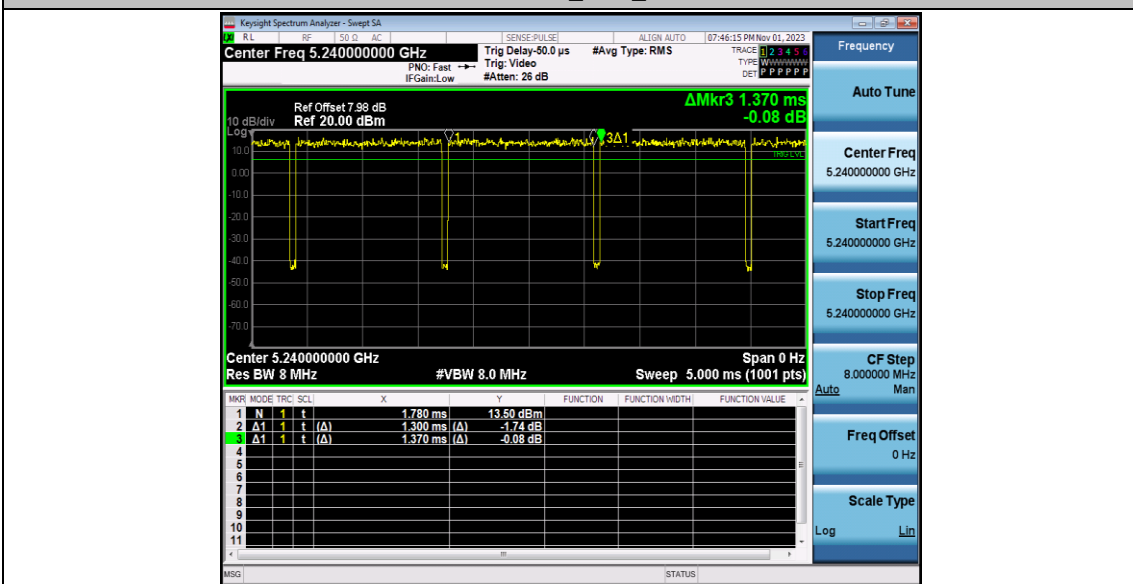


11N20SISO_Ant2_5260

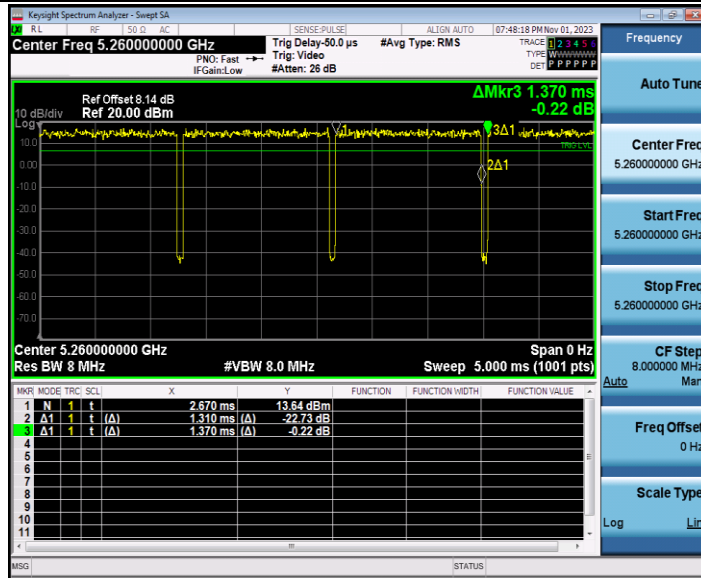


11N20SISO_Ant2_5300

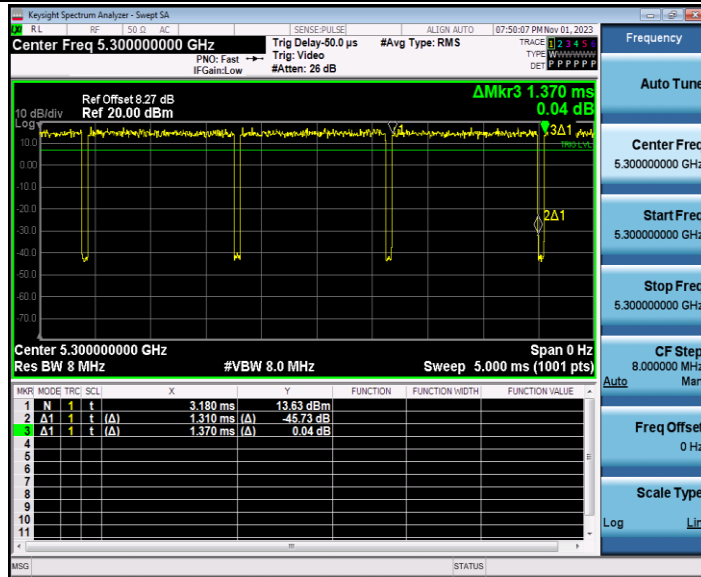


11N20SISO_Ant2_5320

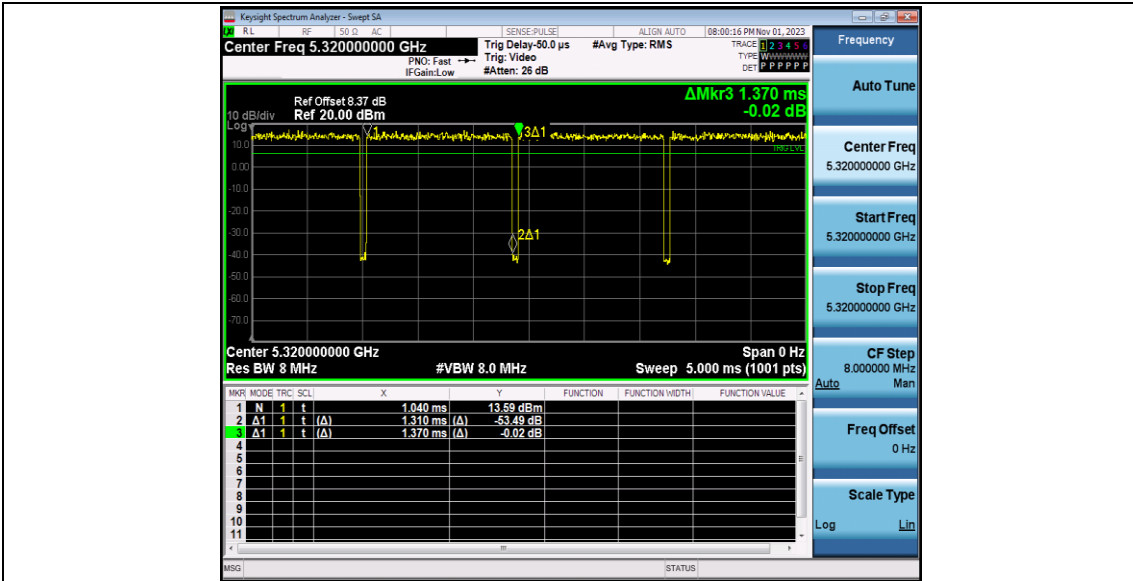


11N20SISO_Ant2_5500

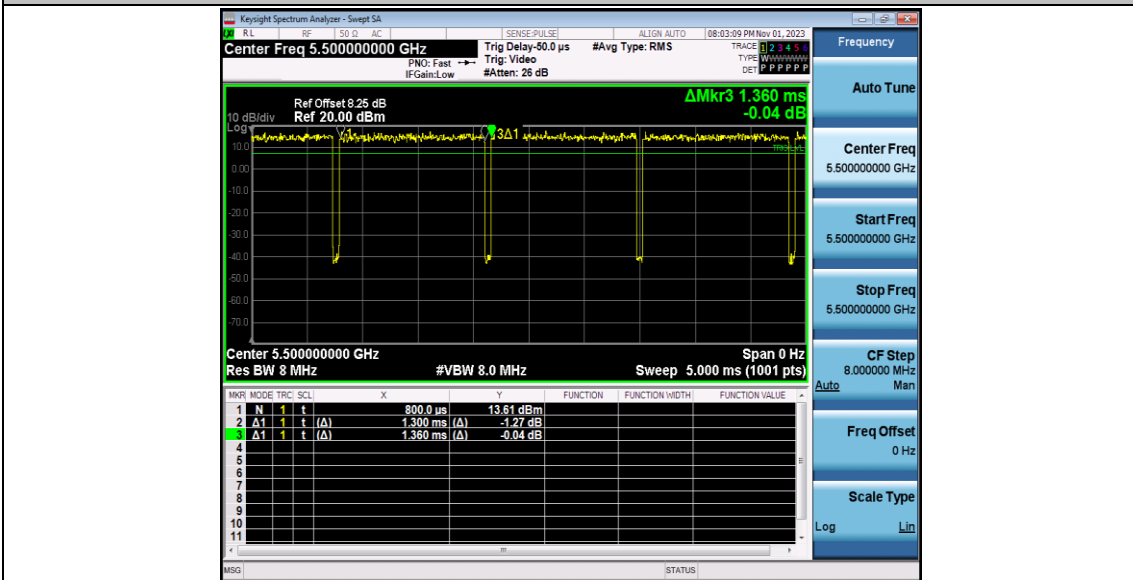


11N20SISO_Ant2_5580

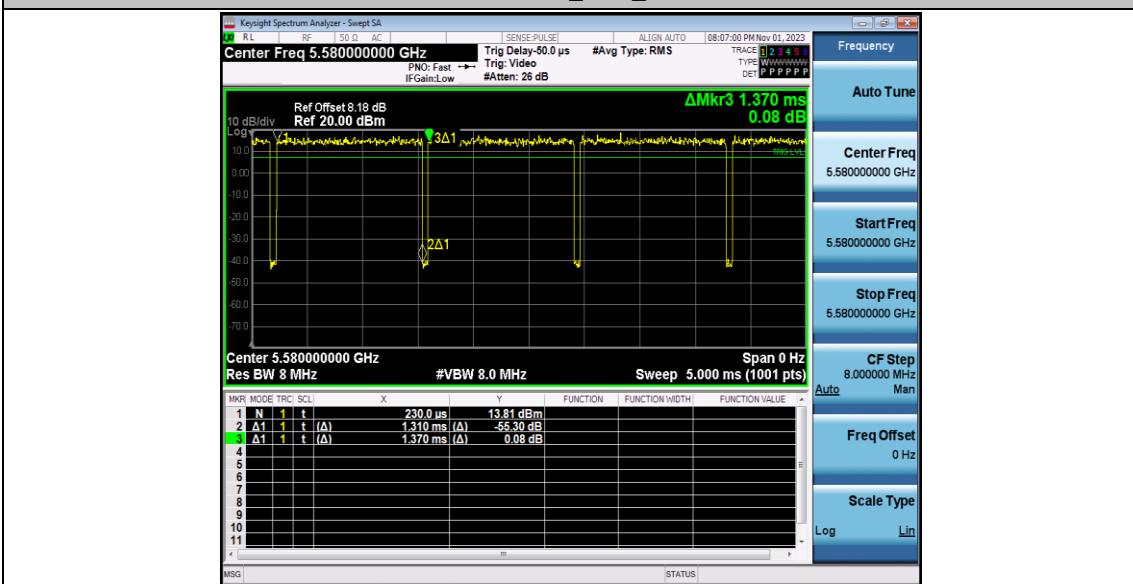


11N20SISO_Ant2_5700

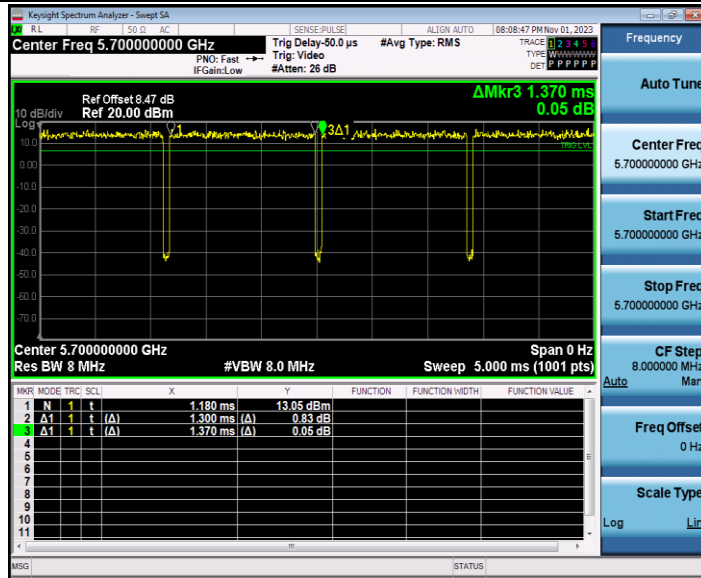


11N20SISO_Ant2_5745

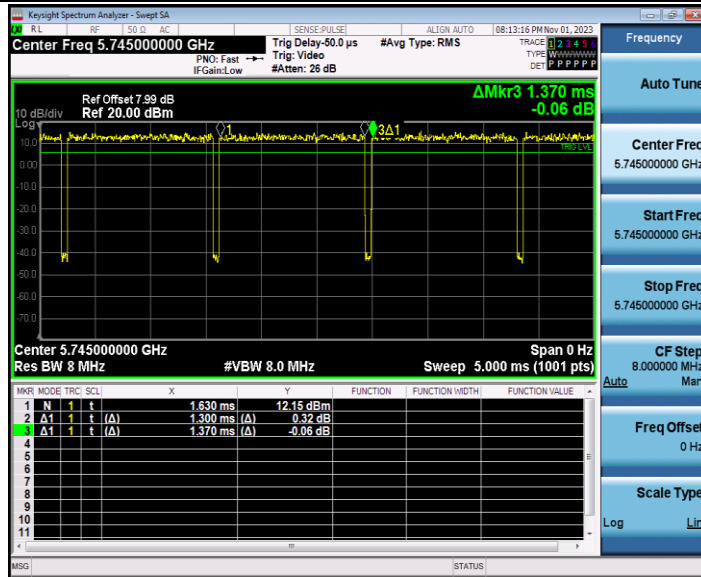


11N20SISO_Ant2_5785

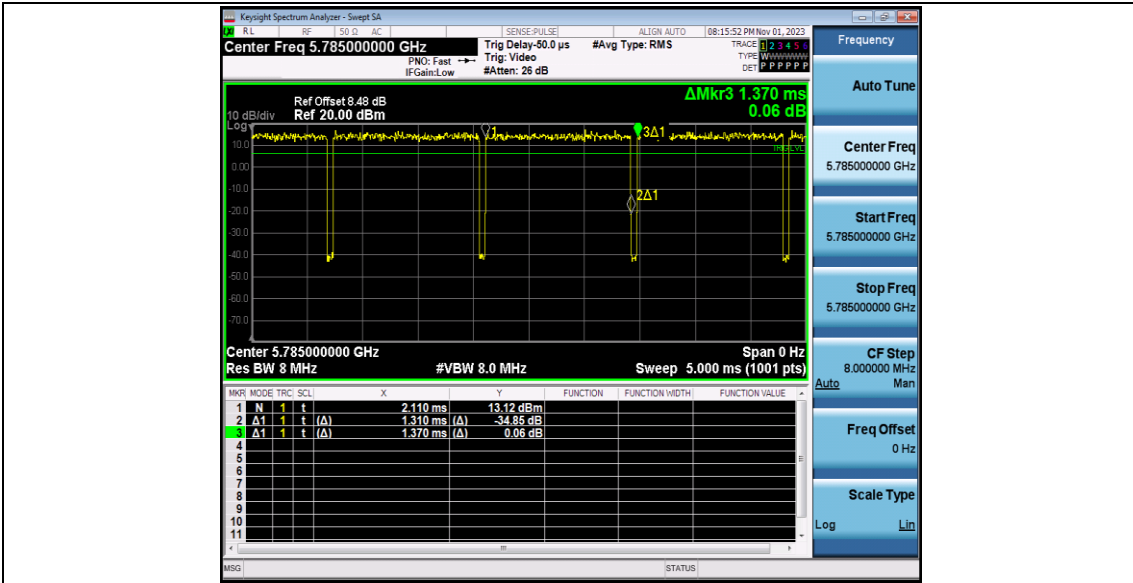


11N20SISO_Ant2_5825

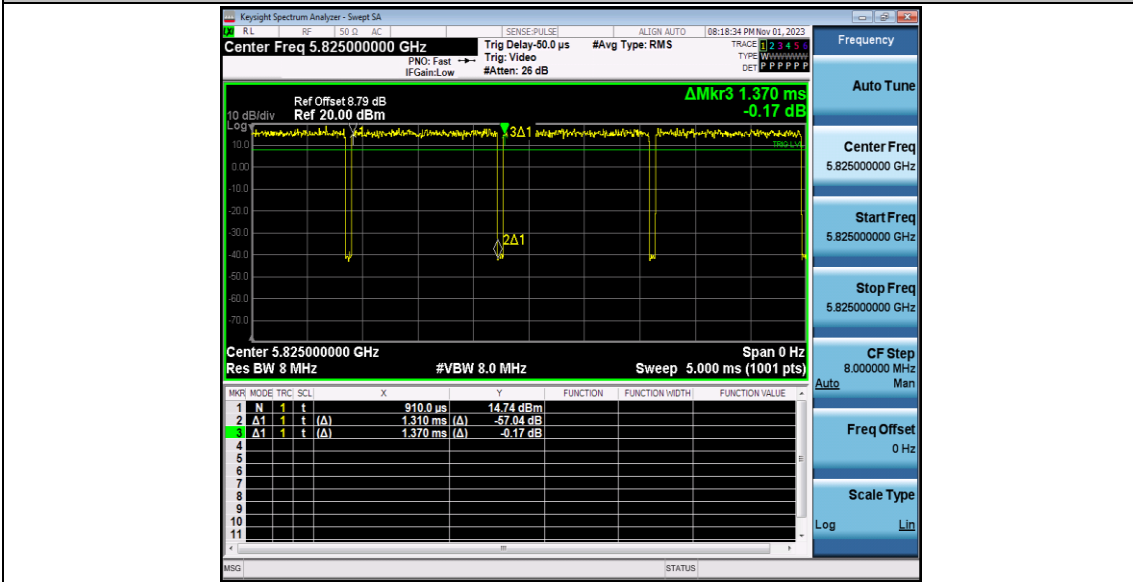


11N40SISO_Ant2_5190

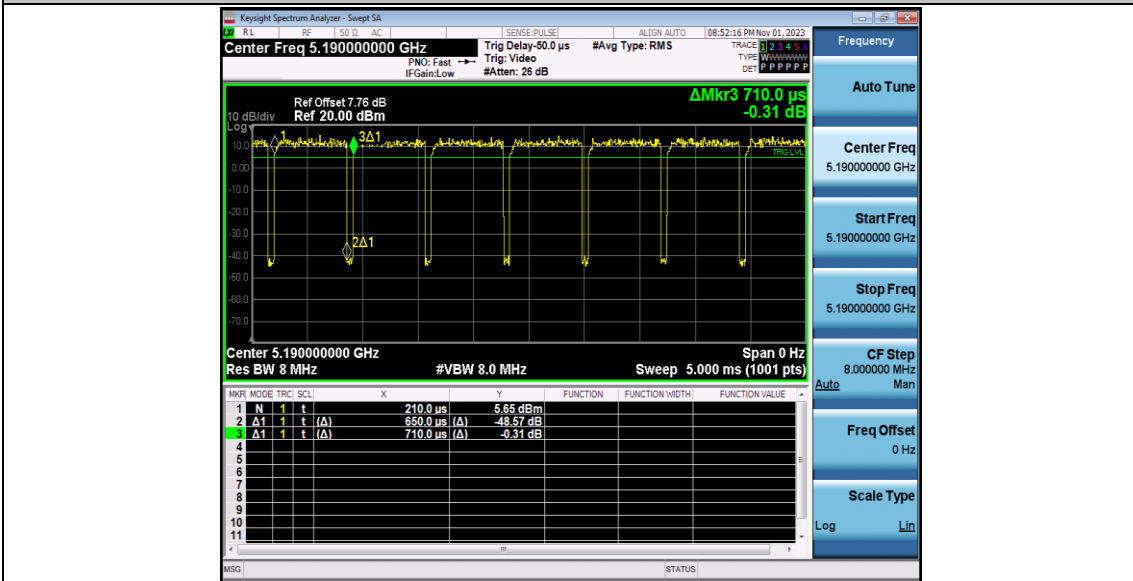


11N40SISO_Ant2_5230

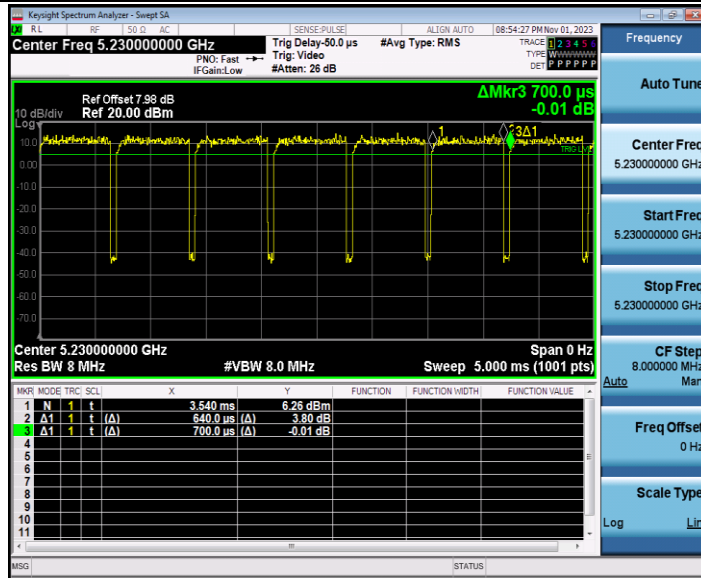


11N40SISO_Ant2_5270

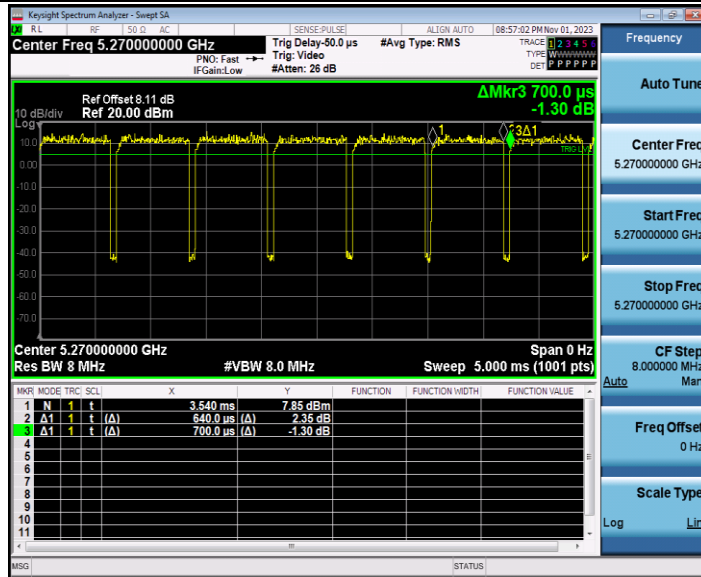


11N40SISO_Ant2_5310

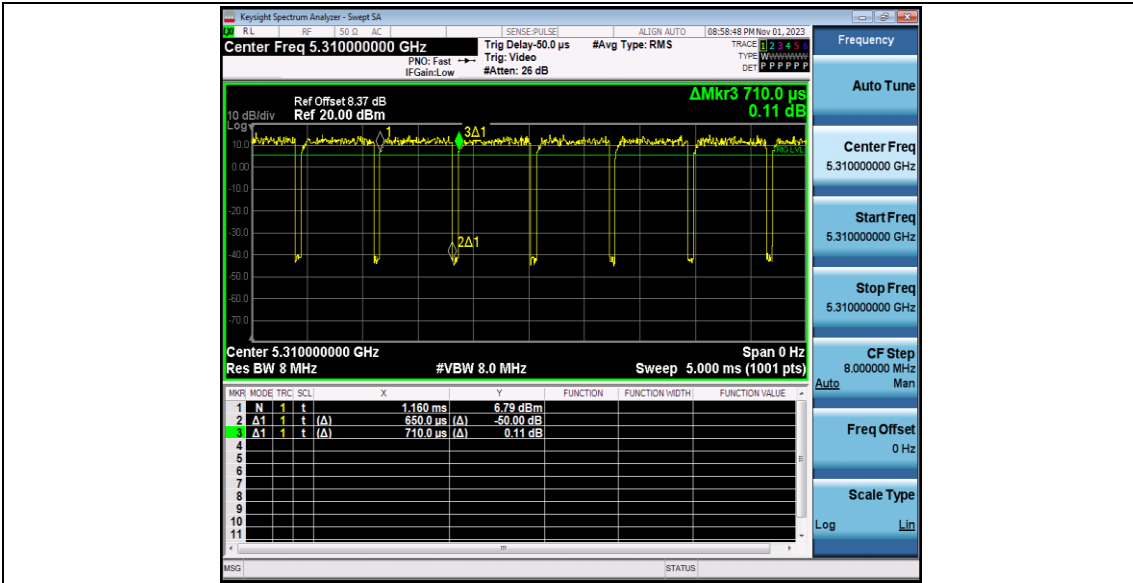


11N40SISO_Ant2_5510

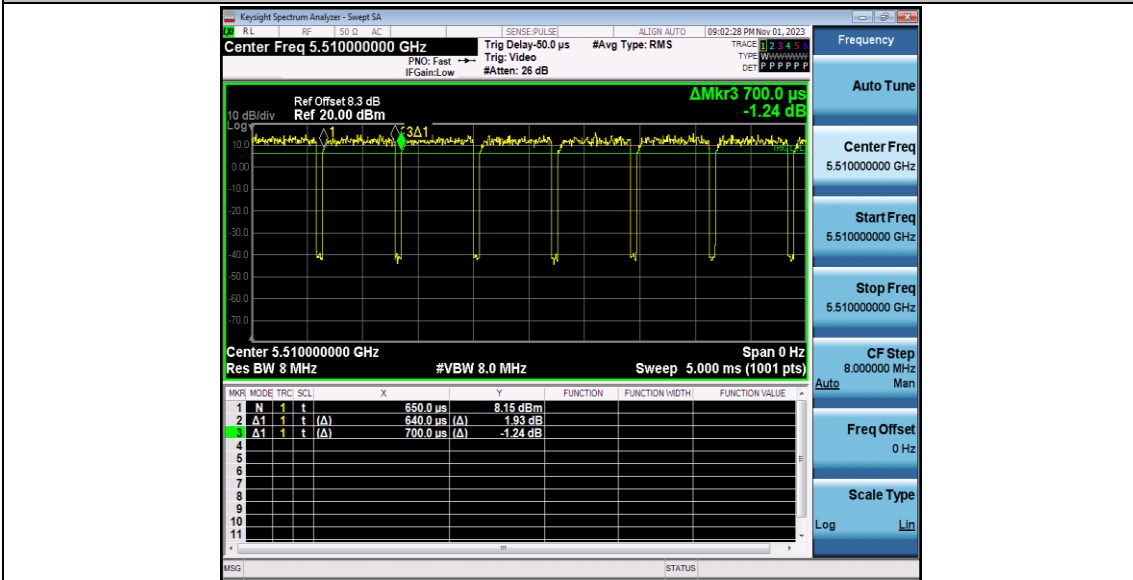


11N40SISO_Ant2_5550

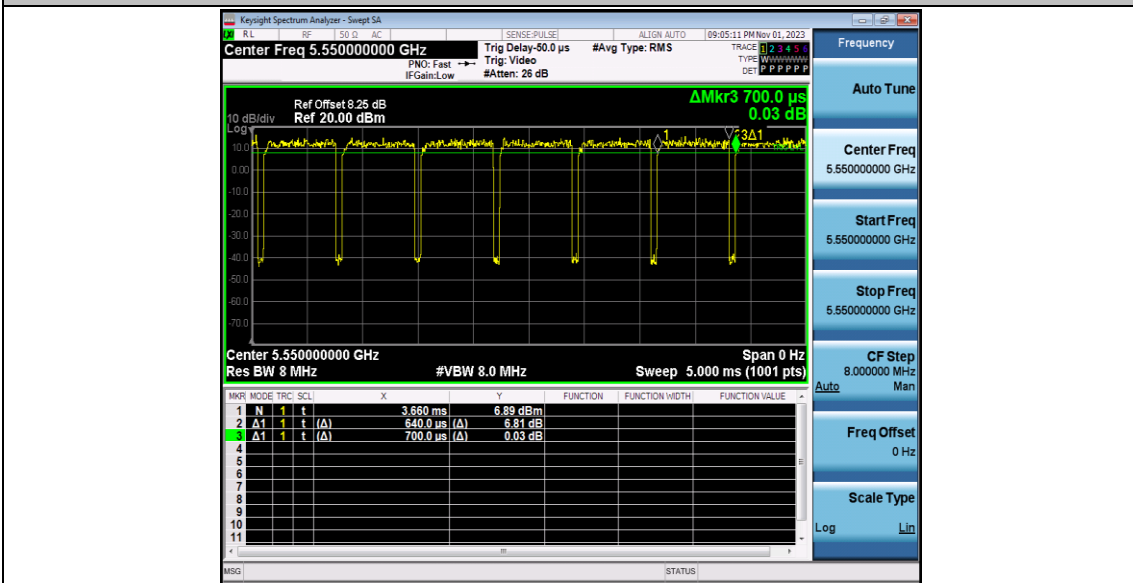


11N40SISO_Ant2_5670

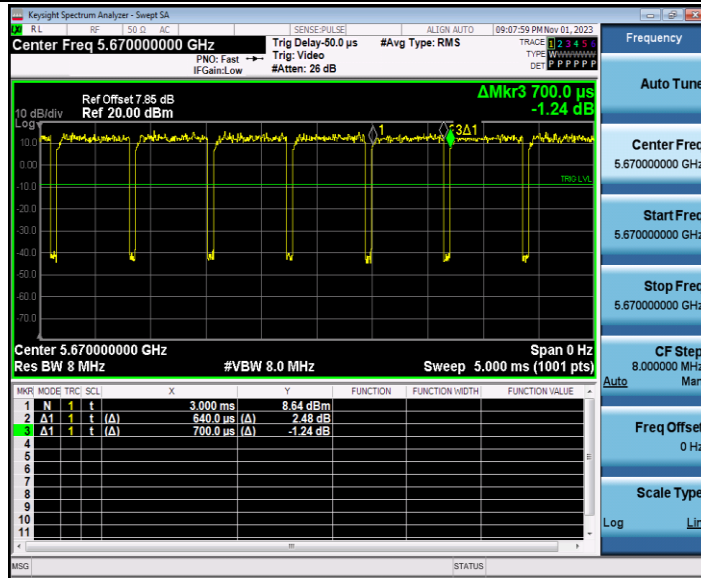


11N40SISO_Ant2_5755

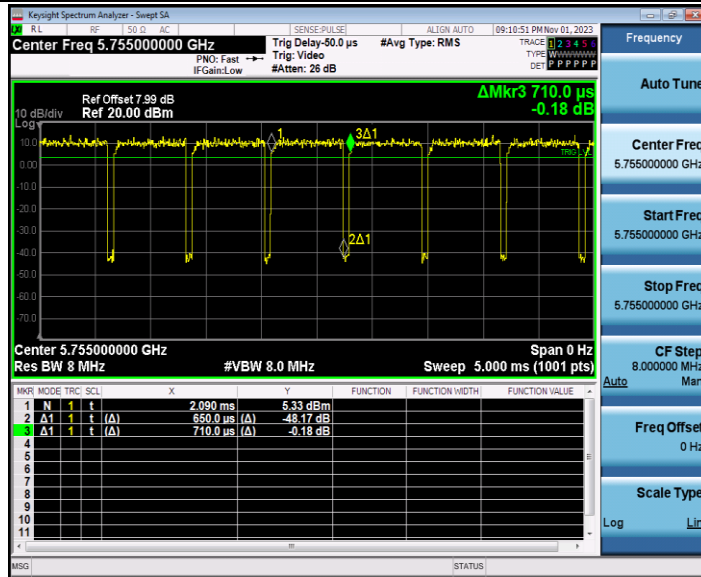


11N40SISO_Ant2_5795

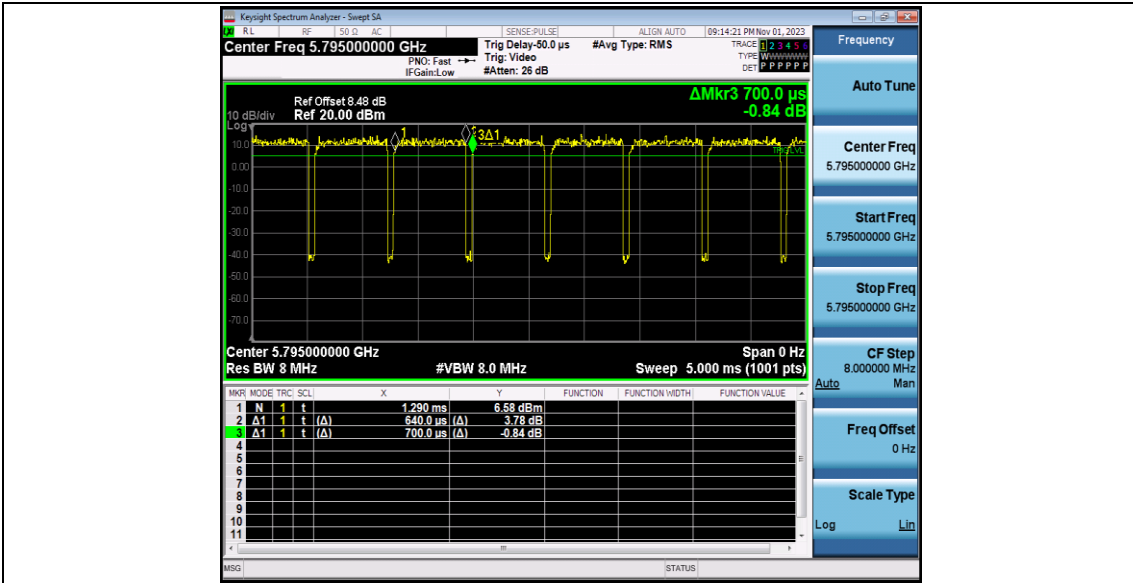


11AC20SISO_Ant2_5180

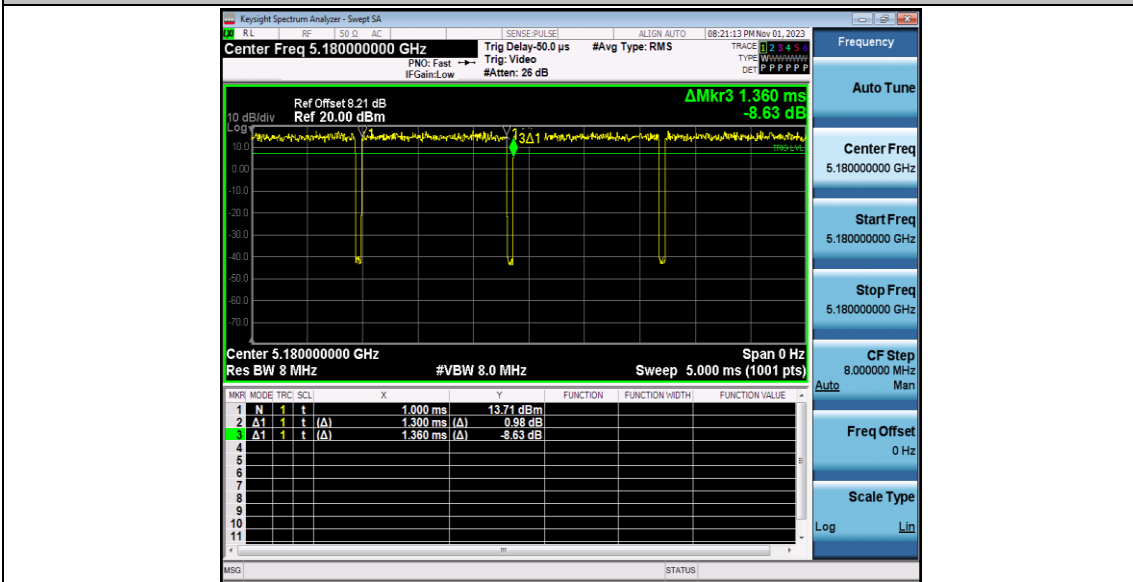


11AC20SISO_Ant2_5220

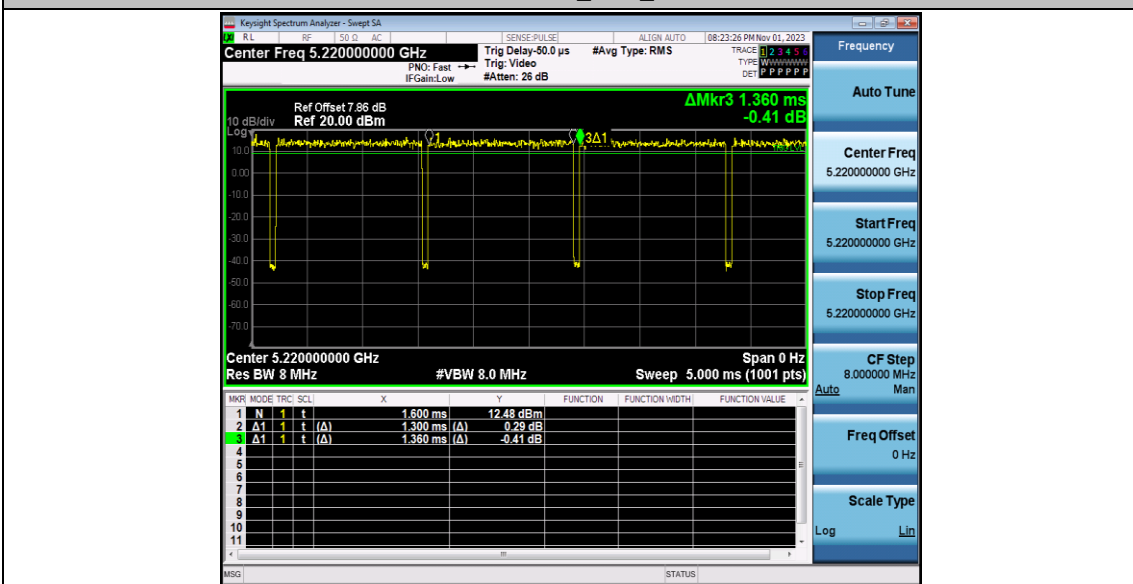


11AC20SISO_Ant2_5240

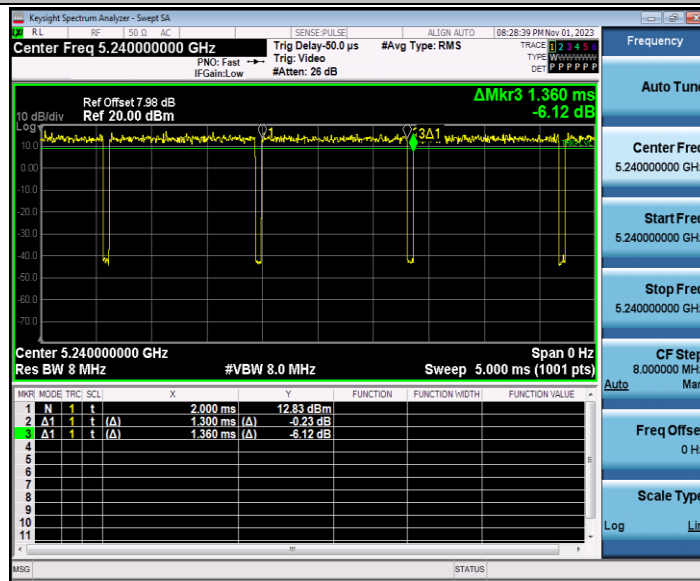


11AC20SISO_Ant2_5260

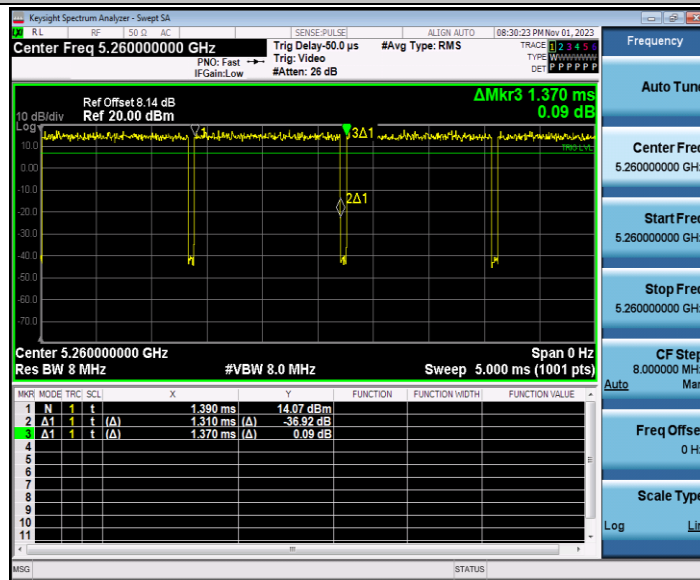


11AC20SISO_Ant2_5300

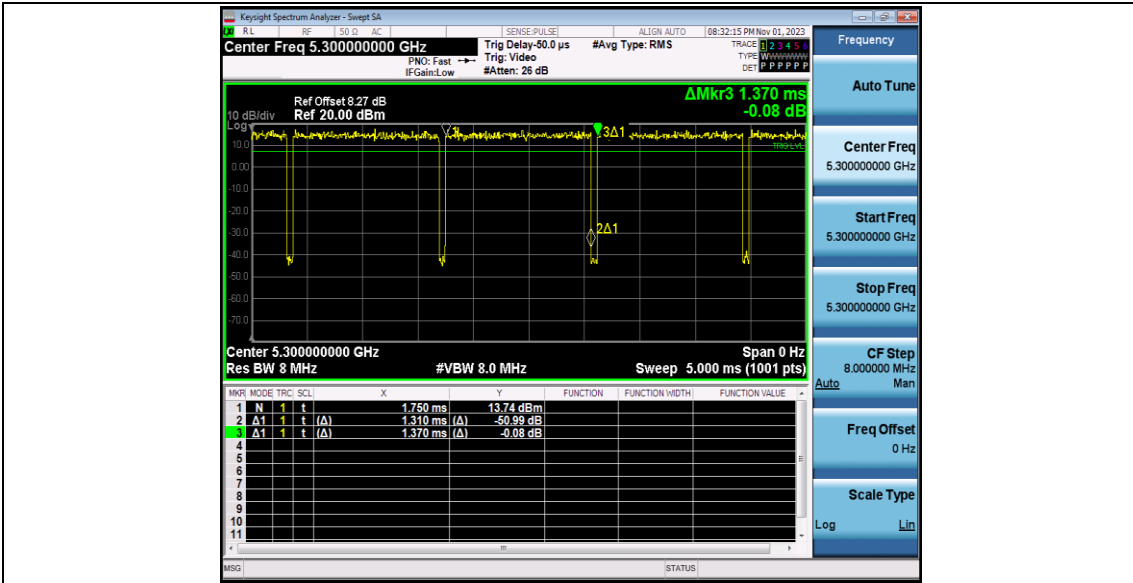


11AC20SISO_Ant2_5320

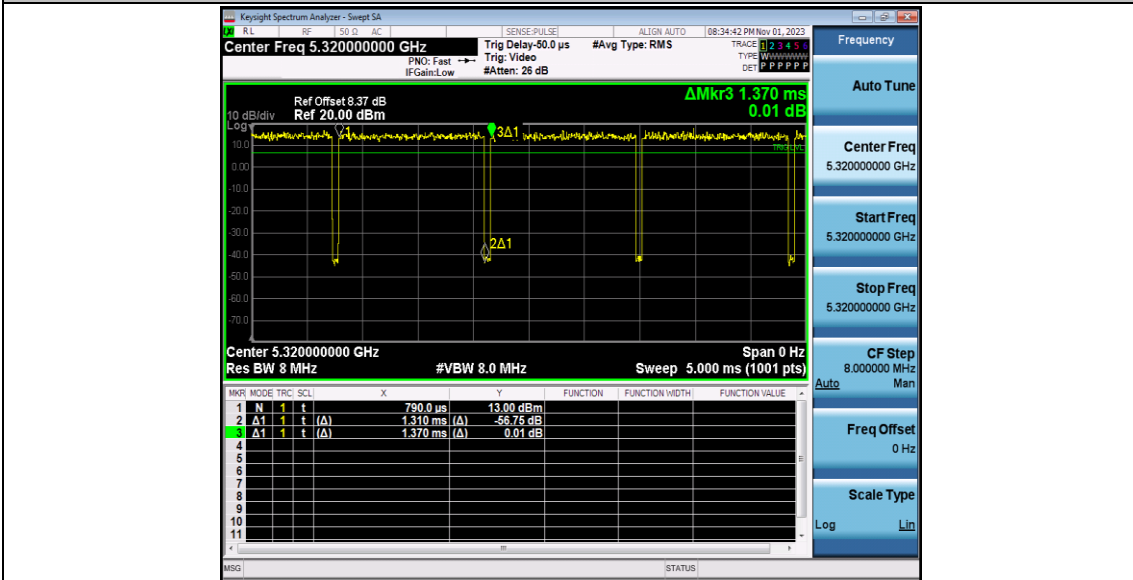


11AC20SISO_Ant2_5500

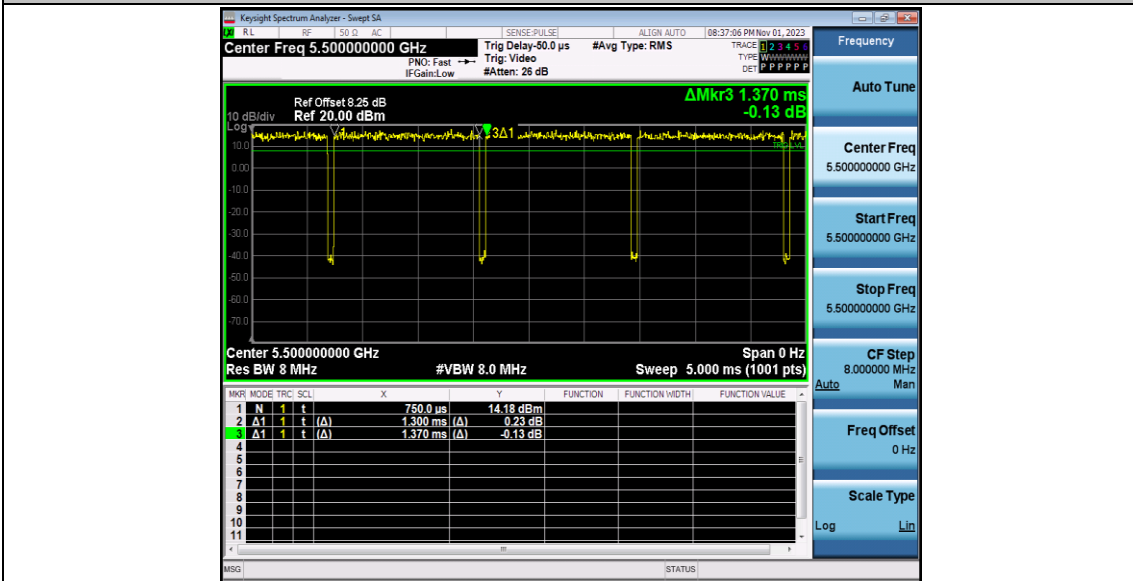


11AC20SISO_Ant2_5580

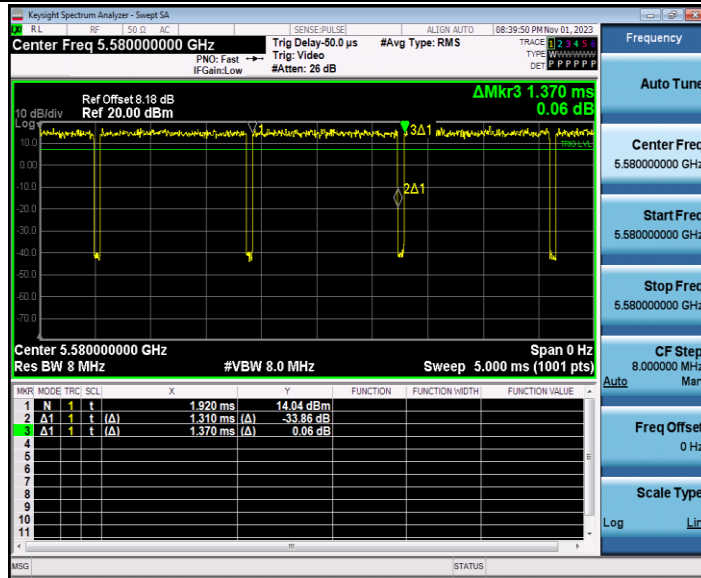


11AC20SISO_Ant2_5700

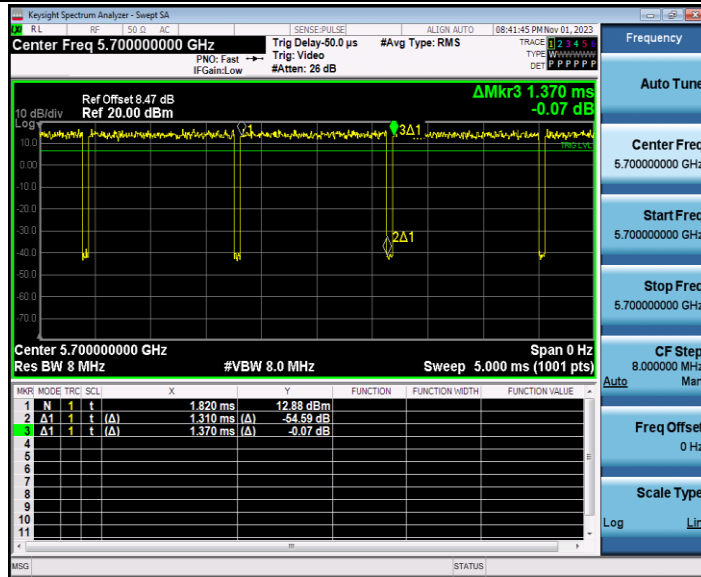


11AC20SISO_Ant2_5745

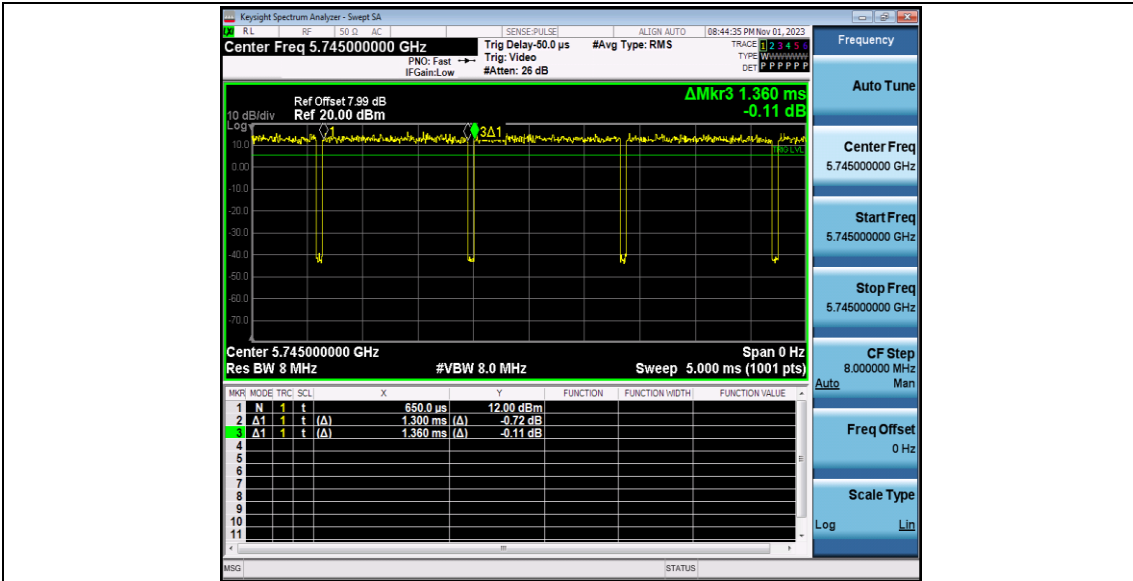


11AC20SISO_Ant2_5785

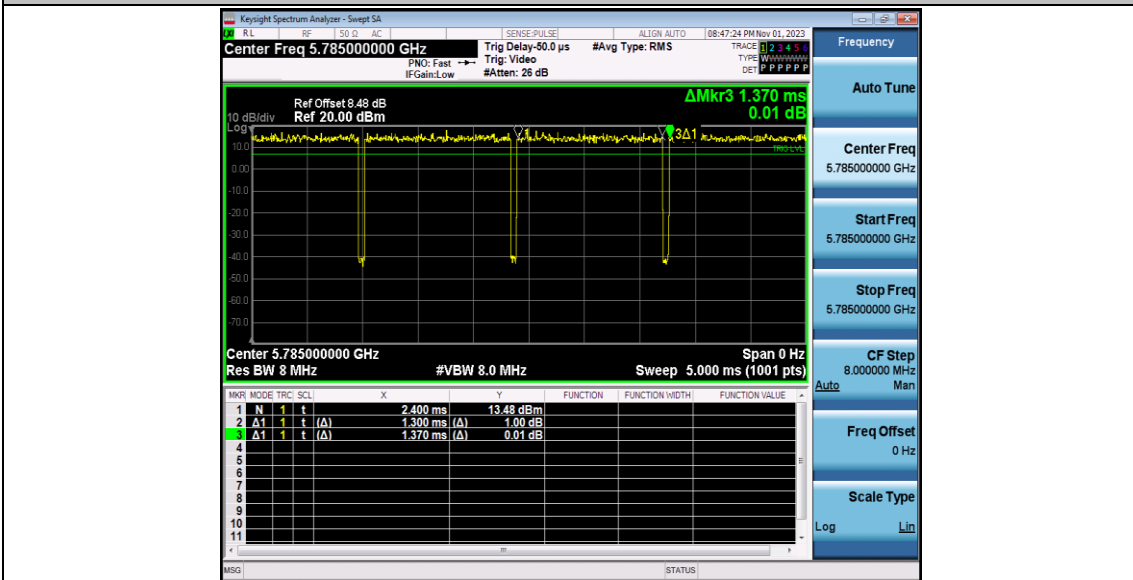


11AC20SISO_Ant2_5825

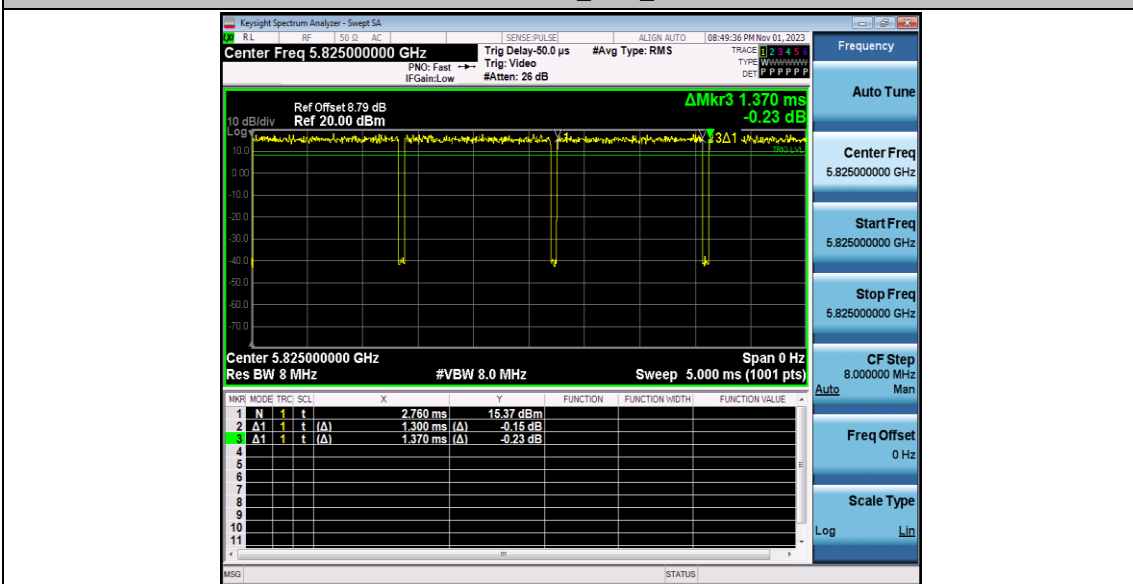


11AC40SISO_Ant2_5190

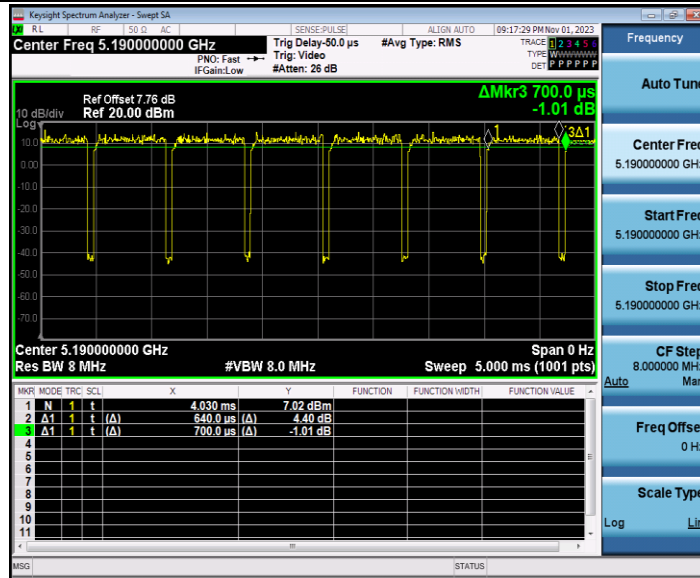


11AC40SISO_Ant2_5230

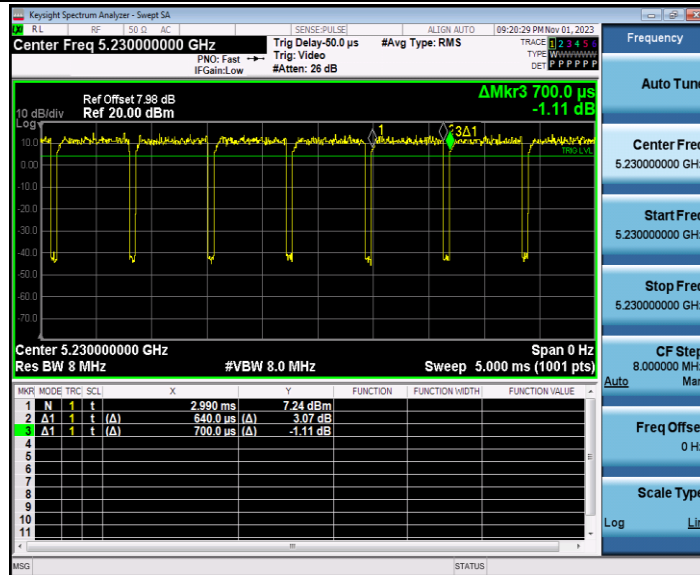

11AC40SISO_Ant2_5270

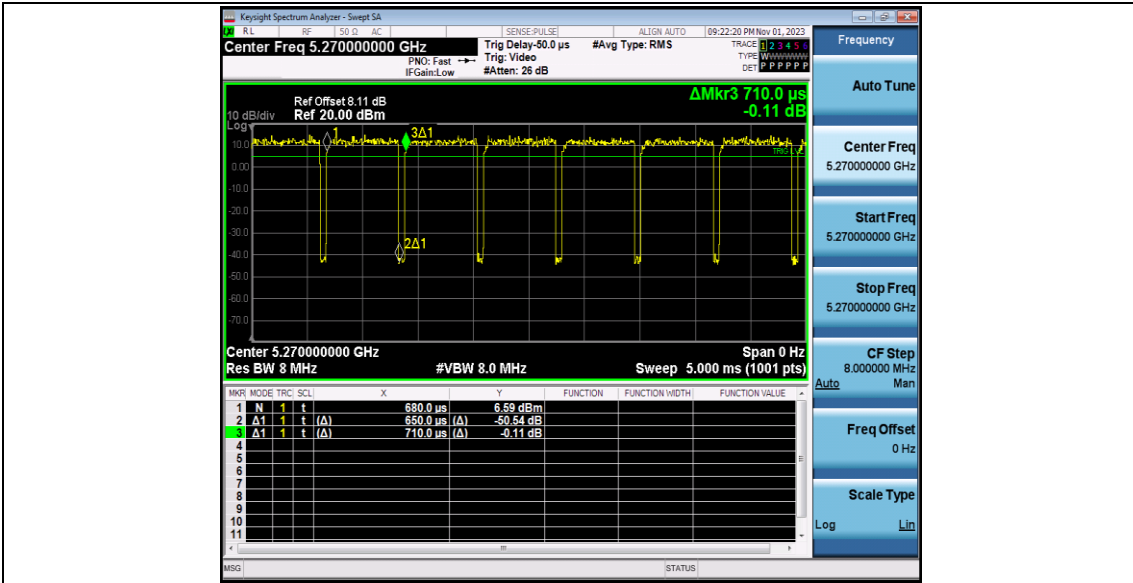

11AC40SISO_Ant2_5310

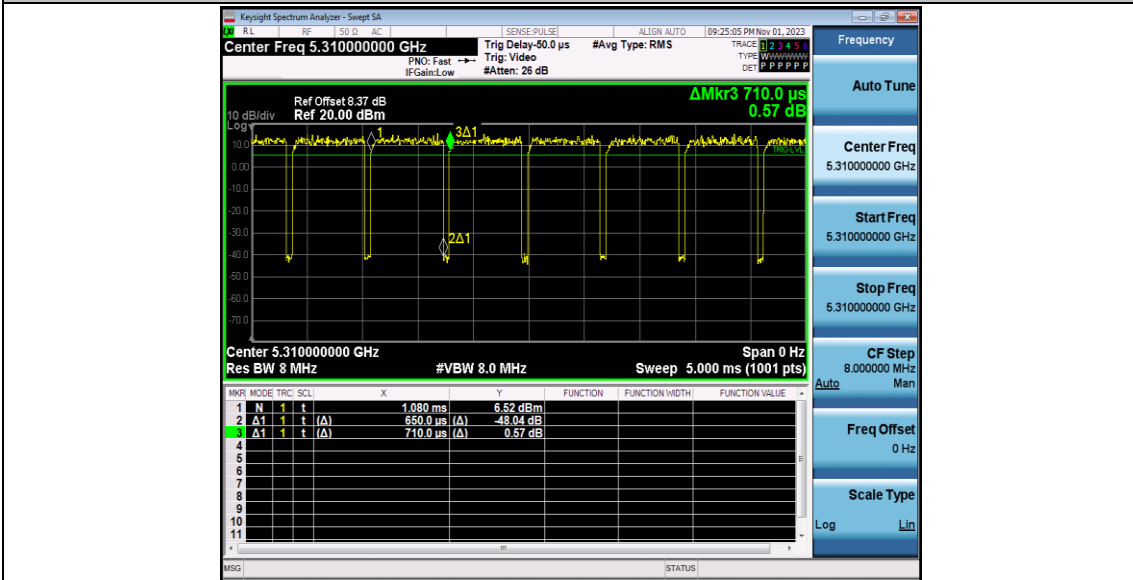

11AC40SISO_Ant2_5510

