





Test Graphs

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Ref

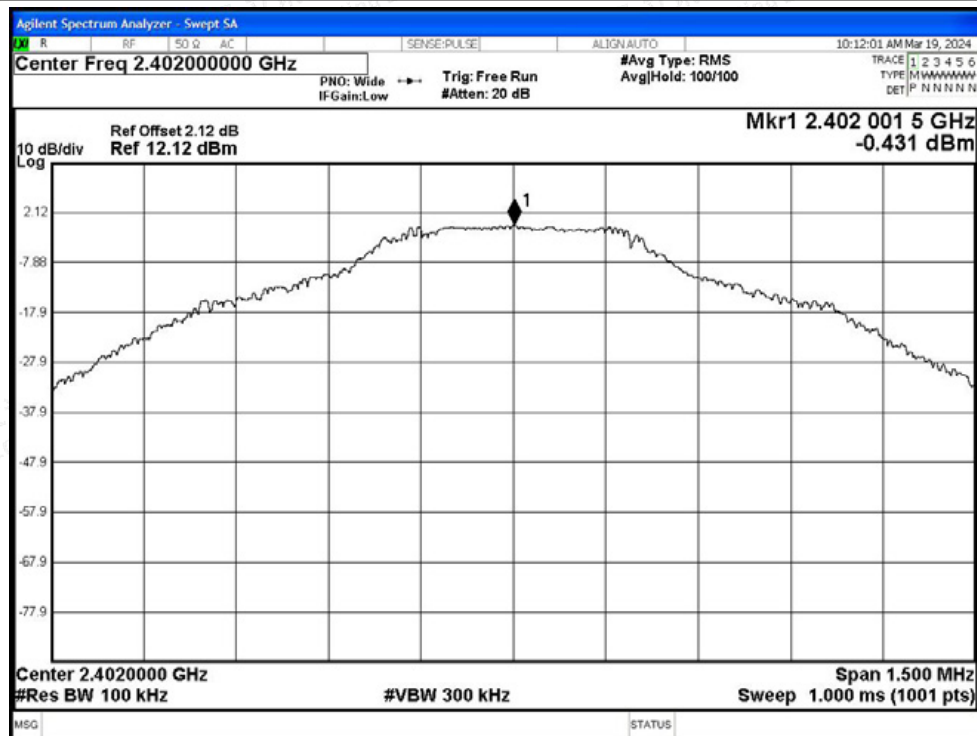

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Emission

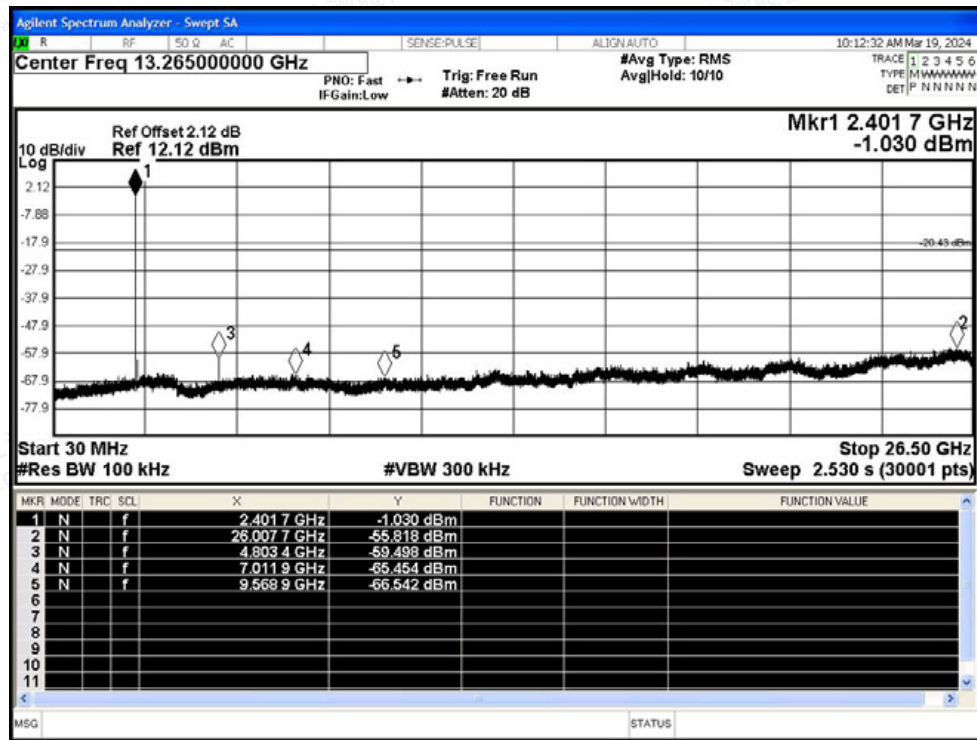

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Ref

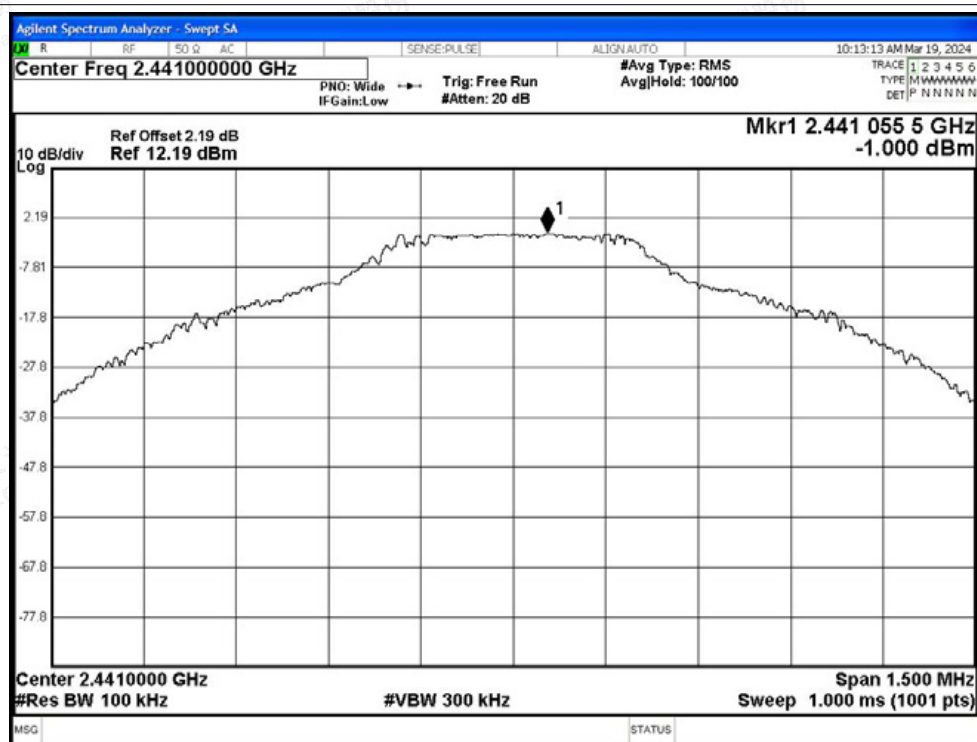

Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Emission

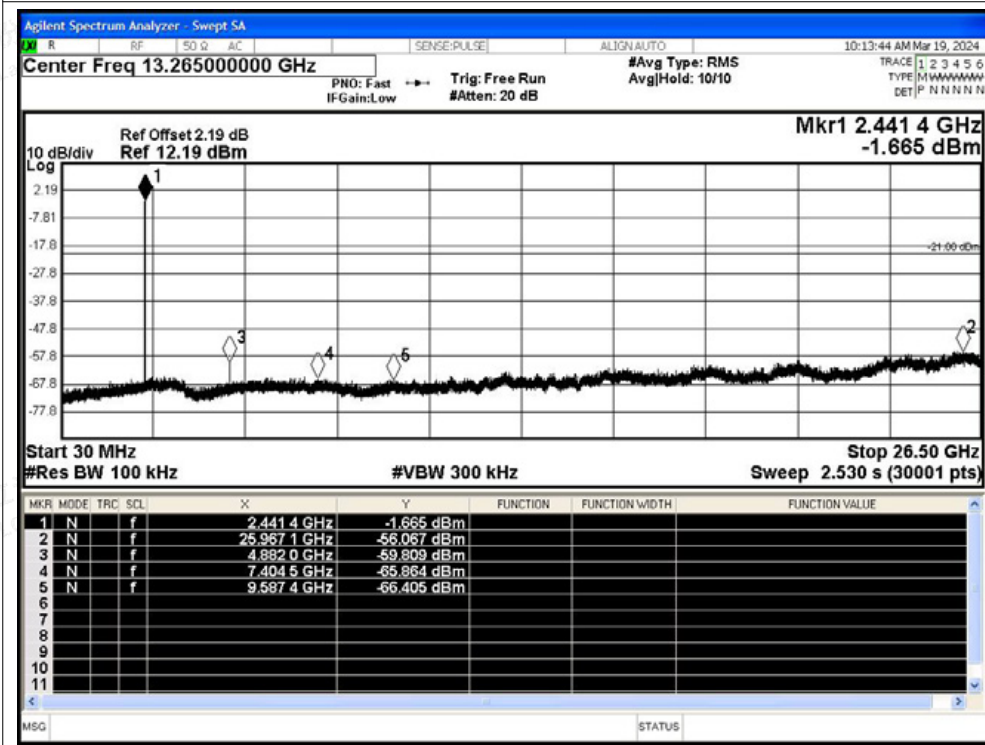

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Ref

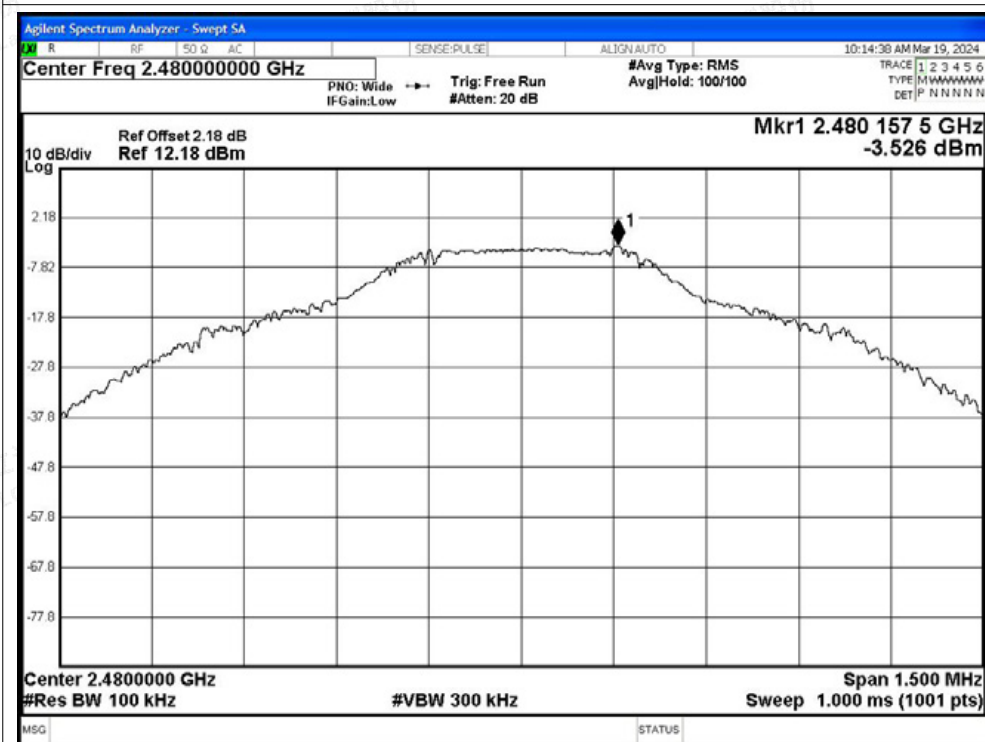

Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Emission

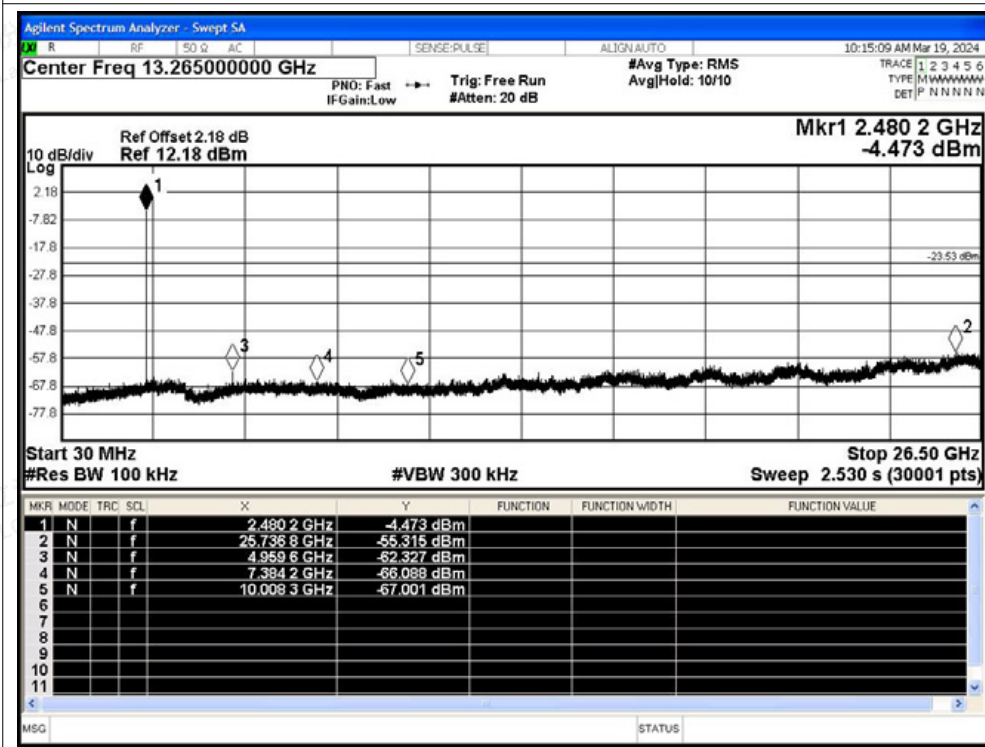

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Ref

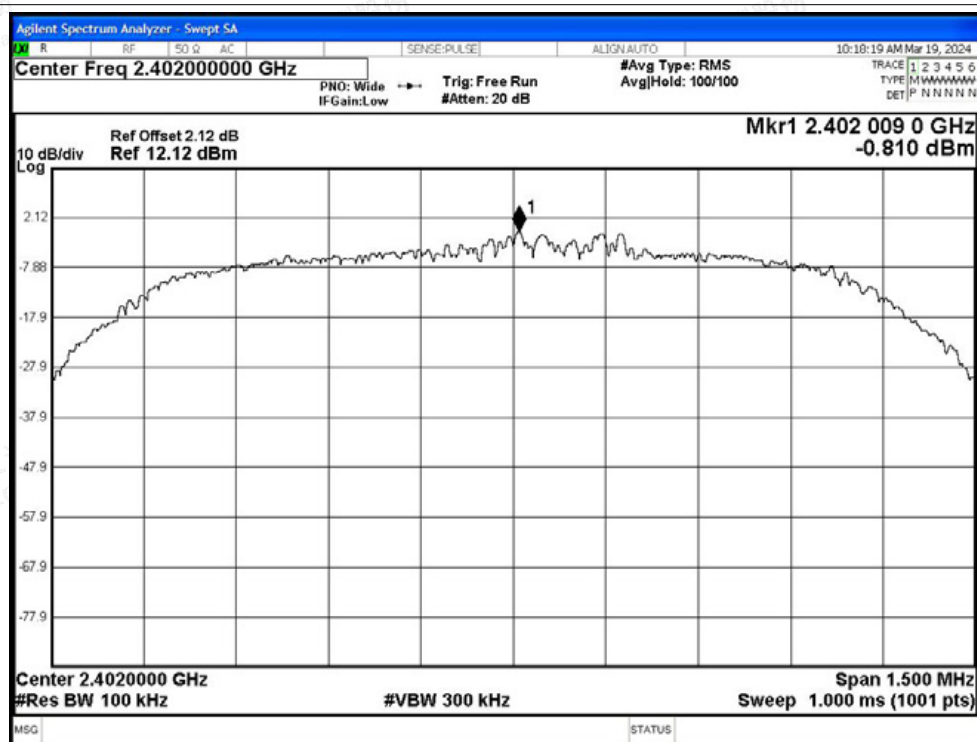

Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Emission

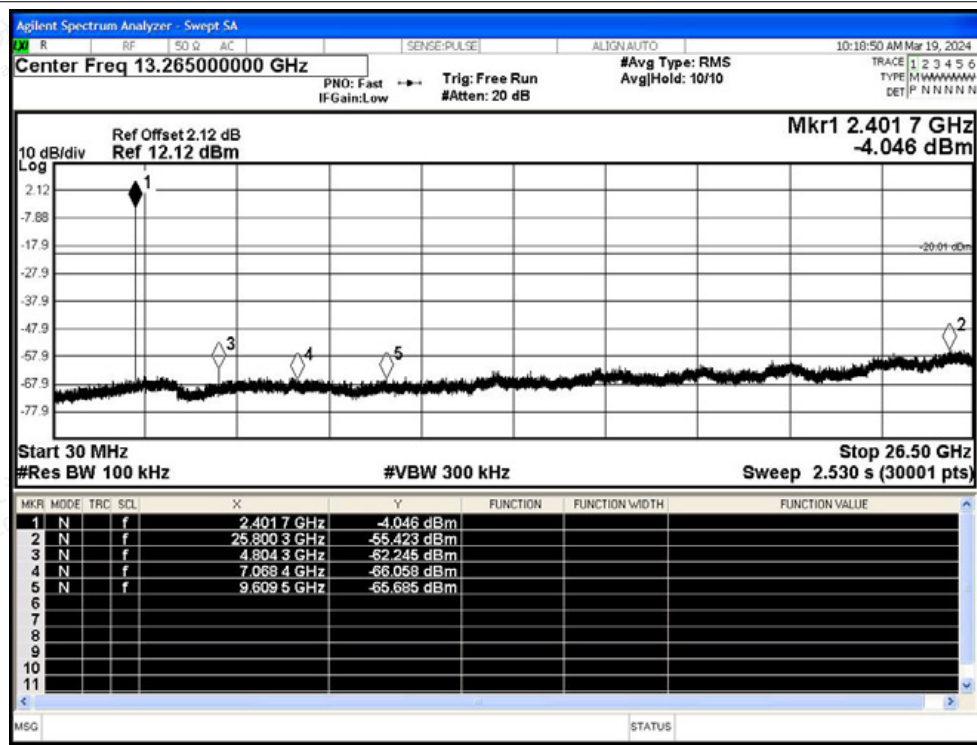

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Ref

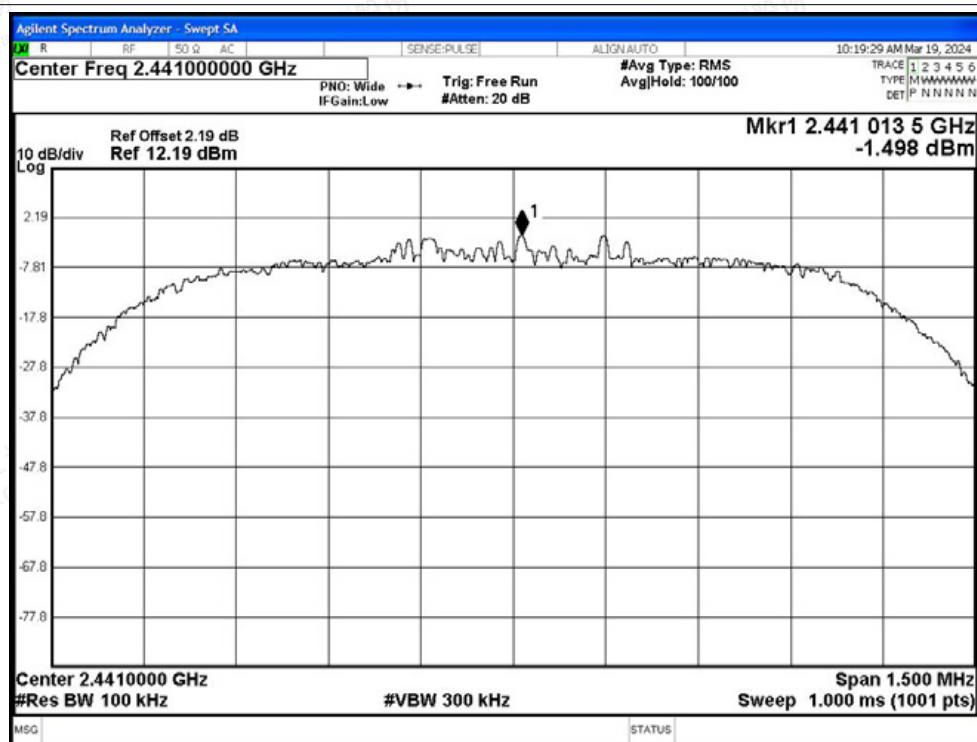

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Emission

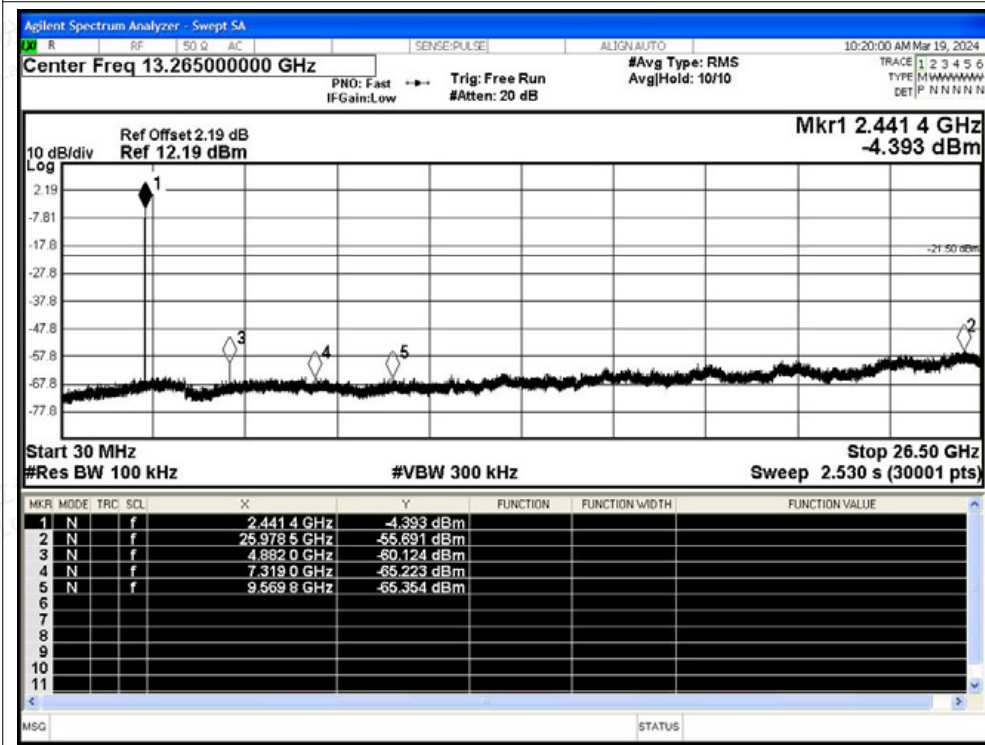

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref

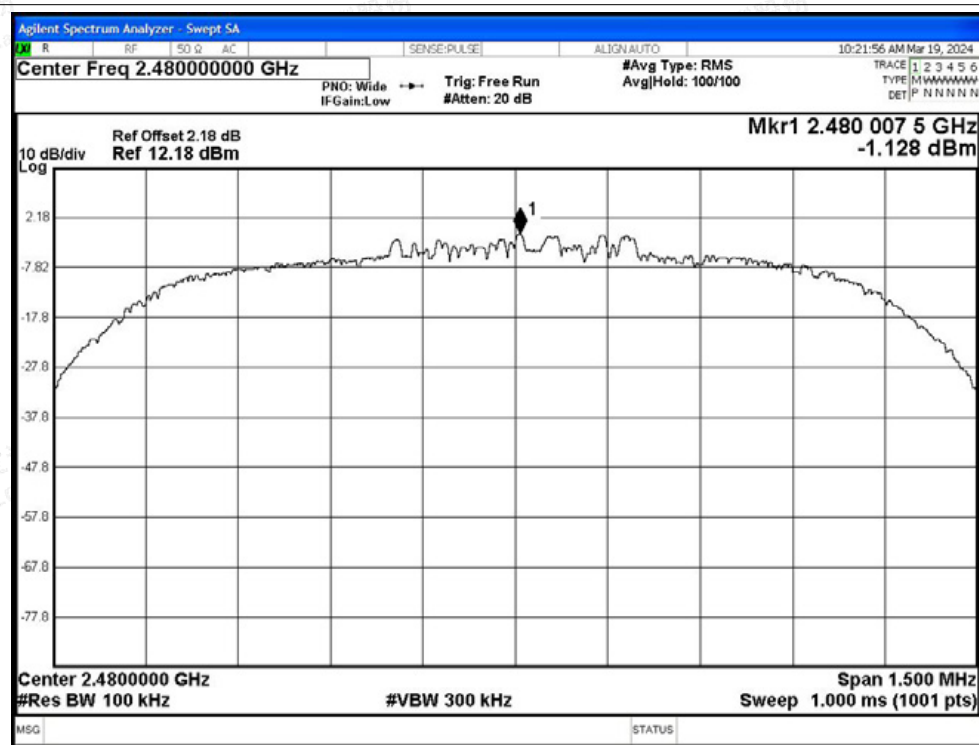

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission

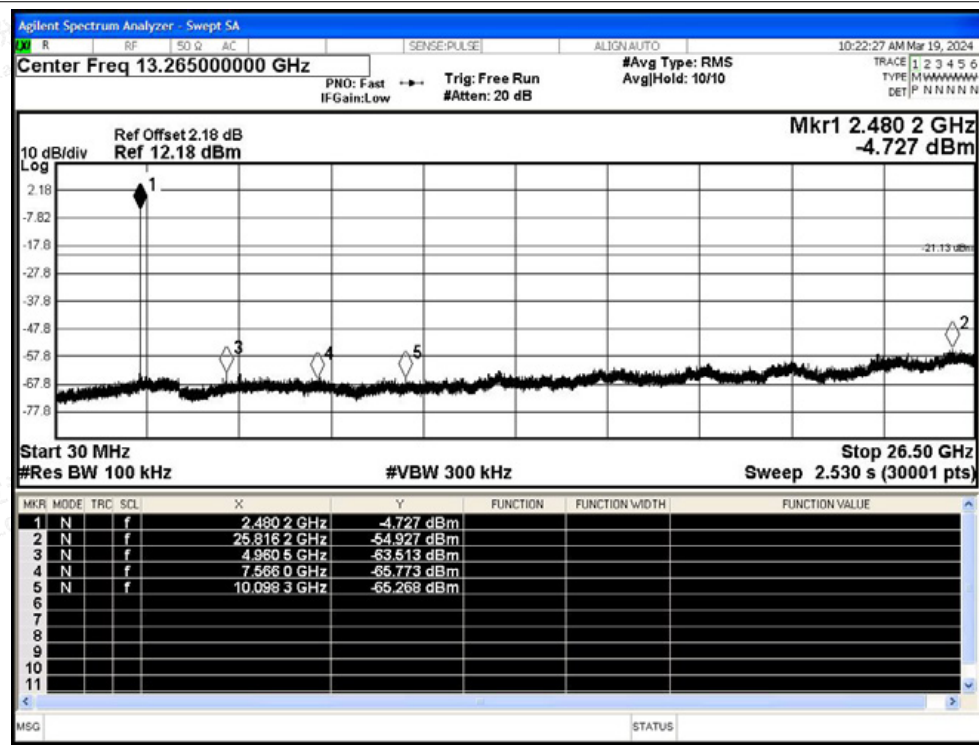

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref

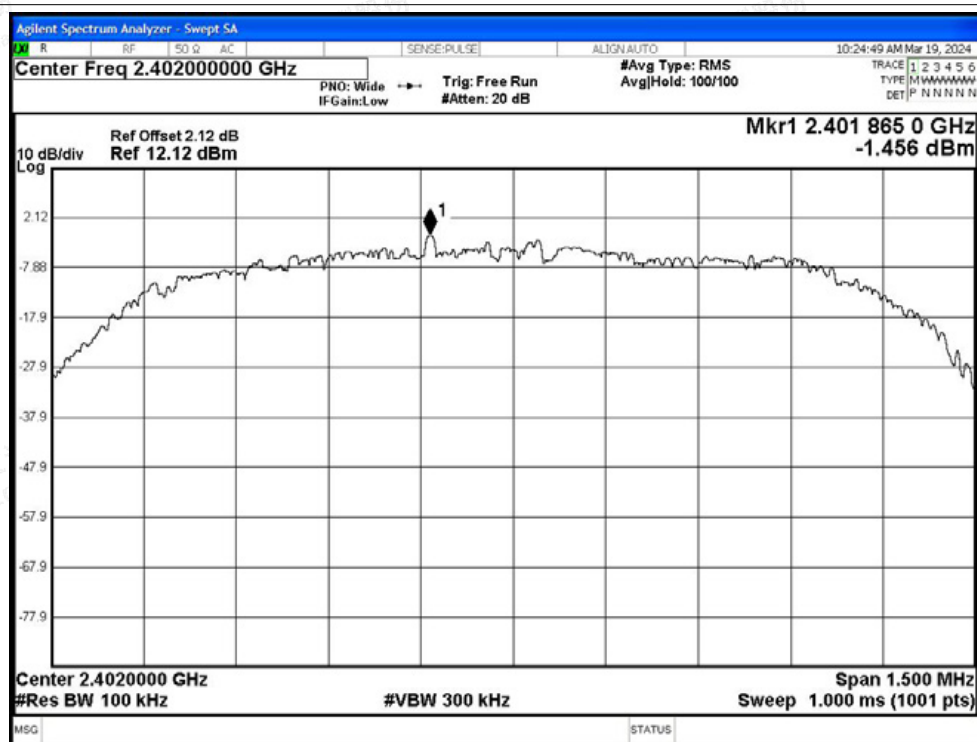

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission

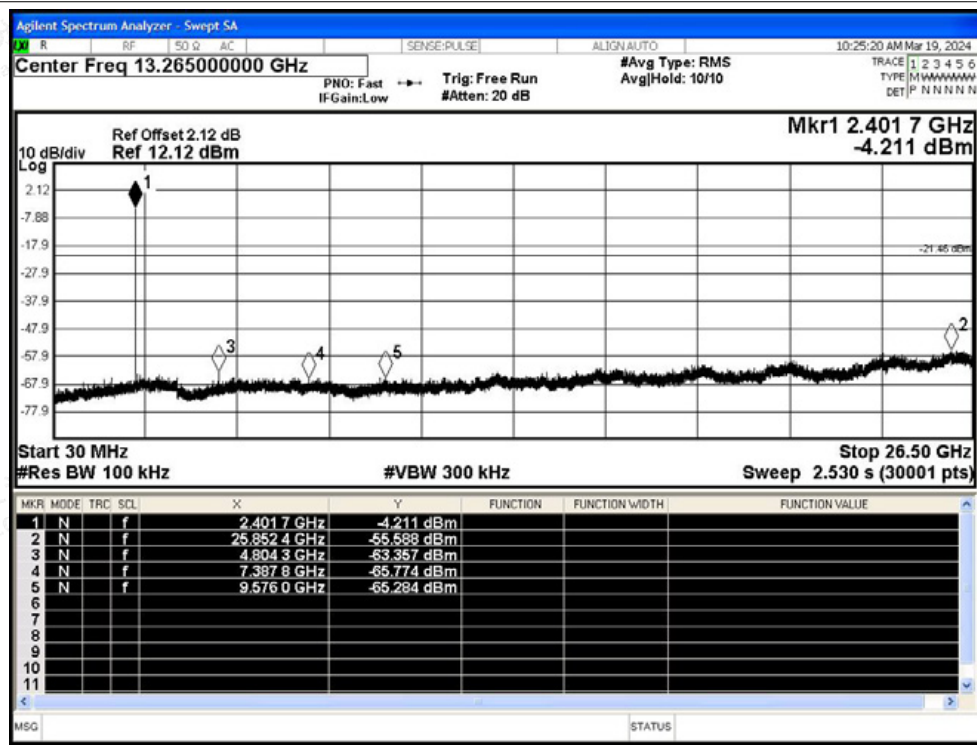

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref

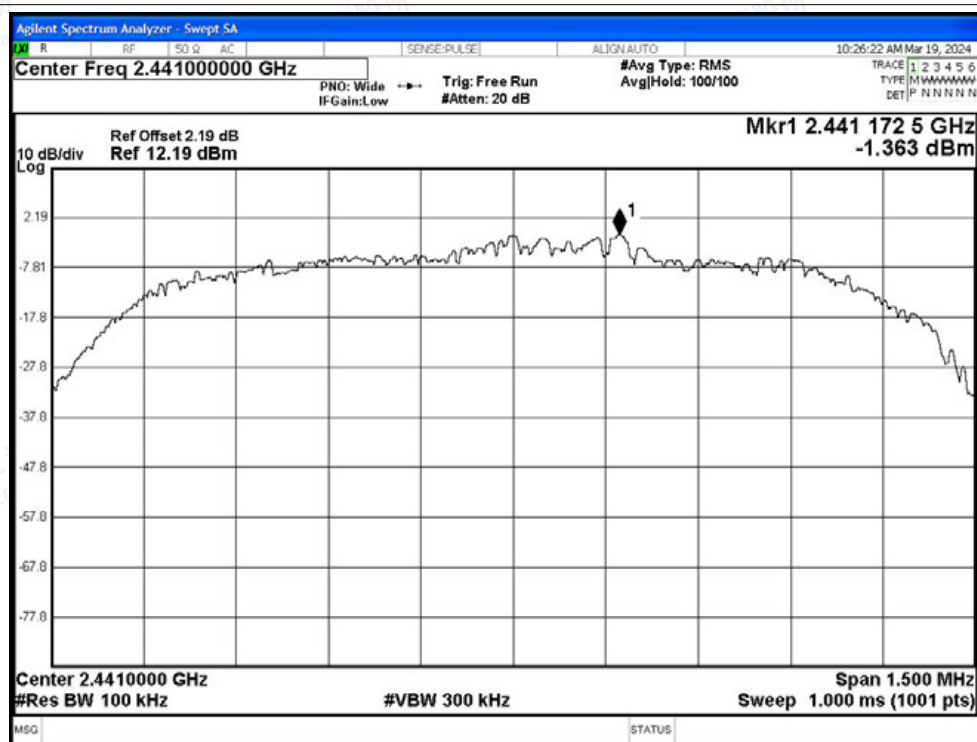

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission

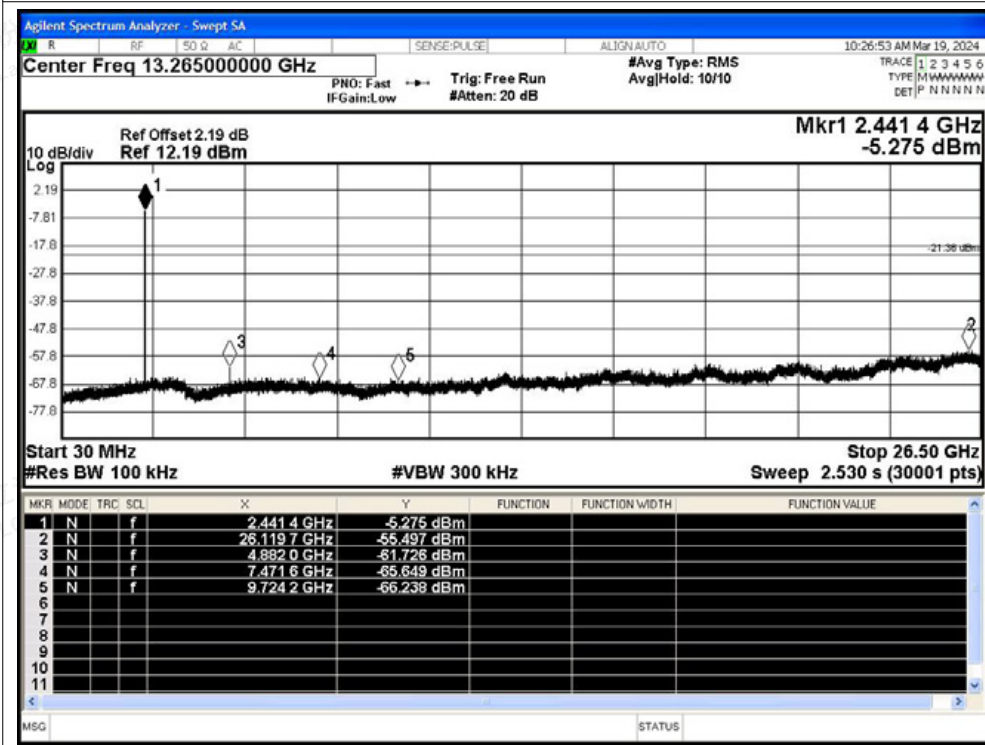

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref

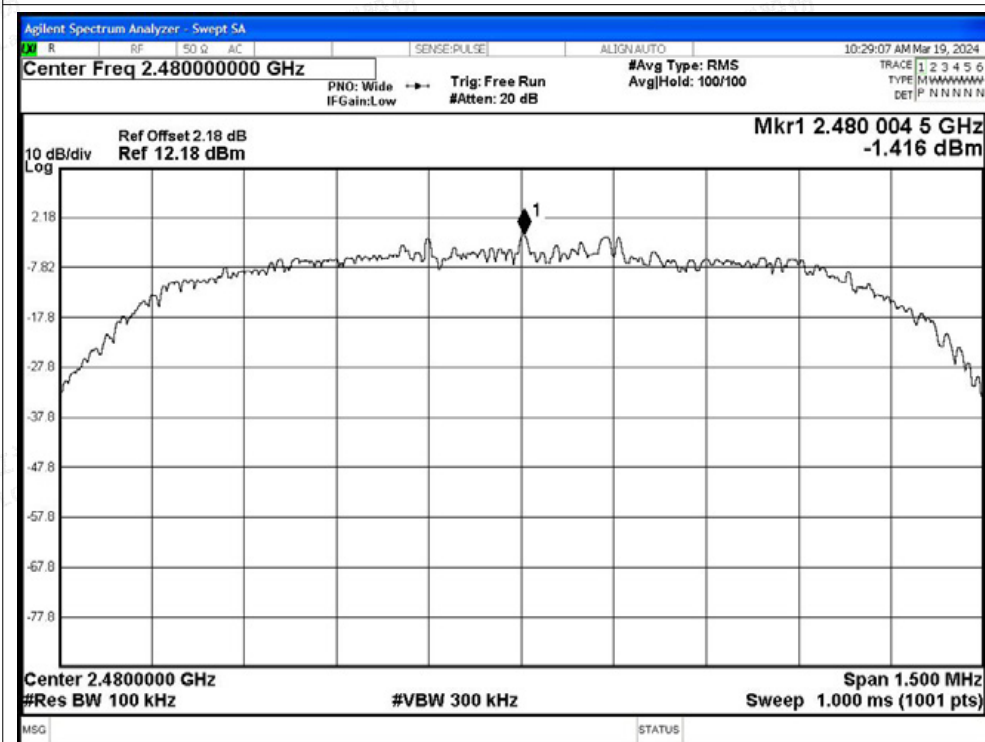

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission

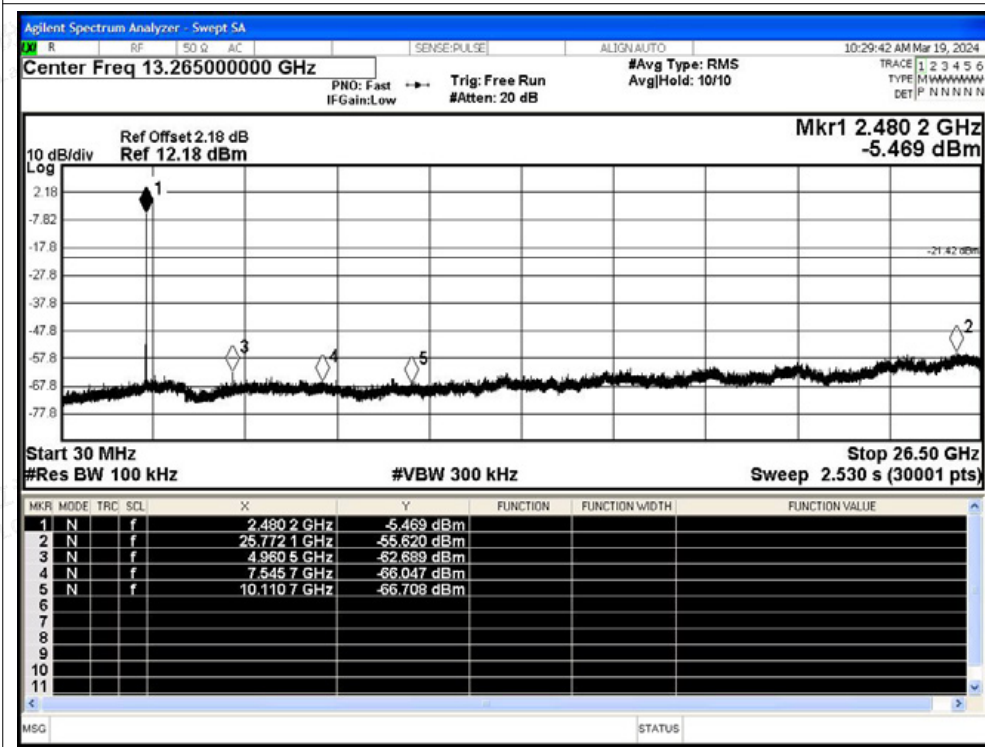

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.8 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	76.88	1.14	0.35
NVNT	1-DH5	2441	Ant1	76.85	1.14	0.35
NVNT	1-DH5	2480	Ant1	76.88	1.14	0.35
NVNT	2-DH5	2402	Ant1	76.99	1.14	0.35
NVNT	2-DH5	2441	Ant1	76.99	1.14	0.35
NVNT	2-DH5	2480	Ant1	76.96	1.14	0.35
NVNT	3-DH5	2402	Ant1	77.04	1.13	0.35
NVNT	3-DH5	2441	Ant1	77.01	1.13	0.35
NVNT	3-DH5	2480	Ant1	77.01	1.13	0.35






Test Graphs

Duty Cycle NVNT 1-DH5 2402MHz Ant1

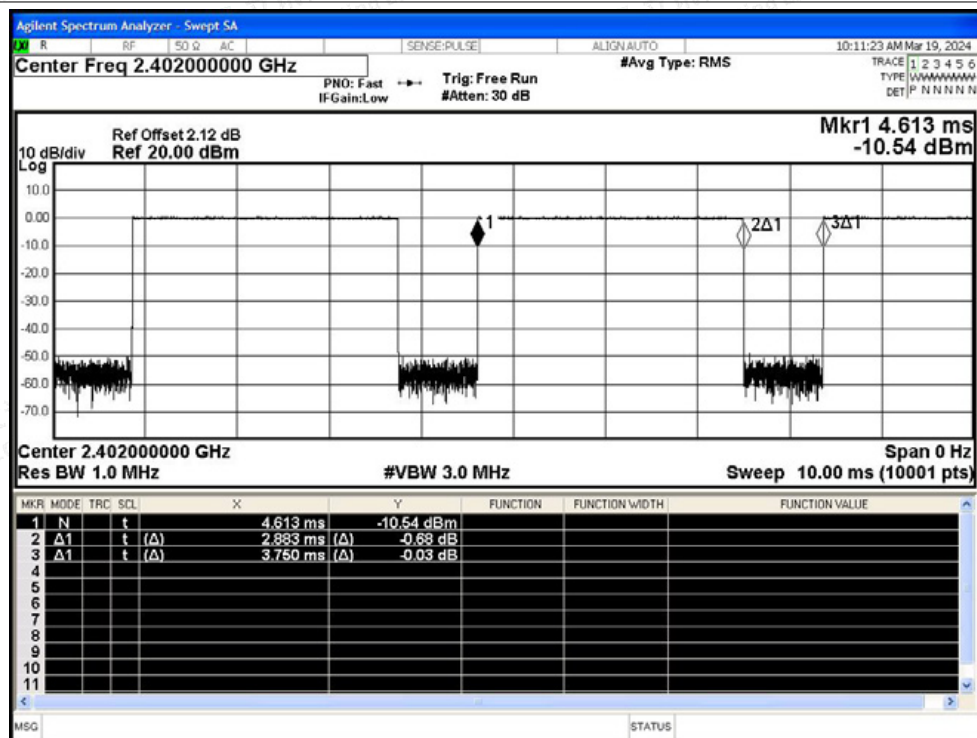

Duty Cycle NVNT 1-DH5 2441MHz Ant1

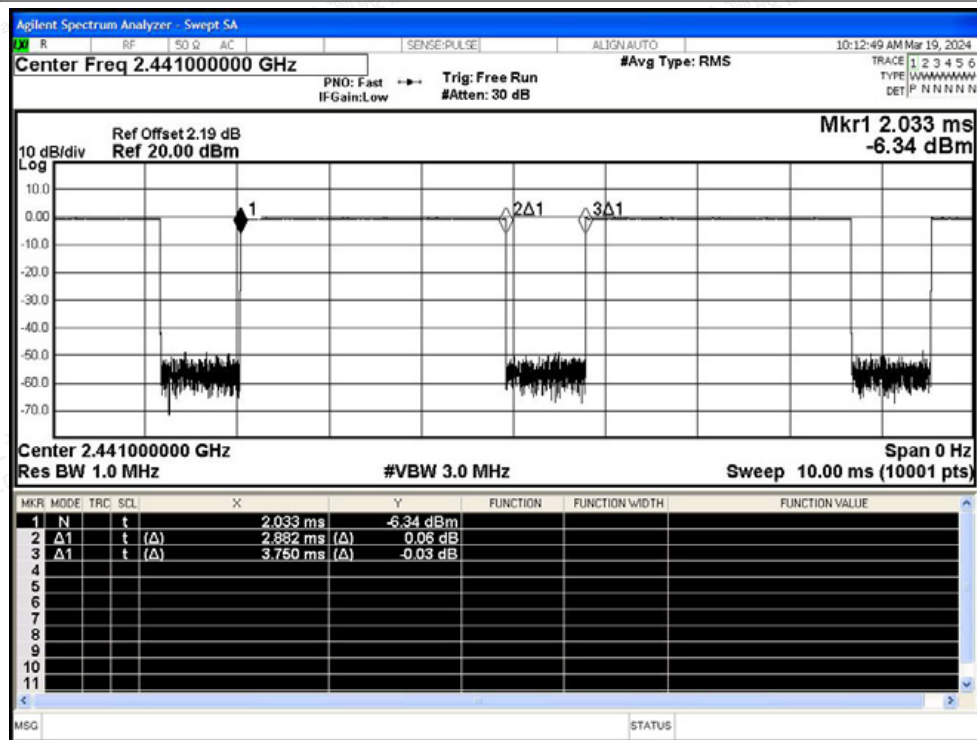

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 1-DH5 2480MHz Ant1

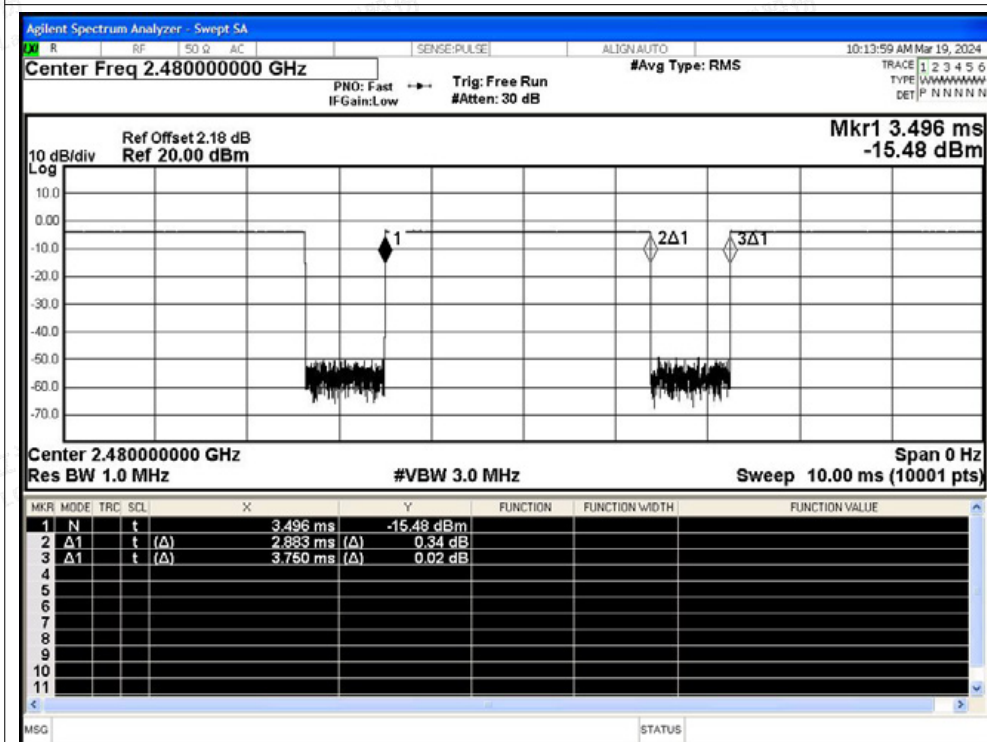

Duty Cycle NVNT 2-DH5 2402MHz Ant1

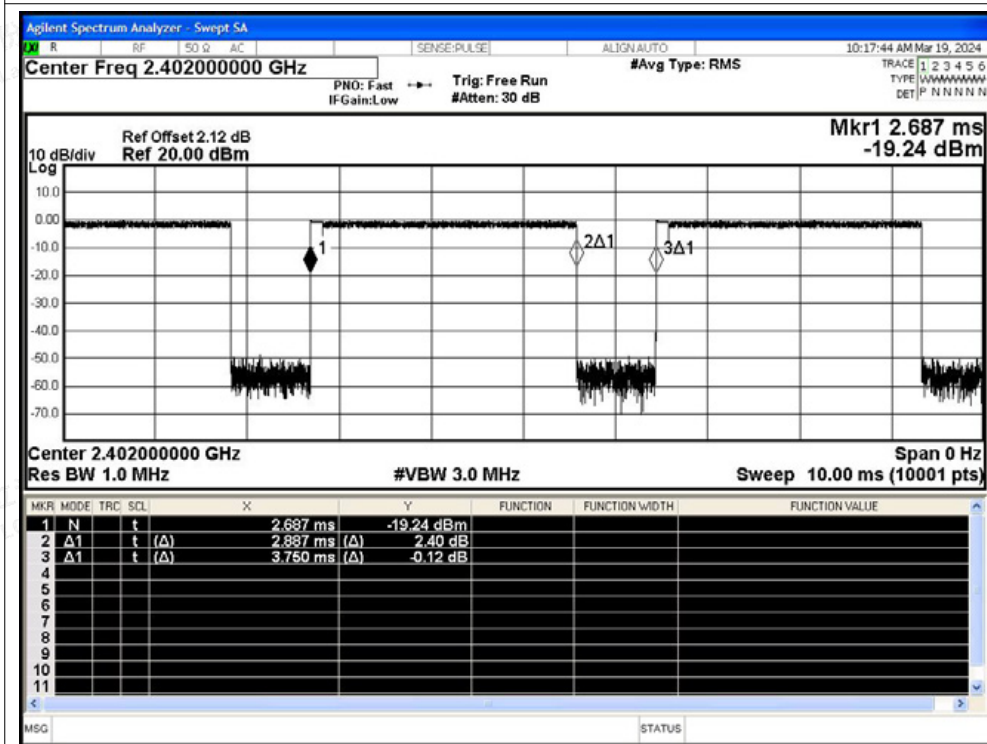

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 2-DH5 2441MHz Ant1

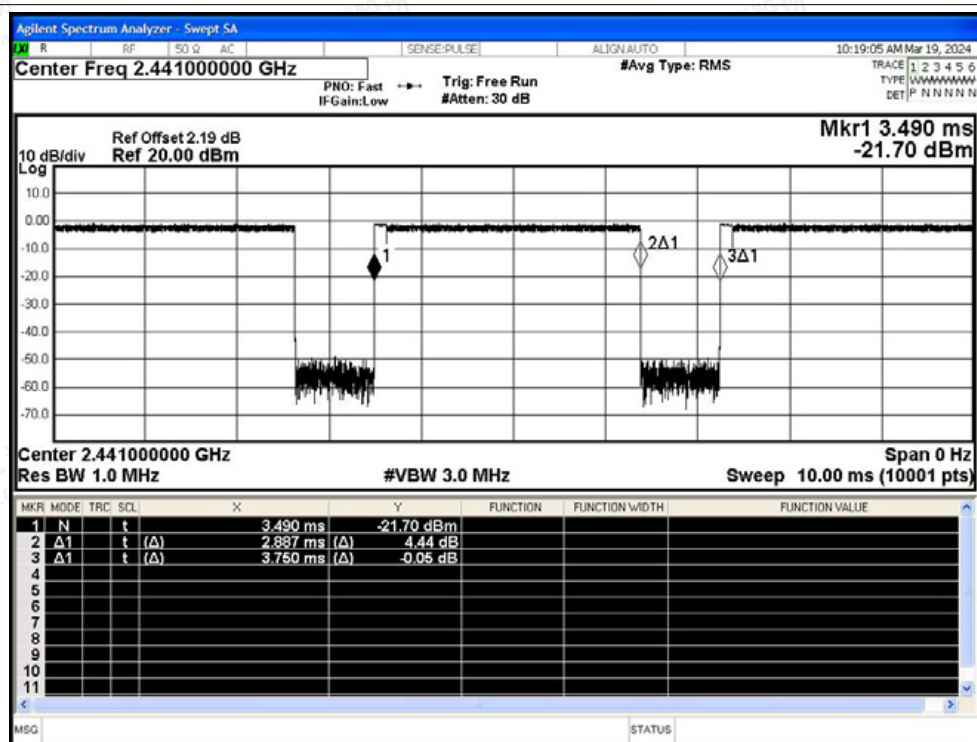

Duty Cycle NVNT 2-DH5 2480MHz Ant1

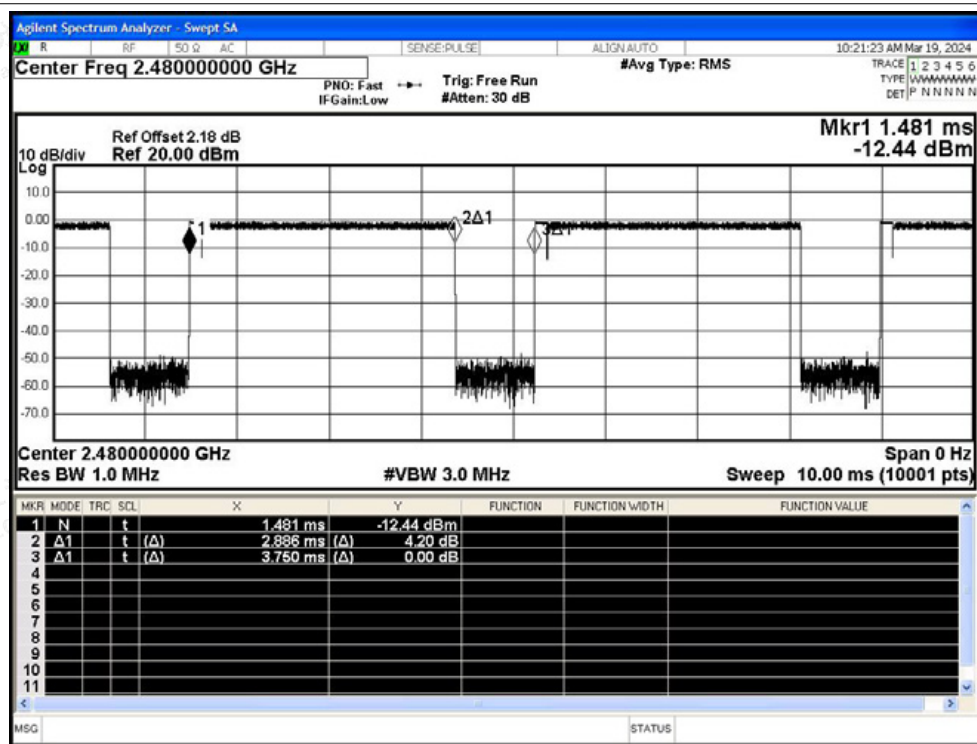

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2402MHz Ant1

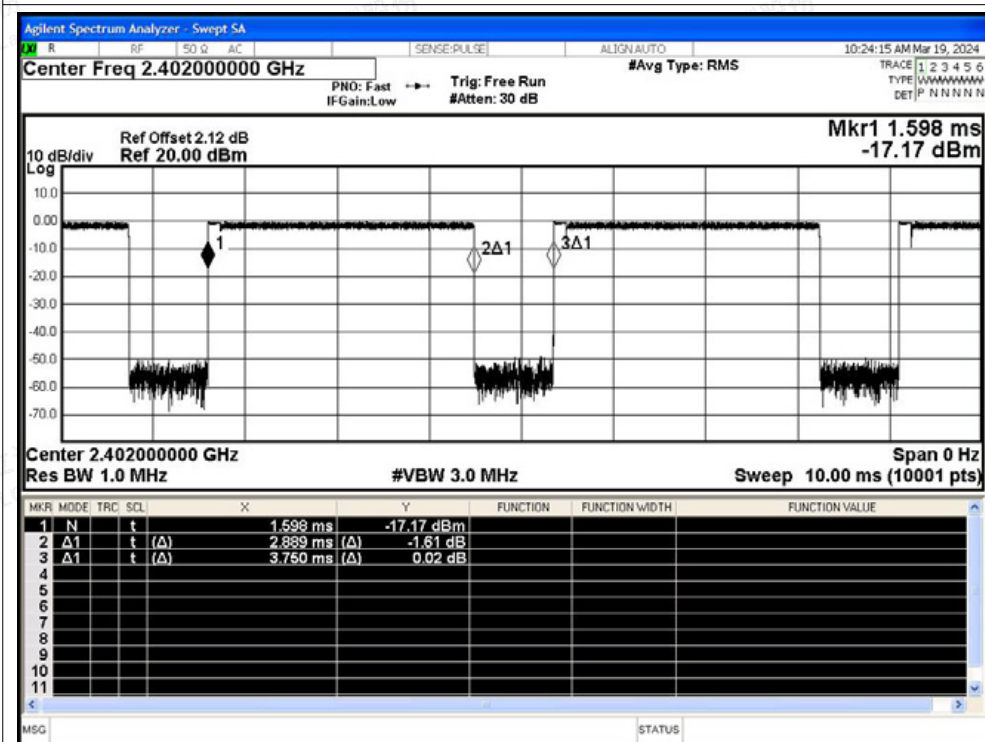

Duty Cycle NVNT 3-DH5 2441MHz Ant1

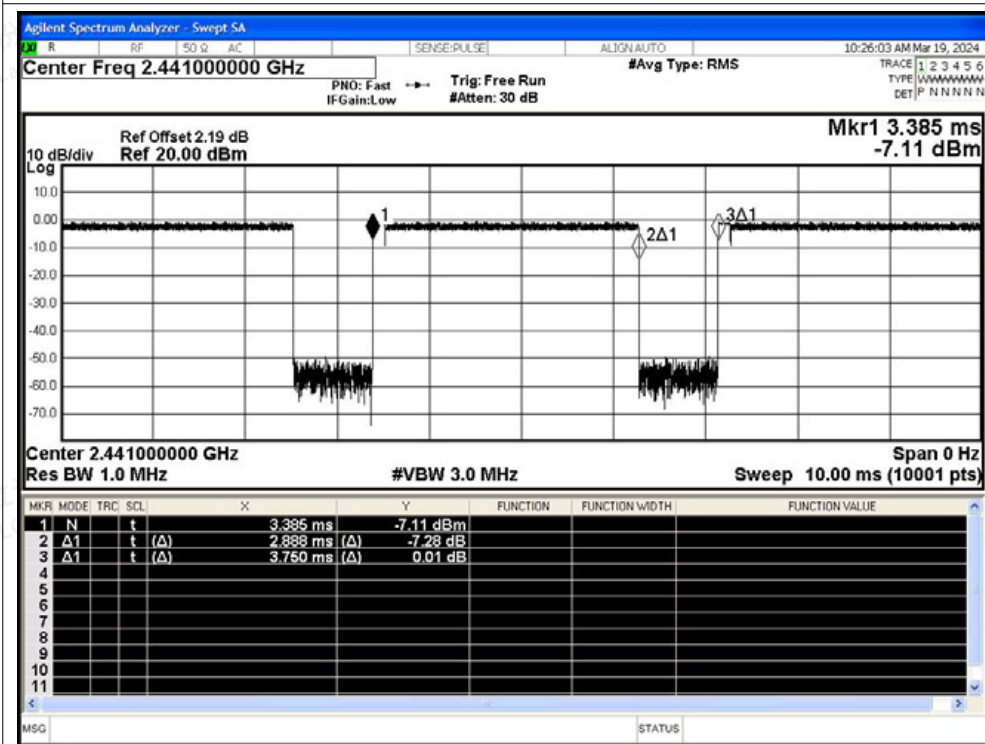


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

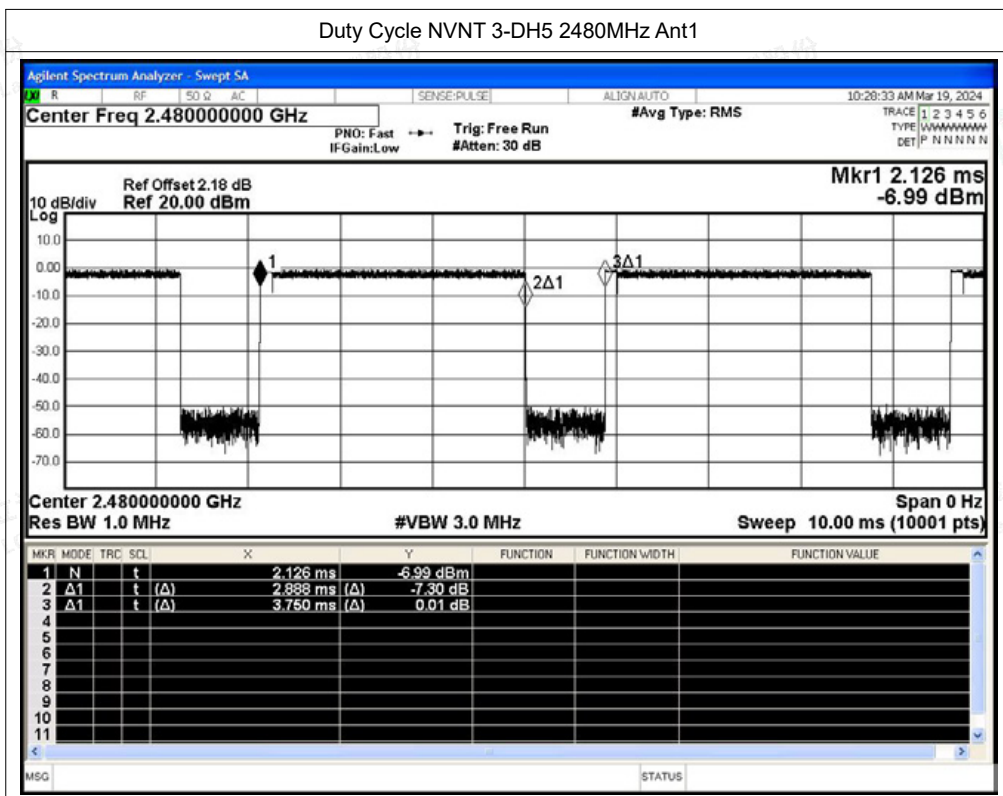



A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-50.92	2.35	-	46.69	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-58.46	2.35	1.14	40.29	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2341.488	-47.61	2.35	-	50	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2385.36	-57.68	2.35	1.14	41.07	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-49.42	2.35	-	48.19	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.57	2.35	1.14	40.18	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-50.85	2.35	-	46.76	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-58.32	2.35	1.14	40.43	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2490.448	-47.17	2.35	-	50.44	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2490.568	-57.24	2.35	1.14	41.51	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-50.99	2.35	-	46.62	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-57.68	2.35	1.14	41.07	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-50.31	2.35	-	47.3	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-58.79	2.35	1.14	39.96	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2351.664	-47.73	2.35	-	49.88	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2373.36	-57.82	2.35	1.14	40.93	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-51.14	2.35	-	46.47	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.35	2.35	1.14	40.4	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-48.91	2.35	-	48.7	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-57.21	2.35	1.14	41.54	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2489.728	-47.25	2.35	-	50.36	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2492.848	-57.01	2.35	1.14	41.74	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-49.06	2.35	-	48.55	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-57.86	2.35	1.14	40.89	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-50.14	2.35	-	47.47	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-58.39	2.35	1.13	40.35	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2372.688	-46.57	2.35	-	51.04	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2387.088	-57.69	2.35	1.13	41.05	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-48.65	2.35	-	48.96	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.47	2.35	1.13	40.27	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-48.95	2.35	-	48.66	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-57.55	2.35	1.13	41.19	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2485.48	-46.84	2.35	-	50.77	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2488.84	-56.91	2.35	1.13	41.83	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-49.96	2.35	-	47.65	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-57.85	2.35	1.13	40.89	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

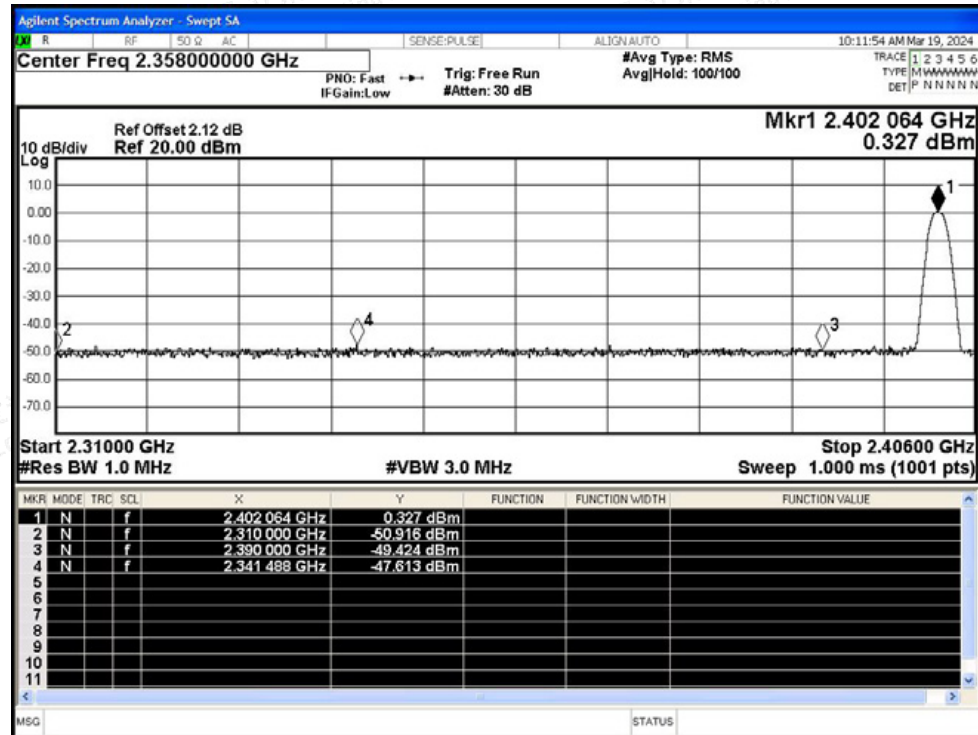

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average

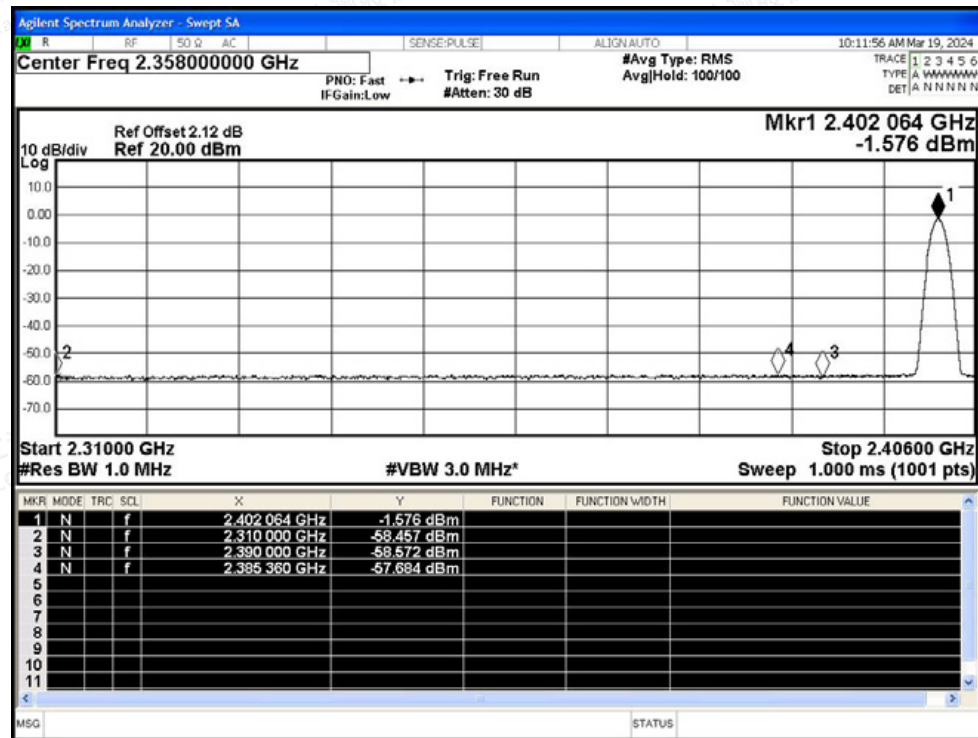

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

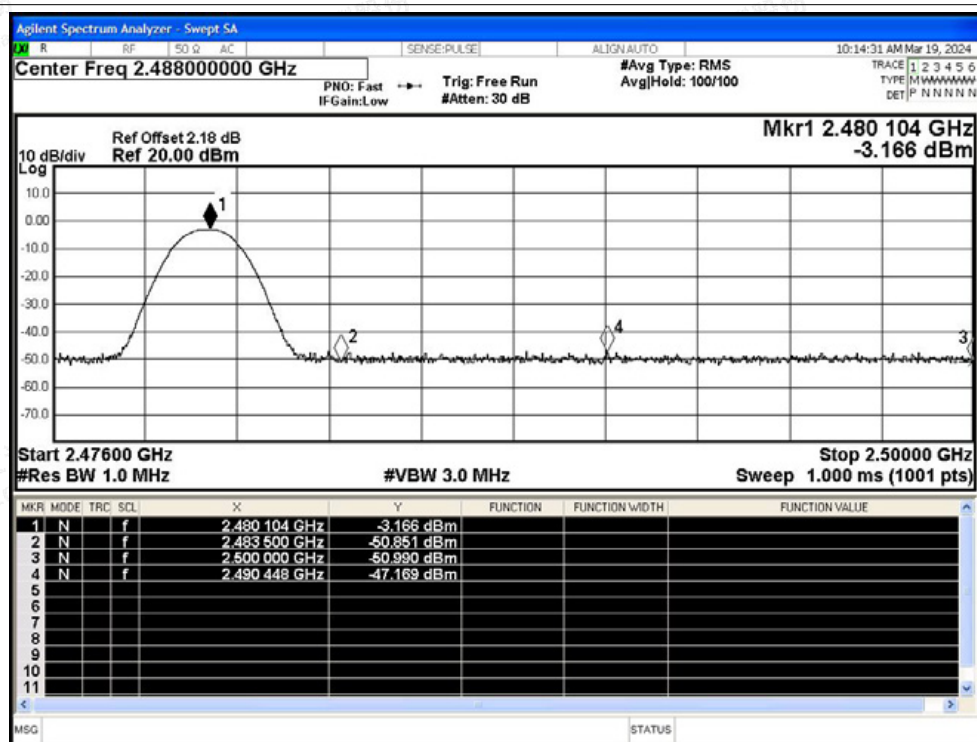

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average

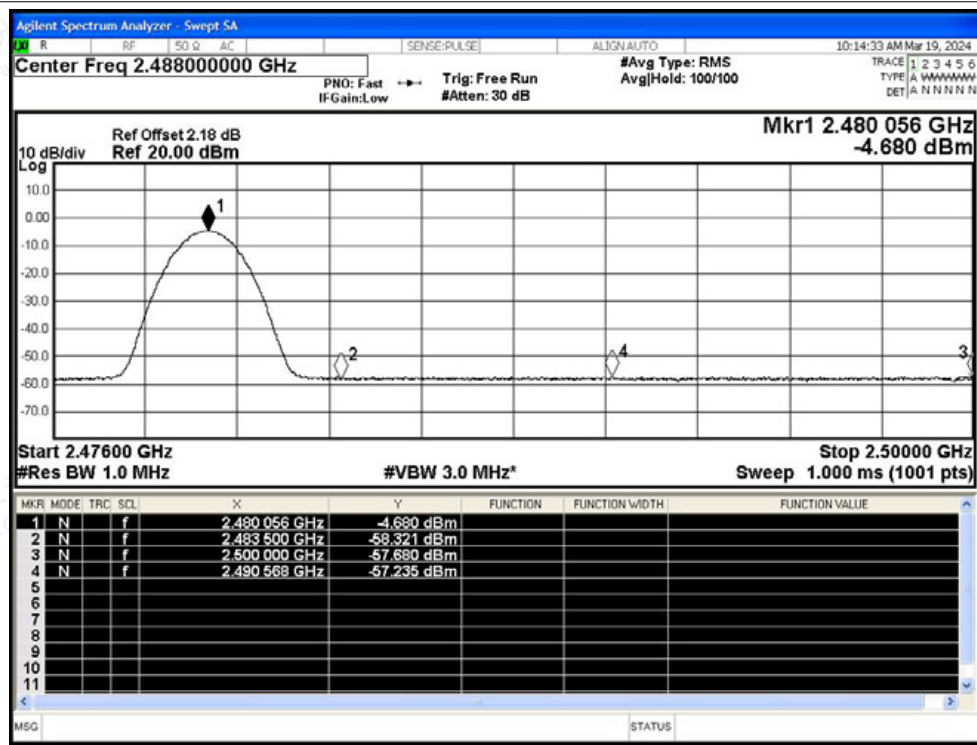

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Peak

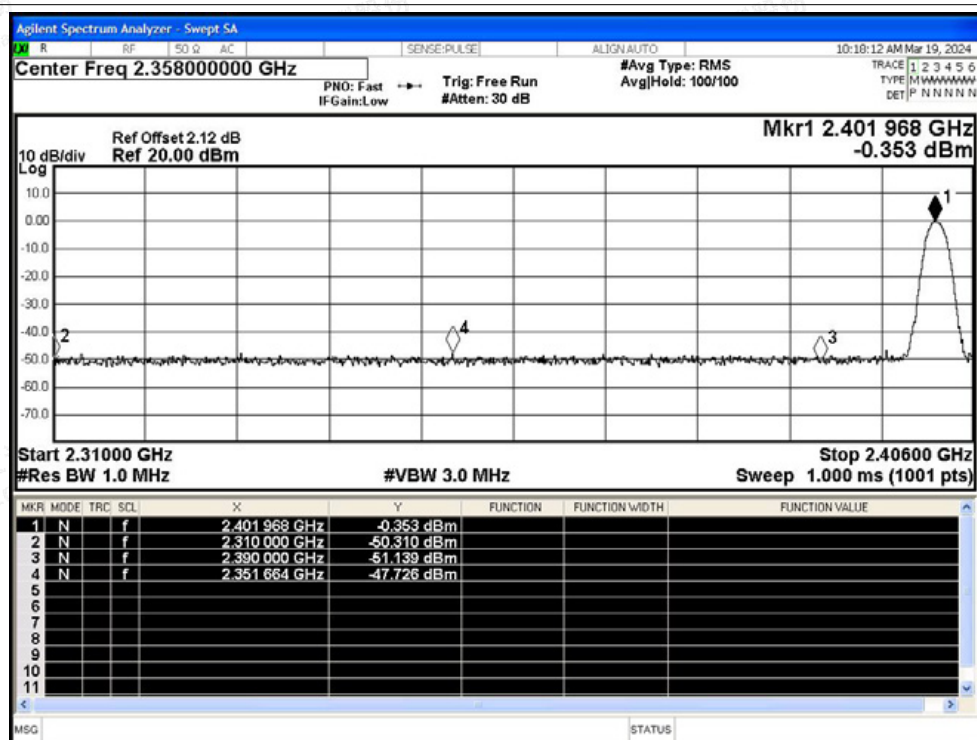

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Average

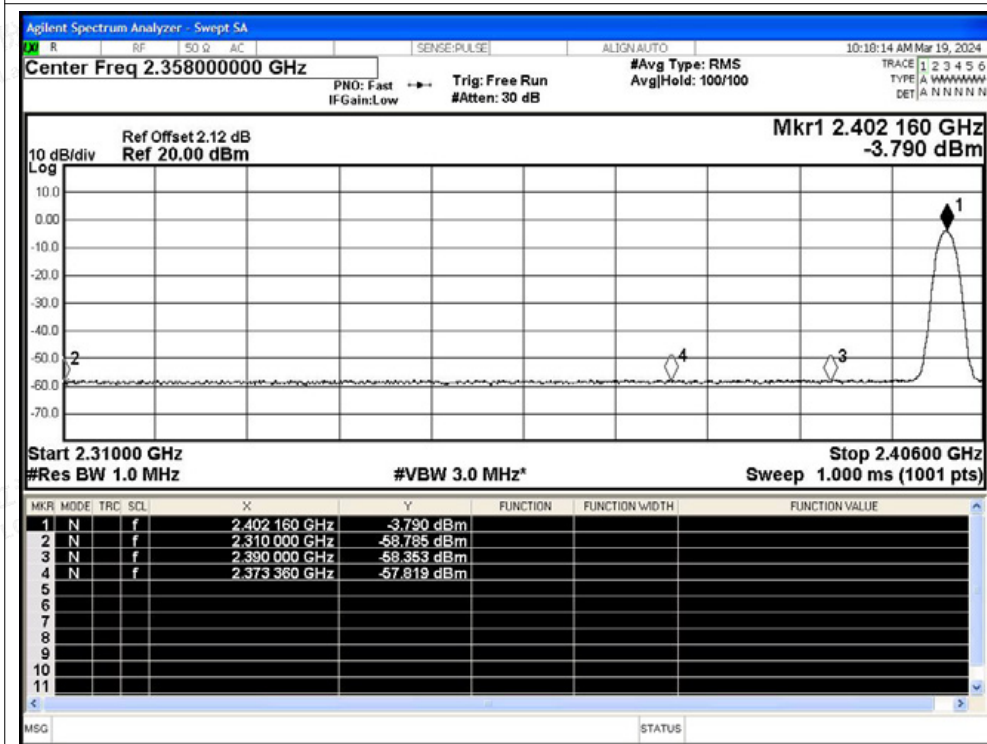

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak

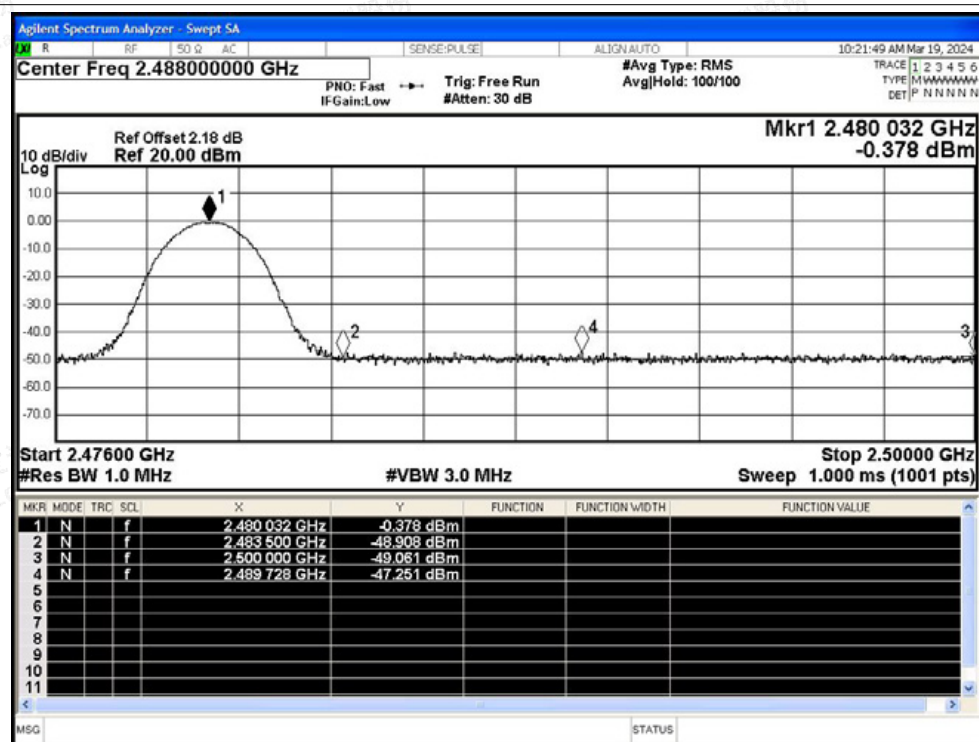

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average

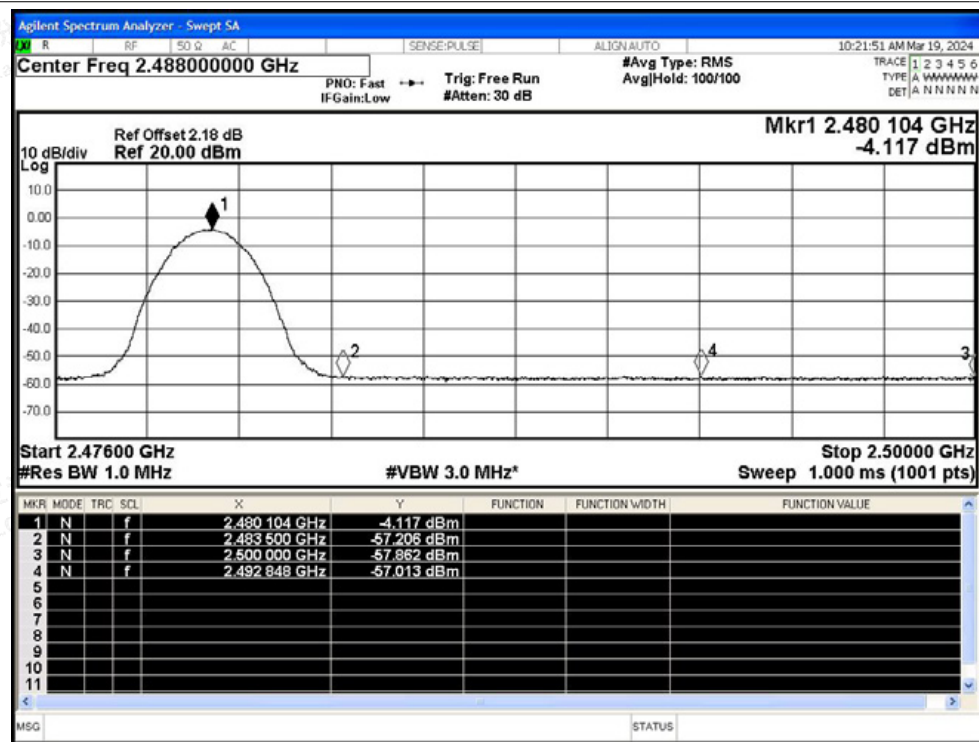

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak

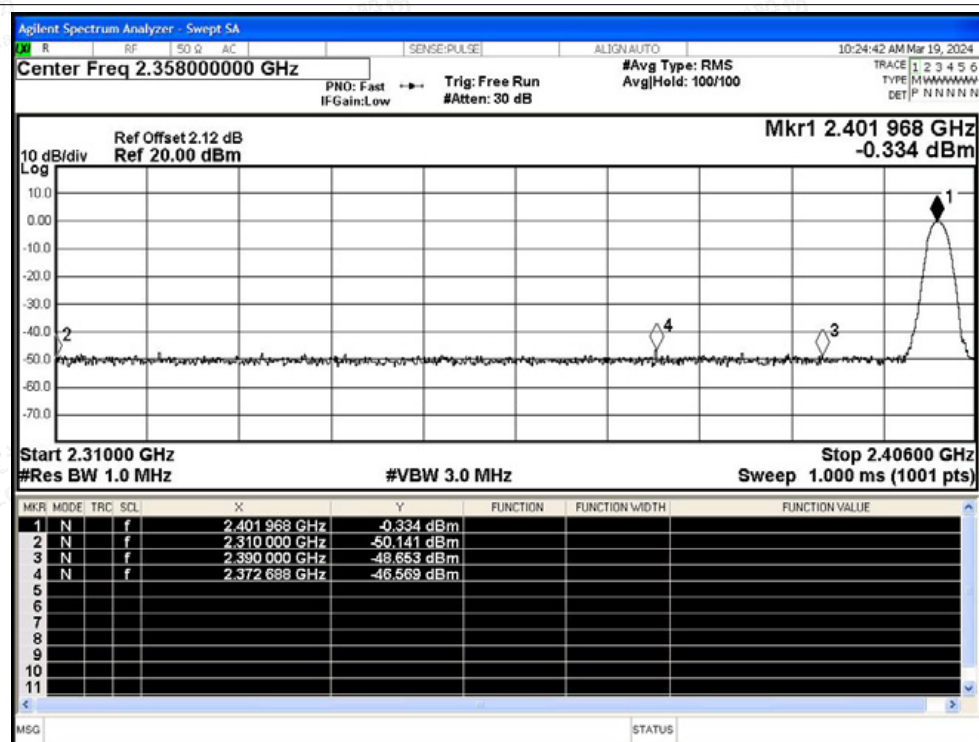

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average

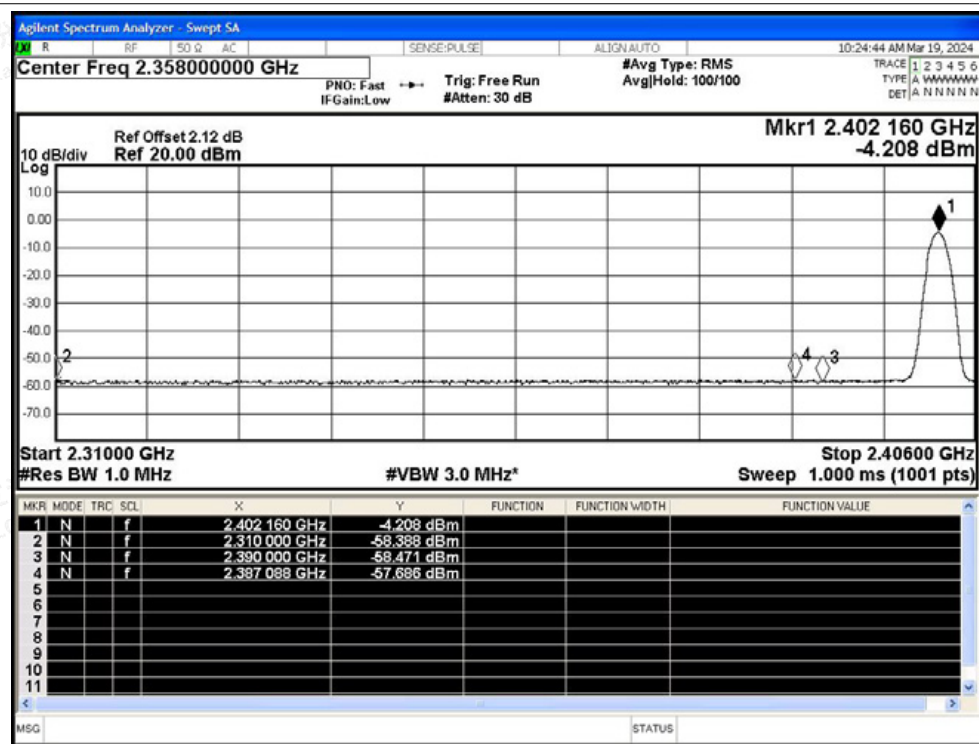

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak

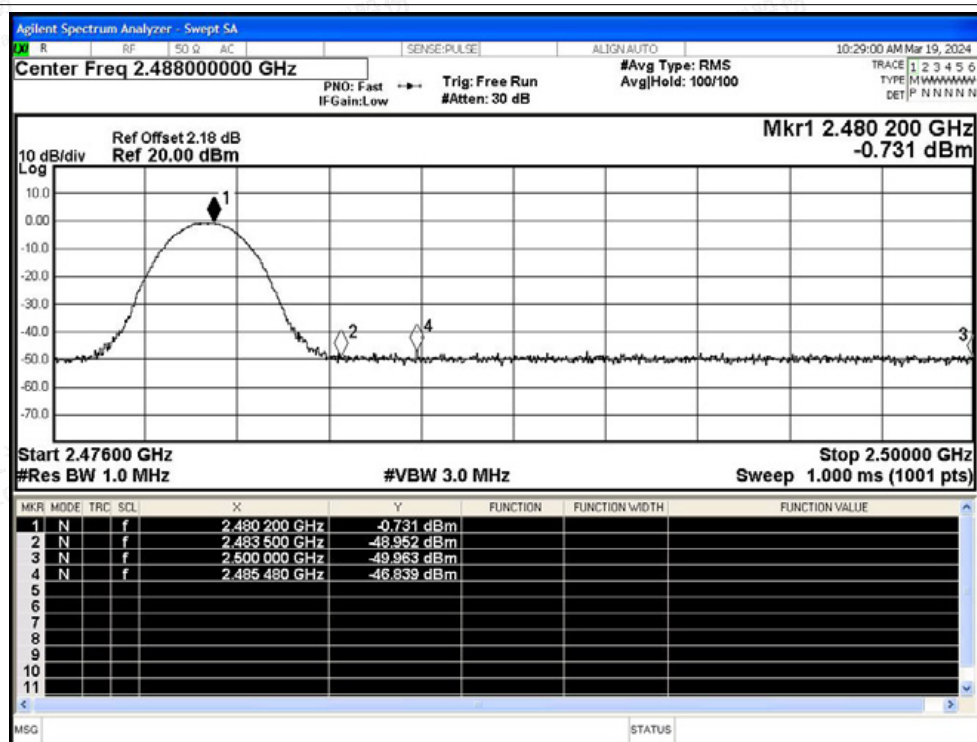

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average

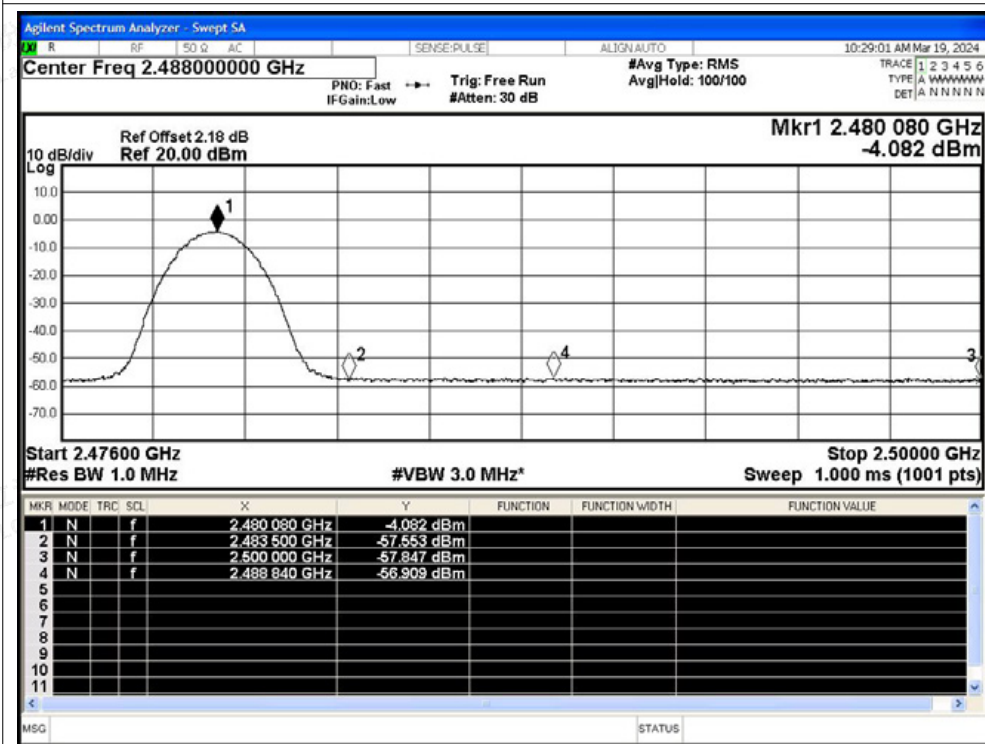

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity