



Band 2 CSE 1.4MHz-L-QPSK-1RB0-30MHz-10GHz

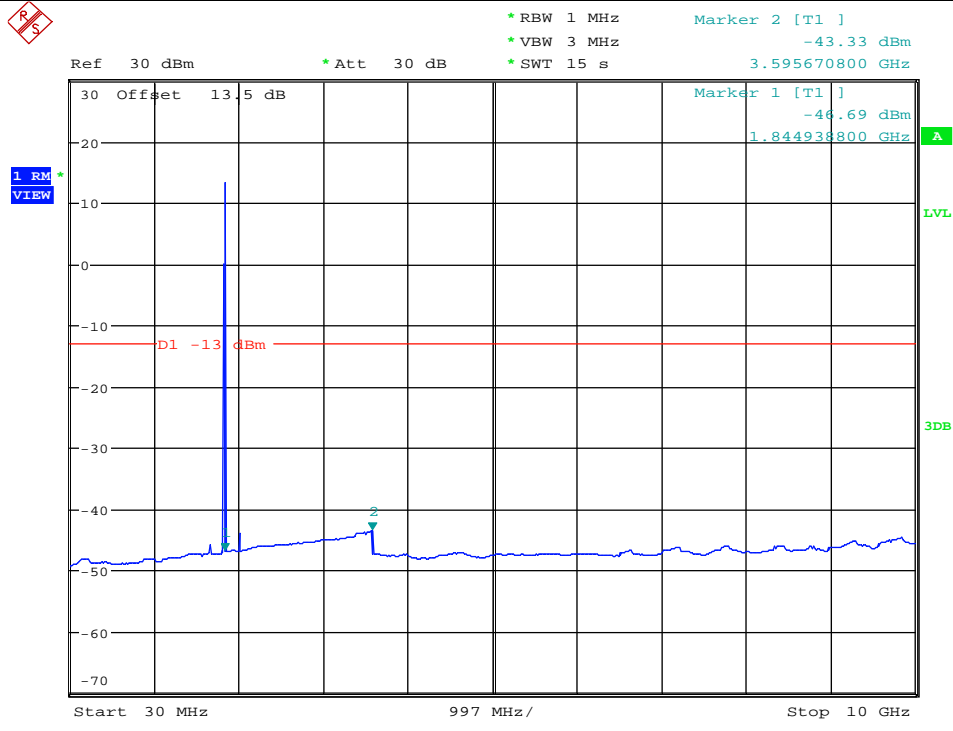


Date: 16.NOV.2022 14:17:34

Band 2 CSE 1.4MHz-L-QPSK-1RB0-10GHz-20GHz

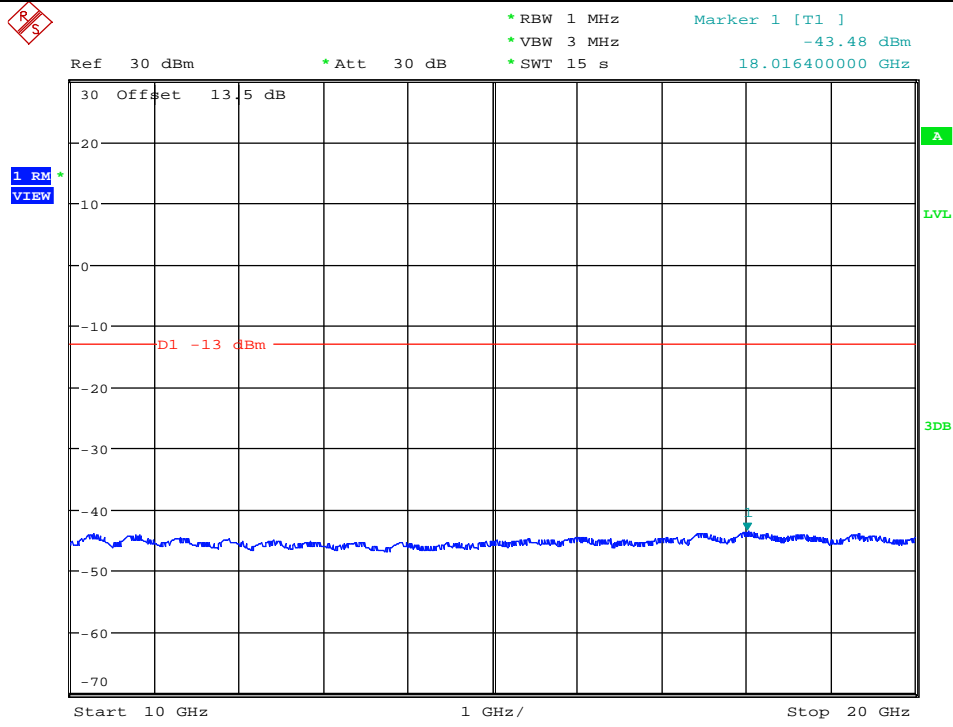


Date: 16.NOV.2022 14:18:03

Band 2 CSE 1.4MHz-L-16QAM-1RB0-30MHz-10GHz

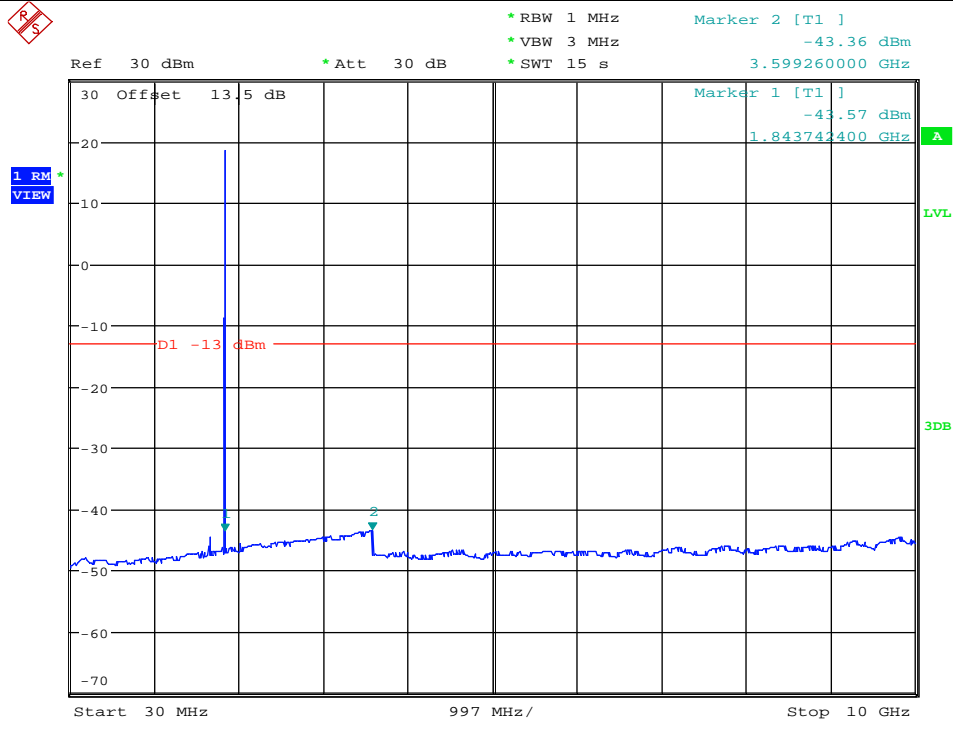


Date: 16.NOV.2022 14:44:17

Band 2 CSE 1.4MHz-L-16QAM-1RB0-10GHz-20GHz

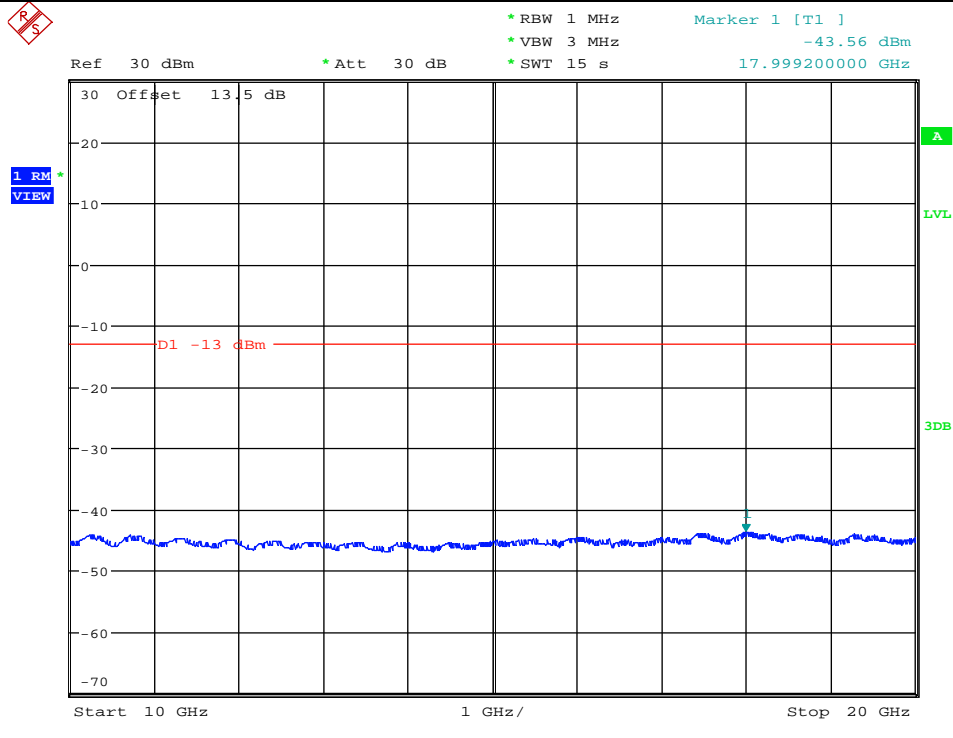


Date: 16.NOV.2022 14:44:45

Band 2 CSE 1.4MHz-M-QPSK-1RB0-30MHz-10GHz

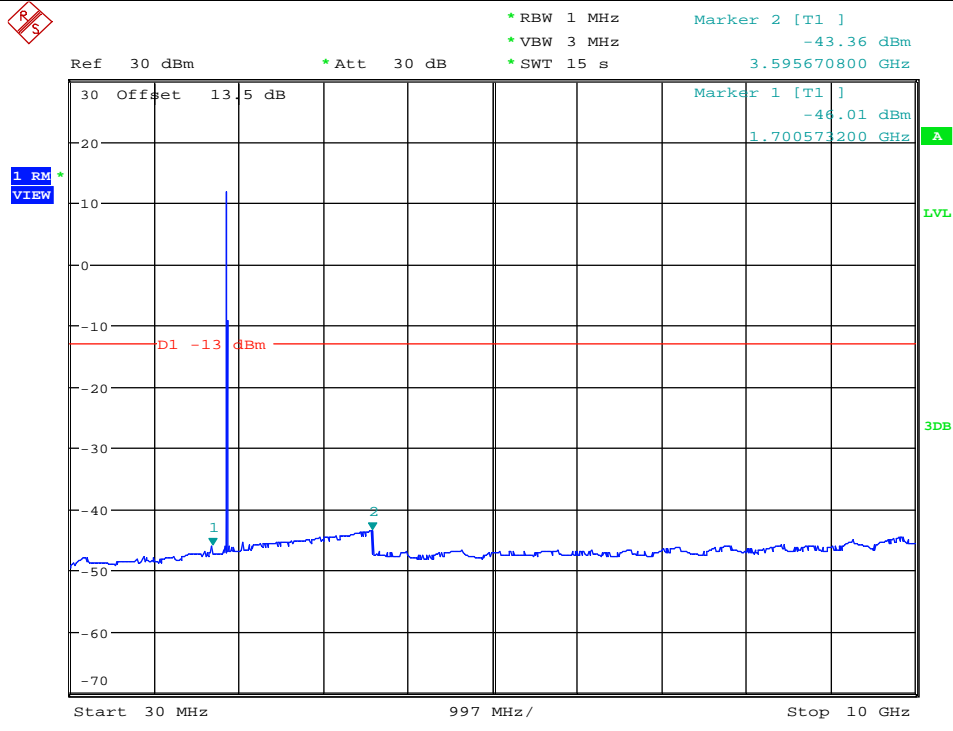


Date: 16.NOV.2022 14:23:25

Band 2 CSE 1.4MHz-M-QPSK-1RB0-10GHz-20GHz

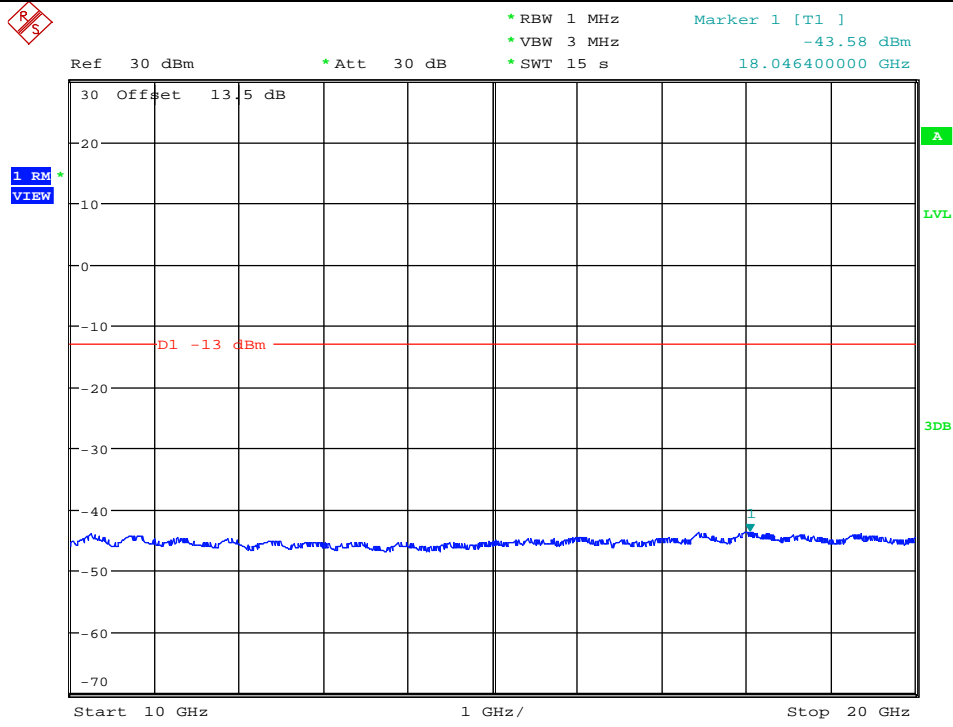


Date: 16.NOV.2022 14:23:54

Band 2 CSE 1.4MHz-M-16QAM-1RB0-30MHz-10GHz

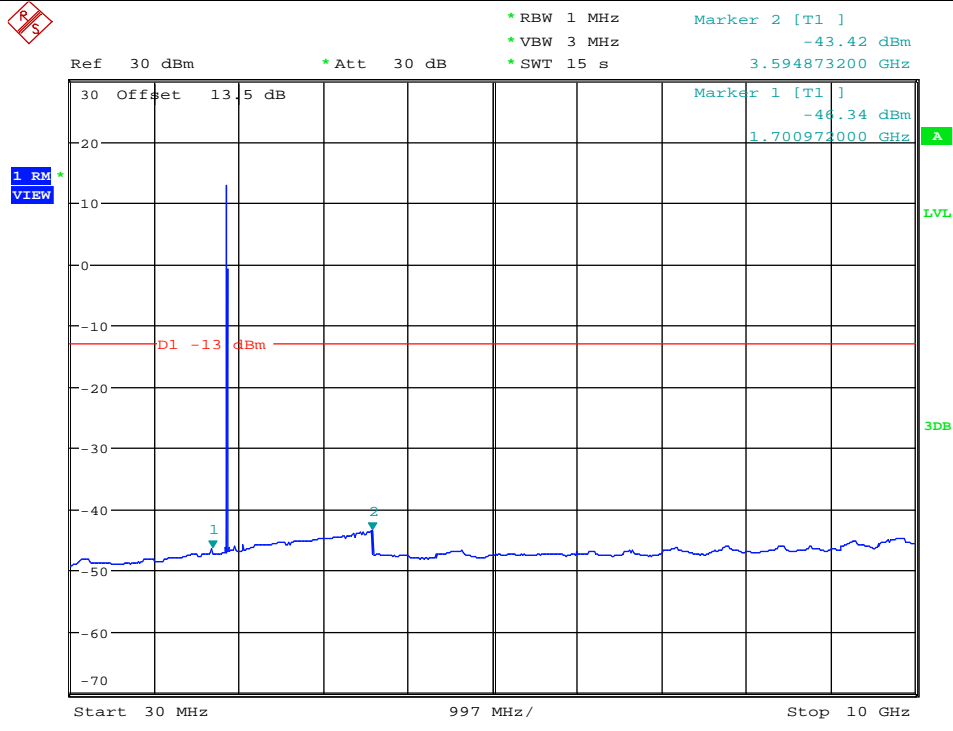


Date: 16.NOV.2022 14:50:40

Band 2 CSE 1.4MHz-M-16QAM-1RB0-10GHz-20GHz

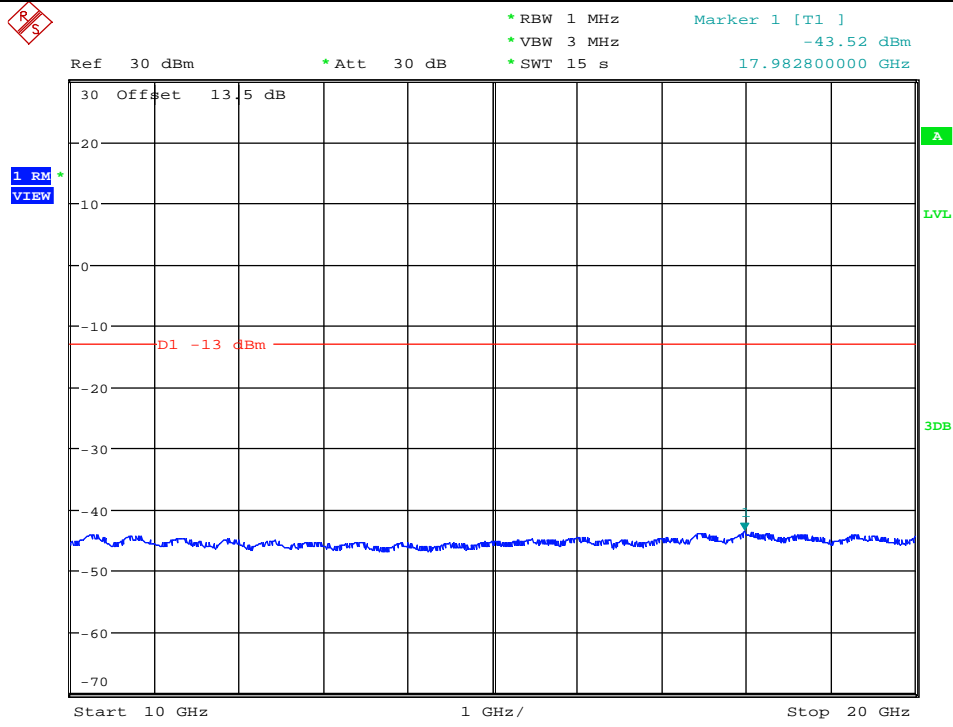


Date: 16.NOV.2022 14:51:09

Band 2 CSE 1.4MHz-H-QPSK-1RB0-30MHz-10GHz

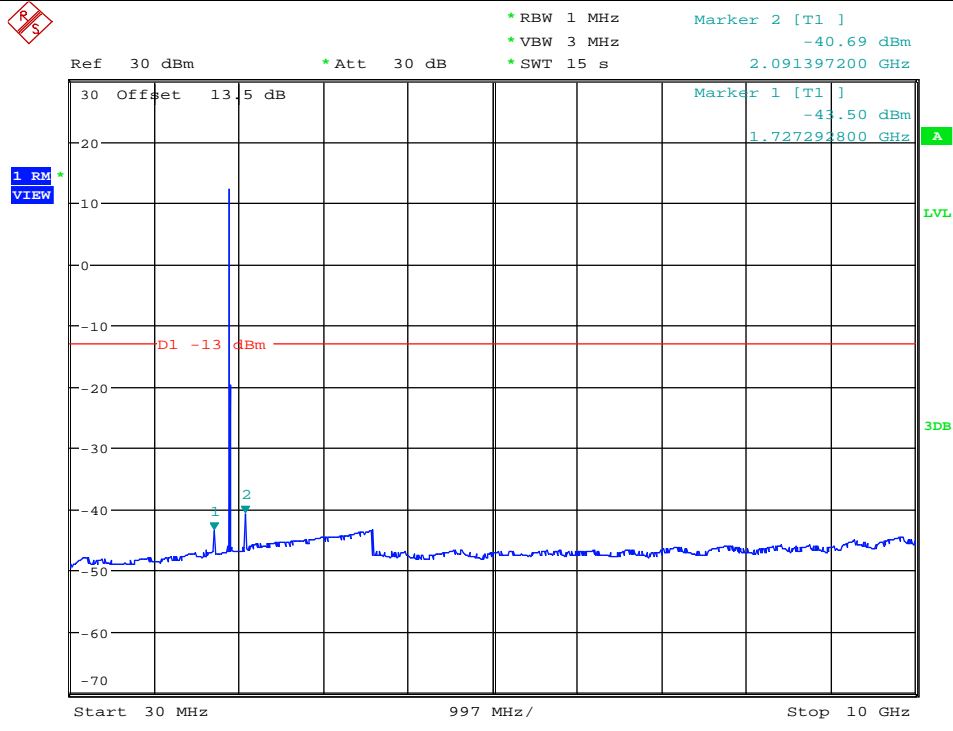


Date: 16.NOV.2022 14:31:47

Band 2 CSE 1.4MHz-H-QPSK-1RB0-10GHz-20GHz

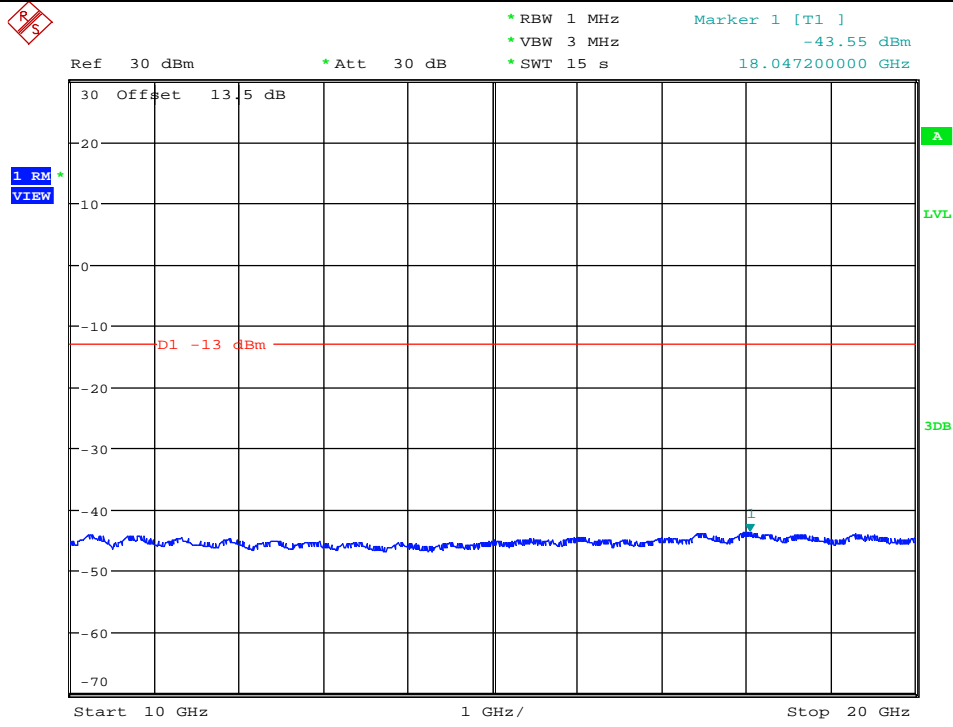


Date: 16.NOV.2022 14:32:17

Band 2 CSE 1.4MHz-H-16QAM-1RB0-30MHz-10GHz

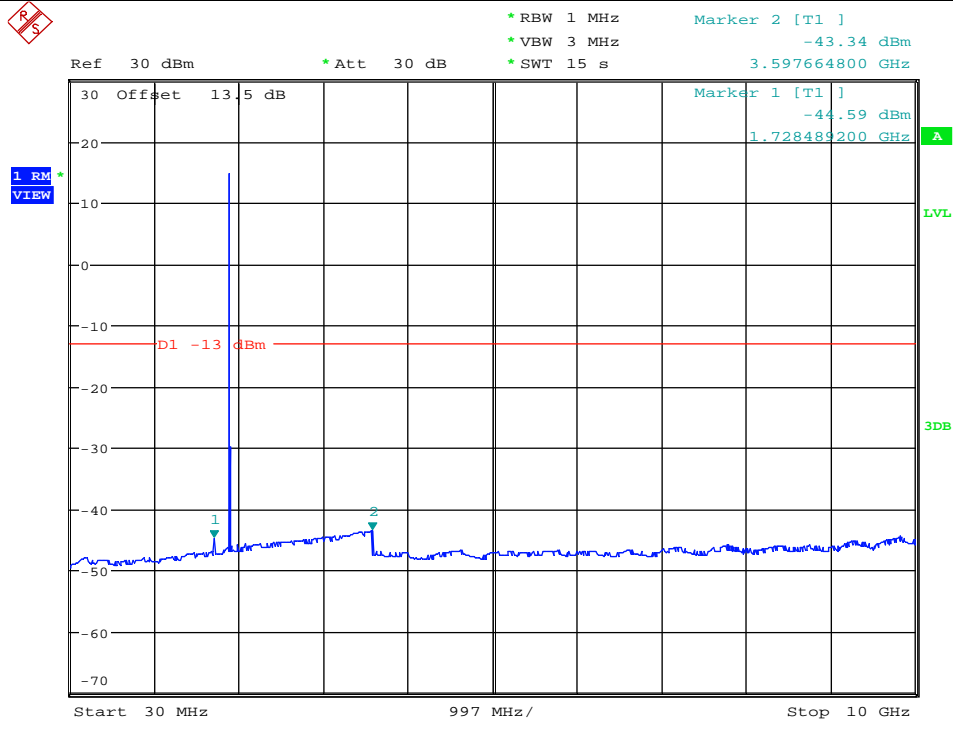


Date: 16.NOV.2022 15:01:02

Band 2 CSE 1.4MHz-H-16QAM-1RB0-10GHz-20GHz

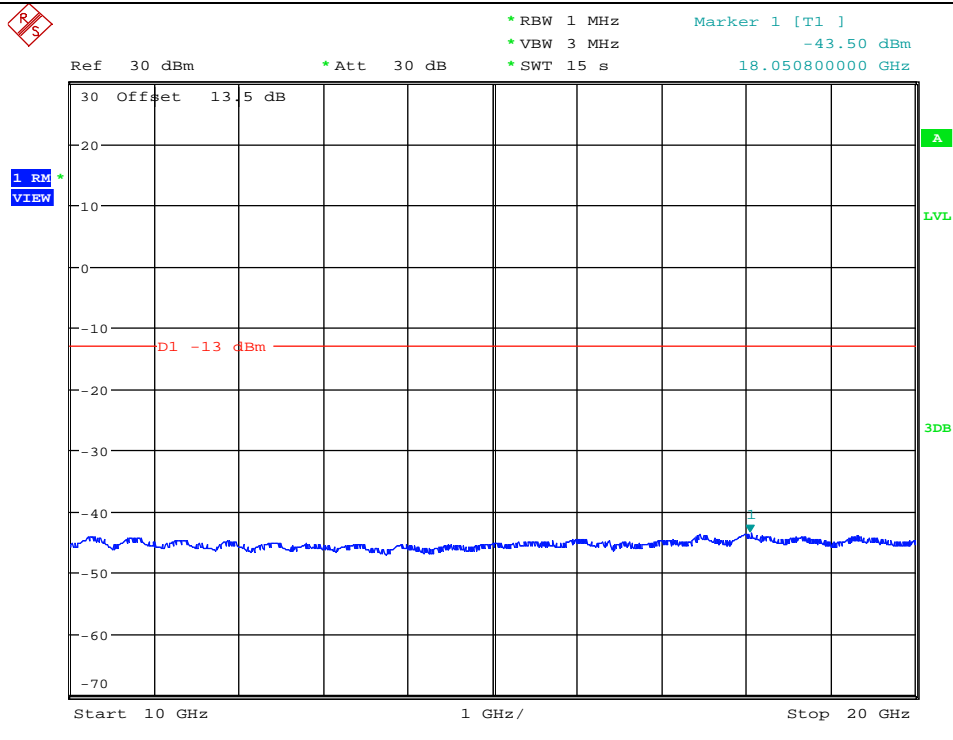


Date: 16.NOV.2022 15:01:30

Band 2 CSE 3MHz-L-QPSK-1RB0-30MHz-10GHz

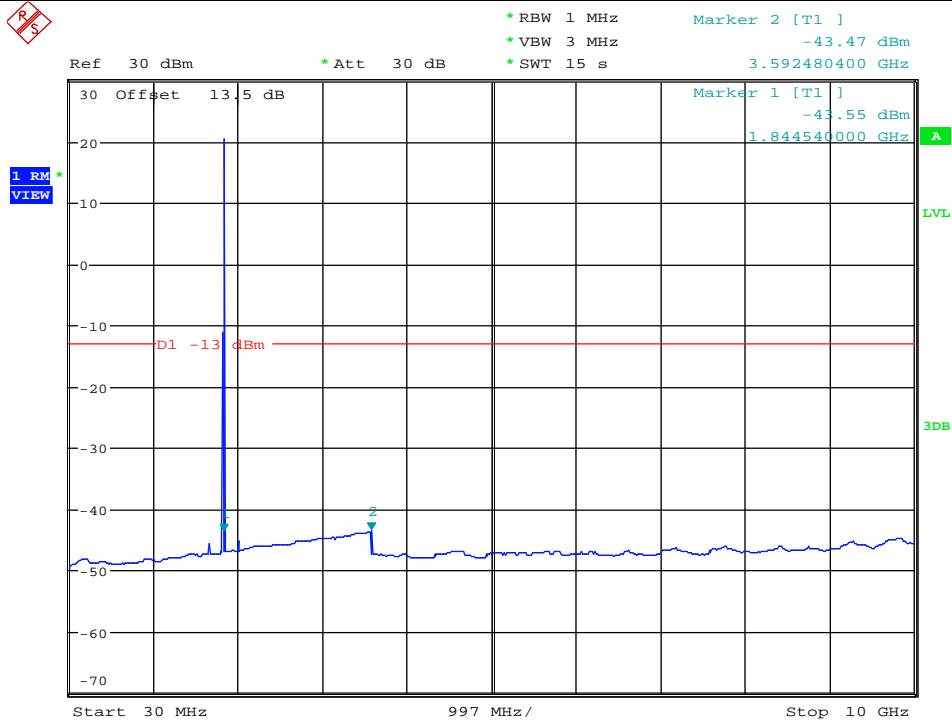


Date: 16.NOV.2022 15:14:00

Band 2 CSE 3MHz-L-QPSK-1RB0-10GHz-20GHz

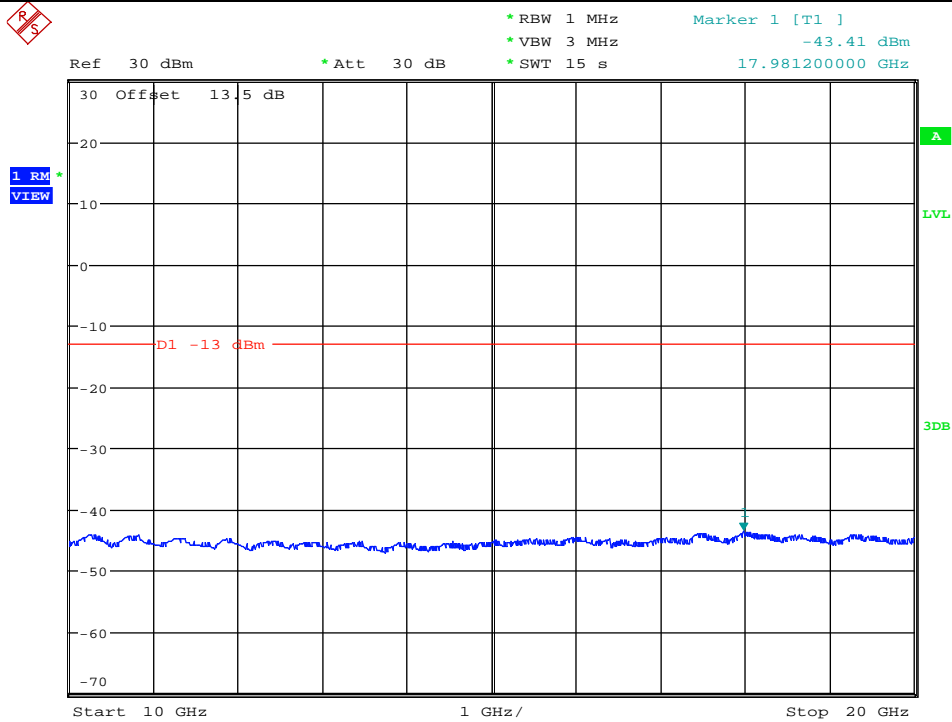


Date: 16.NOV.2022 15:14:30

Band 2 CSE 3MHz-L-16QAM-1RB0-30MHz-10GHz

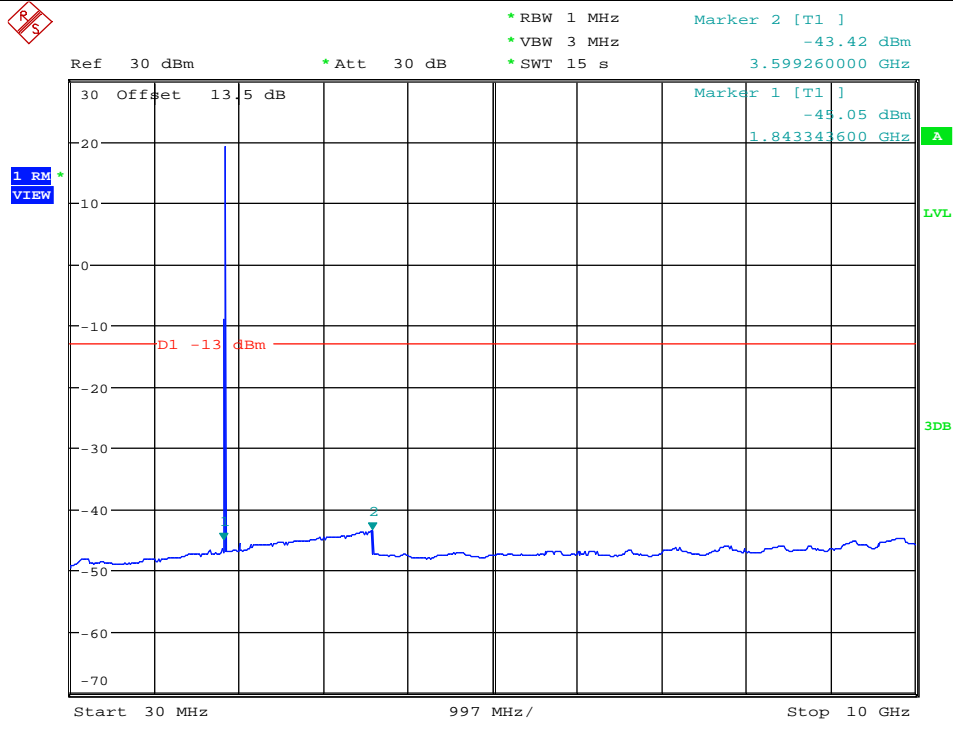


Date: 16.NOV.2022 17:41:58

Band 2 CSE 3MHz-L-16QAM-1RB0-10GHz-20GHz

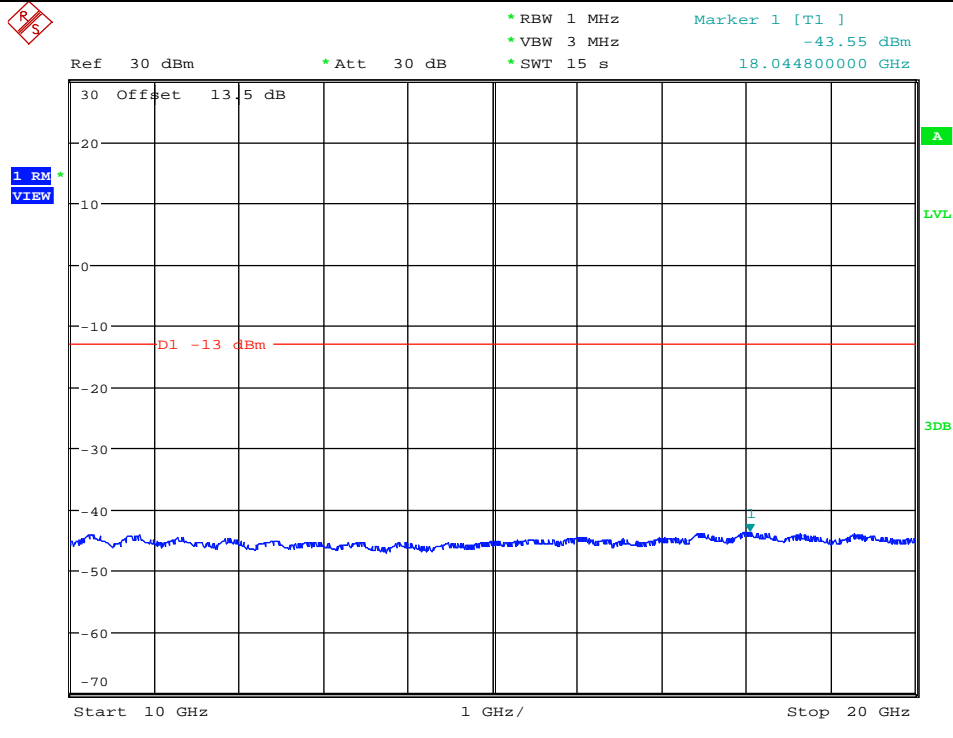


Date: 16.NOV.2022 17:42:28

Band 2 CSE 3MHz-M-QPSK-1RB0-30MHz-10GHz

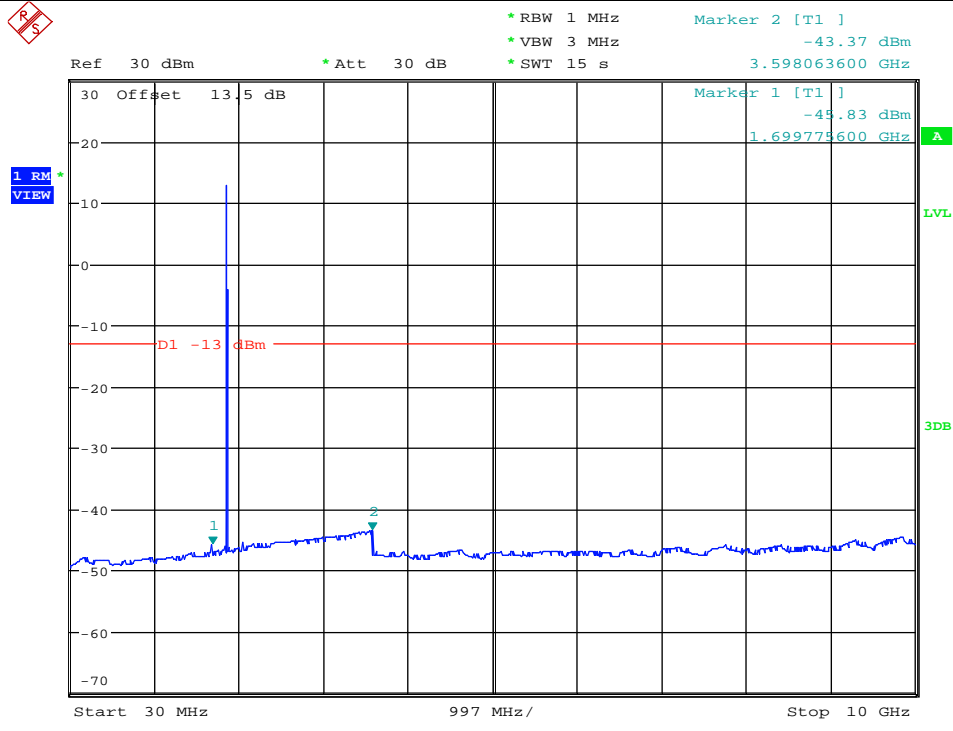


Date: 16.NOV.2022 15:19:35

Band 2 CSE 3MHz-M-QPSK-1RB0-10GHz-20GHz

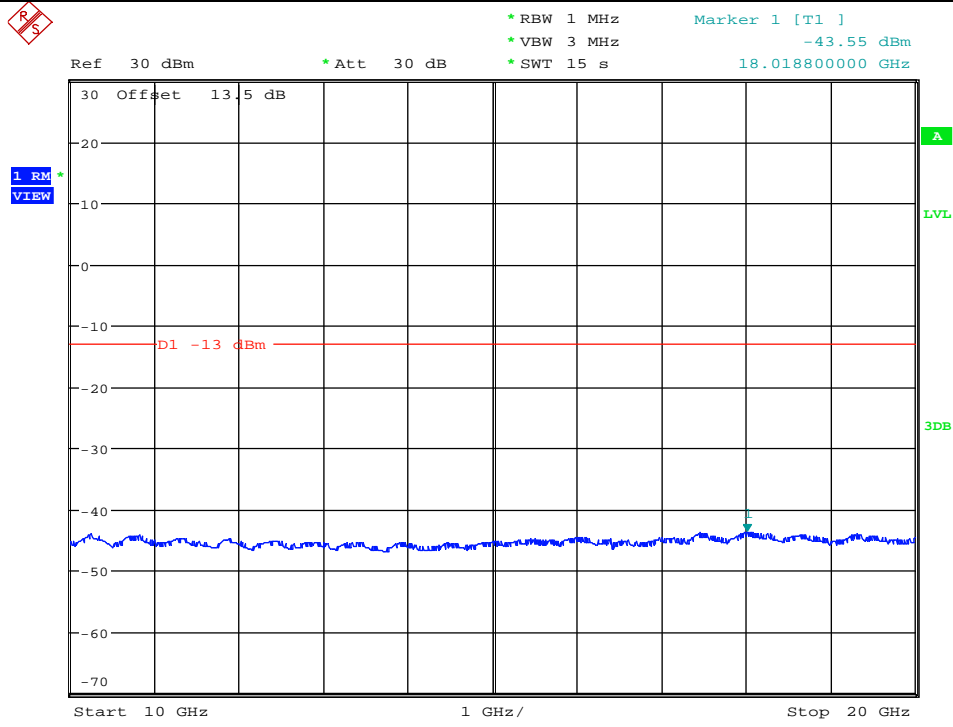


Date: 16.NOV.2022 15:20:05

Band 2 CSE 3MHz-M-16QAM-1RB0-30MHz-10GHz

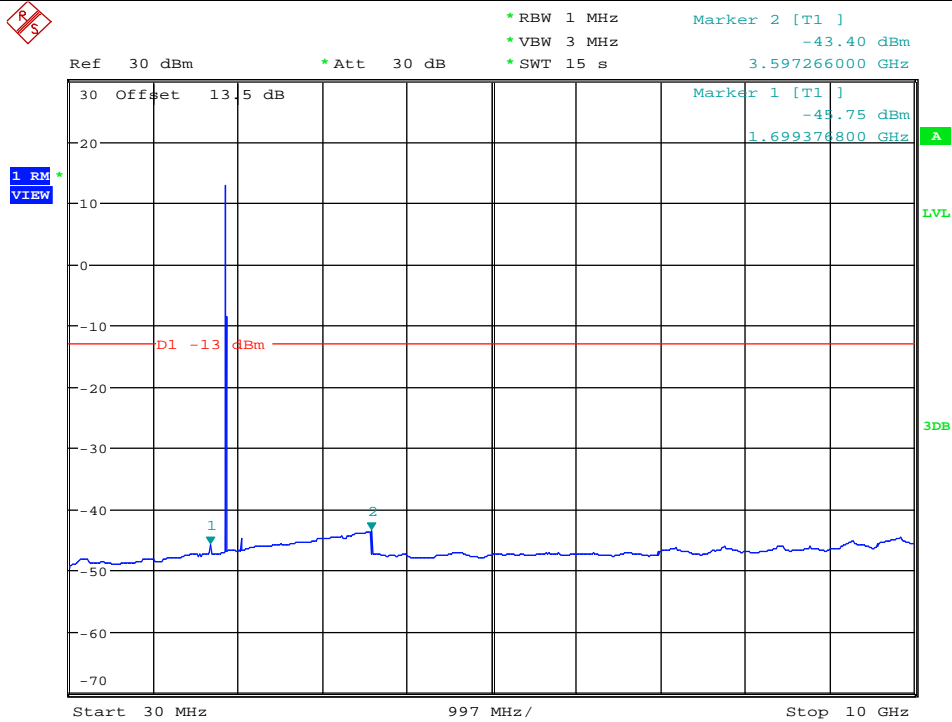


Date: 16.NOV.2022 15:46:39

Band 2 CSE 3MHz-M-16QAM-1RB0-10GHz-20GHz

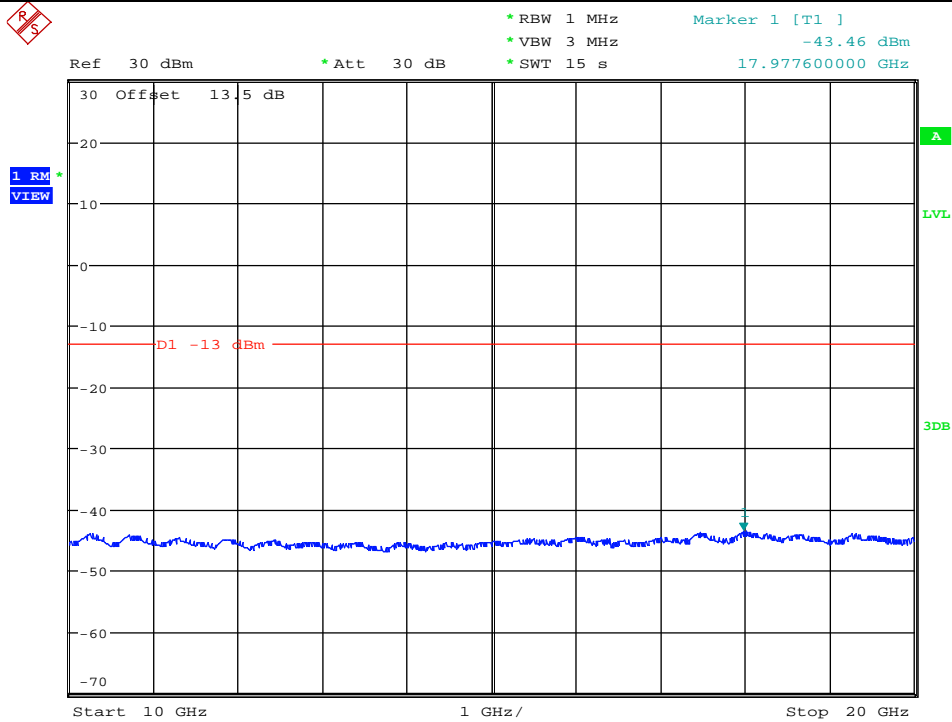


Date: 16.NOV.2022 15:47:06

Band 2 CSE 3MHz-H-QPSK-1RB0-30MHz-10GHz

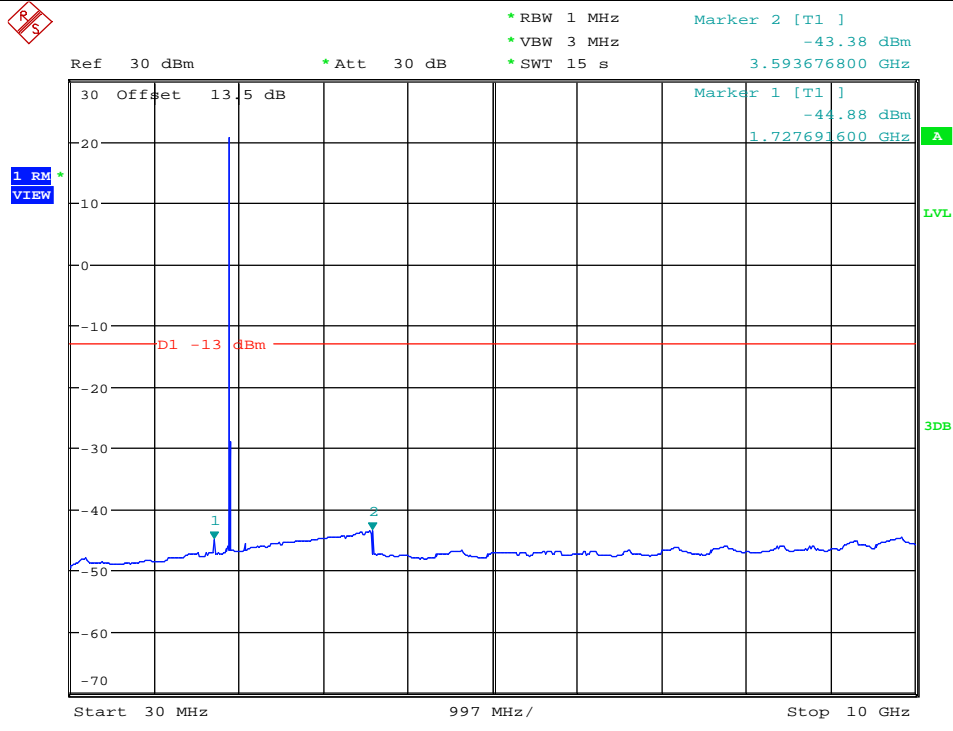


Date: 16.NOV.2022 15:30:54

Band 2 CSE 3MHz-H-QPSK-1RB0-10GHz-20GHz

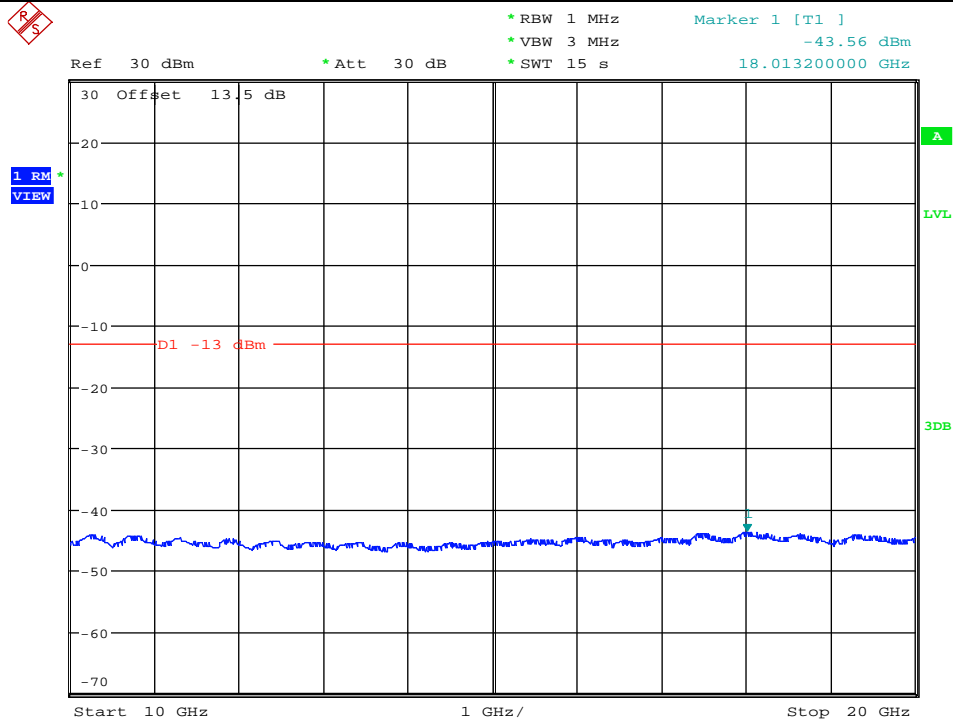


Date: 16.NOV.2022 15:31:23

Band 2 CSE 3MHz-H-16QAM-1RB0-30MHz-10GHz

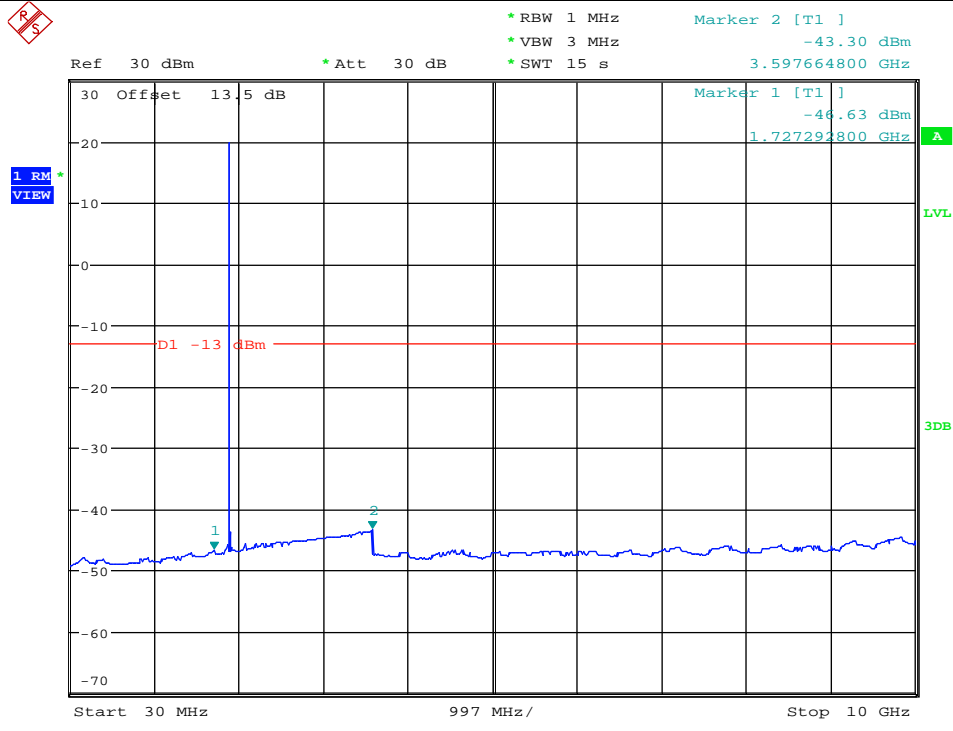


Date: 16.NOV.2022 15:56:33

Band 2 CSE 3MHz-H-16QAM-1RB0-10GHz-20GHz

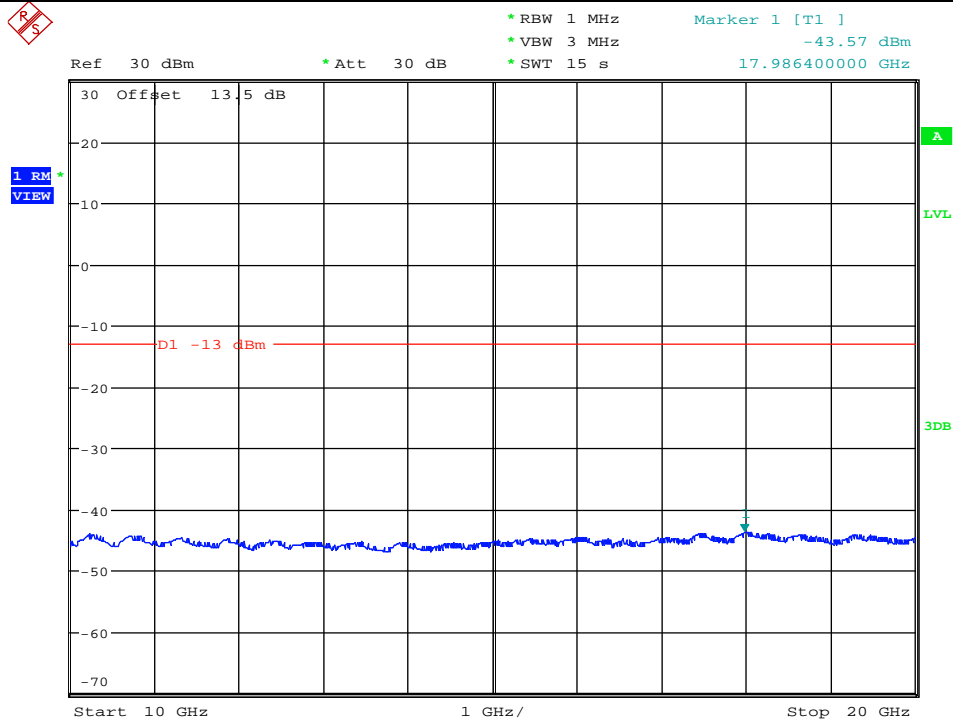


Date: 16.NOV.2022 15:57:01

Band 2 CSE 5MHz-L-QPSK-1RB0-30MHz-10GHz

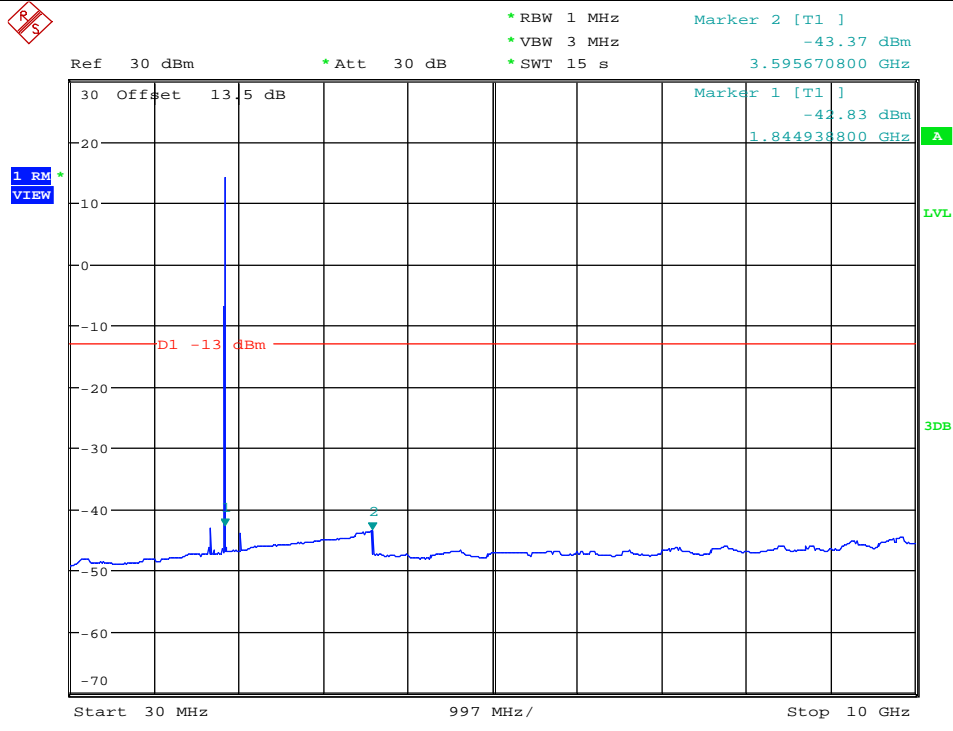


Date: 16.NOV.2022 18:35:03

Band 2 CSE 5MHz-L-QPSK-1RB0-10GHz-20GHz

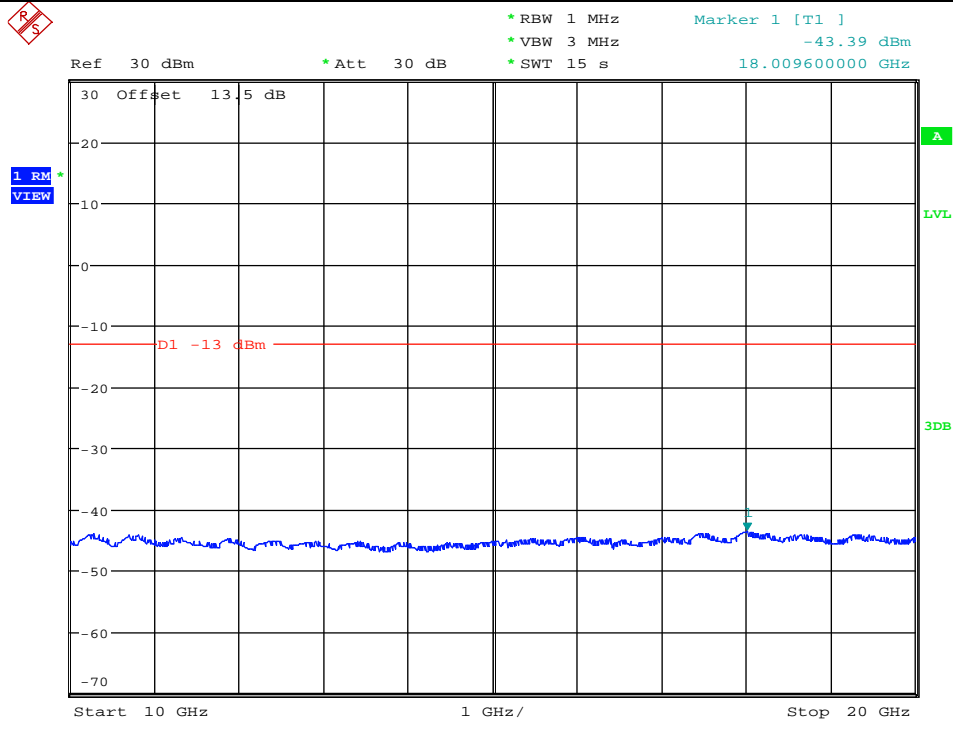


Date: 16.NOV.2022 18:35:31

Band 2 CSE 5MHz-L-16QAM-1RB0-30MHz-10GHz

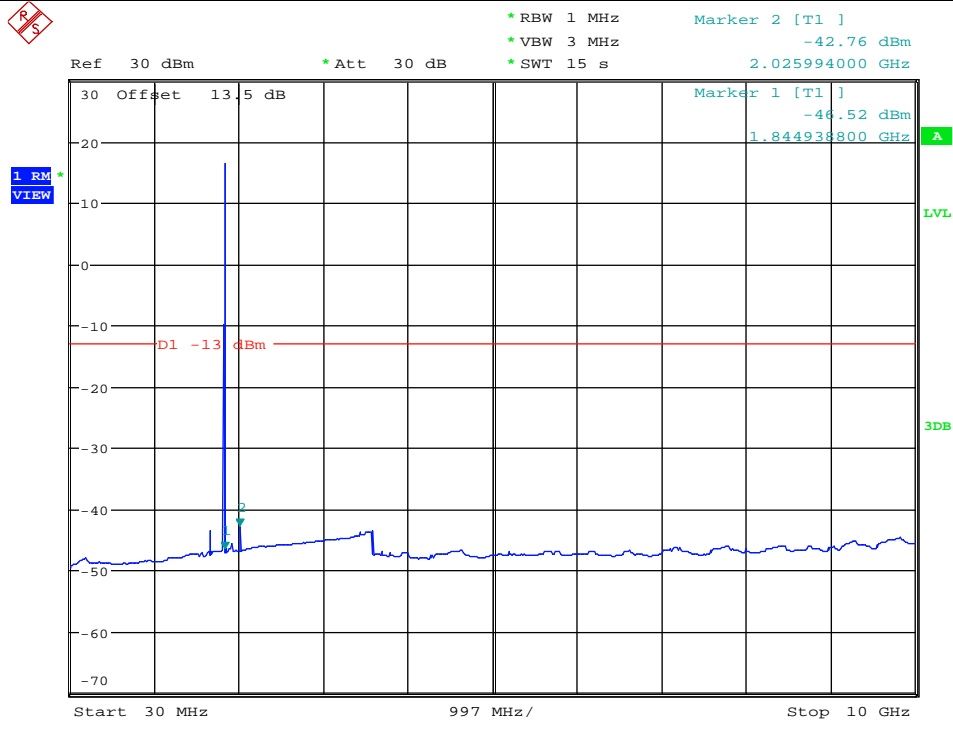


Date: 16.NOV.2022 18:56:19

Band 2 CSE 5MHz-L-16QAM-1RB0-10GHz-20GHz

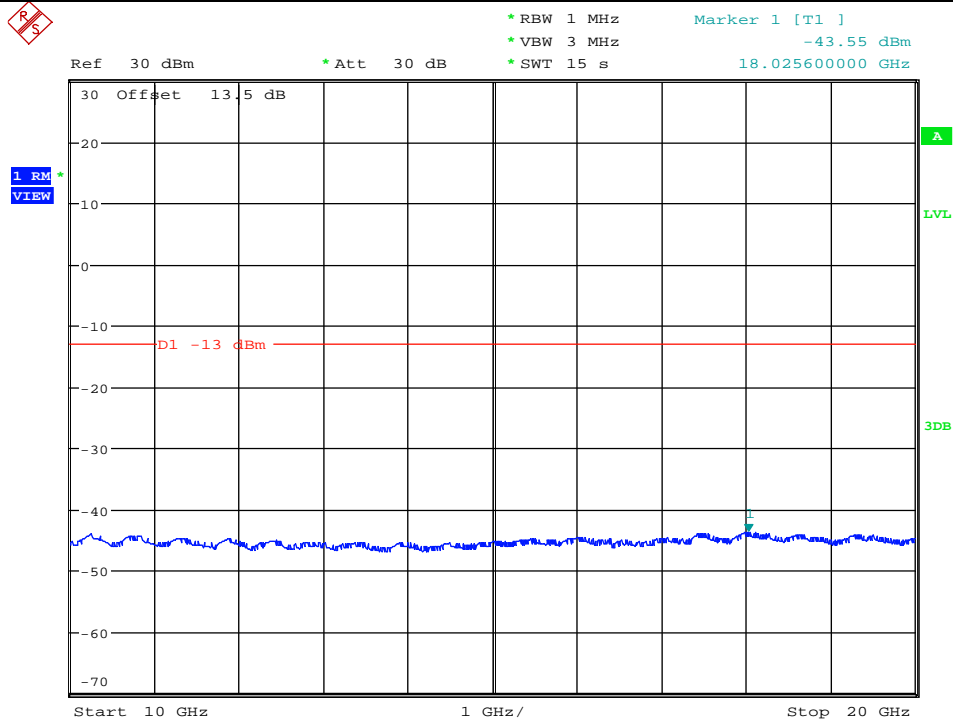


Date: 16.NOV.2022 18:56:48

Band 2 CSE 5MHz-M-QPSK-1RB0-30MHz-10GHz

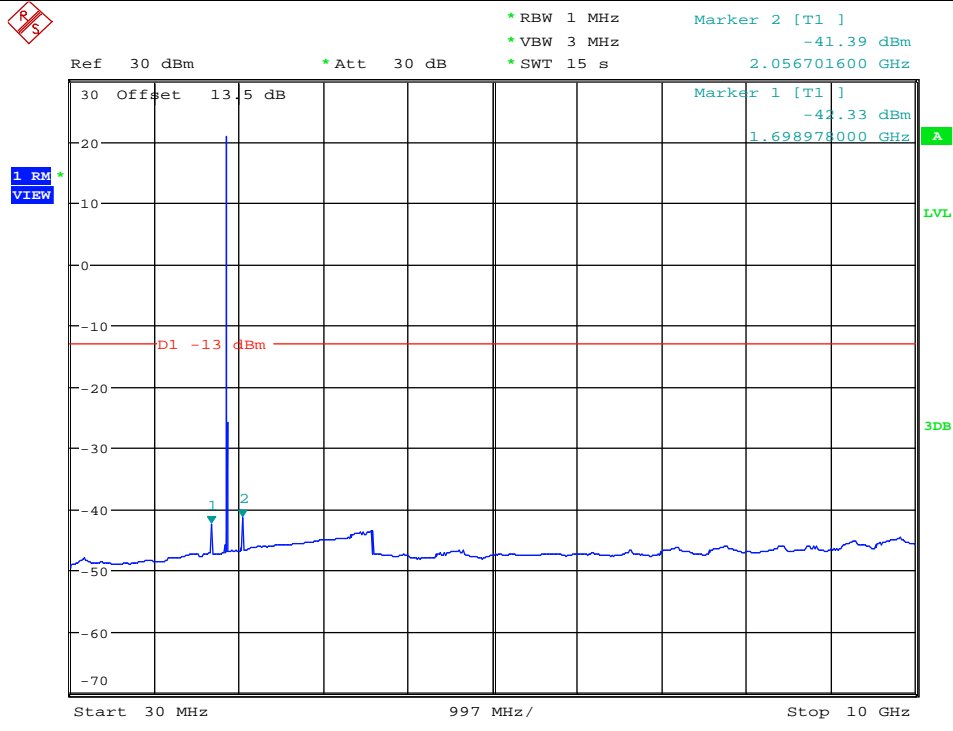


Date: 16.NOV.2022 18:40:22

Band 2 CSE 5MHz-M-QPSK-1RB0-10GHz-20GHz

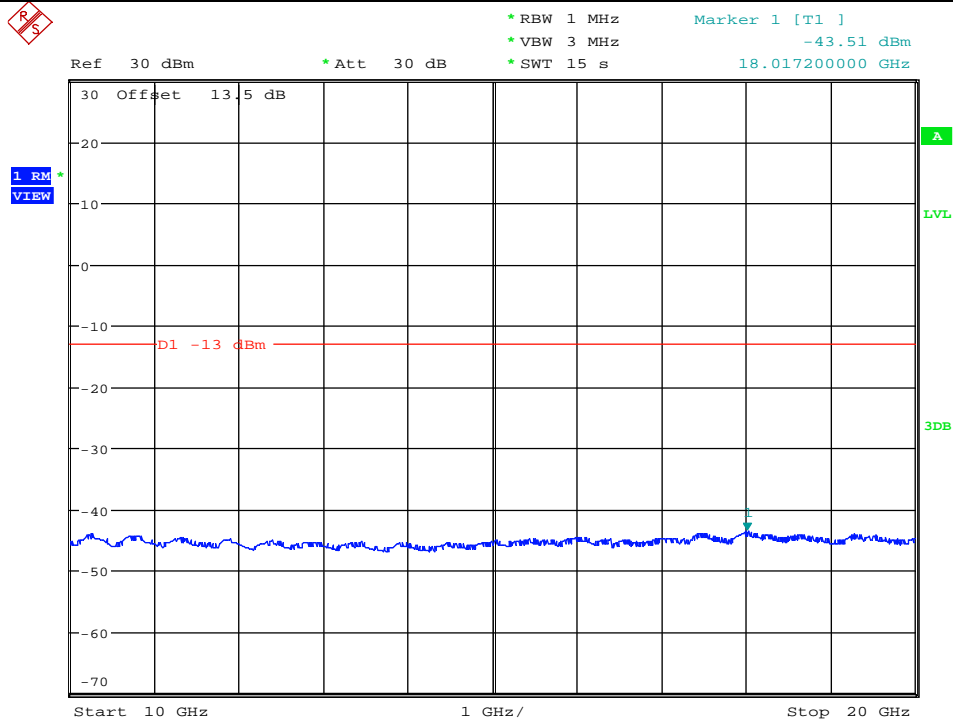


Date: 16.NOV.2022 18:40:51


Band 2 CSE 5MHz-M-16QAM-1RB0-30MHz-10GHz

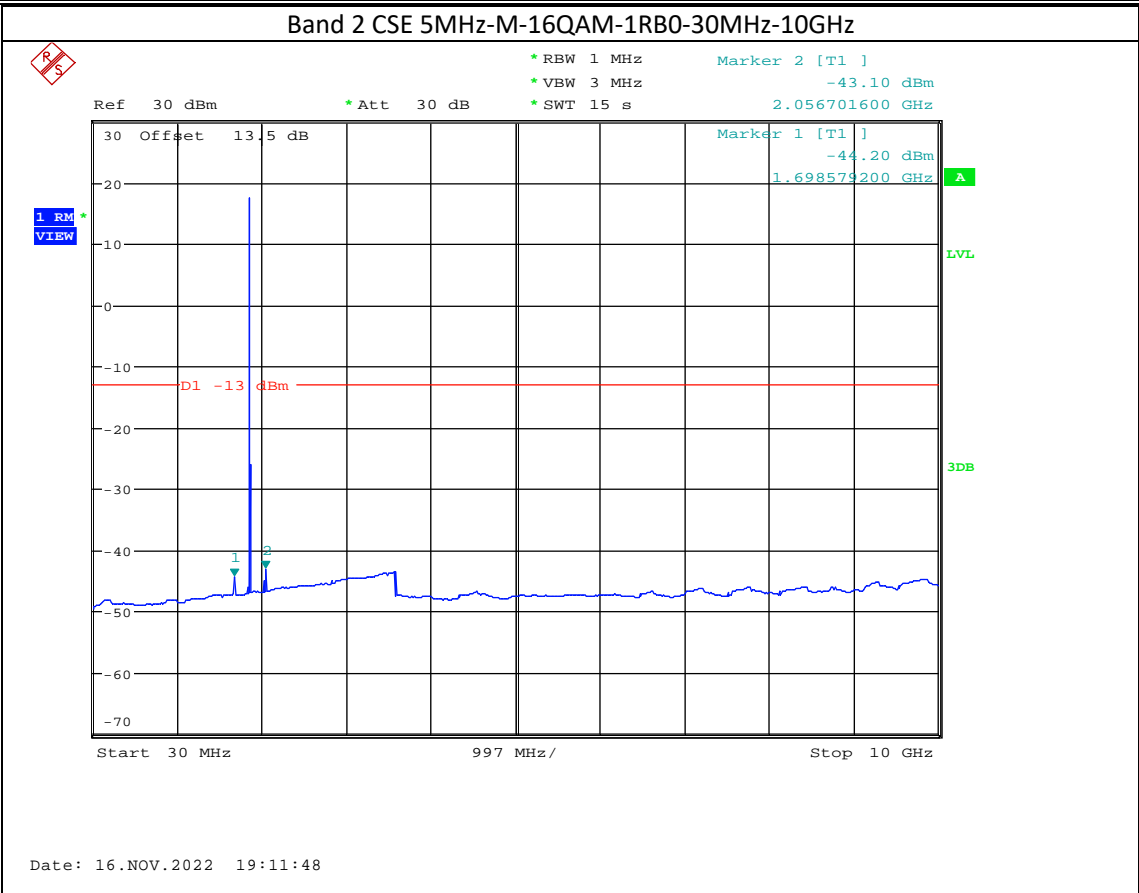


Band 2 CSE 5MHz-M-16QAM-1RB0-10GHz-20GHz

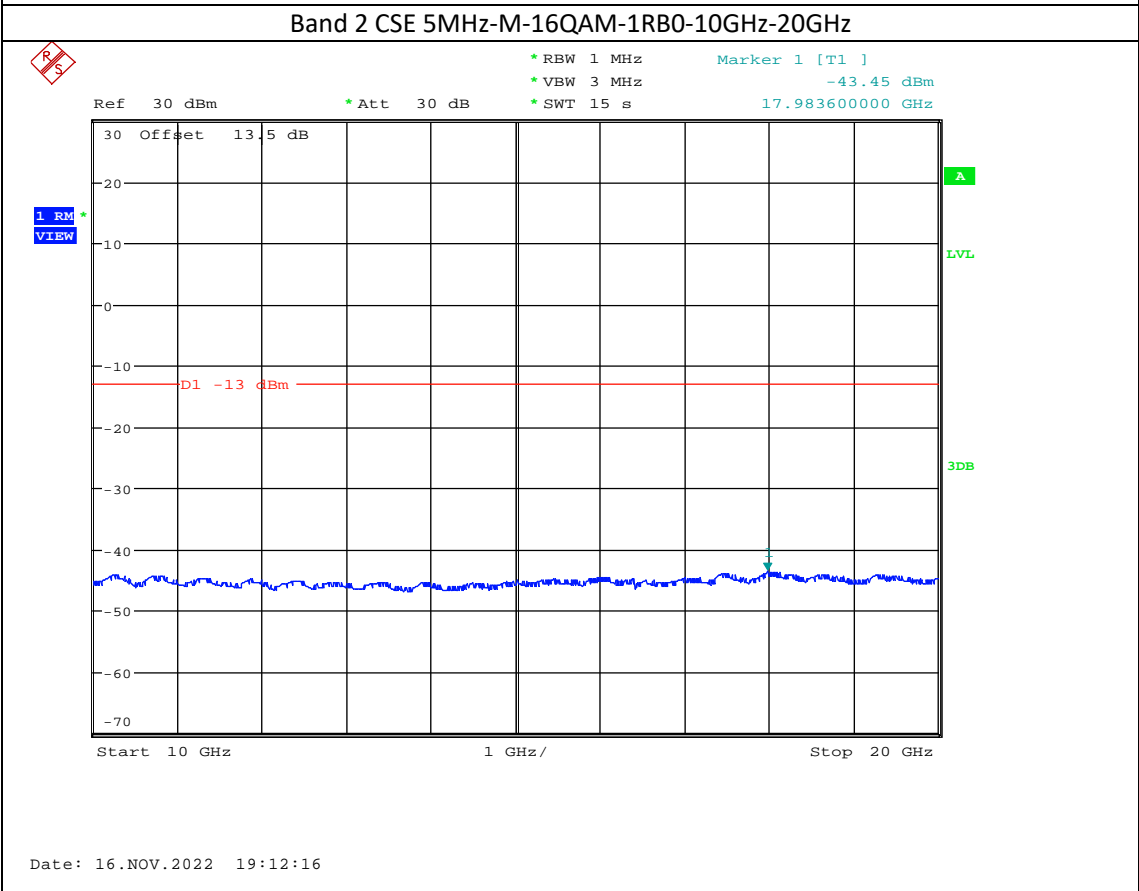


Band 2 CSE 5MHz-H-QPSK-1RB0-30MHz-10GHz

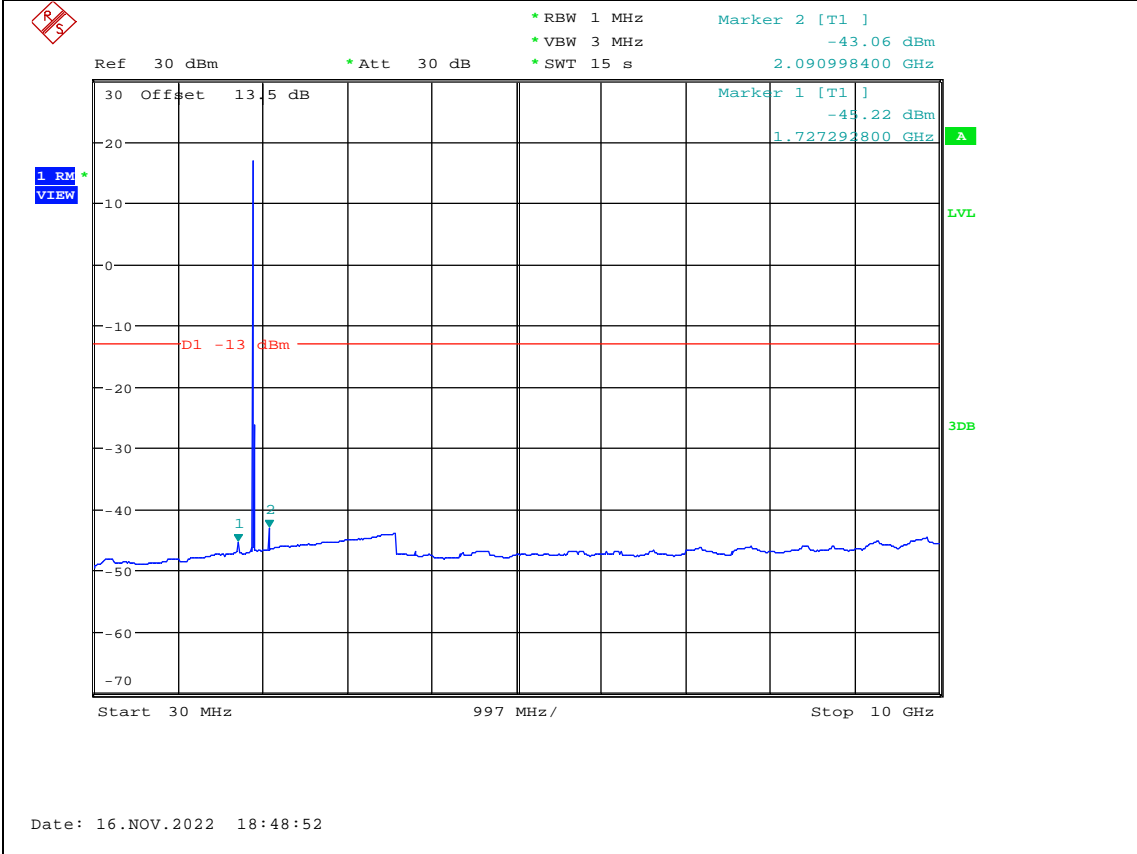

Band 2 CSE 5MHz-H-QPSK-1RB0-10GHz-20GHz

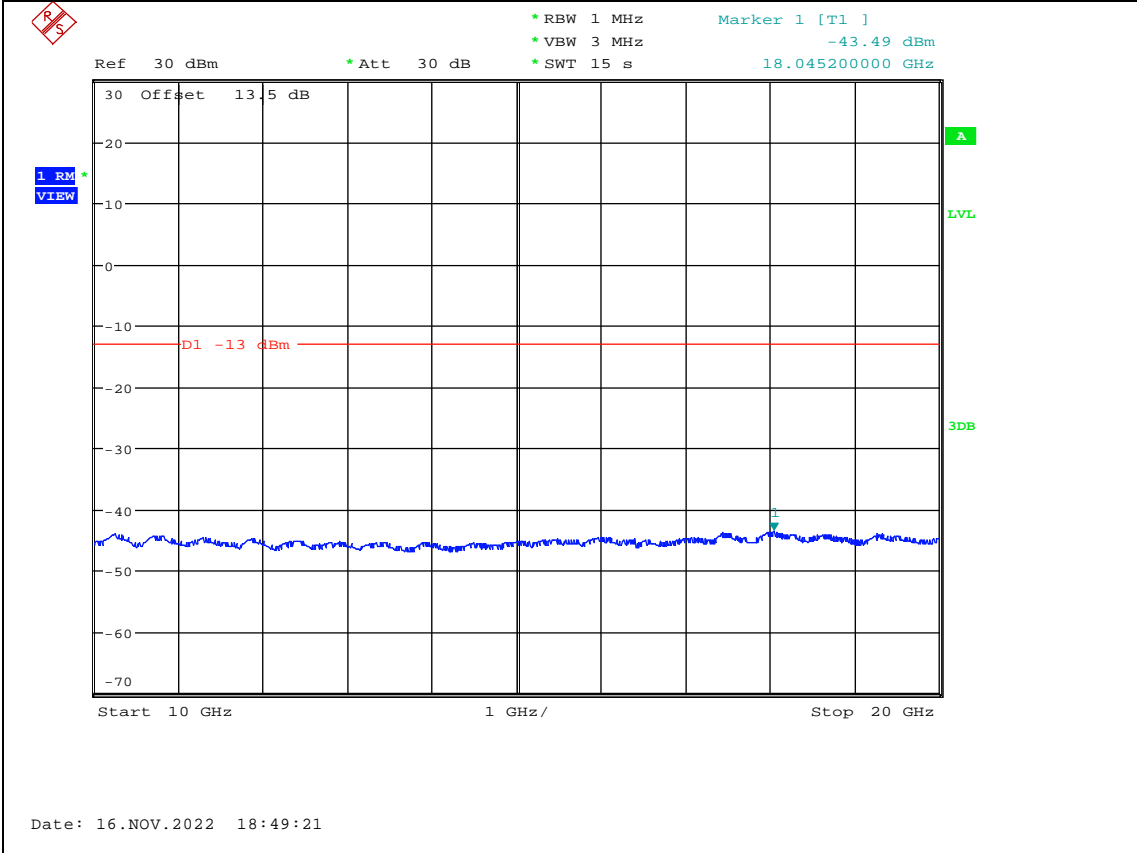


Band 2 CSE 5MHz-H-16QAM-1RB0-30MHz-10GHz

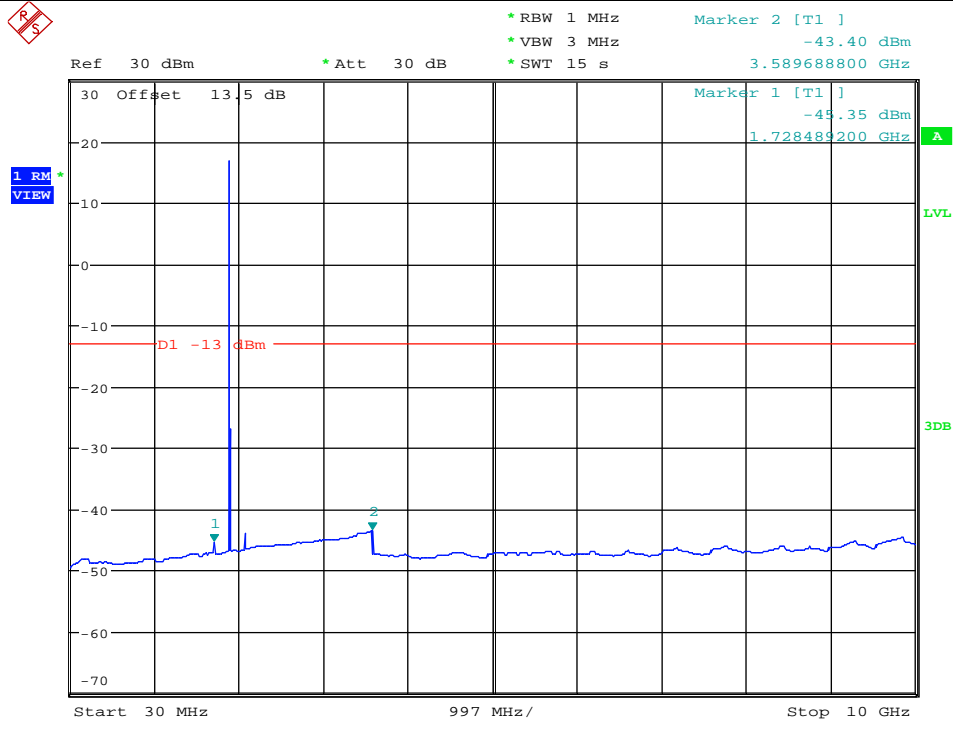


Date: 16.NOV.2022 19:18:56

Band 2 CSE 5MHz-H-16QAM-1RB0-10GHz-20GHz

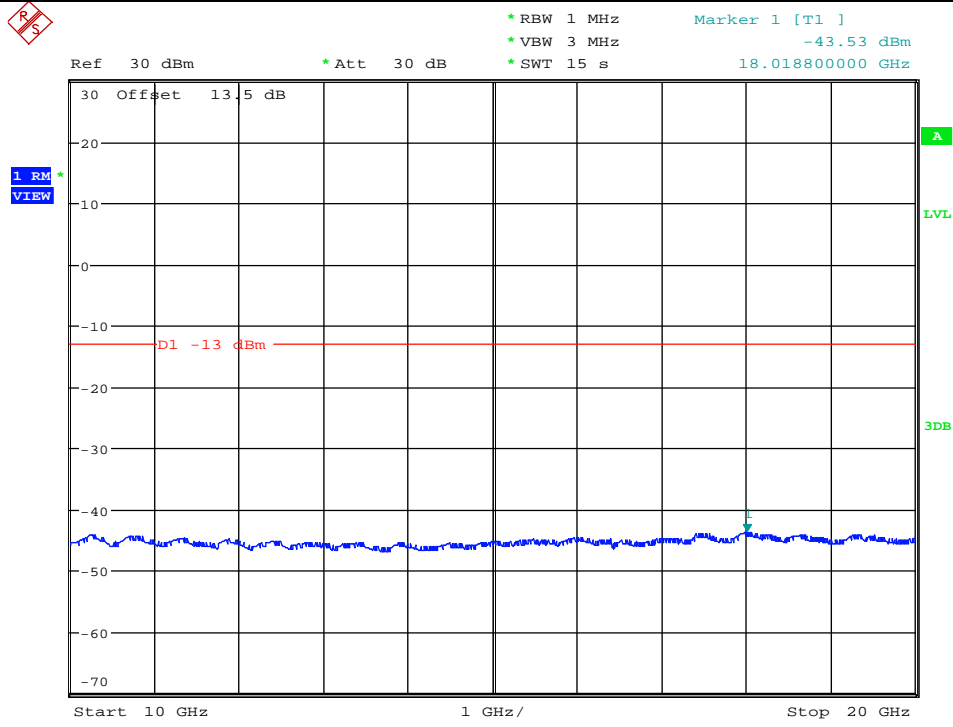


Date: 16.NOV.2022 19:19:24

Band 2 CSE 10MHz-L-QPSK-1RB0-30MHz-10GHz

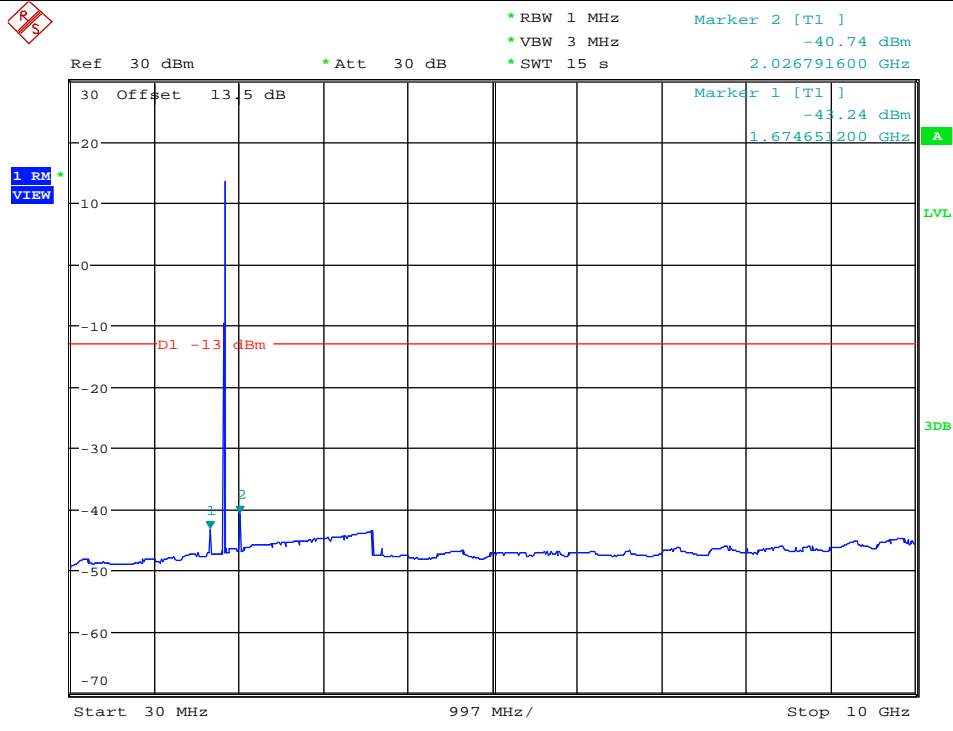


Date: 17.NOV.2022 09:33:12

Band 2 CSE 10MHz-L-QPSK-1RB0-10GHz-20GHz

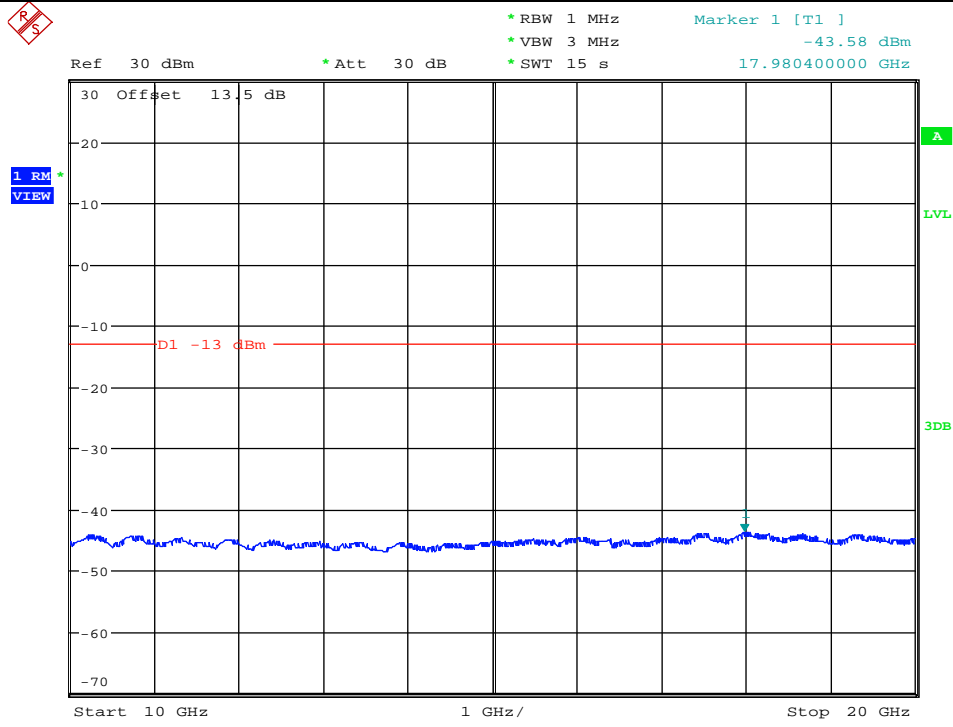


Date: 17.NOV.2022 09:33:41


Band 2 CSE 10MHz-L-16QAM-1RB0-30MHz-10GHz

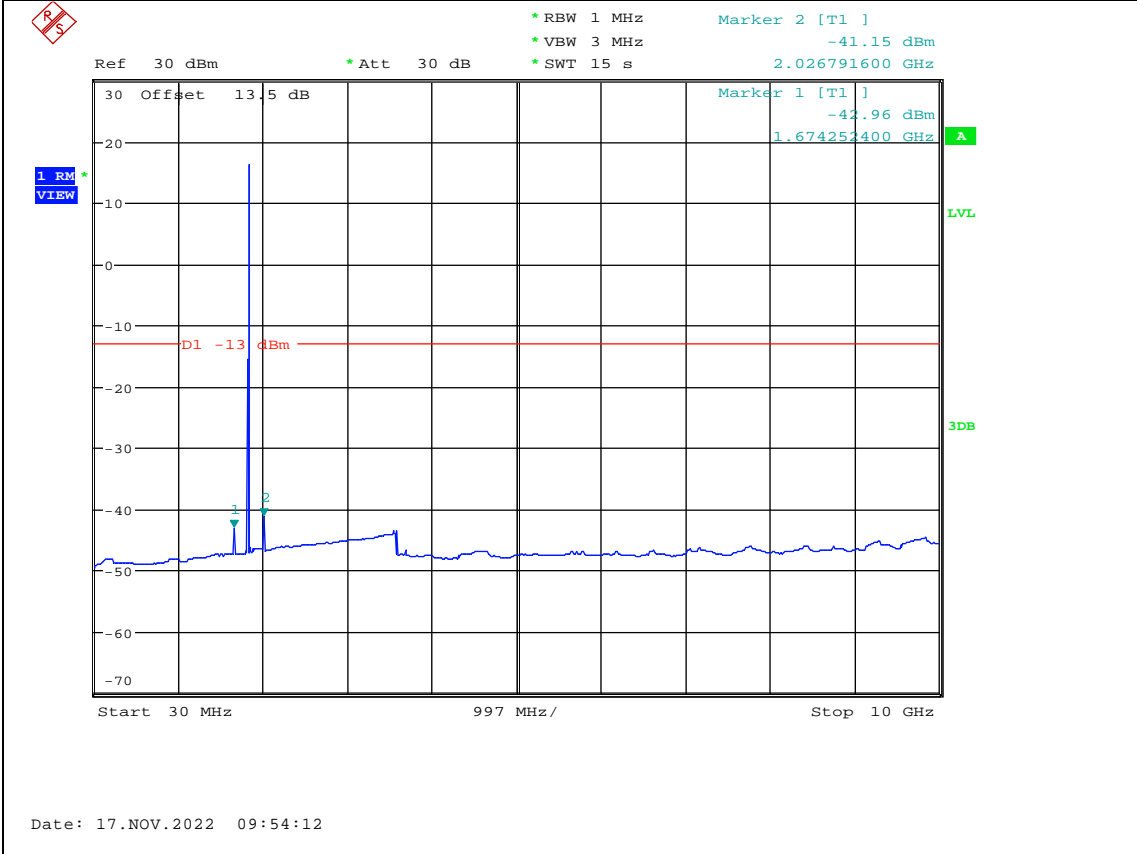

Band 2 CSE 10MHz-L-16QAM-1RB0-10GHz-20GHz

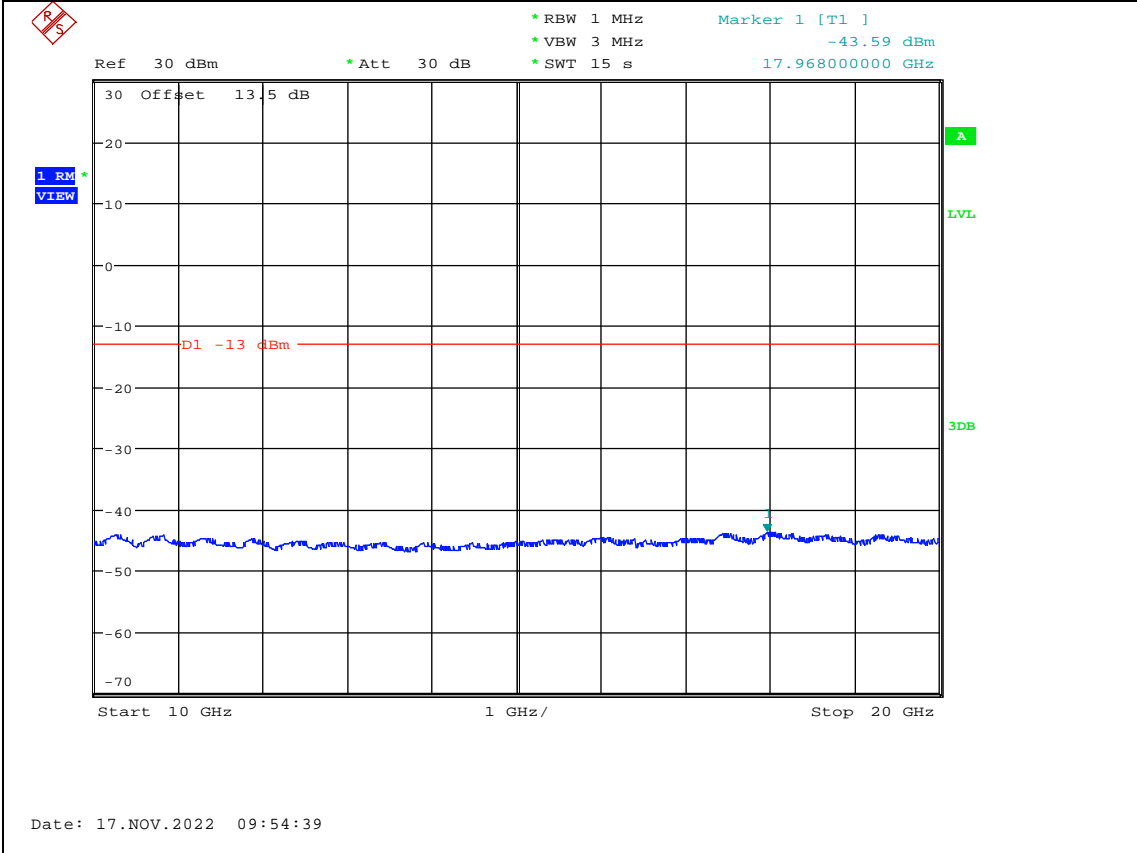


Band 2 CSE 10MHz-M-QPSK-1RB0-30MHz-10GHz

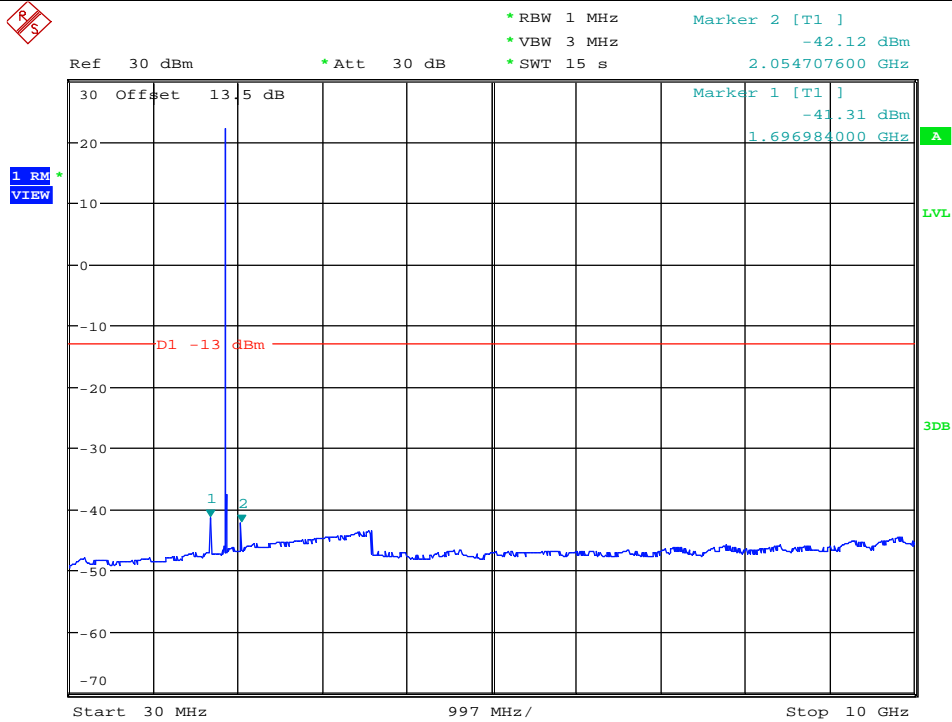


Date: 17.NOV.2022 09:38:42

Band 2 CSE 10MHz-M-QPSK-1RB0-10GHz-20GHz

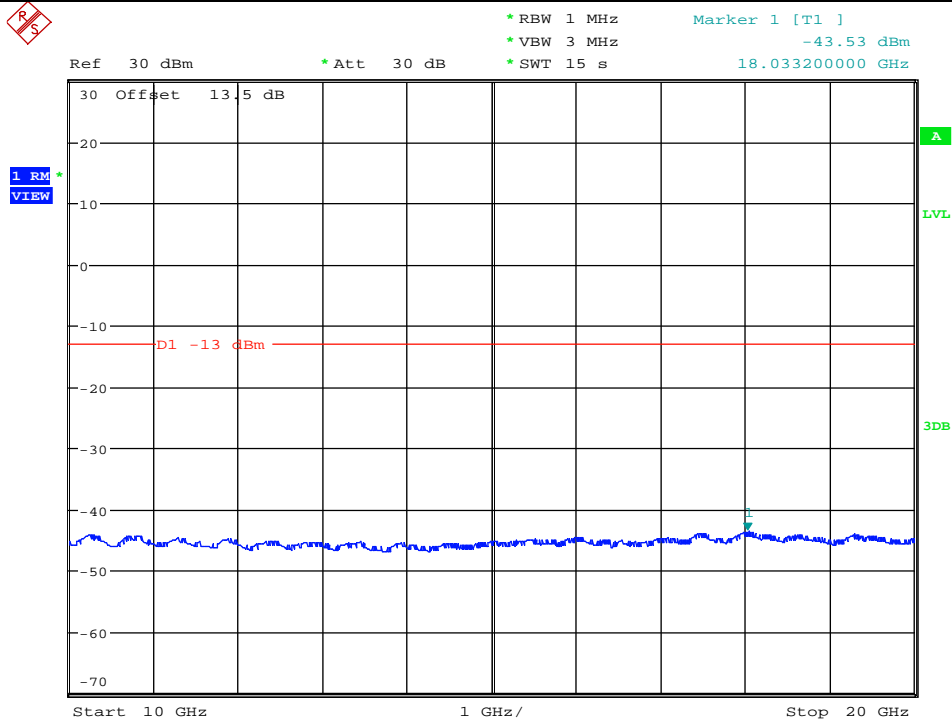


Date: 17.NOV.2022 09:39:10

Band 2 CSE 10MHz-M-16QAM-1RB0-30MHz-10GHz

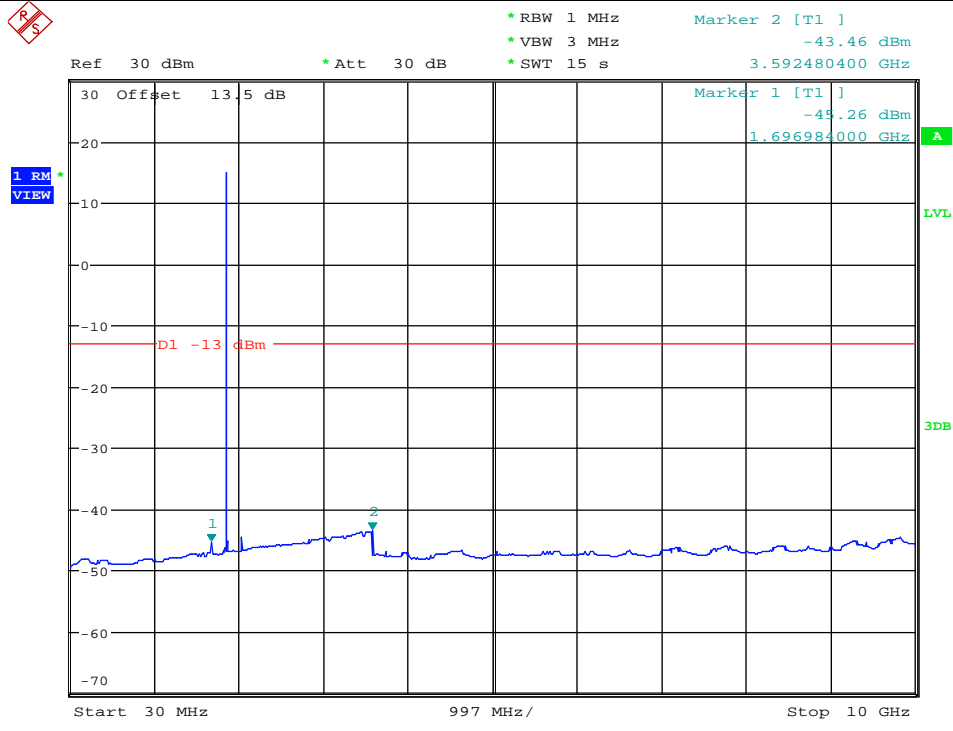


Date: 17.NOV.2022 09:59:18

Band 2 CSE 10MHz-M-16QAM-1RB0-10GHz-20GHz

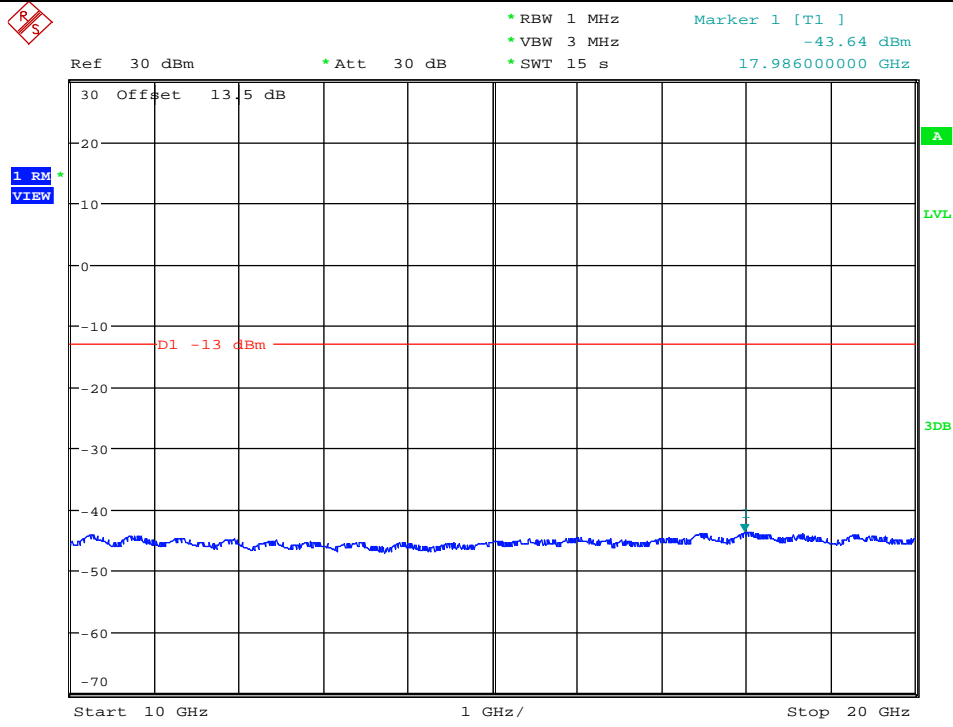


Date: 17.NOV.2022 09:59:47

Band 2 CSE 10MHz-H-QPSK-1RB0-30MHz-10GHz

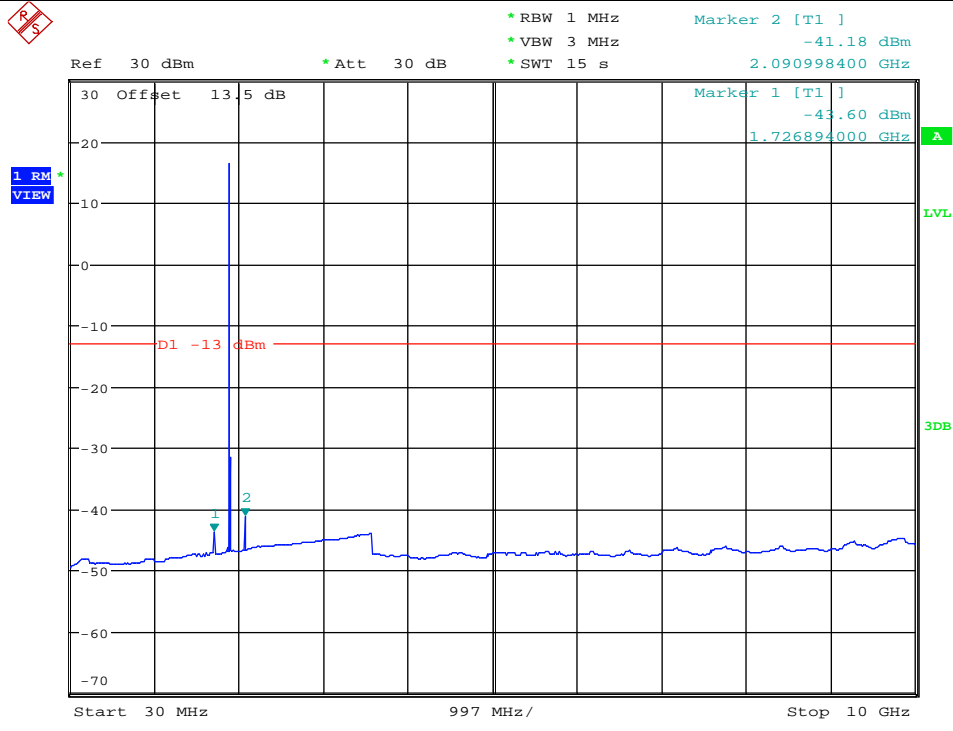


Date: 17.NOV.2022 09:47:01

Band 2 CSE 10MHz-H-QPSK-1RB0-10GHz-20GHz

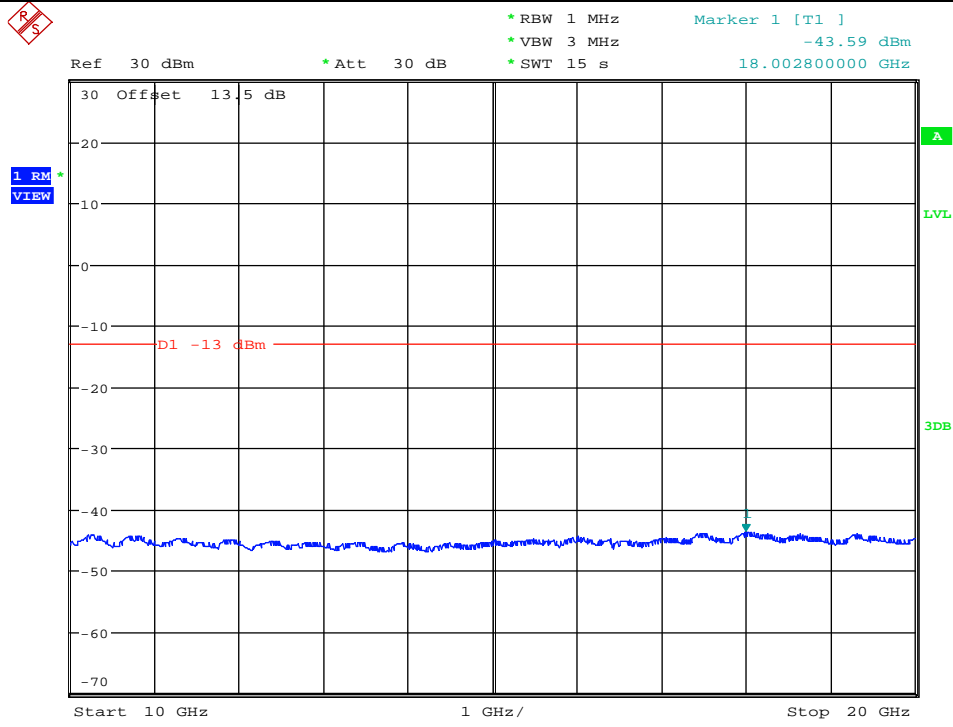


Date: 17.NOV.2022 09:47:30

Band 2 CSE 10MHz-H-16QAM-1RB0-30MHz-10GHz

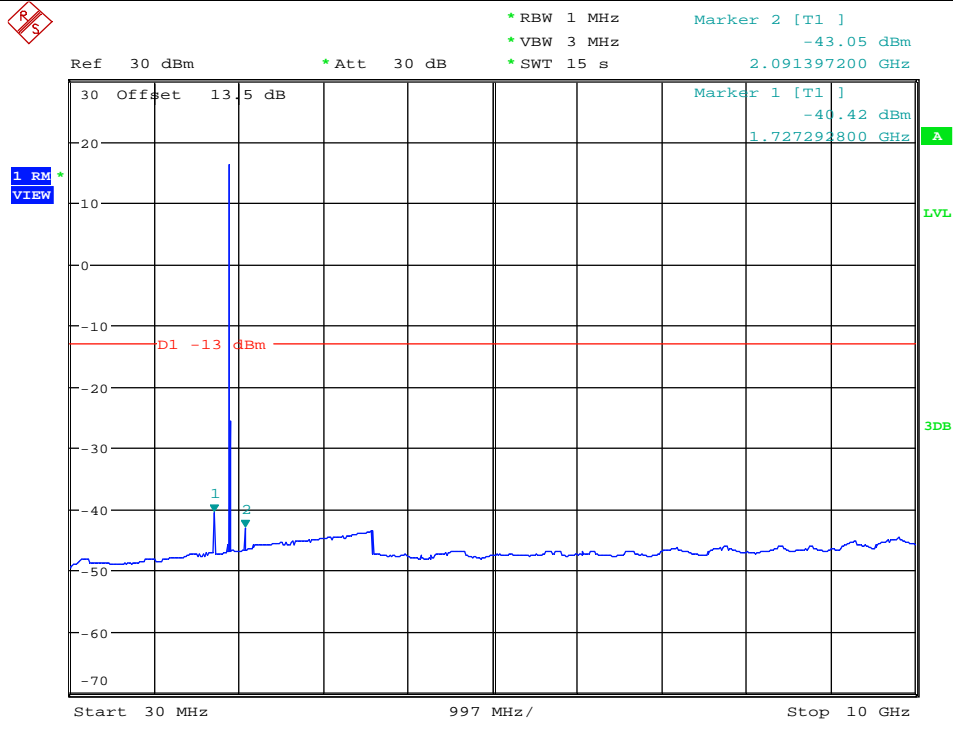


Date: 17.NOV.2022 10:06:14

Band 2 CSE 10MHz-H-16QAM-1RB0-10GHz-20GHz

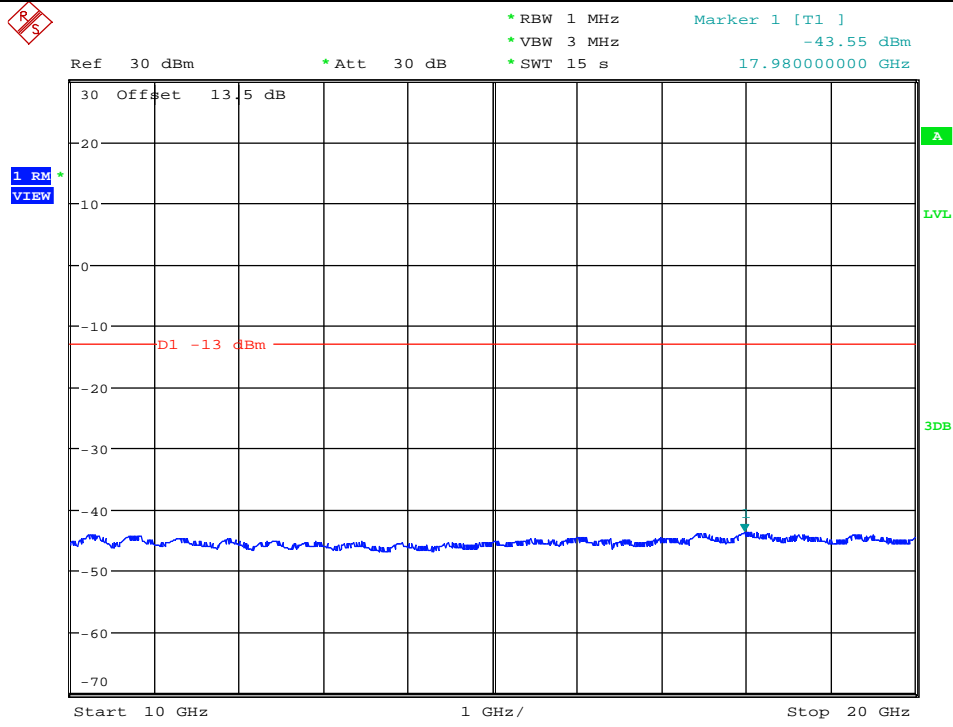


Date: 17.NOV.2022 10:06:44

Band 2 CSE 15MHz-L-QPSK-1RB0-30MHz-10GHz

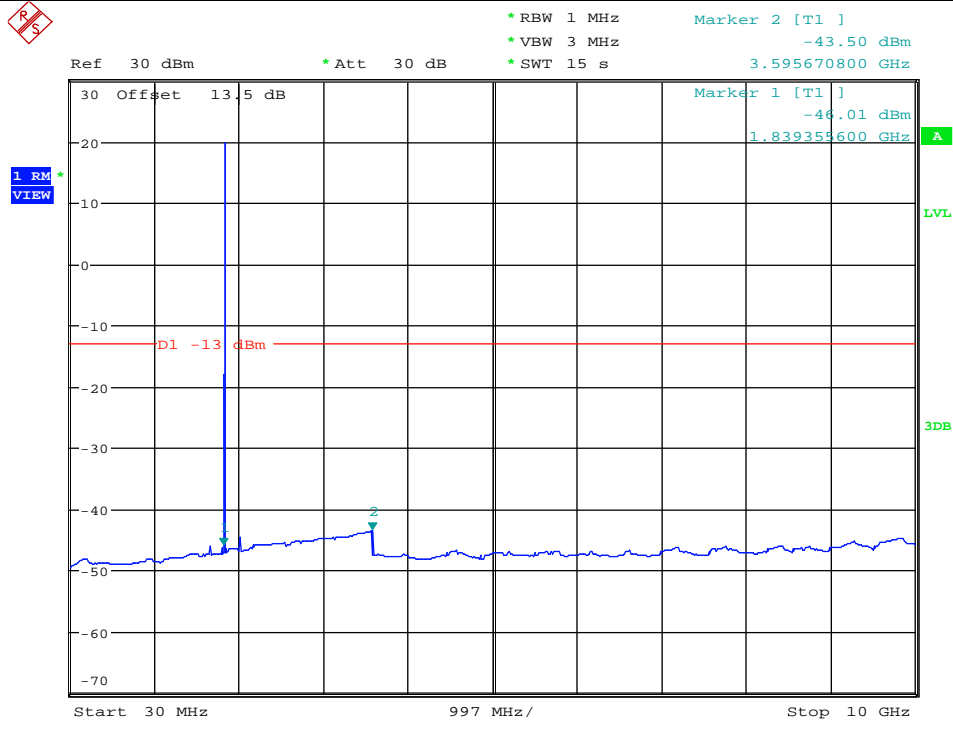


Date: 17.NOV.2022 08:45:58

Band 2 CSE 15MHz-L-QPSK-1RB0-10GHz-20GHz

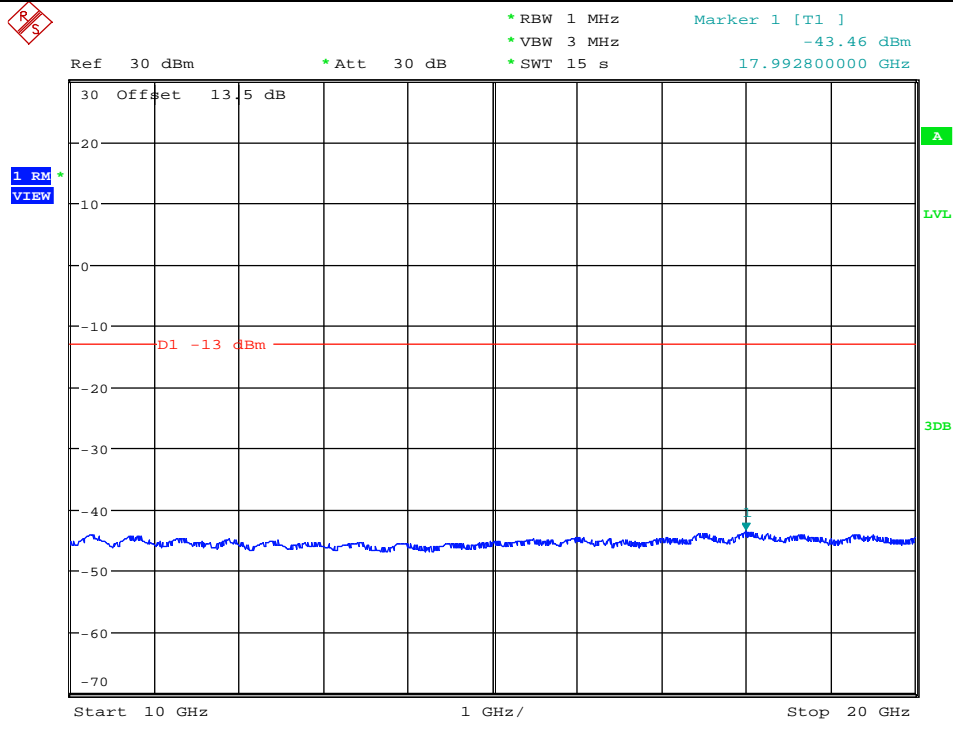


Date: 17.NOV.2022 08:46:27

Band 2 CSE 15MHz-L-16QAM-1RB0-30MHz-10GHz

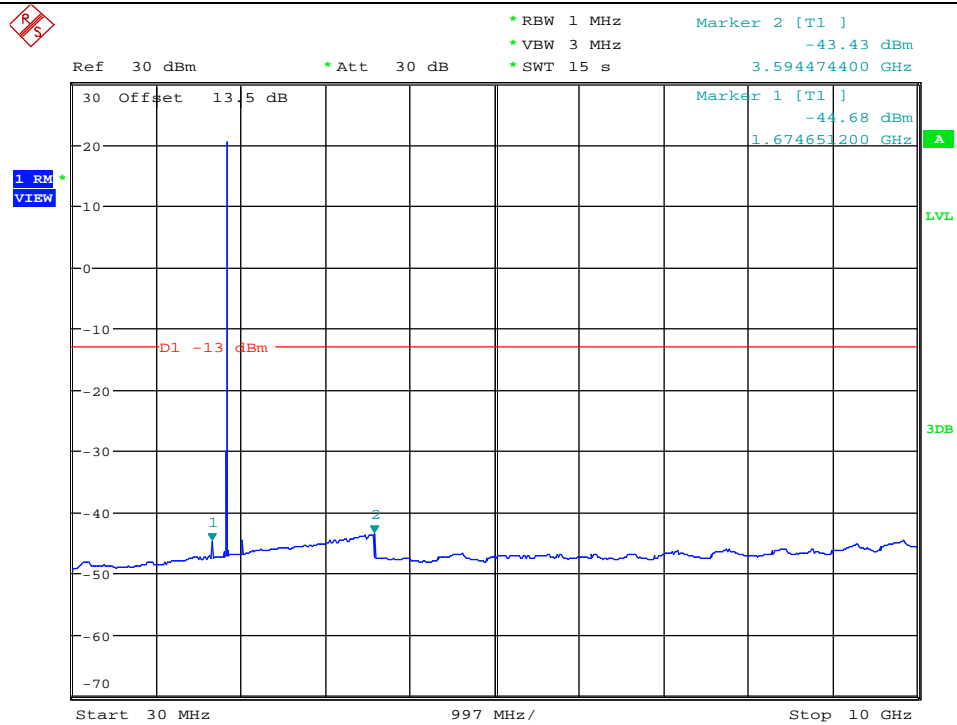


Date: 17.NOV.2022 09:07:36

Band 2 CSE 15MHz-L-16QAM-1RB0-10GHz-20GHz

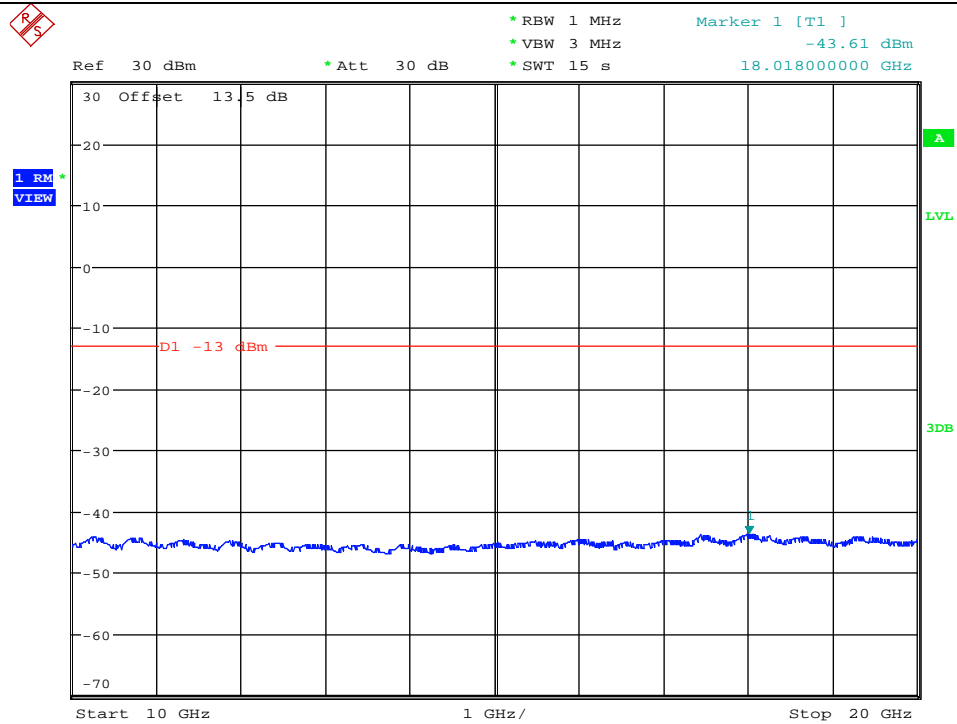


Date: 17.NOV.2022 09:08:03


Band 2 CSE 15MHz-M-QPSK-1RB0-30MHz-10GHz

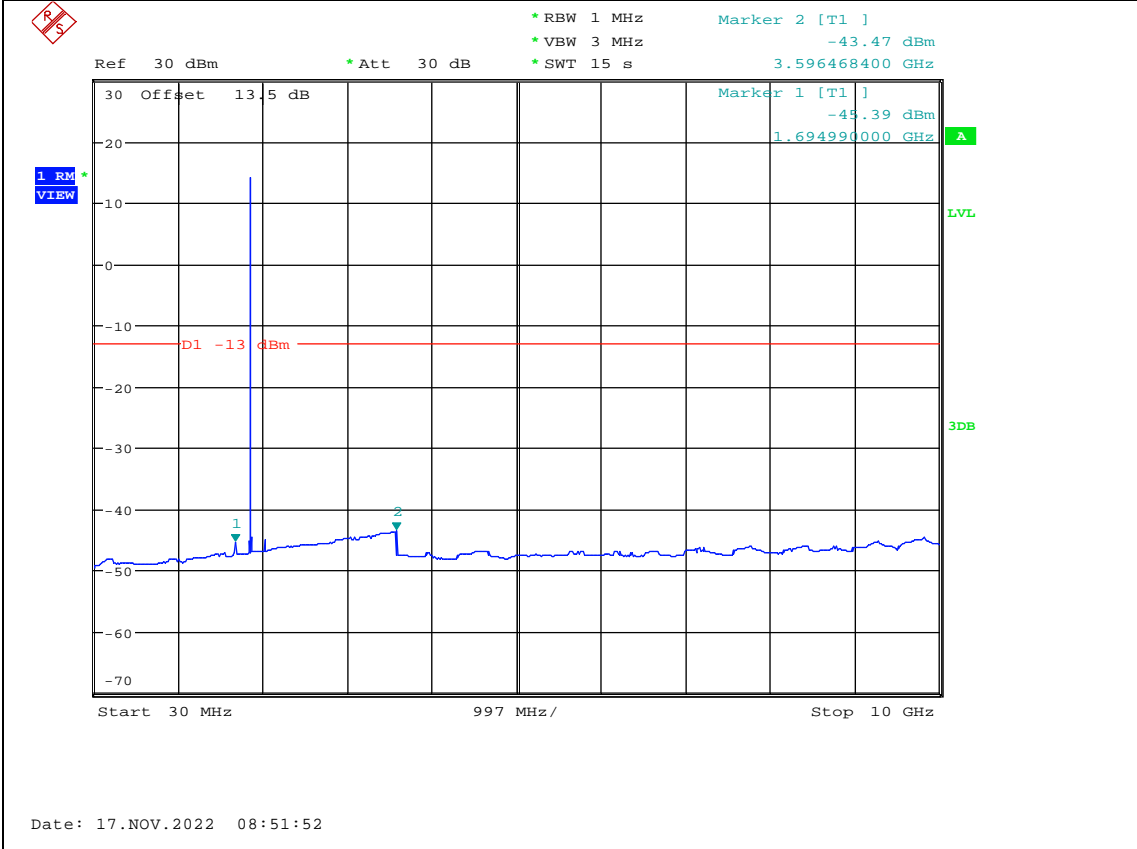

Band 2 CSE 15MHz-M-QPSK-1RB0-10GHz-20GHz

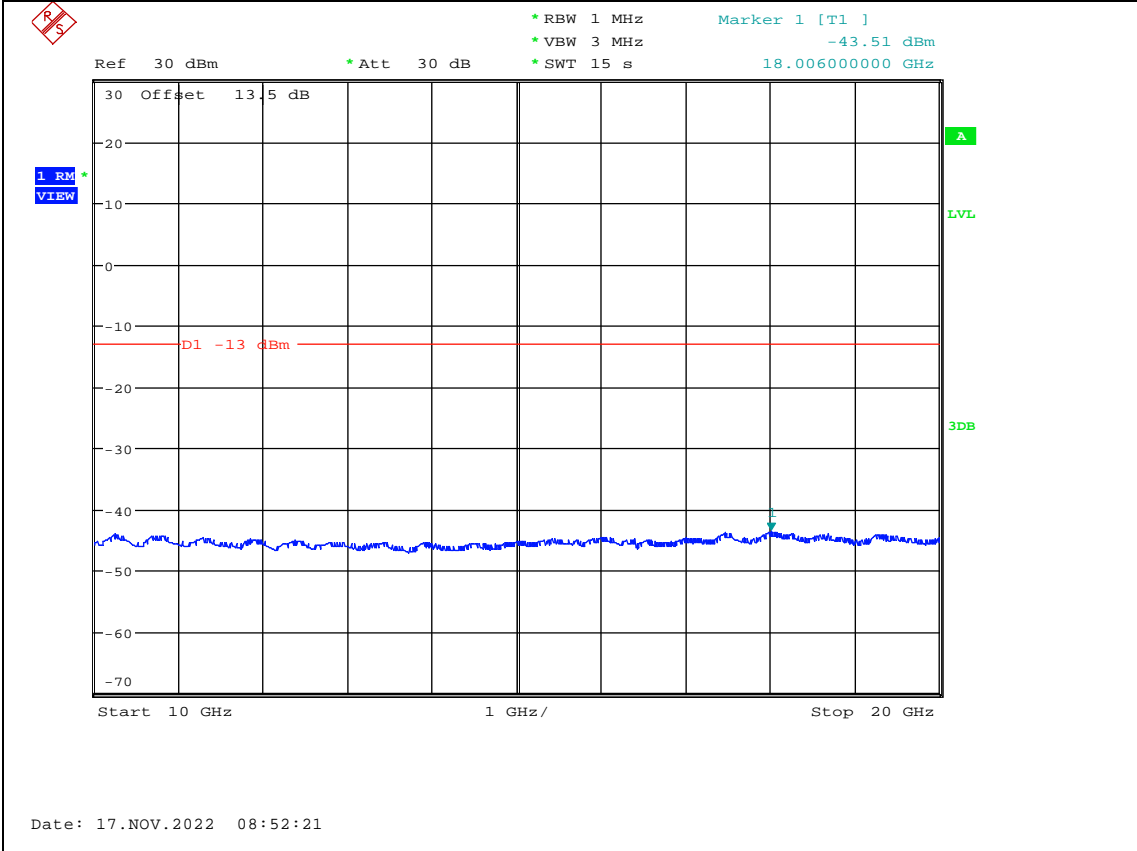


Band 2 CSE 15MHz-M-16QAM-1RB0-30MHz-10GHz

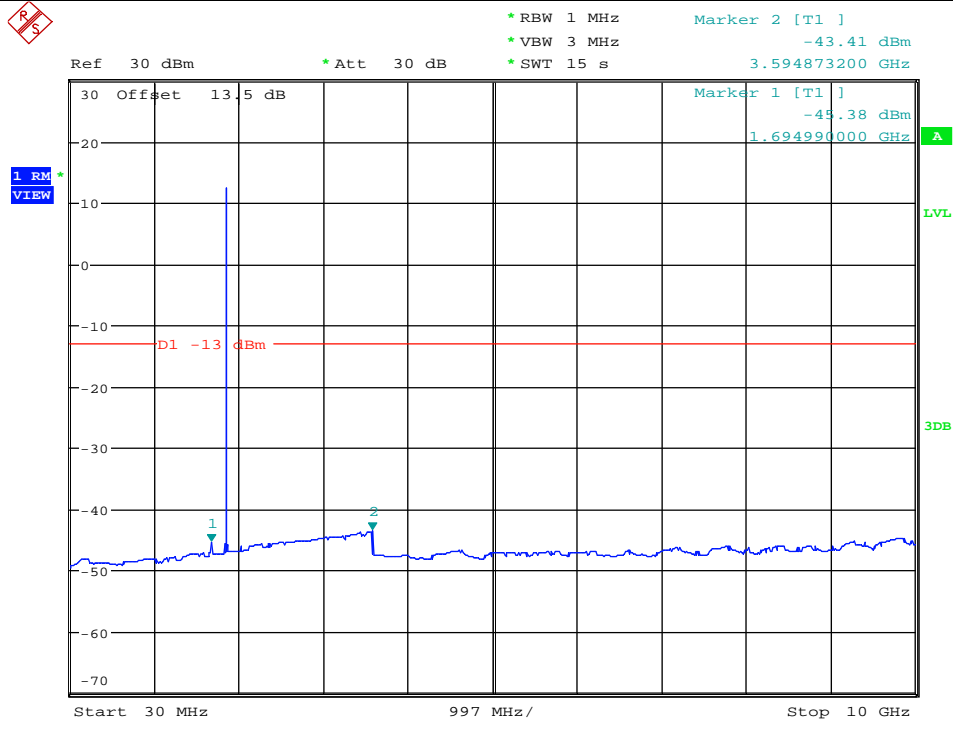


Date: 17.NOV.2022 09:13:20

Band 2 CSE 15MHz-M-16QAM-1RB0-10GHz-20GHz

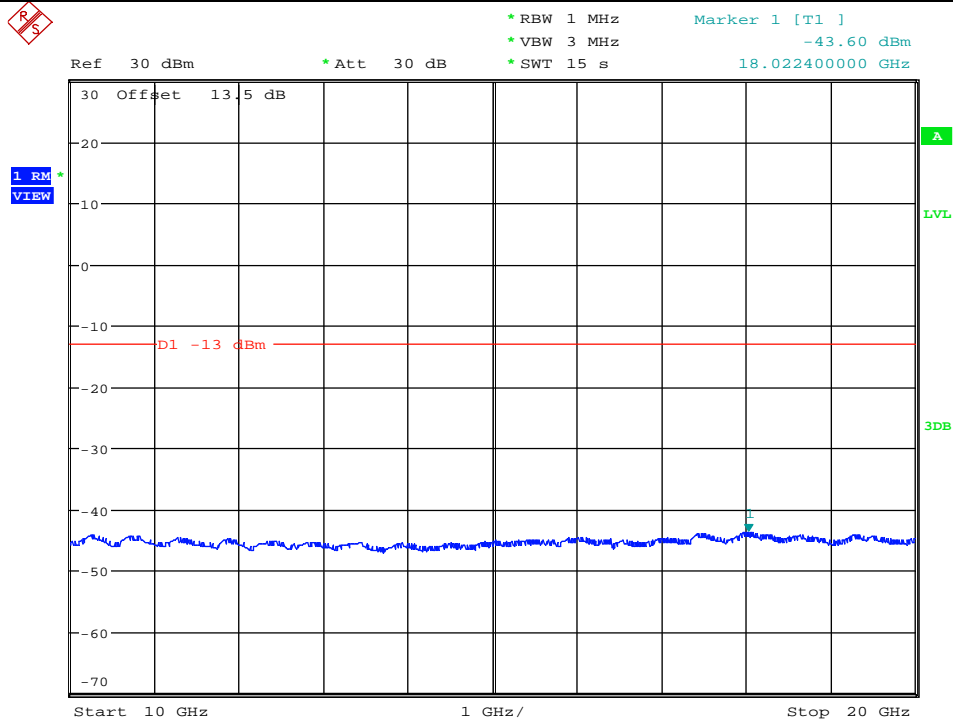


Date: 17.NOV.2022 09:13:48

Band 2 CSE 15MHz-H-QPSK-1RB0-30MHz-10GHz

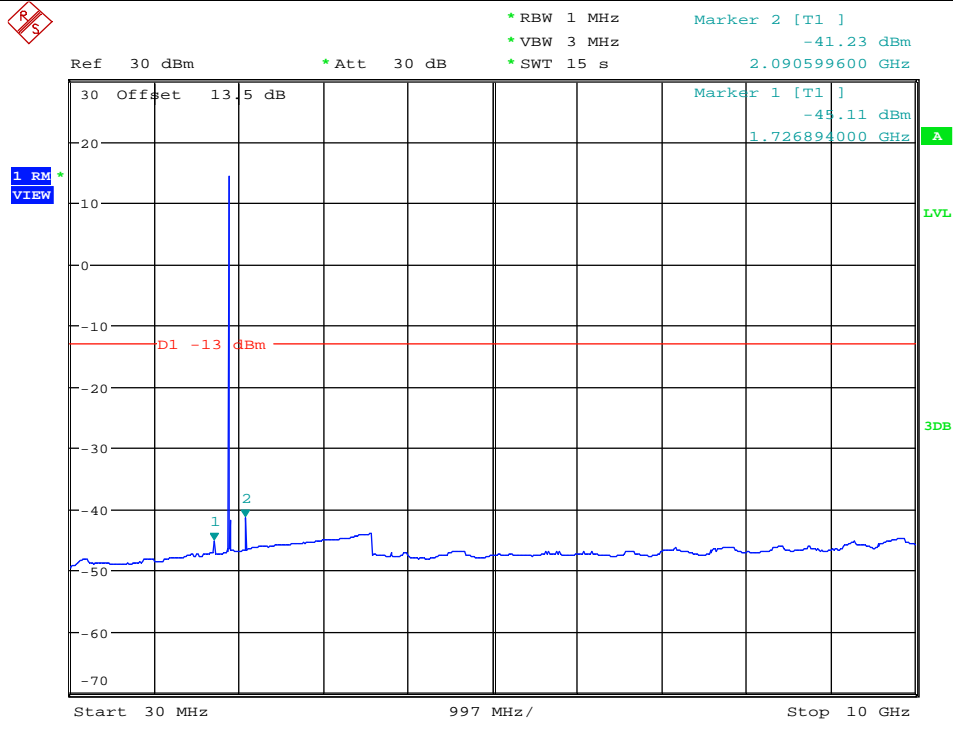


Date: 17.NOV.2022 08:59:56

Band 2 CSE 15MHz-H-QPSK-1RB0-10GHz-20GHz

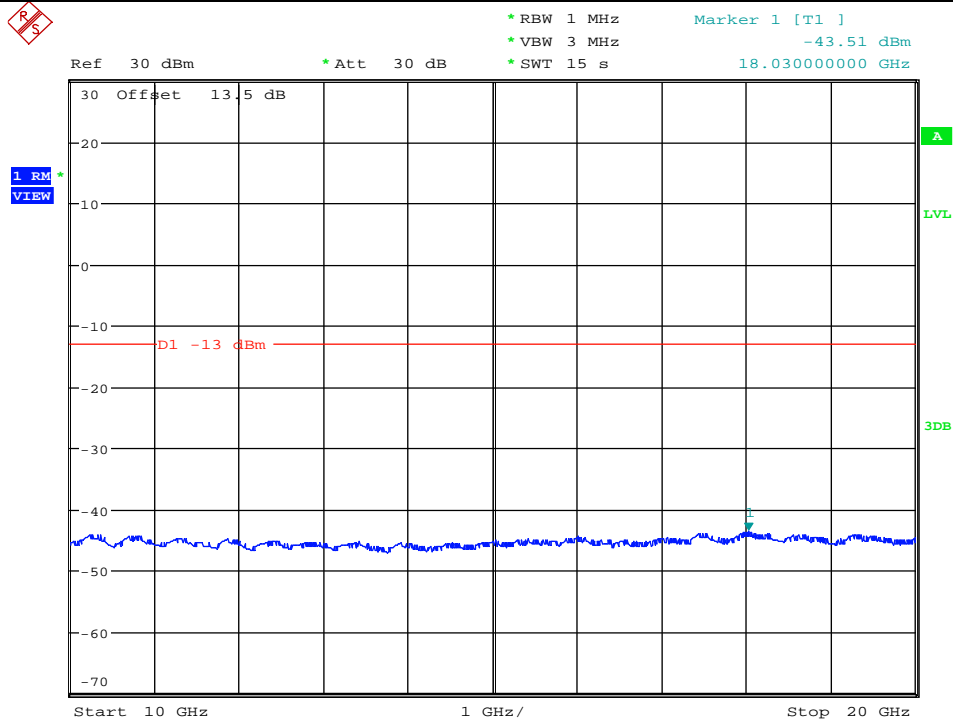


Date: 17.NOV.2022 09:00:24

Band 2 CSE 15MHz-H-16QAM-1RB0-30MHz-10GHz

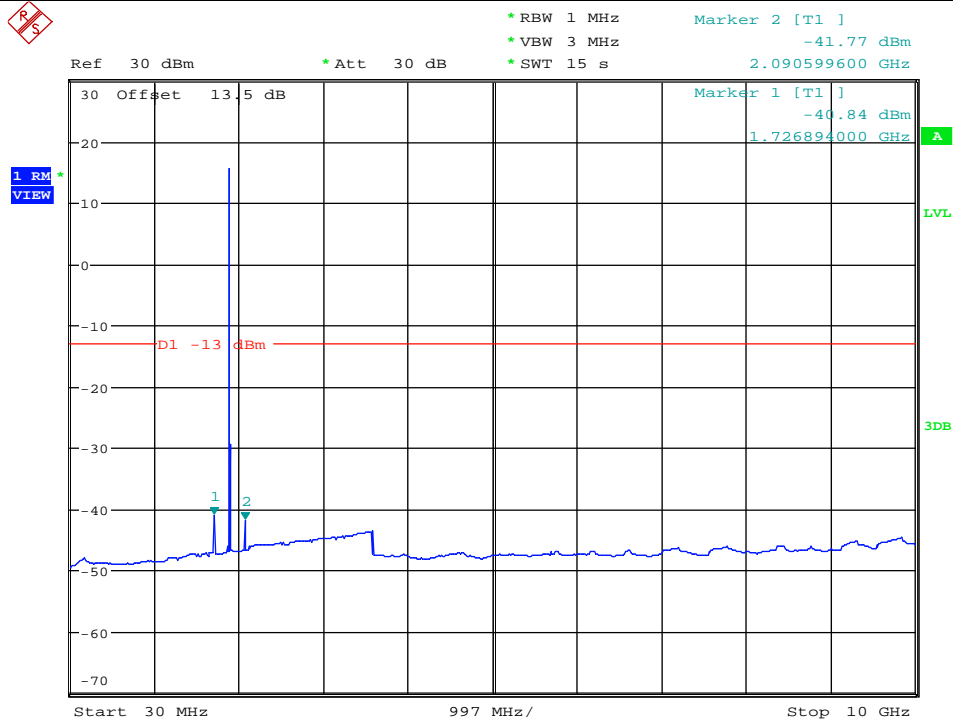


Date: 17.NOV.2022 09:26:15

Band 2 CSE 15MHz-H-16QAM-1RB0-10GHz-20GHz

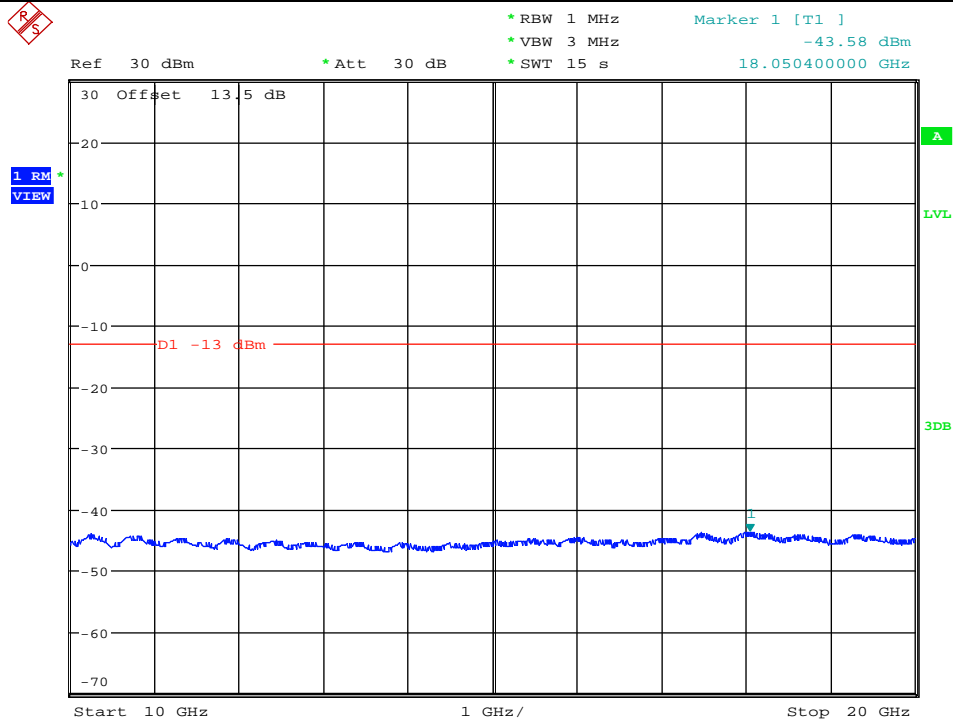


Date: 17.NOV.2022 09:26:42

Band 2 CSE 20MHz-L-QPSK-1RB0-30MHz-10GHz

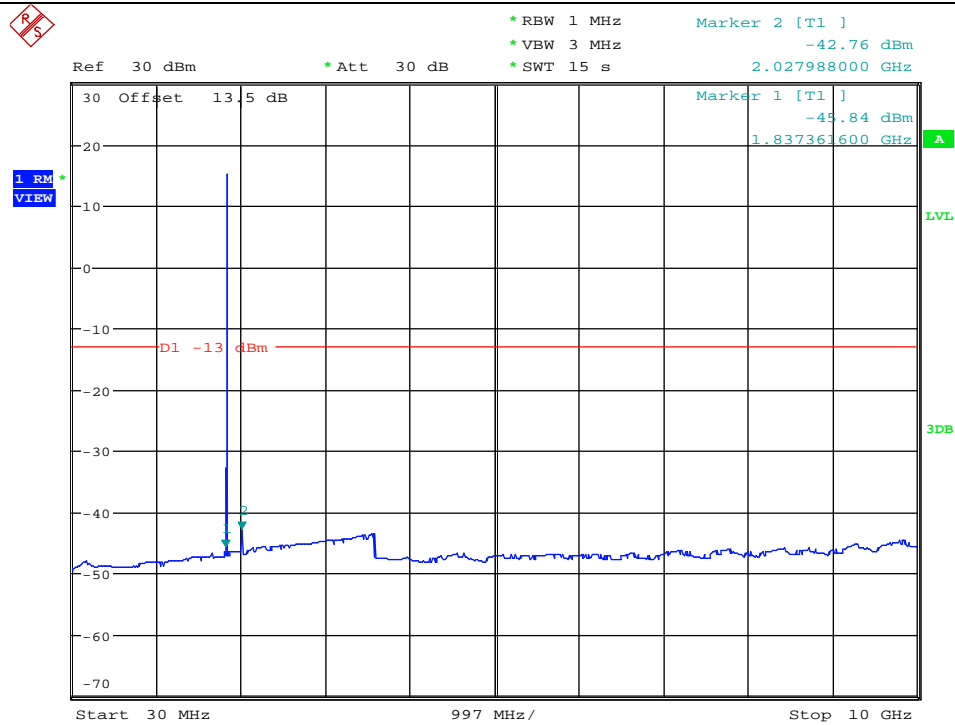


Date: 17.NOV.2022 10:13:04

Band 2 CSE 20MHz-L-QPSK-1RB0-10GHz-20GHz

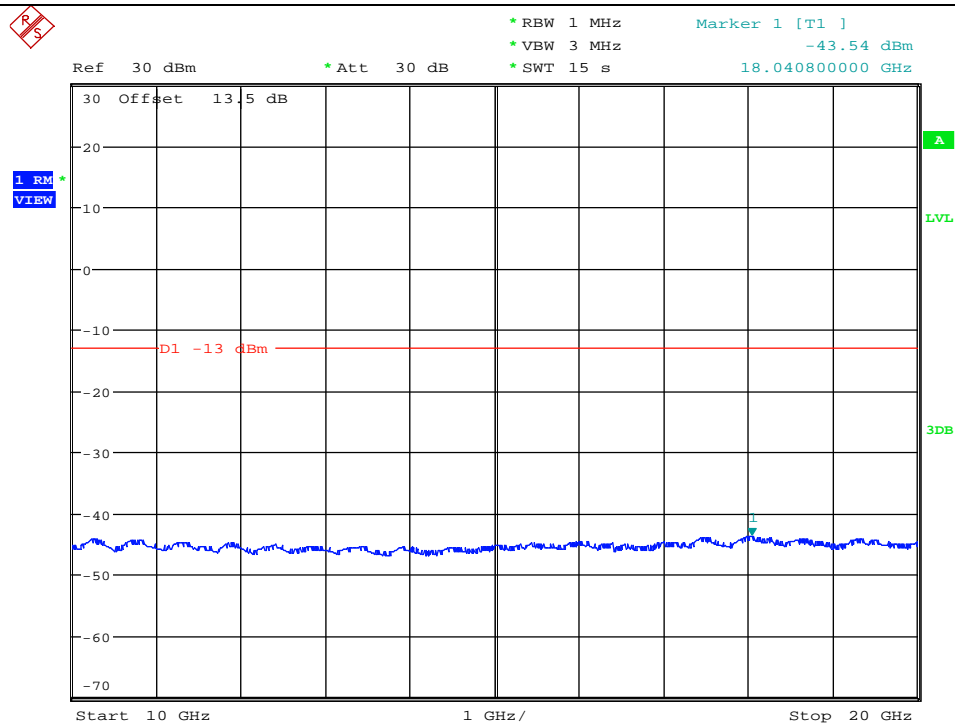


Date: 17.NOV.2022 10:13:33

Band 2 CSE 20MHz-L-16QAM-1RB0-30MHz-10GHz

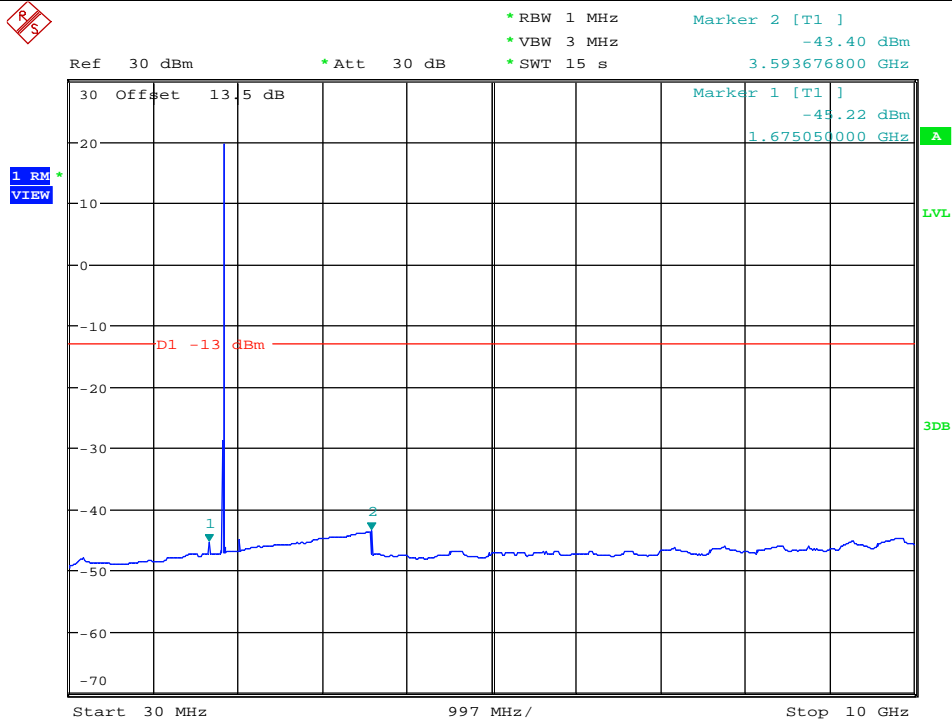


Date: 17.NOV.2022 10:33:51

Band 2 CSE 20MHz-L-16QAM-1RB0-10GHz-20GHz

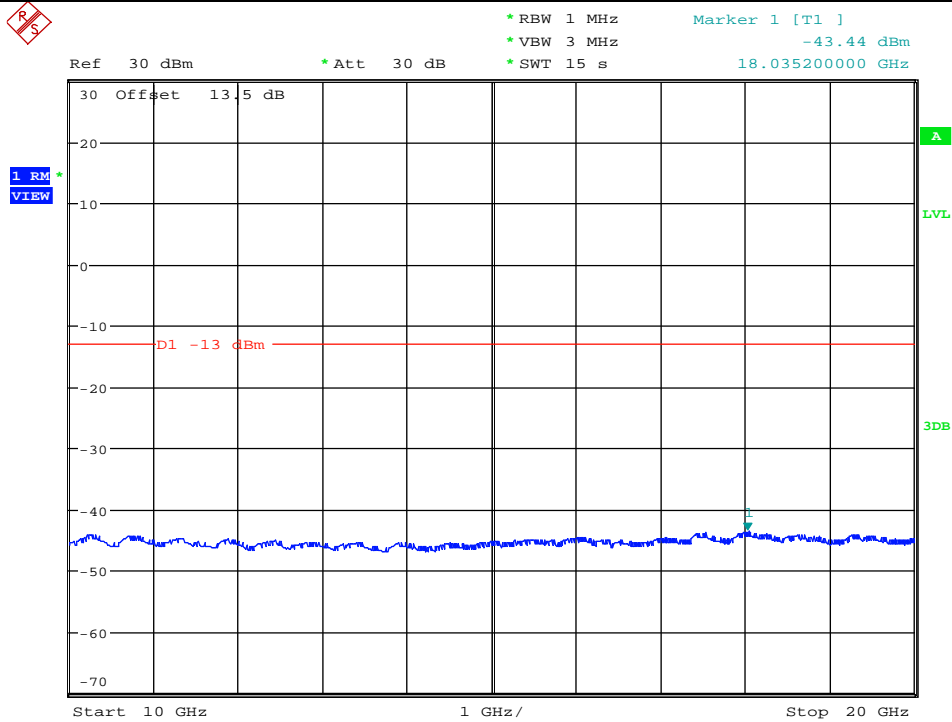


Date: 17.NOV.2022 10:34:20

Band 2 CSE 20MHz-M-QPSK-1RB0-30MHz-10GHz


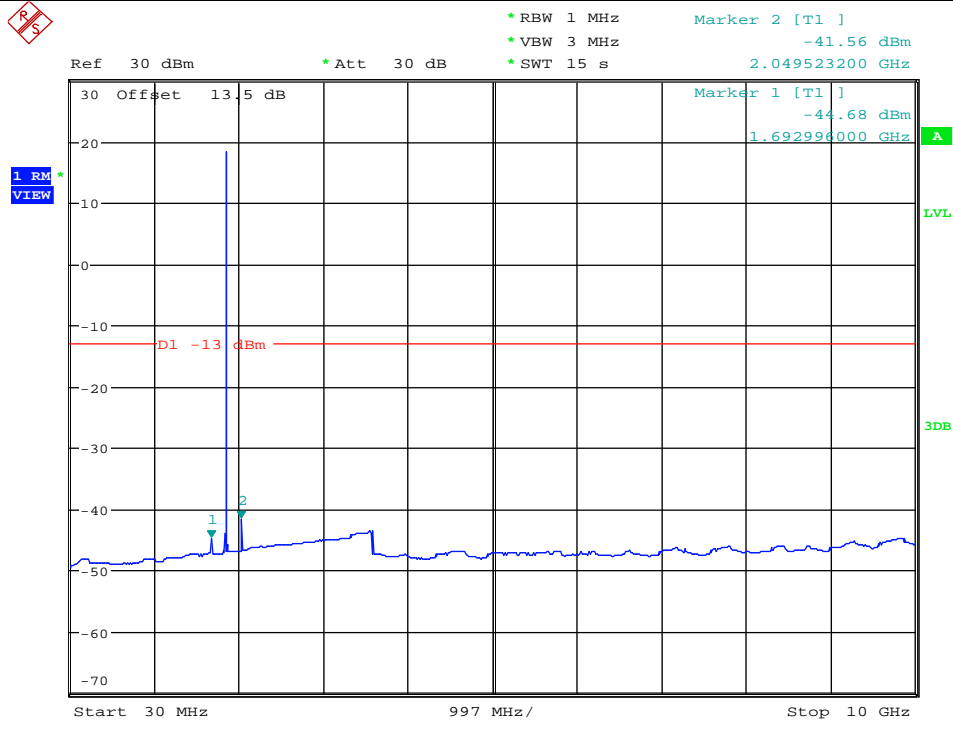


Date: 17.NOV.2022 10:19:47


Band 2 CSE 20MHz-M-QPSK-1RB0-10GHz-20GHz

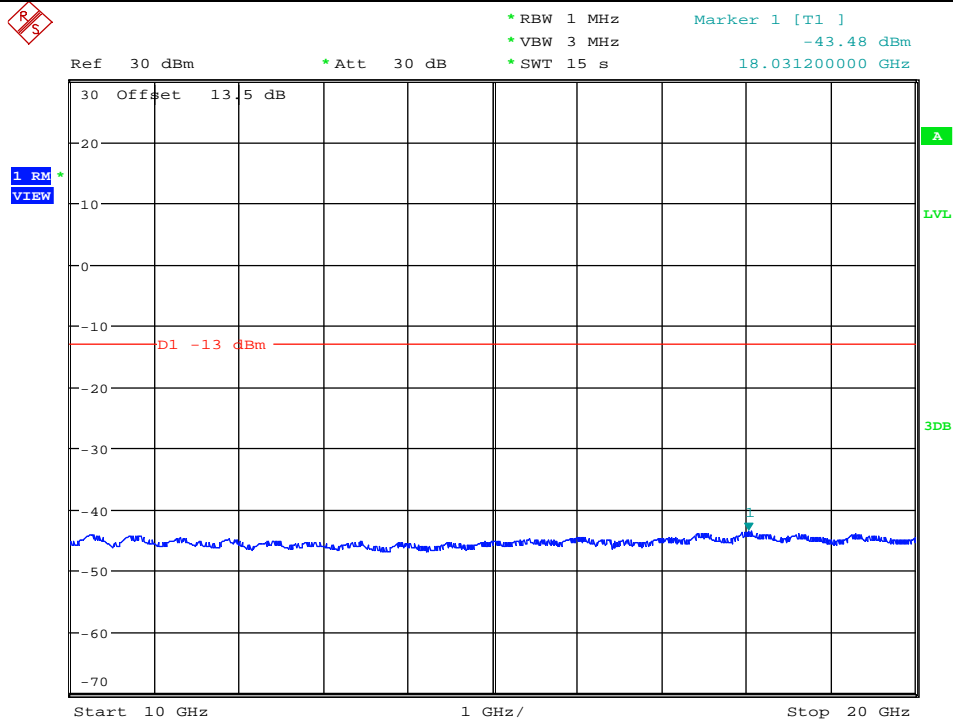

Date: 17.NOV.2022 10:20:14

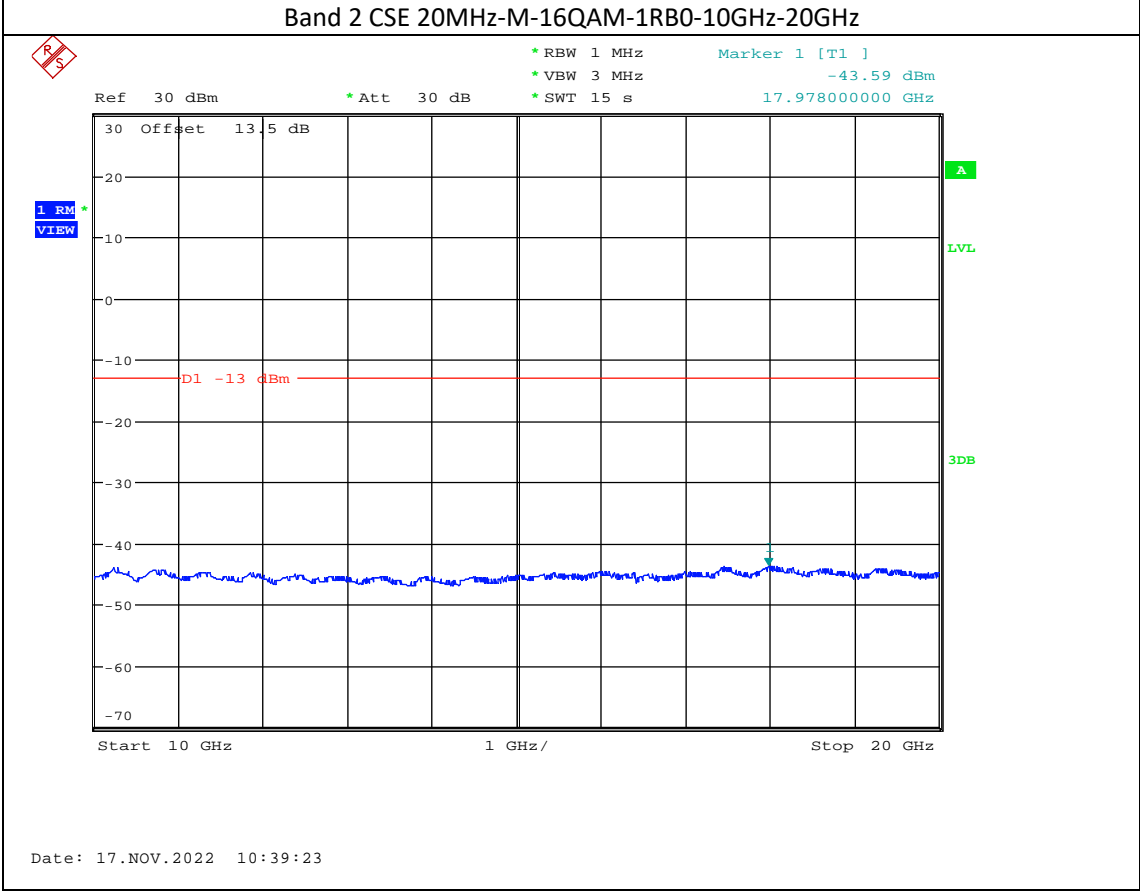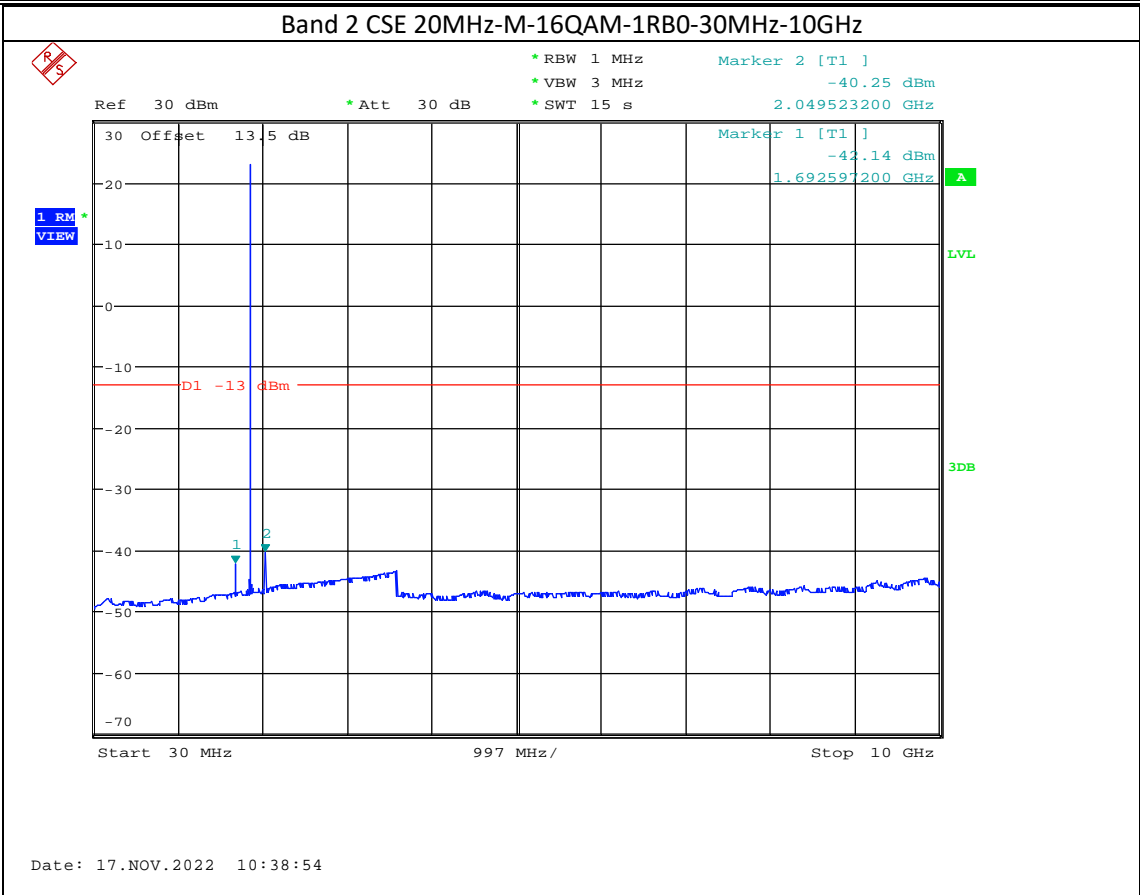


Band 2 CSE 20MHz-H-QPSK-1RB0-30MHz-10GHz

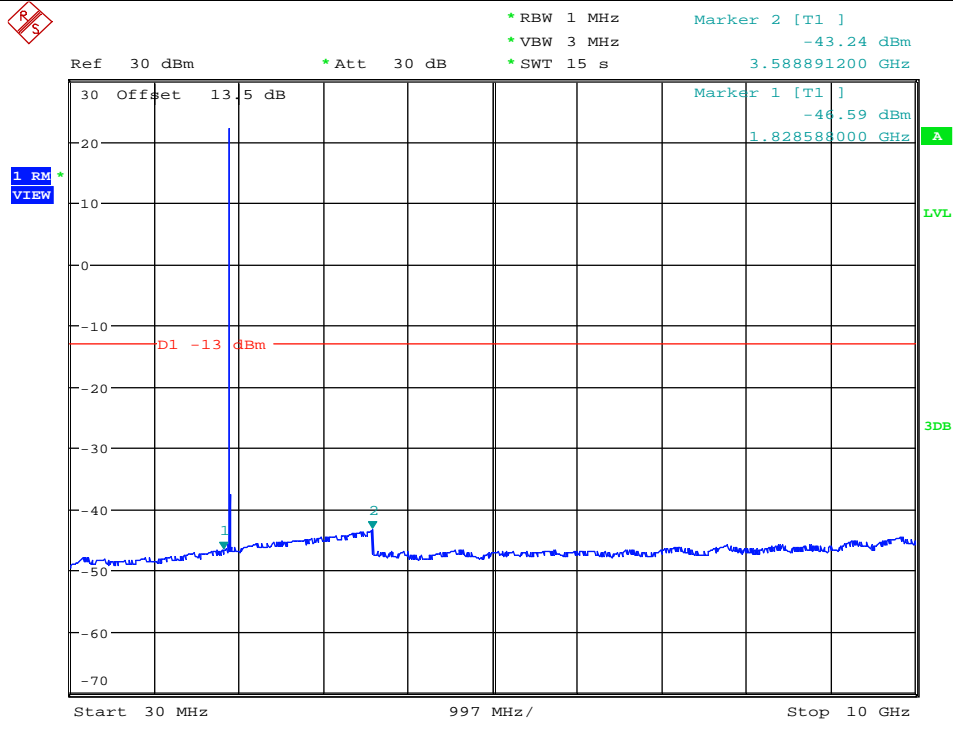


Date: 17.NOV.2022 10:25:38

Band 2 CSE 20MHz-H-QPSK-1RB0-10GHz-20GHz

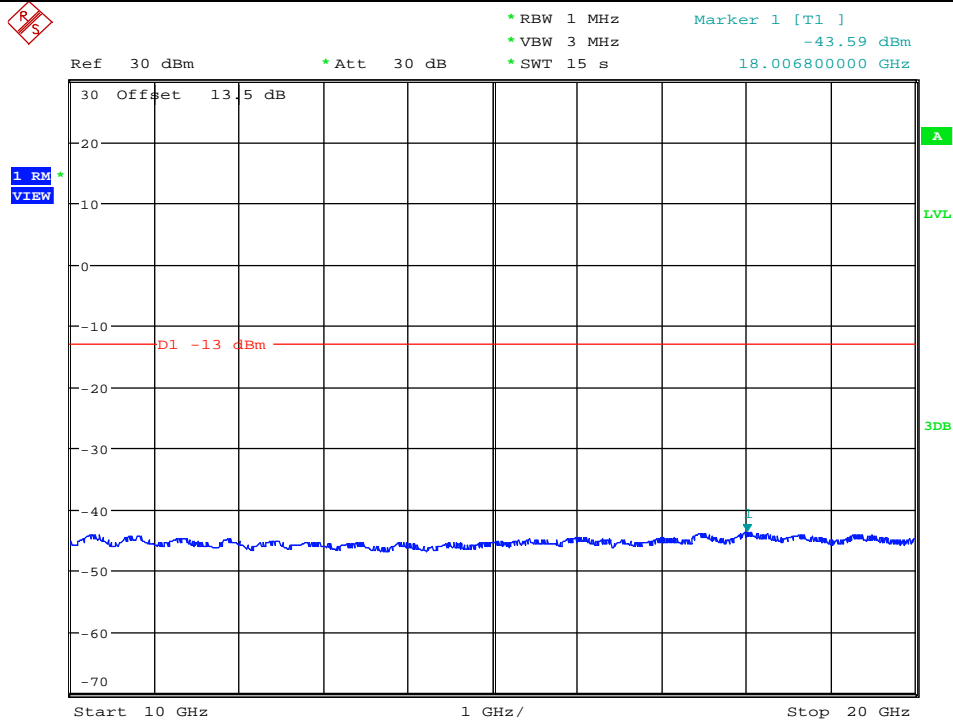


Date: 17.NOV.2022 10:26:07

Band 2 CSE 20MHz-H-16QAM-1RB0-30MHz-10GHz

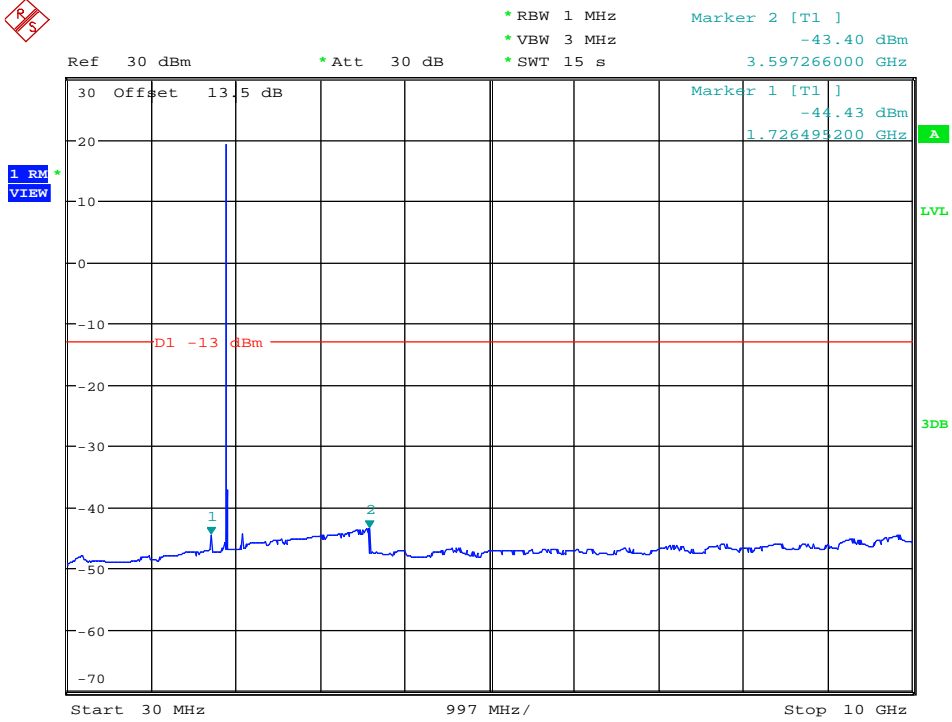


Date: 17.NOV.2022 10:45:36

Band 2 CSE 20MHz-H-16QAM-1RB0-10GHz-20GHz

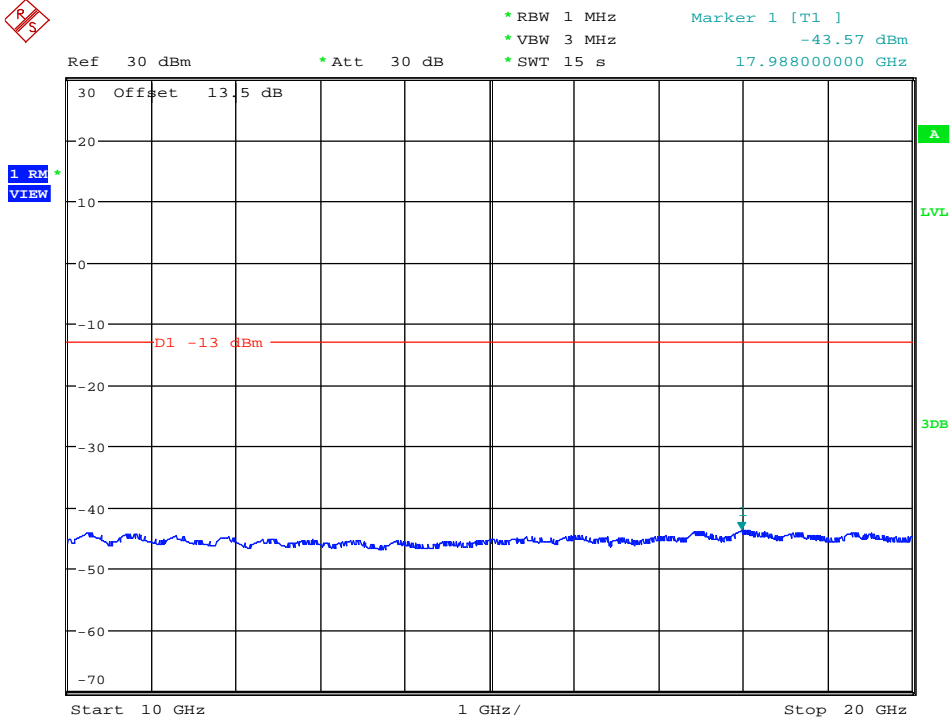


Date: 17.NOV.2022 10:46:04


Band 4 CSE 1.4MHz-L-QPSK-1RB0-30MHz-10GHz

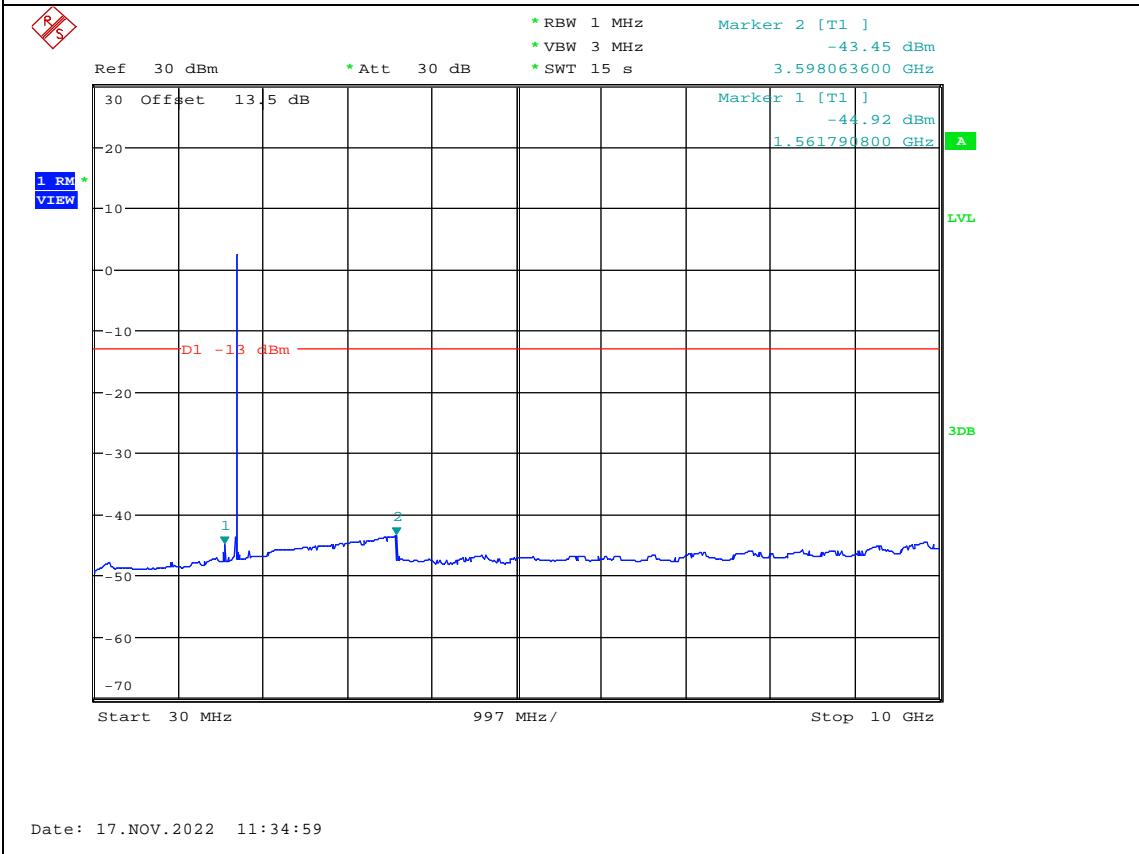

Band 4 CSE 1.4MHz-L-QPSK-1RB0-10GHz-20GHz

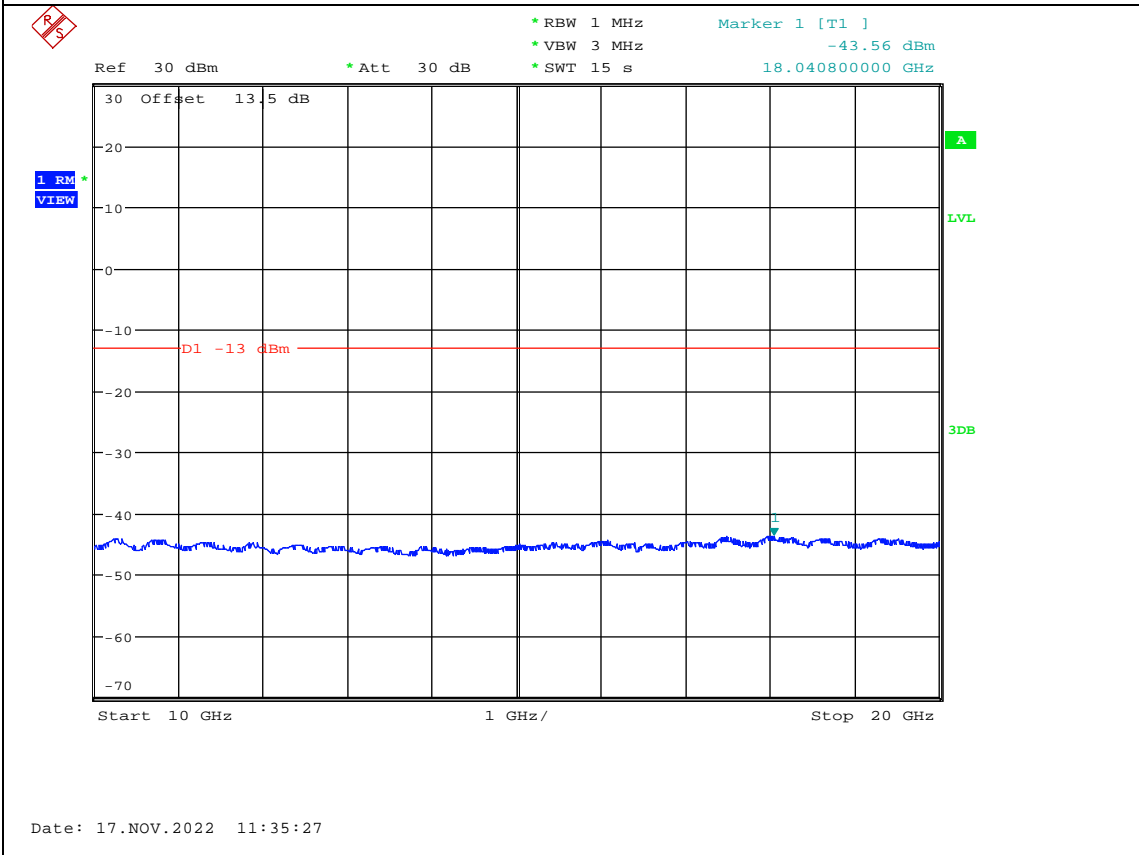


Band 4 CSE 1.4MHz-L-16QAM-1RB0-30MHz-10GHz

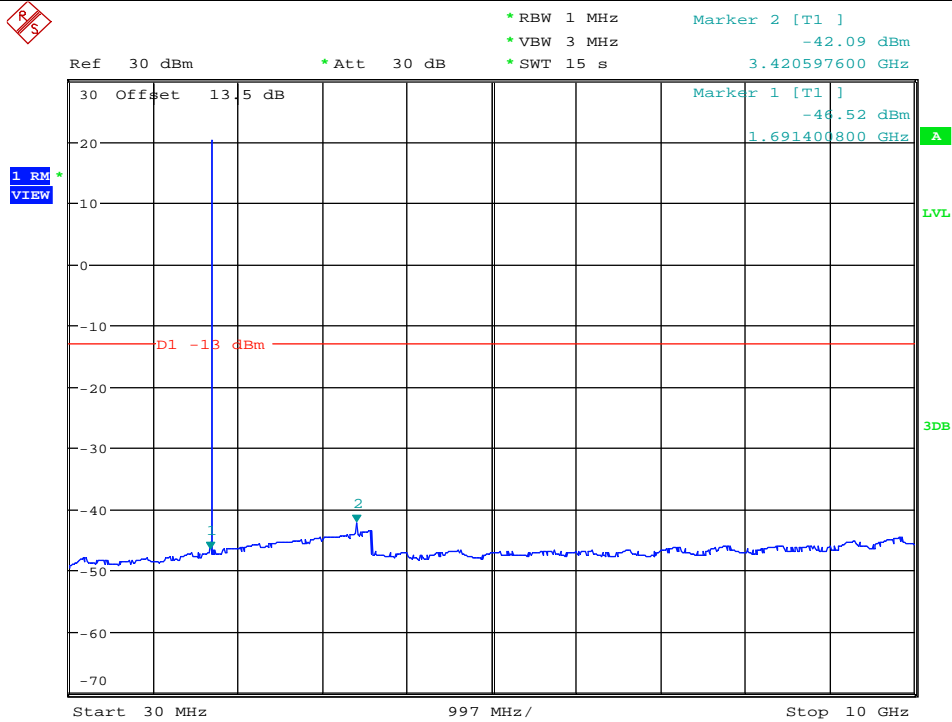


Date: 17.NOV.2022 11:56:25

Band 4 CSE 1.4MHz-L-16QAM-1RB0-10GHz-20GHz

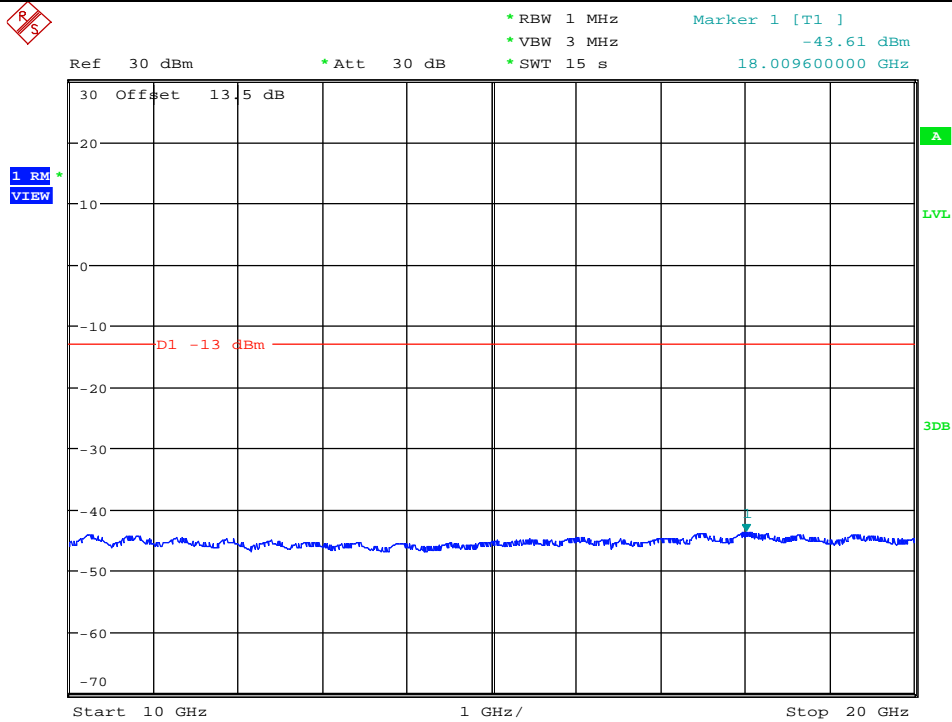


Date: 17.NOV.2022 11:56:53

Band 4 CSE 1.4MHz-M-QPSK-1RB0-30MHz-10GHz

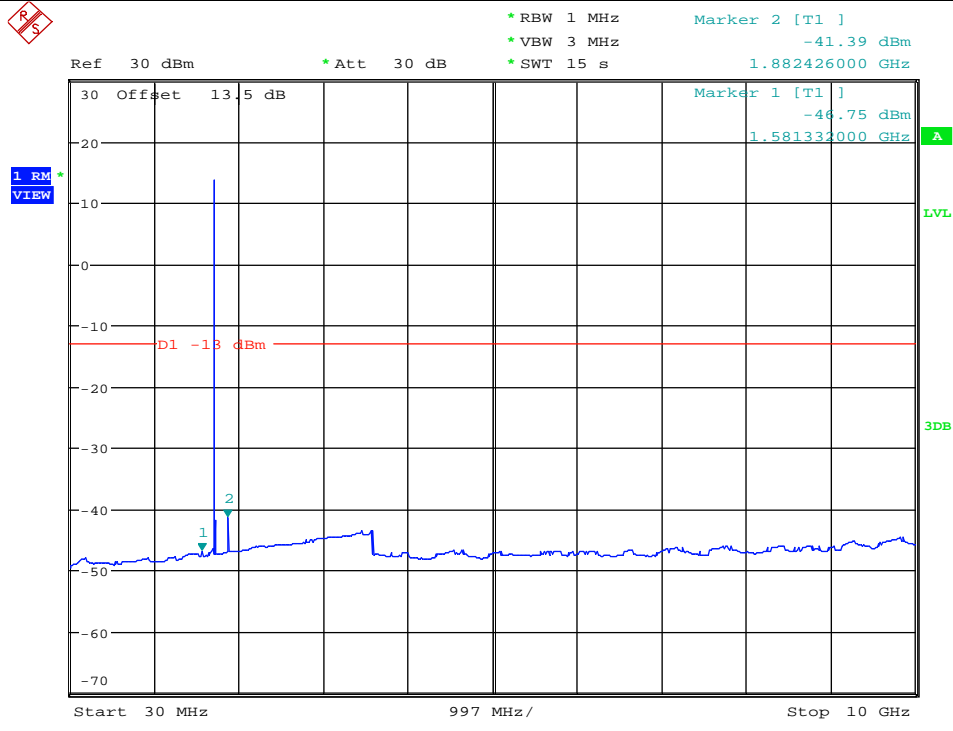


Date: 17.NOV.2022 11:40:32

Band 4 CSE 1.4MHz-M-QPSK-1RB0-10GHz-20GHz

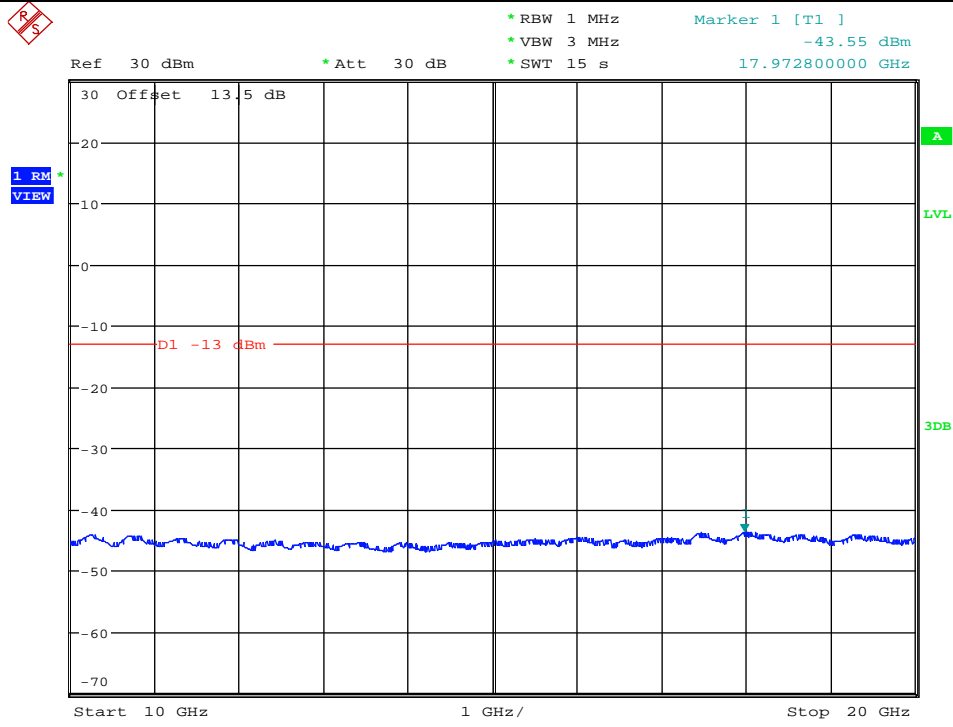


Date: 17.NOV.2022 11:40:59

Band 4 CSE 1.4MHz-M-16QAM-1RB0-30MHz-10GHz

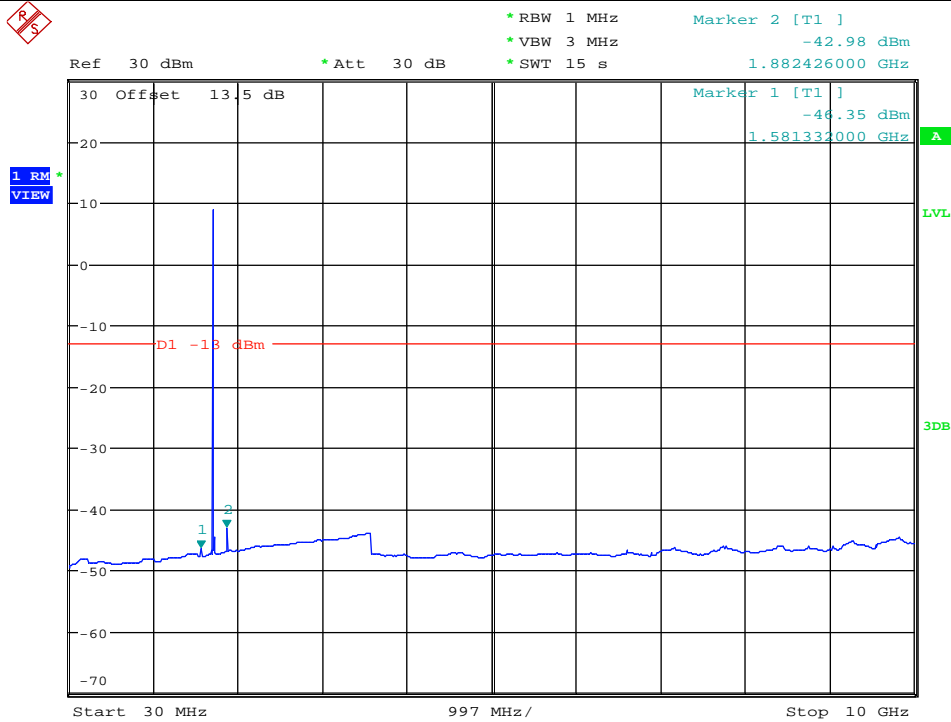


Date: 17.NOV.2022 12:02:28

Band 4 CSE 1.4MHz-M-16QAM-1RB0-10GHz-20GHz

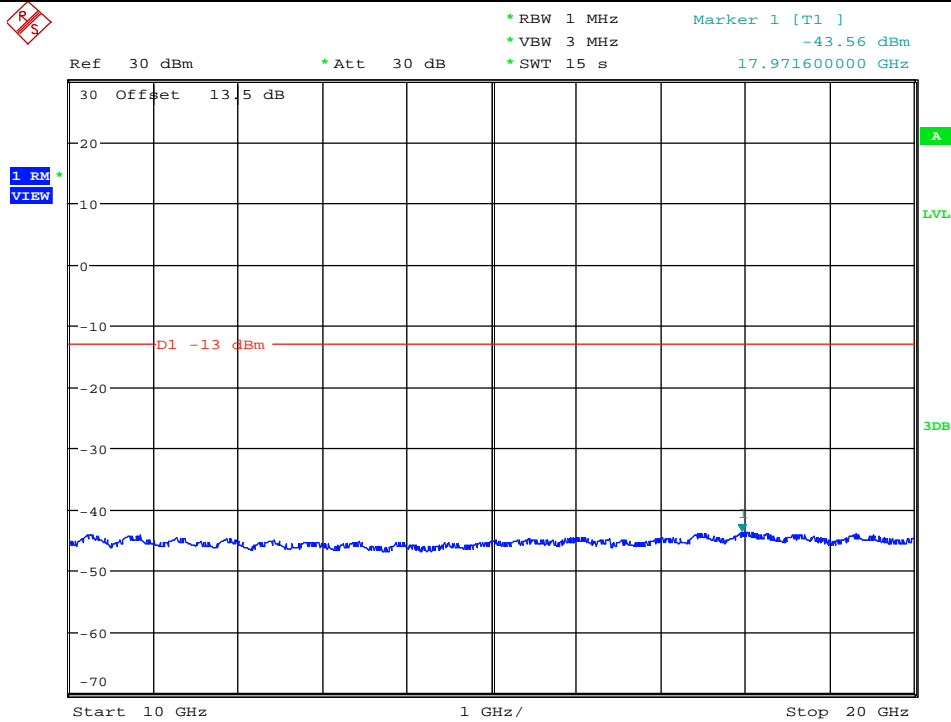


Date: 17.NOV.2022 12:02:58

Band 4 CSE 1.4MHz-H-QPSK-1RB0-30MHz-10GHz

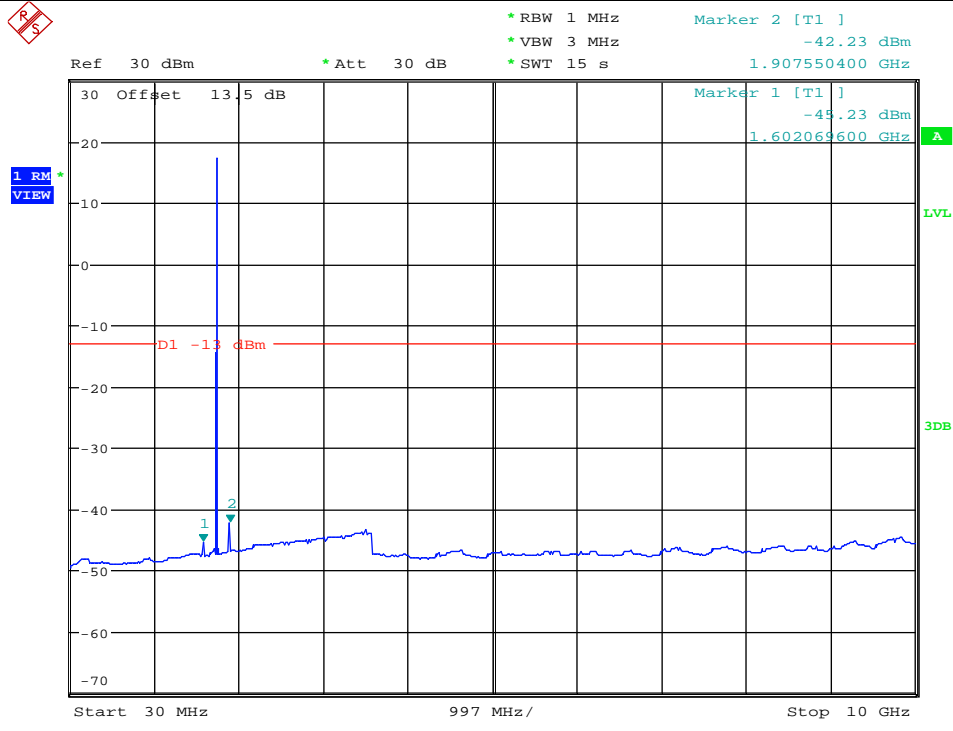


Date: 17.NOV.2022 13:46:24

Band 4 CSE 1.4MHz-H-QPSK-1RB0-10GHz-20GHz

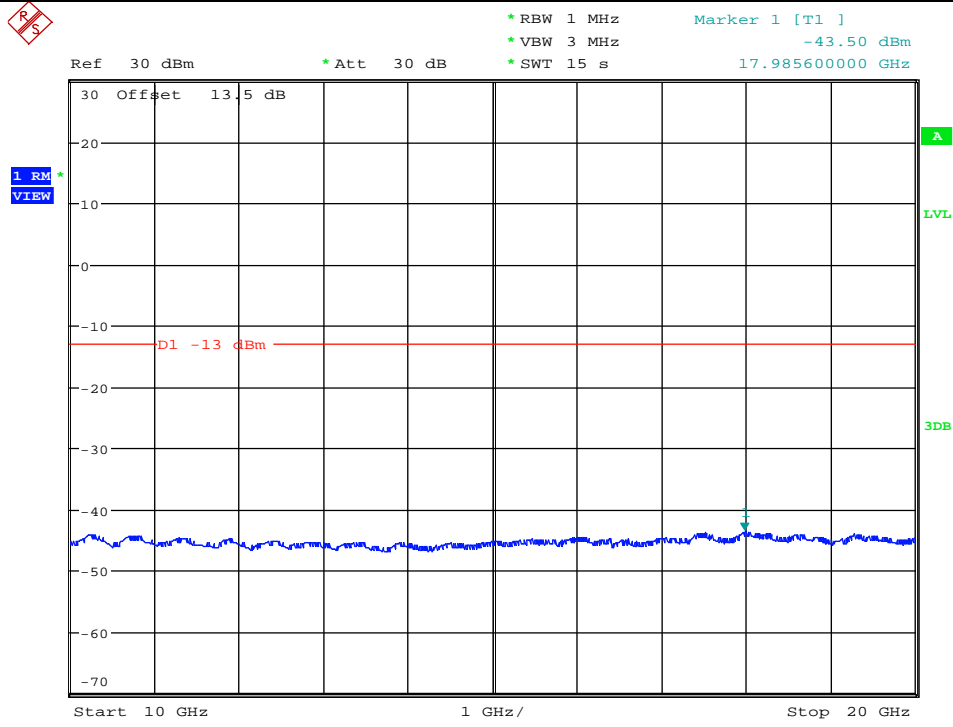


Date: 17.NOV.2022 13:46:53

Band 4 CSE 1.4MHz-H-16QAM-1RB0-30MHz-10GHz

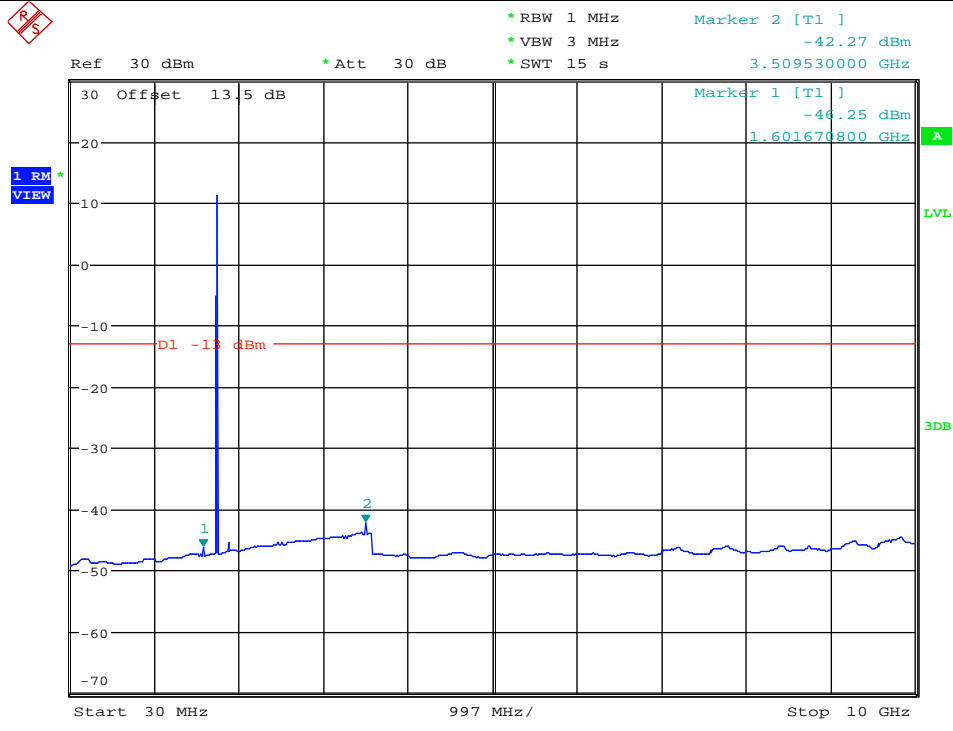


Date: 17.NOV.2022 14:02:04

Band 4 CSE 1.4MHz-H-16QAM-1RB0-10GHz-20GHz

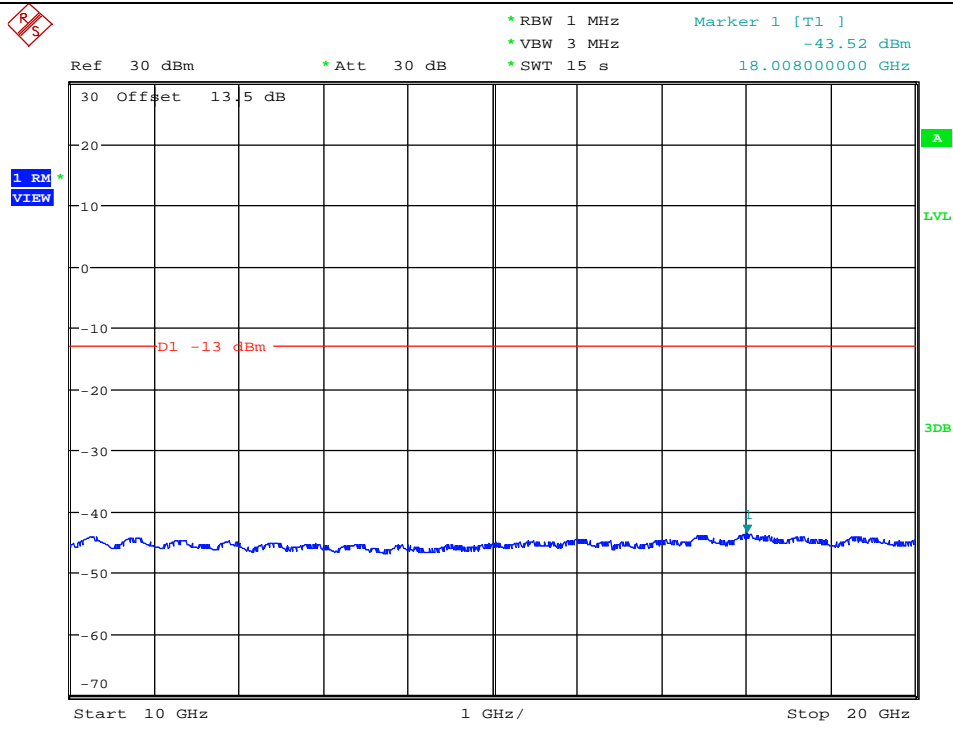


Date: 17.NOV.2022 14:02:33

Band 4 CSE 3MHz-L-QPSK-1RB0-30MHz-10GHz

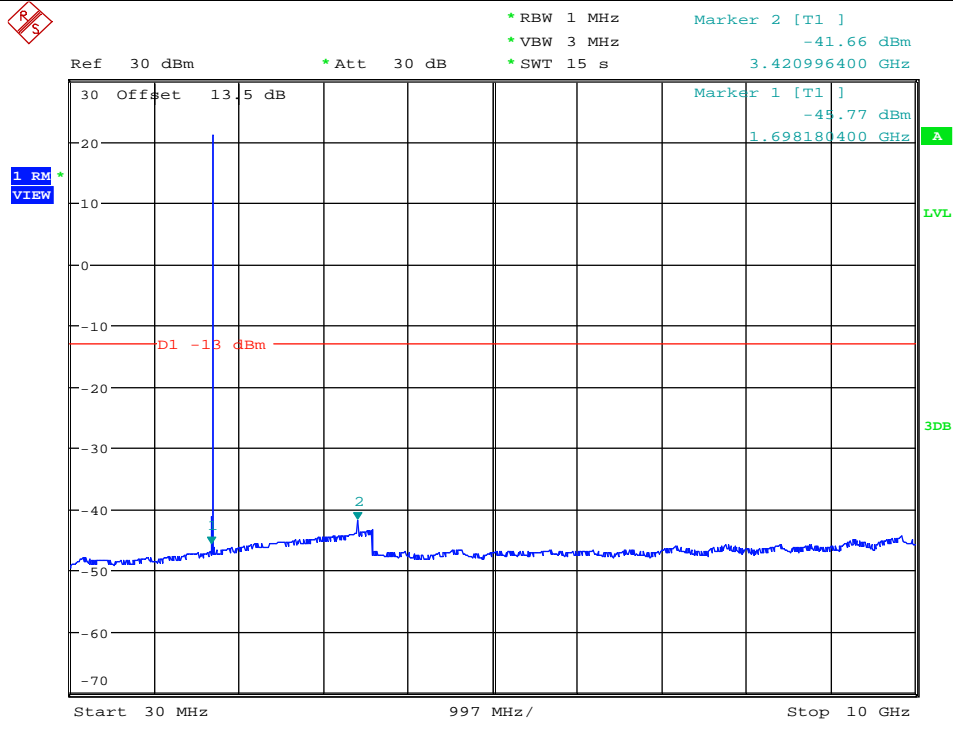


Date: 17.NOV.2022 14:37:57

Band 4 CSE 3MHz-L-QPSK-1RB0-10GHz-20GHz

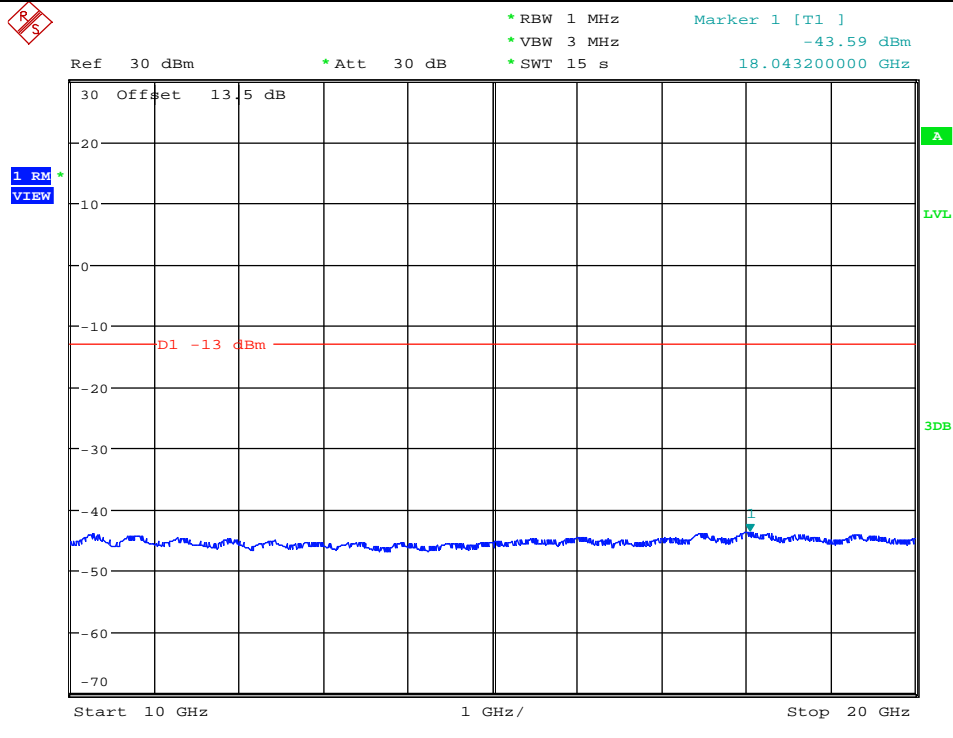


Date: 17.NOV.2022 14:38:26

Band 4 CSE 3MHz-L-16QAM-1RB0-30MHz-10GHz

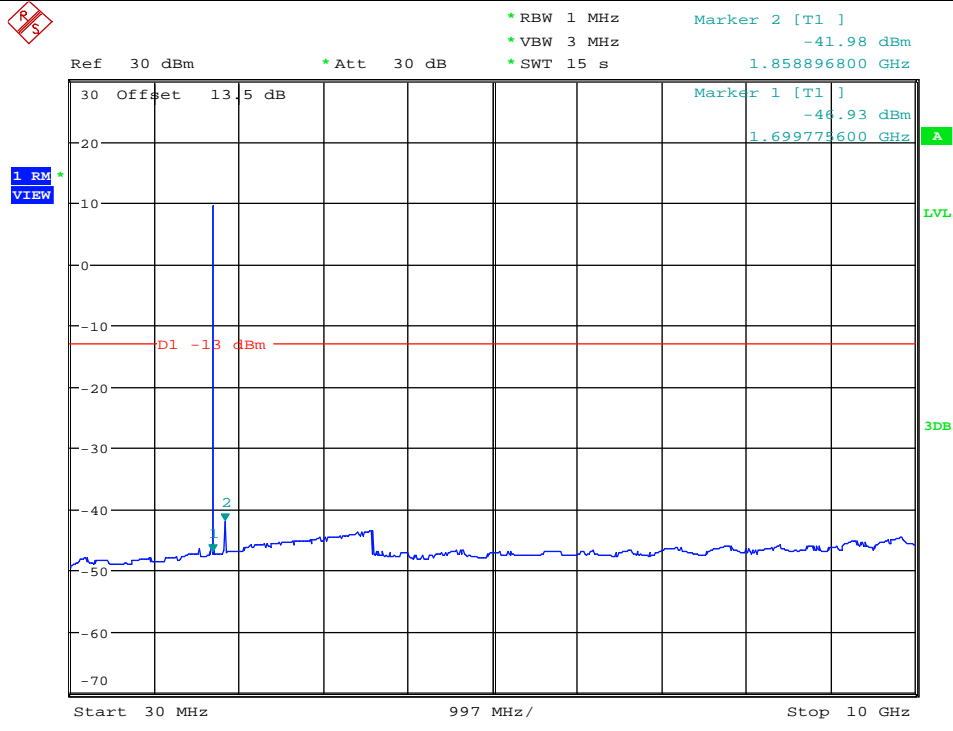


Date: 17.NOV.2022 15:00:35

Band 4 CSE 3MHz-L-16QAM-1RB0-10GHz-20GHz

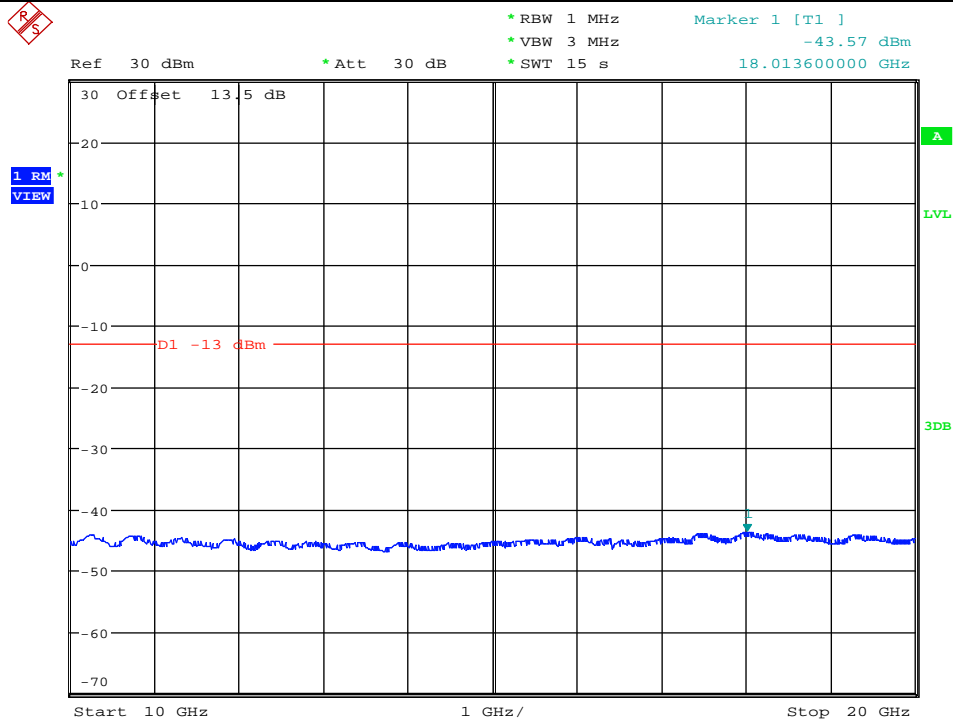


Date: 17.NOV.2022 15:01:02

Band 4 CSE 3MHz-M-QPSK-1RB0-30MHz-10GHz

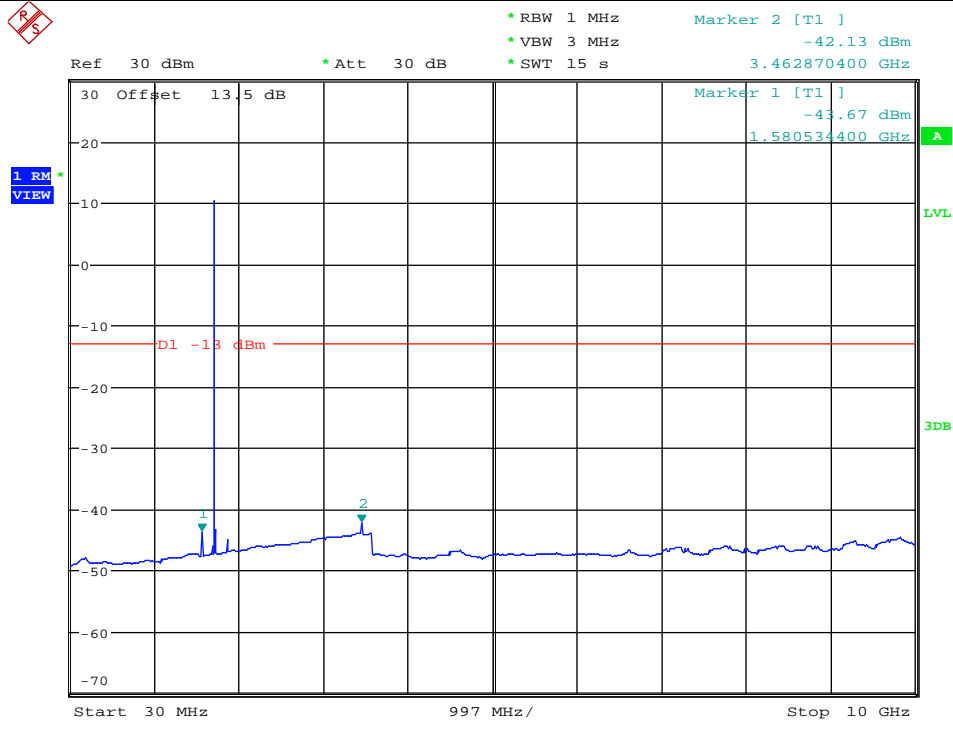


Date: 17.NOV.2022 14:43:32

Band 4 CSE 3MHz-M-QPSK-1RB0-10GHz-20GHz

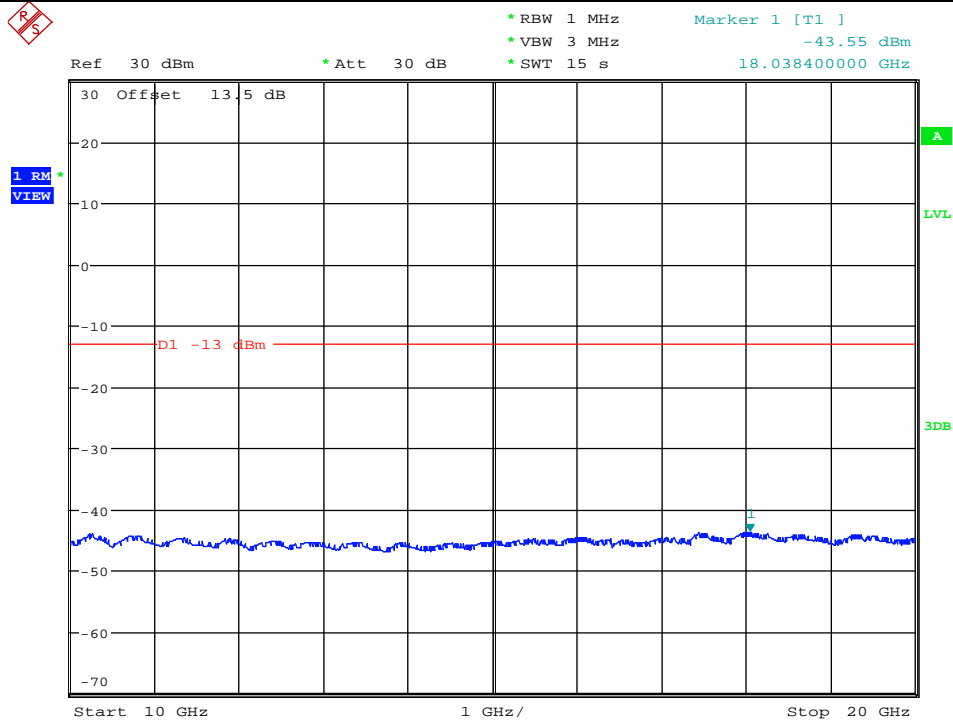


Date: 17.NOV.2022 14:44:00

Band 4 CSE 3MHz-M-16QAM-1RB0-30MHz-10GHz

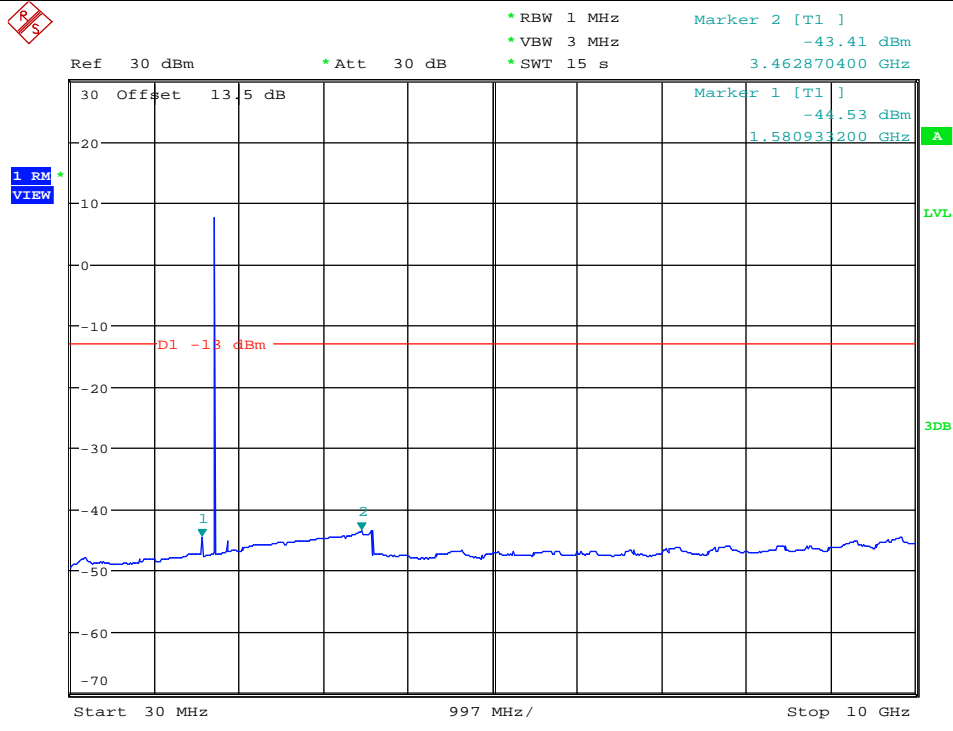


Date: 17.NOV.2022 15:06:10

Band 4 CSE 3MHz-M-16QAM-1RB0-10GHz-20GHz

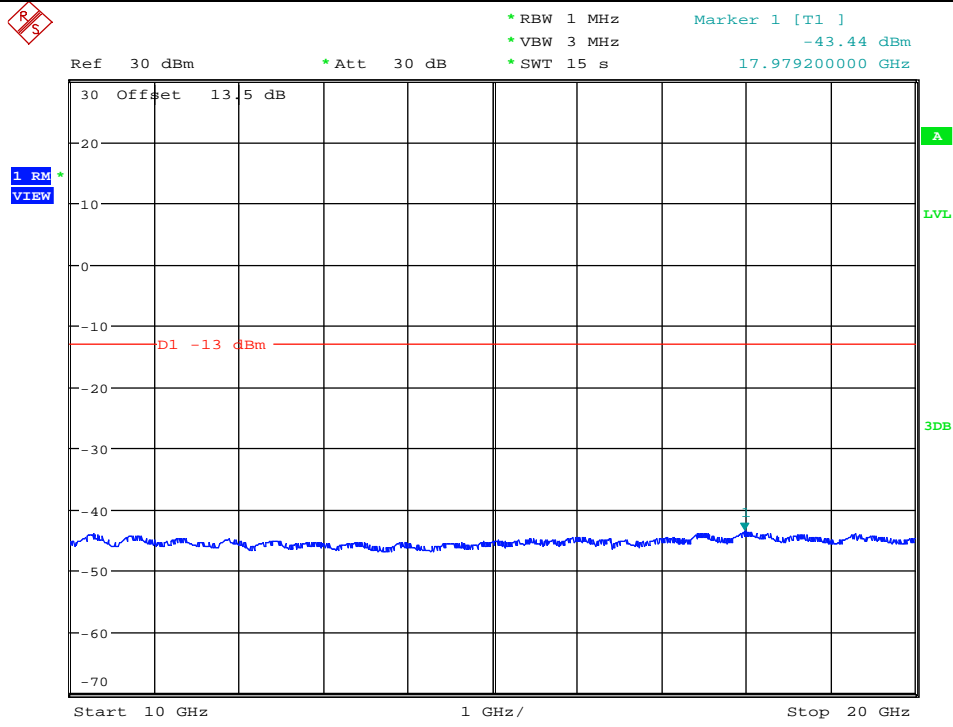


Date: 17.NOV.2022 15:06:38

Band 4 CSE 3MHz-H-QPSK-1RB0-30MHz-10GHz

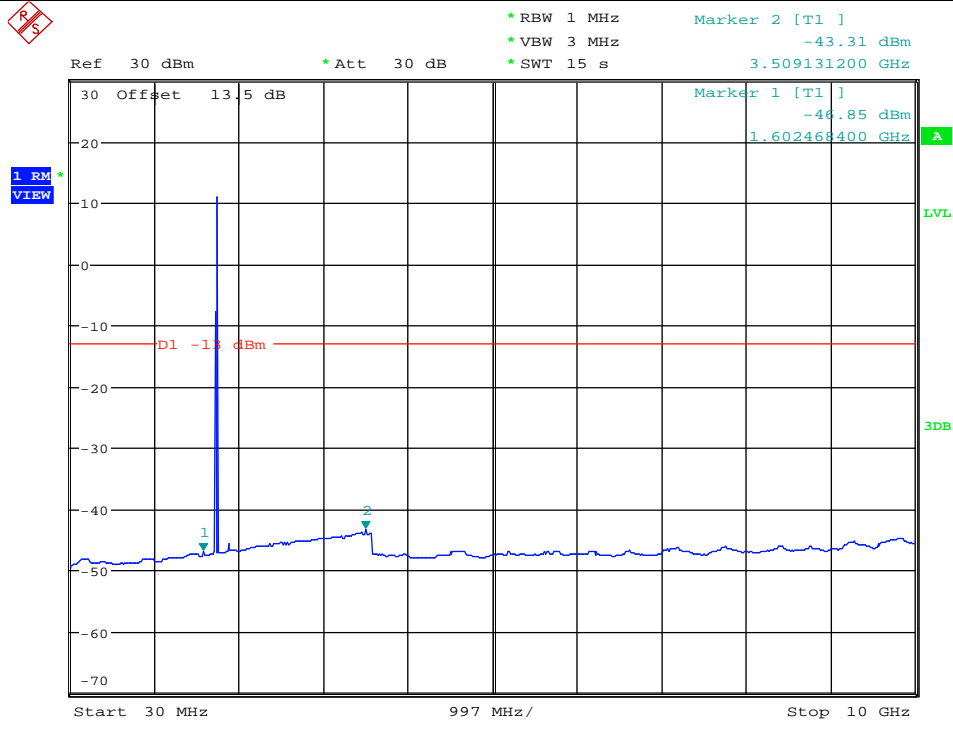


Date: 17.NOV.2022 14:53:04

Band 4 CSE 3MHz-H-QPSK-1RB0-10GHz-20GHz

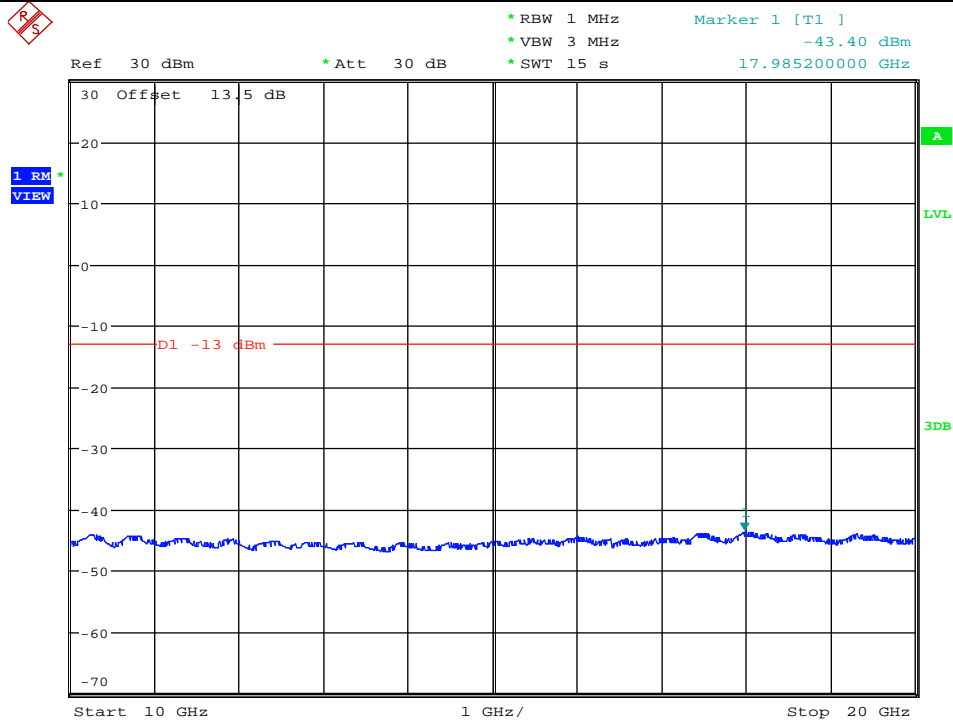


Date: 17.NOV.2022 14:53:33

Band 4 CSE 3MHz-H-16QAM-1RB0-30MHz-10GHz

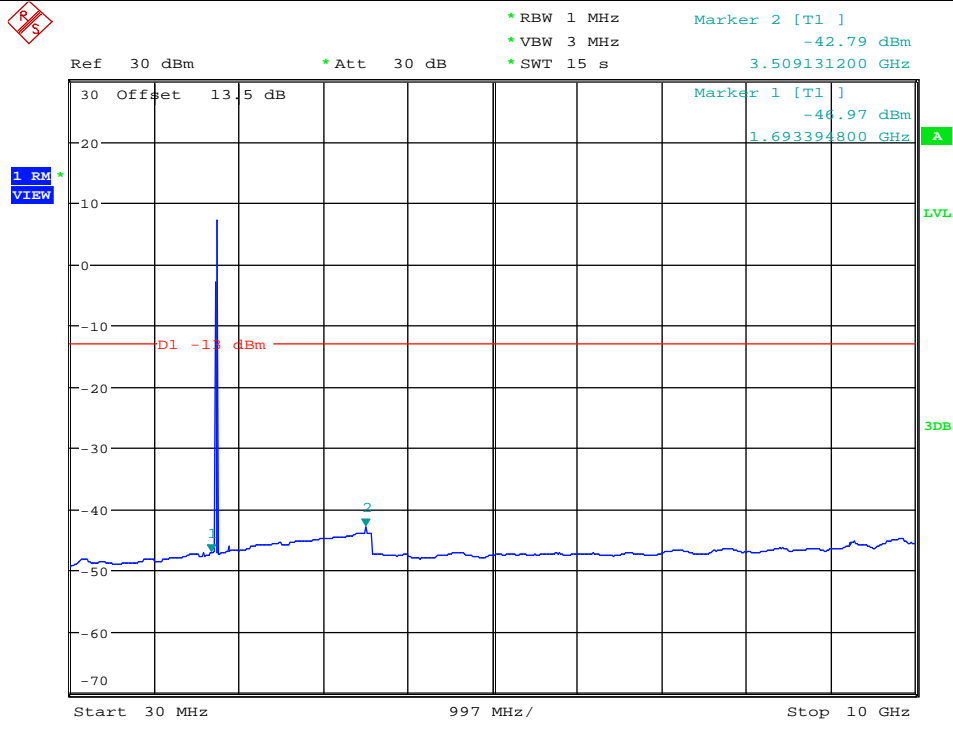


Date: 17.NOV.2022 15:15:29

Band 4 CSE 3MHz-H-16QAM-1RB0-10GHz-20GHz

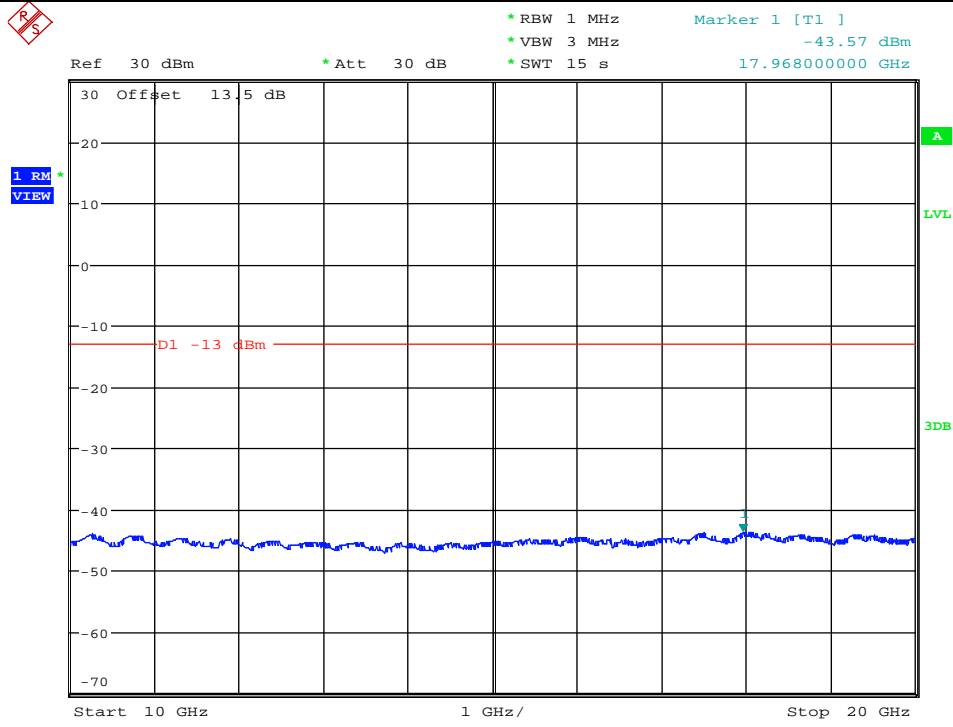


Date: 17.NOV.2022 15:15:59


Band 4 CSE 5MHz-L-QPSK-1RB0-30MHz-10GHz

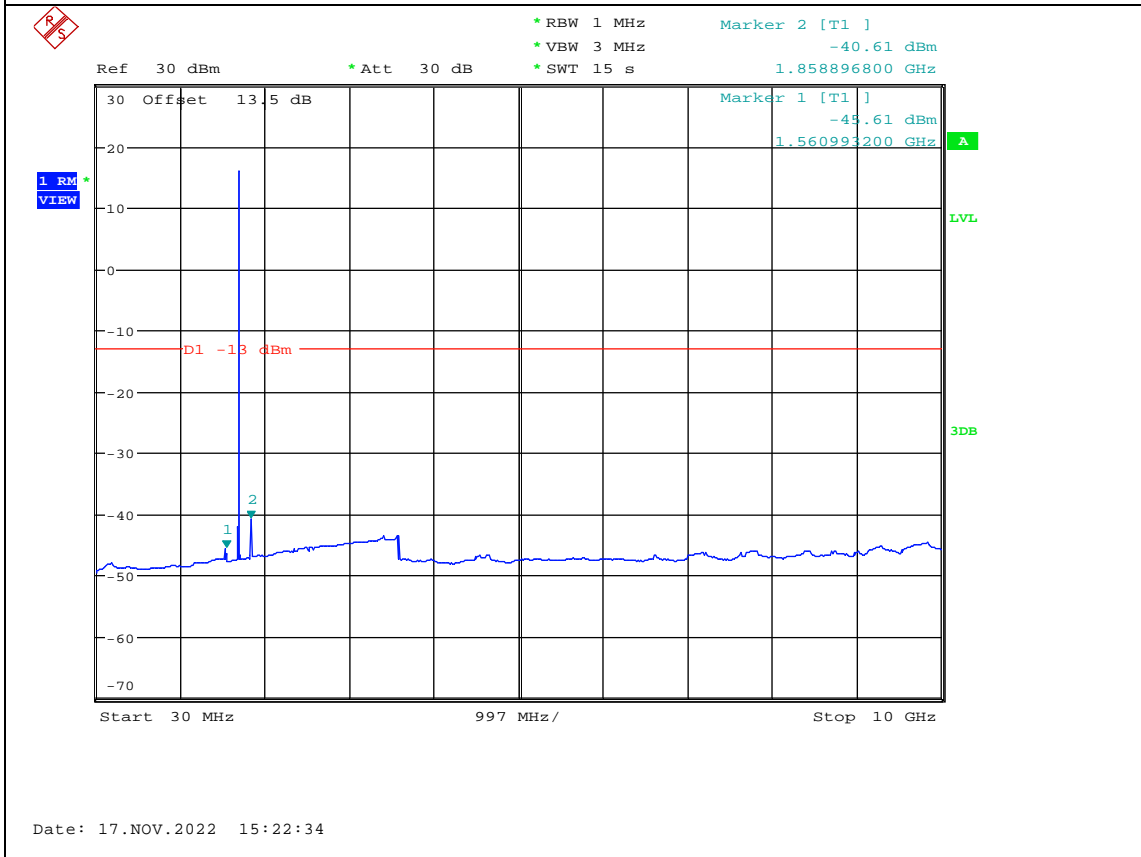

Band 4 CSE 5MHz-L-QPSK-1RB0-10GHz-20GHz

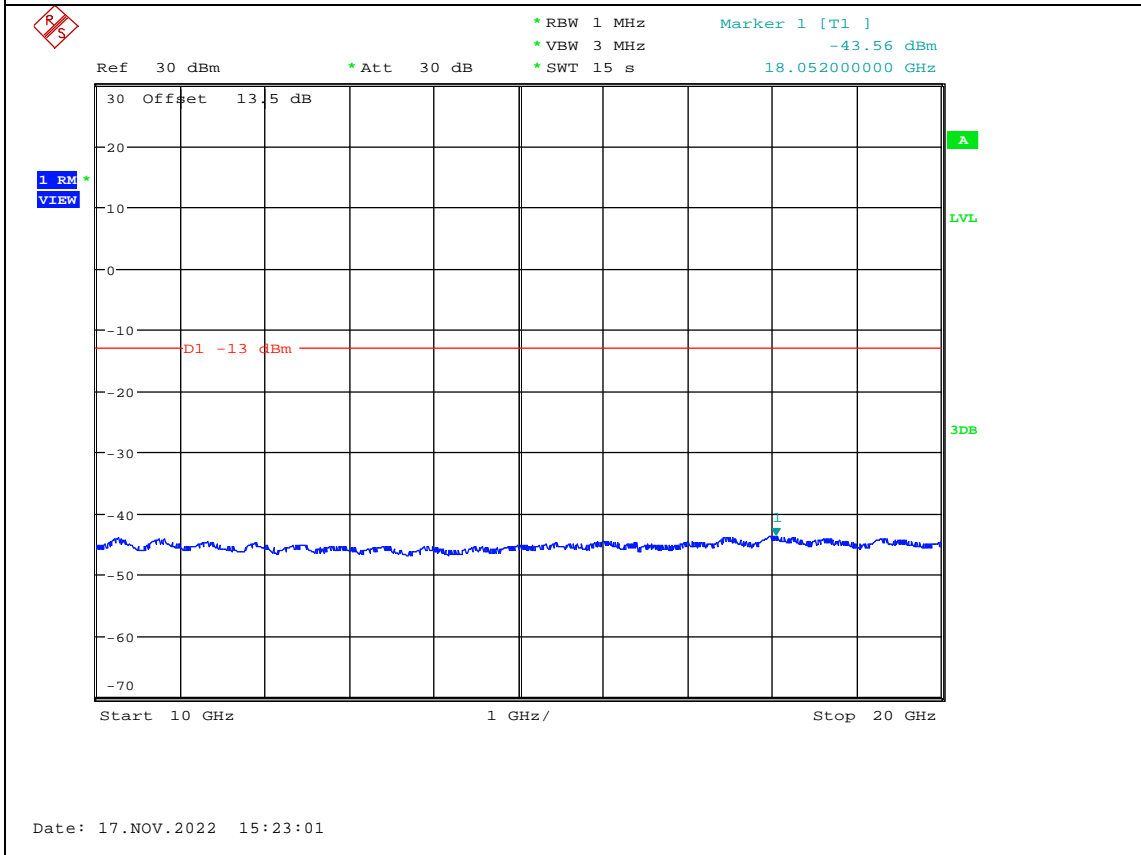


Band 4 CSE 5MHz-L-16QAM-1RB0-30MHz-10GHz

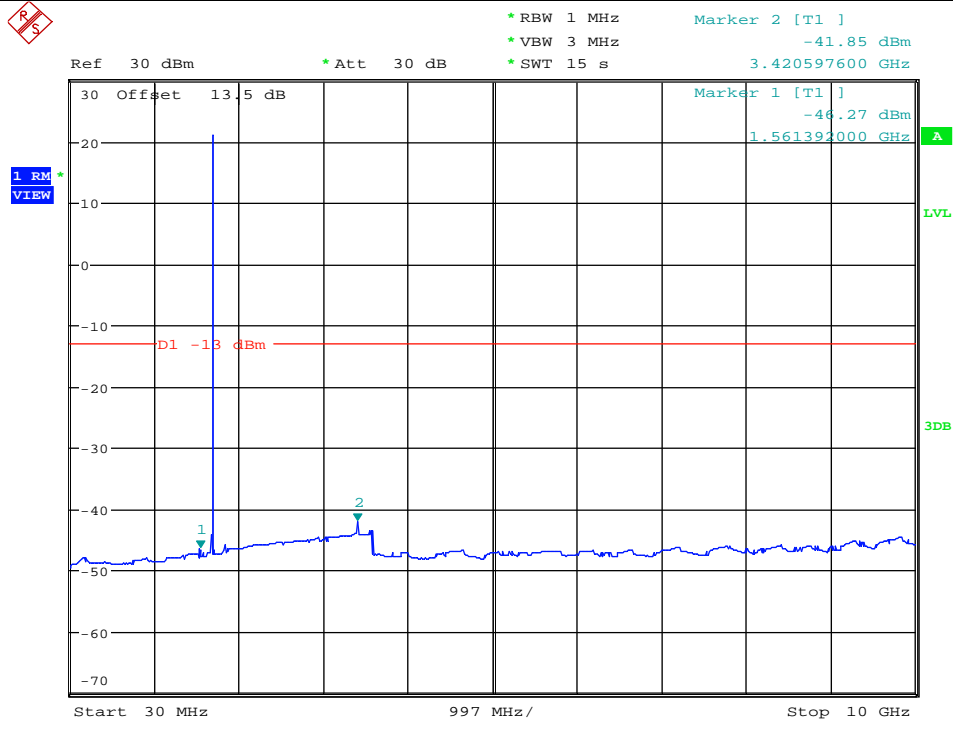


Date: 17.NOV.2022 15:48:59

Band 4 CSE 5MHz-L-16QAM-1RB0-10GHz-20GHz

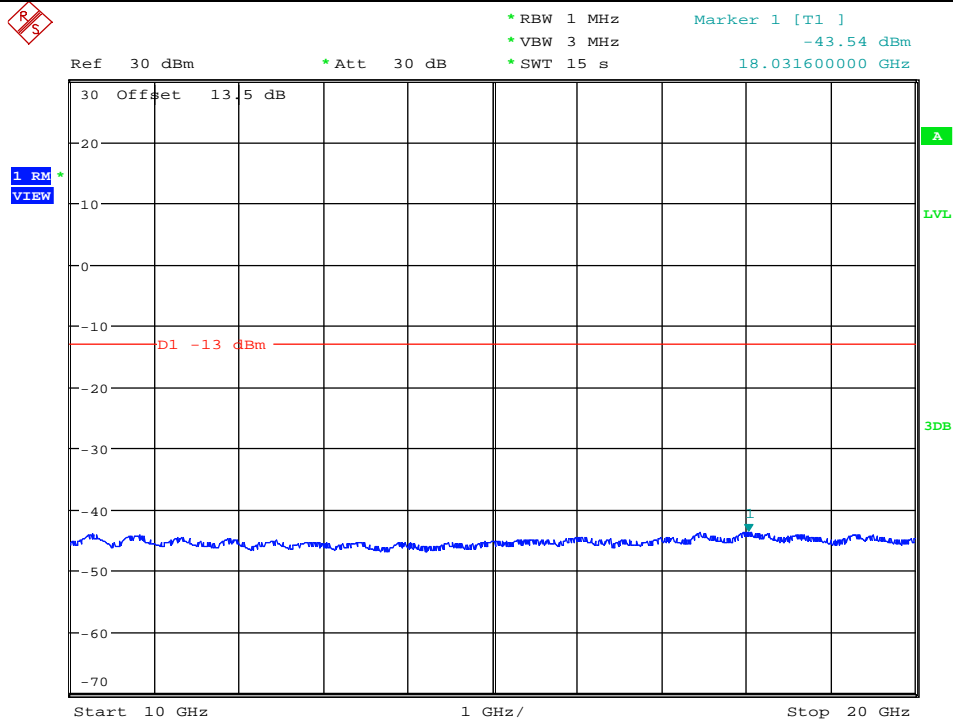


Date: 17.NOV.2022 15:49:26

Band 4 CSE 5MHz-M-QPSK-1RB0-30MHz-10GHz

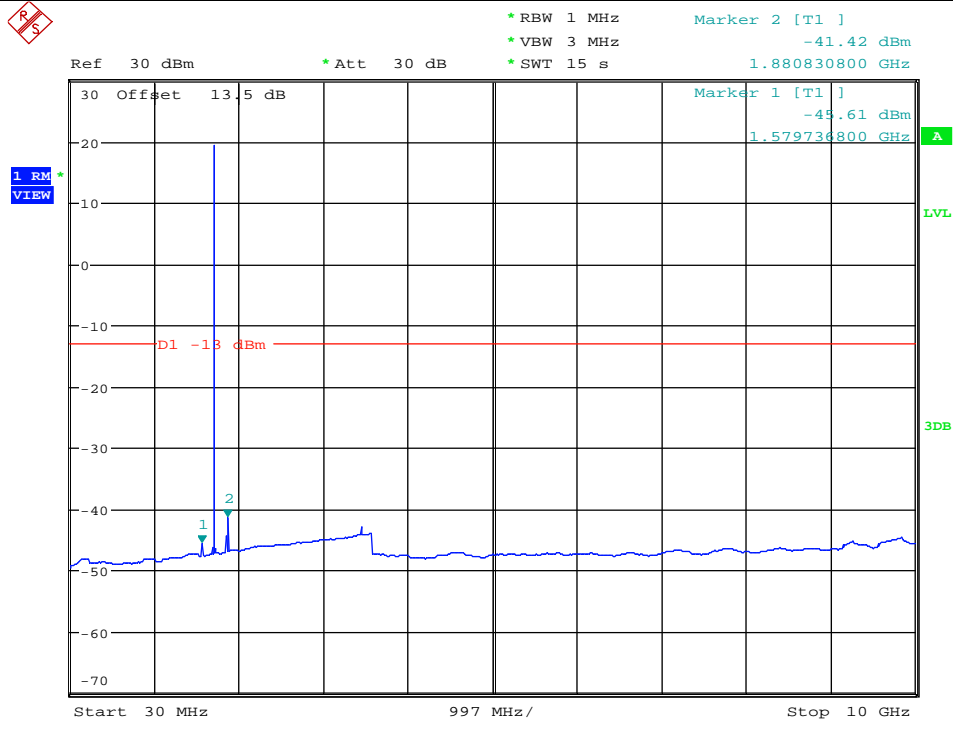


Date: 17.NOV.2022 15:27:58

Band 4 CSE 5MHz-M-QPSK-1RB0-10GHz-20GHz

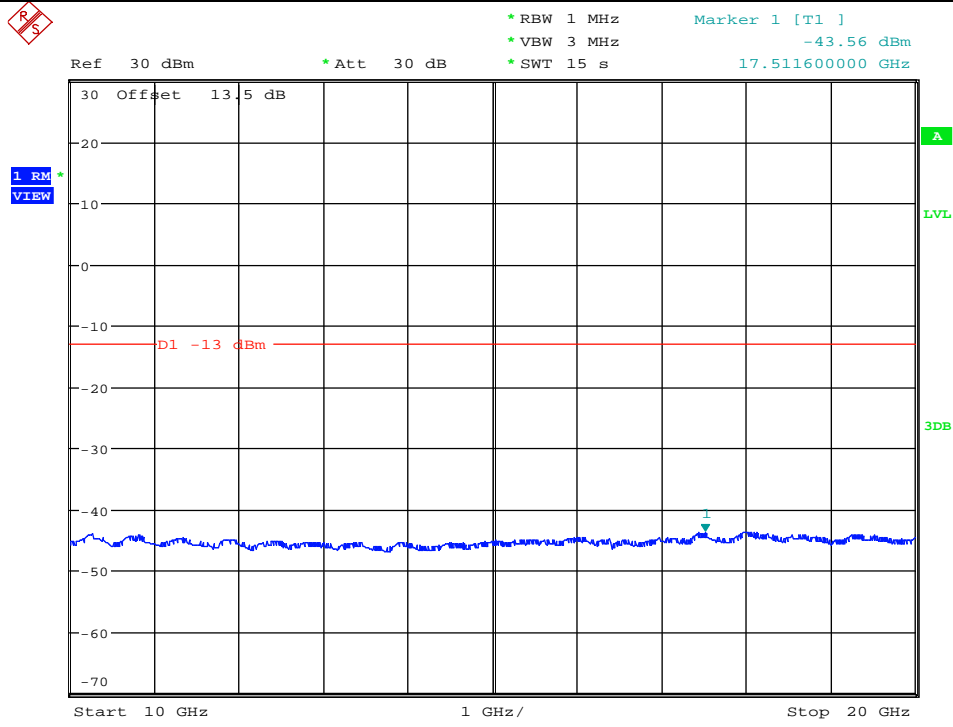


Date: 17.NOV.2022 15:28:26

Band 4 CSE 5MHz-M-16QAM-1RB0-30MHz-10GHz

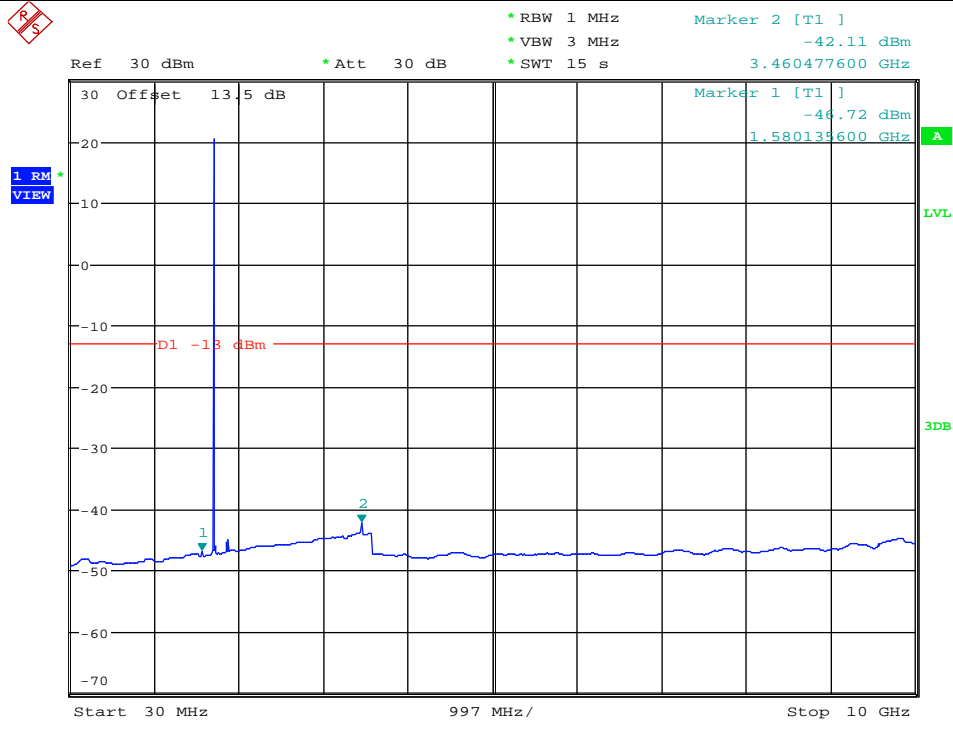


Date: 17.NOV.2022 16:03:39

Band 4 CSE 5MHz-M-16QAM-1RB0-10GHz-20GHz

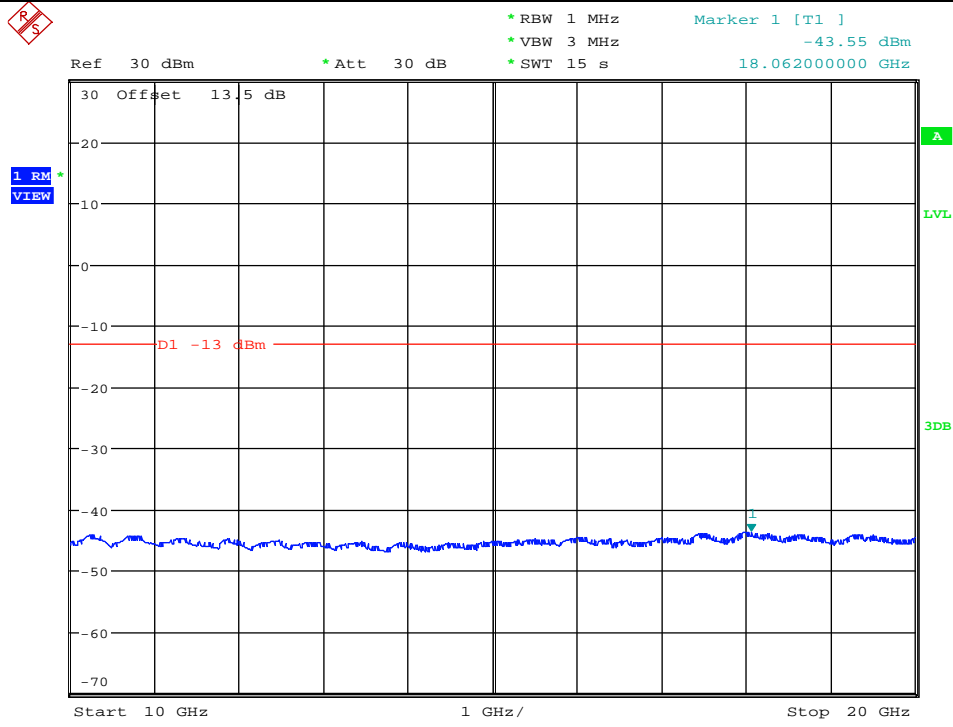


Date: 17.NOV.2022 16:04:06

Band 4 CSE 5MHz-H-QPSK-1RB0-30MHz-10GHz

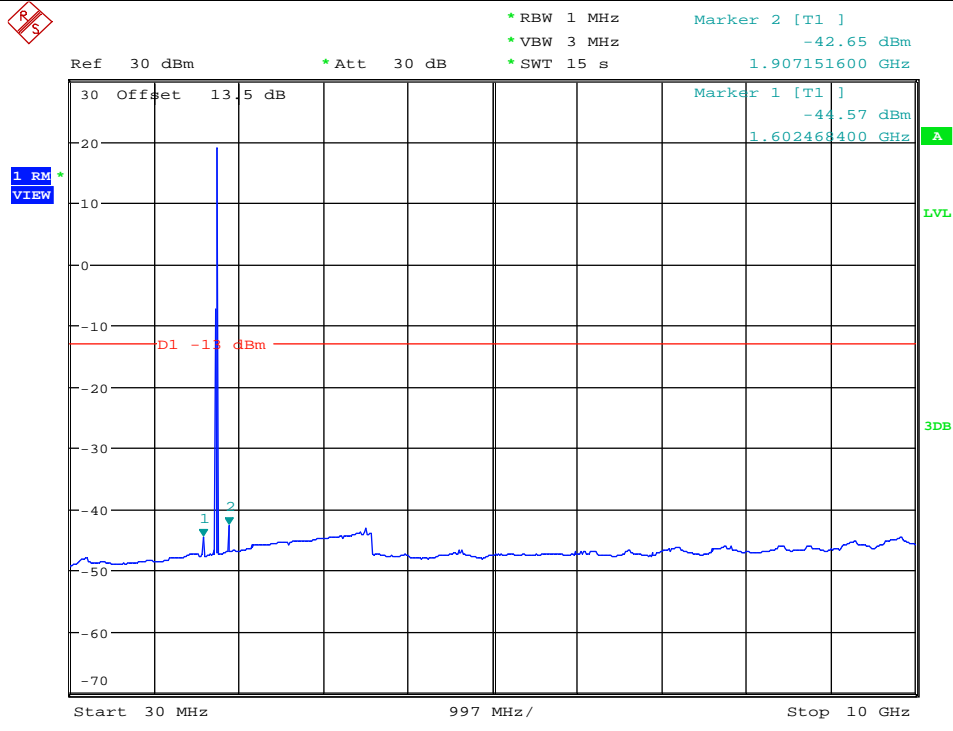


Date: 17.NOV.2022 15:36:38

Band 4 CSE 5MHz-H-QPSK-1RB0-10GHz-20GHz

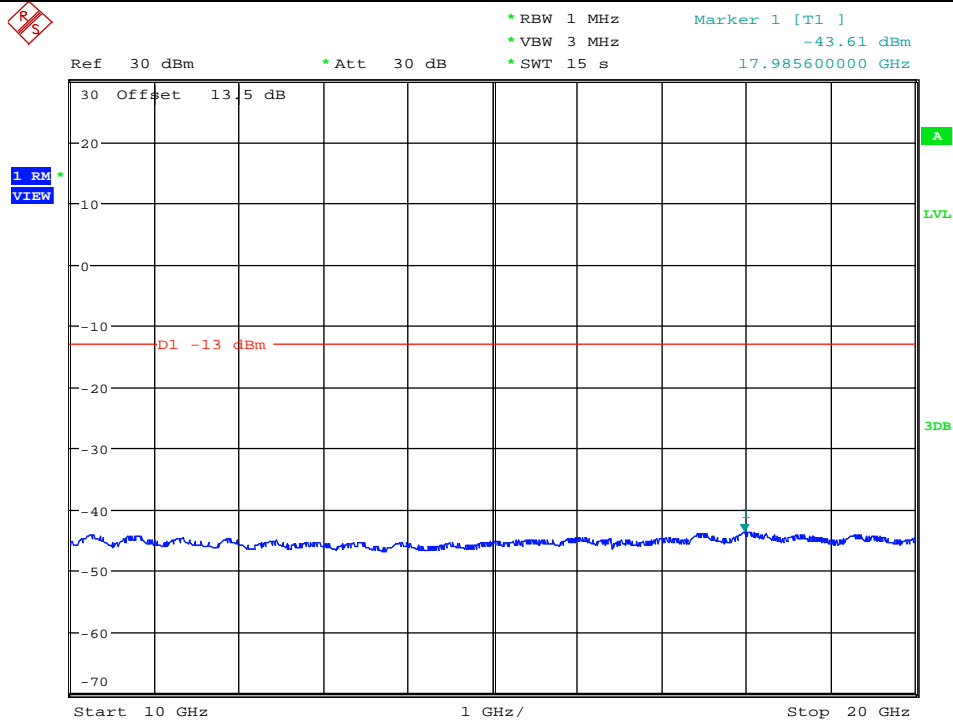


Date: 17.NOV.2022 15:37:05

Band 4 CSE 5MHz-H-16QAM-1RB0-30MHz-10GHz

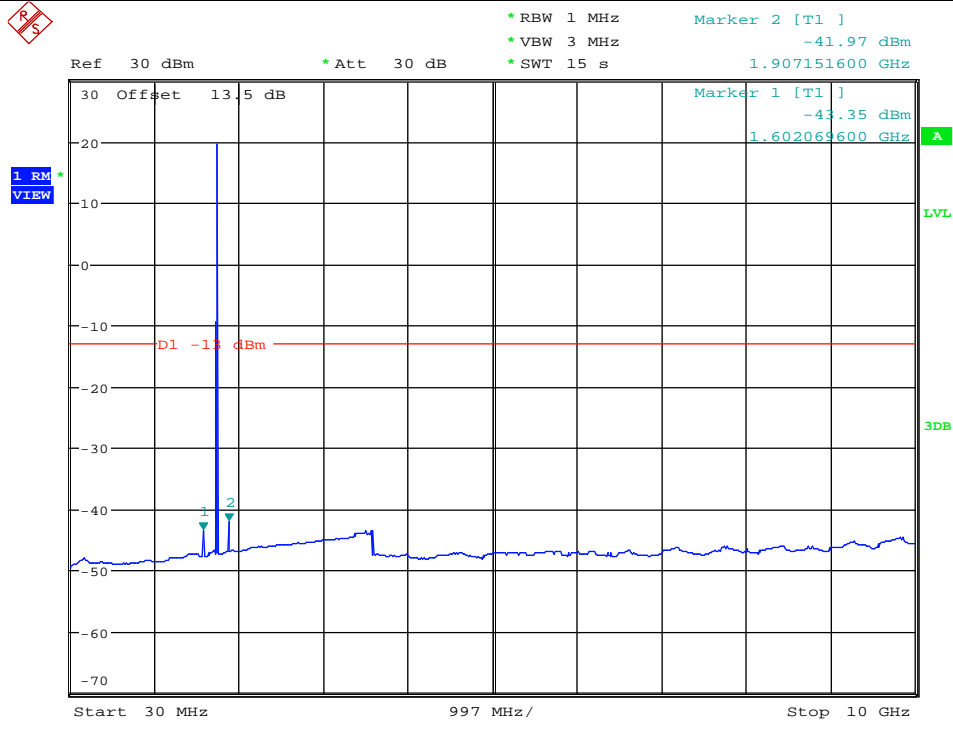


Date: 17.NOV.2022 16:10:04

Band 4 CSE 5MHz-H-16QAM-1RB0-10GHz-20GHz

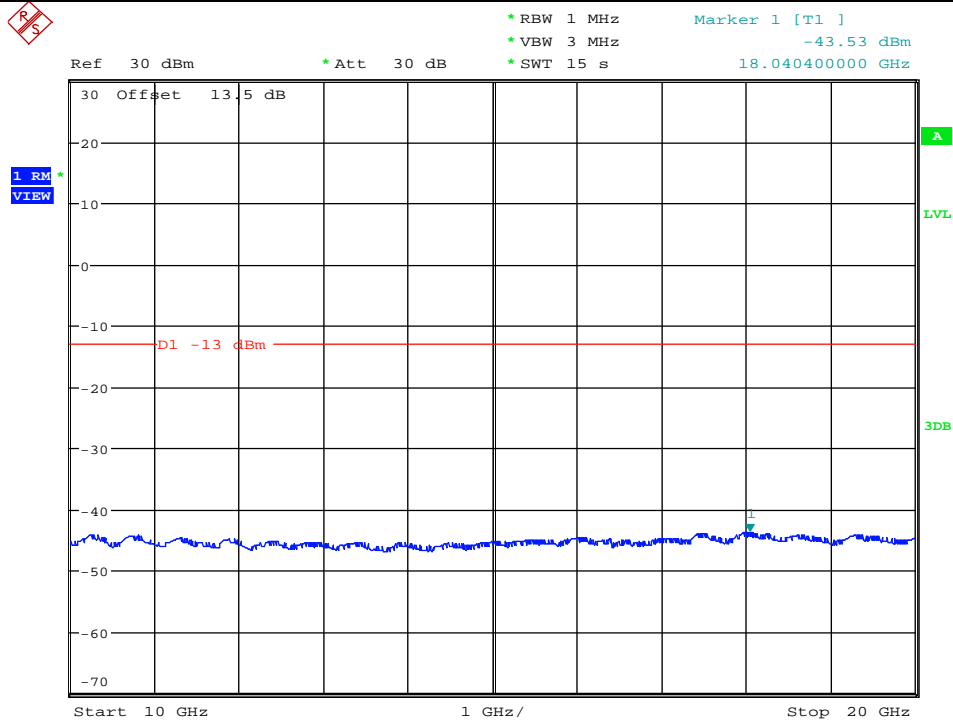


Date: 17.NOV.2022 16:10:34

Band 4 CSE 10MHz-L-QPSK-1RB0-30MHz-10GHz

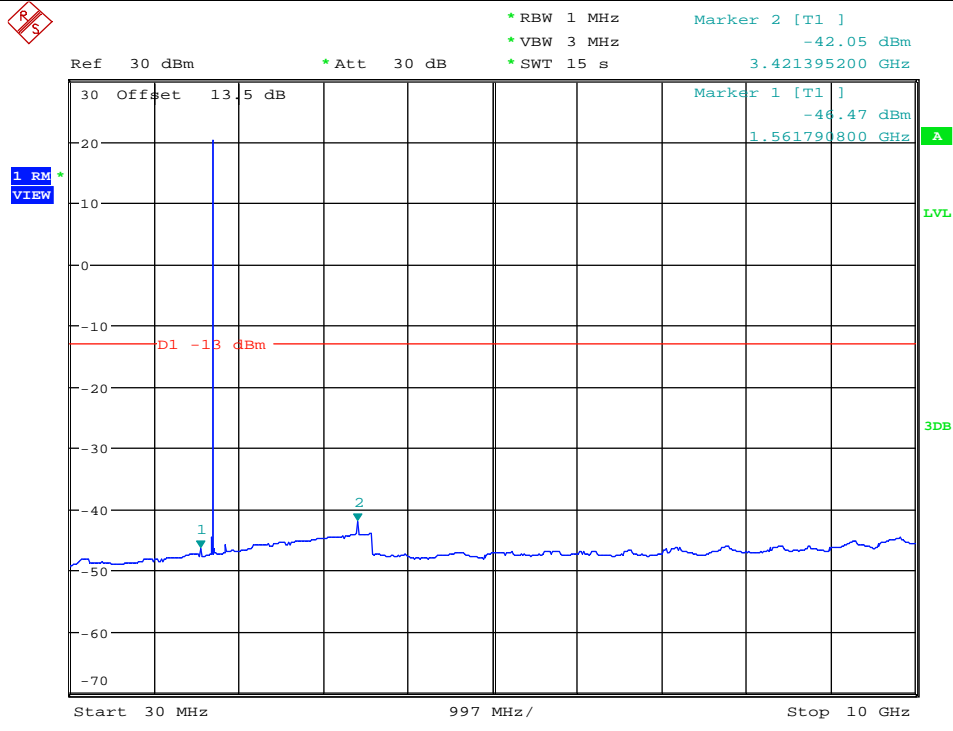


Date: 17.NOV.2022 16:18:09

Band 4 CSE 10MHz-L-QPSK-1RB0-10GHz-20GHz

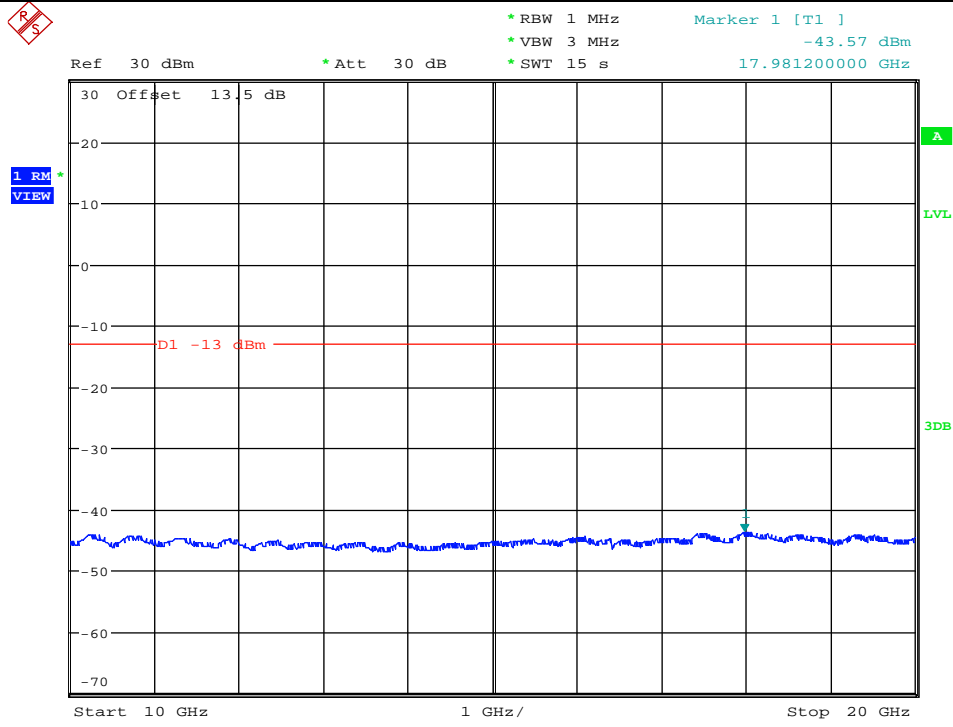


Date: 17.NOV.2022 16:18:39

Band 4 CSE 10MHz-L-16QAM-1RB0-30MHz-10GHz

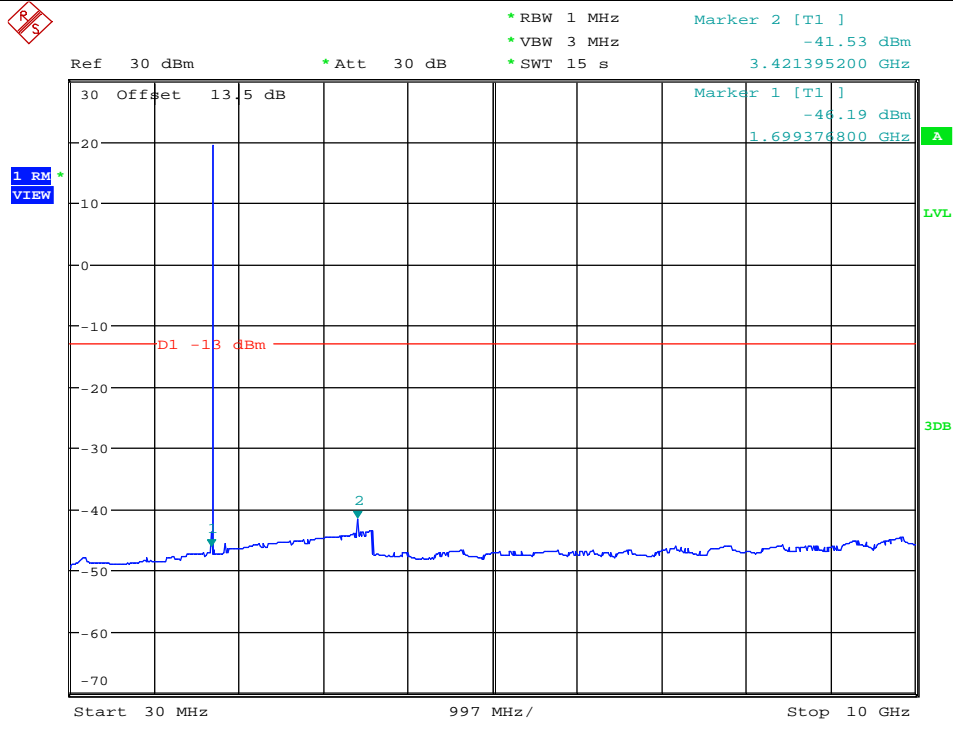


Date: 17.NOV.2022 16:41:53

Band 4 CSE 10MHz-L-16QAM-1RB0-10GHz-20GHz

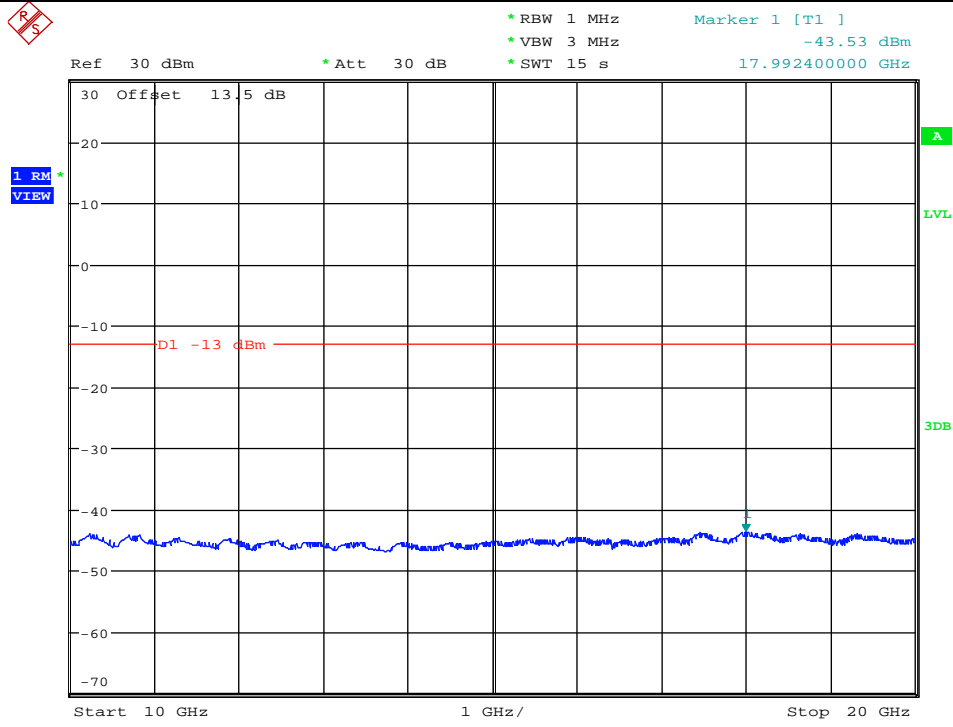


Date: 17.NOV.2022 16:42:22

Band 4 CSE 10MHz-M-QPSK-1RB0-30MHz-10GHz

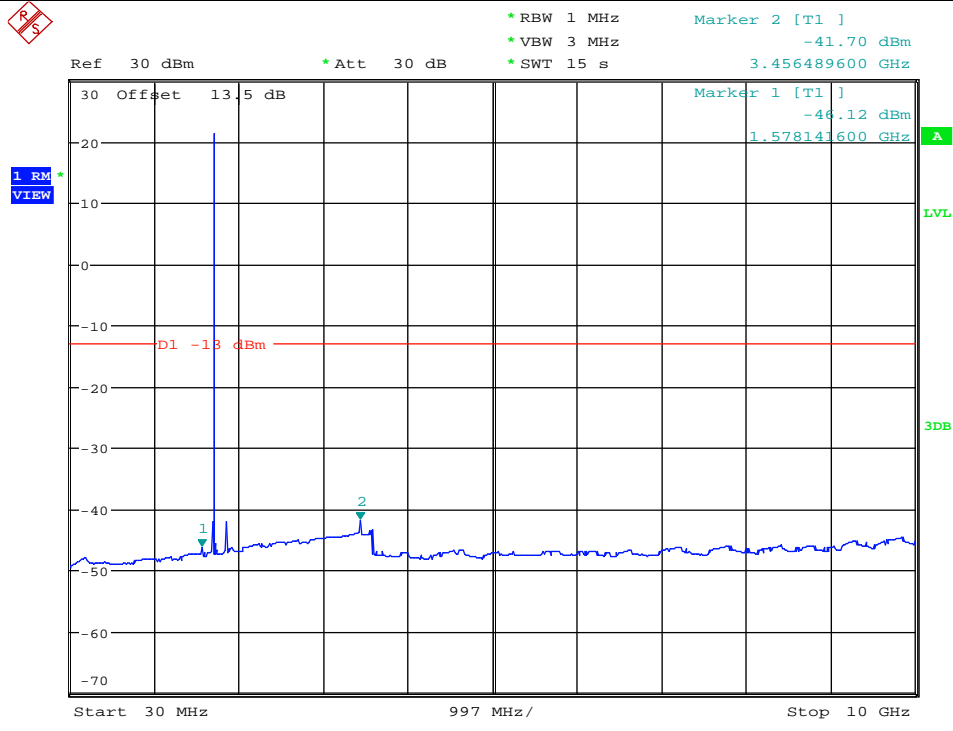


Date: 17.NOV.2022 16:24:53

Band 4 CSE 10MHz-M-QPSK-1RB0-10GHz-20GHz

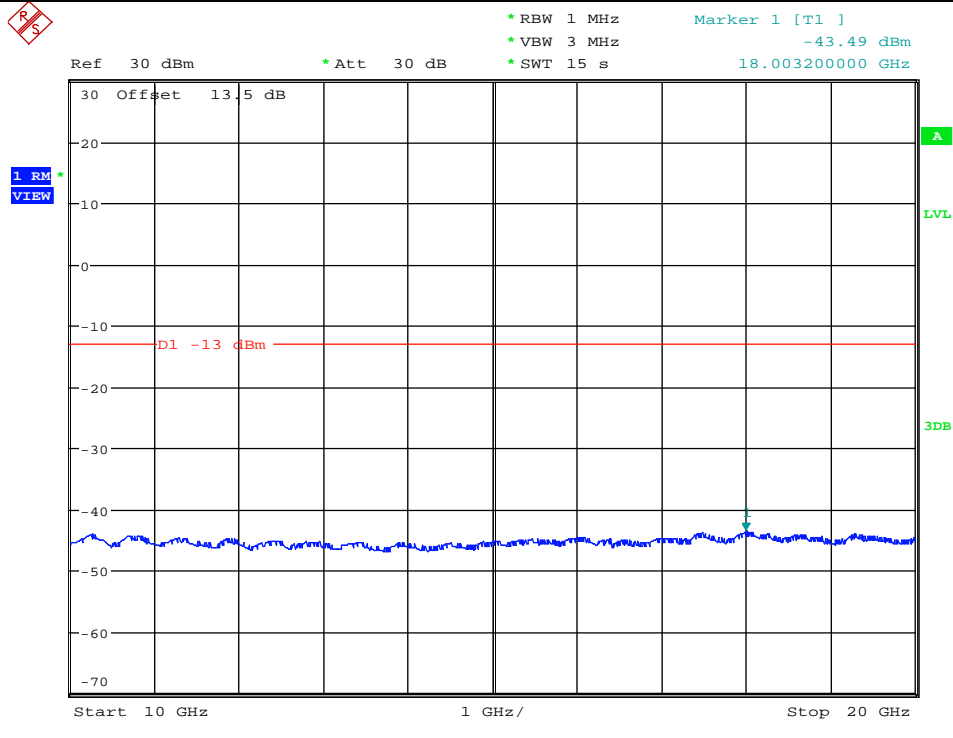


Date: 17.NOV.2022 16:25:20

Band 4 CSE 10MHz-H-QPSK-1RB0-30MHz-10GHz

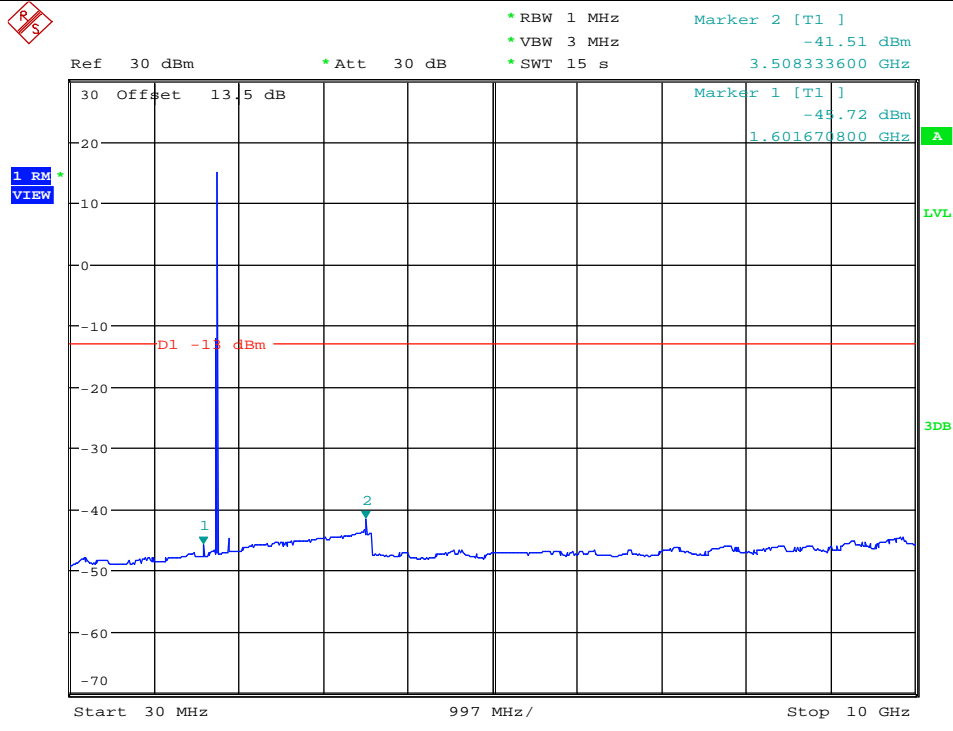


Date: 17.NOV.2022 16:34:19

Band 4 CSE 10MHz-H-QPSK-1RB0-10GHz-20GHz

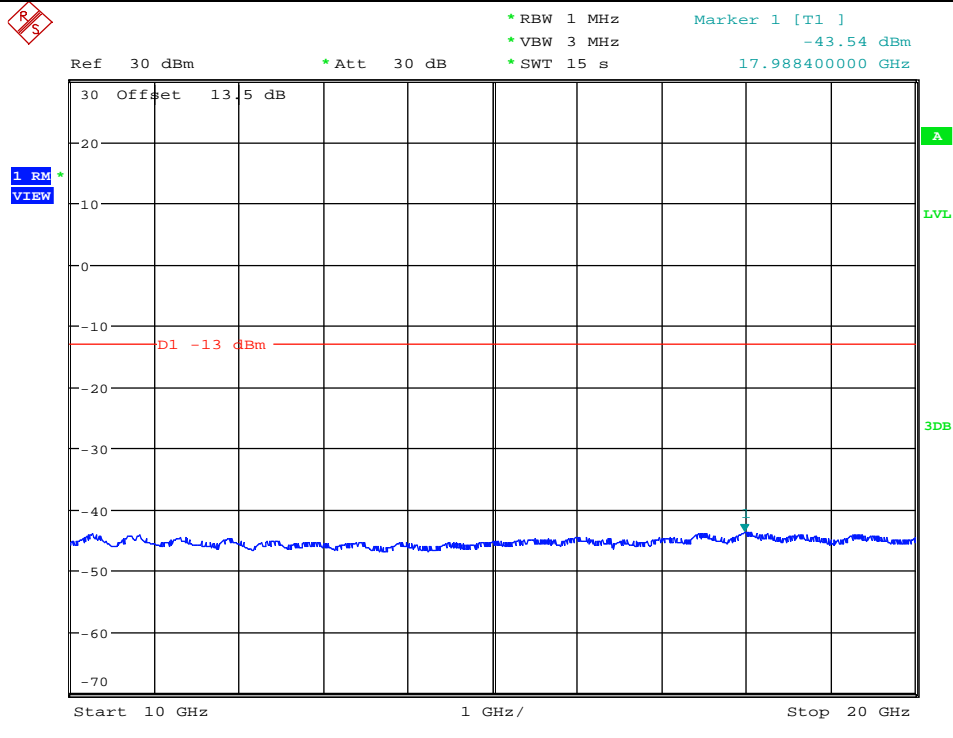


Date: 17.NOV.2022 16:34:46

Band 4 CSE 10MHz-H-16QAM-1RB0-30MHz-10GHz

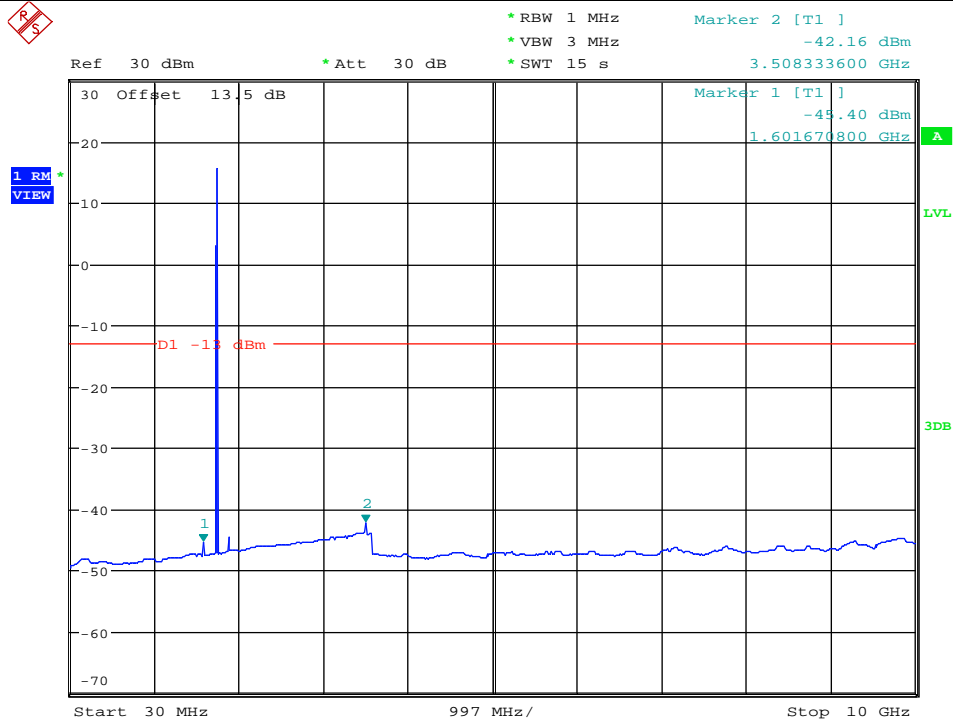


Date: 17.NOV.2022 16:54:43

Band 4 CSE 10MHz-H-16QAM-1RB0-10GHz-20GHz

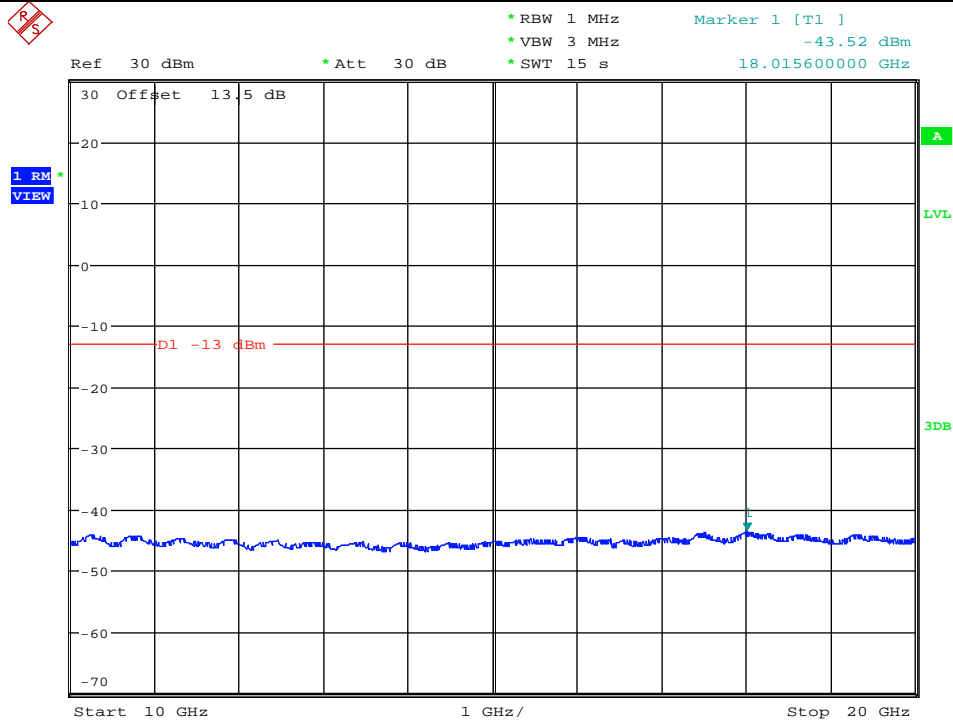


Date: 17.NOV.2022 16:55:12

Band 4 CSE 15MHz-L-QPSK-1RB0-30MHz-10GHz

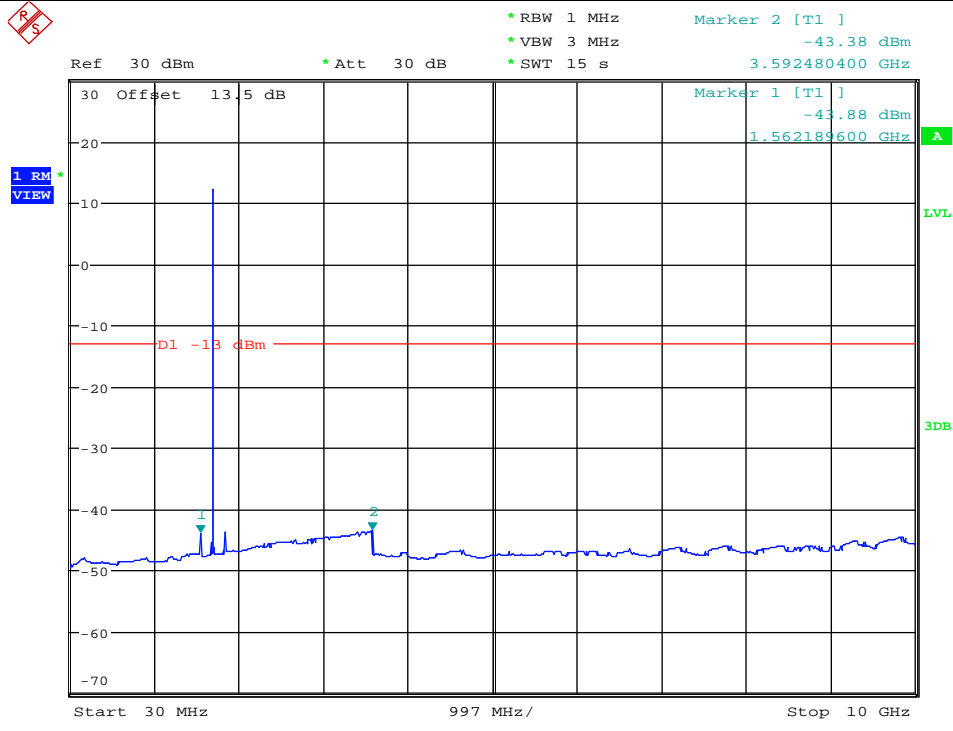


Date: 17.NOV.2022 17:03:19

Band 4 CSE 15MHz-L-QPSK-1RB0-10GHz-20GHz

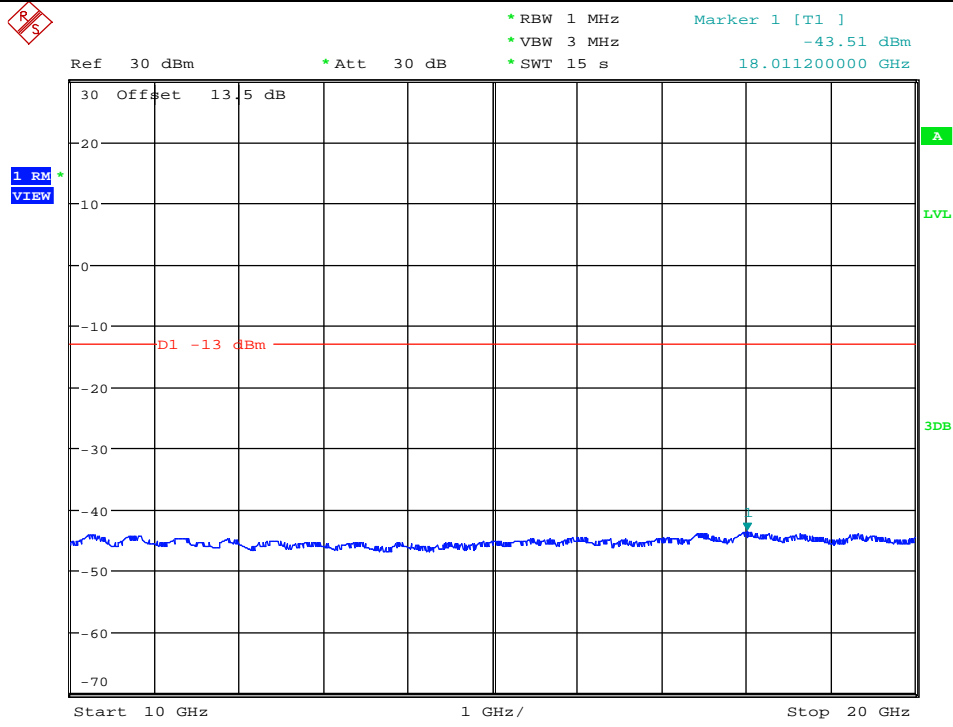


Date: 17.NOV.2022 17:03:47

Band 4 CSE 15MHz-L-16QAM-1RB0-30MHz-10GHz

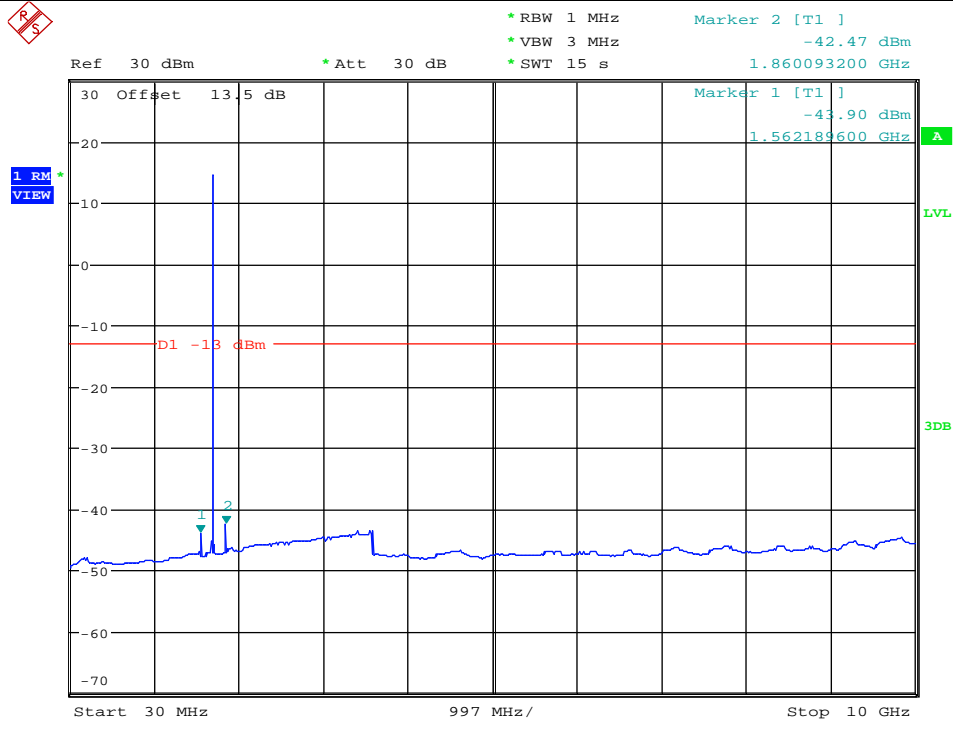


Date: 17.NOV.2022 17:25:32

Band 4 CSE 15MHz-L-16QAM-1RB0-10GHz-20GHz

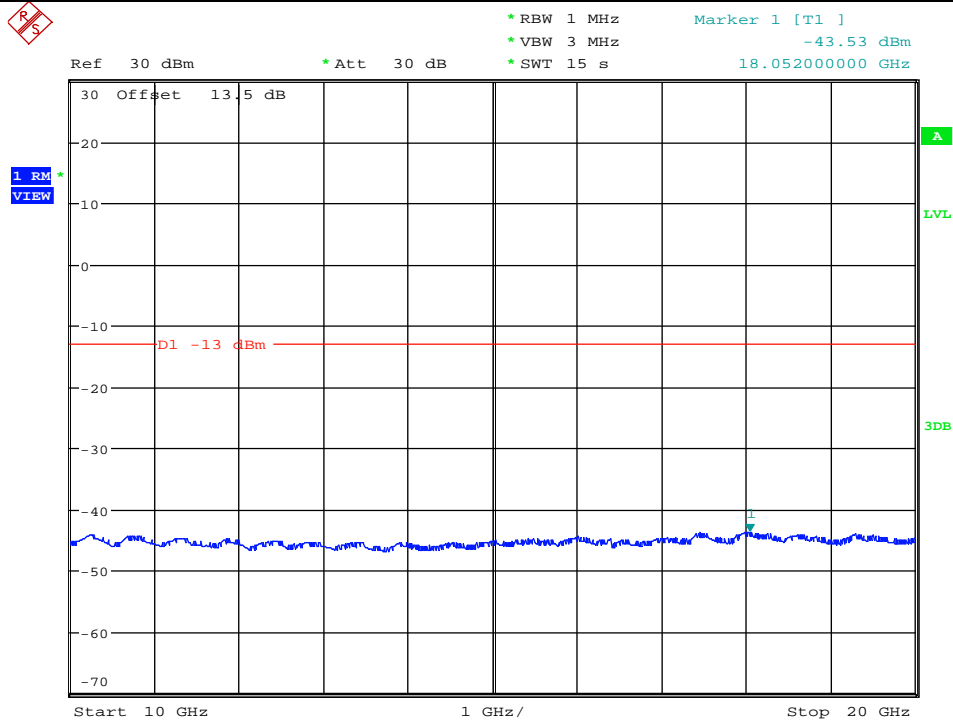


Date: 17.NOV.2022 17:25:59

Band 4 CSE 15MHz-M-QPSK-1RB0-30MHz-10GHz

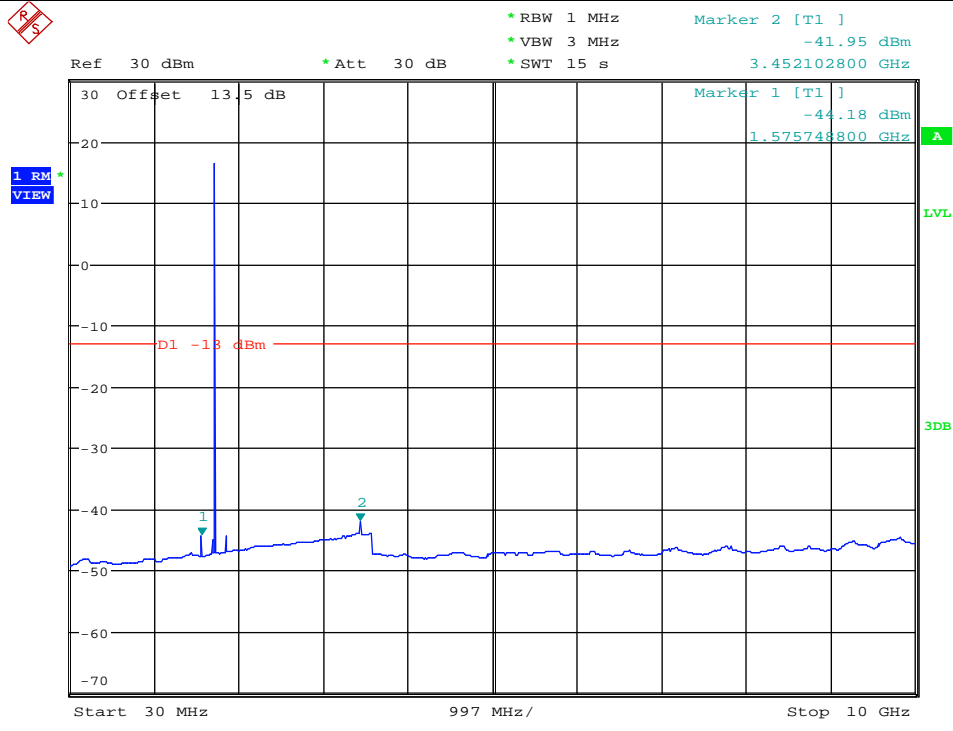


Date: 17.NOV.2022 17:10:37

Band 4 CSE 15MHz-M-QPSK-1RB0-10GHz-20GHz

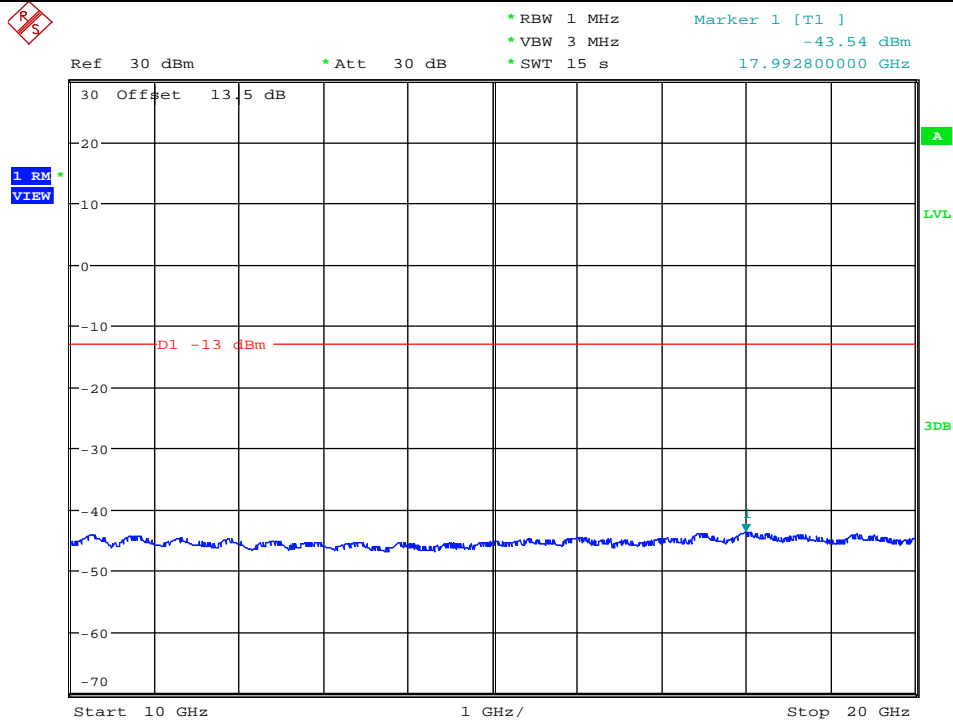


Date: 17.NOV.2022 17:11:06

Band 4 CSE 15MHz-M-16QAM-1RB0-30MHz-10GHz

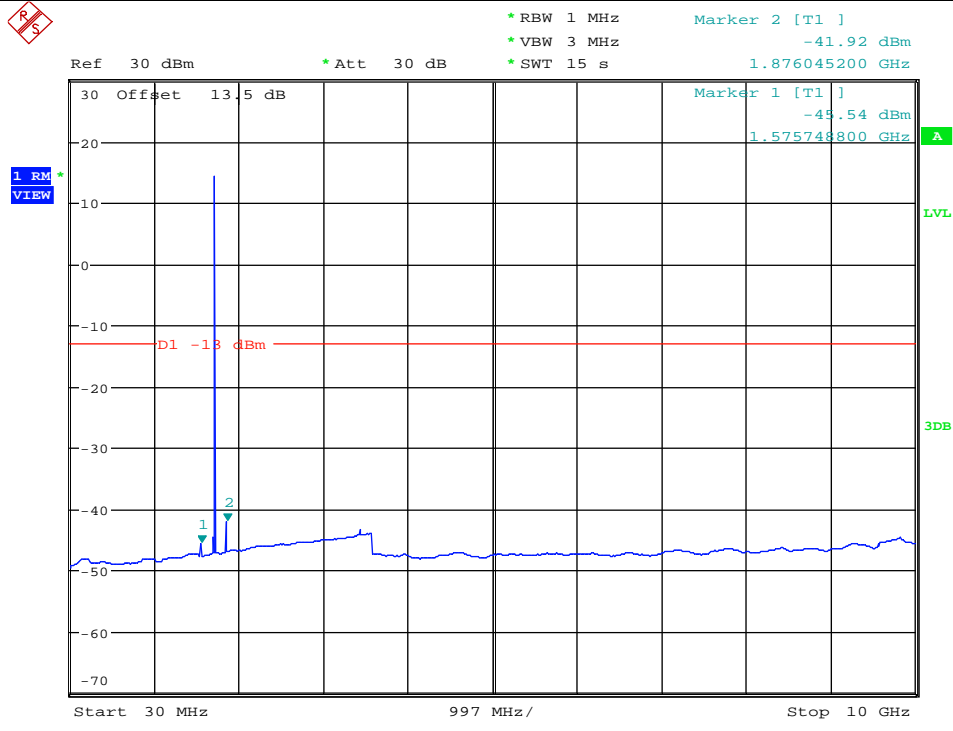


Date: 17.NOV.2022 17:34:24

Band 4 CSE 15MHz-M-16QAM-1RB0-10GHz-20GHz

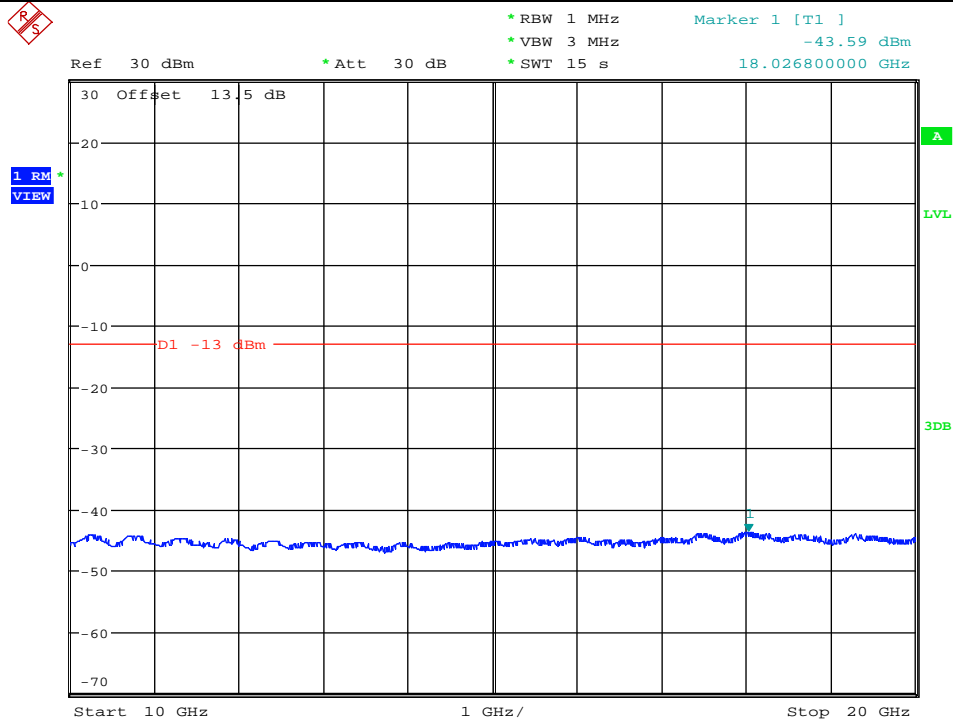


Date: 17.NOV.2022 17:34:52

Band 4 CSE 15MHz-H-QPSK-1RB0-30MHz-10GHz

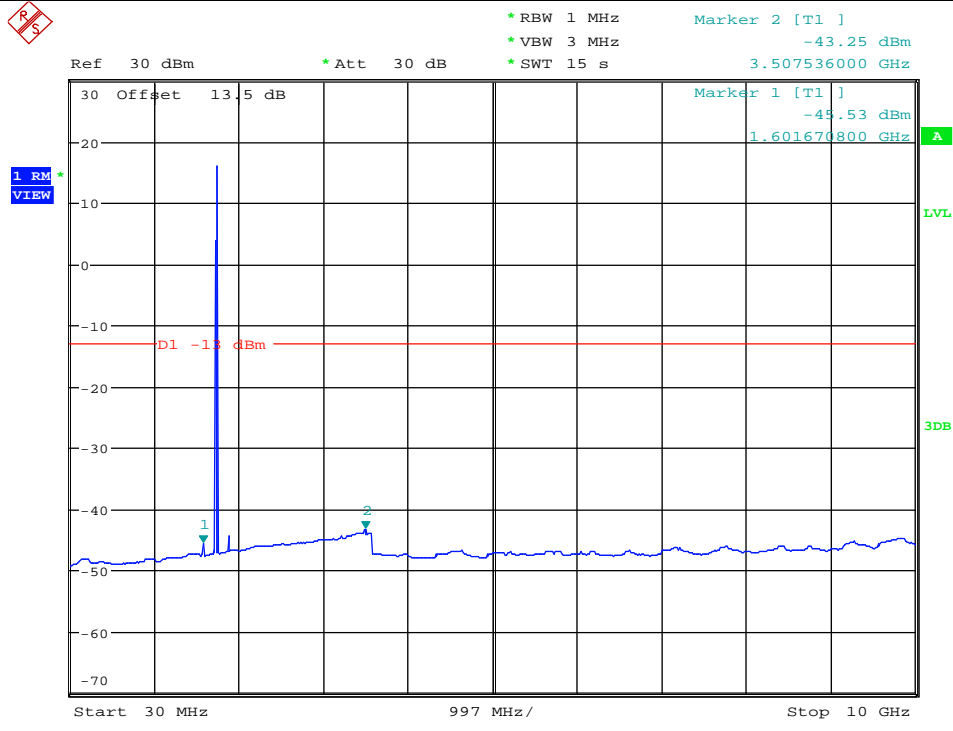


Date: 17.NOV.2022 17:19:13

Band 4 CSE 15MHz-H-QPSK-1RB0-10GHz-20GHz

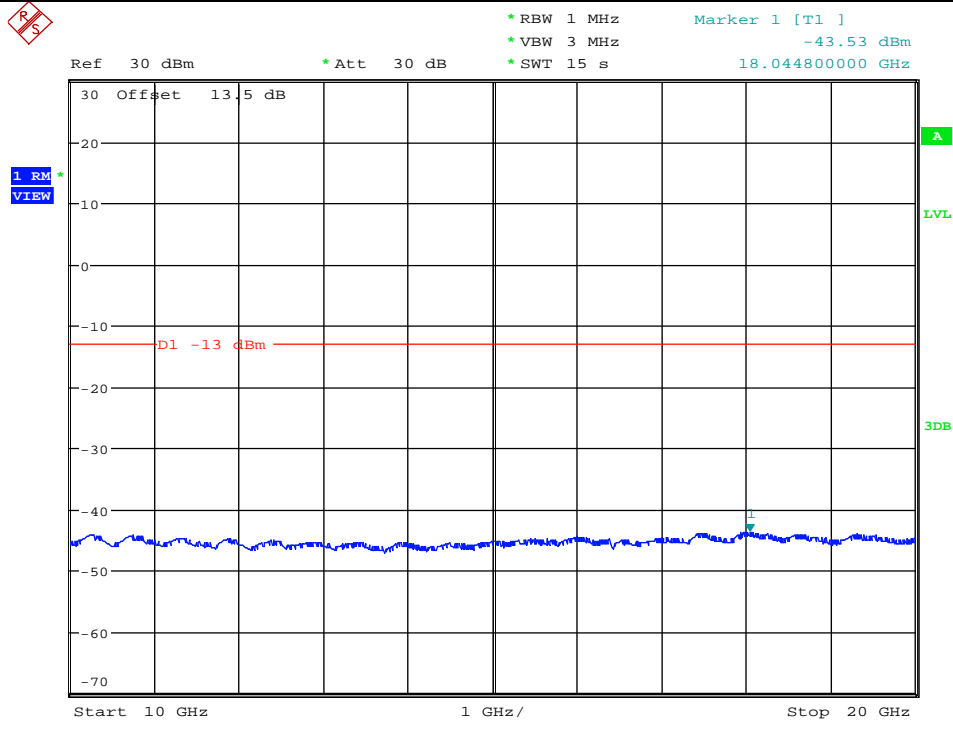


Date: 17.NOV.2022 17:19:42

Band 4 CSE 15MHz-H-16QAM-1RB0-30MHz-10GHz

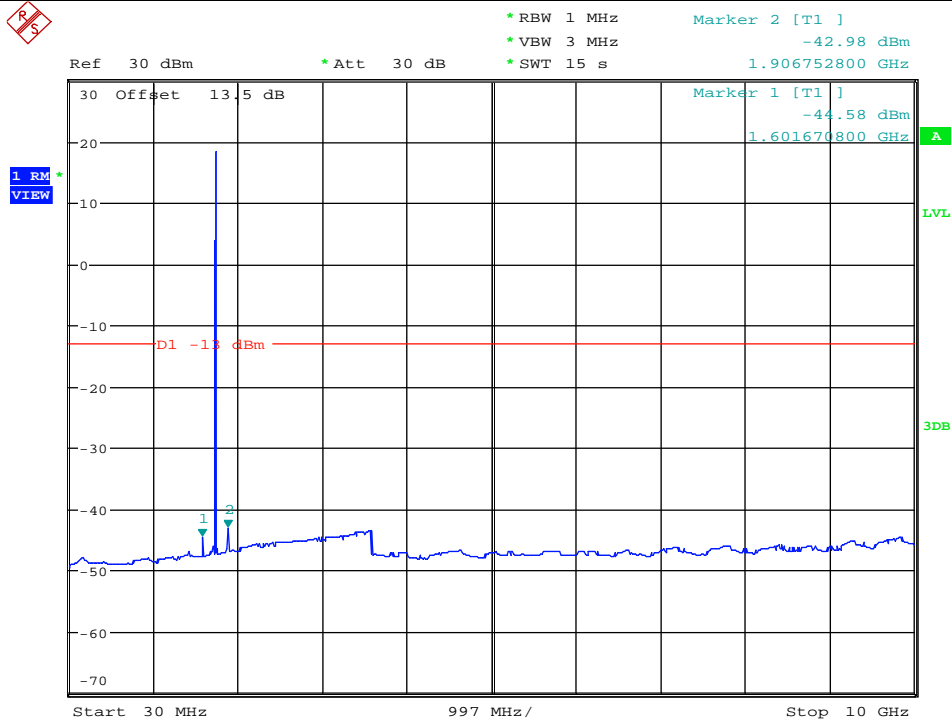


Date: 17.NOV.2022 17:43:20

Band 4 CSE 15MHz-H-16QAM-1RB0-10GHz-20GHz

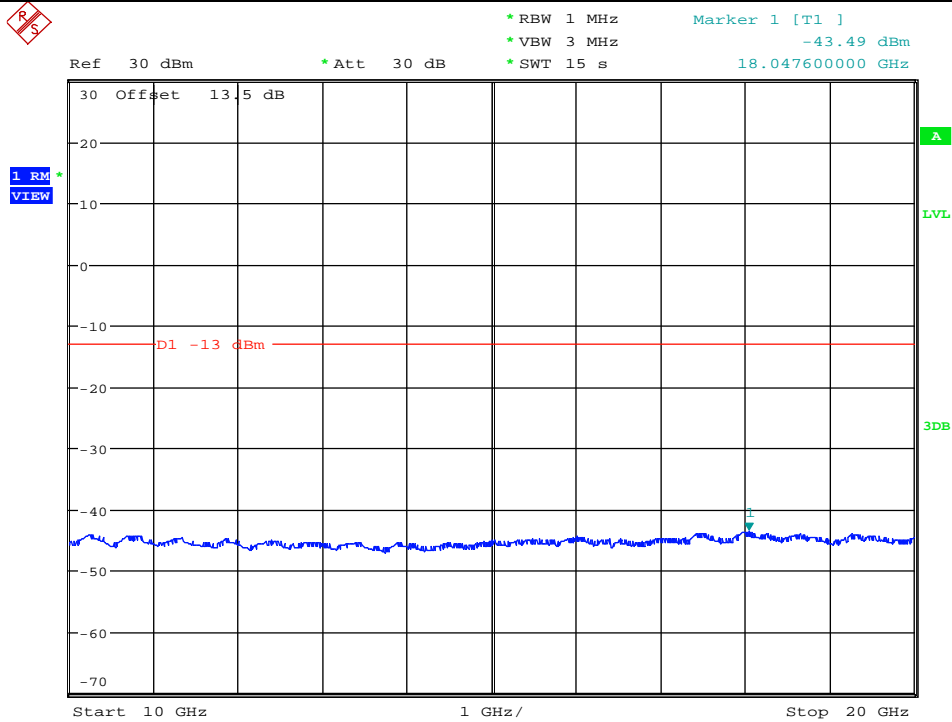


Date: 17.NOV.2022 17:43:49

Band 4 CSE 20MHz-L-QPSK-1RB0-30MHz-10GHz

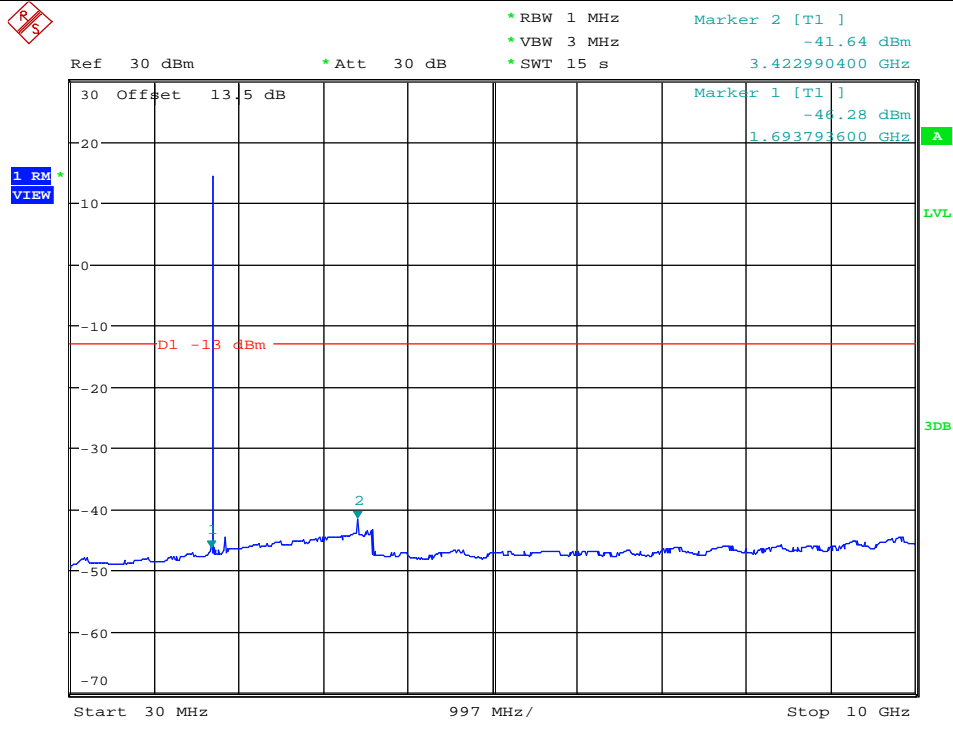


Date: 17.NOV.2022 17:52:46

Band 4 CSE 20MHz-L-QPSK-1RB0-10GHz-20GHz

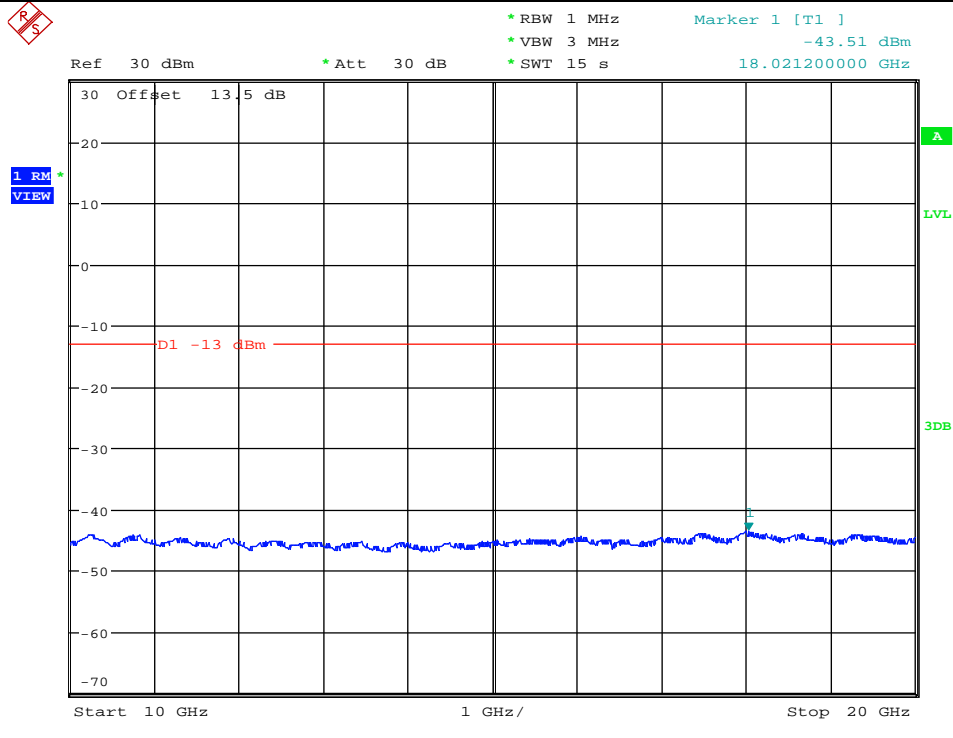


Date: 17.NOV.2022 17:53:16

Band 4 CSE 20MHz-M-QPSK-1RB0-30MHz-10GHz


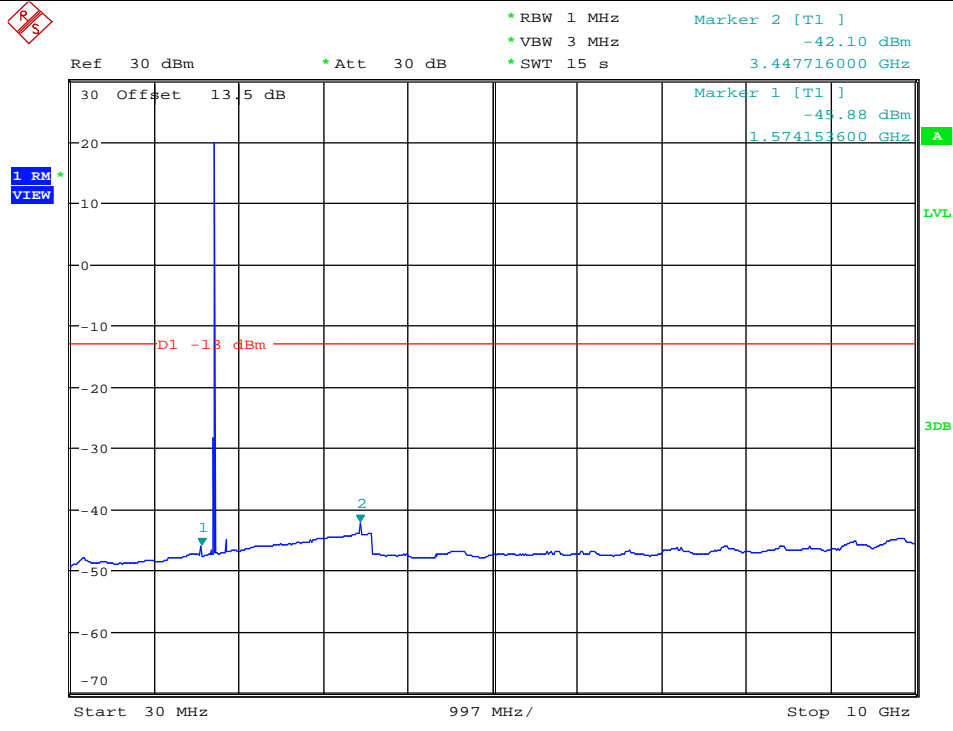


Date: 17.NOV.2022 17:59:27


Band 4 CSE 20MHz-M-QPSK-1RB0-10GHz-20GHz

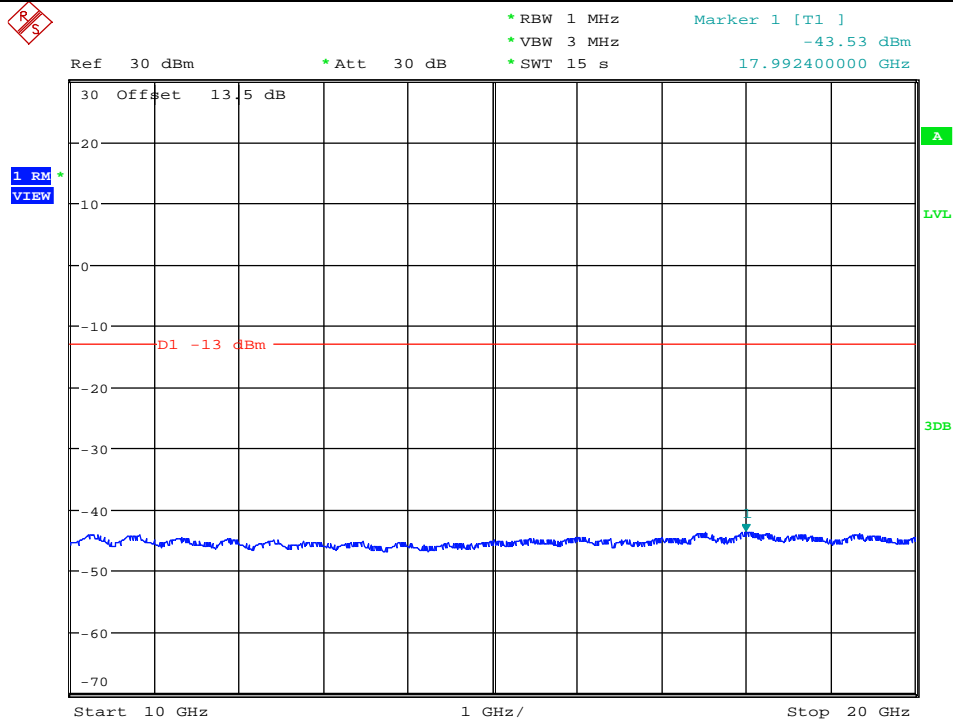

Date: 17.NOV.2022 17:59:56

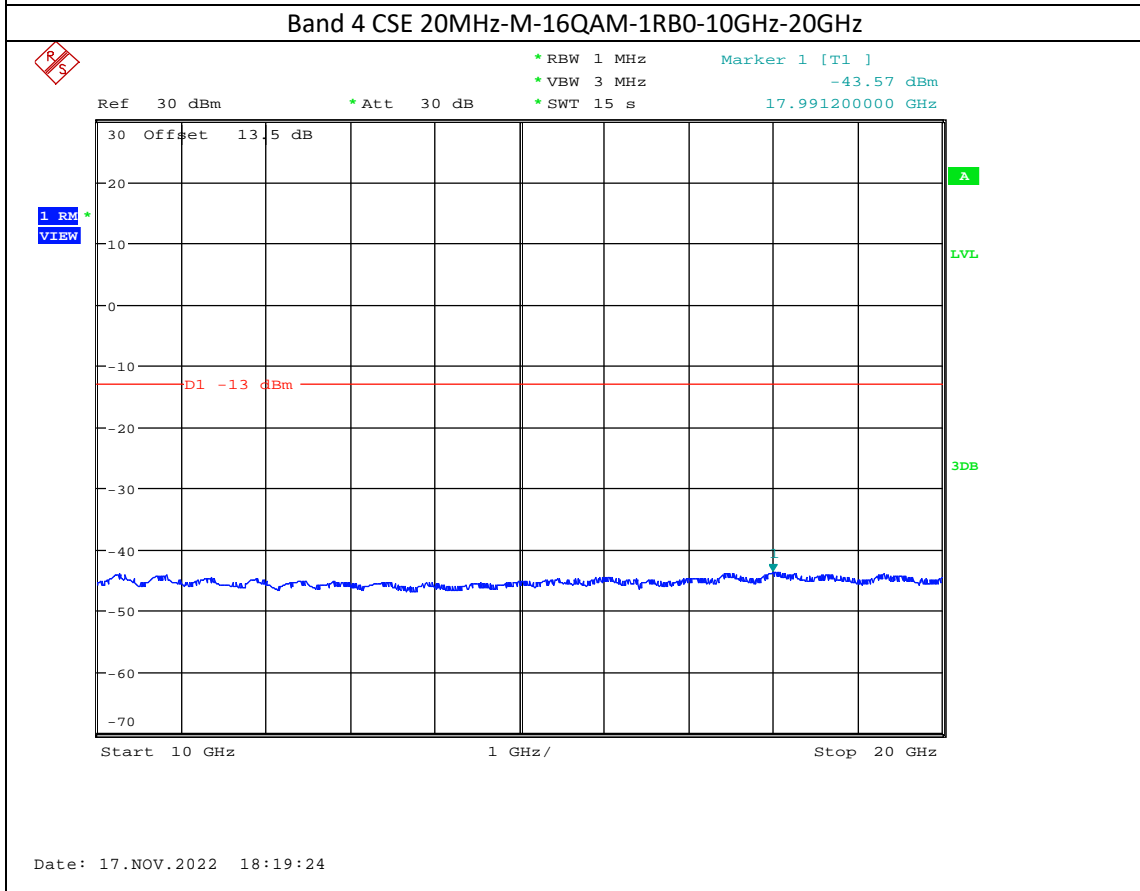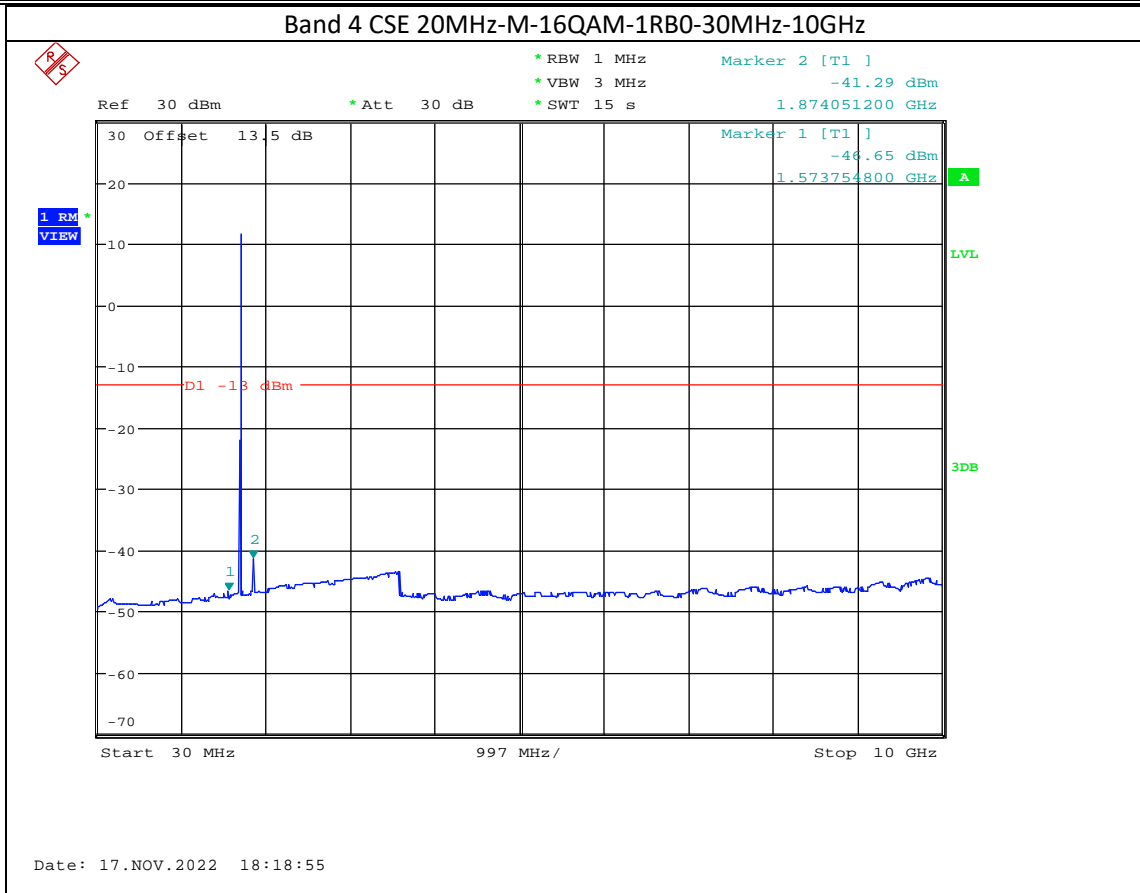


Band 4 CSE 20MHz-H-QPSK-1RB0-30MHz-10GHz

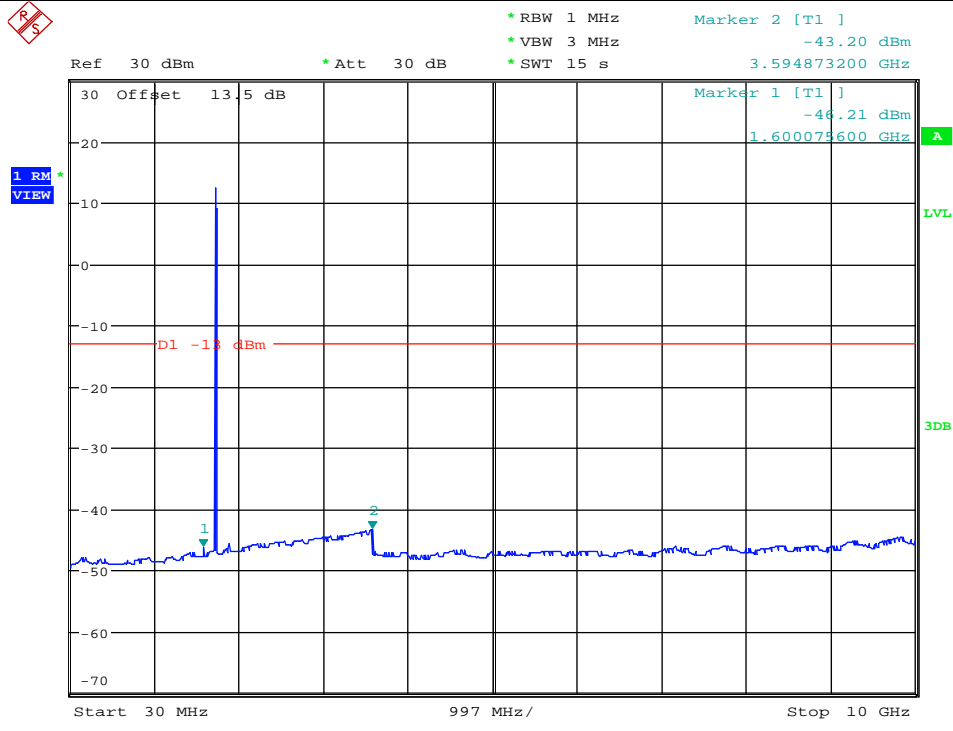


Date: 17.NOV.2022 18:05:40

Band 4 CSE 20MHz-H-QPSK-1RB0-10GHz-20GHz

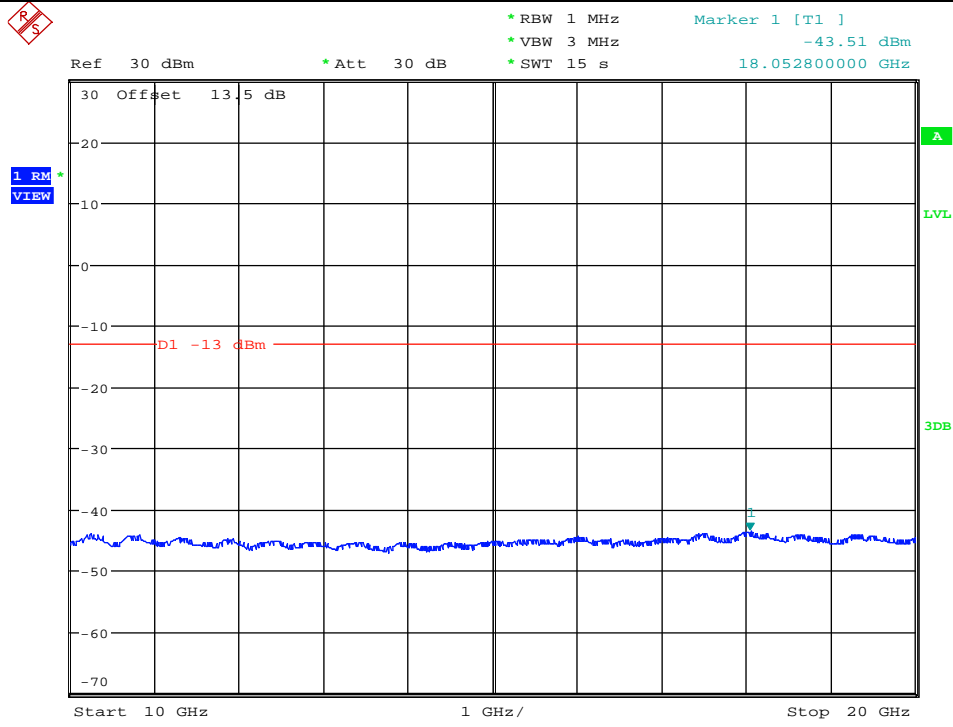


Date: 17.NOV.2022 18:06:08

Band 4 CSE 20MHz-H-16QAM-1RB0-30MHz-10GHz

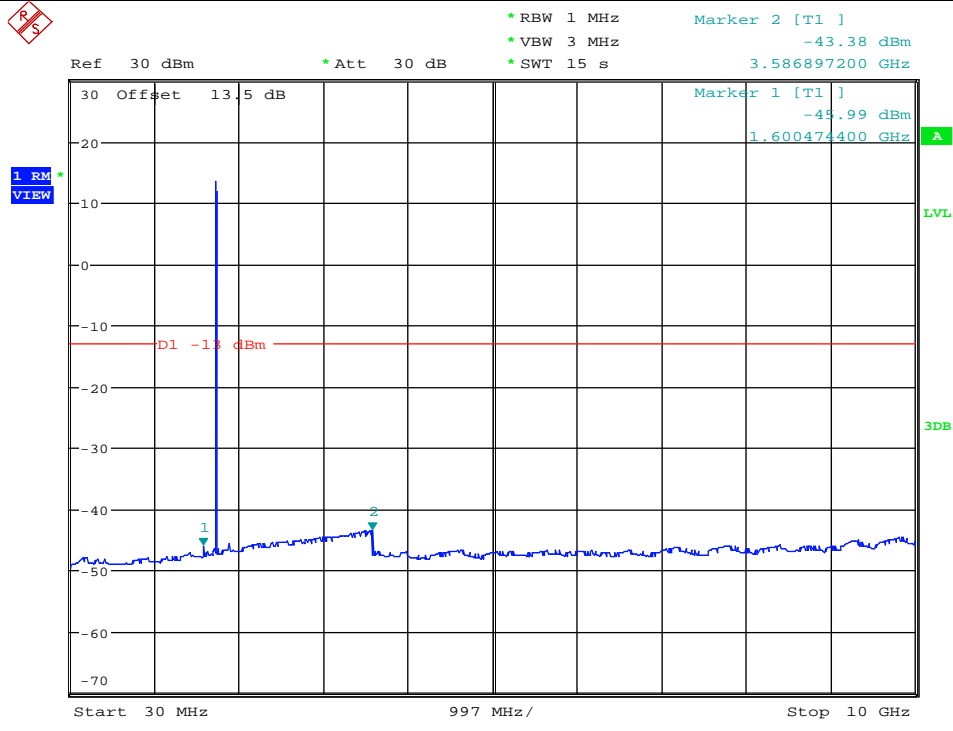


Date: 17.NOV.2022 18:25:11

Band 4 CSE 20MHz-H-16QAM-1RB0-10GHz-20GHz

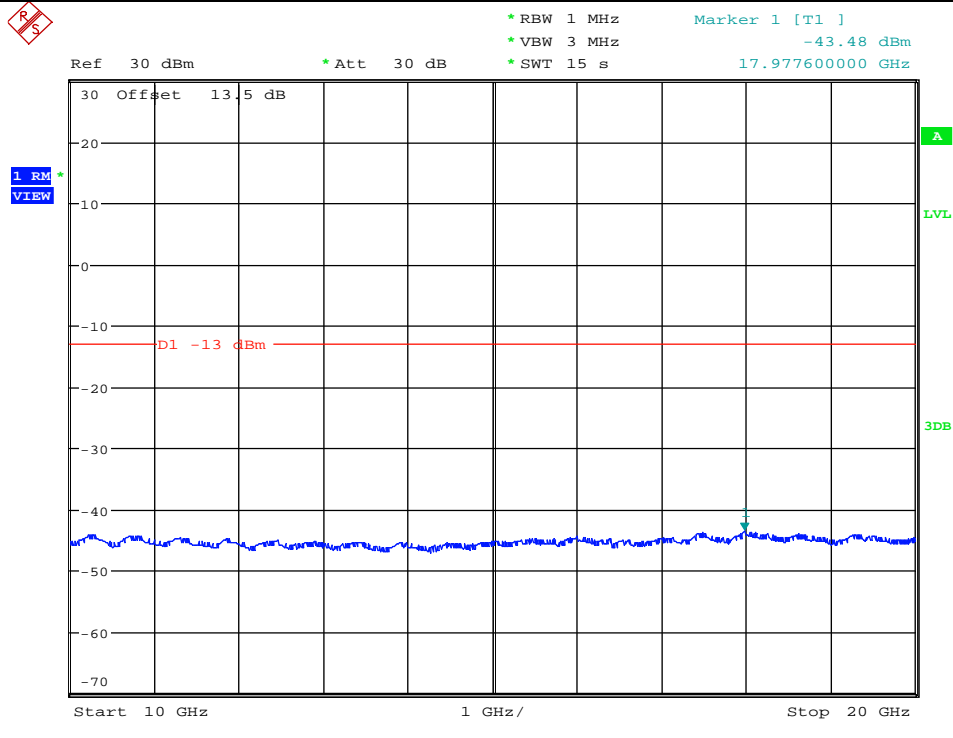


Date: 17.NOV.2022 18:25:40

Band 5 CSE 1.4MHz-L-QPSK-1RB0-30MHz-10GHz

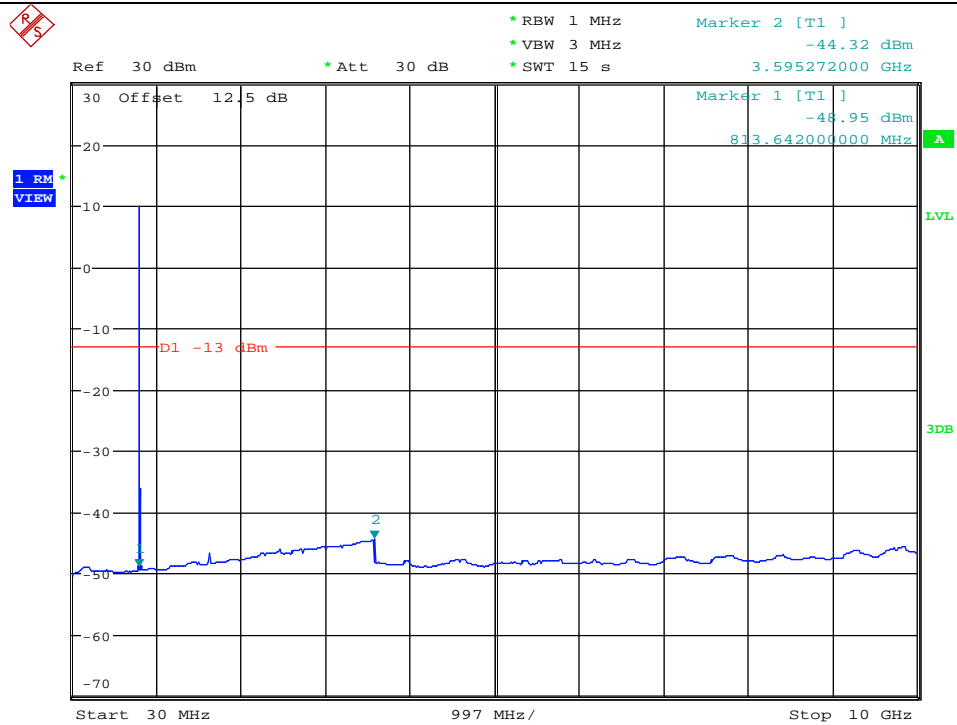


Date: 17.NOV.2022 18:48:30

Band 5 CSE 1.4MHz-L-16QAM-1RB0-30MHz-10GHz

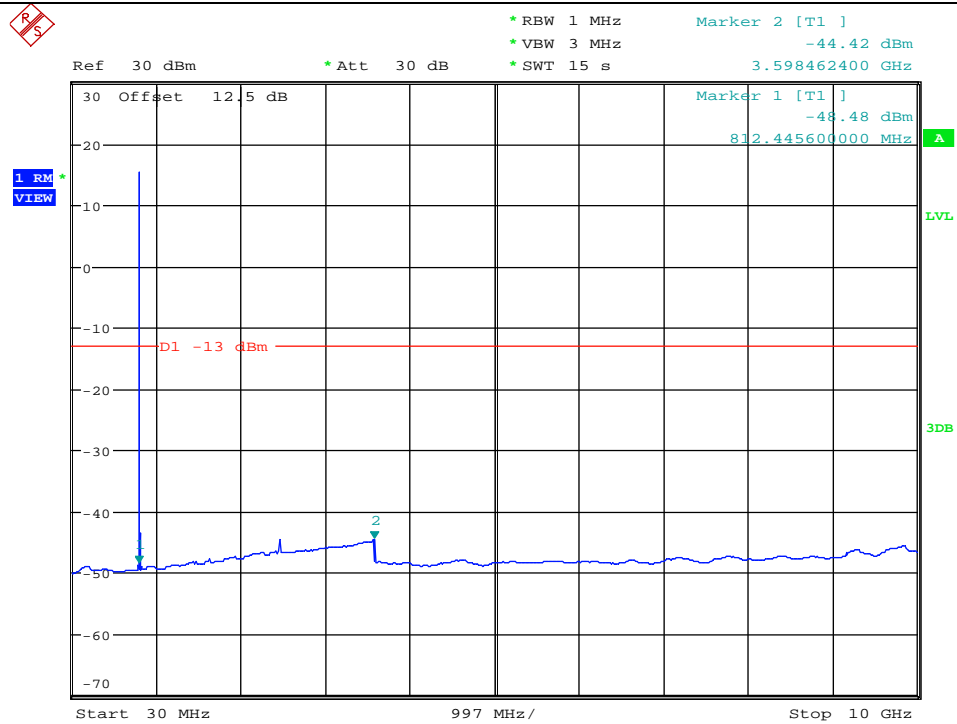


Date: 17.NOV.2022 19:29:32


Band 5 CSE 1.4MHz-M-QPSK-1RB0-30MHz-10GHz

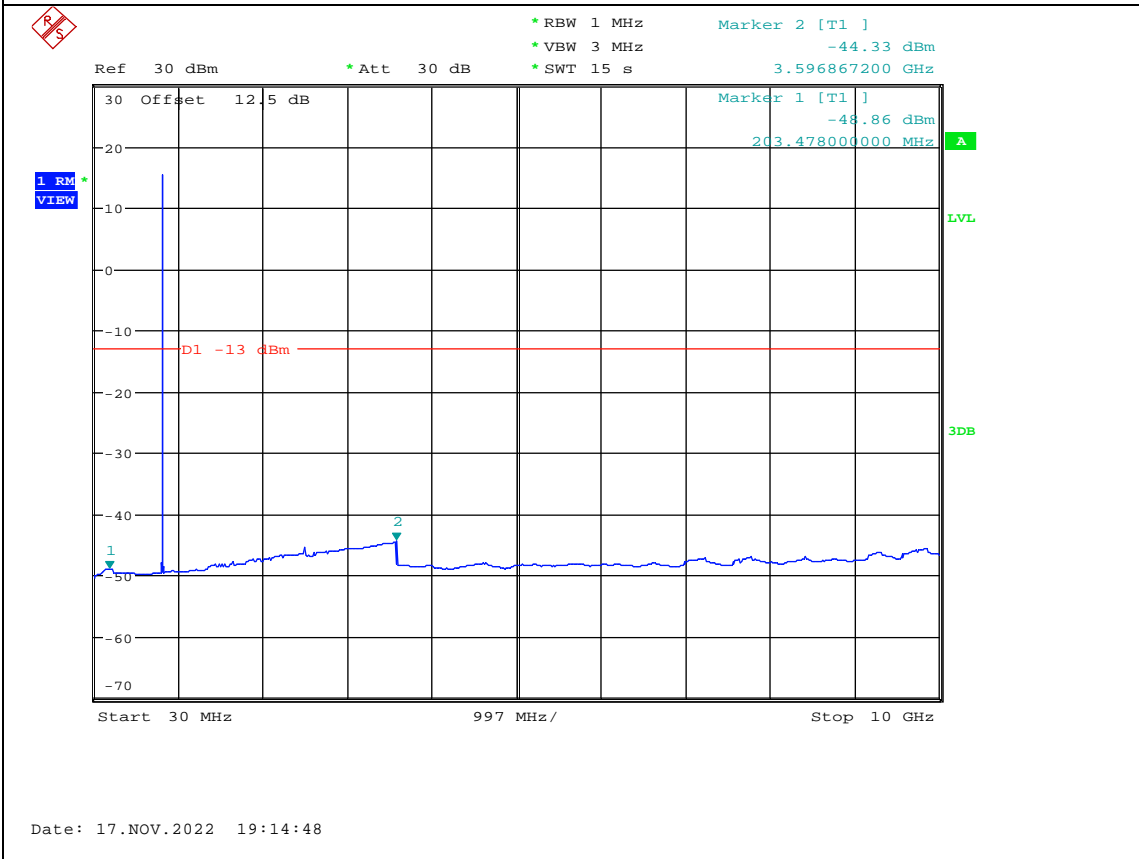

Band 5 CSE 1.4MHz-M-16QAM-1RB0-30MHz-10GHz

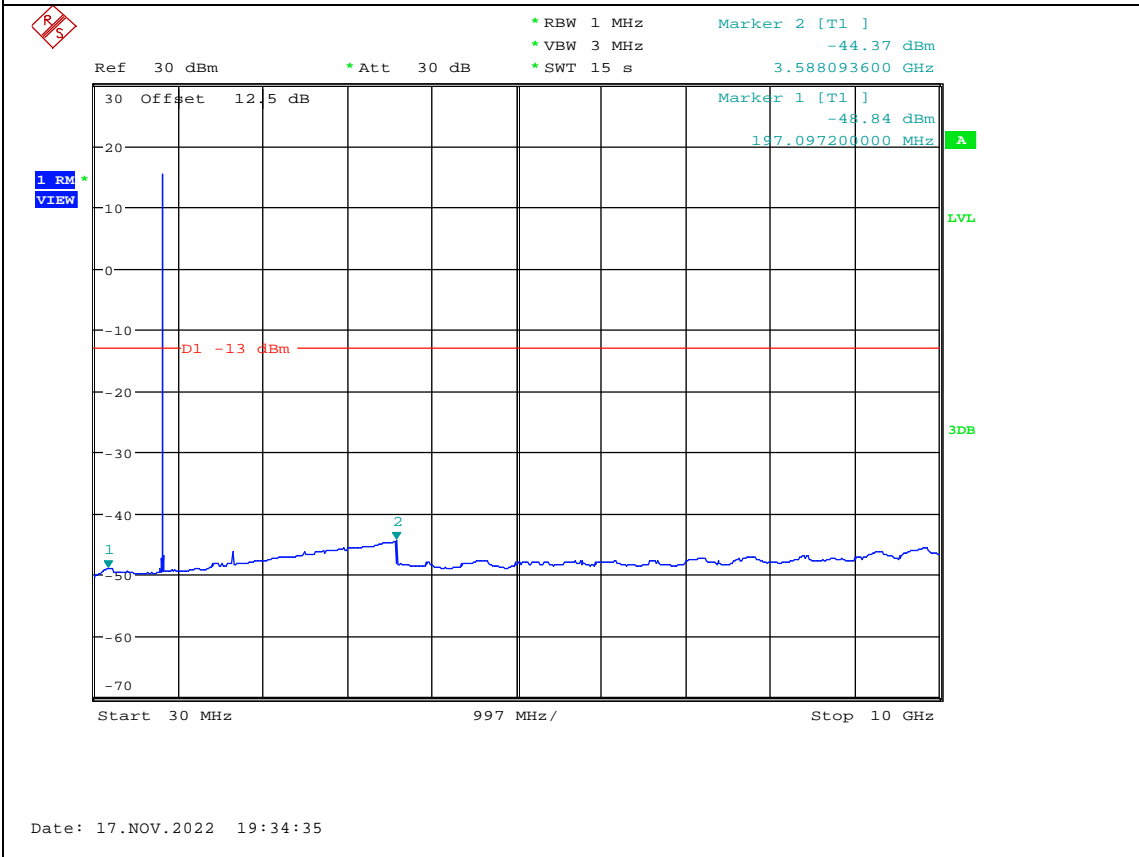


Band 5 CSE 1.4MHz-H-QPSK-1RB0-30MHz-10GHz

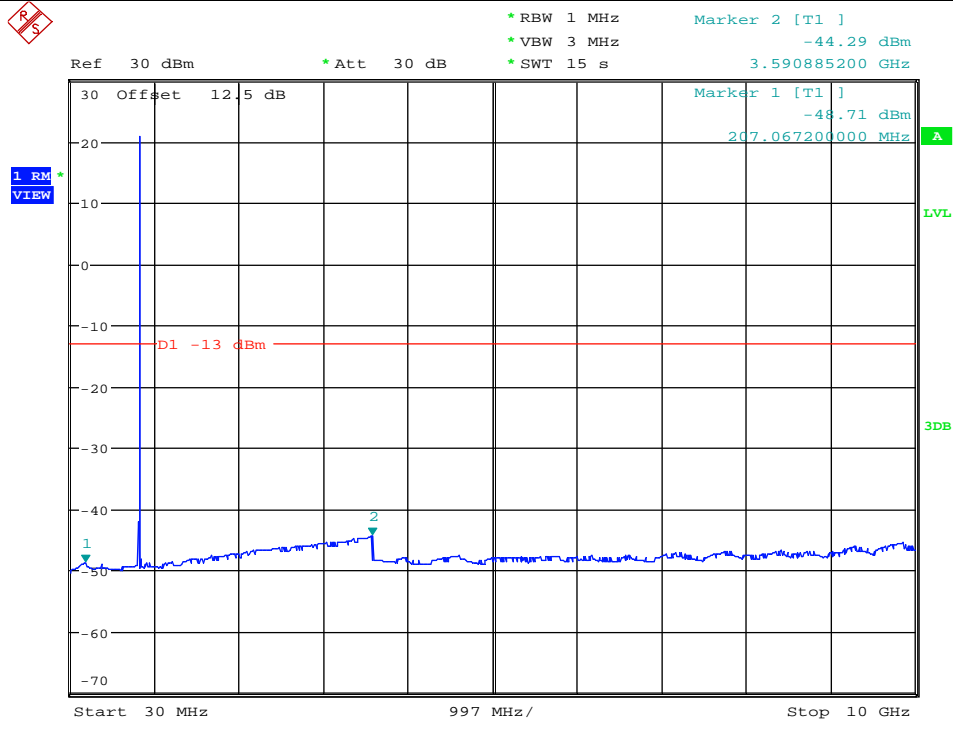


Date: 17.NOV.2022 19:21:37

Band 5 CSE 1.4MHz-H-16QAM-1RB0-30MHz-10GHz

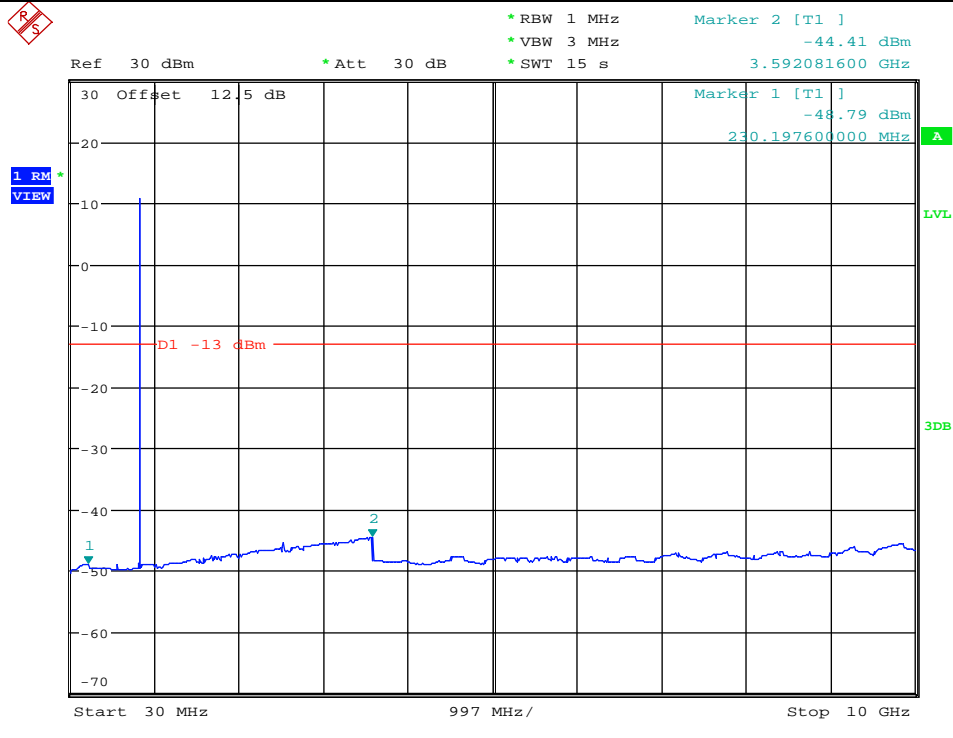


Date: 17.NOV.2022 19:40:29

Band 5 CSE 3MHz-L-QPSK-1RB0-30MHz-10GHz

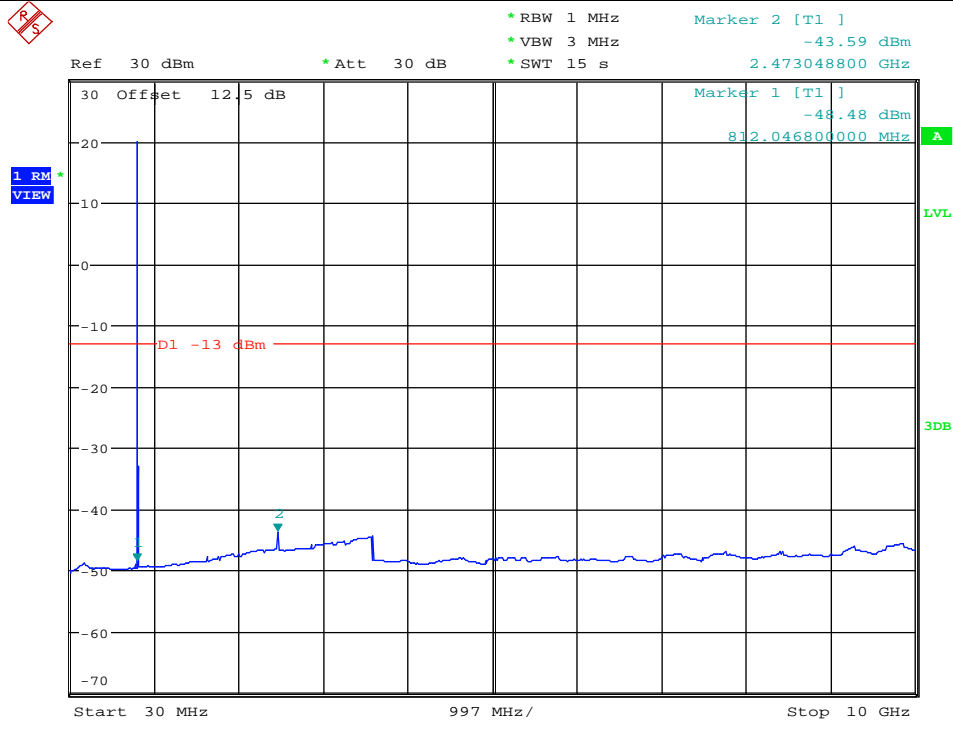


Date: 17.NOV.2022 19:49:01

Band 5 CSE 3MHz-L-16QAM-1RB0-30MHz-10GHz

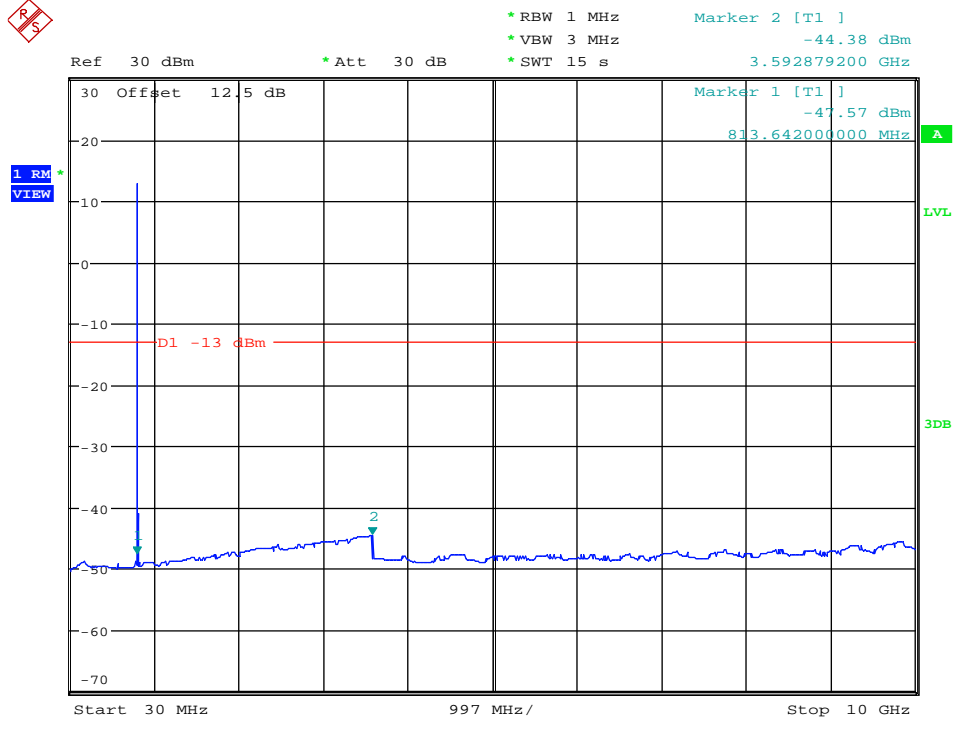


Date: 17.NOV.2022 20:11:37

Band 5 CSE 3MHz-M-QPSK-1RB0-30MHz-10GHz

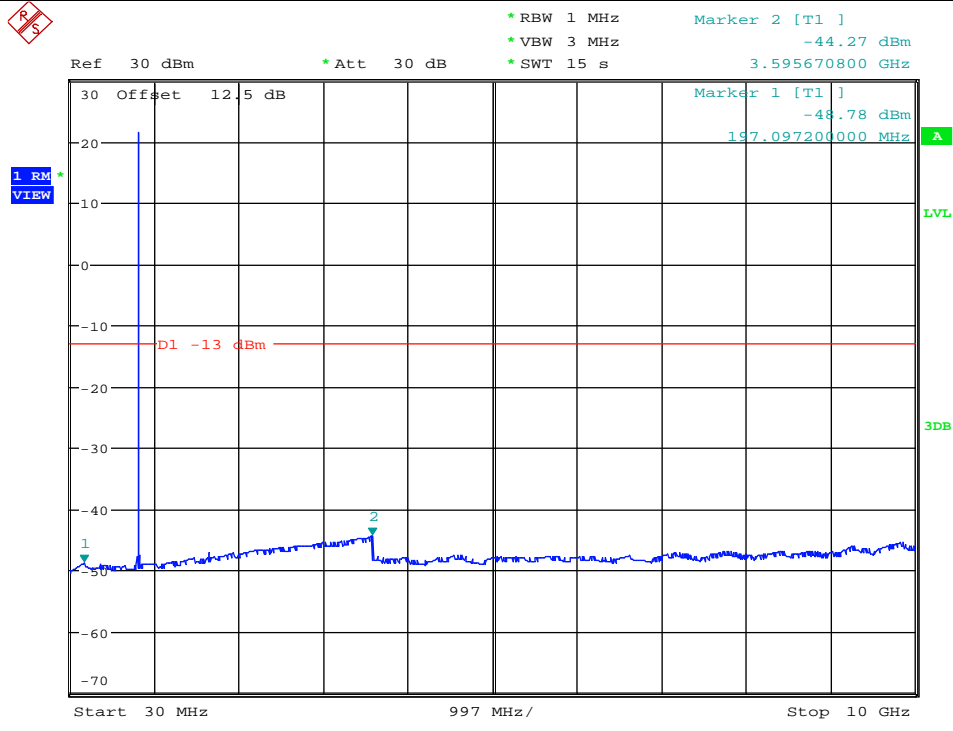


Date: 17.NOV.2022 19:55:23

Band 5 CSE 3MHz-M-16QAM-1RB0-30MHz-10GHz

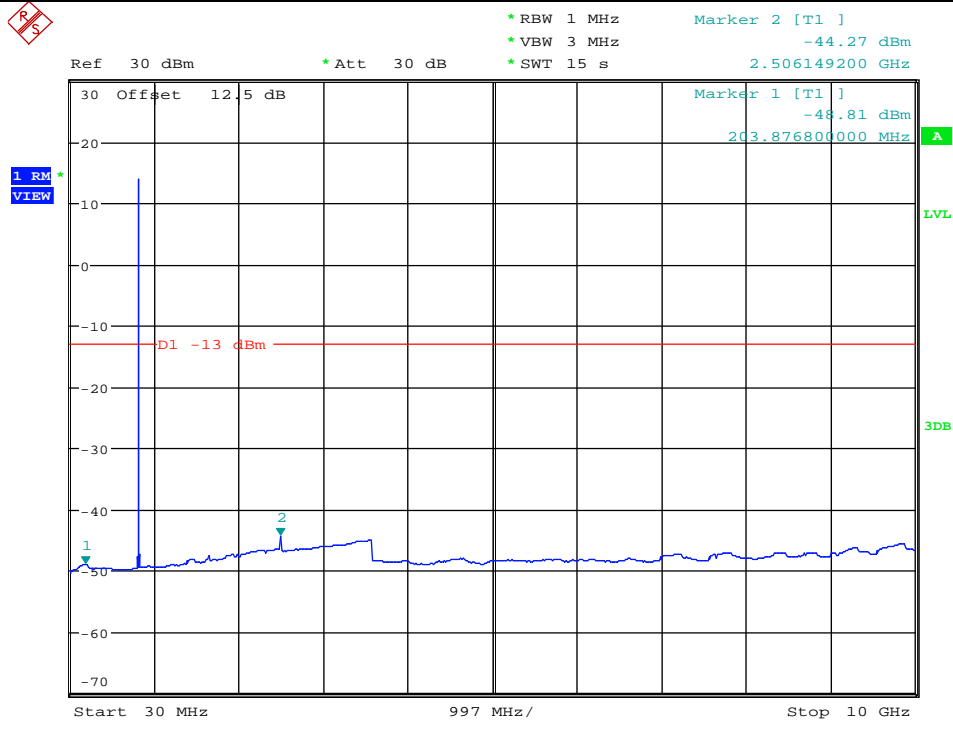


Date: 17.NOV.2022 20:16:50


Band 5 CSE 3MHz-H-QPSK-1RB0-30MHz-10GHz

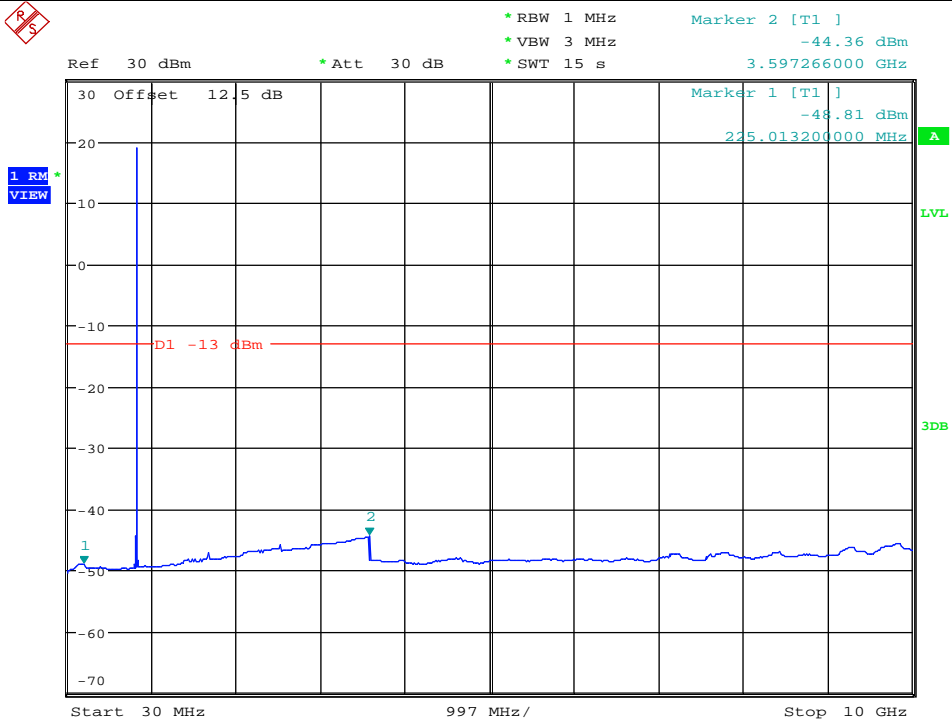

Band 5 CSE 3MHz-H-16QAM-1RB0-30MHz-10GHz

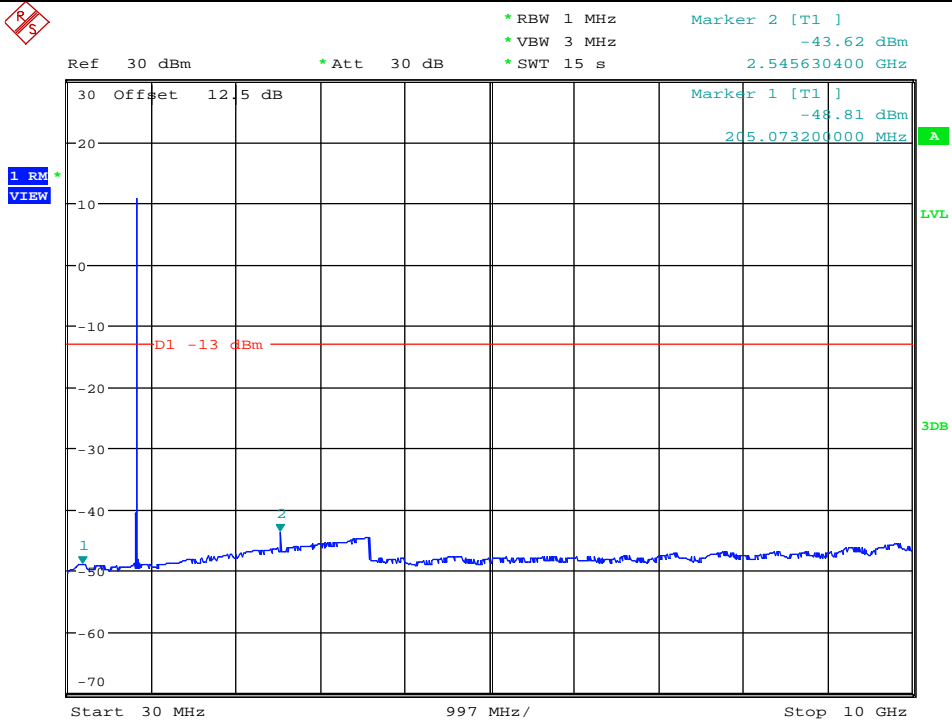


Band 5 CSE 5MHz-L-QPSK-1RB0-30MHz-10GHz

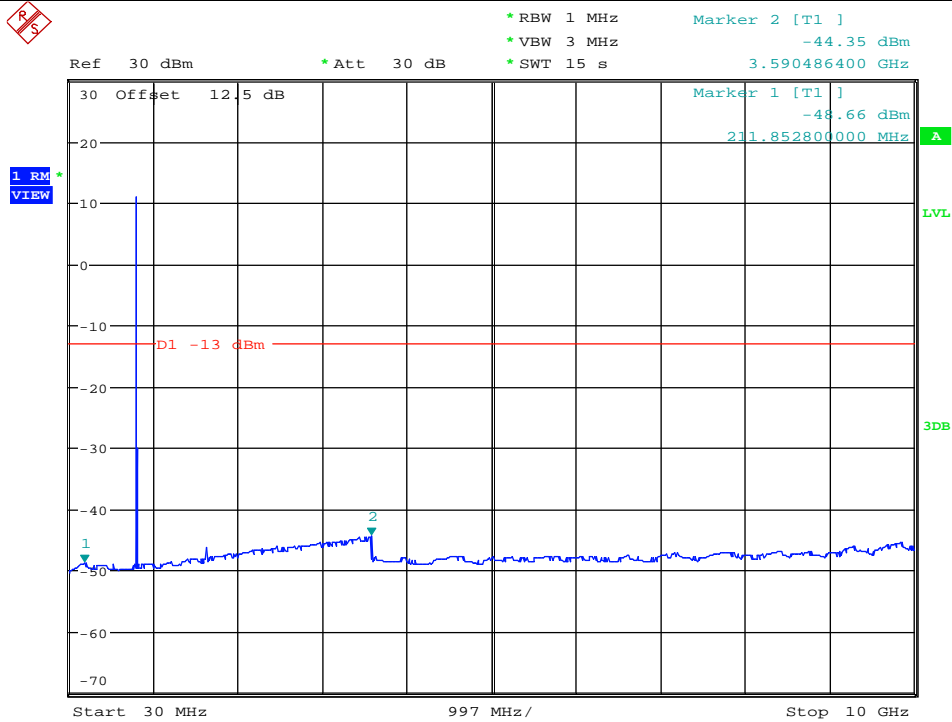


Date: 18.NOV.2022 09:28:14

Band 5 CSE 5MHz-L-16QAM-1RB0-30MHz-10GHz

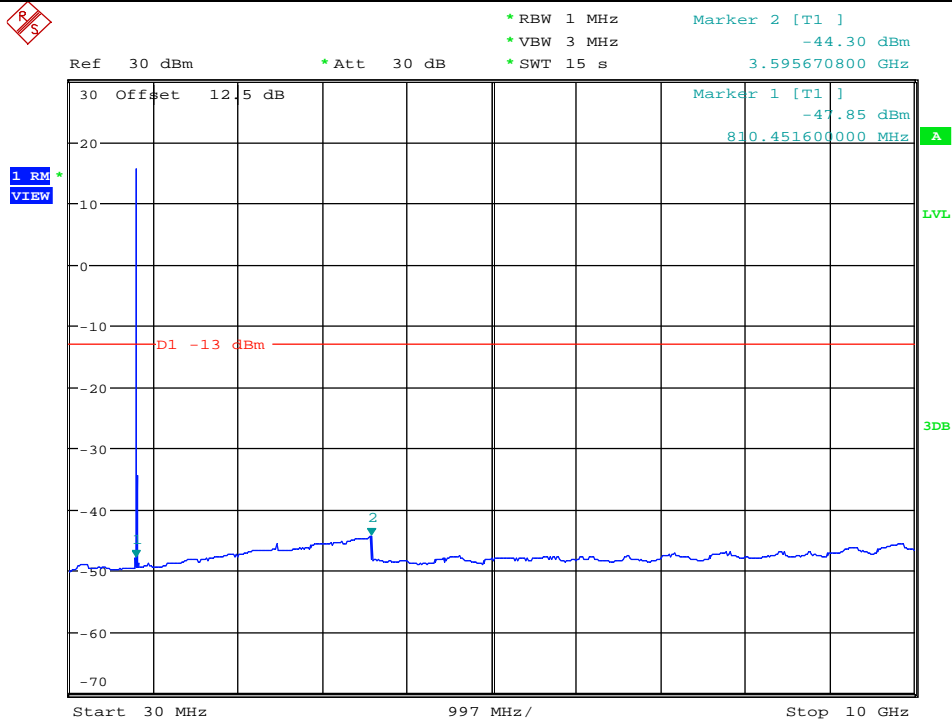


Date: 18.NOV.2022 09:42:49

Band 5 CSE 5MHz-M-QPSK-1RB0-30MHz-10GHz

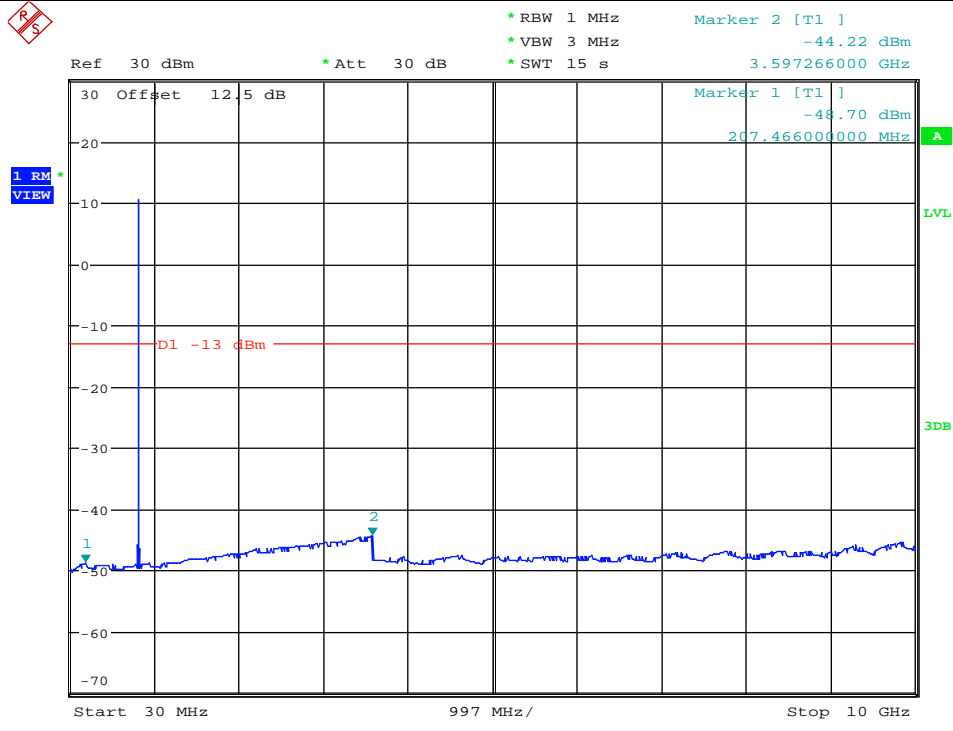


Date: 18.NOV.2022 09:32:03

Band 5 CSE 5MHz-M-16QAM-1RB0-30MHz-10GHz

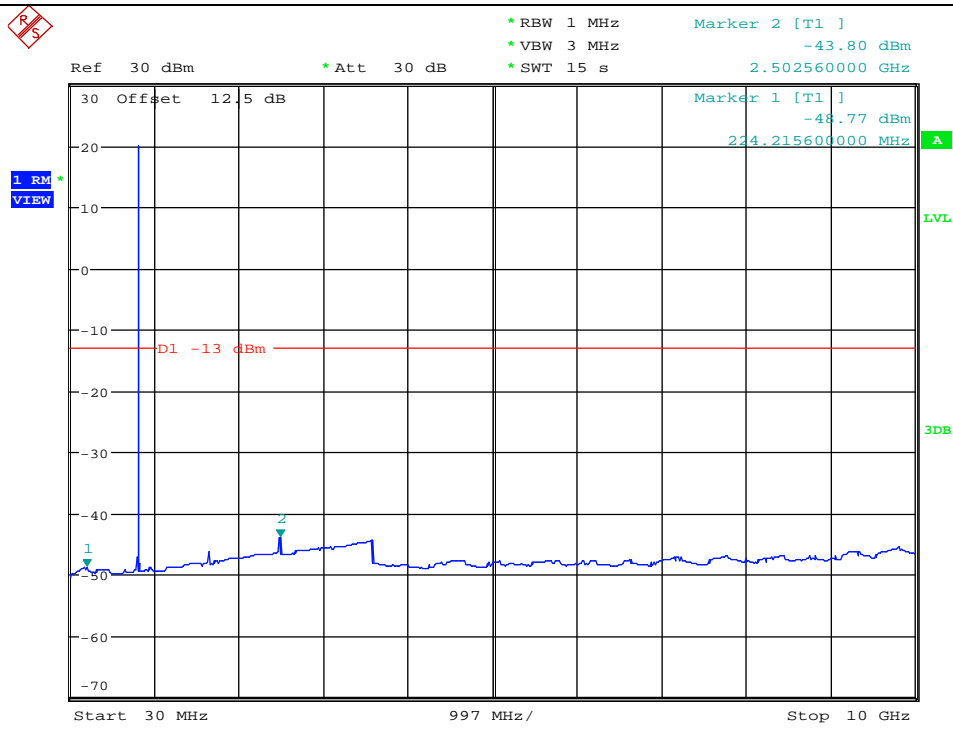


Date: 18.NOV.2022 09:47:53


Band 5 CSE 5MHz-H-QPSK-1RB0-30MHz-10GHz

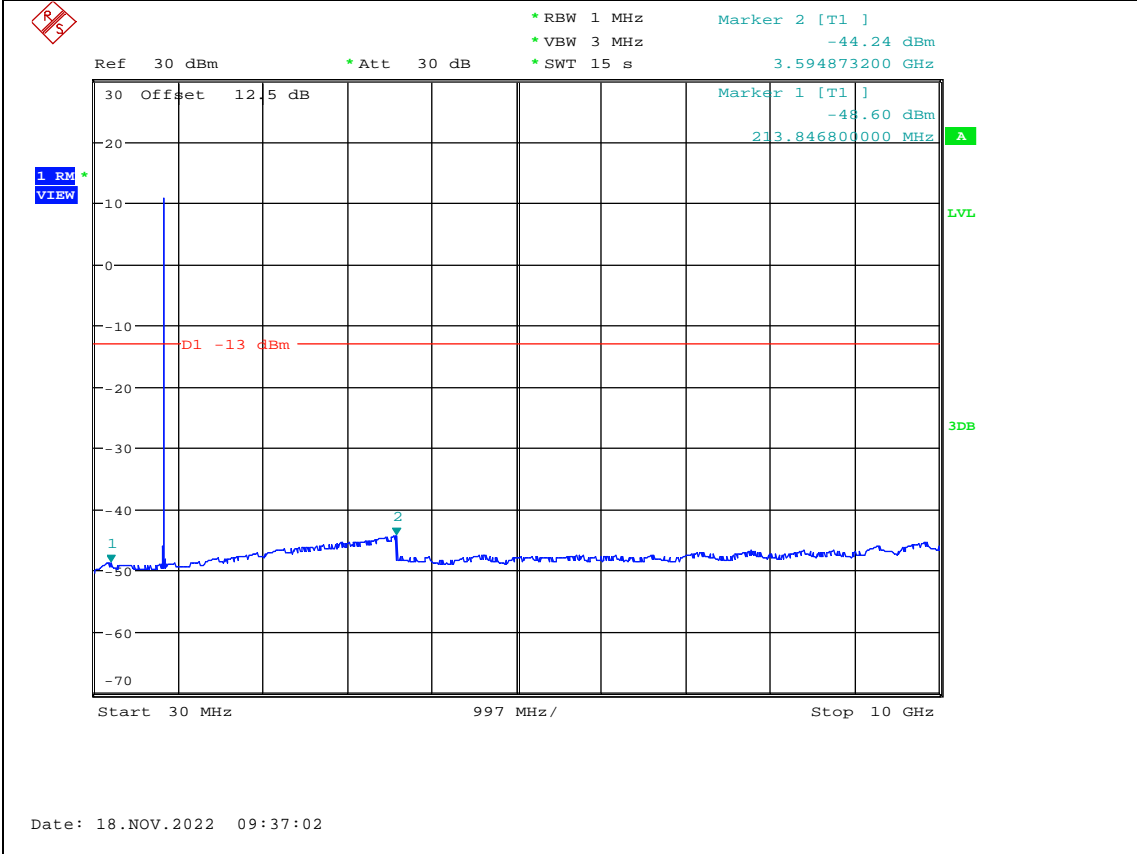

Band 5 CSE 5MHz-H-16QAM-1RB0-30MHz-10GHz

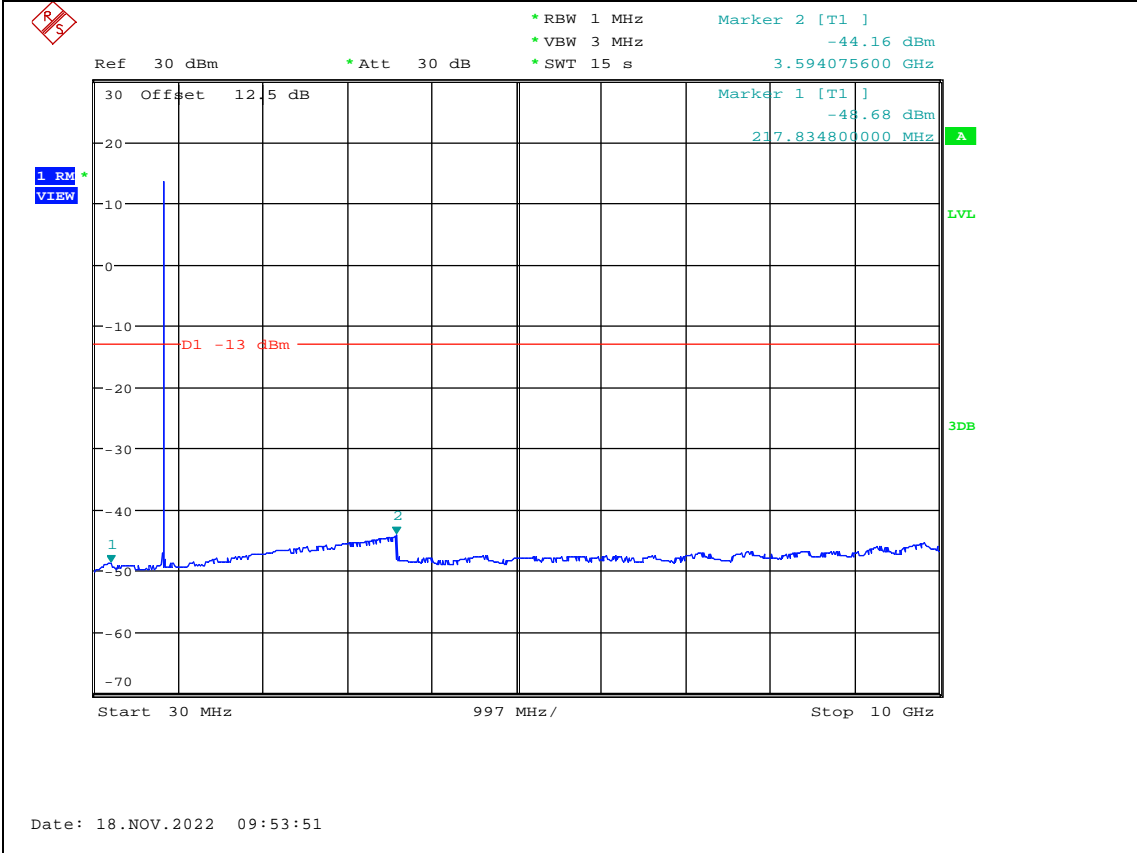


Band 5 CSE 10MHz-L-QPSK-1RB0-30MHz-10GHz

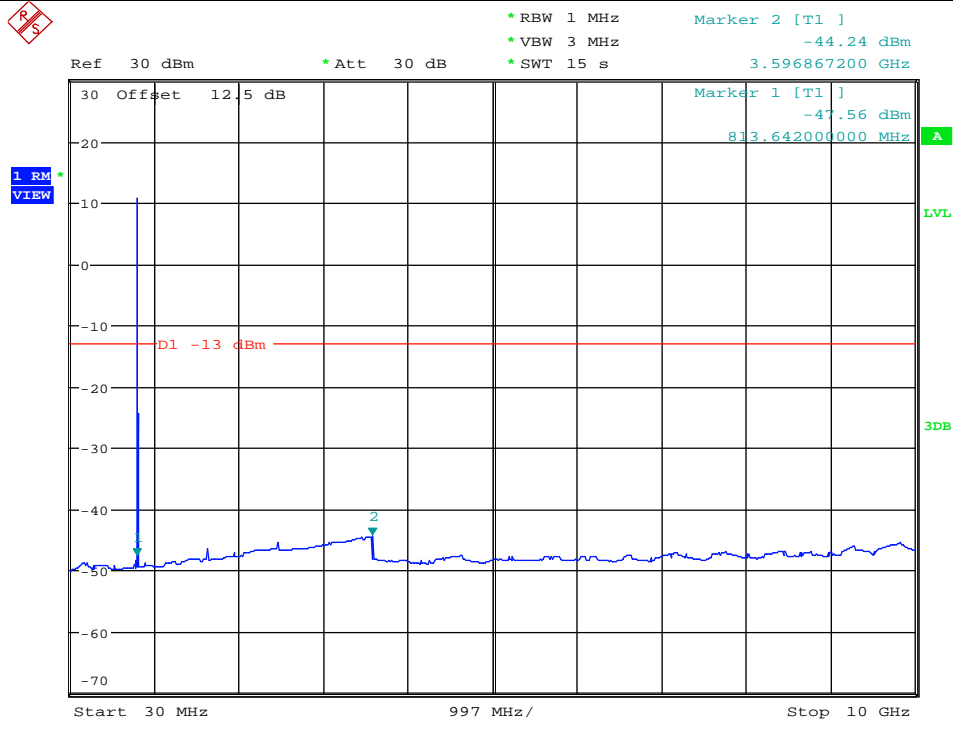


Date: 18.NOV.2022 10:01:41

Band 5 CSE 10MHz-L-16QAM-1RB0-30MHz-10GHz

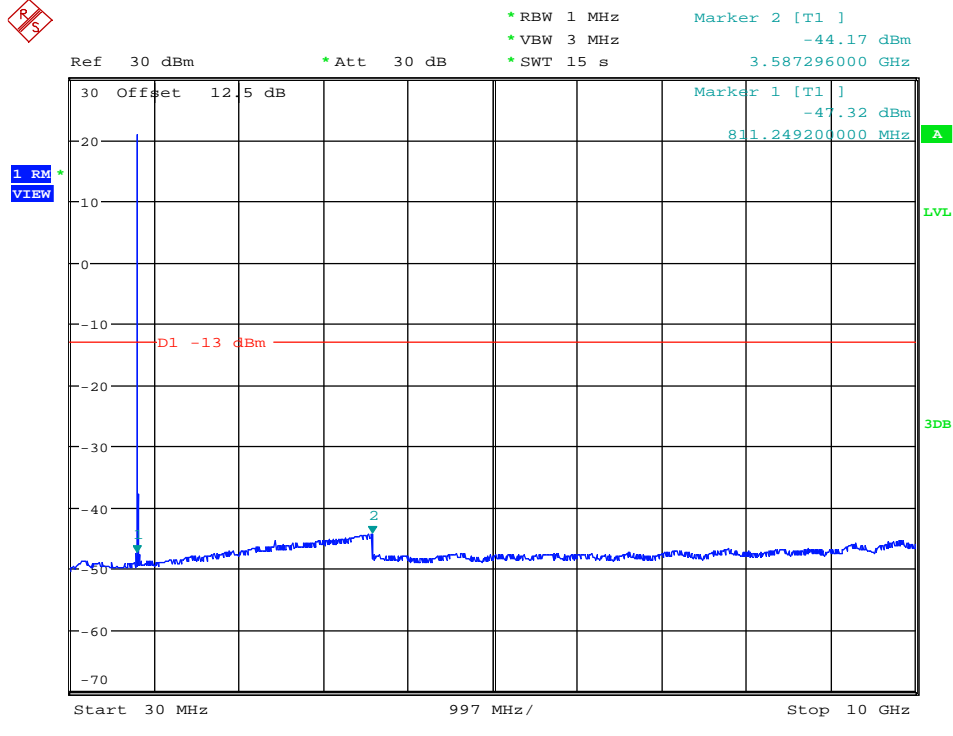


Date: 18.NOV.2022 10:20:56

Band 5 CSE 10MHz-M-QPSK-1RB0-30MHz-10GHz

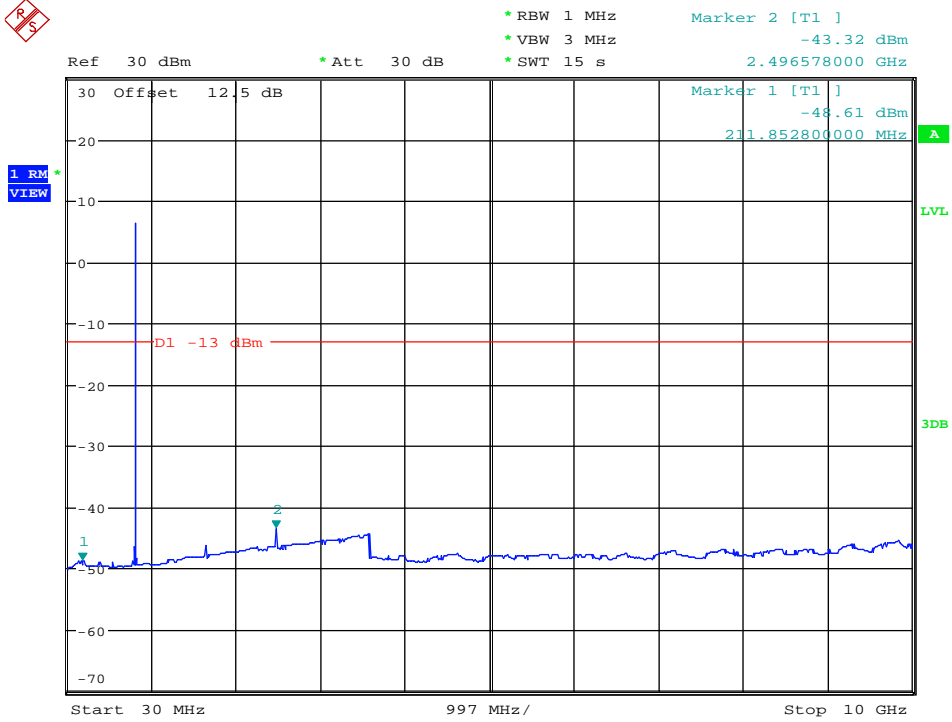


Date: 18.NOV.2022 10:06:37

Band 5 CSE 10MHz-M-16QAM-1RB0-30MHz-10GHz

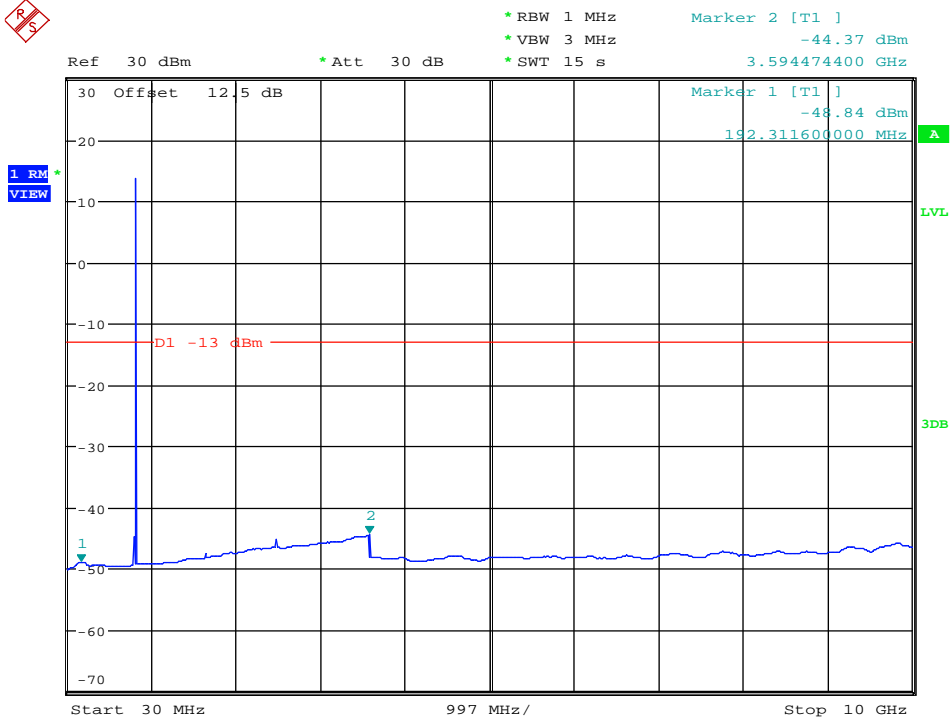


Date: 18.NOV.2022 10:34:47

Band 5 CSE 10MHz-H-QPSK-1RB0-30MHz-10GHz

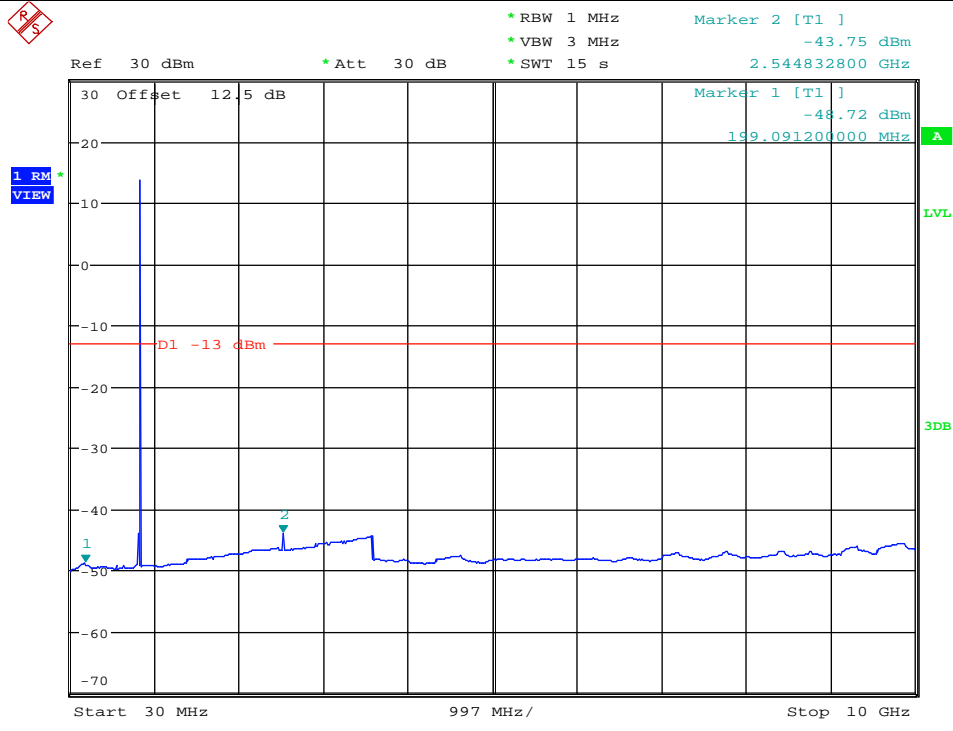


Date: 18.NOV.2022 10:13:51

Band 5 CSE 10MHz-H-16QAM-1RB0-30MHz-10GHz

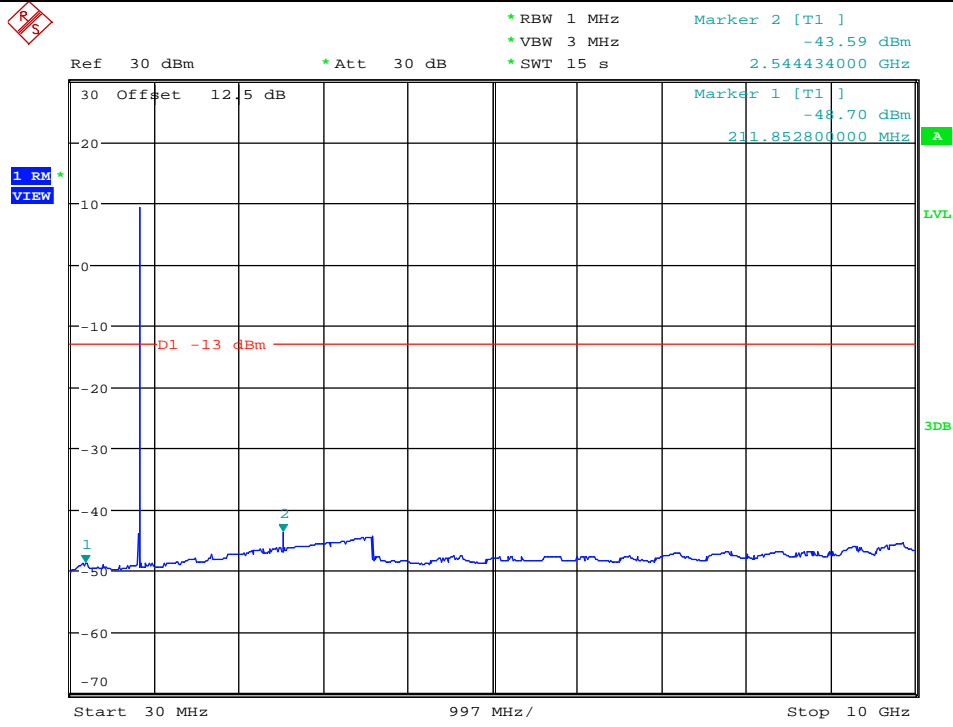


Date: 18.NOV.2022 10:49:27


Band 12 CSE 1.4MHz-L-QPSK-1RB0-30MHz-10GHz

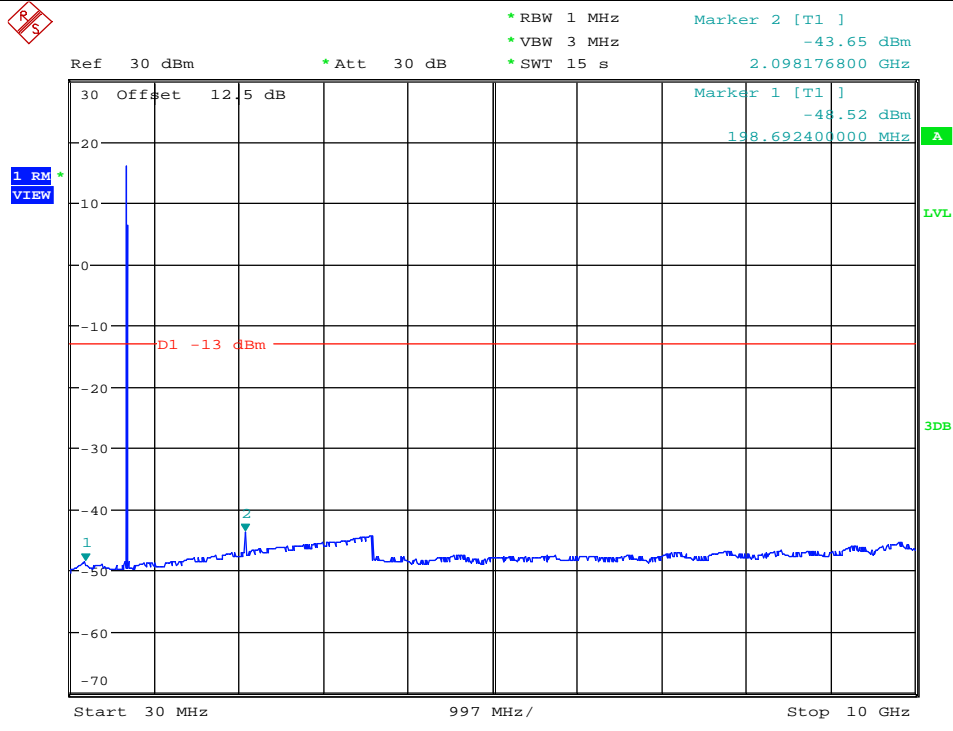

Band 12 CSE 1.4MHz-L-16QAM-1RB0-30MHz-10GHz

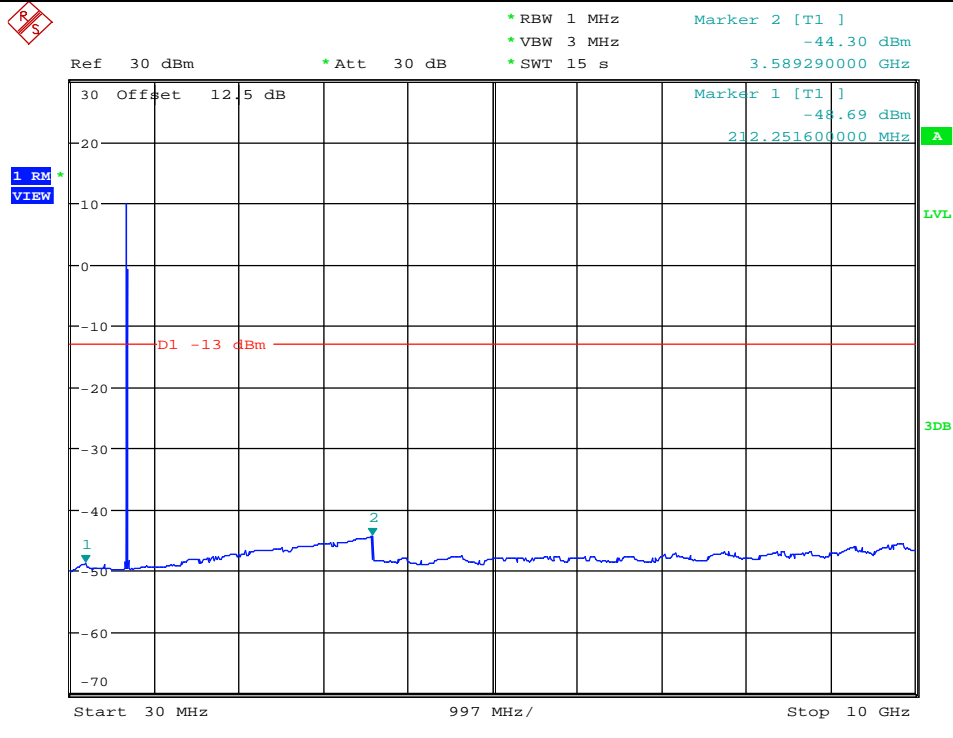


Band 12 CSE 1.4MHz-M-QPSK-1RB0-30MHz-10GHz

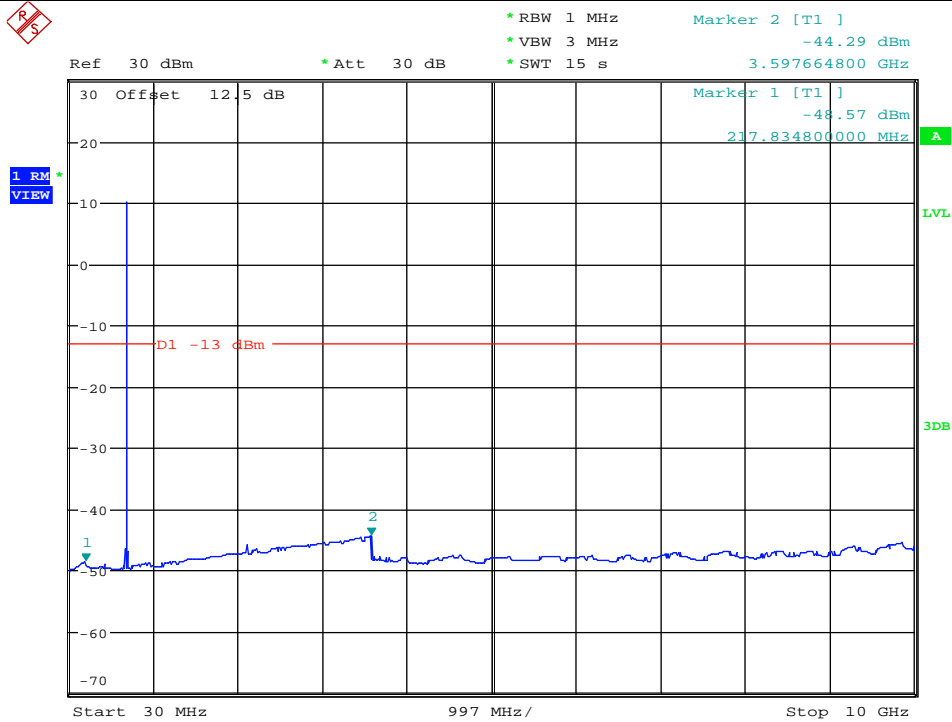


Date: 18.NOV.2022 11:02:42

Band 12 CSE 1.4MHz-M-16QAM-1RB0-30MHz-10GHz

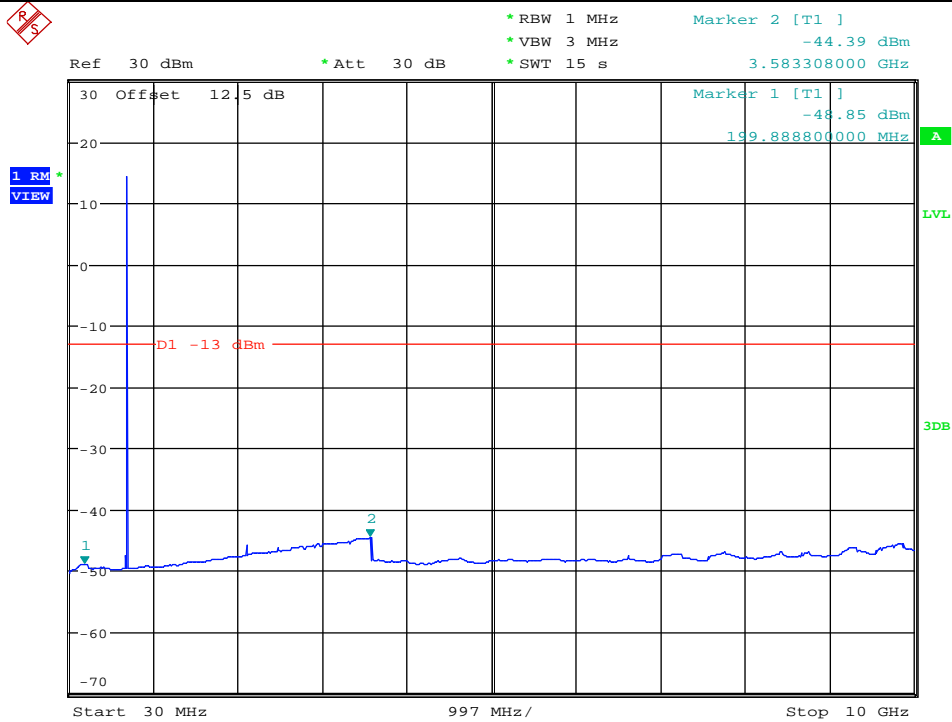


Date: 18.NOV.2022 11:23:31

Band 12 CSE 1.4MHz-H-QPSK-1RB0-30MHz-10GHz

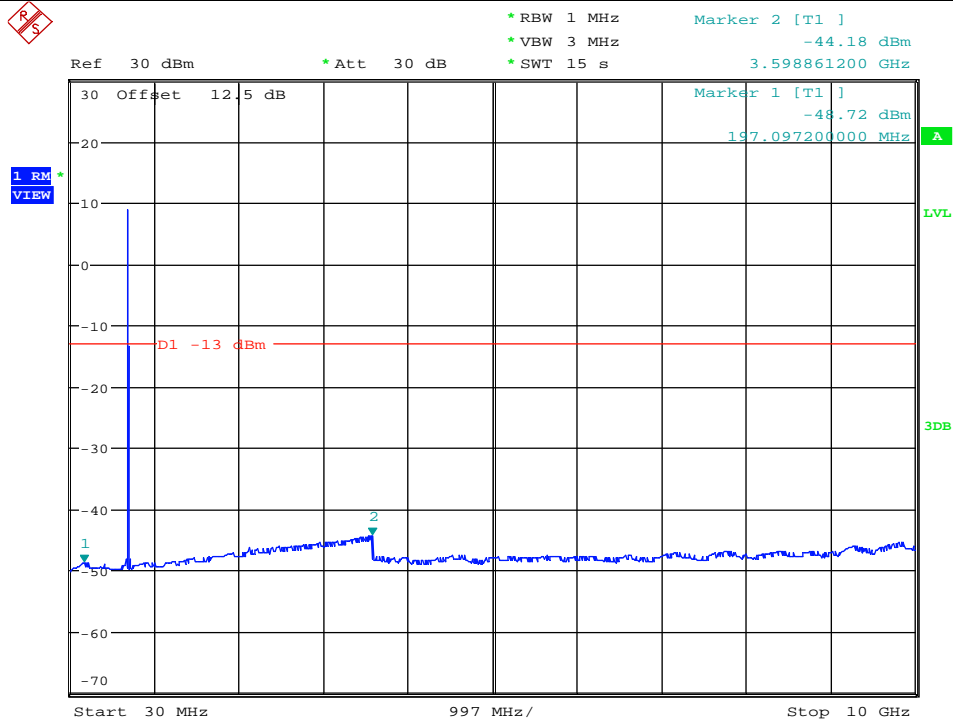


Date: 18.NOV.2022 11:08:20

Band 12 CSE 1.4MHz-H-16QAM-1RB0-30MHz-10GHz

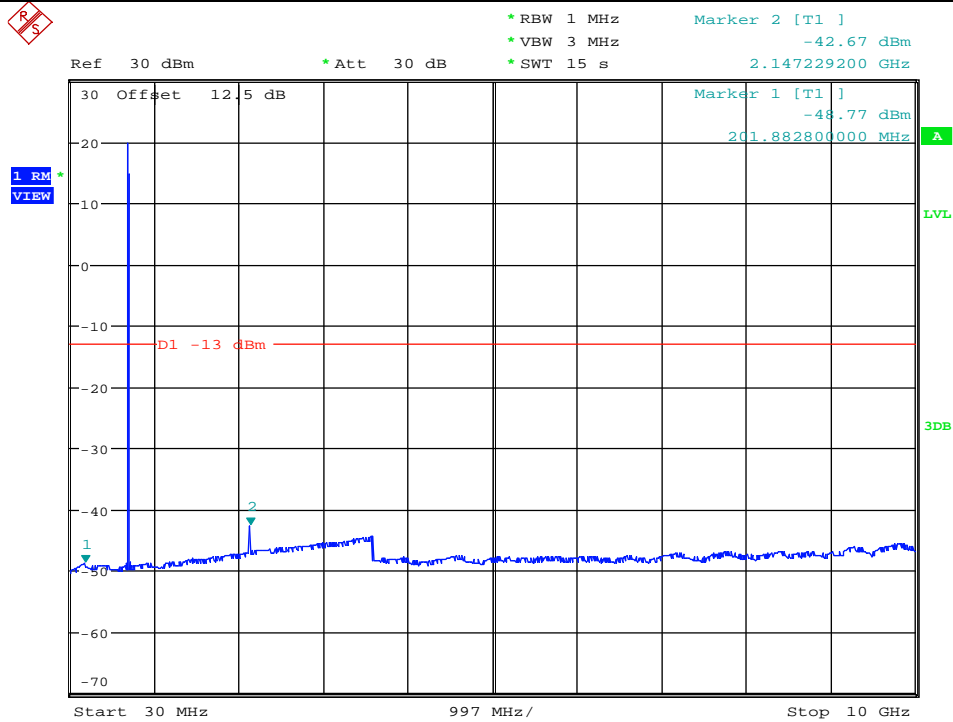


Date: 18.NOV.2022 11:29:29

Band 12 CSE 3MHz-L-QPSK-1RB0-30MHz-10GHz

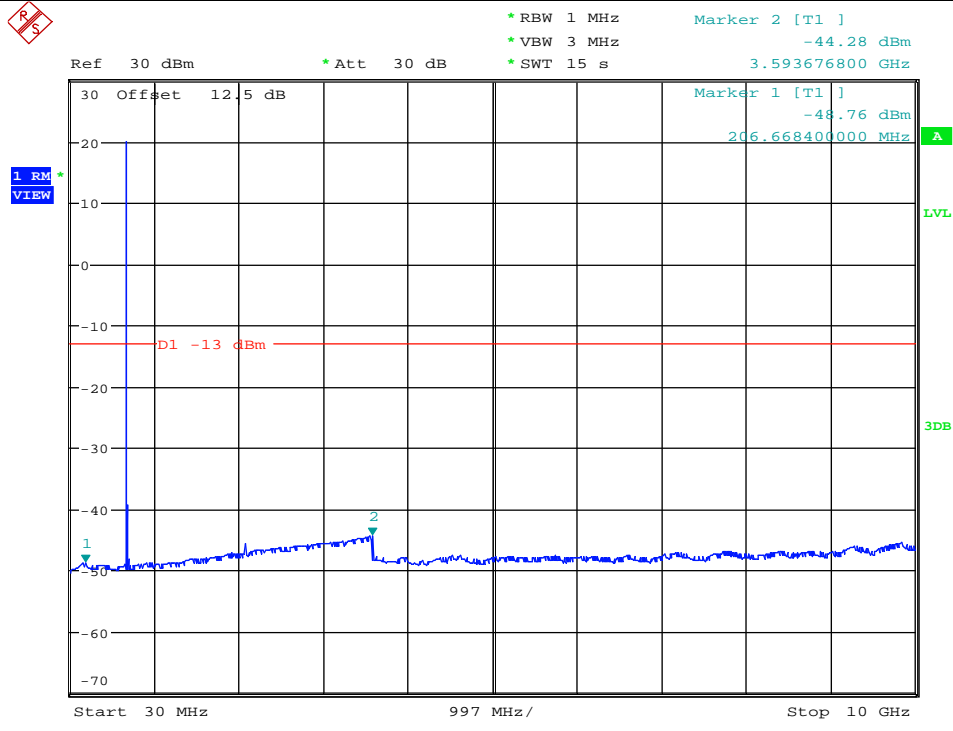


Date: 18.NOV.2022 11:40:09

Band 12 CSE 3MHz-L-16QAM-1RB0-30MHz-10GHz

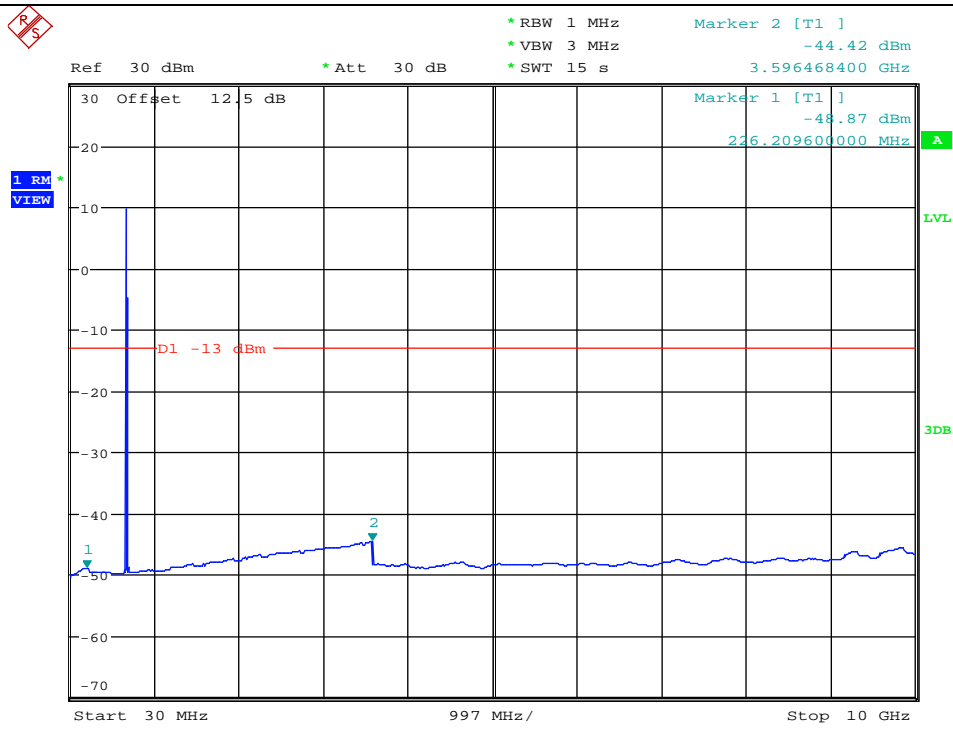


Date: 18.NOV.2022 12:02:22

Band 12 CSE 5MHz-L-QPSK-1RB0-30MHz-10GHz

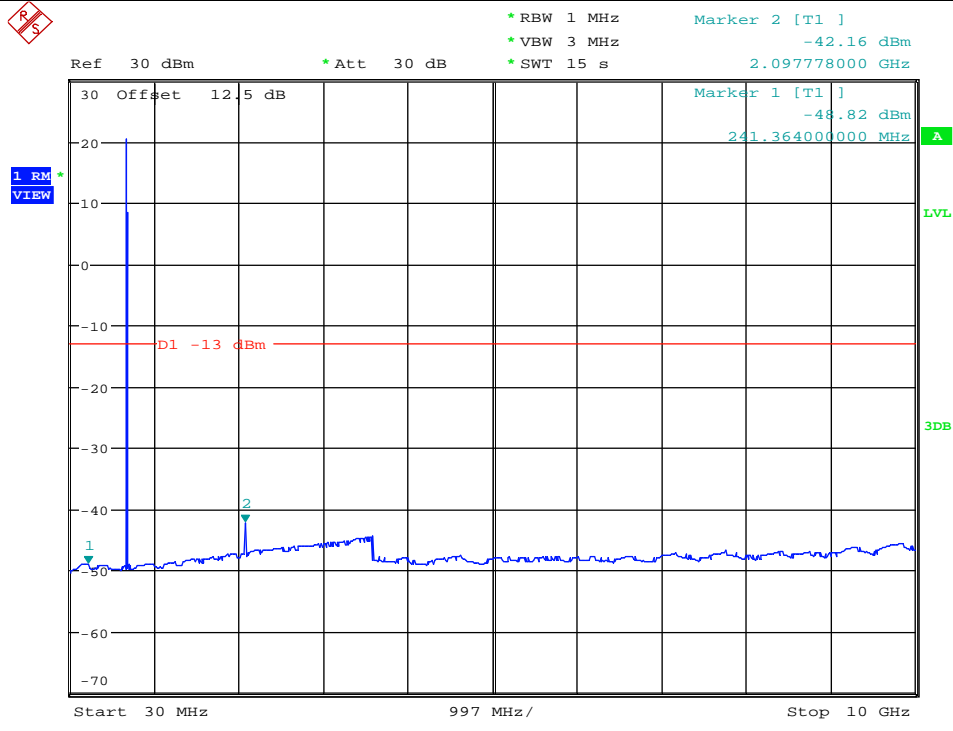


Date: 18.NOV.2022 13:15:07

Band 12 CSE 5MHz-L-16QAM-1RB0-30MHz-10GHz

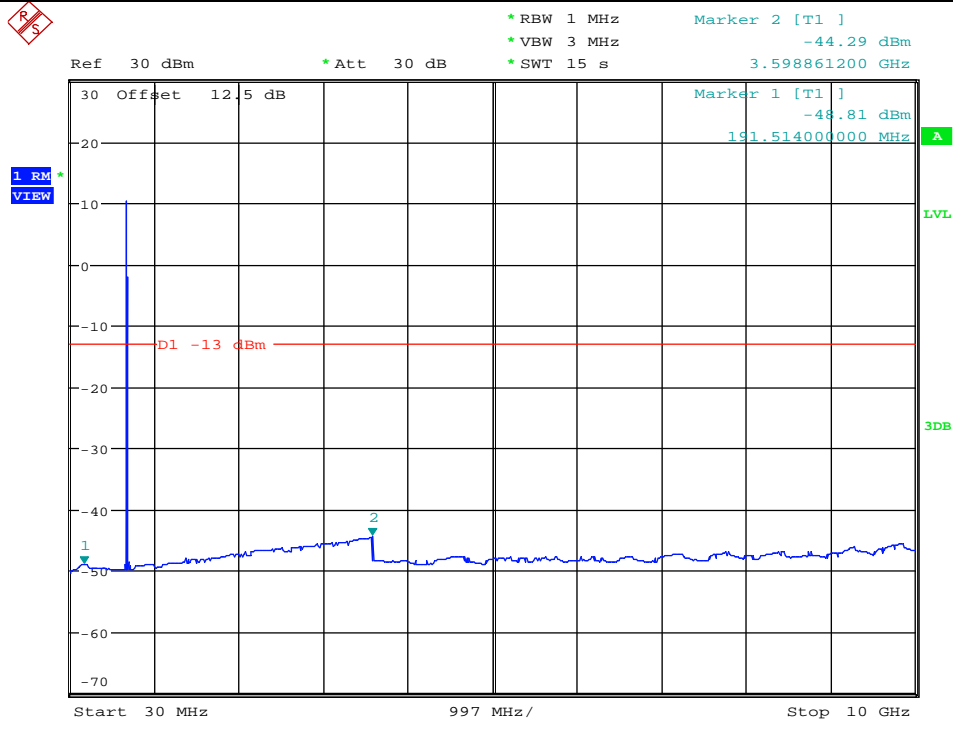


Date: 18.NOV.2022 13:30:19

Band 12 CSE 5MHz-H-QPSK-1RB0-30MHz-10GHz

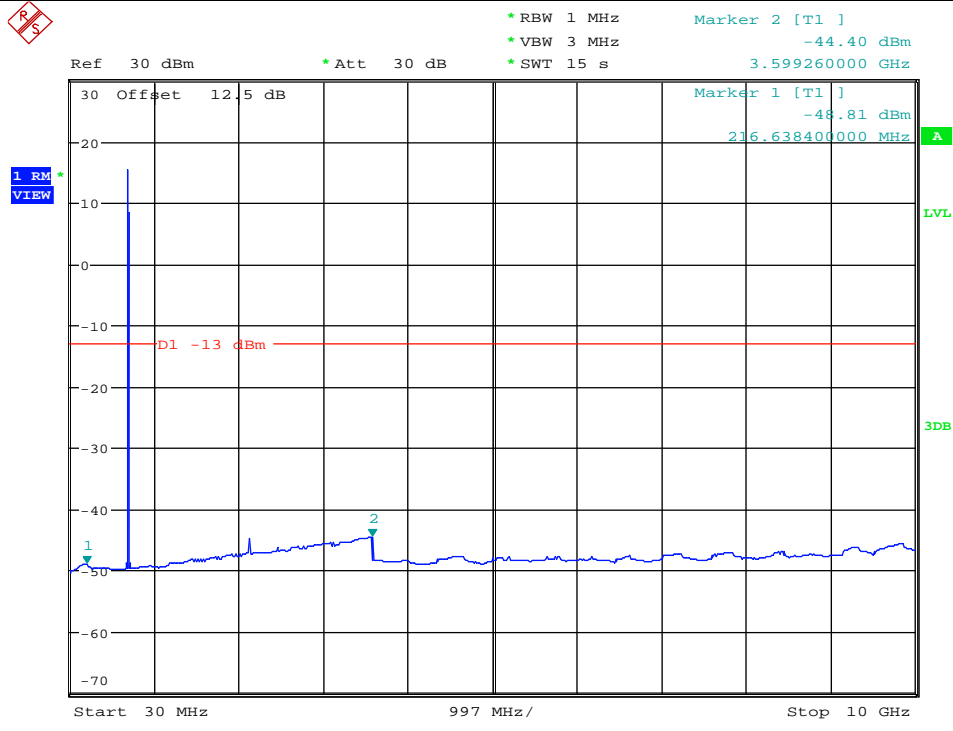


Date: 18.NOV.2022 13:25:08

Band 12 CSE 5MHz-H-16QAM-1RB0-30MHz-10GHz

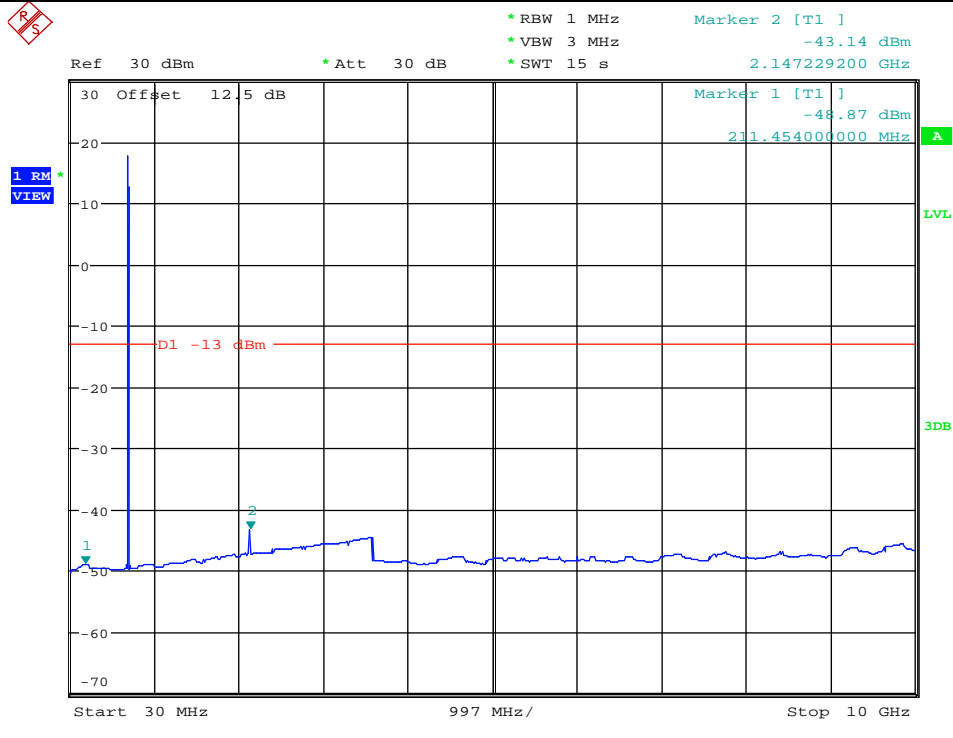


Date: 18.NOV.2022 13:40:27

Band 12 CSE 10MHz-M-QPSK-1RB0-30MHz-10GHz

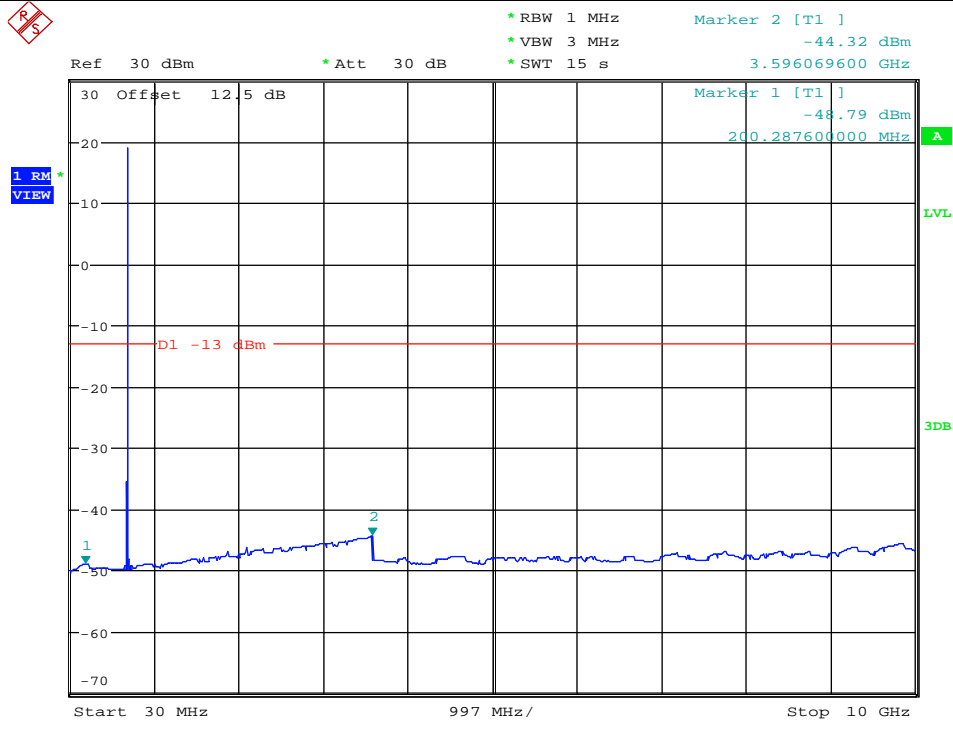


Date: 18.NOV.2022 13:51:57

Band 12 CSE 10MHz-M-16QAM-1RB0-30MHz-10GHz

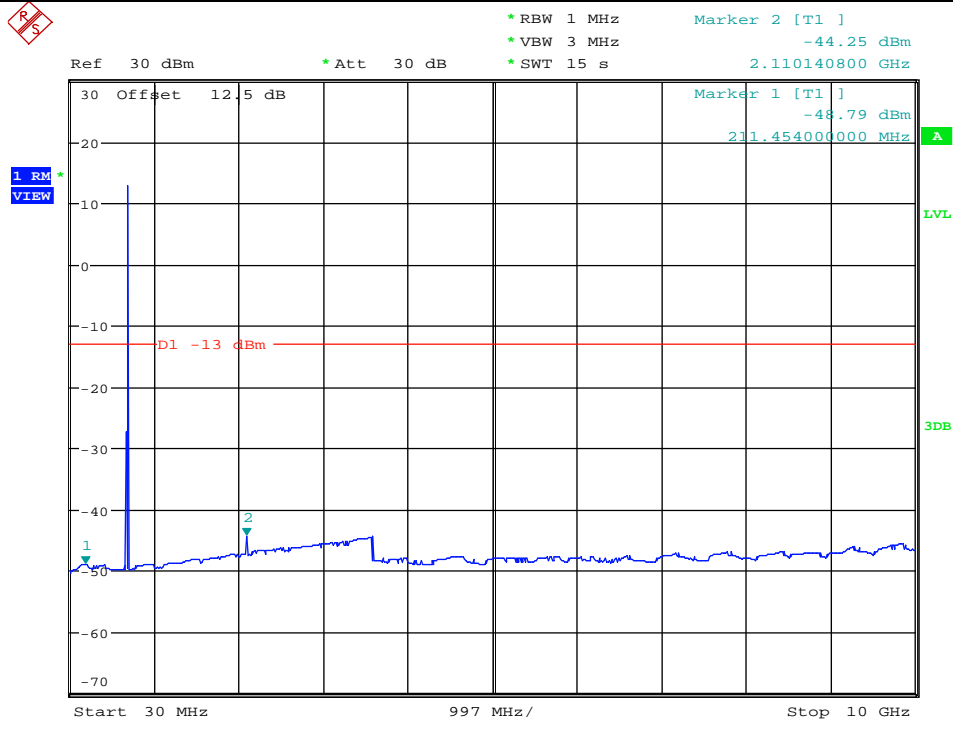


Date: 18.NOV.2022 14:10:28

Band 13 CSE 5MHz-L-QPSK-1RB0-30MHz-10GHz

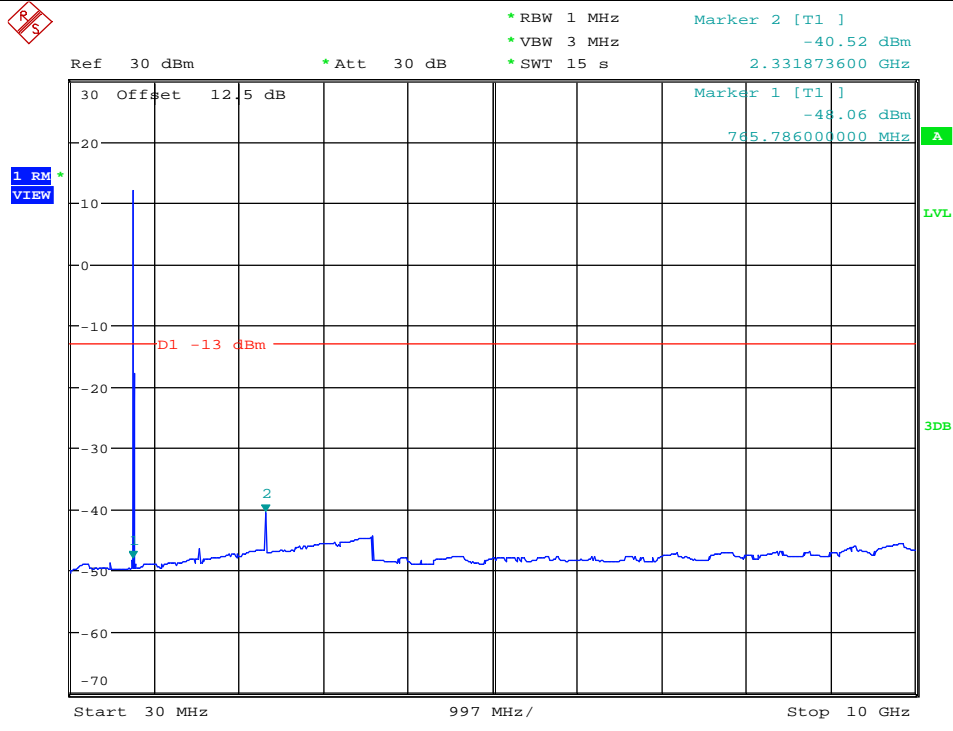


Date: 18.NOV.2022 16:41:03

Band 13 CSE 5MHz-L-16QAM-1RB0-30MHz-10GHz

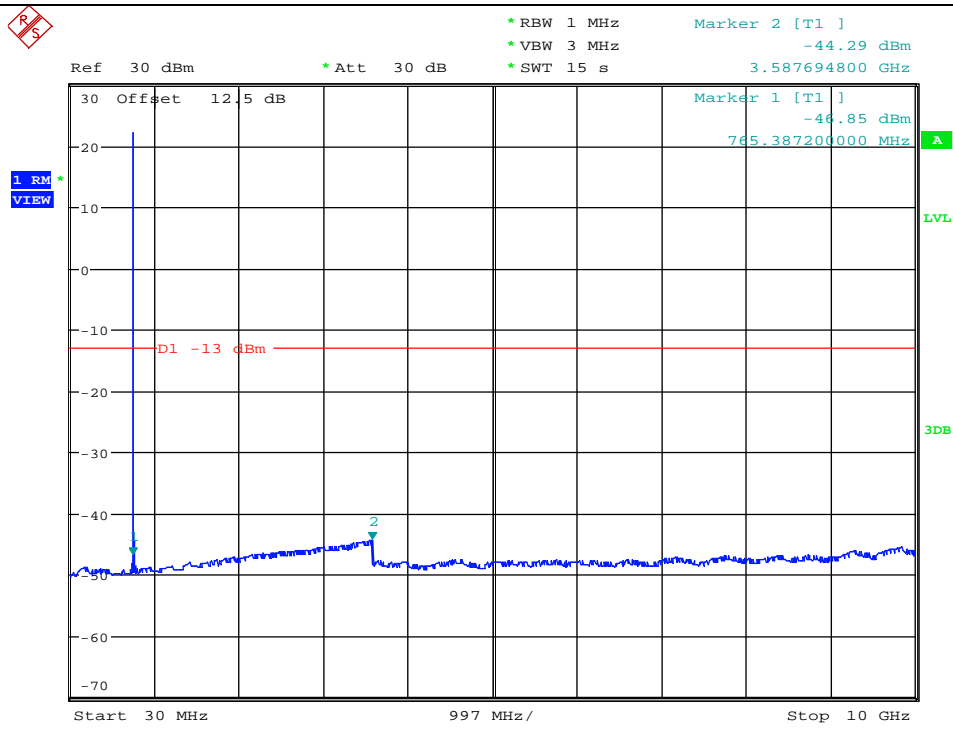


Date: 18.NOV.2022 16:54:38

Band 13 CSE 5MHz-M-QPSK-1RB0-30MHz-10GHz

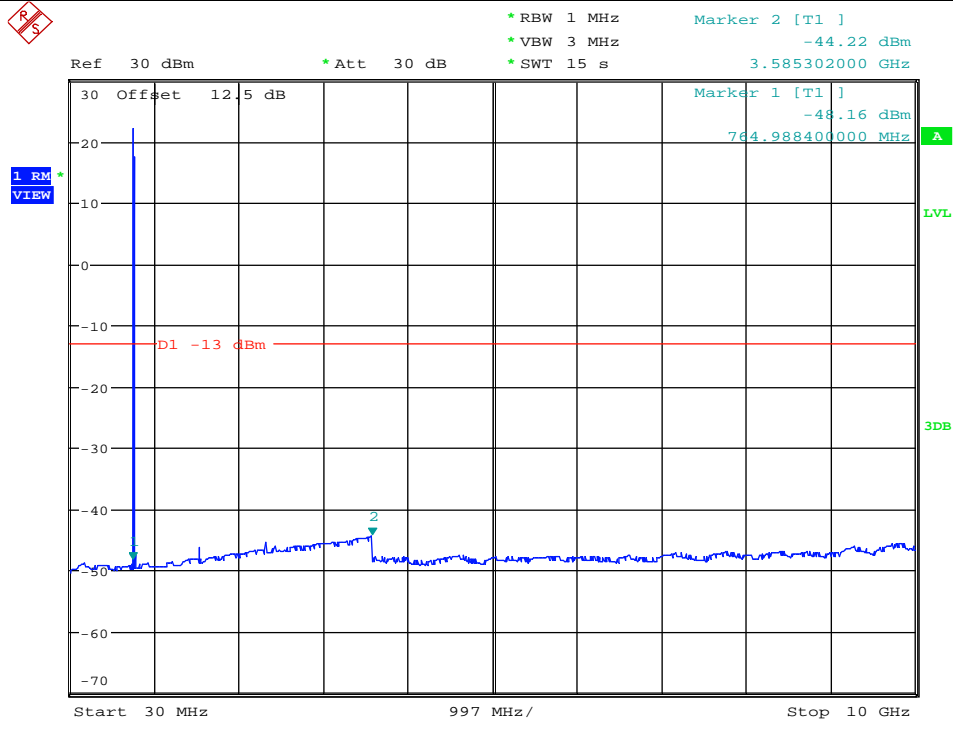


Date: 18.NOV.2022 16:44:09

Band 13 CSE 5MHz-M-16QAM-1RB0-30MHz-10GHz

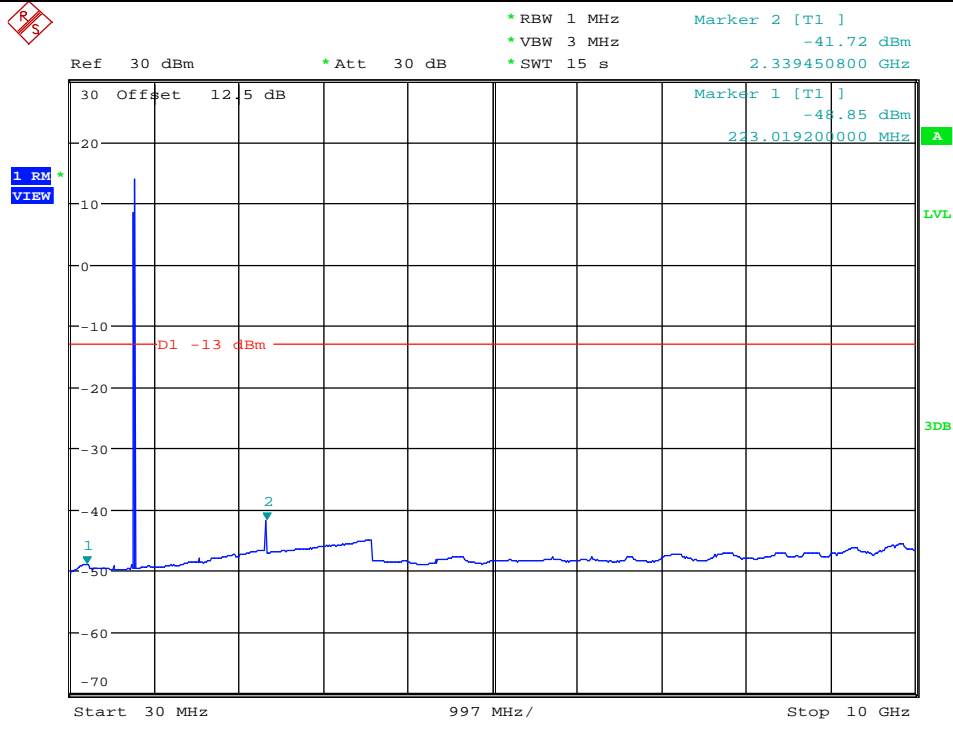


Date: 18.NOV.2022 16:59:33

Band 13 CSE 5MHz-H-QPSK-1RB0-30MHz-10GHz

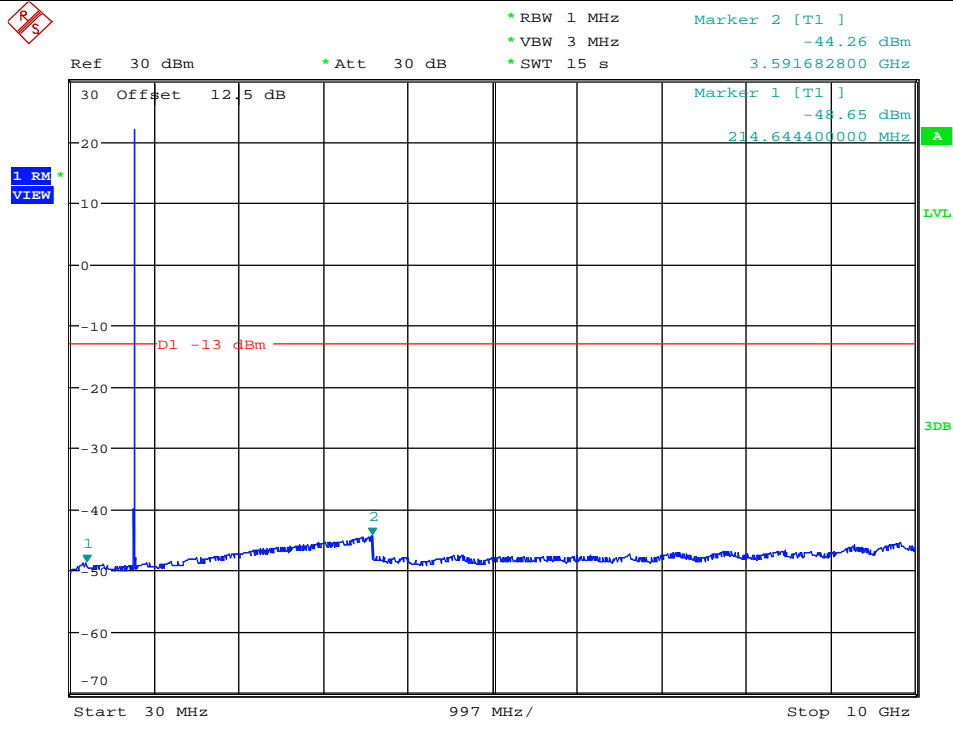


Date: 18.NOV.2022 16:50:18

Band 13 CSE 5MHz-H-16QAM-1RB0-30MHz-10GHz

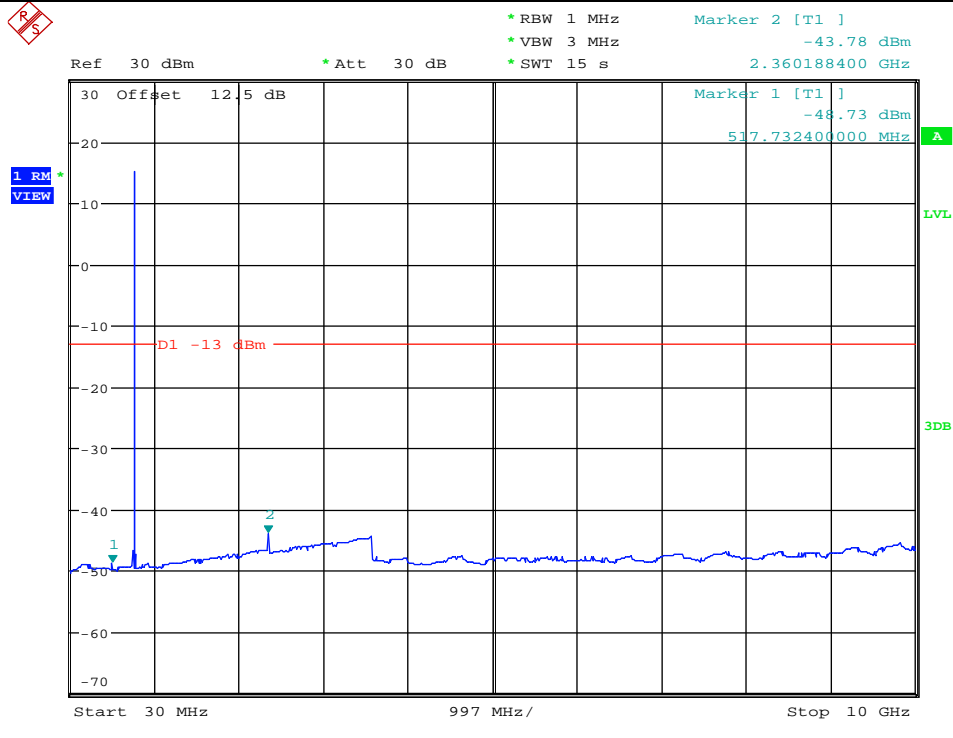


Date: 18.NOV.2022 17:04:49

Band 13 CSE 10MHz-M-QPSK-1RB0-30MHz-10GHz

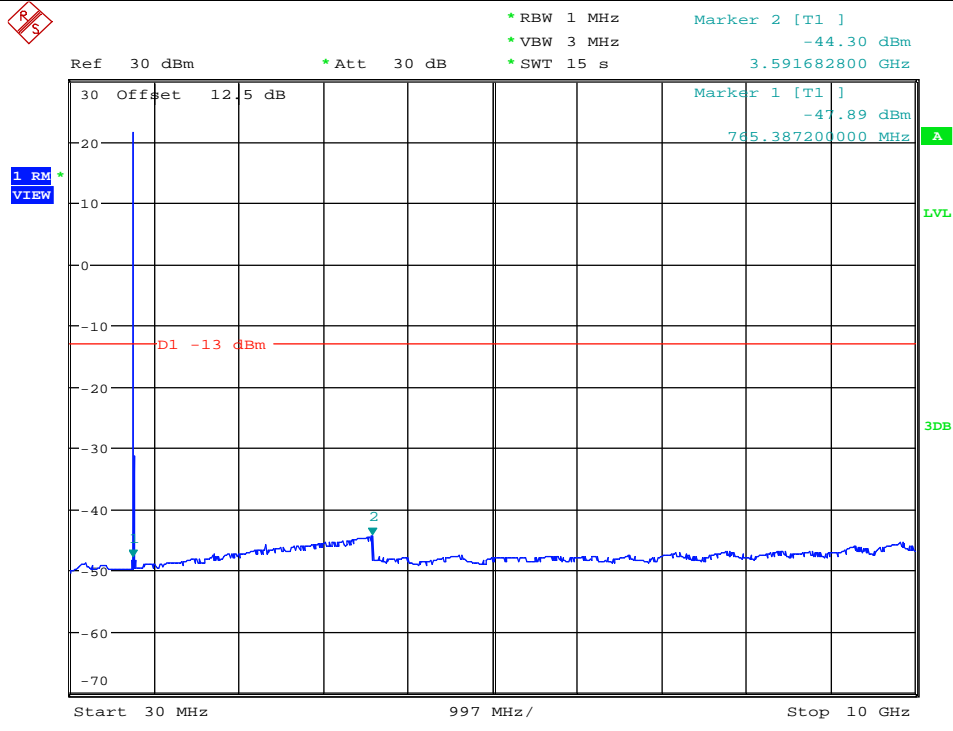

Date: 18.NOV.2022 18:30:49

Band 13 CSE 10MHz-M-16QAM-1RB0-30MHz-10GHz

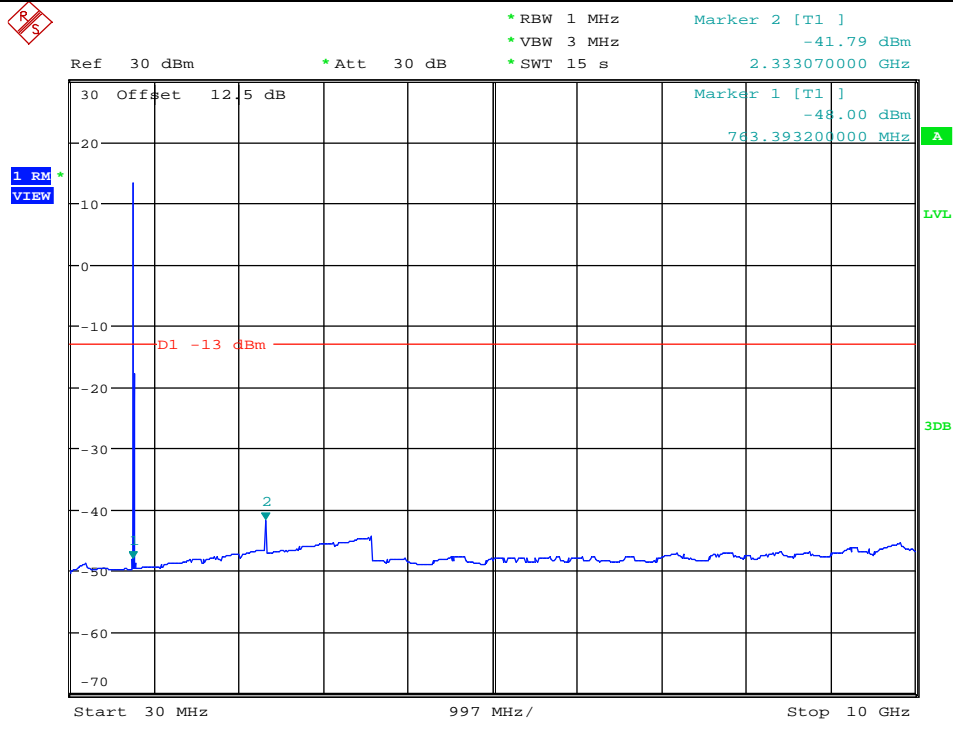

Date: 18.NOV.2022 18:39:49