# **FCC RF Test Report**

APPLICANT : HMD Global Oy

**EQUIPMENT**: GSM/WCDMA/LTE Mobile Phone

BRAND NAME : NOKIA MODEL NAME : TA-1483

FCC ID : 2AJOTTA-1483

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

TEST DATE(S) : May 18, 2022 ~ Jun. 06, 2022

We, Sporton International Inc. (Kunshan), would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

This report contains data that were produced under subcontract by Sporton International Inc. (Shenzhen).

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Kunshan), the test report shall not be reproduced except in full.

JasonJia

Approved by: Jason Jia





Report No.: FR241204

# Sporton International Inc. (Kunshan)

No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300 People's Republic of China

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 1 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

# **TABLE OF CONTENTS**

RE	VISIO	N HISTORY	3
SU	MMAR	RY OF TEST RESULT	4
1	GENI	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Product Specification of Equipment Under Test	5
	1.5	Modification of EUT	5
	1.6	Testing Location	6
	1.7	Test Software	6
	1.8	Applicable Standards	
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	
	2.1	Carrier Frequency Channel	8
	2.2	Test Mode	
	2.3	Connection Diagram of Test System	10
	2.4	Support Unit used in test configuration and system	
	2.5	EUT Operation Test Setup	11
	2.6	Measurement Results Explanation Example	11
3	TEST	RESULT	12
	3.1	Number of Channel Measurement	
	3.2	Hopping Channel Separation Measurement	14
	3.3	Dwell Time Measurement	20
	3.4	20dB Bandwidth Measurement	22
	3.5	Output Power Measurement	28
	3.6	Conducted Band Edges Measurement	29
	3.7	Conducted Spurious Emission Measurement	
	3.8	Radiated Band Edges and Spurious Emission Measurement	46
	3.9	AC Conducted Emission Measurement	50
	3.10	Antenna Requirements	52
4	LIST	OF MEASURING EQUIPMENT	53
5	UNC	ERTAINTY OF EVALUATION	54
ΑP	PEND	IX A. CONDUCTED TEST RESULTS	
ΑP	PEND	IX B. AC CONDUCTED EMISSION TEST RESULT	
ΑP	PEND	IX C. RADIATED SPURIOUS EMISSION	
ΑP	PEND	IX D. DUTY CYCLE PLOTS	
ΑP	PEND	IX E. SETUP PHOTOGRAPHS	

Report No. : FR241204

# **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR241204	Rev. 01	Initial issue of report	Jun. 15, 2022

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 3 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No. : FR241204

# **SUMMARY OF TEST RESULT**

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	-	Report only	-
3.4	-	99% Bandwidth	-	Report only	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	15.247(d)	Conducted Spurious Emission	≤ 20dBc	Pass	-
		Radiated Band Edges			Under limit
3.8	15.247(d)	and Radiated Spurious	15.209(a) & 15.247(d)	Pass	5.94 dB at
		Emission			2490.520 MHz
		AC Conducted		Pass	Under limit
3.9	15.207	Emission	15.207(a)		11.68 dB at
		21111001011			4.136 MHz
3.10	15.203 &	Antenna Requirement	15.203 & 15.247(b)	Pass	_
5.10	15.247(b)	7 a norma requirement	10.200 & 10.277(0)	1 433	-

#### **Declaration of Conformity:**

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

#### **Comments and Explanations:**

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 4 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

# 1 General Description

# 1.1 Applicant

**HMD Global Oy** 

Bertel Jungin aukio 9, 02600 Espoo, Finland

#### 1.2 Manufacturer

**HMD Global Oy** 

Bertel Jungin aukio 9, 02600 Espoo, Finland

# 1.3 Product Feature of Equipment Under Test

Product Feature					
Equipment GSM/WCDMA/LTE Mobile Phone					
Brand Name	NOKIA				
Model Name	TA-1483				
FCC ID	2AJOTTA-1483				
	Conducted: 356517420000252/356517420002811				
IMEI Code	Conduction: 356517420000039/356517420002597				
	Radiation: 356517420000211/356517420002779				
HW Version	0107				
SW Version	0.2221.15.10				
EUT Stage	Identical Prototype				

**Report No. : FR241204** 

**Remark:** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

# 1.4 Product Specification of Equipment Under Test

Standards-related Product Specification					
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz				
Number of Channels	79				
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78				
Maximum Output Power to Antenna	Bluetooth BR(1Mbps) : 10.50 dBm (0.0112 W) Bluetooth EDR (2Mbps) : 12.30 dBm (0.0170 W) Bluetooth EDR (3Mbps) : 12.60 dBm (0.0182 W)				
Antenna Type / Gain	Line Antenna with gain 0.00 dBi				
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) :π/4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK				

#### 1.5 Modification of EUT

No modifications are made to the EUT during all test items.

 Sporton International Inc. (Kunshan)
 Page Number
 : 5 of 54

 TEL: +86-512-57900158
 Report Issued Date
 : Jun. 15, 2022

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID: 2AJOTTA-1483 Report Template No.: BU5-FR15CBT Version 2.0

# 1.6 Testing Location

Sporton International Inc. (Kunshan) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

**Report No. : FR241204** 

Test Firm	Sporton International Inc. (Kunshan)				
Test Site Location	No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300 People's Republic of China TEL: +86-512-57900158 FAX: +86-512-57900958				
Took Site No.	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.		
Test Site No.	CO01-KS 03CH07-KS	CN1257	314309		

Sporton International Inc. (Shenzhen) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.01.

Test Firm	Sporton International Inc. (Shenzhen)						
Test Site Location	1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China TEL: +86-755-86379589 FAX: +86-755-86379595						
Test Site No.	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.				
	TH01-SZ	CN1256	421272				

Test data subcontracted: Condcuted test items in section 3.1~3.7 of this report.

#### 1.7 Test Software

Item	Site	Manufacturer	Name	Version
1.	03CH07-KS	AUDIX	E3	6.2009-8-24al
2.	CO01-KS	AUDIX	E3	6.2009-8-24

 Sporton International Inc. (Kunshan)
 Page Number
 : 6 of 54

 TEL: +86-512-57900158
 Report Issued Date
 : Jun. 15, 2022

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID: 2AJOTTA-1483 Report Template No.: BU5-FR15CBT Version 2.0

# 1.8 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

#### Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 7 of 54

Report Issued Date : Jun. 15, 2022

Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

**Report No. : FR241204** 

# 2 Test Configuration of Equipment Under Test

# 2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 8 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

**Report No. : FR241204** 

#### 2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (X plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases						
	Data Rate / Modulation						
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps				
	GFSK	π/4-DQPSK	8-DPSK				
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz				
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz				
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz				
	Bluetooth EDR 3Mbps 8-DPSK						
Radiated	Mode 1: CH00_2402 MHz						
	Mode 2: CH39_2441 MHz						
Test Cases	Mode 3: CH78_2480 MHz						
	Co-location:BT CH78 Tx + LTE_B7_BW_20M Tx						
AC							
Conducted	Mode 1 : Bluetooth Link + Charging from Adapter 1 + Earphone						
Emission							

#### Remark:

- For radiated test cases, the worst mode data rate 3Mbps was reported only, because this data rate
  has the highest RF output power at preliminary tests, and no other significantly frequencies found in
  conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter 1 and Earphone.

Sporton International Inc. (Kunshan)
TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 9 of 54


Report Issued Date : Jun. 15, 2022

Report Version : Rev. 01


Report No.: FR241204

# 2.3 Connection Diagram of Test System

#### For Radiated Emission

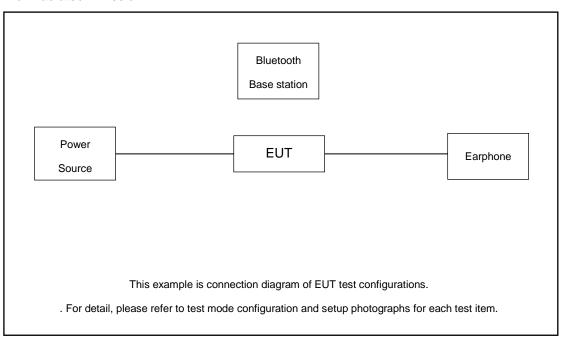

#### For Conducted Emission

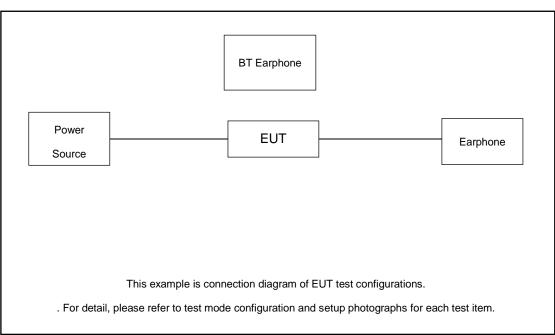

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 10 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

# 2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	BT Base Station	R&S	СВТ	N/A	N/A	Unshielded,1.8m
12.	Bluetooth Earphone	Lenovo	LBH308	N/A	N/A	N/A

# 2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit.

For AC power line conducted emissions, the EUT was set to connect with the Bluetooth Earphone under large package sizes transmission.

## 2.6 Measurement Results Explanation Example

#### For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

#### Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 1.4dB and 10dB attenuator.

Page Number : 11 of 54
Report Issued Date : Jun. 15, 2022

Report No.: FR241204

Report Version : Rev. 01

### 3 Test Result

#### 3.1 Number of Channel Measurement

#### 3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.


#### 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

#### 3.1.4 Test Setup

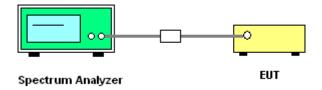


#### 3.1.5 Test Result of Number of Hopping Frequency

Please refer to Appendix A.


FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 12 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

### Number of Hopping Channel Plot on Channel 00 - 78

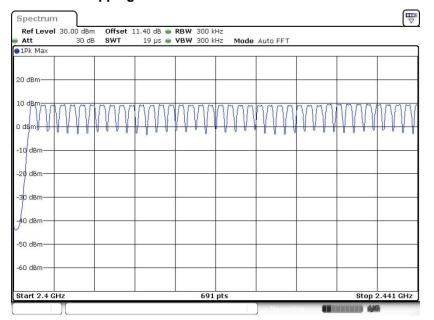

Date: 25.MAY.2022 05:00:36

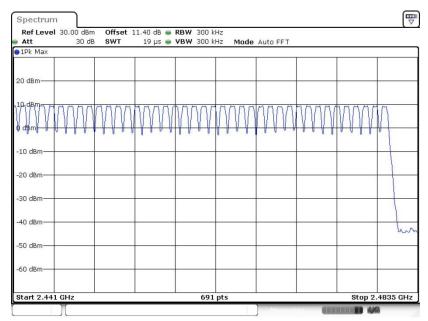

Date: 25.MAY.2022 05:01:05

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 13 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

# 3.2 Hopping Channel Separation Measurement

#### 3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

Report No.: FR241204


#### 3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings:
   Span = wide enough to capture the peaks of two adjacent channels;
   RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.2.4 Test Setup

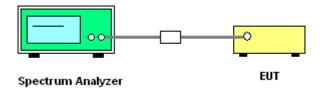


#### 3.2.5 Test Result of Hopping Channel Separation

Please refer to Appendix A.

FCC ID: 2AJOTTA-1483 Report Template No.: BU5-FR15CBT Version 2.0


#### <1Mbps>

#### Channel Separation Plot on Channel 00 - 01

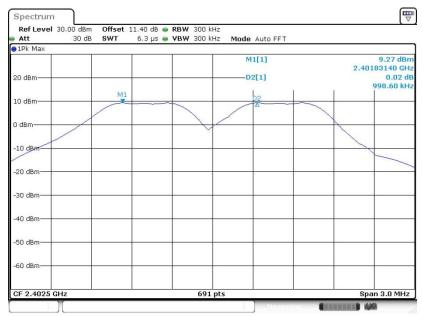

Date: 25.MAY.2022 04:39:10

#### Channel Separation Plot on Channel 39 - 40

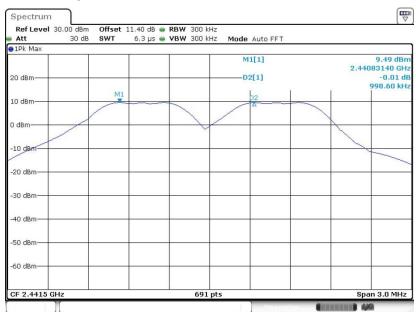

Date: 25.MAY.2022 04:42:29


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483

Page Number : 15 of 54 Report Issued Date: Jun. 15, 2022 Report Version : Rev. 01

**Report No. : FR241204** 


#### Channel Separation Plot on Channel 77 - 78

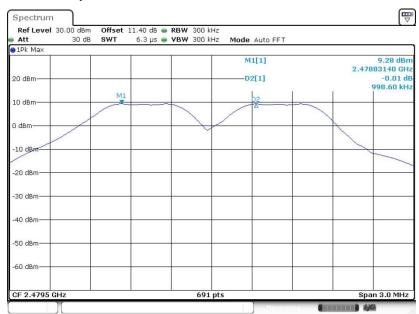

Date: 25.MAY.2022 04:54:48

#### <2Mbps>

#### Channel Separation Plot on Channel 00 - 01

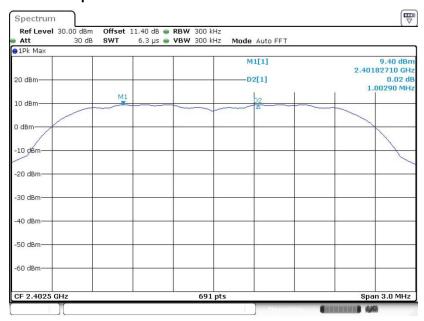


Date: 25.MAY.2022 06:50:35

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 16 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

#### Channel Separation Plot on Channel 39 - 40

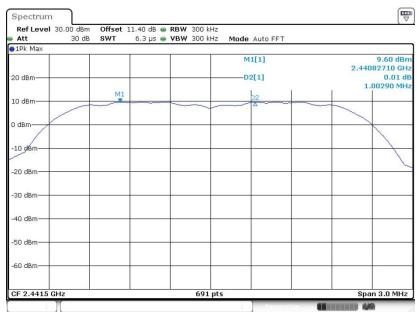

Date: 25.MAY.2022 07:00:18

#### **Channel Separation Plot on Channel 77 - 78**

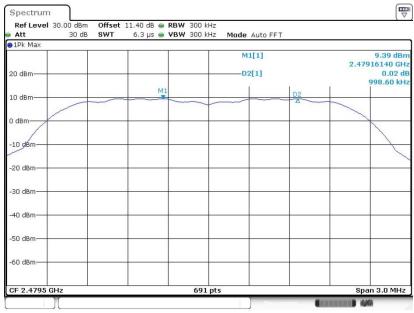

Date: 25.MAY.2022 07:11:14


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 17 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <3Mbps>

#### Channel Separation Plot on Channel 00 - 01

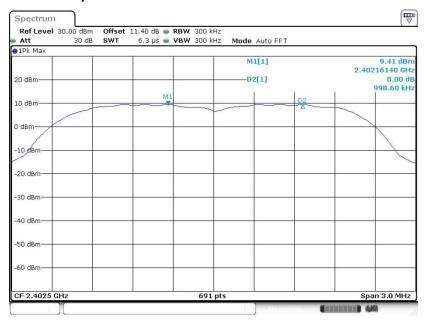

Date: 25.MAY.2022 07:29:43

#### Channel Separation Plot on Channel 39 - 40

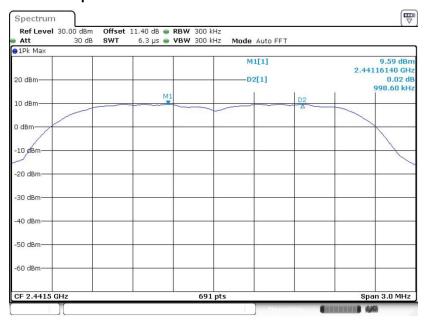


Date: 25.MAY.2022 07:41:54

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 18 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

#### Channel Separation Plot on Channel 77 - 78

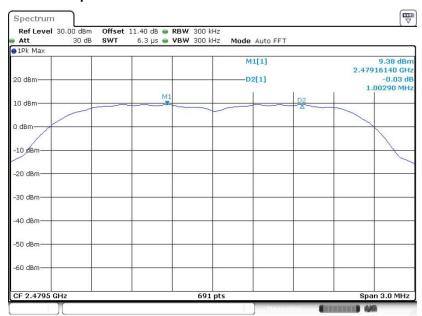

Date: 25.MAY.2022 07:50:06

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 19 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

#### 3.3 Dwell Time Measurement

#### 3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.


#### 3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.3.4 Test Setup

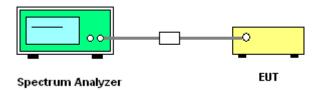

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 20 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

#### 3.3.5 Test Result of Dwell Time

Please refer to Appendix A.

#### **Package Transfer Time Plot** Spectrum Ref Level 30.00 dB Offset 15.20 dB RBW 1 MHz Att 30 dB . SWT 10 ms VBW 1 MHz ●1Pk Max D3[1] 0.01 dE 3.7536 ms 9.93 dBn 20 dBm M1[1] 1.2681 m O de -10 -20 -30 dBm -40 dB/m July May whole to -50 dBm 691 pts 1.0 ms/ Marker Type | Ref | Trc | **Function Result** Y-value Function X-value 1.2681 ms 2.913 ms 3.7536 ms M1 M1 -0.22 dB 0.01 dB

#### Date: 18.MAY.2022 21:52:54

#### Remark:

In normal mode, hopping rate is 1600 hops/s with 6 slots (5 Transmit and 1 Receive slot)
 in 79 hopping channels.

With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit  $(0.4 \times 79)$  (s), Hops Over Occupancy Time comes to  $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$  hops.

- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels.
  With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4 x 20) (s),
  Hops Over Occupancy Time comes to (800 / 6 / 20) x (0.4 x 20) = 53.33 hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 21 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

#### 3.4 20dB Bandwidth Measurement

#### 3.4.1 Limit of 20dB Bandwidth

Reporting only

#### 3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.

Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;


The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = peak;

Trace =  $\max$  hold.

5. Measure and record the results in the test report.

#### 3.4.4 Test Setup



#### 3.4.5 Test Result of 20dB Bandwidth

Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 22 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

#### <1Mbps>

#### 20 dB Bandwidth Plot on Channel 00



Date: 25.MAY.2022 04:36:10

#### 20 dB Bandwidth Plot on Channel 39



Date: 25.MAY.2022 04:40:22

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 23 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### 20 dB Bandwidth Plot on Channel 78



Date: 25.MAY.2022 04:48:27

#### <2Mbps>

#### 20 dB Bandwidth Plot on Channel 00

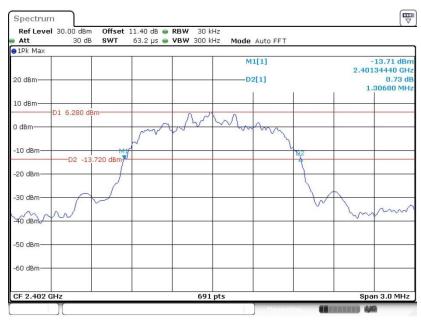


Date: 25.MAY.2022 06:36:31

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 24 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

#### 20 dB Bandwidth Plot on Channel 39

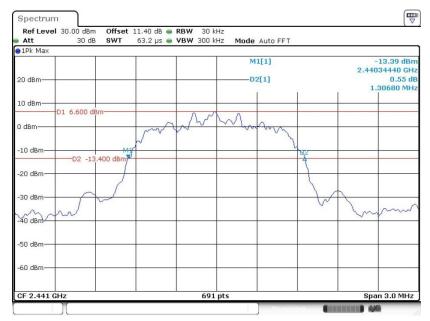

Date: 25.MAY.2022 06:51:51

#### 20 dB Bandwidth Plot on Channel 78

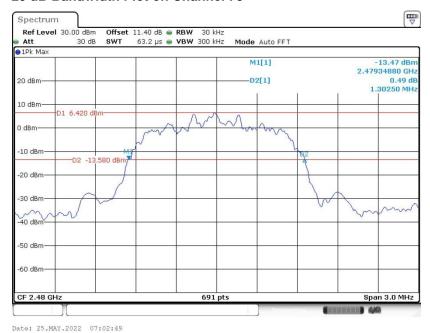


Date: 23.FM1.2022 07:02:43

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 25 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <3Mbps>

#### 20 dB Bandwidth Plot on Channel 00

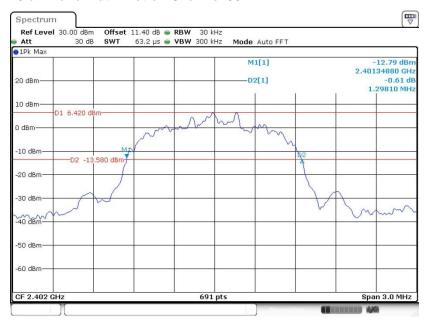

Date: 25.MAY.2022 07:13:09

#### 20 dB Bandwidth Plot on Channel 39

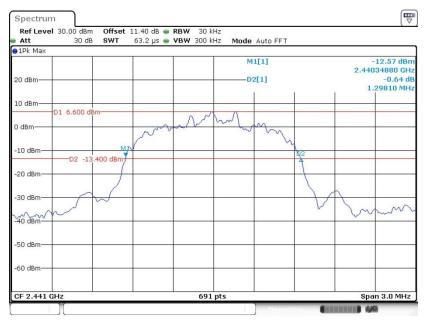

Date: 25.MAY.2022 07:30:39

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 26 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

#### 20 dB Bandwidth Plot on Channel 78



Date: 25.MAY.2022 07:43:37

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 27 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

## 3.5 Output Power Measurement

#### 3.5.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps, 2Mbps, 3Mbps and AFH modes are 0.125 watts.


#### 3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

#### 3.5.4 Test Setup

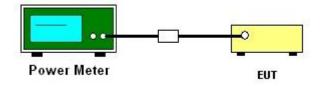

#### 3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

#### 3.5.6 Test Result of Average Output Power (Reporting Only)

Please refer to Appendix A.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 28 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

## 3.6 Conducted Band Edges Measurement

#### 3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


#### 3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

#### 3.6.4 Test Setup

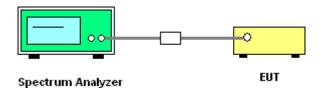

Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 29 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

# 3.6.5 Test Result of Conducted Band Edges


#### <1Mbps>

#### Low Band Edge Plot on Channel 00

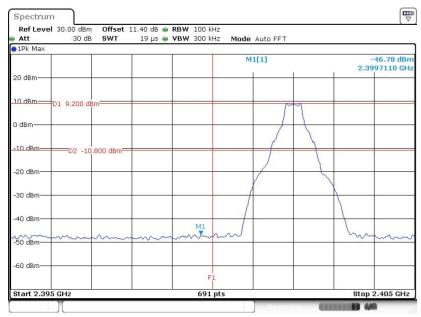

#### Date: 25.MAY.2022 04:36:41

### High Band Edge Plot on Channel 78

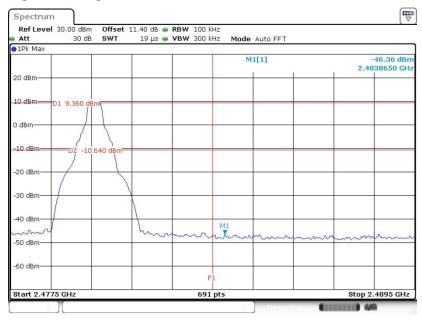


Date: 25.MAY.2022 04:48:59

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 30 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <2Mbps>

#### Low Band Edge Plot on Channel 00

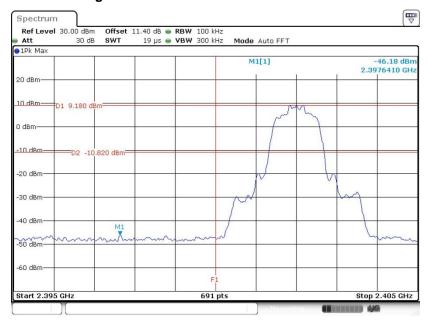

Date: 25.MAY.2022 06:36:52

#### **High Band Edge Plot on Channel 78**

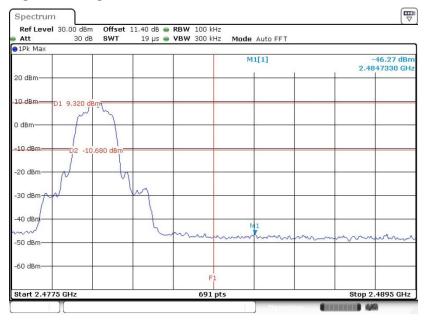

Date: 25.MAY.2022 07:03:31


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 31 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <3Mbps>

#### Low Band Edge Plot on Channel 00

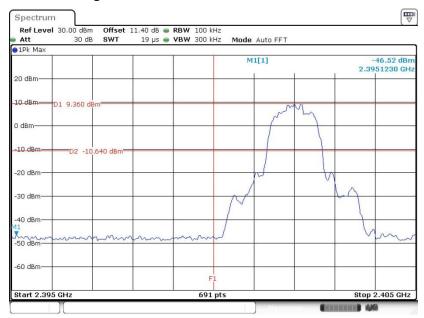

Date: 25.MAY.2022 07:13:30

#### **High Band Edge Plot on Channel 78**

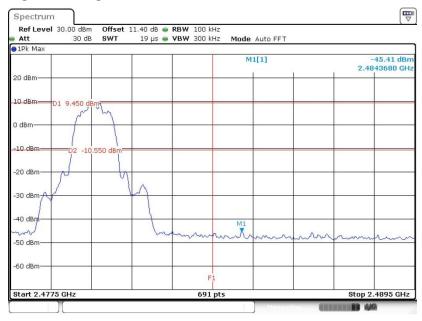

Date: 25.MAY.2022 07:44:03

Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 32 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

# 3.6.6 Test Result of Conducted Hopping Mode Band Edges


#### <1Mbps>

#### **Hopping Mode Low Band Edge Plot**

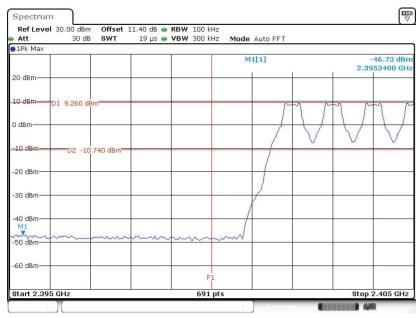

#### Date: 25.MAY.2022 04:59:10

#### **Hopping Mode High Band Edge Plot**

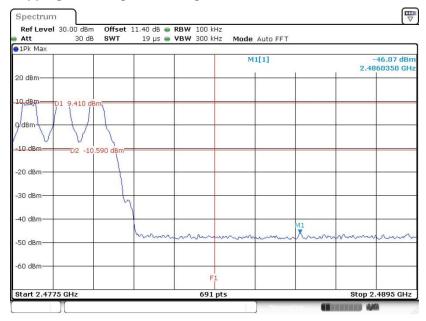


Date: 25.MAY.2022 05:06:36

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 33 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <2Mbps>

#### **Hopping Mode Low Band Edge Plot**

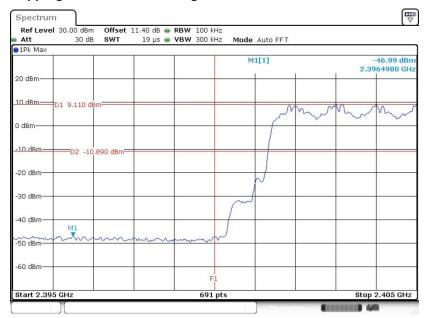

#### Date: 25.MAY.2022 05:08:16

#### **Hopping Mode High Band Edge Plot**

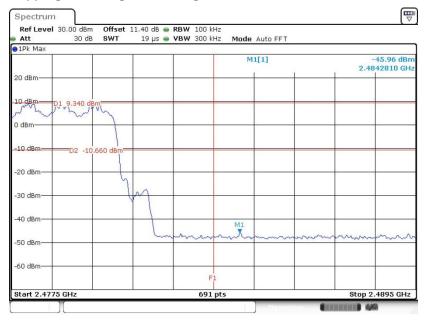


Date: 25.MAY.2022 05:07:37

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 34 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <3Mbps>

#### **Hopping Mode Low Band Edge Plot**

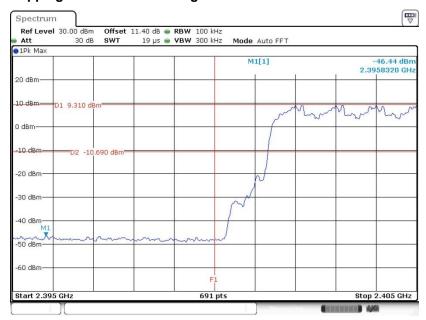

Date: 25.MAY.2022 07:51:27

#### **Hopping Mode High Band Edge Plot**

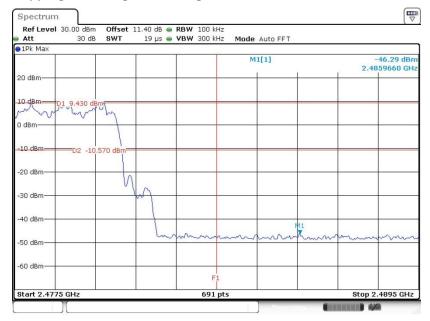

Date: 25.MAY.2022 07:52:22

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 35 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

# 3.7 Conducted Spurious Emission Measurement

#### 3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


#### 3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

#### 3.7.4 Test Setup

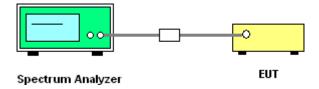

FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Report Issued Date: Jun. 15, 2022
Report Version: Rev. 01

Page Number

Report Template No.: BU5-FR15CBT Version 2.0


: 36 of 54

Report No.: FR241204


## 3.7.5 Test Result of Conducted Spurious Emission

#### <1Mbps>

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

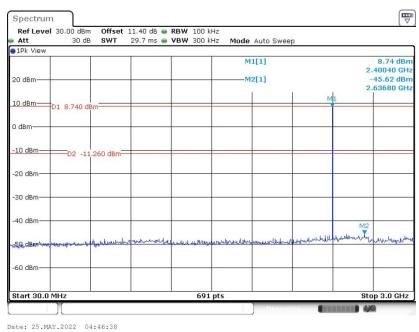

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

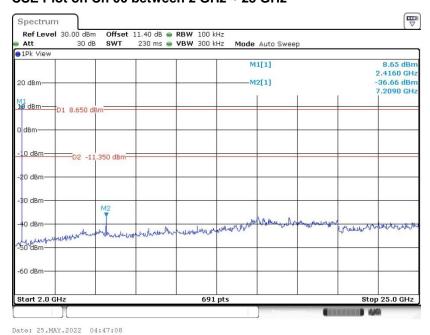


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 37 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

## CSE Plot on Ch 39 between 30MHz ~ 3 GHz

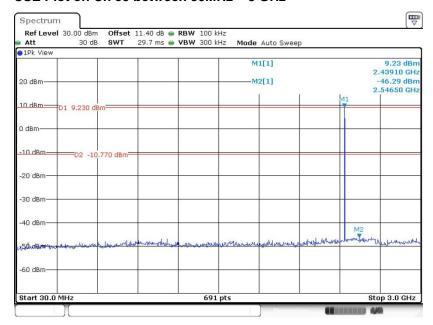

Date: 25.MAY.2022 04:43:45

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

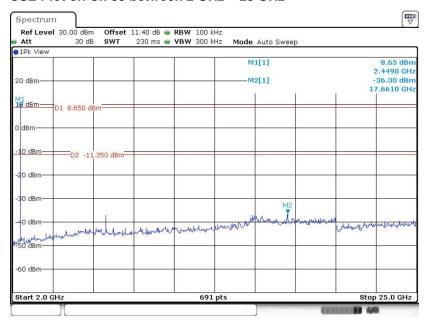


Date: 25.MAY.2022 04:44:14

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 38 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

## CSE Plot on Ch 78 between 30MHz ~ 3 GHz

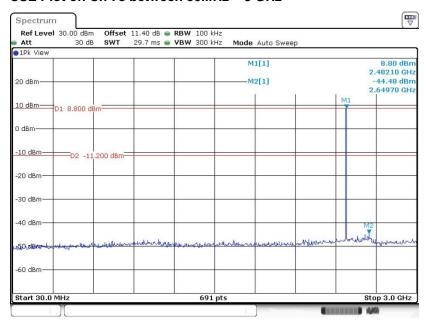

Date: 25.MAY.2022 04:52:55

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

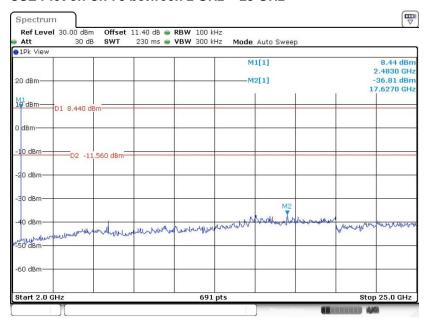


Date: 25.MAY.2022 04:53:26

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 39 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <2Mbps>

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

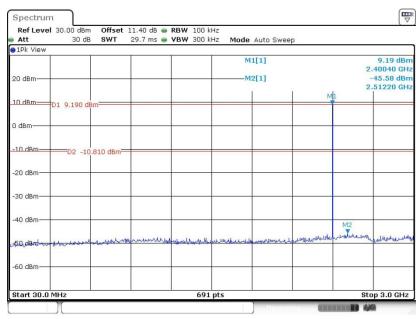

Date: 25.MAY.2022 06:48:38

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

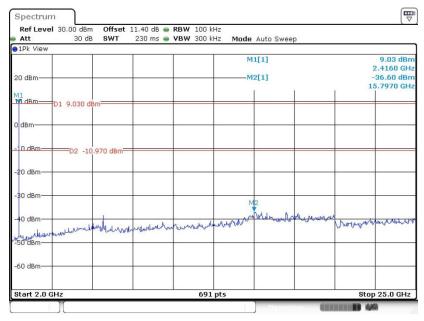


Date: 25.MAY.2022 06:49:08

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 40 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

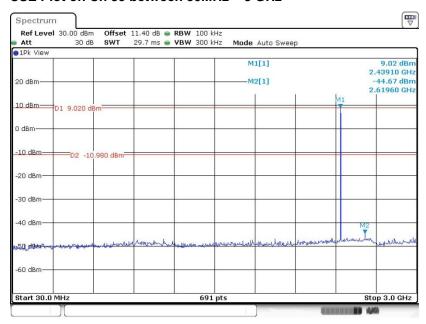

Date: 25.MAY.2022 06:58:24

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

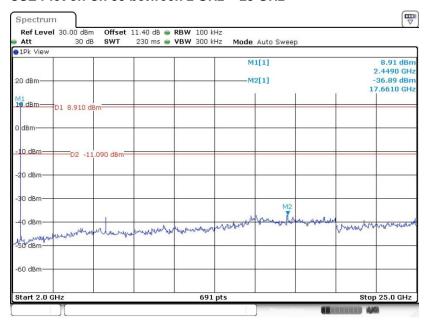


Date: 25.MAY.2022 06:58:53

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 41 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

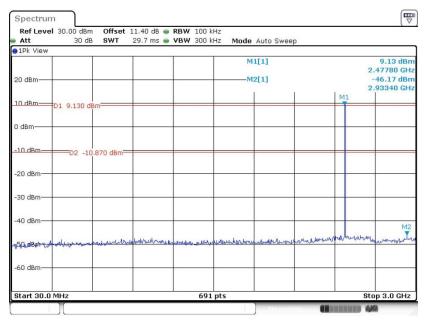

Date: 25.MAY.2022 09:52:45

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

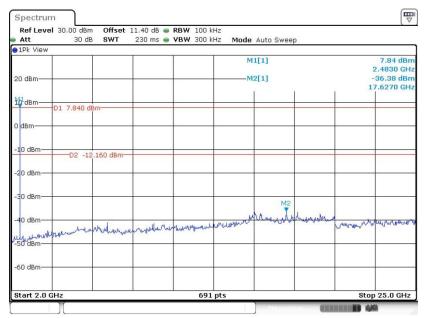

Date: 25.MAY.2022 09:53:13


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 42 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 


#### <3Mbps>

#### CSE Plot on Ch 00 between 30MHz ~ 3 GHz

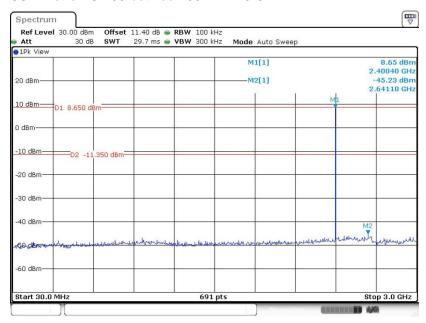

Date: 25.MAY.2022 07:28:11

#### CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

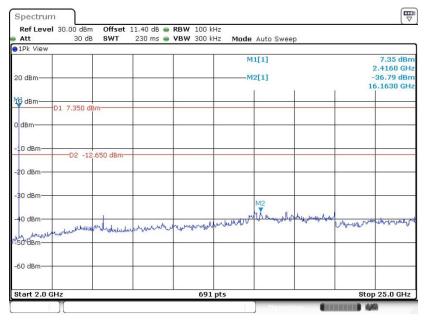


Date: 25.MAY.2022 07:28:40

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 43 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

#### CSE Plot on Ch 39 between 30MHz ~ 3 GHz

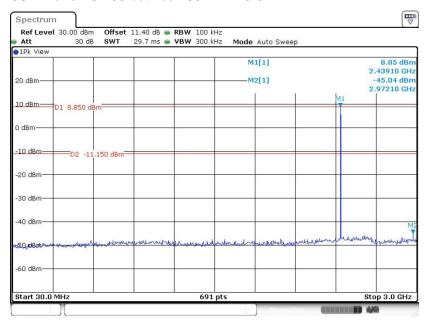

Date: 25.MAY.2022 07:39:27

#### CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

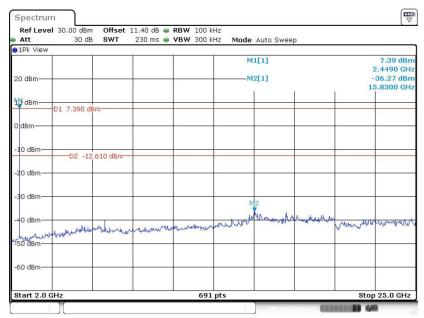


Date: 25.MAY.2022 07:40:20

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 44 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01


**Report No. : FR241204** 

#### CSE Plot on Ch 78 between 30MHz ~ 3 GHz

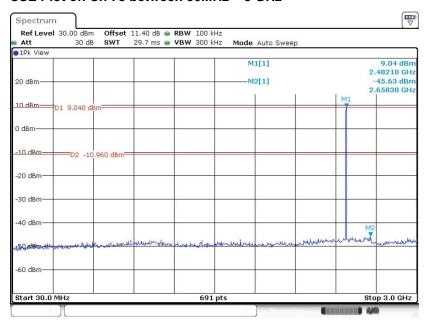

Date: 25.MAY.2022 07:47:59

#### CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

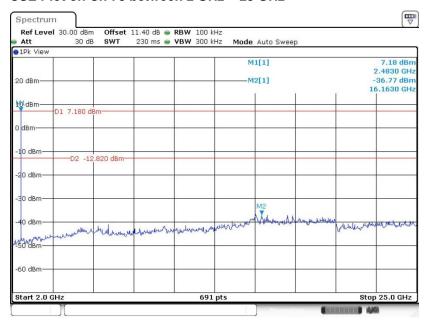

Date: 25.MAY.2022 07:48:29

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483

Page Number : 45 of 54 Report Issued Date: Jun. 15, 2022 Report Version : Rev. 01

**Report No. : FR241204** 

## 3.8 Radiated Band Edges and Spurious Emission Measurement

## 3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

## 3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 46 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

### 3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
  - (1) Span shall wide enough to fully capture the emission being measured;
  - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
  - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time =  $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ 

Where  $N_1$  is number of type 1 pulses,  $L_1$  is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)


- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than peak limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.70dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.


Report No.: FR241204

## 3.8.4 Test Setup


#### For radiated emissions below 30MHz

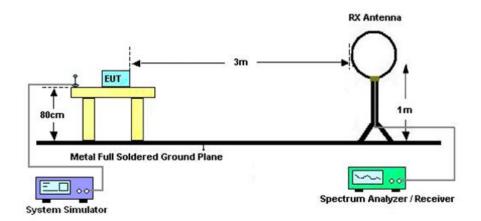

#### For radiated emissions from 30MHz to 1GHz

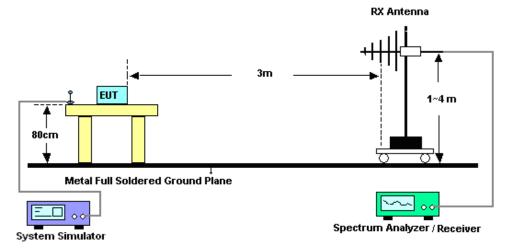

#### For radiated emissions above 1GHz

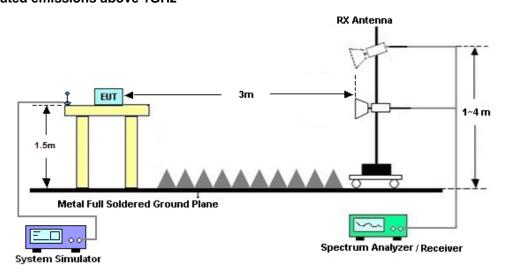

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 48 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

### 3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

### 3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix C.

# 3.8.7 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic or 40GHz, whichever is lower)

Please refer to Appendix C.

### 3.8.8 Duty cycle correction factor for average measurement

Please refer to Appendix D.

Sporton International Inc. (Kunshan)
TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 49 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

#### 3.9 AC Conducted Emission Measurement

#### 3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Eroquency of emission (MUz)	Conducted limit (dBμV)				
Frequency of emission (MHz)	Quasi-peak	Average			
0.15-0.5	66 to 56*	56 to 46*			
0.5-5	56	46			
5-30	60	50			

<sup>\*</sup>Decreases with the logarithm of the frequency.

### 3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.9.3 Test Procedures


- The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 50 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Boy 01

Report No.: FR241204

Report Version : Rev. 01

## 3.9.4 Test Setup

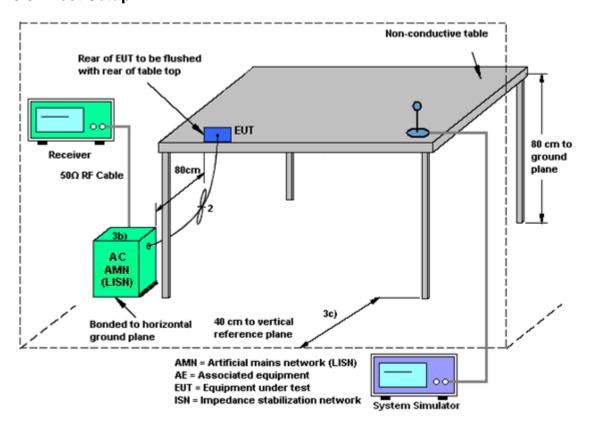

## 3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix B.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 51 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

## 3.10 Antenna Requirements

### 3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

## 3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

#### 3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 52 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

## 4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101078	10Hz~40GHz	Apr. 07, 2022	May 18, 2022~ May 25, 2022	Apr. 06, 2023	Conducted (TH01-SZ)
Pulse Power Senor	Anritsu	MA2411B	1339473	30MHz~40GHz	Dec. 28, 2021	May 18, 2022~ May 25, 2022	Dec. 27, 2022	Conducted (TH01-SZ)
Power Meter	Anritsu	ML2495A	1542004	50MHz Bandwidth	Dec. 28, 2021	May 18, 2022~ May 25, 2022	Dec. 27, 2022	Conducted (TH01-SZ)
EMI Test Receiver	R&S	ESR7	101403	9kHz~7GHz;Ma x 30dBm	Oct. 16, 2021	Jun. 06, 2022	Oct. 15, 2022	Radiation (03CH07-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY553705 28	10Hz-44G,MAX 30dB	Oct. 16, 2021	Jun. 06, 2022	Oct. 15, 2022	Radiation (03CH07-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Oct. 30, 2021	Jun. 06, 2022	Oct. 29, 2022	Radiation (03CH07-KS)
Bilog Antenna	TeseQ	CBL6111D	44483	30MHz-1GHz	Dec. 22, 2021	Jun. 06, 2022	Dec. 21, 2022	Radiation (03CH07-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	75957	1GHz~18GHz	Oct. 30, 2021	Jun. 06, 2022	Oct. 29, 2022	Radiation (03CH07-KS)
high gain Amplifier	MITEQ	AMF-7D-0010 1800-30-10P	2025788	1Ghz-18Ghz	Jul. 30, 2021	Jun. 06, 2022	Jul. 29, 2023	Radiation (03CH07-KS)
SHF-EHF Horn	Com-power	AH-840	101070	18GHz~40GHz	Jan. 05, 2022	Jun. 06, 2022	Jan. 04, 2023	Radiation (03CH07-KS)
Amplifier	SONOMA	310N	413740	9KHz-1GHz	Jan. 05, 2022	Jun. 06, 2022	Jan. 04, 2023	Radiation (03CH07-KS)
Amplifier	Keysight	83017A	MY532703 16	500MHz~26.5G Hz	Oct. 16, 2021	Jun. 06, 2022	Oct. 15, 2022	Radiation (03CH07-KS)
Amplifier	MITEQ	EM18G40GG A	060728	18~40GHz	Jan. 05, 2022	Jun. 06, 2022	Jan. 04, 2023	Radiation (03CH07-KS)
AC Power Source	Chroma	61601	616010002 473	N/A	NCR	Jun. 06, 2022	NCR	Radiation (03CH07-KS)
Turn Table	MF	MF7802	N/A	0~360 degree	NCR	Jun. 06, 2022	NCR	Radiation (03CH07-KS)
Antenna Mast	MF	MF7802	N/A	1 m~4 m	NCR	Jun. 06, 2022	NCR	Radiation (03CH07-KS)
EMI Receiver	R&S	ESCI7	100768	9kHz~7GHz;	Apr. 21, 2022	May 27, 2022	Apr. 20, 2023	Conduction (CO01-KS)
AC LISN (for auxiliary equipment)	MessTec	AN3016	060103	9kHz~30MHz	Oct. 14, 2021	May 27, 2022	Oct. 13, 2022	Conduction (CO01-KS)
AC LISN	R&S	ENV216	100334	9kHz~30MHz	Oct. 14, 2021	May 27, 2022	Oct. 13, 2022	Conduction (CO01-KS)
AC Power Source	Chroma	61602	ABP00000 0811	AC 0V~300V, 45Hz~1000Hz	Oct. 14, 2021	May 27, 2022	Oct. 13, 2022	Conduction (CO01-KS)

NCR: No Calibration Required

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : 53 of 54
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No. : FR241204

## 5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.10-2013. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

**Report No. : FR241204** 

#### <u>Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)</u>

Measuring Uncertainty for a Level of Confidence	2.2dB
of 95% (U = 2Uc(y))	2.208

#### <u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	0.0db

#### Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	3.VUB

#### Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	3.0UB

----- THE END ------

 Sporton International Inc. (Kunshan)
 Page Number
 : 54 of 54

 TEL: +86-512-57900158
 Report Issued Date
 : Jun. 15, 2022

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID: 2AJOTTA-1483 Report Template No.: BU5-FR15CBT Version 2.0

## **Appendix A. Conducted Test Results**

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : A1 of A1
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No. : FR241204

Report Number : FR241204

Test Engineer:	Ma Jie	Temperature:	24~26	°C
Test Date:	2022/5/18~2022/5/25	Relative Humidity:	50~53	%

## <u>TEST RESULTS DATA</u> 20dB and 99% Occupied Bandwidth and Hopping Channel Separation

Mod.	Data Rate	NTX	CH.	Freq. (MHz)	20db BW (MHz)	99% Bandwidth (MHz)	Hopping Channel Separation Measurement (MHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.938	0.877	0.999	0.6252	Pass
DH	1Mbps	1	39	2441	0.938	0.877	0.999	0.6252	Pass
DH	1Mbps	1	78	2480	0.938	0.880	0.999	0.6252	Pass
2DH	2Mbps	1	0	2402	1.307	1.178	1.003	0.8712	Pass
2DH	2Mbps	1	39	2441	1.307	1.178	1.003	0.8712	Pass
2DH	2Mbps	1	78	2480	1.303	1.178	0.999	0.8683	Pass
3DH	3Mbps	1	0	2402	1.298	1.184	0.999	0.8654	Pass
3DH	3Mbps	1	39	2441	1.298	1.184	0.999	0.8654	Pass
3DH	3Mbps	1	78	2480	1.298	1.184	1.003	0.8654	Pass

## TEST RESULTS DATA

#### Dwell Time

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.91	0.31	0.4	Pass
AFH	20	53.33	2.91	0.16	0.4	Pass

## TEST RESULTS DATA

#### Peak Power Table

DH		CH.	CH.	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
			(ubiii)	(ubiii)	Result			
	0	1	10.10	20.97	Pass			
DH5	39	1	10.50	20.97	Pass			
	78	1	10.30	20.97	Pass			
	0	1	11.80	20.97	Pass			
2DH5	39	1	12.30	20.97	Pass			
	78	1	12.10	20.97	Pass			
	0	1	12.20	20.97	Pass			
3DH5	39	1	12.60	20.97	Pass			
	78	1	12.30	20.97	Pass			

## TEST RESULTS DATA Average Power Table

## Average Power Table (Reporting Only)


DH	CH.	NTX	Average Power (dBm)	Duty Factor (dB)
	0	1	9.30	1.10
DH5	39	1	9.60	1.10
	78	1	9.50	1.10
	0	1	9.10	1.14
2DH5	39	1	9.50	1.14
	78	1	9.40	1.14
	0	1	9.10	1.12
3DH5	39	1	9.50	1.12
	78	1	9.40	1.12

## TEST RESULTS DATA

### Number of Hopping Frequency

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass

## **Appendix B. AC Conducted Emission Test Results**

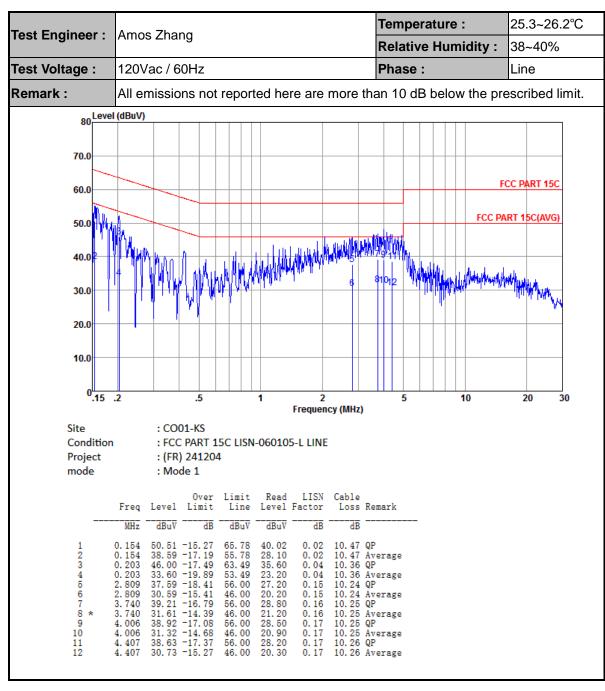

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : B1 of B2
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

Report No.: FR241204

Temperature: 25.3~26.2°C Test Engineer: Amos Zhang **Relative Humidity:** 38~40% Test Voltage: 120Vac / 60Hz Phase: Neutral Remark: All emissions not reported here are more than 10 dB below the prescribed limit. 80 Level (dBuV) 70.0 FCC PART 15C 60.0 FCC PART 15C(AVG) 40.0 LANDAMANAMAN 30.0 20.0 10.0 0.15 .2 10 .5 1 20 30 Frequency (MHz) Site : CO01-KS Condition : FCC PART 15C LISN-060105-N NEUTRAL Project : (FR) 241204 mode : Mode 1 Read LISN Line Level Factor Loss Remark Freq Level Limit dB dBuV MHz dBuV dBuV 40. 56 -15. 44 30. 96 -15. 04 41. 57 -14. 43 32. 47 -13. 53 42. 48 -13. 52 33. 28 -12. 72 42. 50 -13. 50 34. 00 -12. 00 42. 71 -13. 29 34. 21 -11. 79 42. 62 -13. 38 34. 32 -11. 68 41. 64 -14. 36 33. 34 -12. 66 56.00 46.00 56.00 10.23 QP 10.23 Average 10.23 QP  $\begin{array}{c} 0.\ 14 \\ 0.\ 14 \\ 0.\ 14 \\ 0.\ 15 \\ 0.\ 15 \\ 0.\ 16 \\ 0.\ 16 \\ 0.\ 16 \\ 0.\ 17 \\ 0.\ 17 \\ 0.\ 17 \\ \end{array}$ 30. 19 20. 59 31. 20 22. 10 32. 09 22. 89 32. 09 23. 59 32. 30 23. 80 1.744 2. 201 2. 201 2. 664 2. 664 3. 364 3. 364 3. 720 3. 720 46. 00 56. 00 10.23 Average 10.24 QP 46. 00 56. 00 46. 00 56. 00 46. 00 10.24 QF 10.24 Average 10.25 QF 10.25 Average 10.25 QP 10.25 Average 10 32. 20 23. 90 31. 21 22. 91 56. 00 46. 00 56. 00 10.25 QP 10.25 Average 10.26 QP 11 4. 136 4. 136 12

0.17

10.26 Average

#### Note:

Level( $dB\mu V$ ) = Read Level( $dB\mu V$ ) + LISN Factor(dB) + Cable Loss(dB)

46.00

2. Over Limit(dB) = Level(dB $\mu$ V) – Limit Line(dB $\mu$ V)

4.501

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483

: B2 of B2 Page Number Report Issued Date: Jun. 15, 2022 Report Version : Rev. 01

Report No.: FR241204

## Appendix C. Radiated Spurious Emission

### Only the worst results are shown in the report

#### 2.4GHz 2400~2483.5MHz

## BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	(dBµV)	( dB/m )	(dB)	( dB )	( cm )	(deg)	(P/A)	(H/V)
		2487.58	56.80	-17.20	74	48	32.15	7.32	30.67	210	69	Р	Н
		2487.58	32.10	-21.90	54	-	-	•	-	-	-	Α	Н
DT		2480	101.76	-	-	93.03	32.12	7.28	30.67	210	69	Р	Н
BT CH 78		2480	77.06	-	-	-	-	-	-	-	-	Α	Н
2480MHz		2496.58	56.38	-17.62	74	47.51	32.15	7.32	30.6	400	100	Р	V
240011112		2496.58	31.68	-22.32	54	-	-	1	-	-	-	Α	V
		2480	100.47	-	-	91.74	32.12	7.28	30.67	400	100	Р	V
		2480	75.77	-	-	-	-	-	-	-	-	Α	V
Remark		o other spurio I results are P		st Peak	and Averag	je limit lin	e.						

### 2.4GHz 2400~2483.5MHz

### BT (Harmonic @ 3m)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dB <sub>µ</sub> V)	( dB/m )	( dB )	(dB)	( cm )	(deg)	(P/A)	(H/V)
		4965	41.52	-32.48	74	62.36	34.1	10.51	65.45	300	0	Р	Н
BT		7440	48.16	-25.84	74	64.81	35.8	12.88	65.33	300	0	Р	Н
CH 78 2480MHz		4965	41.05	-32.95	74	61.89	34.1	10.51	65.45	300	0	Р	V
		7440	44.08	-29.92	74	60.73	35.8	12.88	65.33	300	0	Р	٧

#### Romari

1. No other spurious found.

2. All results are PASS against Peak and Average limit line.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : C1 of C5 Report Issued Date : Jun. 15, 2022

**Report No. : FR241204** 

Report Version : Rev. 01

#### **Co-location**

#### 2.4GHz 2400~2483.5MHz

## BT& LTE\_B7\_BW\_20M (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	( dB/m )	( dB )	(dB)	( cm )	(deg)	(P/A)	(H/V)
		2490.52	68.06	-5.94	74	59.26	32.15	7.32	30.67	100	77	Р	Н
		2490.52	43.36	-10.64	54	-	-	-	-	-	-	Α	Н
5.7		2480	106.15	-	-	97.42	32.12	7.28	30.67	100	77	Р	Н
BT CH 78		2480	81.45	-	-	-	1	-	-	-	-	Α	Н
2480MHz		2490.82	58.52	-15.48	74	49.72	32.15	7.32	30.67	393	93	Р	V
2400141112		2490.82	33.82	-20.18	54	-	1	-	-	-	-	Α	V
		2480	102.27	-	-	93.54	32.12	7.28	30.67	393	93	Р	V
		2480	77.57	-	-	-	-	-	-	-	-	Α	٧

## Remark

- 1. No other spurious found.
- 2. All results are PASS against Peak and Average limit line.

## 2.4GHz 2400~2483.5MHz BT& LTE\_B7\_BW\_20M (Harmonic @ 3m)

Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
			Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
	(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dBµV)	( dB/m )	(dB)	(dB)	( cm )	(deg)	(P/A)	(H/V)
	4965	41.28	-32.72	74	62.12	34.1	10.51	65.45	100	0	Р	Н
	7440	48.7	-25.3	74	65.35	35.8	12.88	65.33	100	0	Р	Н
	4960	41.18	-32.82	74	62.02	34.1	10.51	65.45	300	0	Р	V
	7440	44.71	-29.29	74	61.36	35.8	12.88	65.33	300	0	Р	٧
	Note	(MHz) 4965 7440 4960	(MHz) (dBμV/m) 4965 41.28 7440 48.7 4960 41.18	(MHz)     (dBμV/m)     (dB)       4965     41.28     -32.72       7440     48.7     -25.3       4960     41.18     -32.82	Limit         Line           (MHz)         (dBμV/m)         (dB)         (dBμV/m)           4965         41.28         -32.72         74           7440         48.7         -25.3         74           4960         41.18         -32.82         74	Limit         Line         Level           (MHz)         (dBμV/m)         (dB)         (dBμV/m)         (dBμV/m)           4965         41.28         -32.72         74         62.12           7440         48.7         -25.3         74         65.35           4960         41.18         -32.82         74         62.02	Limit         Line         Level         Factor           (MHz)         (dBμV/m)         (dB)         (dBμV/m)         (dBμV)         (dB/m)           4965         41.28         -32.72         74         62.12         34.1           7440         48.7         -25.3         74         65.35         35.8           4960         41.18         -32.82         74         62.02         34.1	Limit         Line         Level         Factor         Loss           (MHz)         (dBμV/m)         (dB)         (dBμV/m)         (dBμV)         (dB/m)         (dB)           4965         41.28         -32.72         74         62.12         34.1         10.51           7440         48.7         -25.3         74         65.35         35.8         12.88           4960         41.18         -32.82         74         62.02         34.1         10.51	Limit         Line         Level         Factor         Loss         Factor           (MHz)         (dBμV/m)         (dB)         (dBμV/m)         (dBμV)         (dB/m)         (dB)         (dB)           4965         41.28         -32.72         74         62.12         34.1         10.51         65.45           7440         48.7         -25.3         74         65.35         35.8         12.88         65.33           4960         41.18         -32.82         74         62.02         34.1         10.51         65.45	Limit         Line         Level         Factor         Loss         Factor         Pos           (MHz)         (dBμV/m)         (dB)         (dBμV)         (dBμV)         (dB)         (dB)         (cm)           4965         41.28         -32.72         74         62.12         34.1         10.51         65.45         100           7440         48.7         -25.3         74         65.35         35.8         12.88         65.33         100           4960         41.18         -32.82         74         62.02         34.1         10.51         65.45         300	Limit         Line         Level         Factor         Loss         Factor         Pos         Pos           (MHz)         (dBμV/m)         (dB)         (dBμV)         (dB/m)         (dB)         (dB)         (cm)         (deg)           4965         41.28         -32.72         74         62.12         34.1         10.51         65.45         100         0           7440         48.7         -25.3         74         65.35         35.8         12.88         65.33         100         0           4960         41.18         -32.82         74         62.02         34.1         10.51         65.45         300         0	Limit         Line         Level         Factor         Loss         Factor         Pos         Pos         Avg.           (MHz)         (dBμV/m)         (dB)         (dBμV)         (dB/m)         (dB)         (dB)         (cm)         (deg)         (P/A)           4965         41.28         -32.72         74         62.12         34.1         10.51         65.45         100         0         P           7440         48.7         -25.3         74         65.35         35.8         12.88         65.33         100         0         P           4960         41.18         -32.82         74         62.02         34.1         10.51         65.45         300         0         P

## Remark

- 1. No other spurious found.
- 2. All results are PASS against Peak and Average limit line.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : C2 of C5 Report Issued Date : Jun. 15, 2022

**Report No. : FR241204** 

Report Version : Rev. 01

#### **Emission below 1GHz**

## 2.4GHz BT (LF)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
		( MHz )	( dBµV/m )	Limit (dB)	Line ( dBµV/m )	Level (dBµV)	Factor ( dB/m )	Loss (dB)	Factor (dB)	Pos ( cm )		Avg. (P/A)	(H/V)
		30	21.31	-18.69	40	26.41	25.1	0.5	30.7	-		Р	Η
		104.69	17.9	-25.6	43.5	30.6	16.55	1.49	30.74	-	-	Р	Η
		156.1	19.51	-23.99	43.5	31.77	16.74	1.81	30.81	-	-	Р	Н
		199.75	20.5	-23	43.5	34.23	15.1	2.07	30.9	-	-	Р	Н
		426.73	21.85	-24.15	46	27.71	22.55	3.01	31.42	-	-	Р	Н
2.4GHz		746.83	29.19	-16.81	46	29.59	28.11	3.98	32.49	-	-	Р	Н
BT LF		32.91	30.4	-9.6	40	37.07	23.51	0.54	30.72	-	-	Р	٧
LF		39.7	31.15	-8.85	40	41.49	19.8	0.62	30.76	-	-	Р	٧
		44.55	22.44	-17.56	40	35.15	17.35	0.7	30.76	-	-	Р	٧
		98.87	18.66	-24.84	43.5	31.98	15.97	1.45	30.74	-	-	Р	٧
		187.14	17.05	-26.45	43.5	31.06	14.89	1.99	30.89	-	-	Р	٧
		285.11	19.21	-26.79	46	28.65	19.1	2.47	31.01	-	ı	Р	V

## Remark

No other spurious found.

All results are PASS against limit line.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483

: C3 of C5 Page Number Report Issued Date : Jun. 15, 2022

Report Version

: Rev. 01

Report No. : FR241204

## Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is <b>over limit</b> line.
P/A	Peak or Average
H/V	Horizontal or Vertical

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : C4 of C5
Report Issued Date : Jun. 15, 2022
Report Version : Rev. 01

**Report No. : FR241204** 

### A calculation example for radiated spurious emission is shown as below:

Report No.: FR241204

: C5 of C5

: Rev. 01

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
вт		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 00													
2402MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

- 1. Path Loss(dB) = Cable loss(dB) + Filter loss(dB) + Attenuator loss(dB)
- 2. Level( $dB\mu V/m$ ) =

Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

3. Over Limit(dB) = Level(dB $\mu$ V/m) – Limit Line(dB $\mu$ V/m)

#### For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

#### For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBμV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)


Both peak and average measured complies with the limit line, so test result is "PASS".

Sporton International Inc. (Kunshan) Page Number TEL: +86-512-57900158 Report Issued Date : Jun. 15, 2022 FAX: +86-512-57900958 Report Version


FCC ID: 2AJOTTA-1483

## Appendix D. Duty Cycle Plots

## 3DH5 on time (One Pulse) Plot on Channel 39

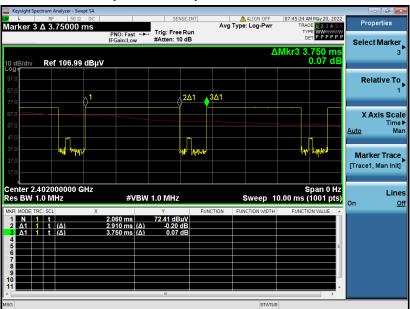

### 3DH5 on time (Count Pulses) Plot on Channel 39

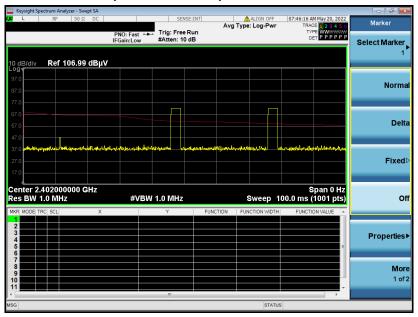

#### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds =  $2 \times 2.91 / 100 = 5.82 \%$
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.70 dB
- 3. 3DH5 has the highest duty cycle worst case and is reported.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AJOTTA-1483 Page Number : D1 of D1
Report Issued Date : Jun. 12, 2022
Report Version : Rev. 01

Report No.: FR241204