





Test Report No.: PSZ-NQN2303280110RF09

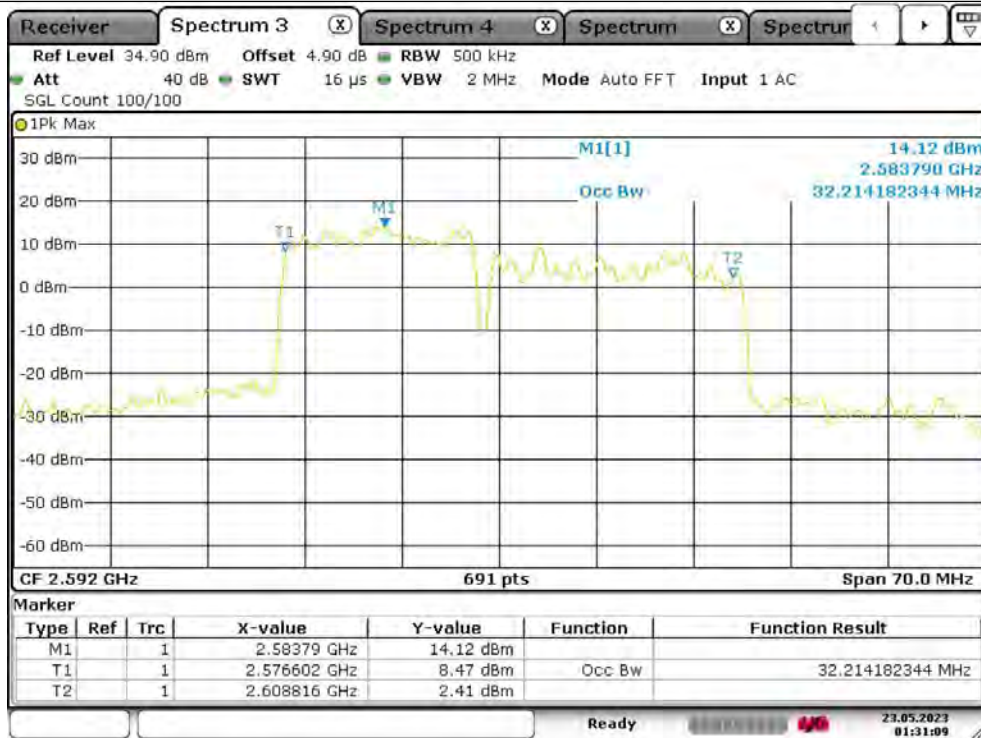

Date: 23.MAY.2023 01:31:09

41-41-15MHz-20MHz-16QAM-16QAM-41319-41490-75RB#0-100RB#0

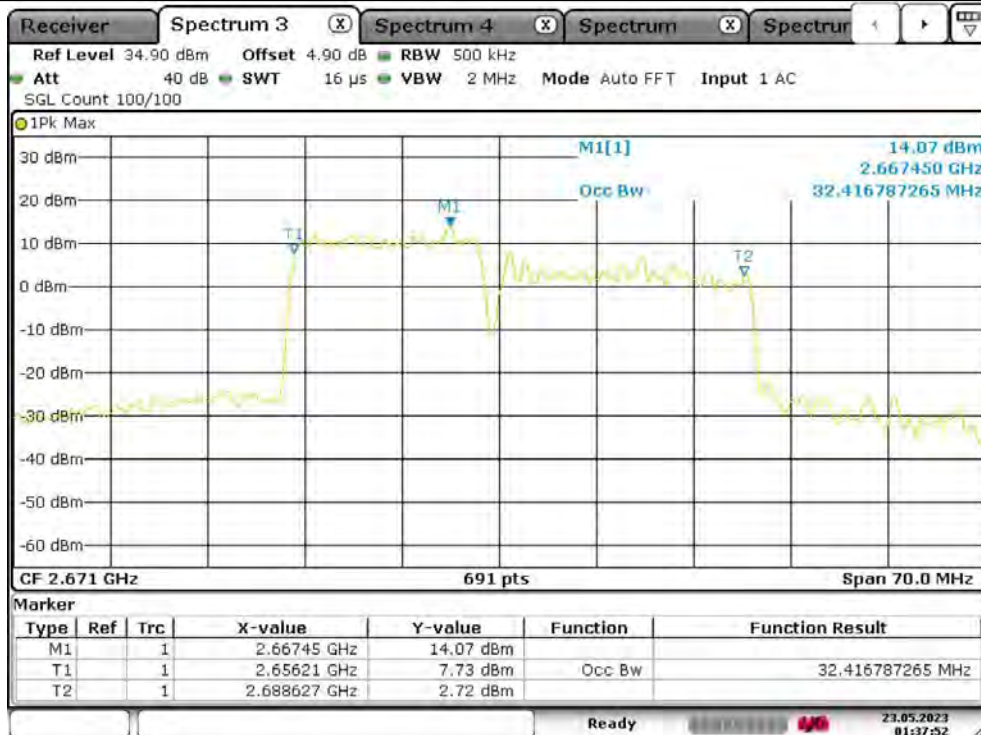


Date: 23.MAY.2023 01:37:55

41-41-15MHz-20MHz-64QAM-64QAM-39728-39899-75RB#0-100RB#0




BUREAU
VERITAS

Test Report No.: PSZ-NQN2303280110RF09

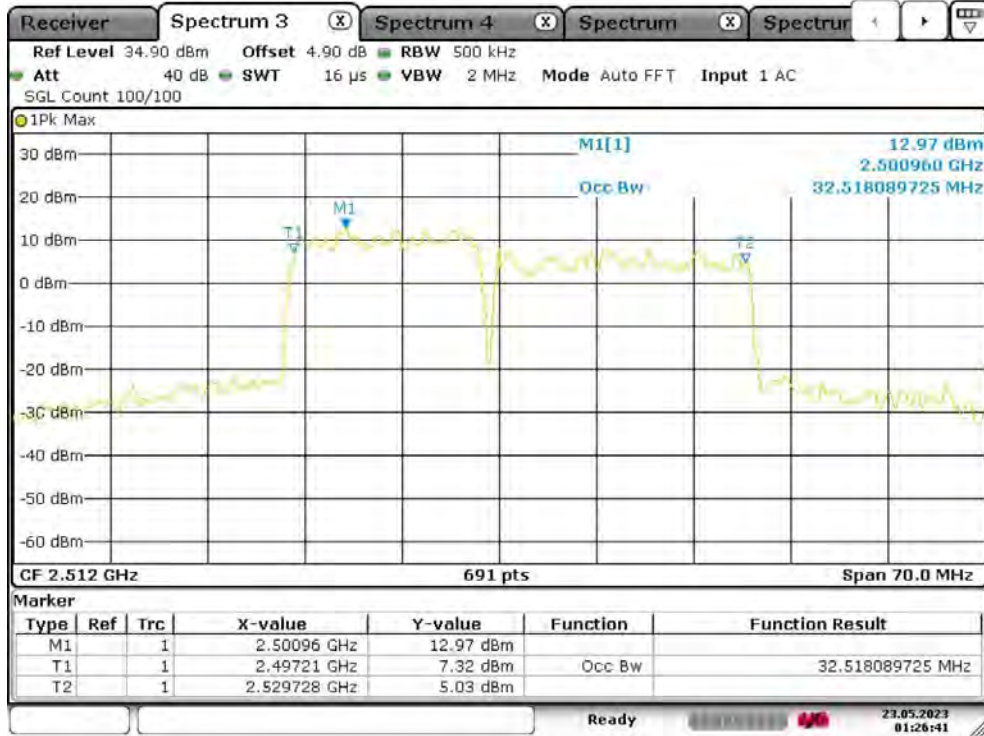

Date: 23.MAY.2023 01:26:42

41-41-15MHz-20MHz-64QAM-64QAM-40523-40694-75RB#0-100RB#0

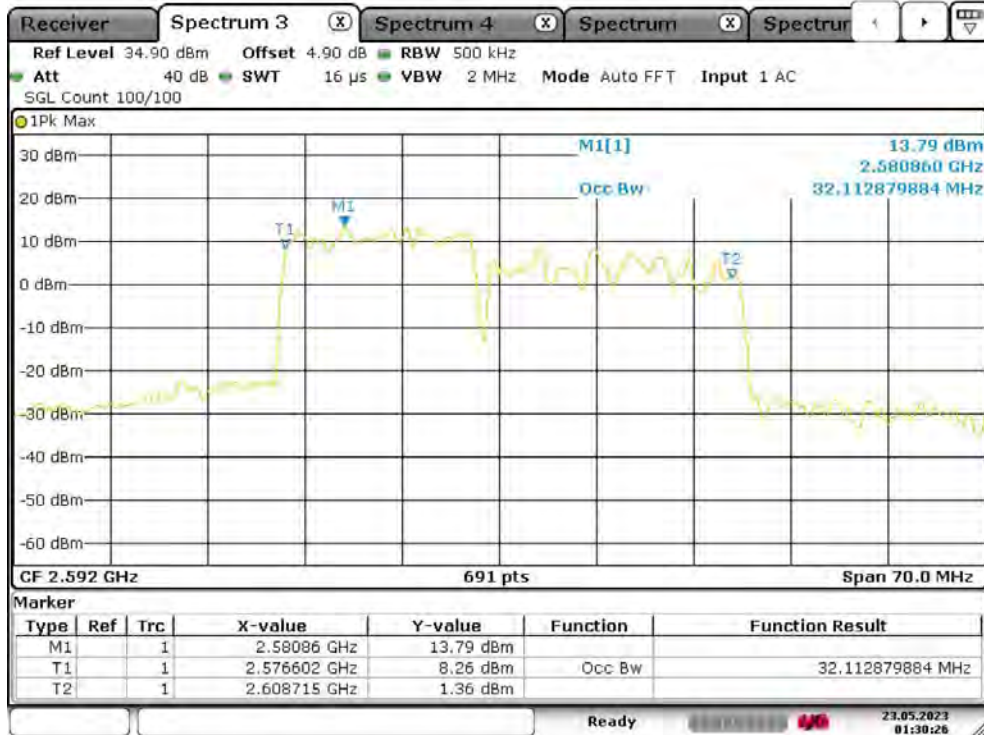


Date: 23.MAY.2023 01:30:26

41-41-15MHz-20MHz-64QAM-64QAM-41319-41490-75RB#0-100RB#0




Test Report No.: PSZ-NQN2303280110RF09

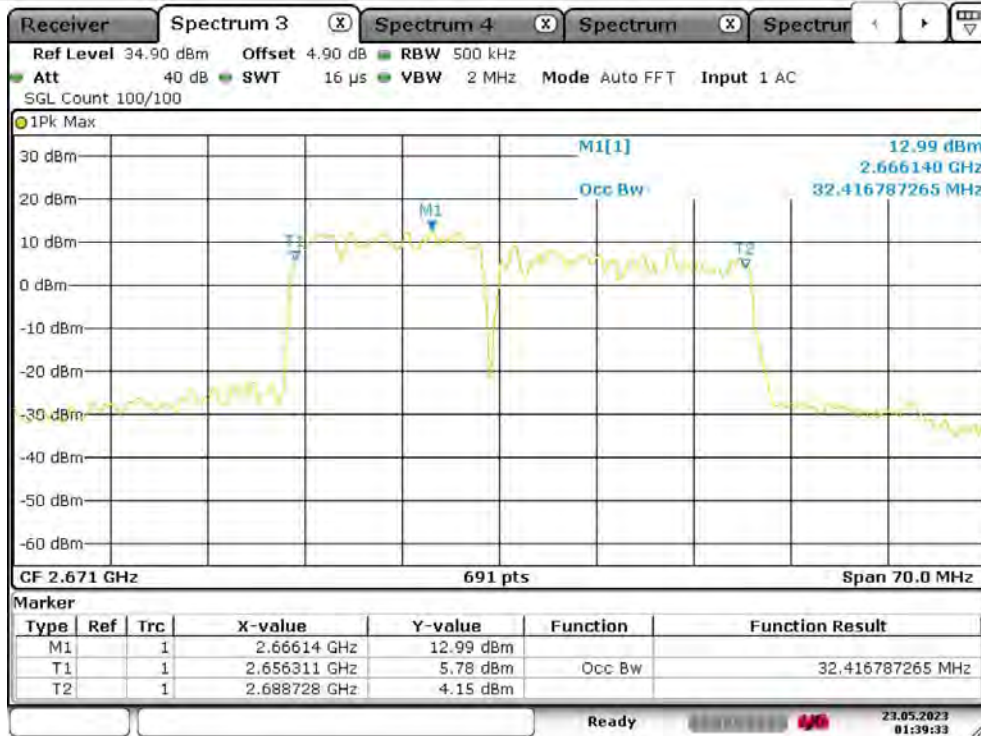

Date: 23.MAY.2023 01:39:33

41-41-20MHz-10MHz-QPSK-QPSK-39750-39894-100RB#0-50RB#0

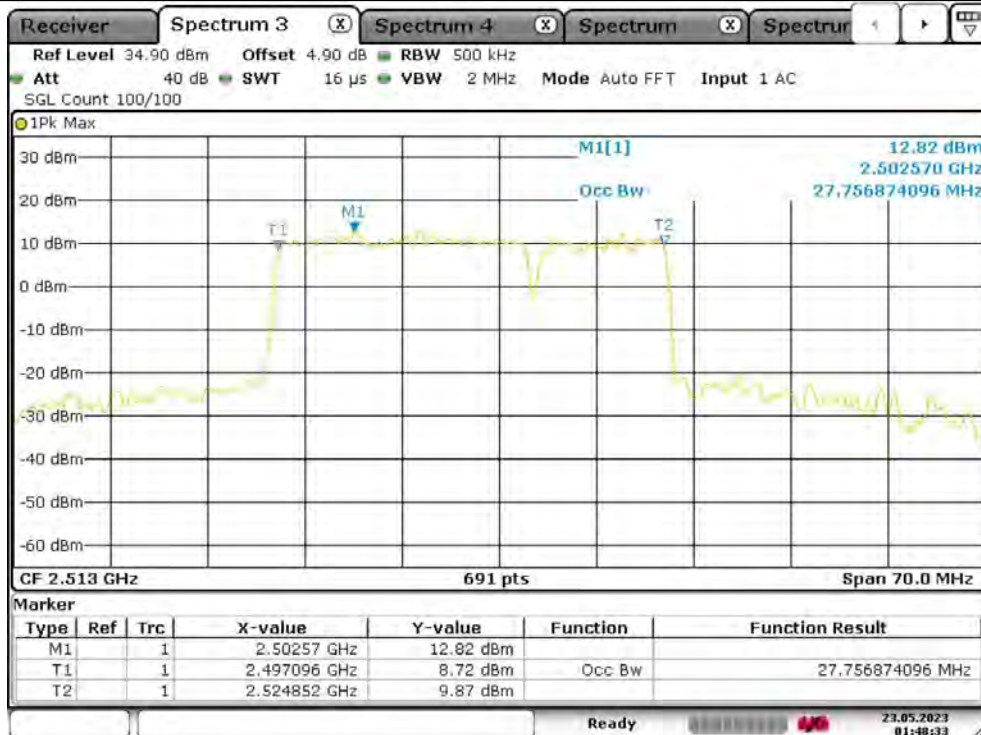


Date: 23.MAY.2023 01:48:32

41-41-20MHz-10MHz-QPSK-QPSK-40571-40715-100RB#0-50RB#0




Test Report No.: PSZ-NQN2303280110RF09

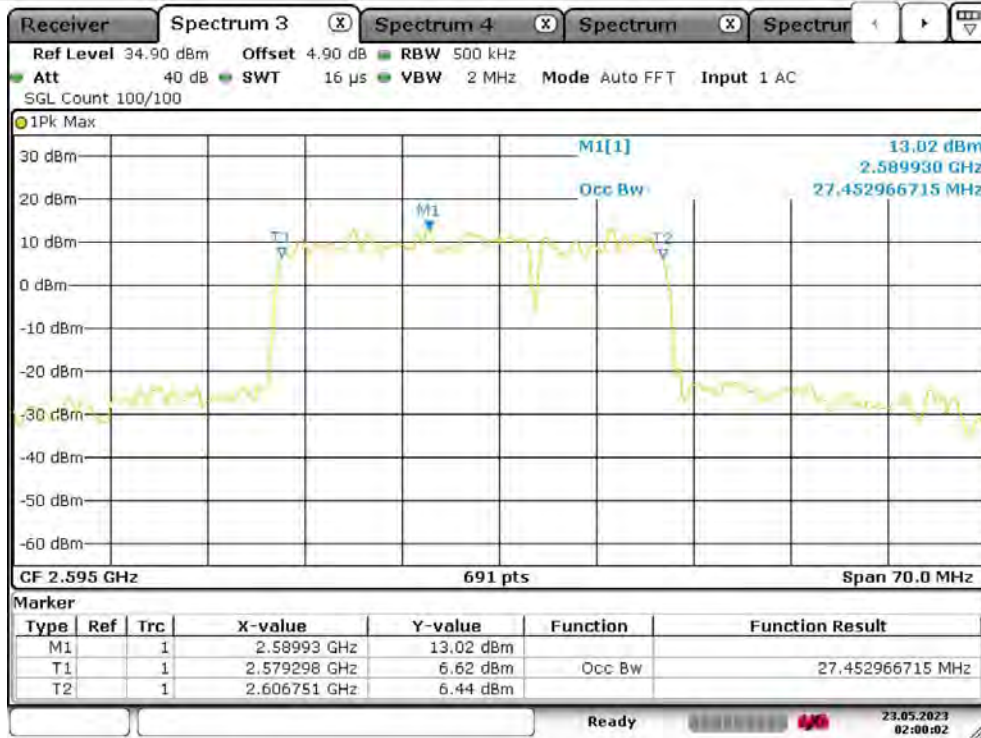

Date: 23.MAY.2023 02:00:02

41-41-20MHz-10MHz-QPSK-QPSK-41391-41535-100RB#0-50RB#0

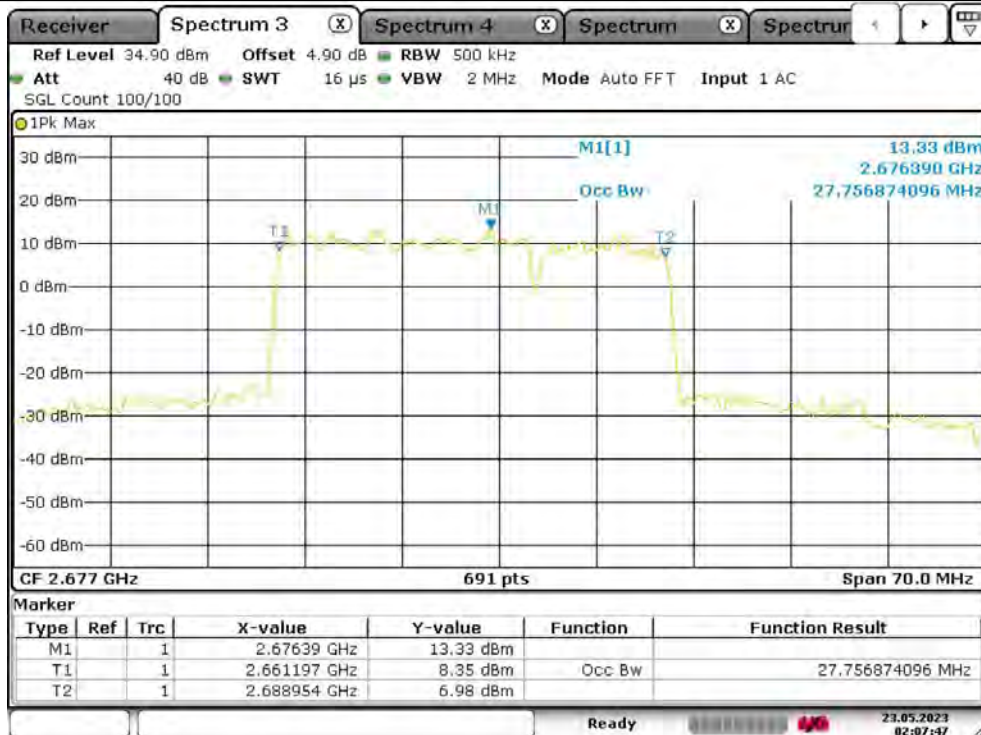


Date: 23.MAY.2023 02:07:47

41-41-20MHz-10MHz-16QAM-16QAM-39750-39894-100RB#0-50RB#0




Test Report No.: PSZ-NQN2303280110RF09

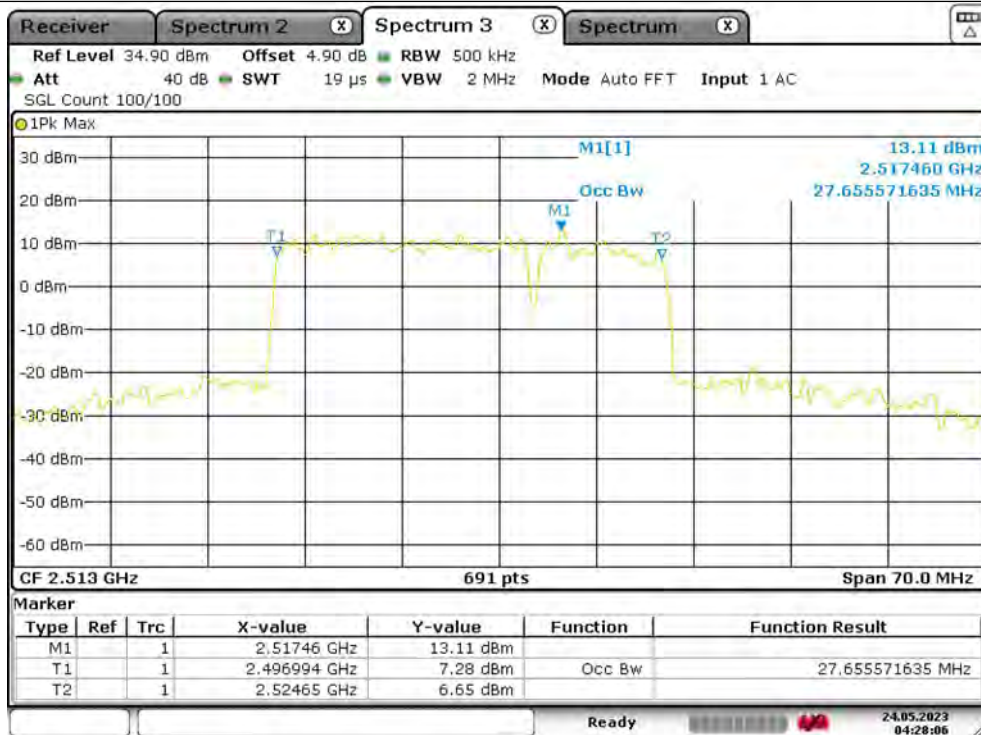

Date: 24.MAY.2023 04:28:07

41-41-20MHz-10MHz-16QAM-16QAM-40571-40715-100RB#0-50RB#0

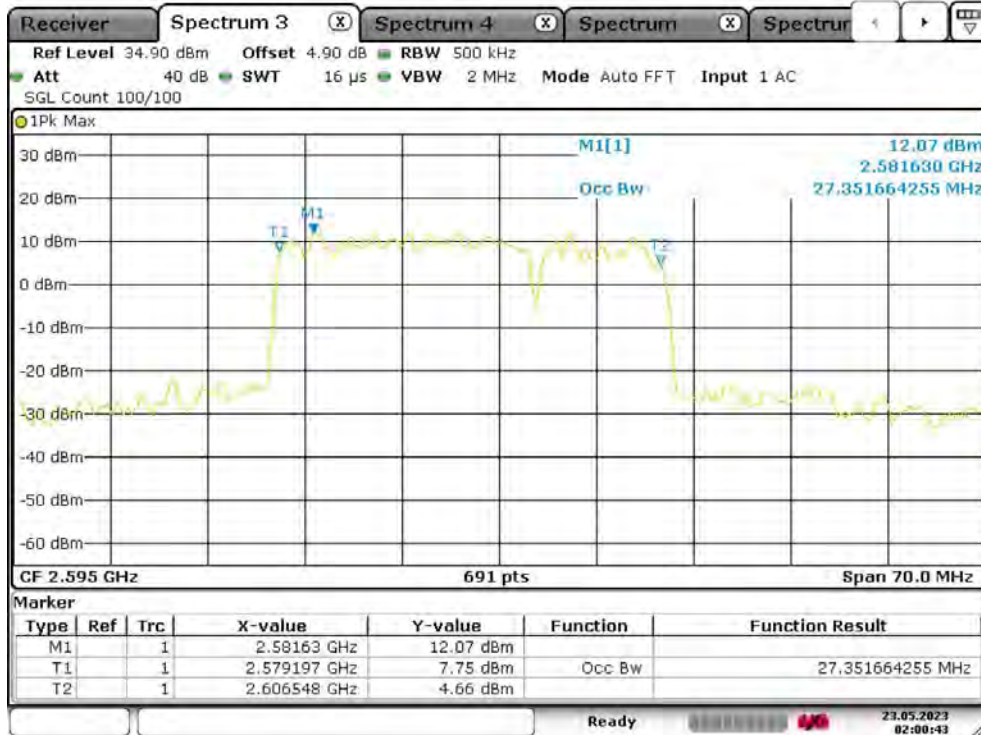


Date: 23.MAY.2023 02:00:42

41-41-20MHz-10MHz-16QAM-16QAM-41391-41535-100RB#0-50RB#0



Test Report No.: PSZ-NQN2303280110RF09

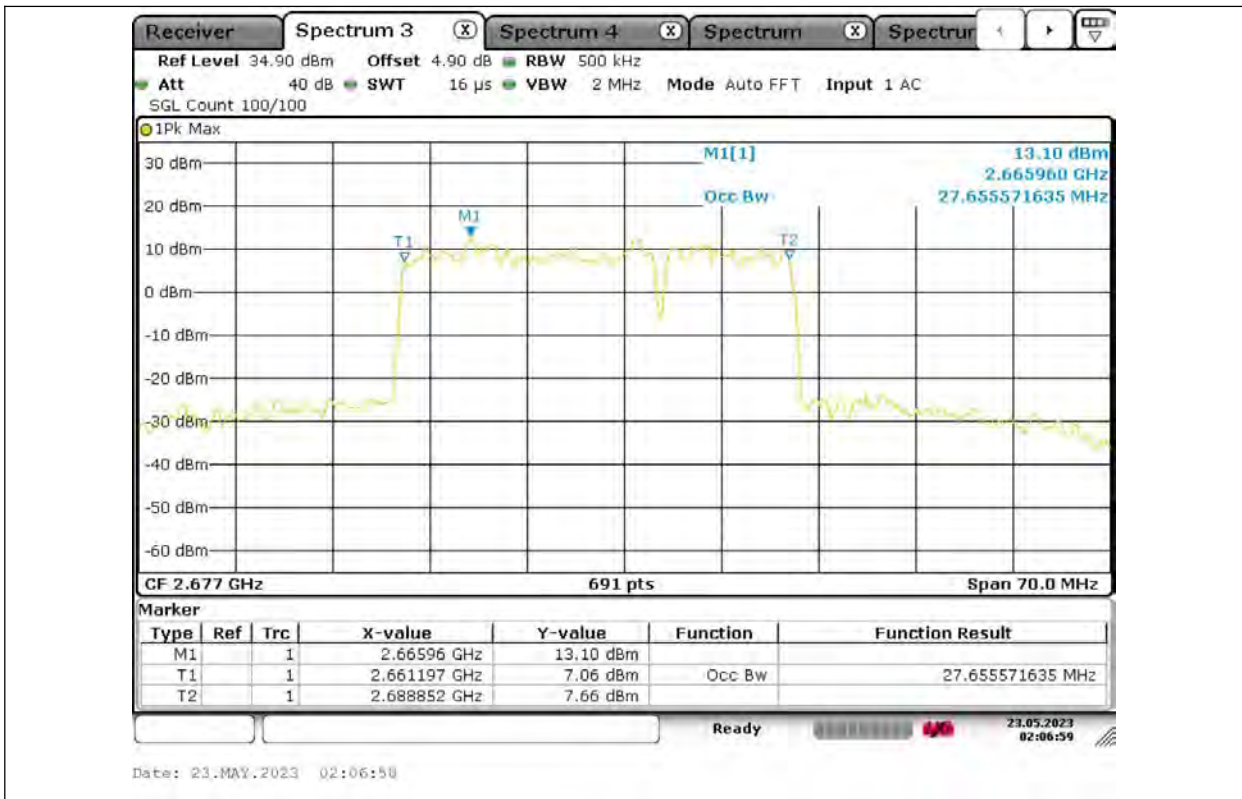


41-41-20MHz-10MHz-64QAM-64QAM-39750-39894-100RB#0-50RB#0



41-41-20MHz-10MHz-64QAM-64QAM-40571-40715-100RB#0-50RB#0




Test Report No.: PSZ-NQN2303280110RF09

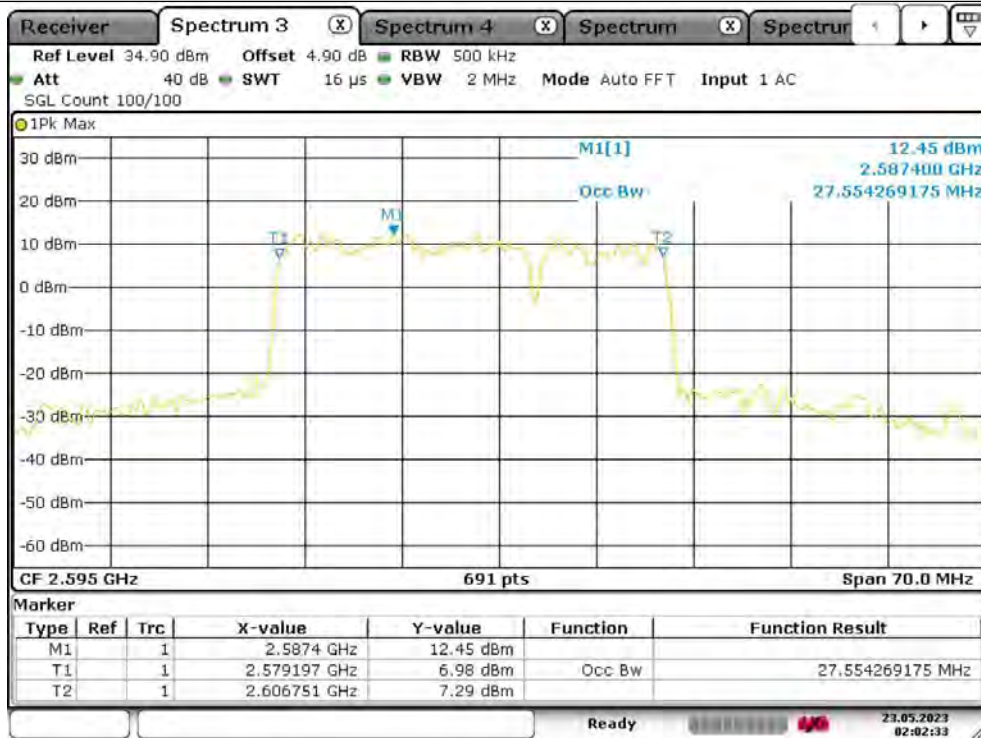

Date: 23.MAY.2023 02:02:52

41-41-20MHz-10MHz-64QAM-64QAM-41391-41535-100RB#0-50RB#0

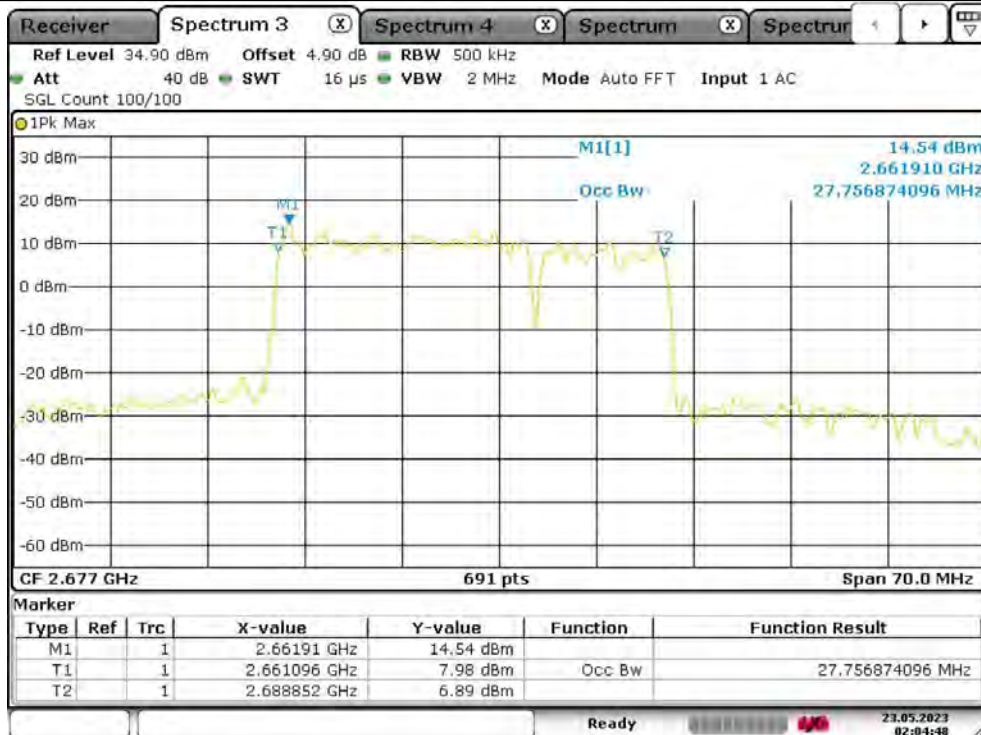


Date: 23.MAY.2023 02:04:48

41-41-20MHz-15MHz-QPSK-QPSK-39750-39921-100RB#0-75RB#0




Test Report No.: PSZ-NQN2303280110RF09

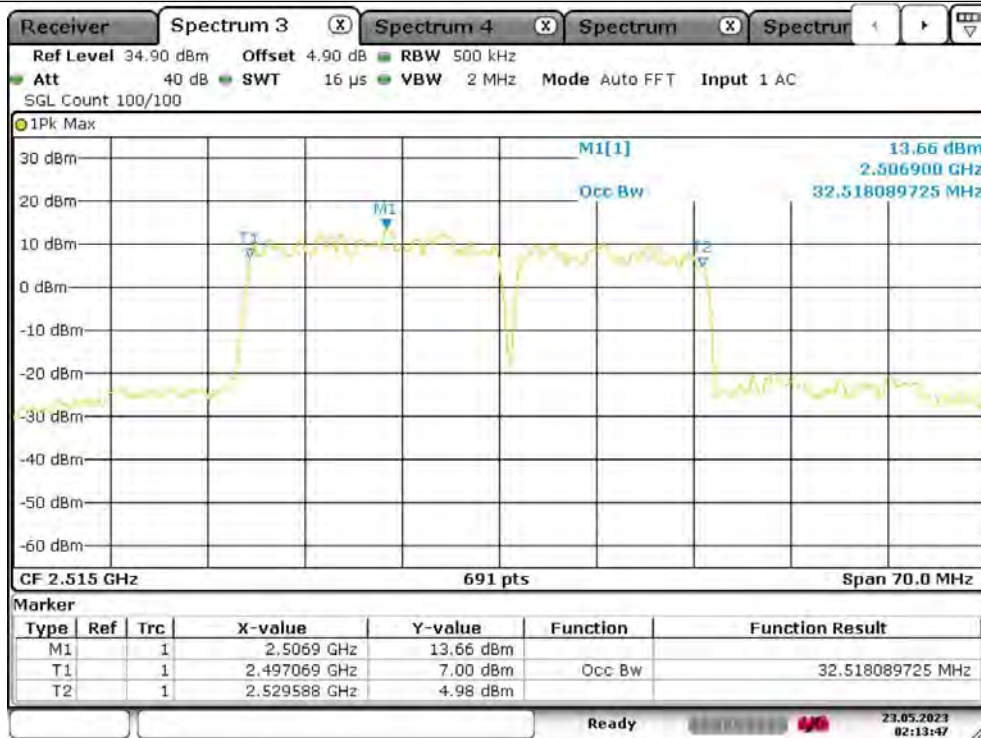

Date: 23.MAY.2023 02:13:47

41-41-20MHz-15MHz-QPSK-QPSK-40546-40717-100RB#0-75RB#0

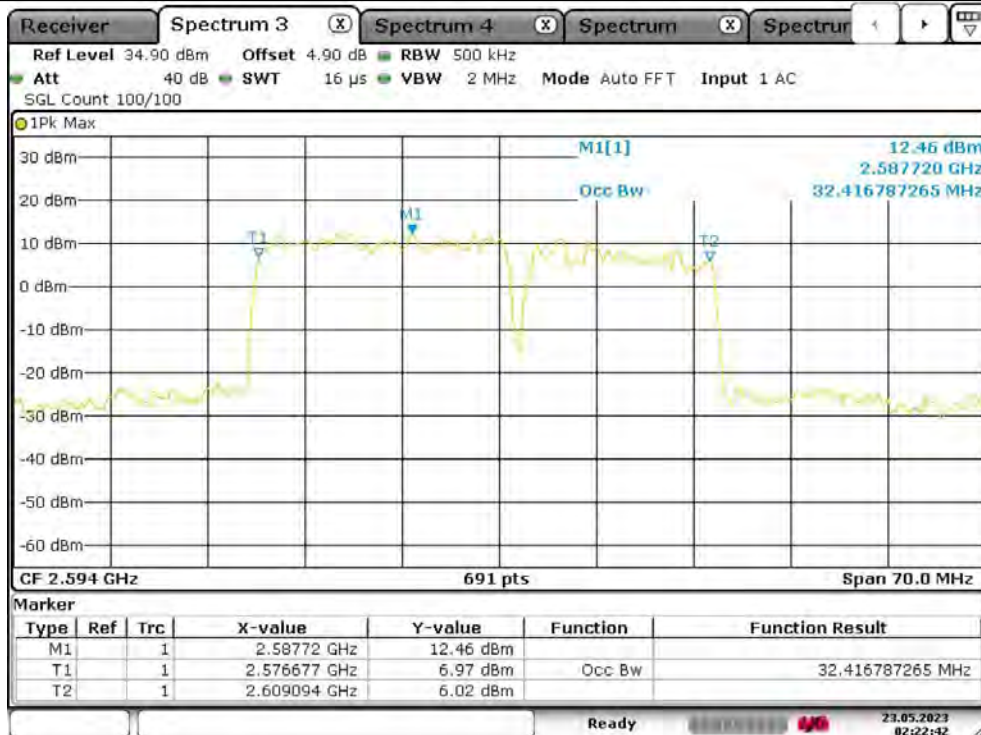


Date: 23.MAY.2023 02:22:42

41-41-20MHz-15MHz-QPSK-QPSK-41341-41512-100RB#0-75RB#0




Test Report No.: PSZ-NQN2303280110RF09

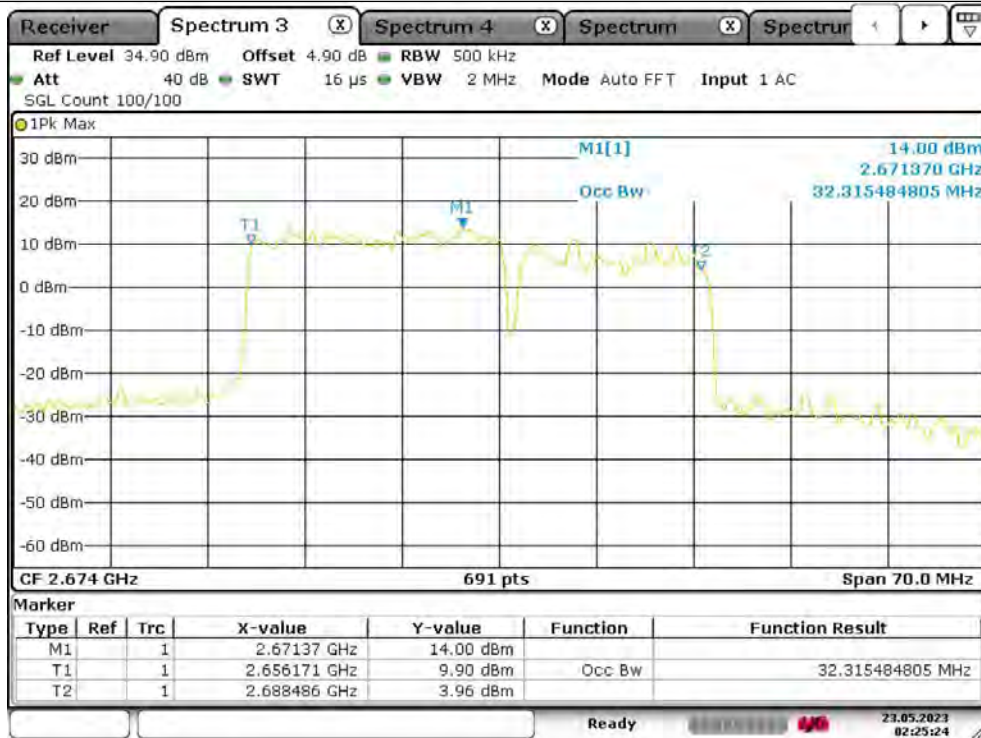

Date: 23.MAY.2023 02:25:24

41-41-20MHz-15MHz-16QAM-16QAM-39750-39921-100RB#0-75RB#0

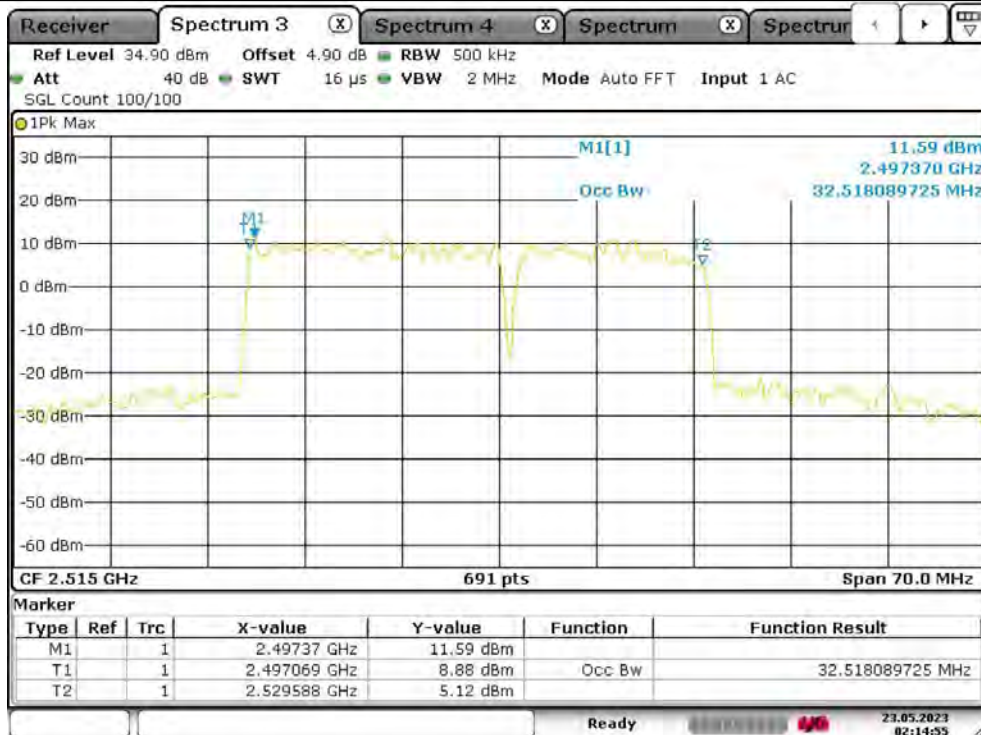


Date: 23.MAY.2023 02:14:55

41-41-20MHz-15MHz-16QAM-16QAM-40546-40717-100RB#0-75RB#0




BUREAU VERITAS

Test Report No.: PSZ-NQN2303280110RF09

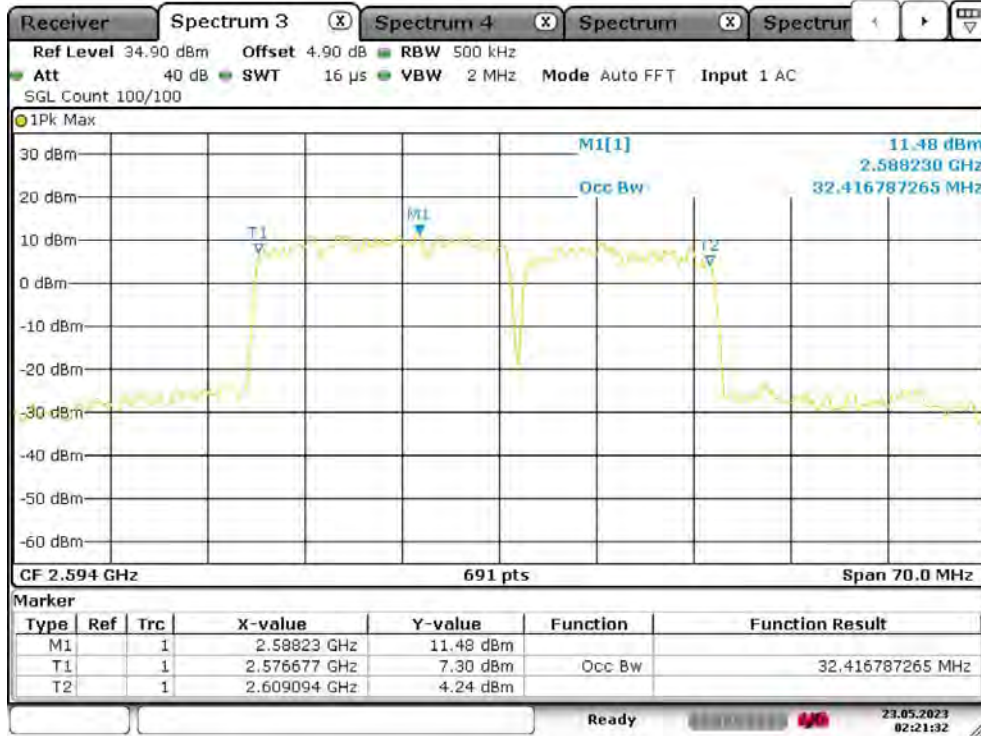

Date: 23.MAY.2023 02:21:32

41-41-20MHz-15MHz-16QAM-16QAM-41341-41512-100RB#0-75RB#0

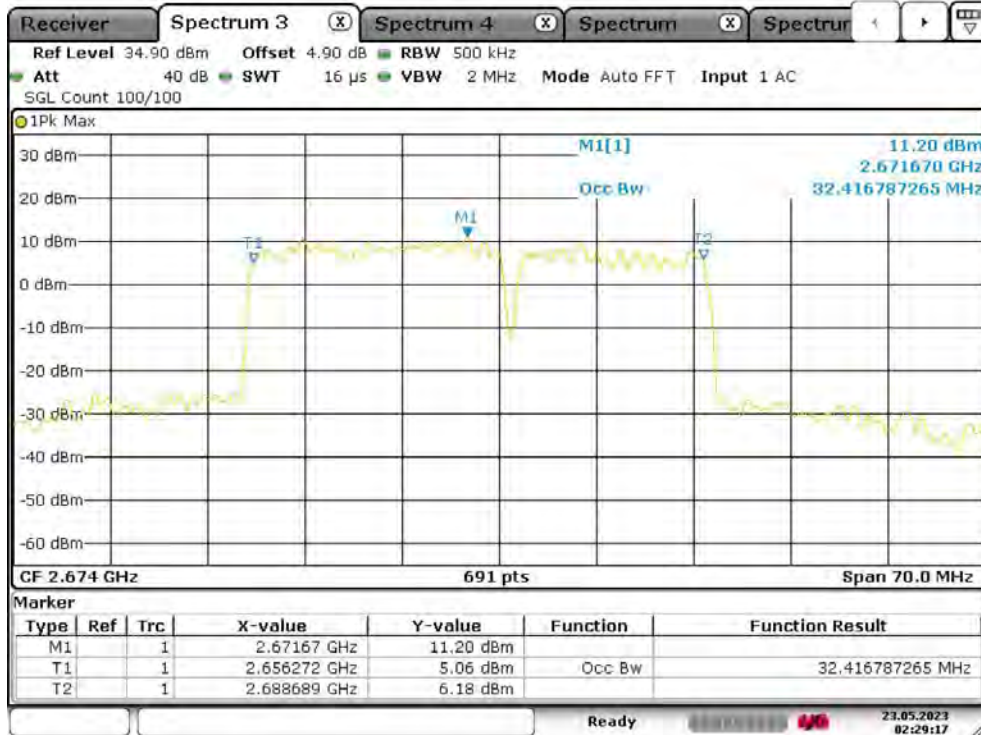


Date: 23.MAY.2023 02:29:17

41-41-20MHz-15MHz-64QAM-64QAM-39750-39921-100RB#0-75RB#0




Test Report No.: PSZ-NQN2303280110RF09

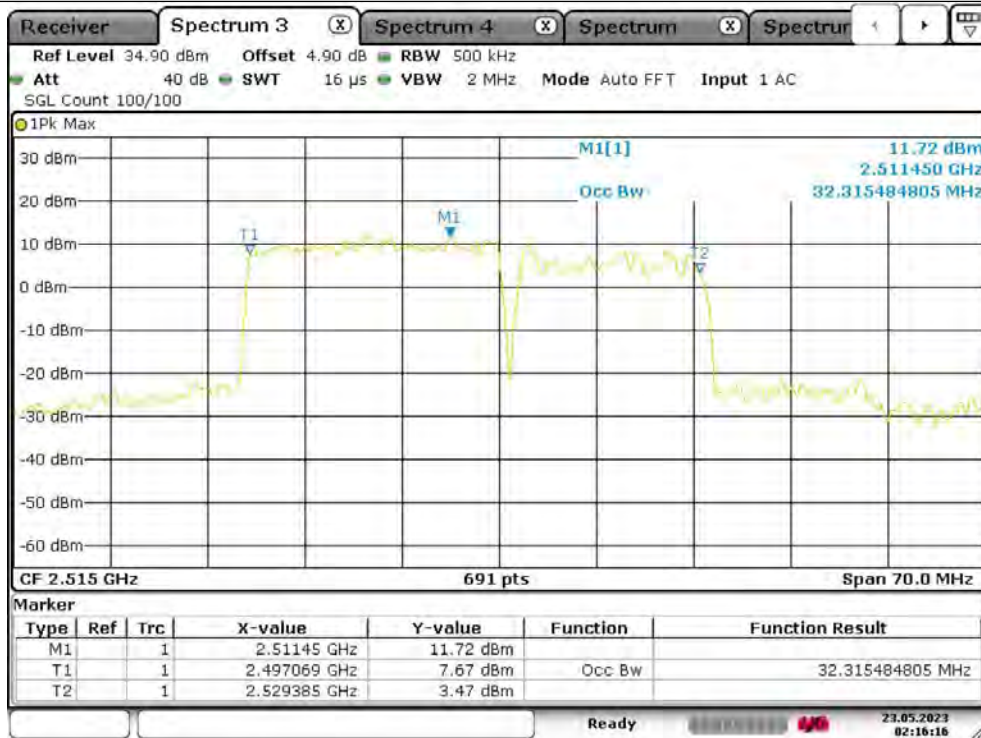

Date: 23.MAY.2023 02:16:15

41-41-20MHz-15MHz-64QAM-64QAM-40546-40717-100RB#0-75RB#0

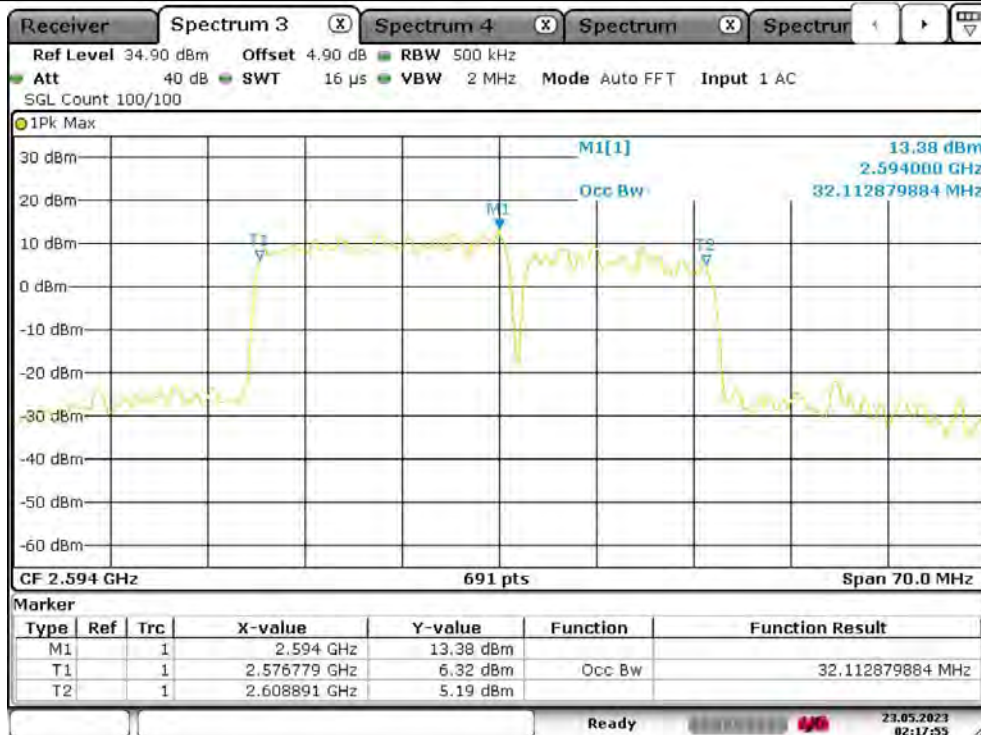


Date: 23.MAY.2023 02:17:54


41-41-20MHz-15MHz-64QAM-64QAM-41341-41512-100RB#0-75RB#0



Test Report No.: PSZ-NQN2303280110RF09

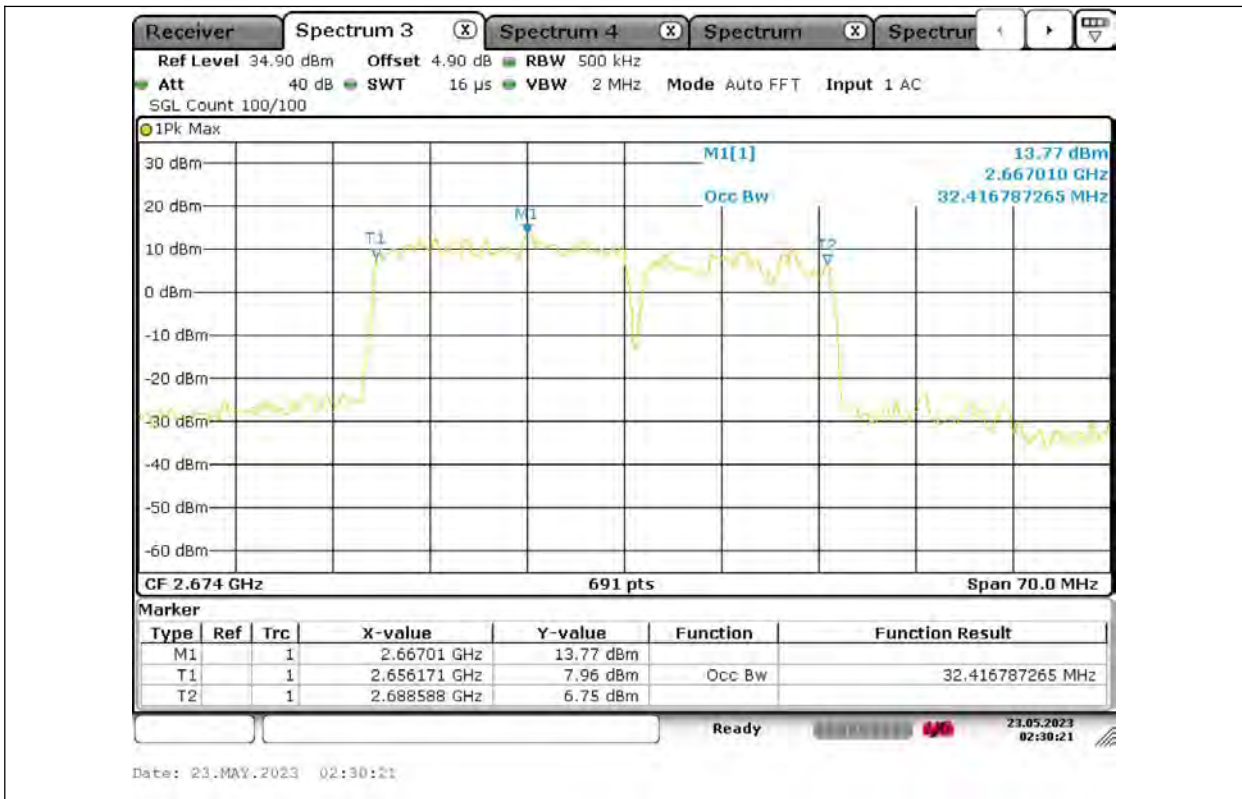


41-41-20MHz-20MHz-QPSK-QPSK-39750-39948-100RB#0-100RB#0

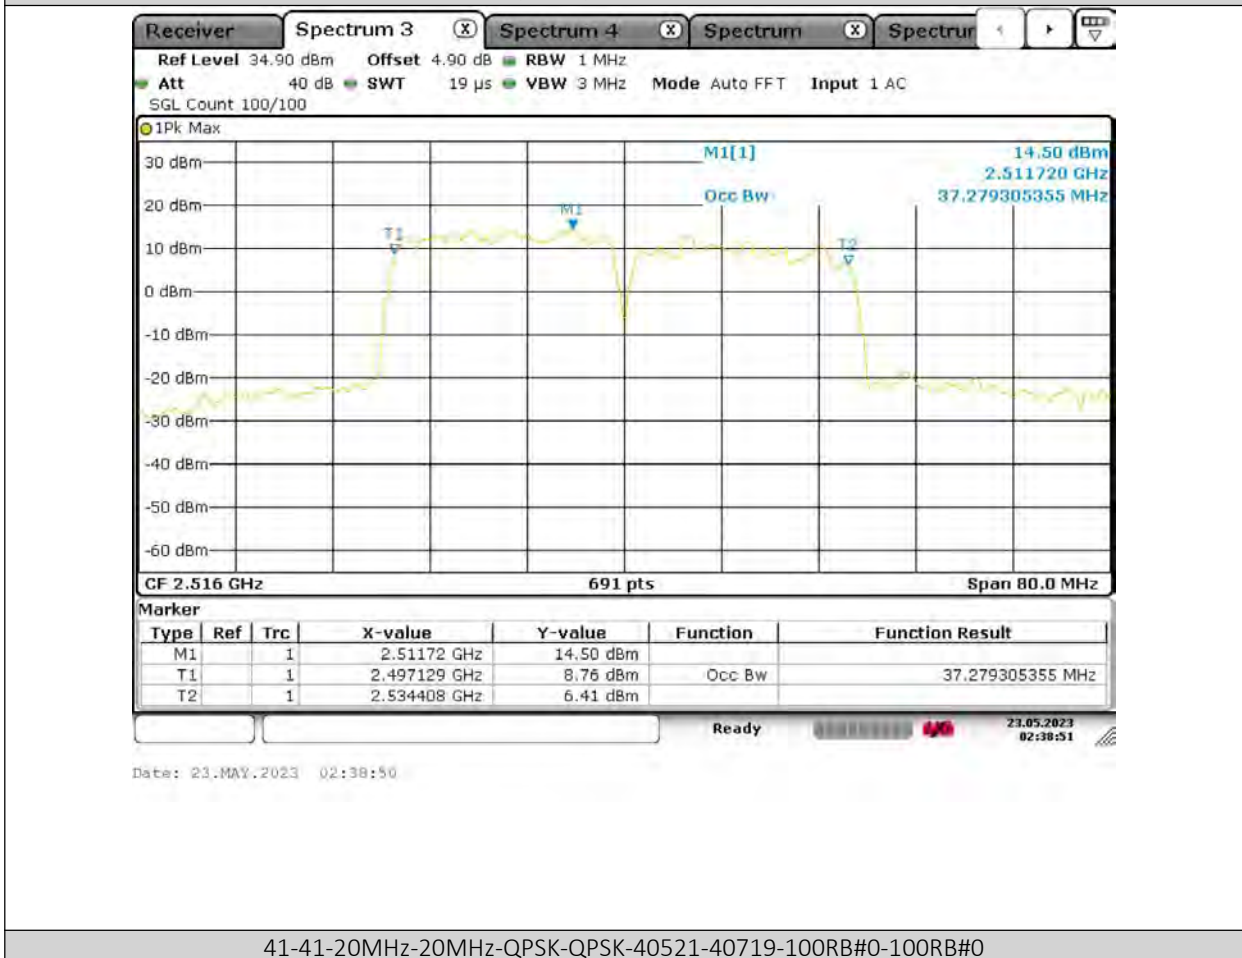

41-41-20MHz-20MHz-QPSK-QPSK-40521-40719-100RB#0-100RB#0




Test Report No.: PSZ-NQN2303280110RF09

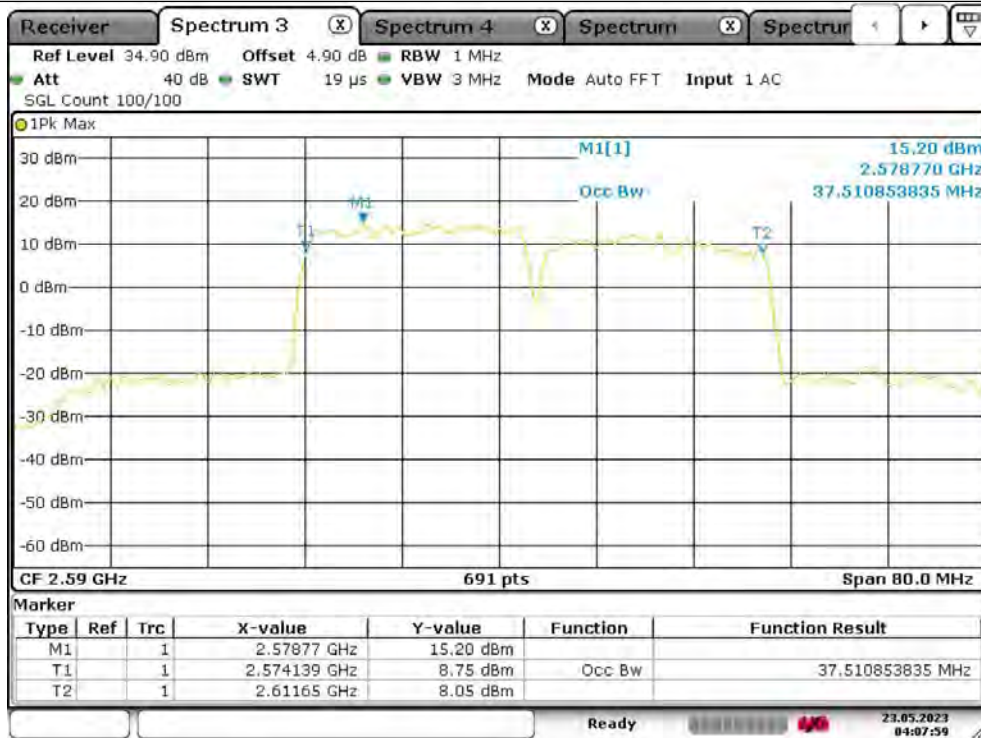

Date: 23.MAY.2023 04:07:59

41-41-20MHz-20MHz-QPSK-QPSK-41292-41490-100RB#0-100RB#0

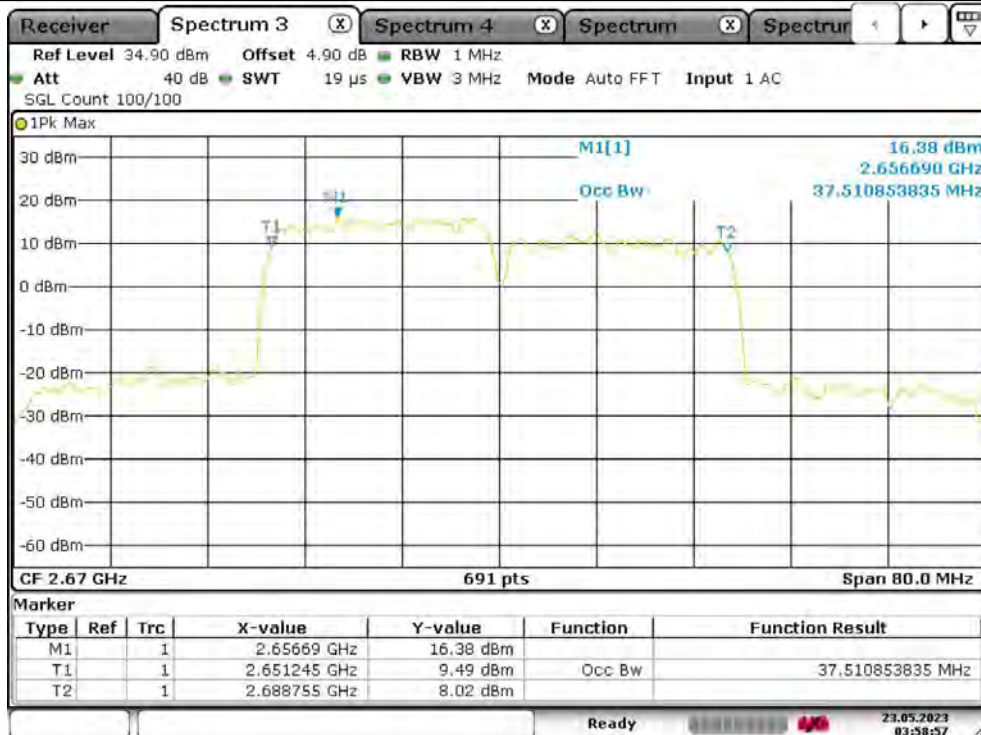


Date: 23.MAY.2023 03:58:57

41-41-20MHz-20MHz-16QAM-16QAM-39750-39948-100RB#0-100RB#0




Test Report No.: PSZ-NQN2303280110RF09

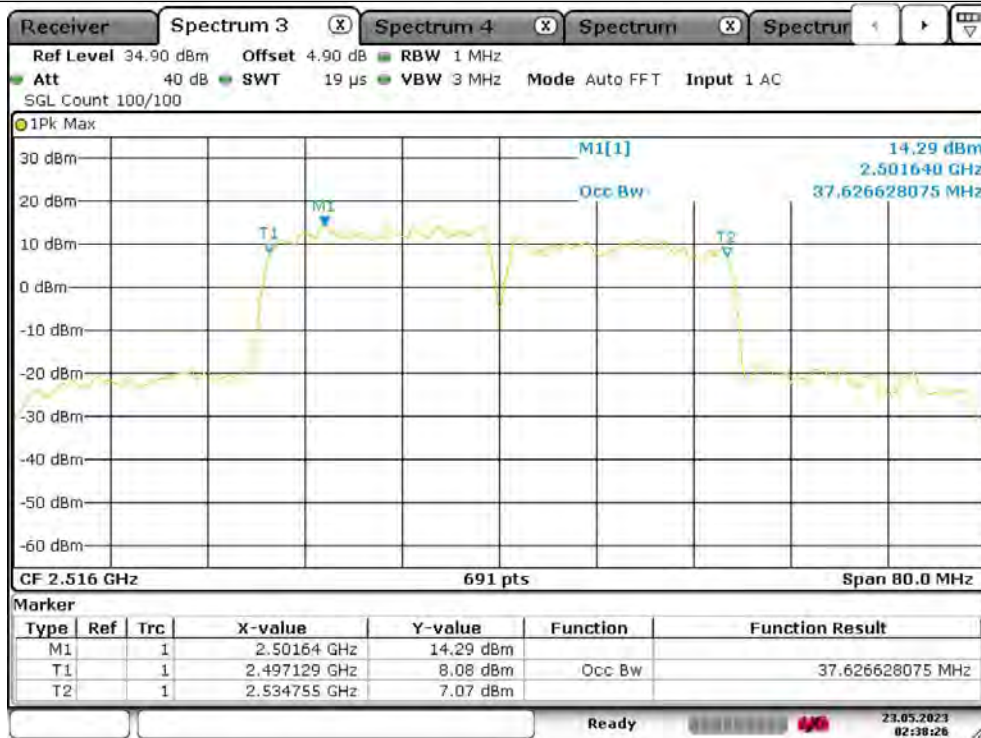

Date: 23.MAY.2023 02:38:26

41-41-20MHz-20MHz-16QAM-16QAM-40521-40719-100RB#0-100RB#0

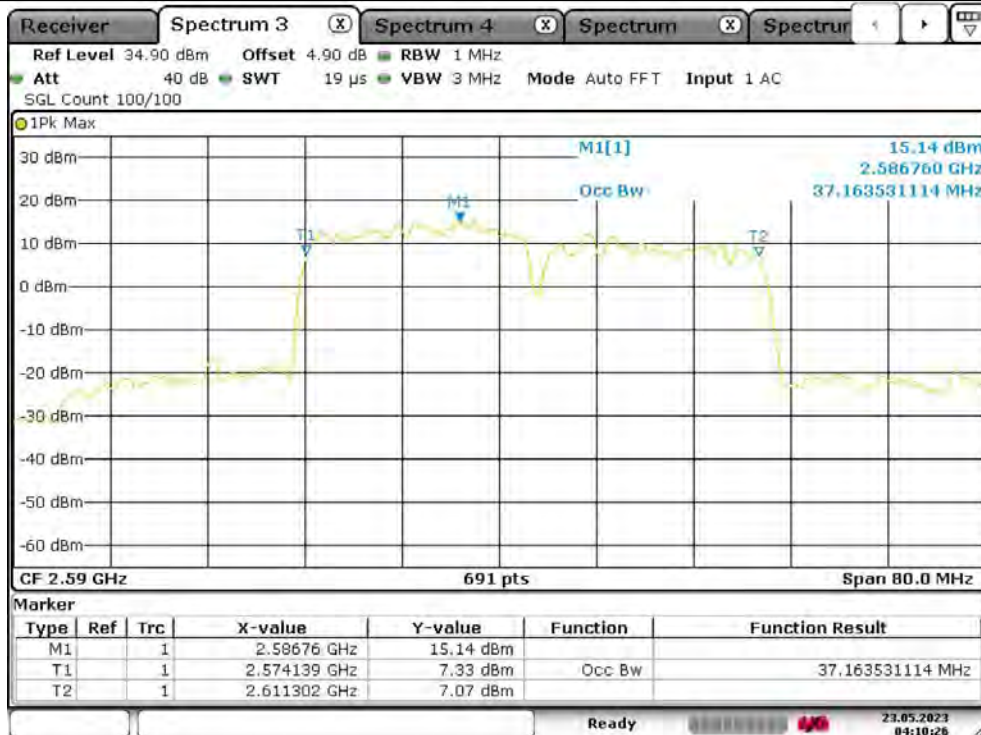


Date: 23.MAY.2023 04:10:26


41-41-20MHz-20MHz-16QAM-16QAM-41292-41490-100RB#0-100RB#0



Test Report No.: PSZ-NQN2303280110RF09

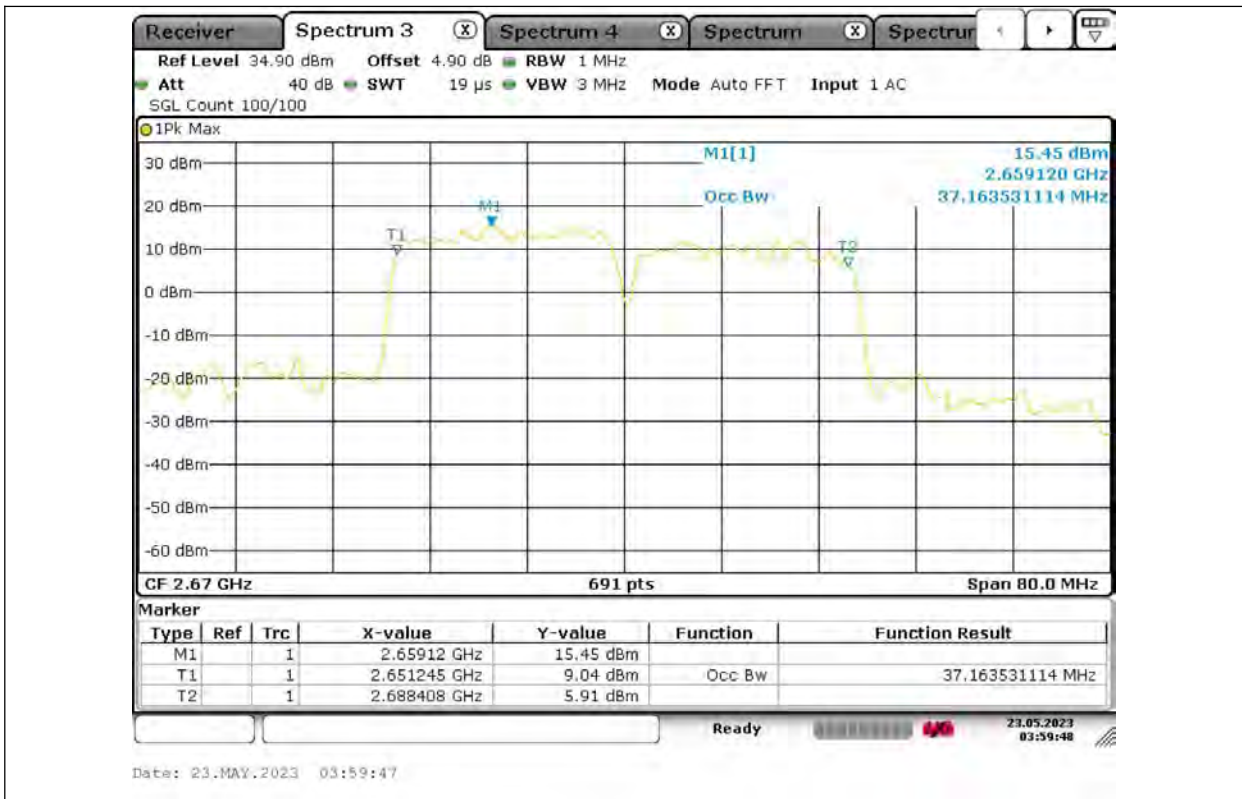


41-41-20MHz-20MHz-64QAM-64QAM-39750-39948-100RB#0-100RB#0

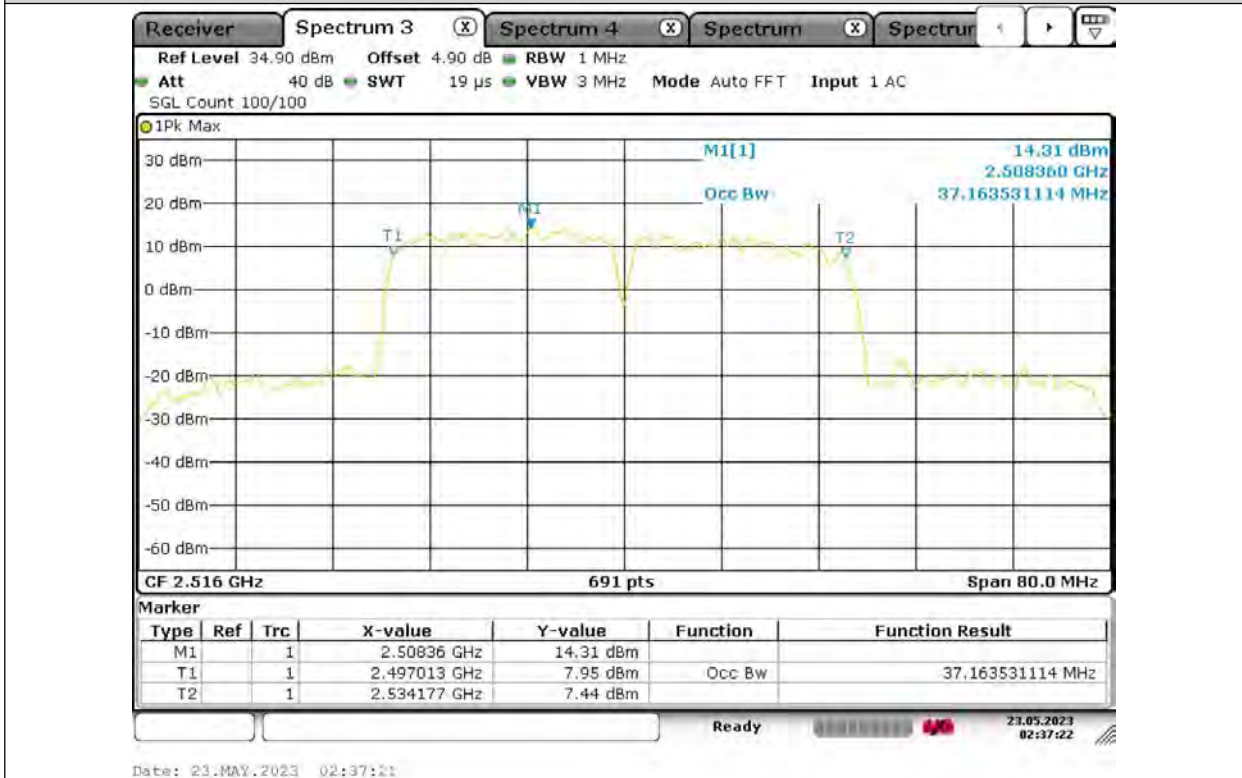

41-41-20MHz-20MHz-64QAM-64QAM-40521-40719-100RB#0-100RB#0




Test Report No.: PSZ-NQN2303280110RF09

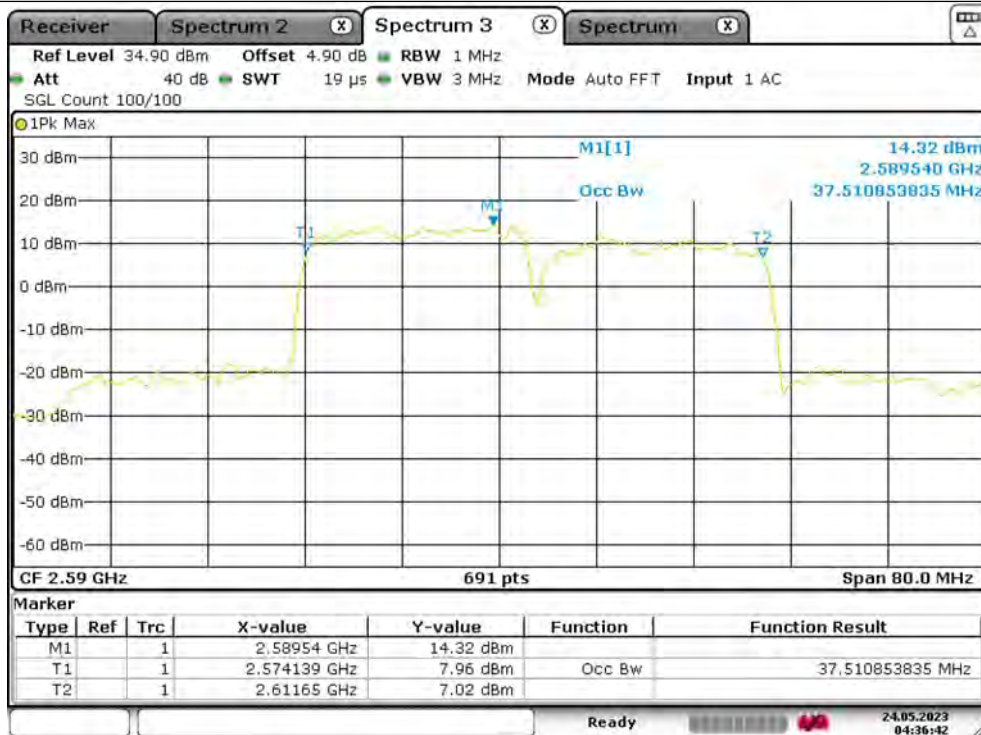

Date: 24.MAY.2023 04:36:43

41-41-20MHz-20MHz-64QAM-64QAM-41292-41490-100RB#0-100RB#0

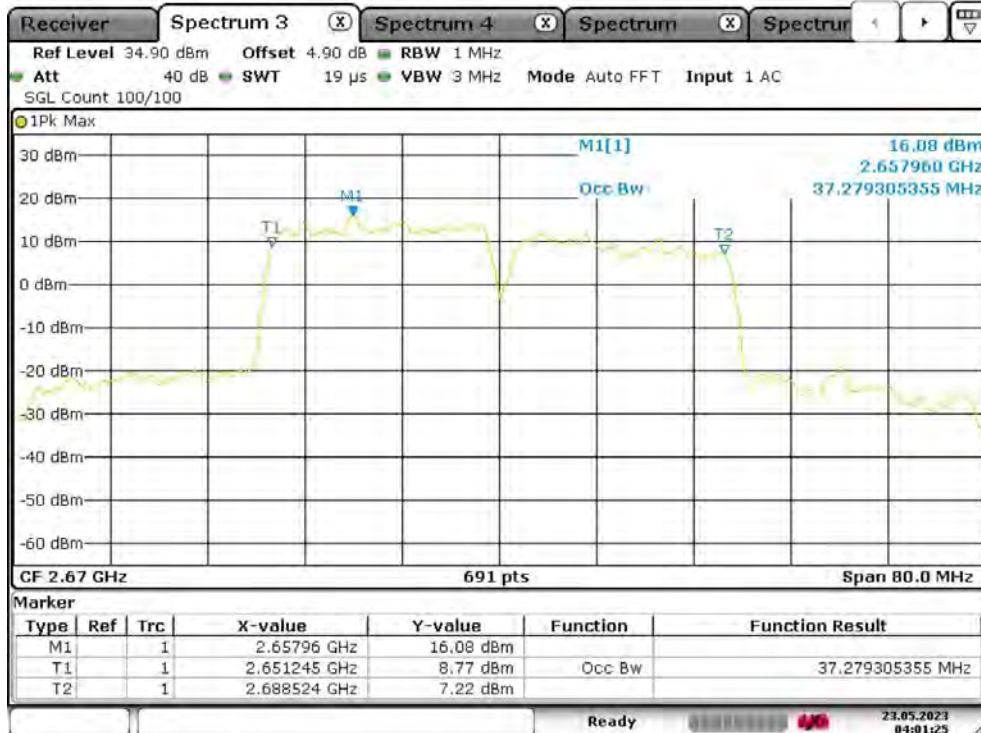


Date: 23.MAY.2023 04:01:25

41-41-20MHz-5MHz-QPSK-QPSK-39750-39867-100RB#0-25RB#0




Test Report No.: PSZ-NQN2303280110RF09

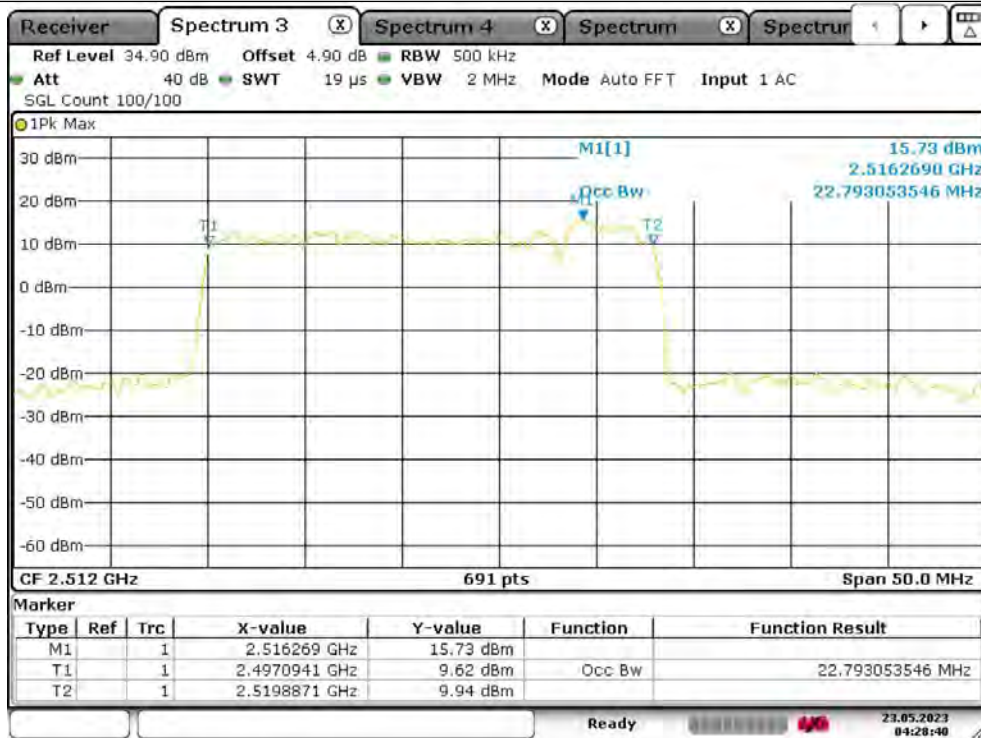

Date: 23.MAY.2023 04:28:40

41-41-20MHz-5MHz-QPSK-QPSK-40595-40712-100RB#0-25RB#0

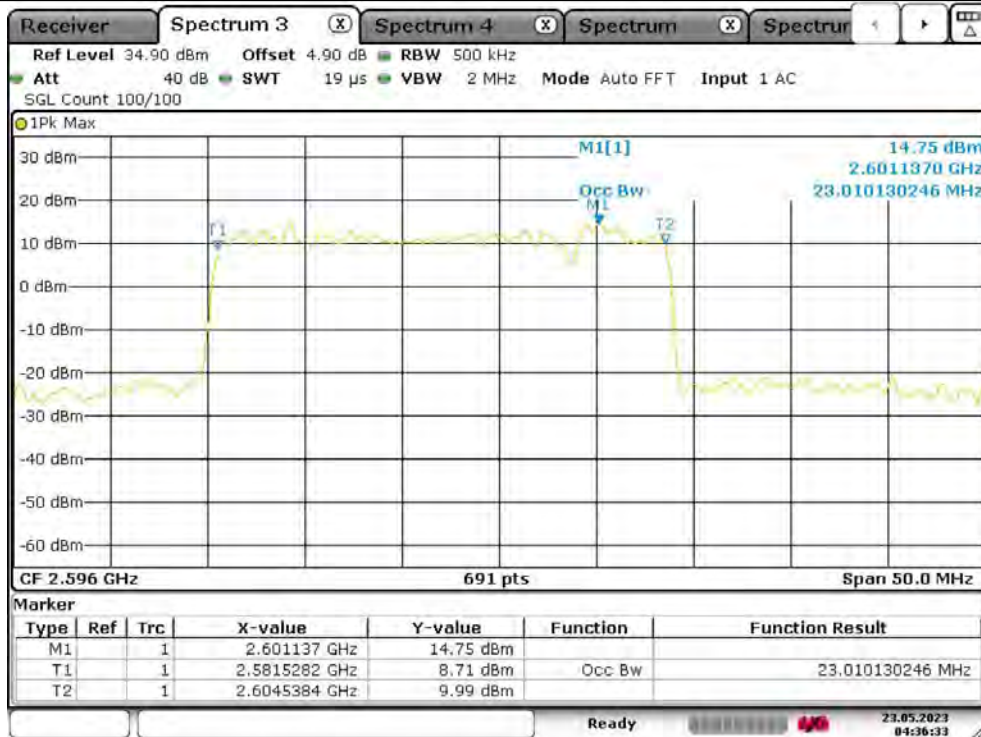


Date: 23.MAY.2023 04:36:33


41-41-20MHz-5MHz-QPSK-QPSK-41440-41557-100RB#0-25RB#0



Test Report No.: PSZ-NQN2303280110RF09

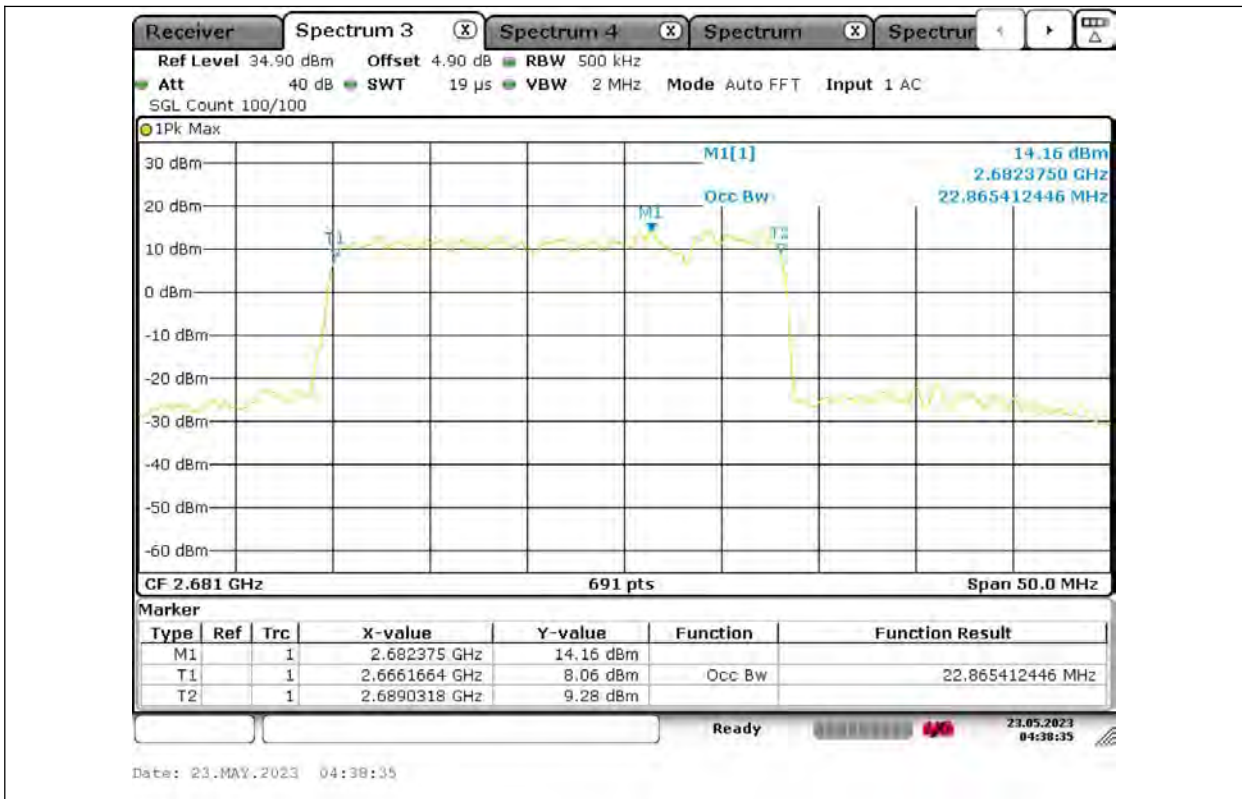


41-41-20MHz-5MHz-16QAM-16QAM-39750-39867-100RB#0-25RB#0

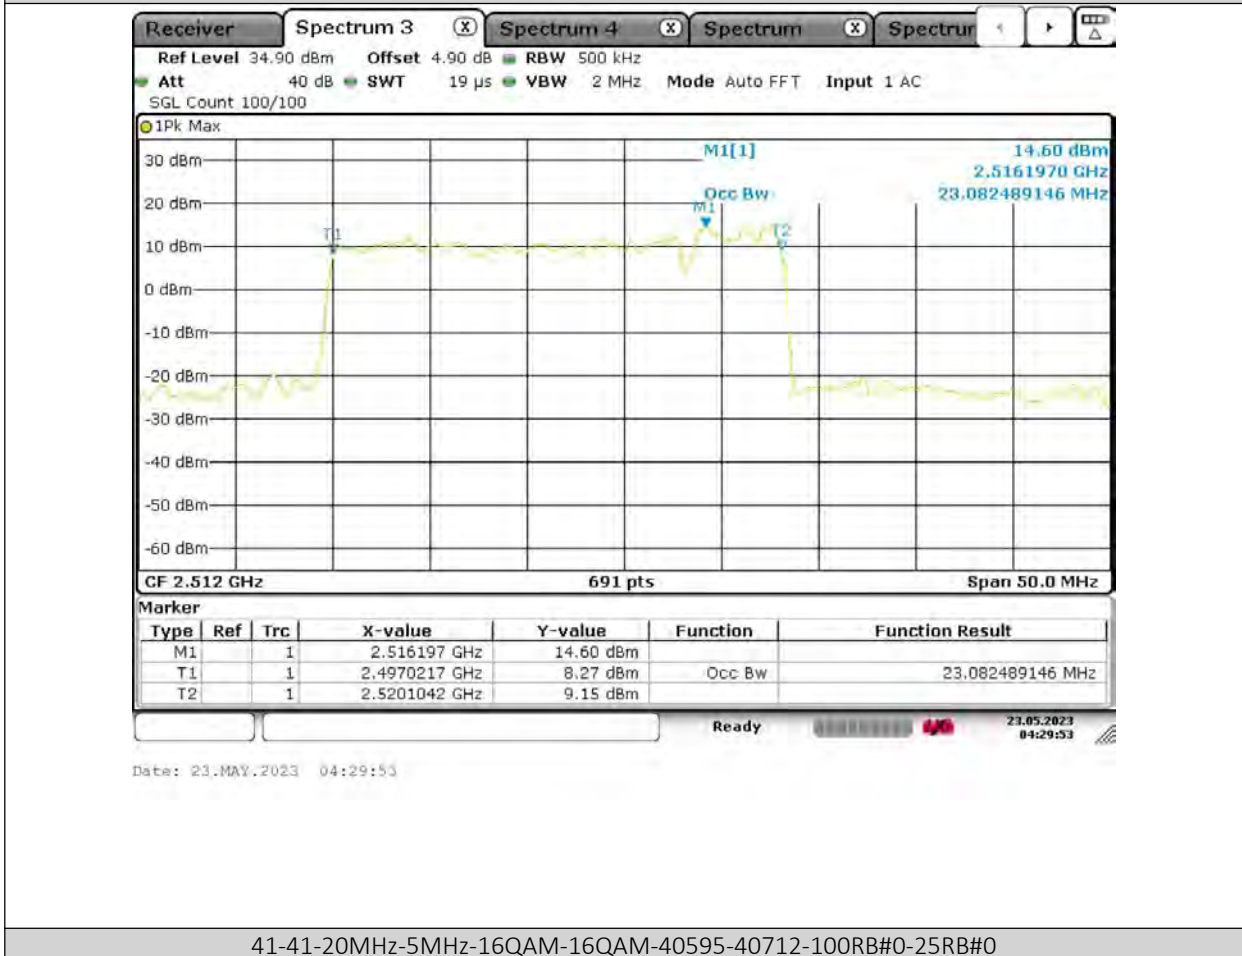

41-41-20MHz-5MHz-16QAM-16QAM-40595-40712-100RB#0-25RB#0




Test Report No.: PSZ-NQN2303280110RF09

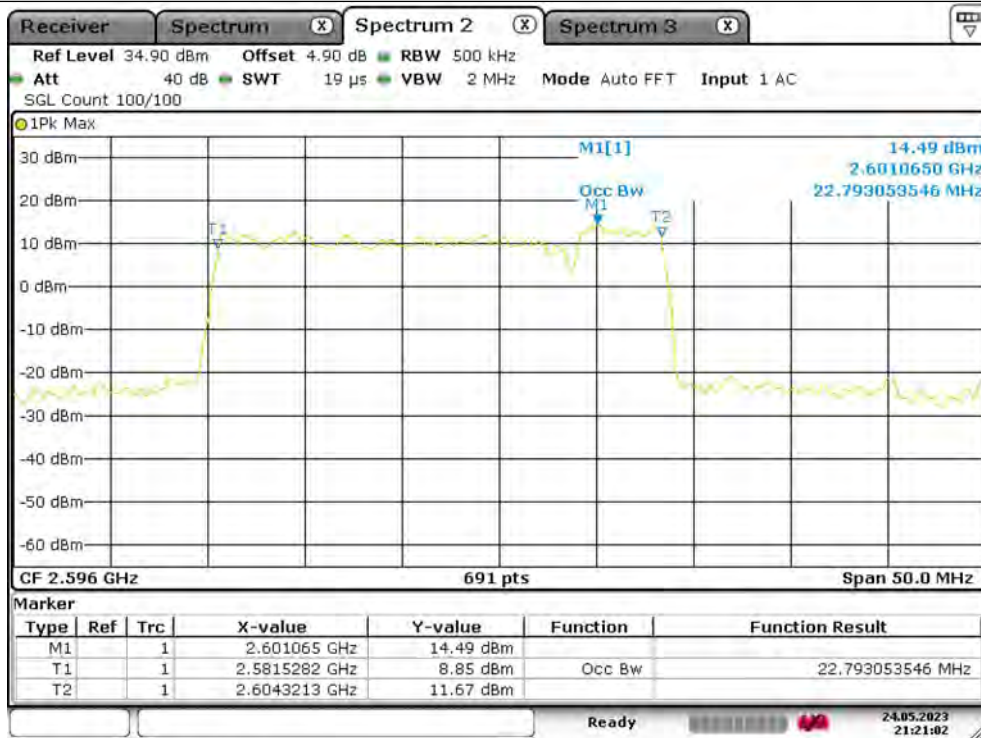

Date: 24.MAY.2023 21:21:02

41-41-20MHz-5MHz-16QAM-16QAM-41440-41557-100RB#0-25RB#0

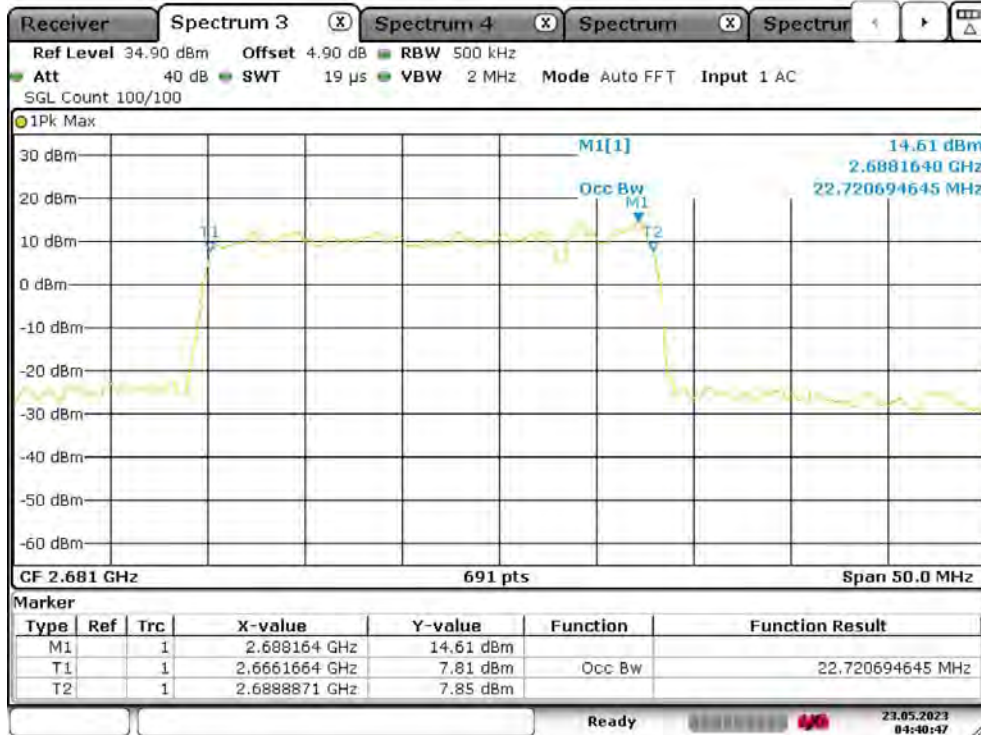


Date: 23.MAY.2023 04:40:47

41-41-20MHz-5MHz-64QAM-64QAM-39750-39867-100RB#0-25RB#0



Test Report No.: PSZ-NQN2303280110RF09

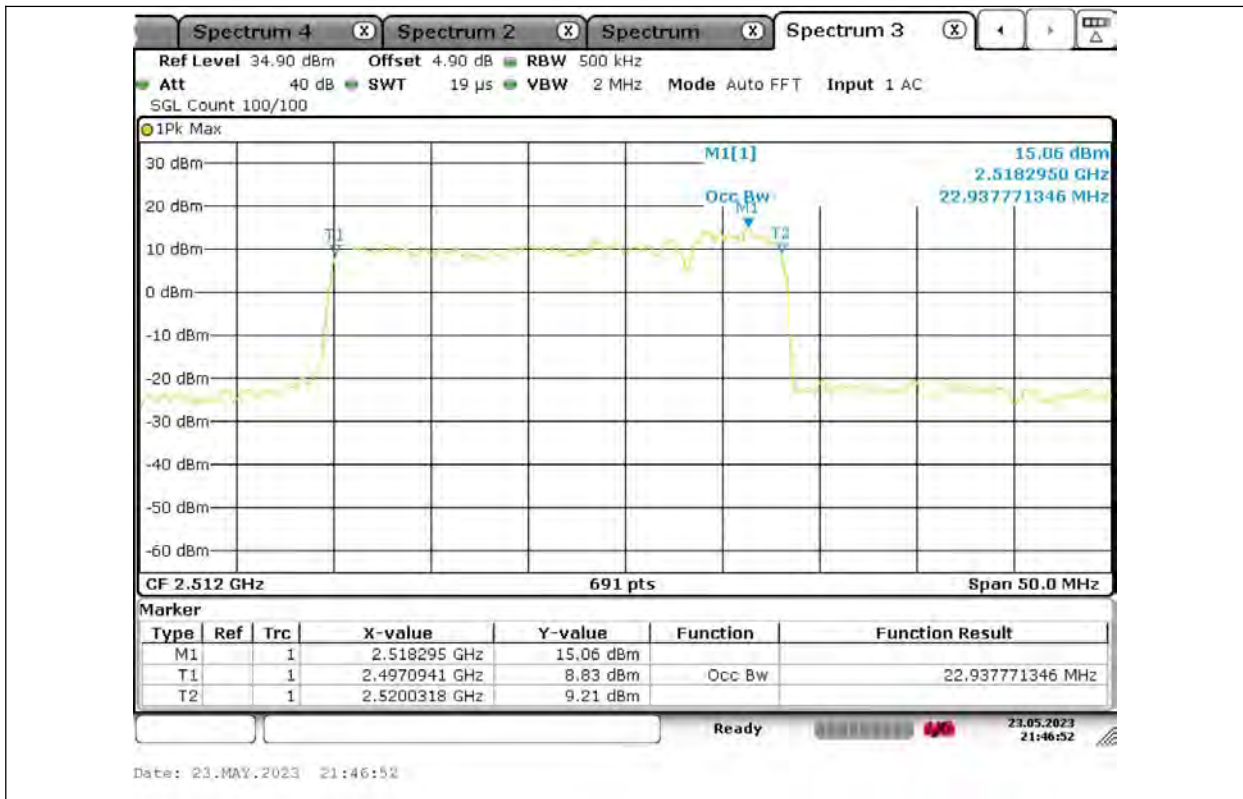


41-41-20MHz-5MHz-64QAM-64QAM-40595-40712-100RB#0-25RB#0



41-41-20MHz-5MHz-64QAM-64QAM-41440-41557-100RB#0-25RB#0




Test Report No.: PSZ-NQN2303280110RF09

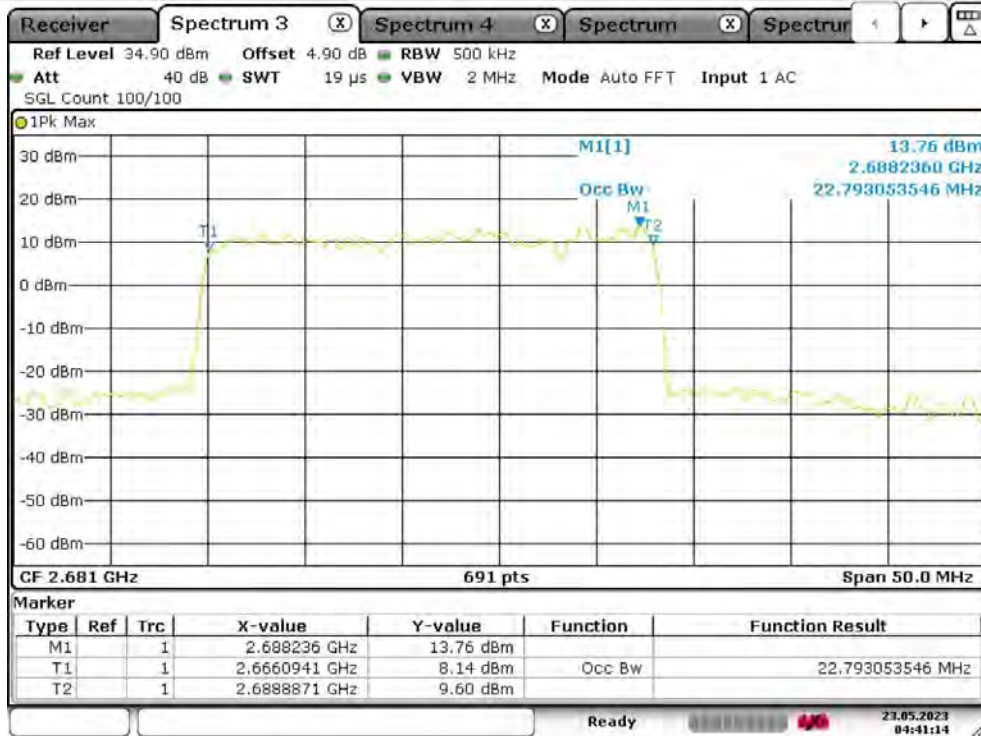

Date: 23.MAY.2023 04:41:14

41-41-5MHz-20MHz-QPSK-QPSK-39683-39800-25RB#0-100RB#0

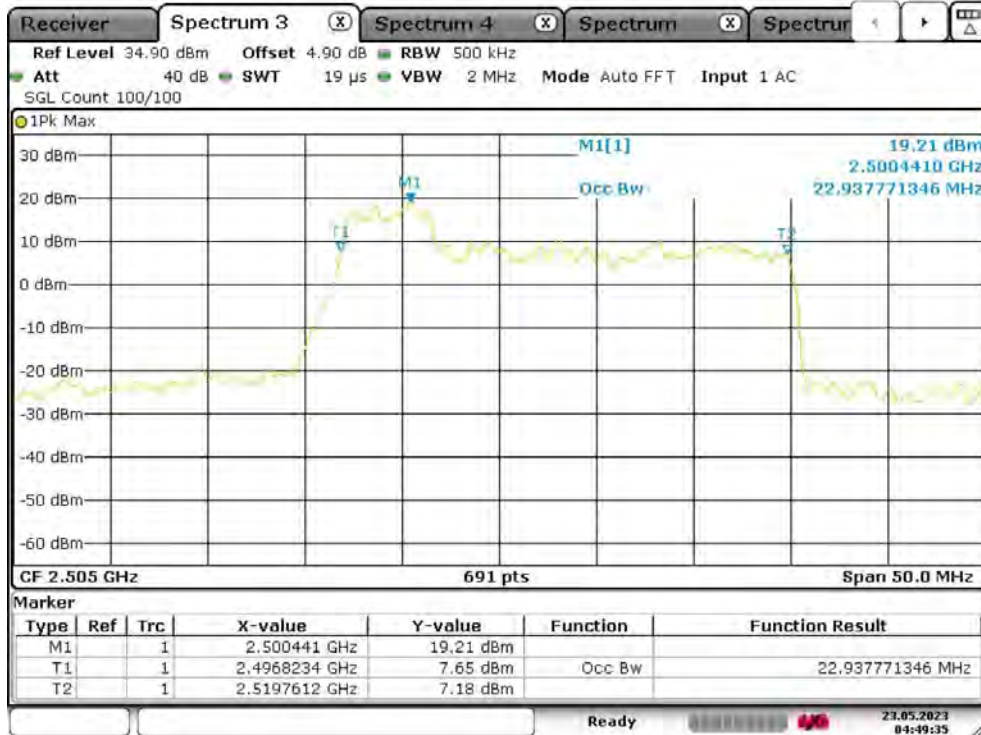


Date: 23.MAY.2023 04:49:35

41-41-5MHz-20MHz-QPSK-QPSK-40528-40645-25RB#0-100RB#0




BUREAU VERITAS

Test Report No.: PSZ-NQN2303280110RF09

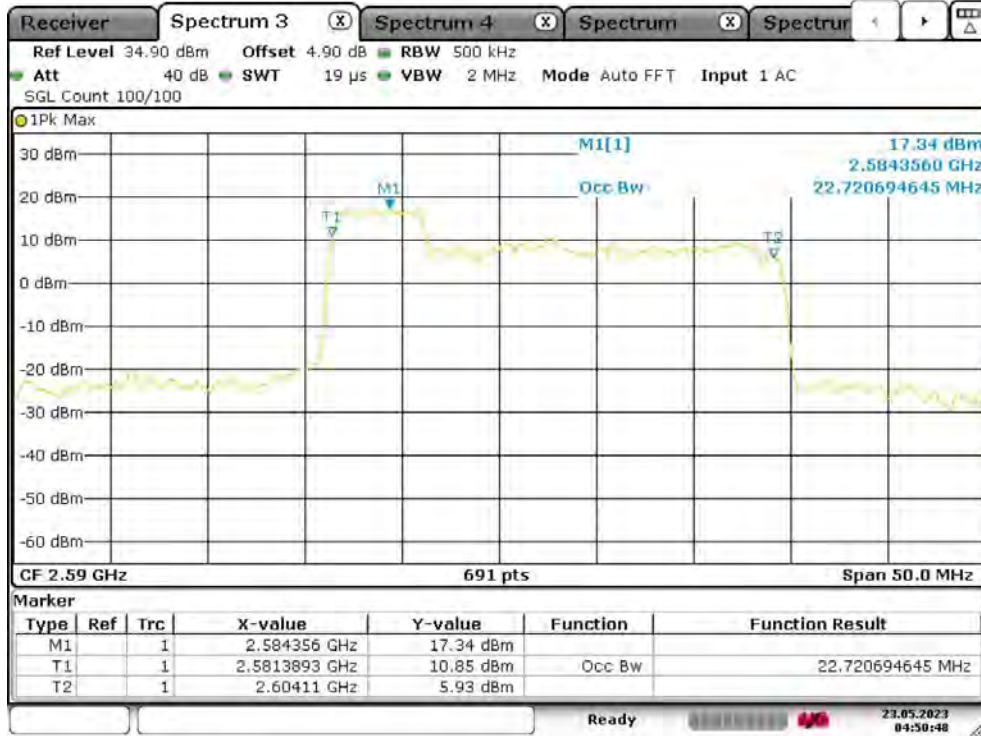

Date: 23.MAY.2023 04:50:48

41-41-5MHz-20MHz-QPSK-QPSK-41373-41490-25RB#0-100RB#0

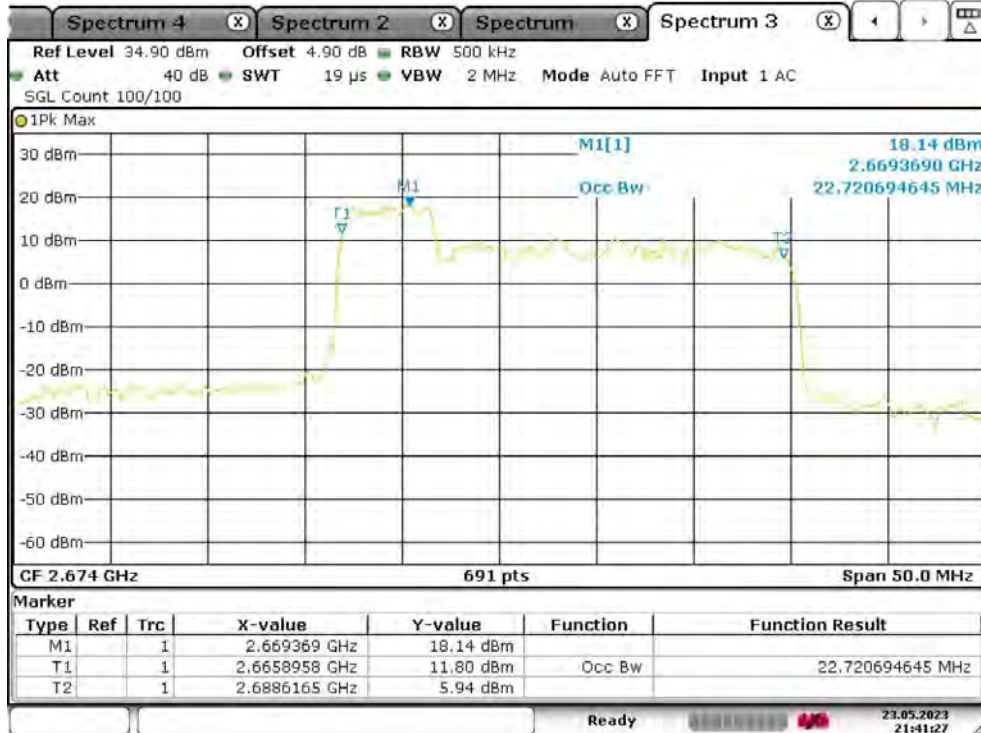


Date: 23.MAY.2023 21:41:27


41-41-5MHz-20MHz-16QAM-16QAM-39683-39800-25RB#0-100RB#0



Test Report No.: PSZ-NQN2303280110RF09

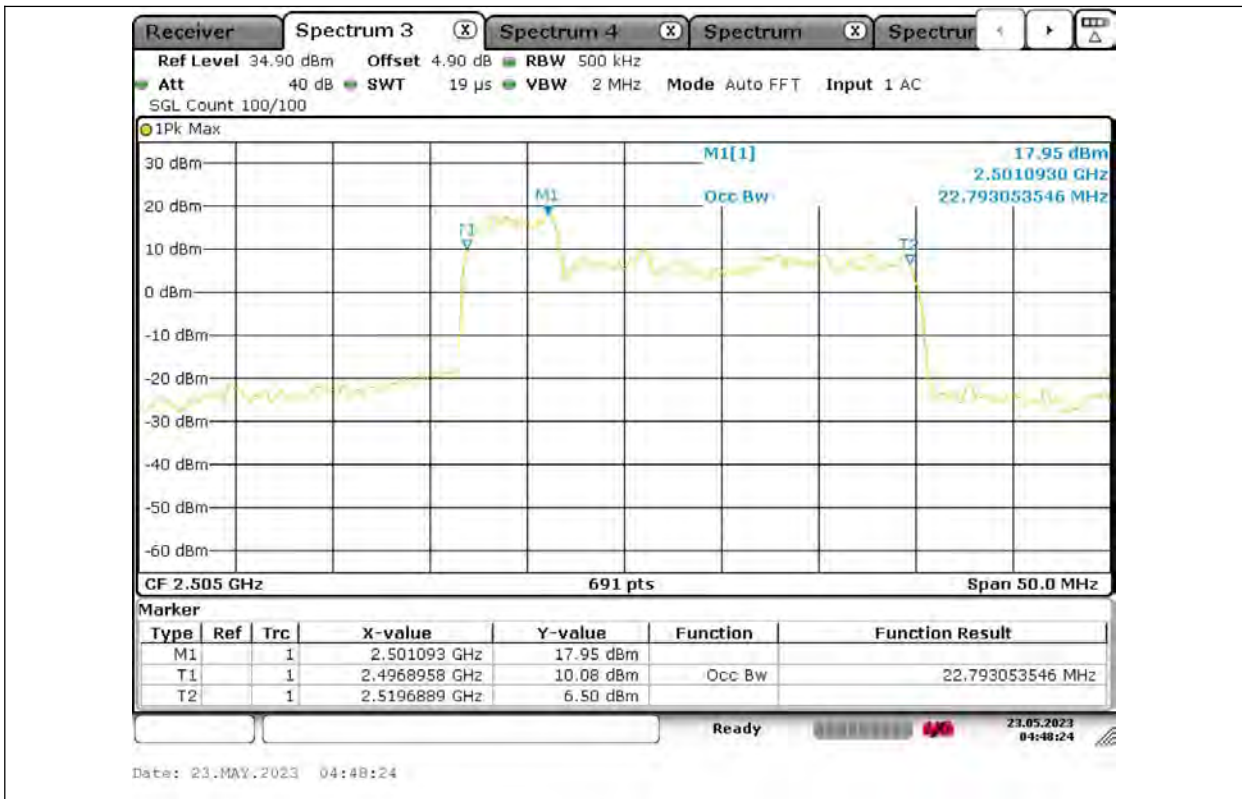

41-41-5MHz-20MHz-16QAM-16QAM-40528-40645-25RB#0-100RB#0

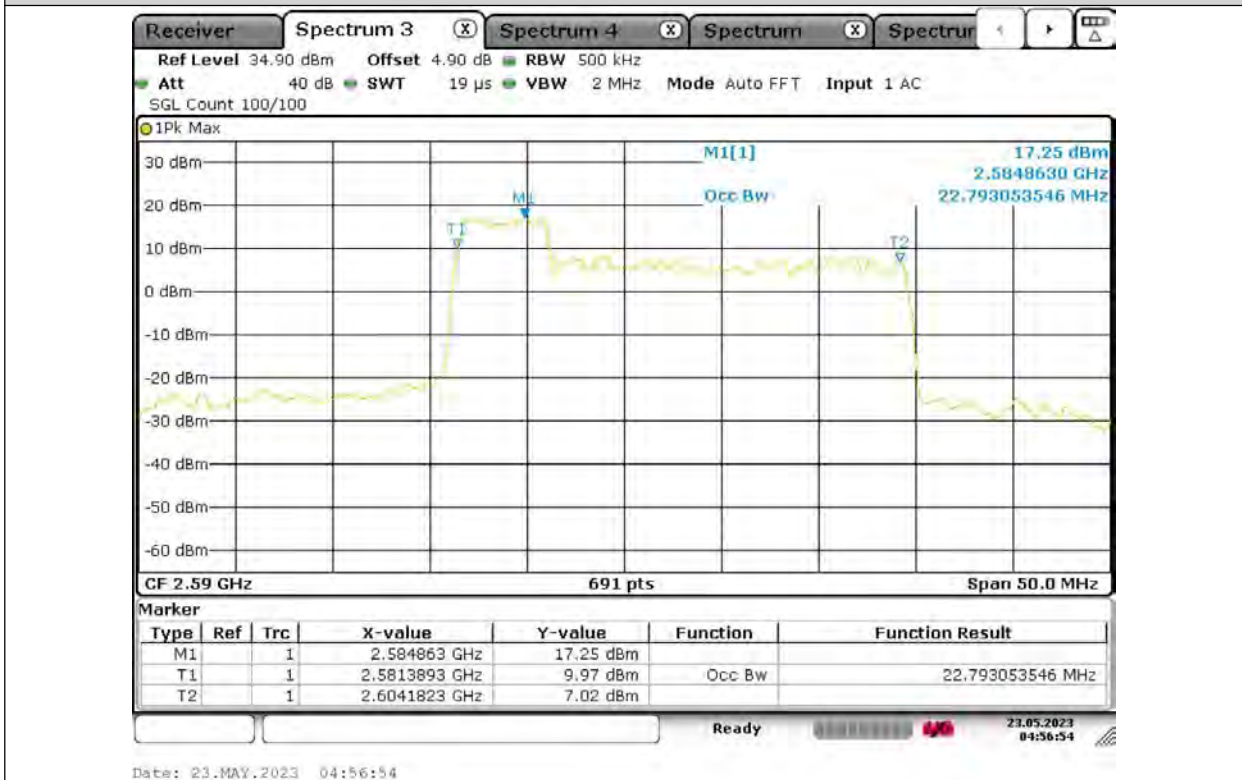


41-41-5MHz-20MHz-16QAM-16QAM-41373-41490-25RB#0-100RB#0




BUREAU VERITAS

Test Report No.: PSZ-NQN2303280110RF09

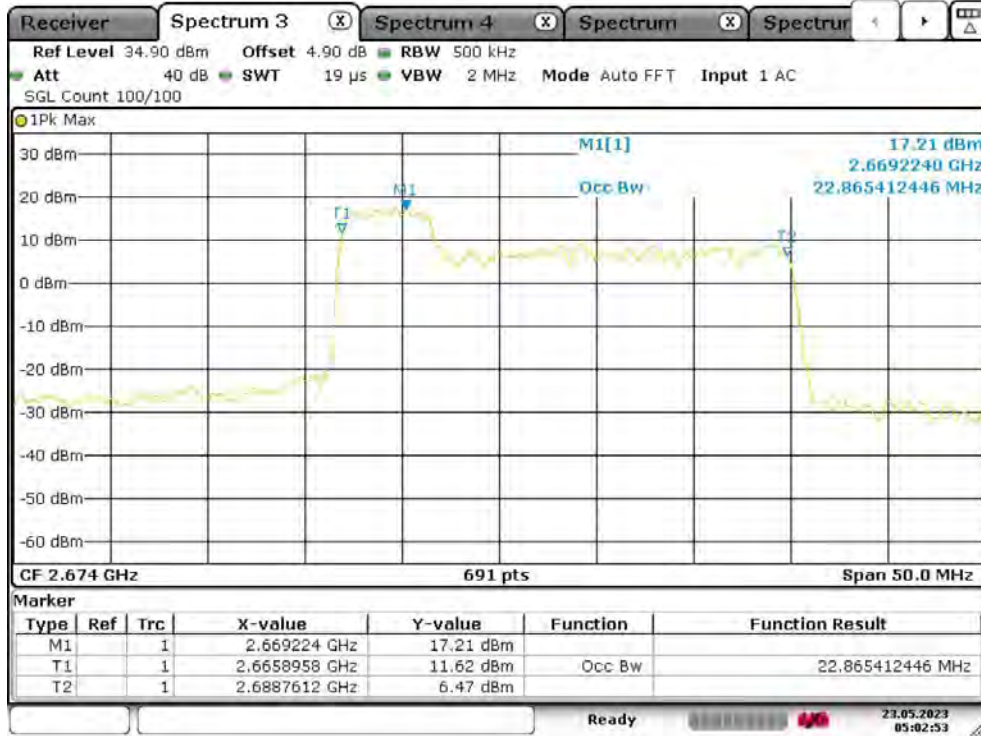

Date: 23.MAY.2023 05:02:52

41-41-5MHz-20MHz-64QAM-64QAM-39683-39800-25RB#0-100RB#0

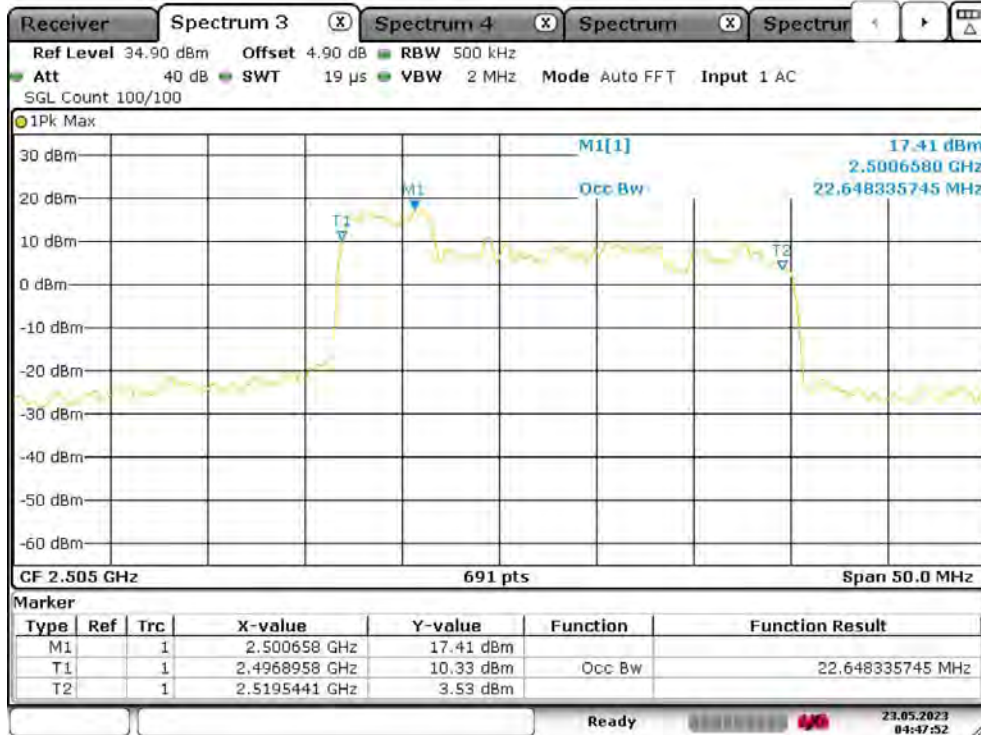


Date: 23.MAY.2023 04:47:52

41-41-5MHz-20MHz-64QAM-64QAM-40528-40645-25RB#0-100RB#0




BUREAU VERITAS

Test Report No.: PSZ-NQN2303280110RF09

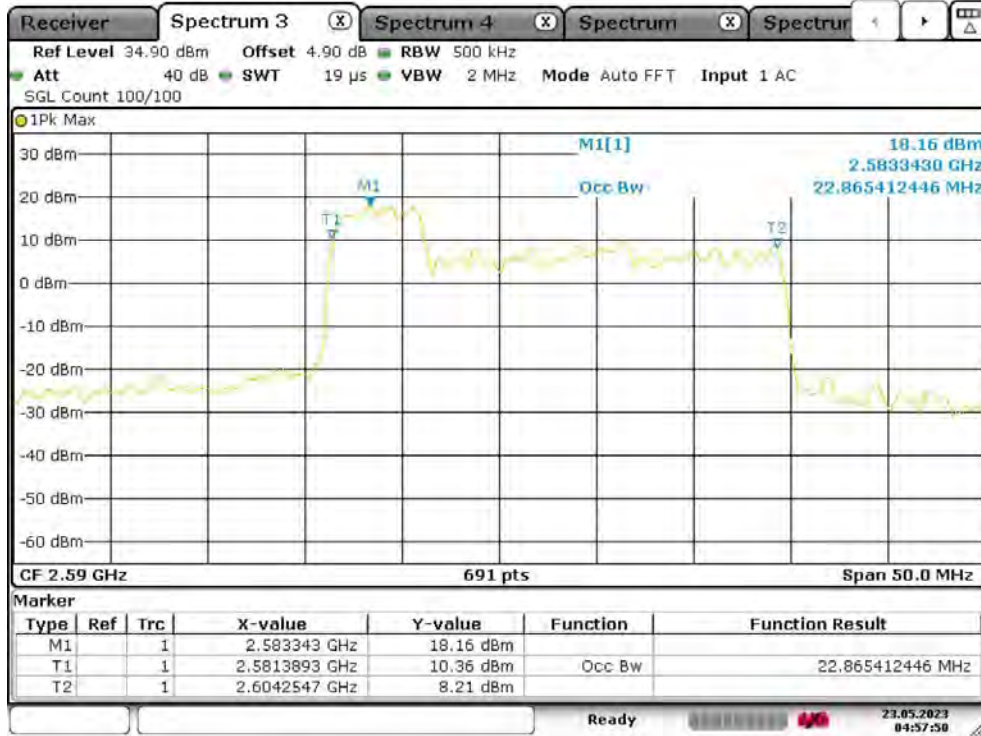

Date: 23.MAY.2023 04:57:50

41-41-5MHz-20MHz-64QAM-64QAM-41373-41490-25RB#0-100RB#0

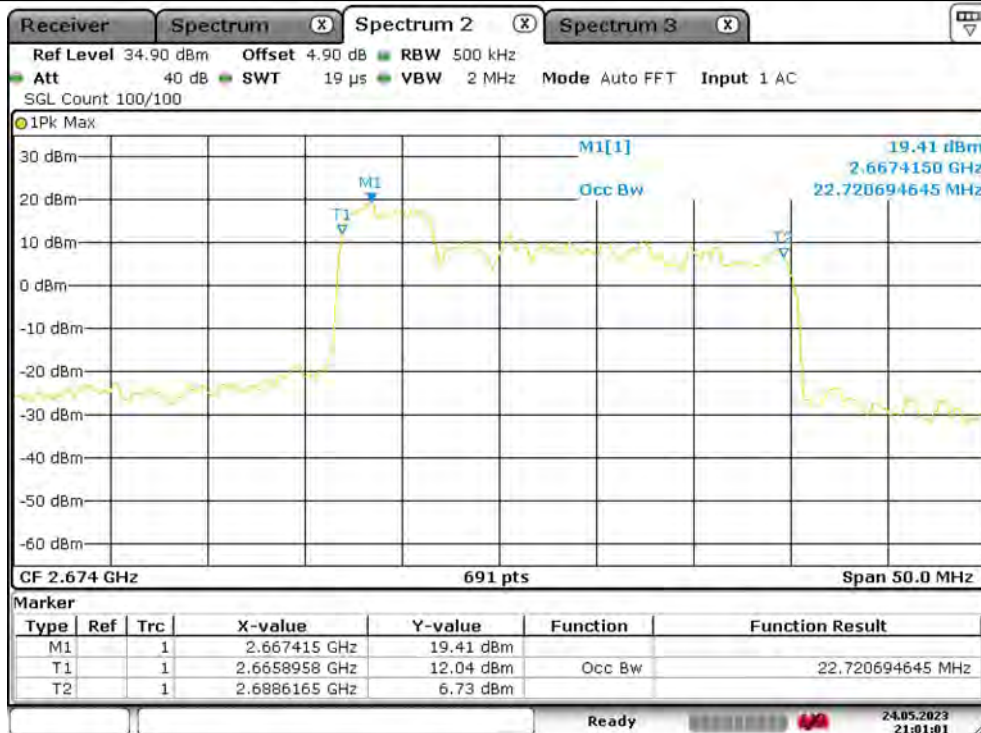

Date: 24.MAY.2023 21:01:01



Test Report No.: PSZ-NQN2303280110RF09

BAND EDGE



Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
41-41	20MHz-20MHz	QPSK-QPSK	39750-39948	100RB#0-100RB#0	-22.46	PASS
41-41	20MHz-20MHz	QPSK-QPSK	39750-39948	1RB#0-1RB#99	-23.08	PASS
41-41	20MHz-20MHz	QPSK-QPSK	39750-39948	1RB#99-1RB#0	-32.67	PASS
41-41	20MHz-20MHz	QPSK-QPSK	41292-41490	100RB#0-100RB#0	-25.34	PASS
41-41	20MHz-20MHz	QPSK-QPSK	41292-41490	1RB#0-1RB#99	-26.21	PASS
41-41	20MHz-20MHz	QPSK-QPSK	41292-41490	1RB#99-1RB#0	-31.48	PASS
41-41	20MHz-20MHz	16QAM-16QAM	39750-39948	100RB#0-100RB#0	-23.21	PASS
41-41	20MHz-20MHz	16QAM-16QAM	39750-39948	1RB#0-1RB#99	-22.43	PASS
41-41	20MHz-20MHz	16QAM-16QAM	39750-39948	1RB#99-1RB#0	-33.36	PASS
41-41	20MHz-20MHz	16QAM-16QAM	41292-41490	100RB#0-100RB#0	-26.03	PASS
41-41	20MHz-20MHz	16QAM-16QAM	41292-41490	1RB#0-1RB#99	-24.51	PASS
41-41	20MHz-20MHz	16QAM-16QAM	41292-41490	1RB#99-1RB#0	-31.51	PASS
41-41	20MHz-20MHz	64QAM-64QAM	39750-39948	100RB#0-100RB#0	-23.06	PASS
41-41	20MHz-20MHz	64QAM-64QAM	39750-39948	1RB#0-1RB#99	-22.60	PASS
41-41	20MHz-20MHz	64QAM-64QAM	39750-39948	1RB#99-1RB#0	-33.61	PASS
41-41	20MHz-20MHz	64QAM-64QAM	41292-41490	100RB#0-100RB#0	-25.66	PASS
41-41	20MHz-20MHz	64QAM-64QAM	41292-41490	1RB#0-1RB#99	-26.78	PASS
41-41	20MHz-20MHz	64QAM-64QAM	41292-41490	1RB#99-1RB#0	-32.71	PASS



Test Report No.: PSZ-NQN2303280110RF09

Test Graphs

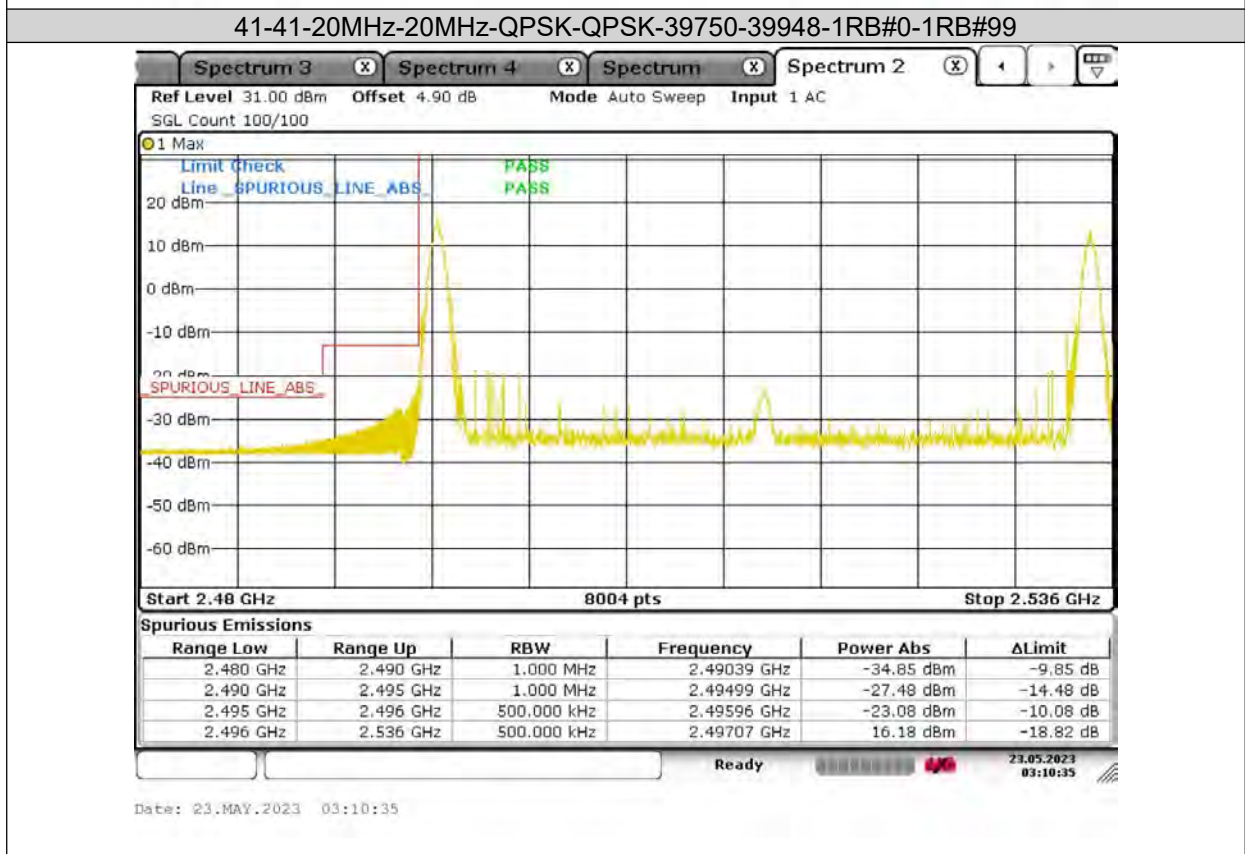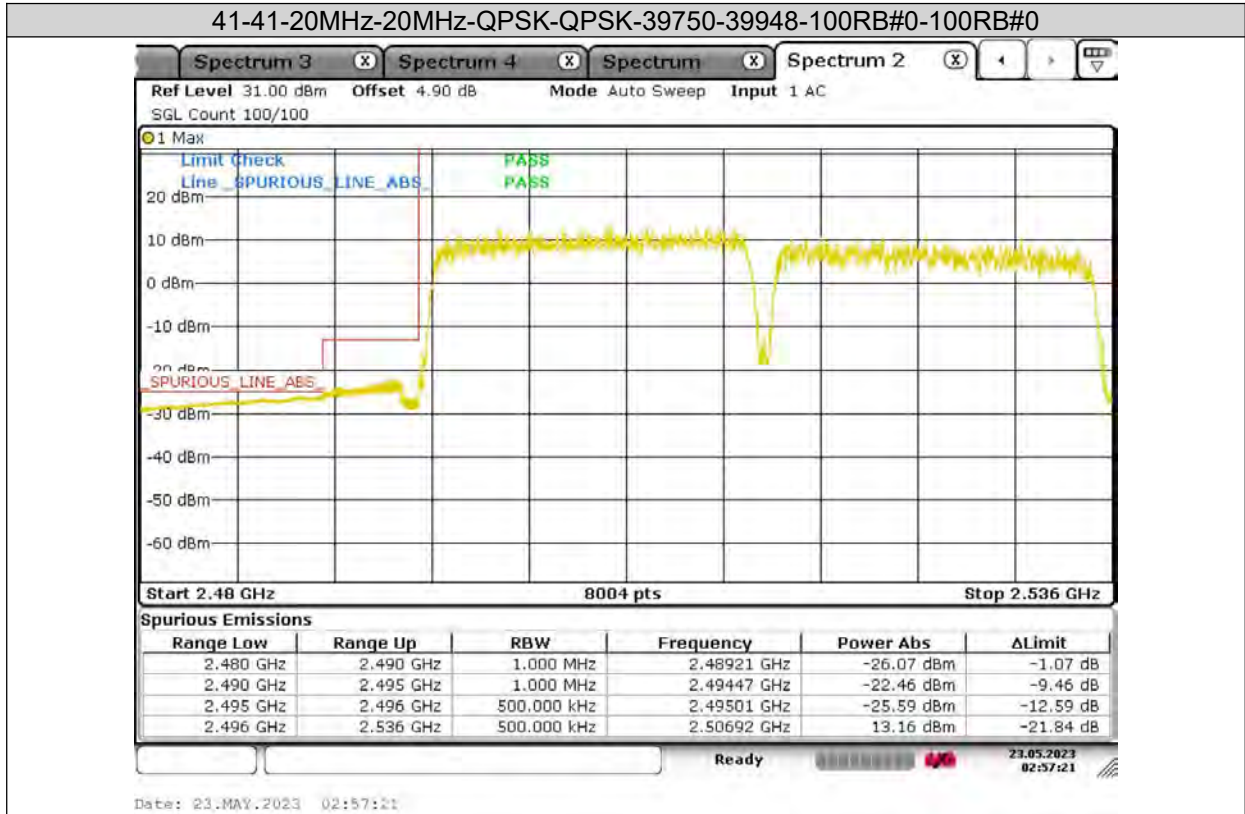




BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-QPSK-QPSK-39750-39948-1RB#99-1RB#0

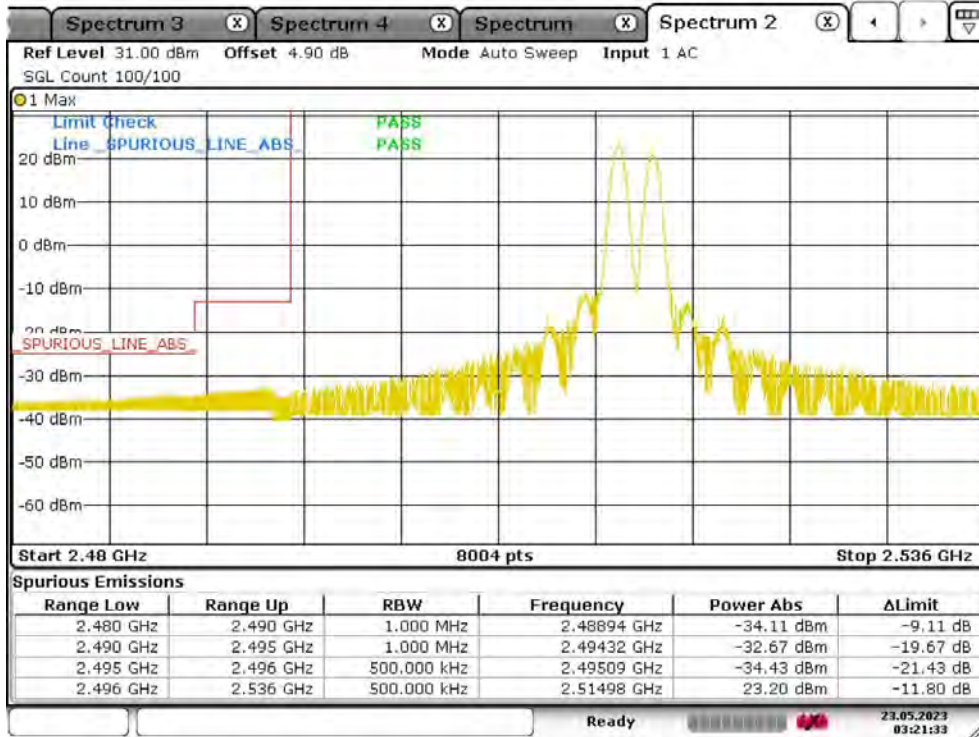

Date: 23.MAY.2023 03:21:33

41-41-20MHz-20MHz-QPSK-QPSK-41292-41490-100RB#0-100RB#0

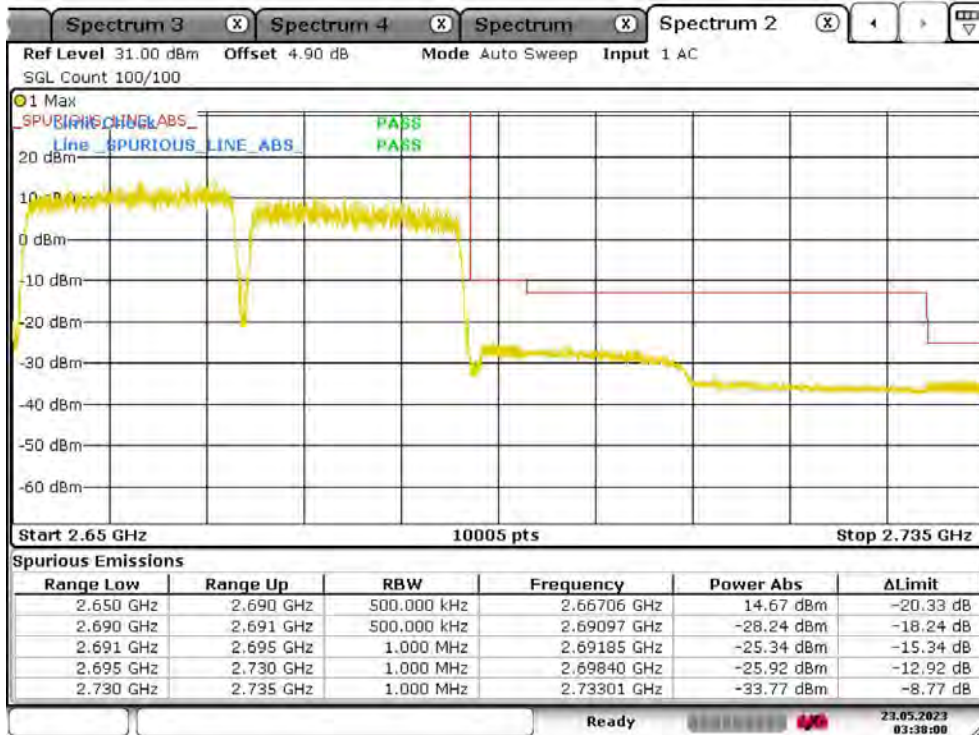


Date: 23.MAY.2023 03:38:00



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-QPSK-QPSK-41292-41490-1RB#0-1RB#99

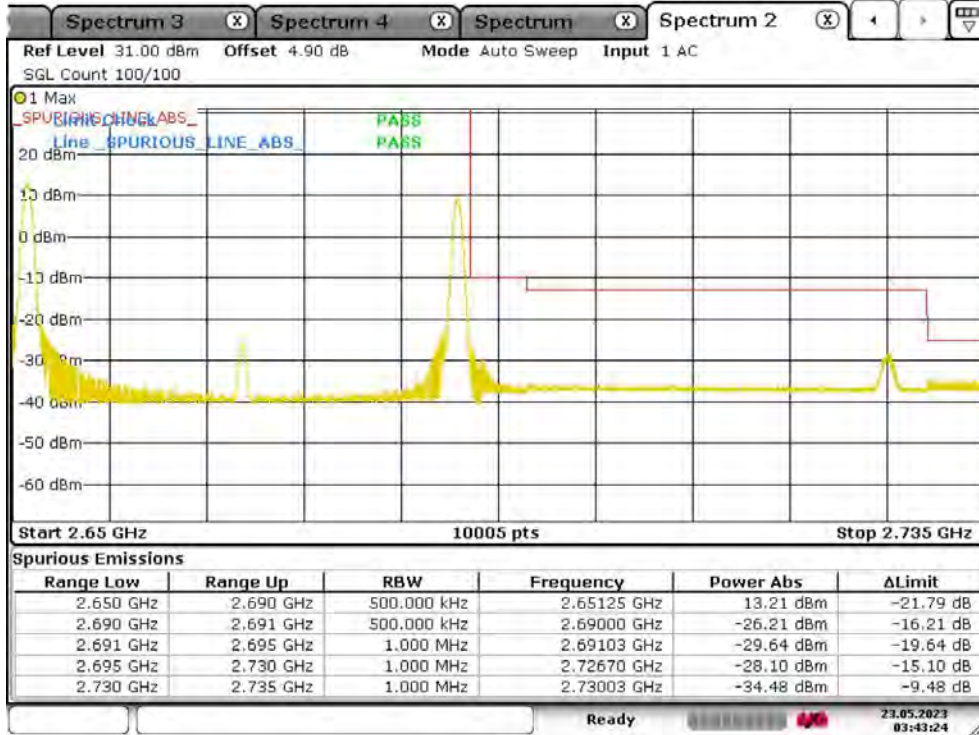

Date: 23.MAY.2023 03:43:23

41-41-20MHz-20MHz-QPSK-QPSK-41292-41490-1RB#99-1RB#0

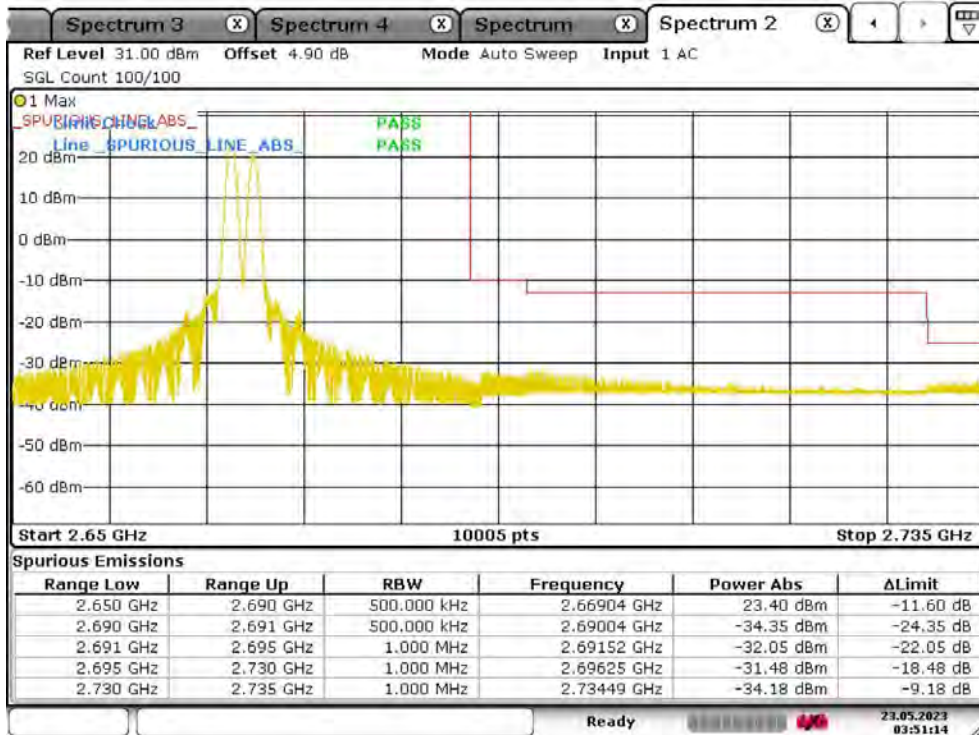


Date: 23.MAY.2023 03:51:14



BUREAU
VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-16QAM-16QAM-39750-39948-100RB#0-100RB#0

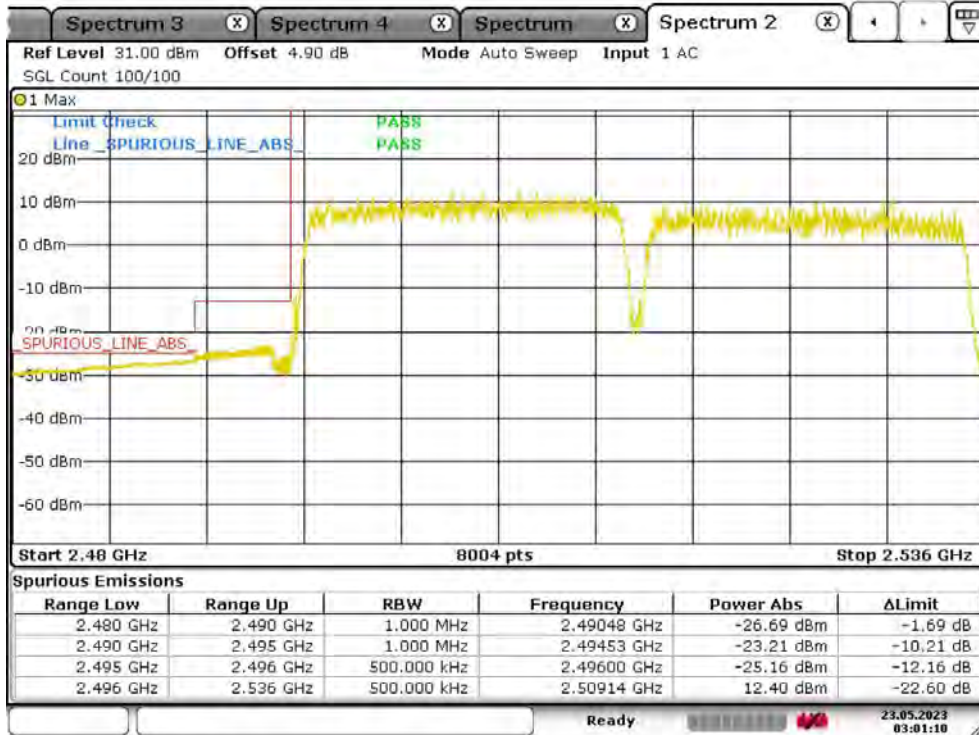

Date: 23.MAY.2023 03:01:09

41-41-20MHz-20MHz-16QAM-16QAM-39750-39948-1RB#0-1RB#99

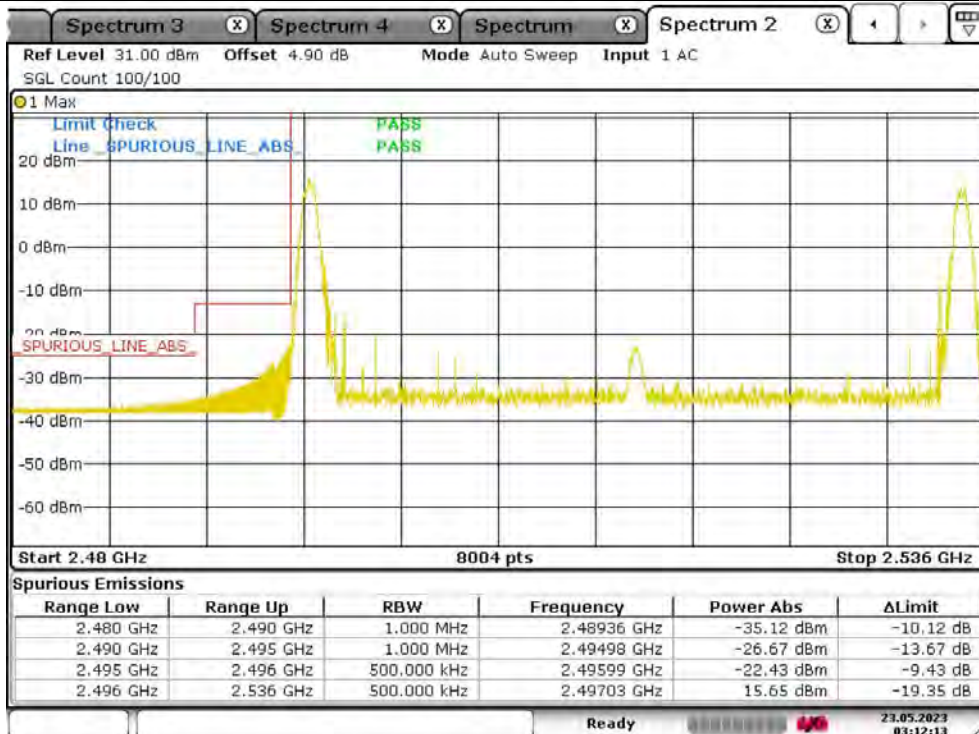


Date: 23.MAY.2023 03:12:13



BUREAU
VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-16QAM-16QAM-39750-39948-1RB#99-1RB#0

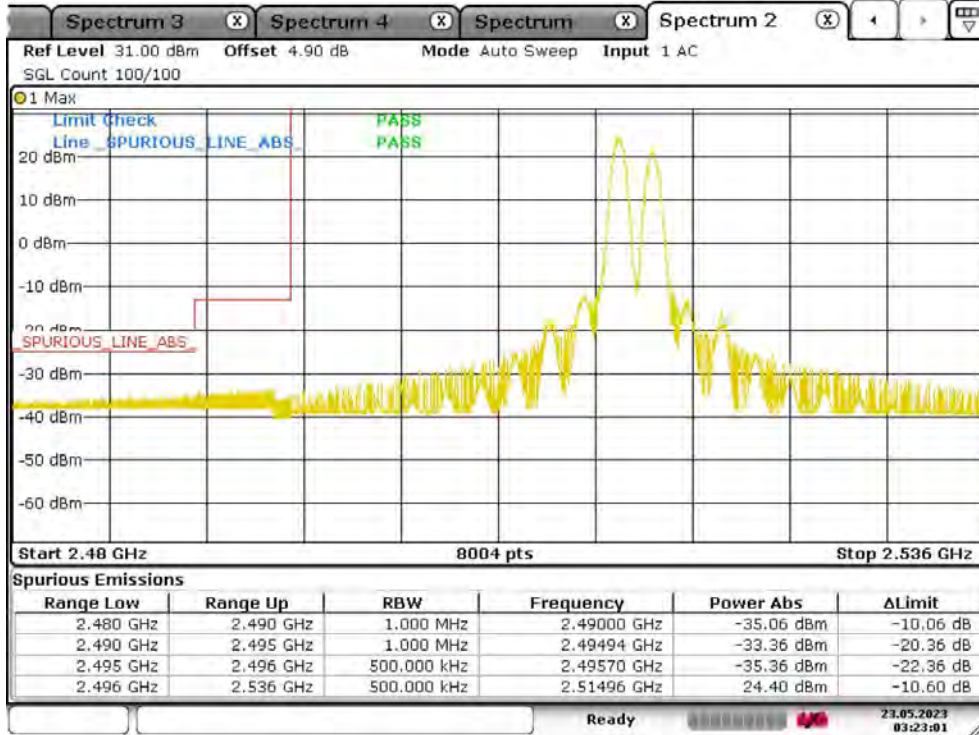

Date: 23.MAY.2023 03:23:01

41-41-20MHz-20MHz-16QAM-16QAM-41292-41490-100RB#0-100RB#0

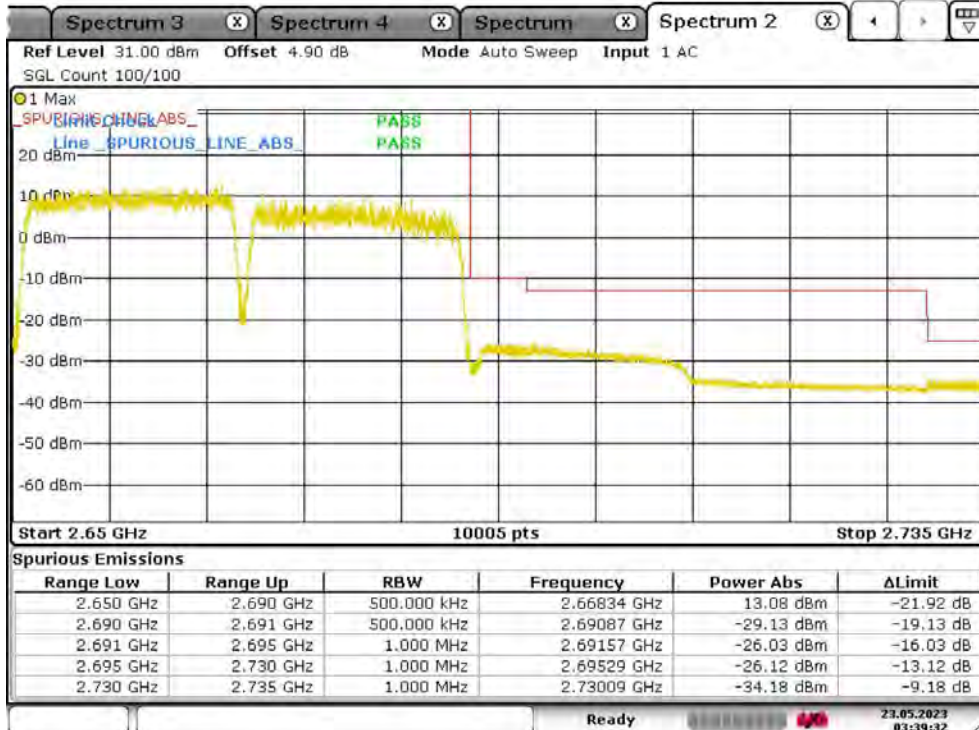


Date: 23.MAY.2023 03:39:32



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-16QAM-16QAM-41292-41490-1RB#0-1RB#99

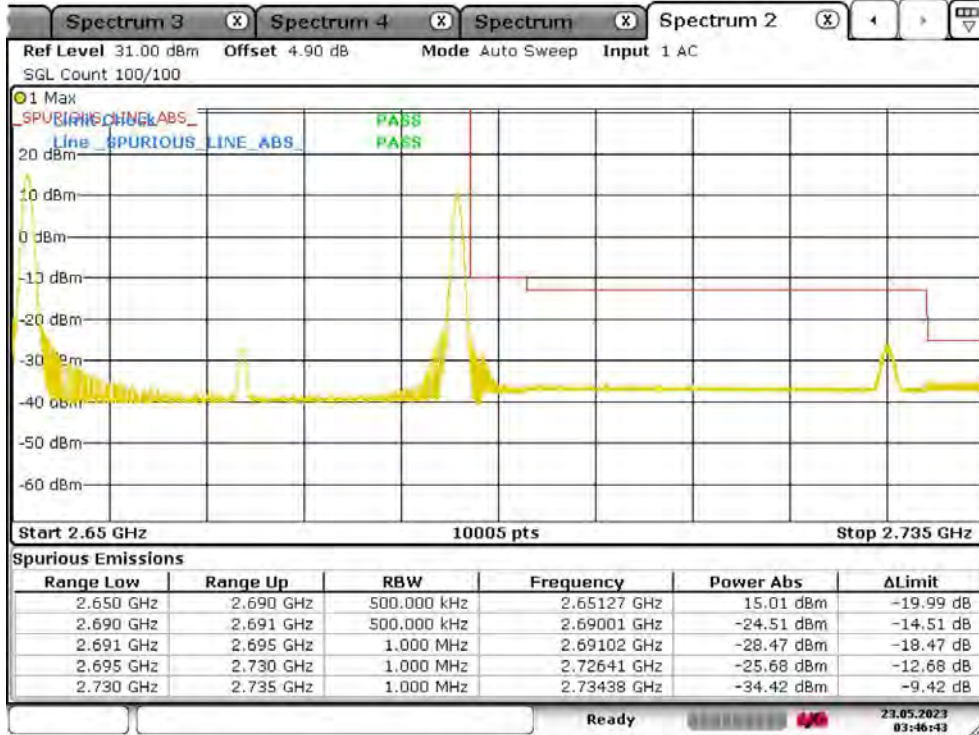

Date: 23.MAY.2023 03:46:43

41-41-20MHz-20MHz-16QAM-16QAM-41292-41490-1RB#99-1RB#0

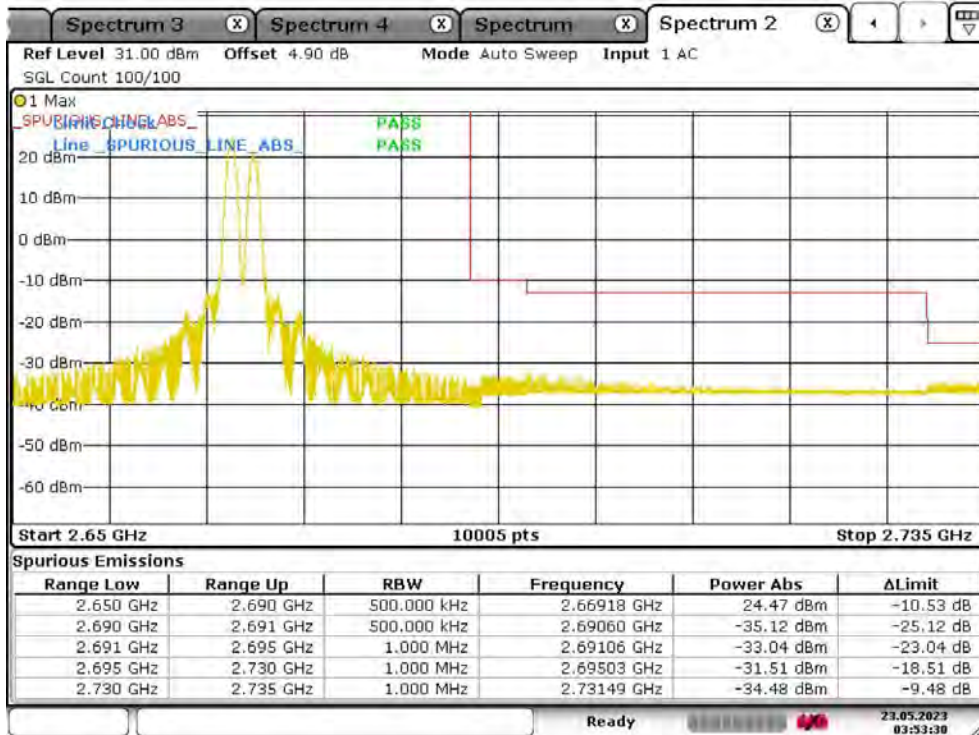


Date: 23.MAY.2023 03:53:30



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-64QAM-64QAM-39750-39948-100RB#0-100RB#0

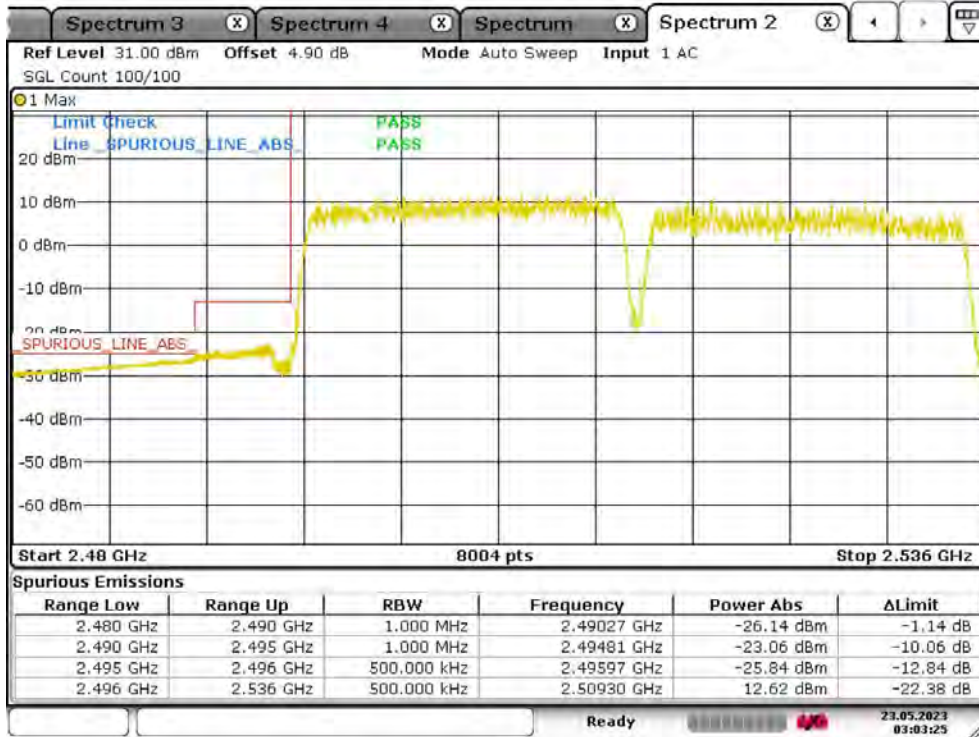

Date: 23.MAY.2023 03:03:25

41-41-20MHz-20MHz-64QAM-64QAM-39750-39948-1RB#0-1RB#99

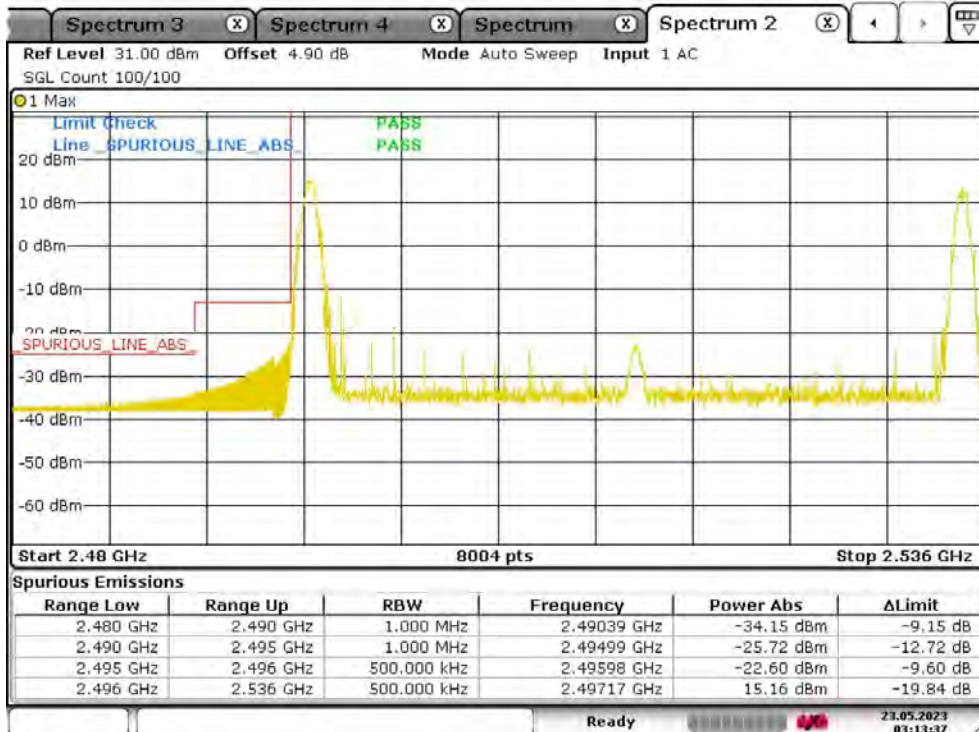


Date: 23.MAY.2023 03:13:37



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-64QAM-64QAM-39750-39948-1RB#99-1RB#0

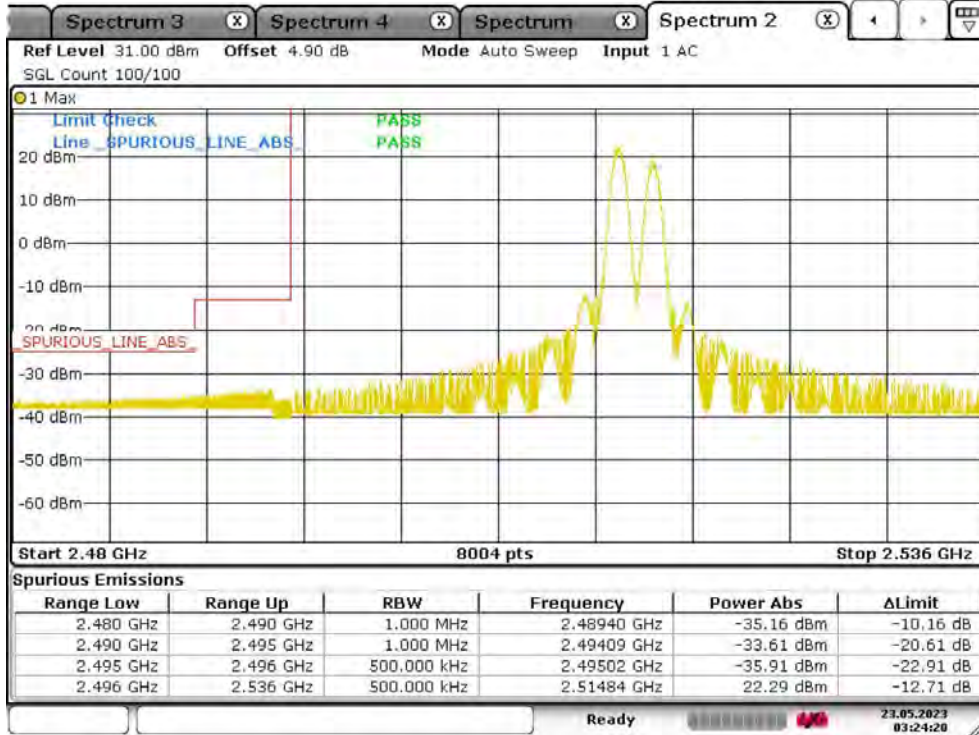

Date: 23.MAY.2023 03:24:20

41-41-20MHz-20MHz-64QAM-64QAM-41292-41490-100RB#0-100RB#0

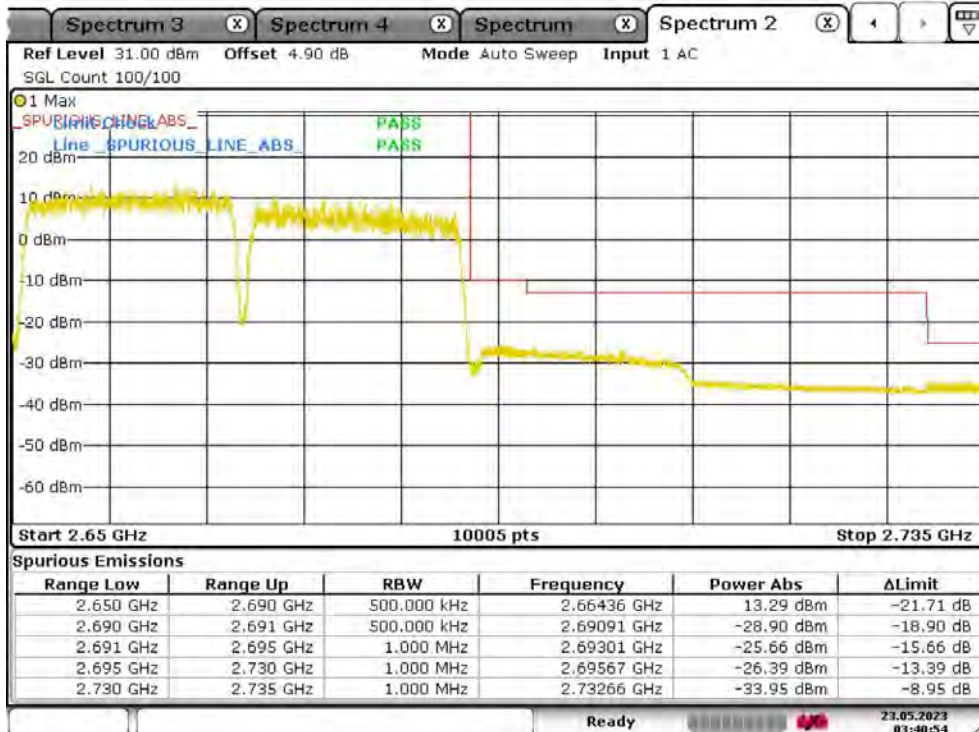


Date: 23.MAY.2023 03:40:54



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-64QAM-64QAM-41292-41490-1RB#0-1RB#99

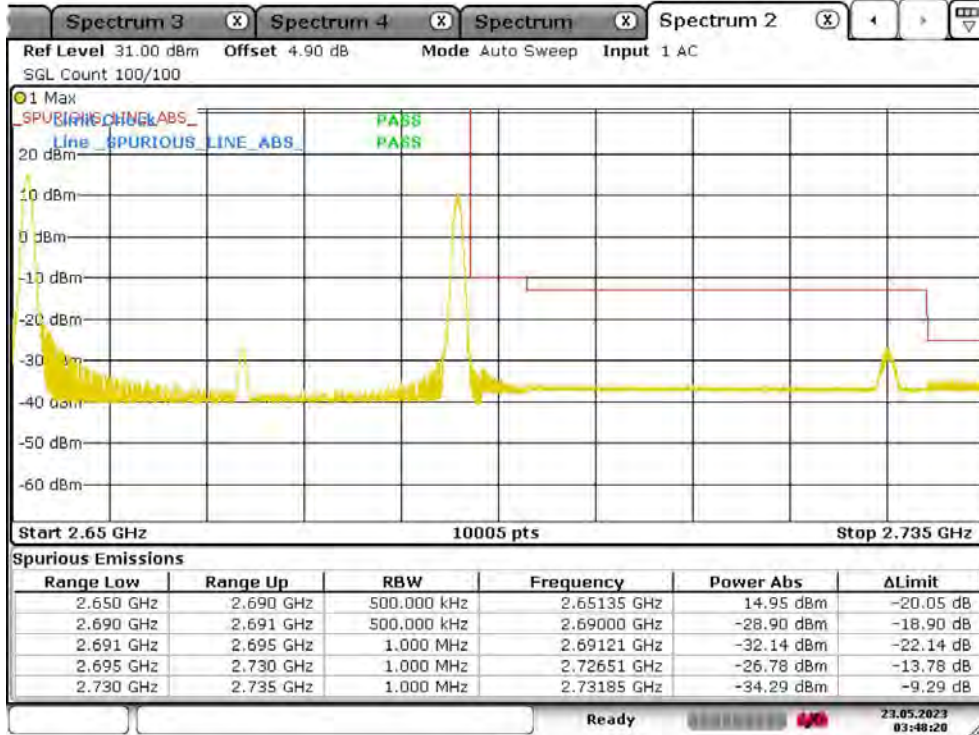

Date: 23.MAY.2023 03:48:20

41-41-20MHz-20MHz-64QAM-64QAM-41292-41490-1RB#99-1RB#0

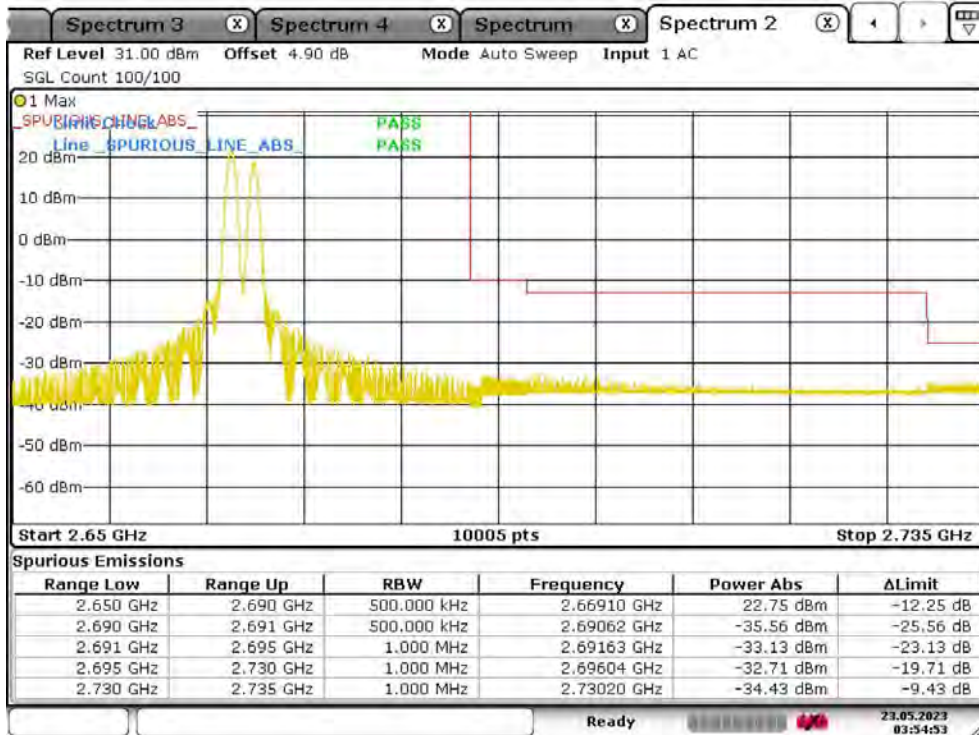

Date: 23.MAY.2023 03:54:55



Test Report No.: PSZ-NQN2303280110RF09

CONDUCTED SPURIOUS EMISSION

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
41-41	20MHz-20MHz	QPSK-QPSK	39750-39948	100RB#0-100RB#0	30~1000MHz	-67.19	PASS
41-41	20MHz-20MHz	QPSK-QPSK	39750-39948	100RB#0-100RB#0	1000~27000MHz	-46.90	PASS
41-41	20MHz-20MHz	QPSK-QPSK	40521-40719	100RB#0-100RB#0	30~1000MHz	-62.08	PASS
41-41	20MHz-20MHz	QPSK-QPSK	40521-40719	100RB#0-100RB#0	1000~27000MHz	-41.65	PASS
41-41	20MHz-20MHz	QPSK-QPSK	41292-41490	100RB#0-100RB#0	30~1000MHz	-62.01	PASS
41-41	20MHz-20MHz	QPSK-QPSK	41292-41490	100RB#0-100RB#0	1000~27000MHz	-41.74	PASS
41-41	20MHz-20MHz	16QAM-16QAM	39750-39948	100RB#0-100RB#0	30~1000MHz	-66.55	PASS
41-41	20MHz-20MHz	16QAM-16QAM	39750-39948	100RB#0-100RB#0	1000~27000MHz	-46.95	PASS
41-41	20MHz-20MHz	16QAM-16QAM	40521-40719	100RB#0-100RB#0	30~1000MHz	-61.65	PASS
41-41	20MHz-20MHz	16QAM-16QAM	40521-40719	100RB#0-100RB#0	1000~27000MHz	-41.68	PASS
41-41	20MHz-20MHz	16QAM-16QAM	41292-41490	100RB#0-100RB#0	30~1000MHz	-62.02	PASS
41-41	20MHz-20MHz	16QAM-16QAM	41292-41490	100RB#0-100RB#0	1000~27000MHz	-41.63	PASS
41-41	20MHz-20MHz	64QAM-64QAM	39750-39948	100RB#0-100RB#0	30~1000MHz	-67.05	PASS
41-41	20MHz-20MHz	64QAM-64QAM	39750-39948	100RB#0-100RB#0	1000~27000MHz	-47.02	PASS
41-41	20MHz-20MHz	64QAM-64QAM	40521-40719	100RB#0-100RB#0	30~1000MHz	-62.05	PASS
41-41	20MHz-20MHz	64QAM-64QAM	40521-40719	100RB#0-100RB#0	1000~27000MHz	-41.73	PASS
41-41	20MHz-20MHz	64QAM-64QAM	41292-41490	100RB#0-100RB#0	30~1000MHz	-61.89	PASS
41-41	20MHz-20MHz	64QAM-64QAM	41292-41490	100RB#0-100RB#0	1000~27000MHz	-41.87	PASS
41-41	20MHz-5MHz	QPSK-QPSK	39750-39867	1RB#99-1RB#0	30~1000MHz	-61.72	PASS
41-41	20MHz-5MHz	QPSK-QPSK	39750-39867	1RB#99-1RB#0	1000~27000MHz	-41.57	PASS
41-41	20MHz-5MHz	QPSK-QPSK	40595-40712	1RB#99-1RB#0	30~1000MHz	-62.02	PASS
41-41	20MHz-5MHz	QPSK-QPSK	40595-40712	1RB#99-1RB#0	1000~27000MHz	-41.94	PASS
41-41	20MHz-5MHz	QPSK-QPSK	41440-41557	1RB#99-1RB#0	30~1000MHz	-61.90	PASS
41-41	20MHz-5MHz	QPSK-QPSK	41440-41557	1RB#99-1RB#0	1000~27000MHz	-41.48	PASS
41-41	20MHz-5MHz	16QAM-16QAM	39750-39867	1RB#99-1RB#0	30~1000MHz	-61.94	PASS
41-41	20MHz-5MHz	16QAM-16QAM	39750-39867	1RB#99-1RB#0	1000~27000MHz	-41.70	PASS
41-41	20MHz-5MHz	16QAM-16QAM	40595-40712	1RB#99-1RB#0	30~1000MHz	-62.08	PASS
41-41	20MHz-5MHz	16QAM-16QAM	40595-40712	1RB#99-1RB#0	1000~27000MHz	-41.62	PASS
41-41	20MHz-5MHz	16QAM-16QAM	41440-41557	1RB#99-1RB#0	30~1000MHz	-61.46	PASS
41-41	20MHz-5MHz	16QAM-16QAM	41440-41557	1RB#99-1RB#0	1000~27000MHz	-41.81	PASS
41-41	20MHz-5MHz	64QAM-64QAM	39750-39867	1RB#99-1RB#0	30~1000MHz	-61.93	PASS
41-41	20MHz-5MHz	64QAM-64QAM	39750-39867	1RB#99-1RB#0	1000~27000MHz	-41.68	PASS
41-41	20MHz-5MHz	64QAM-64QAM	40595-40712	1RB#99-1RB#0	30~1000MHz	-62.13	PASS
41-41	20MHz-5MHz	64QAM-64QAM	40595-40712	1RB#99-1RB#0	1000~27000MHz	-41.74	PASS
41-41	20MHz-5MHz	64QAM-64QAM	41440-41557	1RB#99-1RB#0	30~1000MHz	-61.73	PASS
41-41	20MHz-5MHz	64QAM-64QAM	41440-41557	1RB#99-1RB#0	1000~27000MHz	-41.80	PASS
41-41	5MHz-20MHz	QPSK-QPSK	39683-39800	1RB#24-1RB#0	30~1000MHz	-61.79	PASS
41-41	5MHz-20MHz	QPSK-QPSK	39683-39800	1RB#24-1RB#0	1000~27000MHz	-41.69	PASS
41-41	5MHz-20MHz	QPSK-QPSK	40528-40645	1RB#24-1RB#0	30~1000MHz	-61.75	PASS
41-41	5MHz-20MHz	QPSK-QPSK	40528-40645	1RB#24-1RB#0	1000~27000MHz	-41.83	PASS
41-41	5MHz-20MHz	QPSK-QPSK	41373-41490	1RB#24-1RB#0	30~1000MHz	-61.65	PASS
41-41	5MHz-20MHz	QPSK-QPSK	41373-41490	1RB#24-1RB#0	1000~27000MHz	-41.72	PASS
41-41	5MHz-20MHz	16QAM-16QAM	39683-39800	1RB#24-1RB#0	30~1000MHz	-61.40	PASS
41-41	5MHz-20MHz	16QAM-16QAM	39683-39800	1RB#24-1RB#0	1000~27000MHz	-41.72	PASS
41-41	5MHz-20MHz	16QAM-16QAM	40528-40645	1RB#24-1RB#0	30~1000MHz	-61.80	PASS



**BUREAU
VERITAS**



Test Report No.: PSZ-NQN2303280110RF09

41-41	5MHz-20MHz	16QAM-16QAM	40528-40645	1RB#24-1RB#0	1000~27000MHz	-41.65	PASS
41-41	5MHz-20MHz	16QAM-16QAM	41373-41490	1RB#24-1RB#0	30~1000MHz	-61.69	PASS
41-41	5MHz-20MHz	16QAM-16QAM	41373-41490	1RB#24-1RB#0	1000~27000MHz	-41.90	PASS
41-41	5MHz-20MHz	64QAM-64QAM	39683-39800	1RB#24-1RB#0	30~1000MHz	-62.14	PASS
41-41	5MHz-20MHz	64QAM-64QAM	39683-39800	1RB#24-1RB#0	1000~27000MHz	-41.71	PASS
41-41	5MHz-20MHz	64QAM-64QAM	40528-40645	1RB#24-1RB#0	30~1000MHz	-61.55	PASS
41-41	5MHz-20MHz	64QAM-64QAM	40528-40645	1RB#24-1RB#0	1000~27000MHz	-41.72	PASS
41-41	5MHz-20MHz	64QAM-64QAM	41373-41490	1RB#24-1RB#0	30~1000MHz	-62.07	PASS
41-41	5MHz-20MHz	64QAM-64QAM	41373-41490	1RB#24-1RB#0	1000~27000MHz	-41.65	PASS



Test Report No.: PSZ-NQN2303280110RF09

Test Graphs

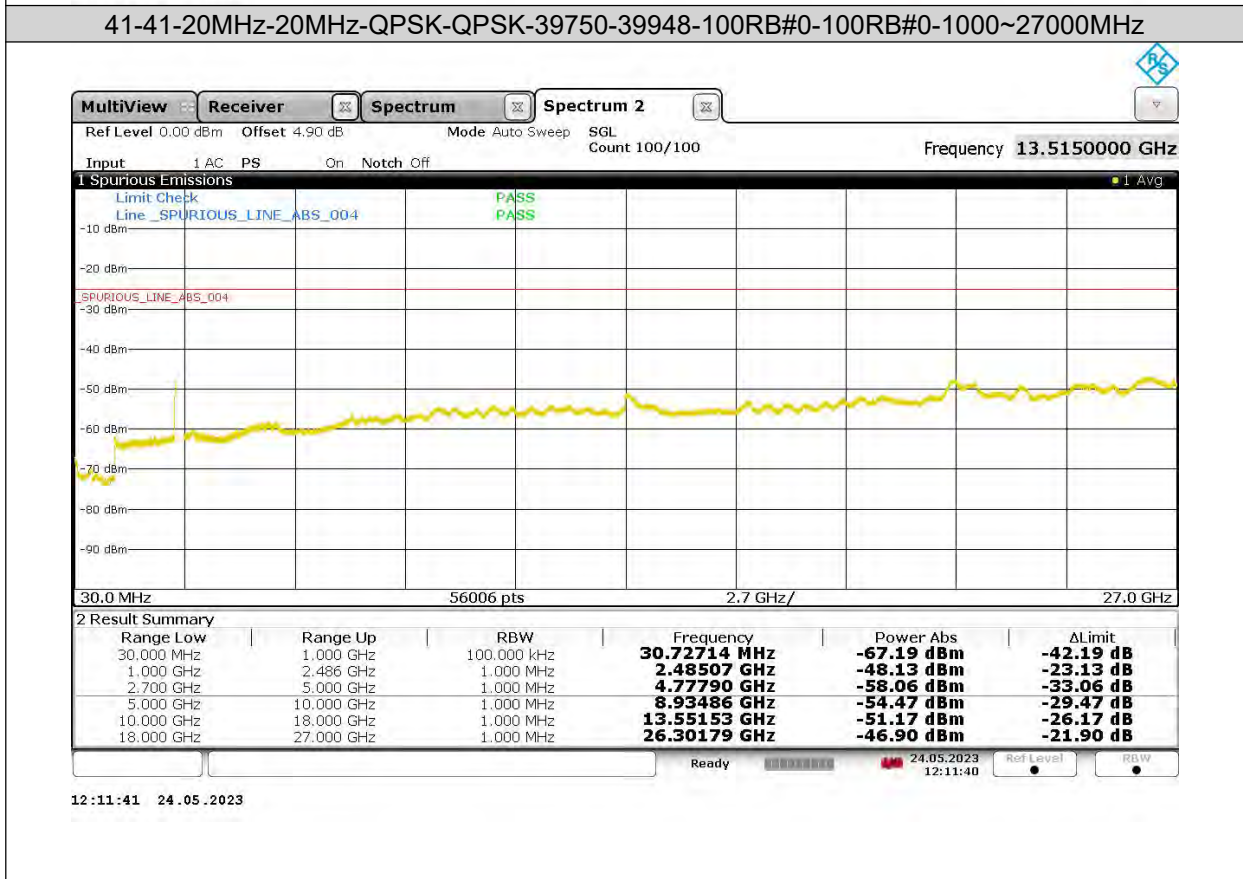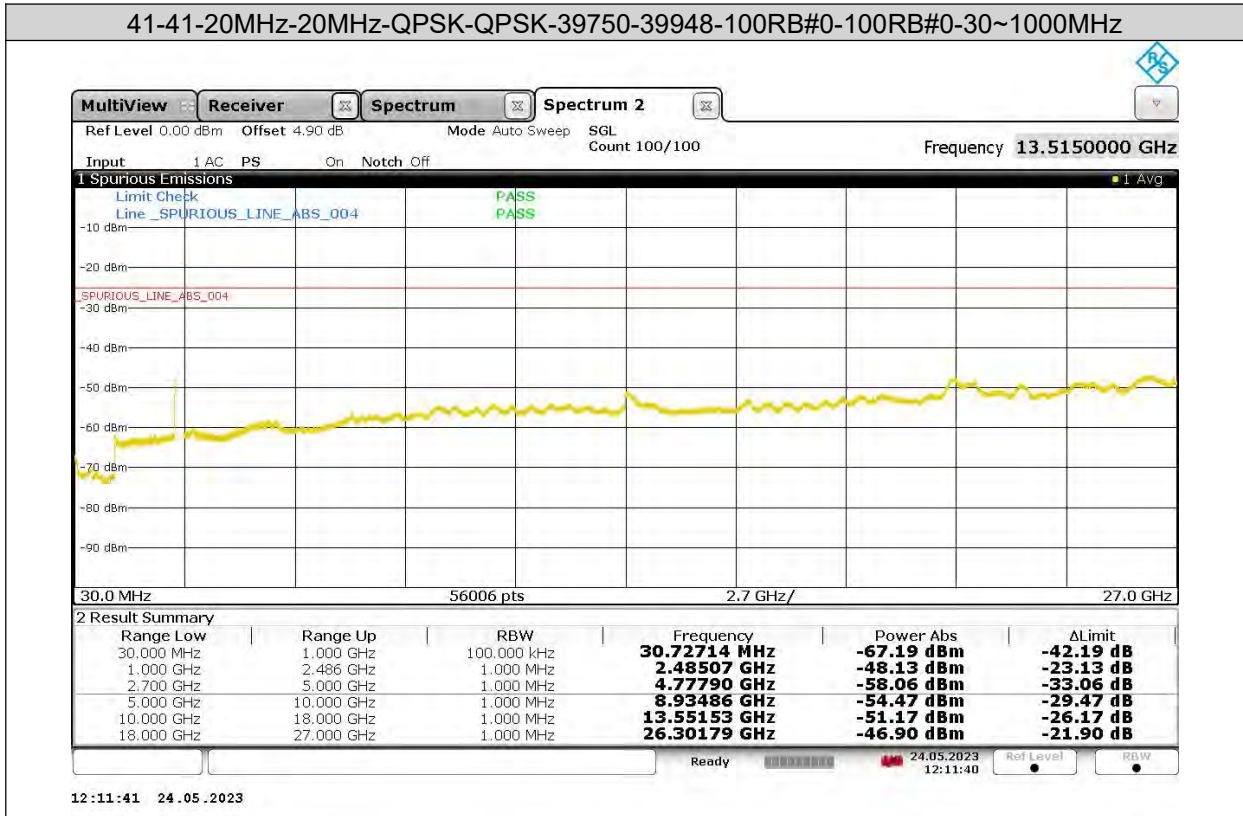




BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-QPSK-QPSK-40521-40719-100RB#0-100RB#0-30~1000MHz

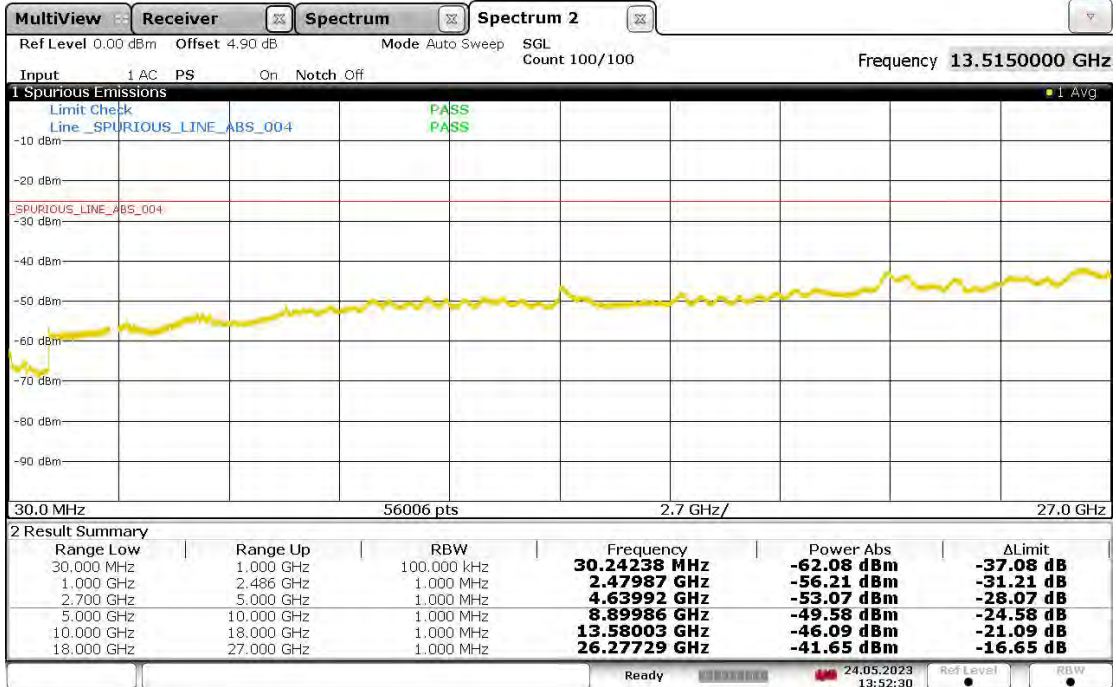

13:52:31 24.05.2023

41-41-20MHz-20MHz-QPSK-QPSK-40521-40719-100RB#0-100RB#0-1000~27000MHz

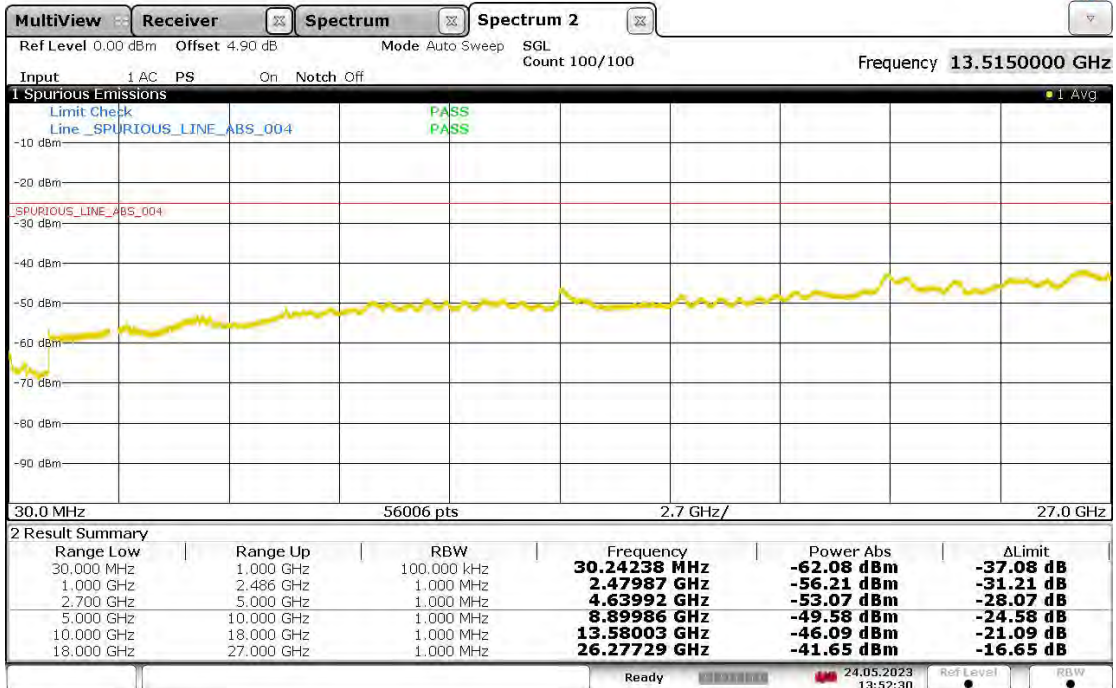


13:52:31 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-QPSK-QPSK-41292-41490-100RB#0-100RB#0-30~1000MHz

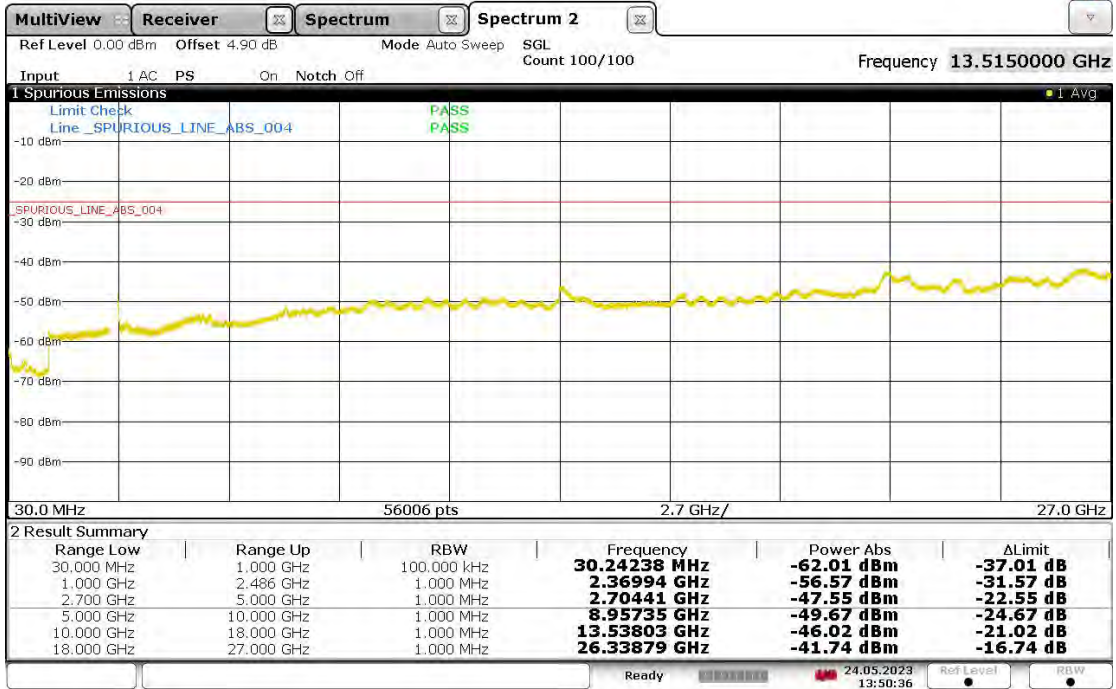

13:50:36 24.05.2023

41-41-20MHz-20MHz-QPSK-QPSK-41292-41490-100RB#0-100RB#0-1000~27000MHz

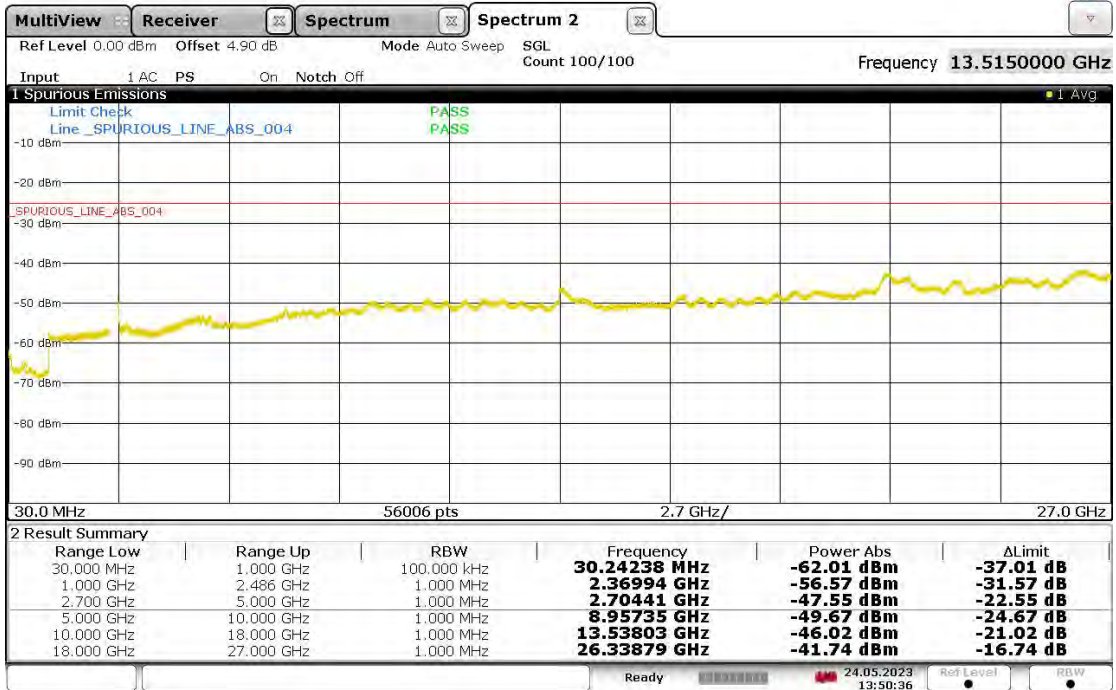


13:50:36 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-16QAM-16QAM-39750-39948-100RB#0-100RB#0-30~1000MHz

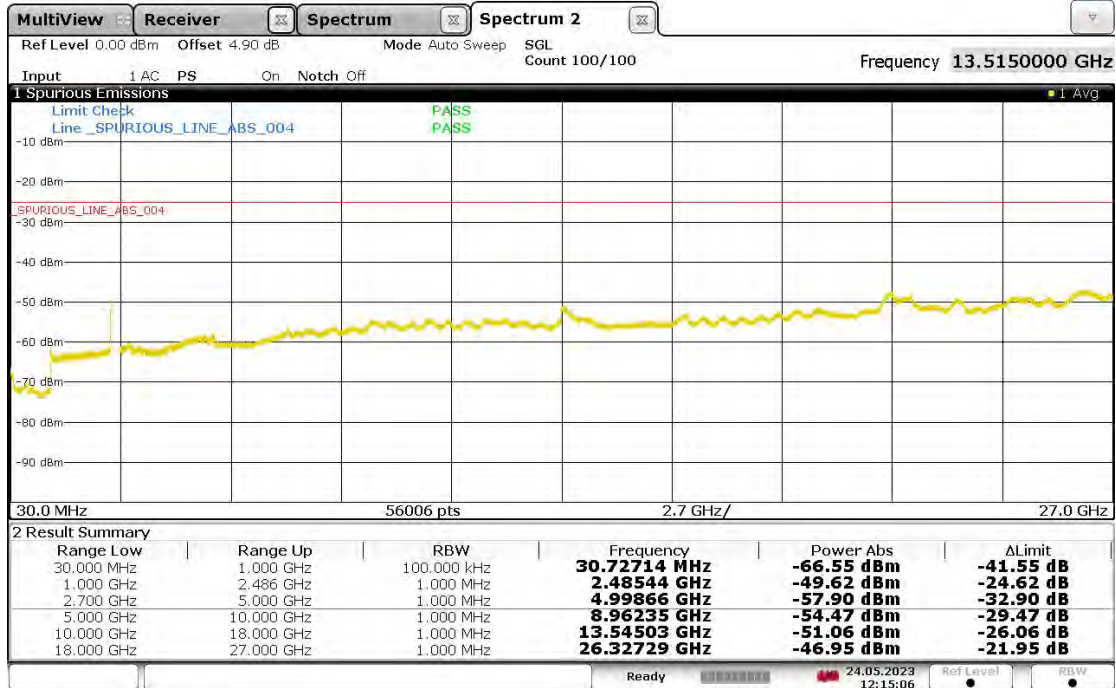

12:15:07 24.05.2023

41-41-20MHz-20MHz-16QAM-16QAM-39750-39948-100RB#0-100RB#0-1000~27000MHz

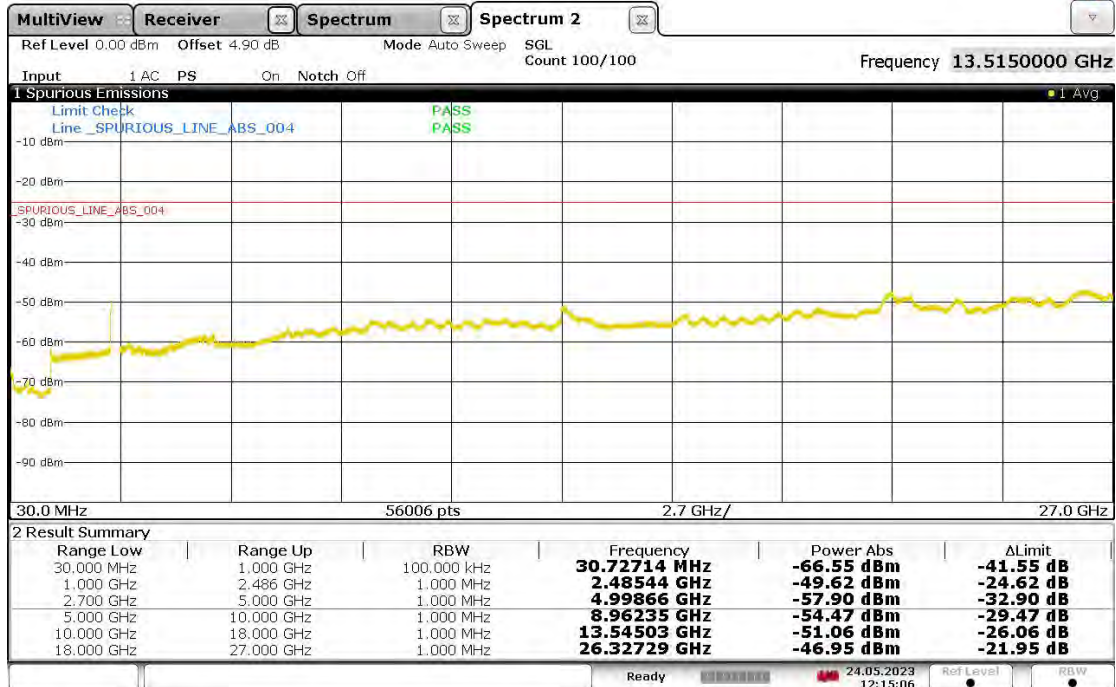


12:15:07 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-16QAM-16QAM-40521-40719-100RB#0-100RB#0-30~1000MHz

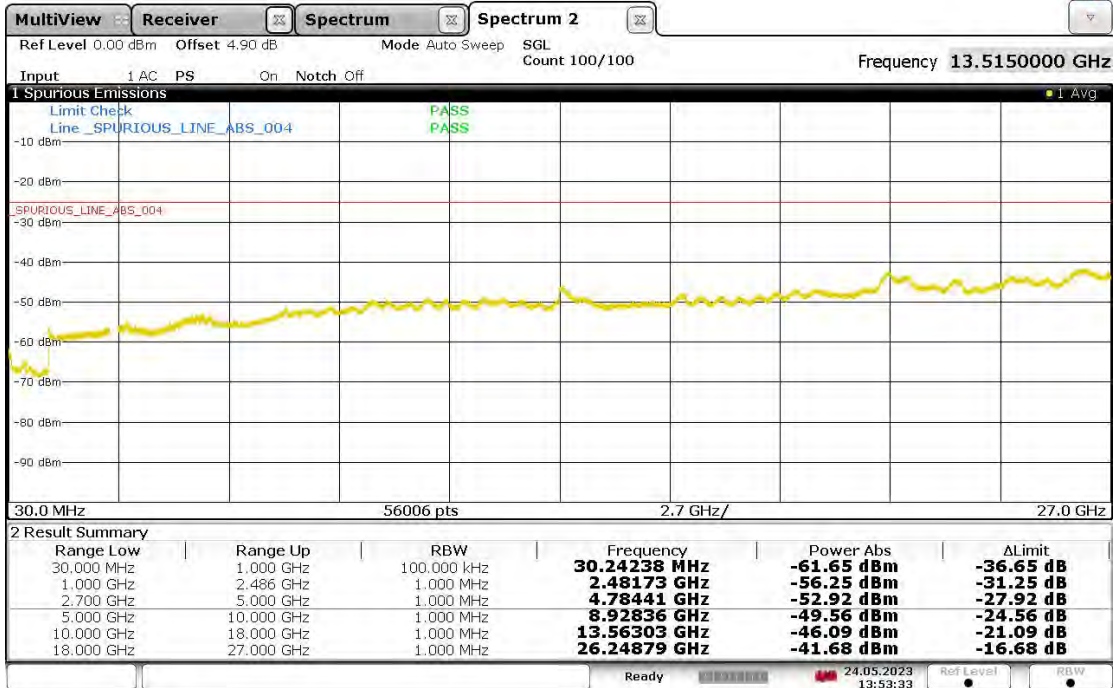

13:53:34 24.05.2023

41-41-20MHz-20MHz-16QAM-16QAM-40521-40719-100RB#0-100RB#0-1000~27000MHz

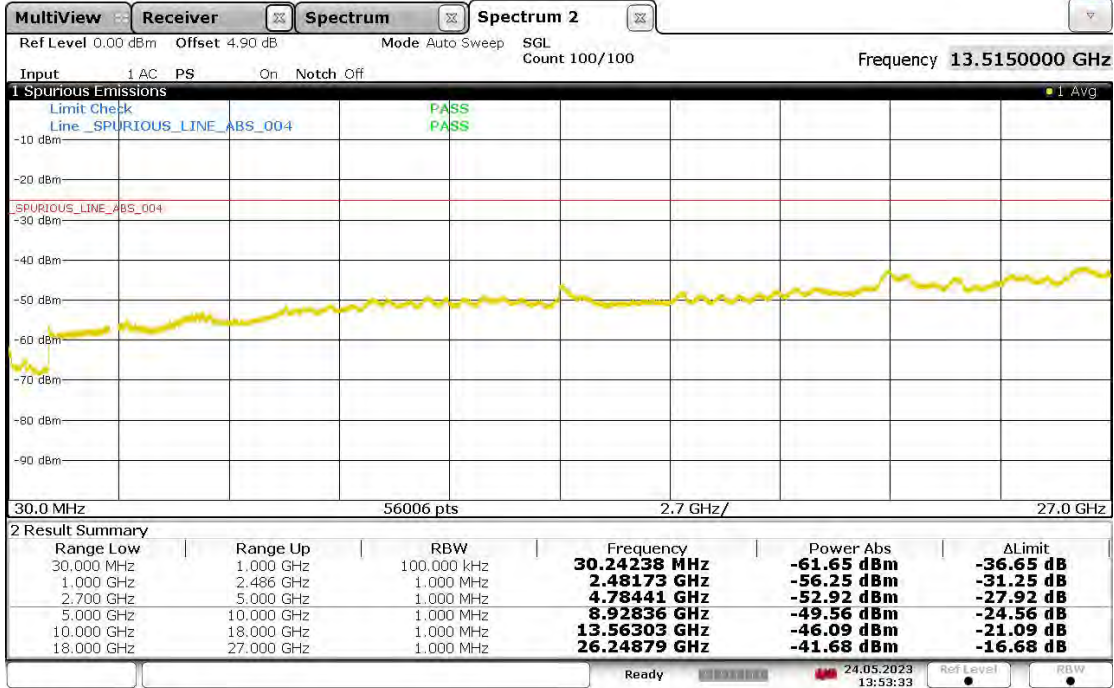


13:53:34 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-16QAM-16QAM-41292-41490-100RB#0-100RB#0-30~1000MHz

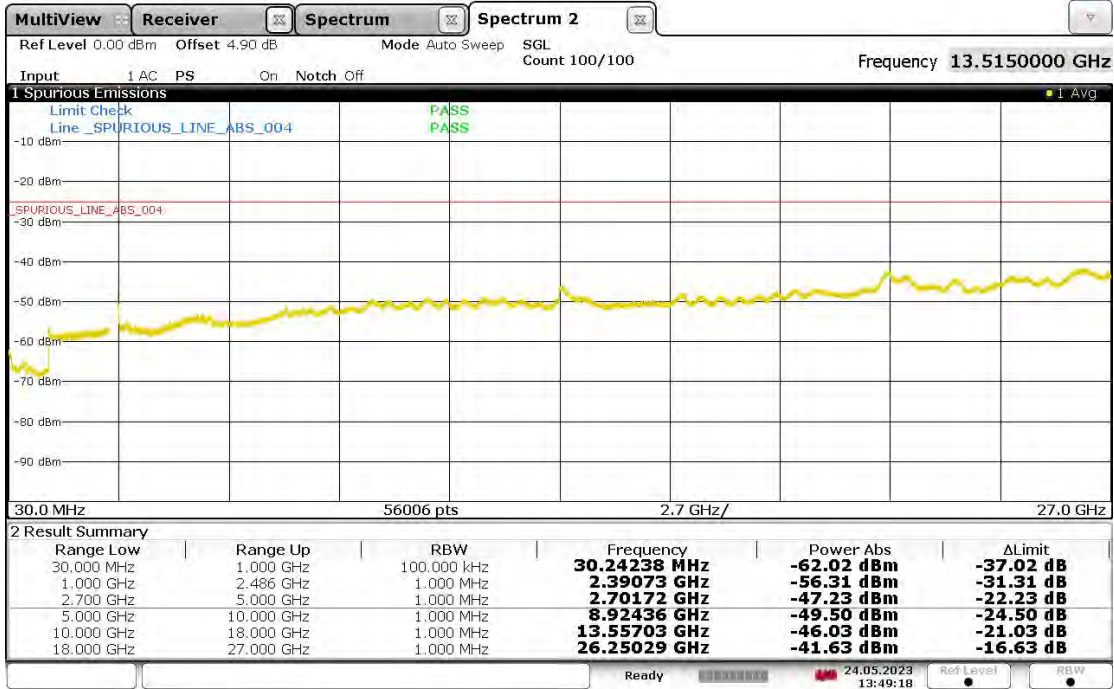

13:49:19 24.05.2023

41-41-20MHz-20MHz-16QAM-16QAM-41292-41490-100RB#0-100RB#0-1000~27000MHz

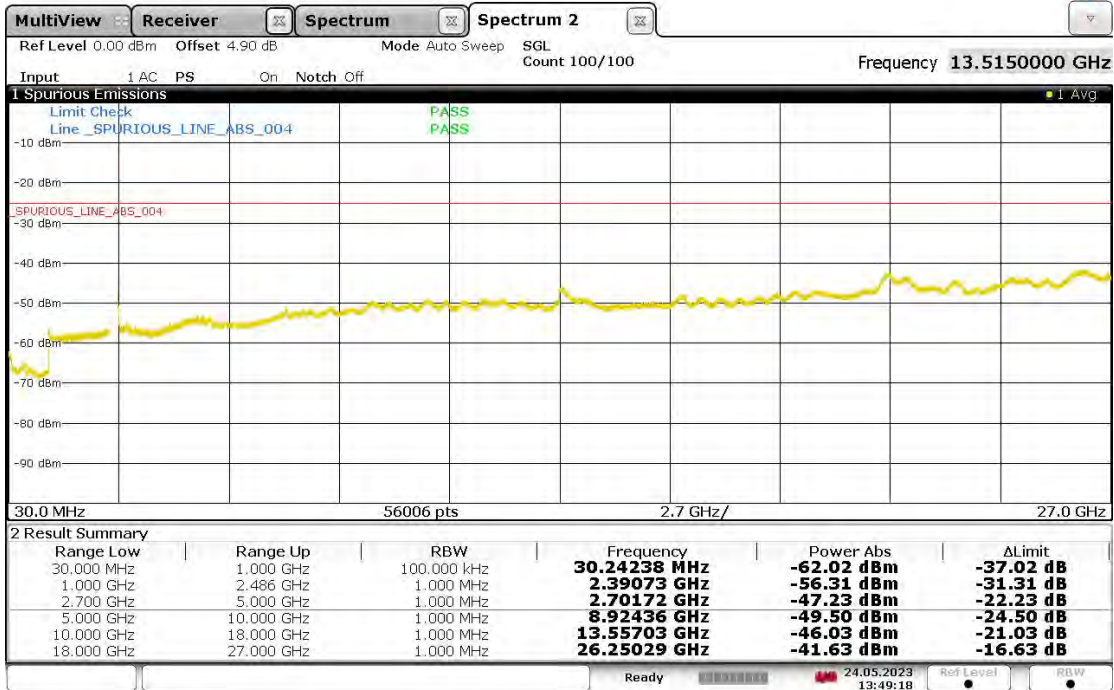


13:49:19 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-64QAM-64QAM-39750-39948-100RB#0-100RB#0-30~1000MHz

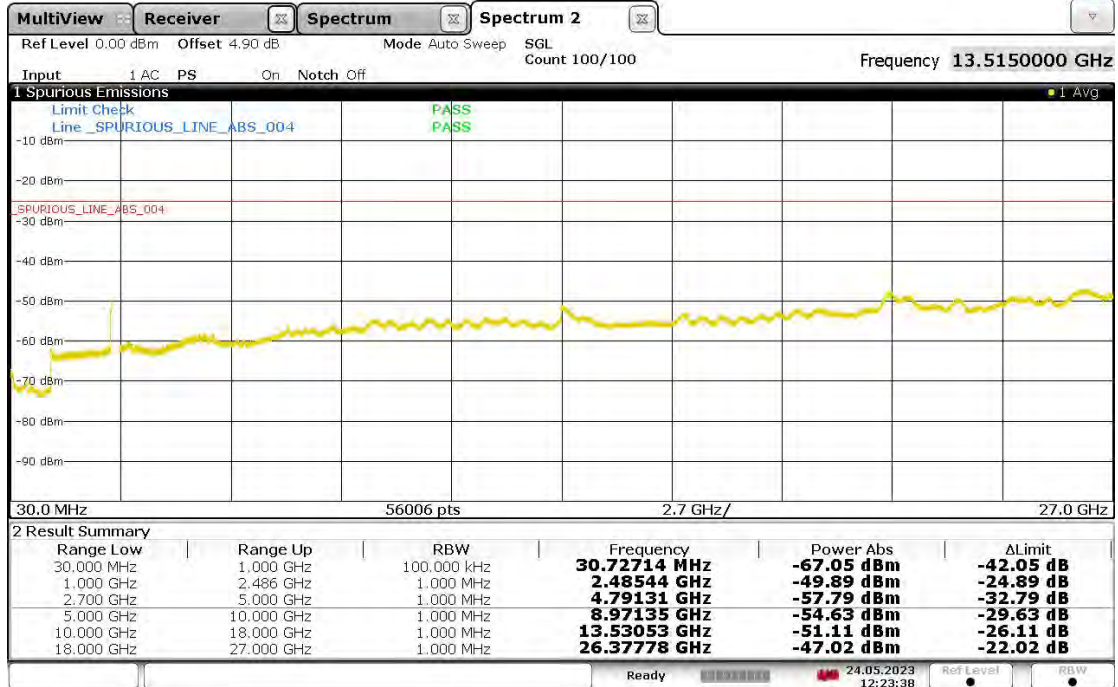

12:23:39 24.05.2023

41-41-20MHz-20MHz-64QAM-64QAM-39750-39948-100RB#0-100RB#0-1000~27000MHz

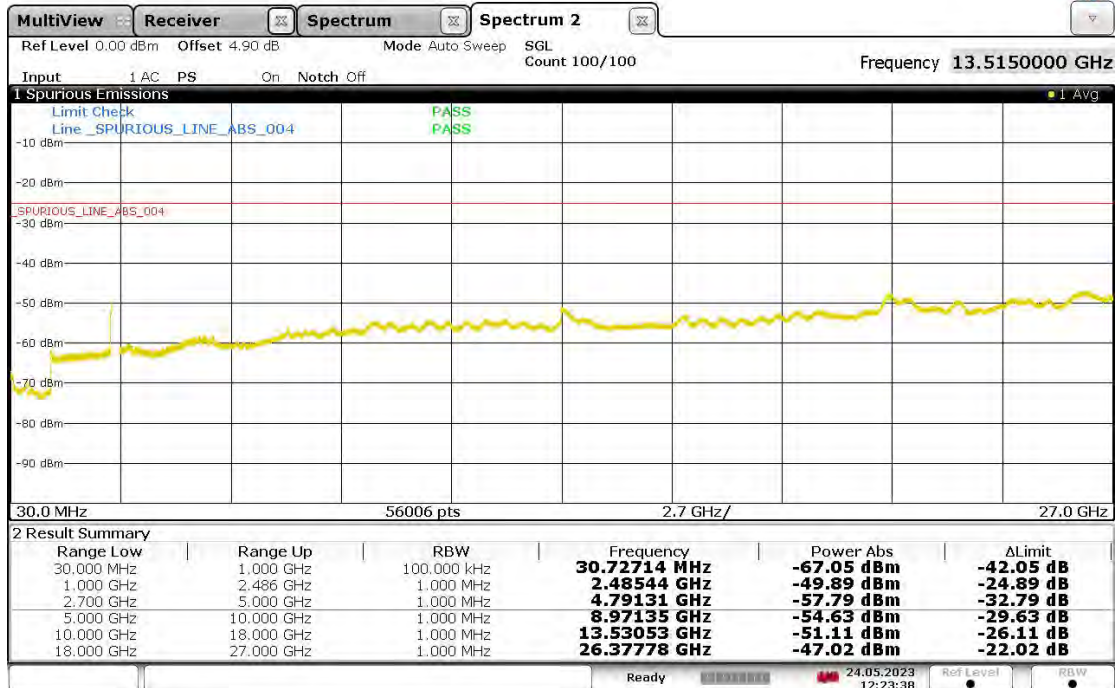


12:23:39 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-64QAM-64QAM-40521-40719-100RB#0-100RB#0-30~1000MHz

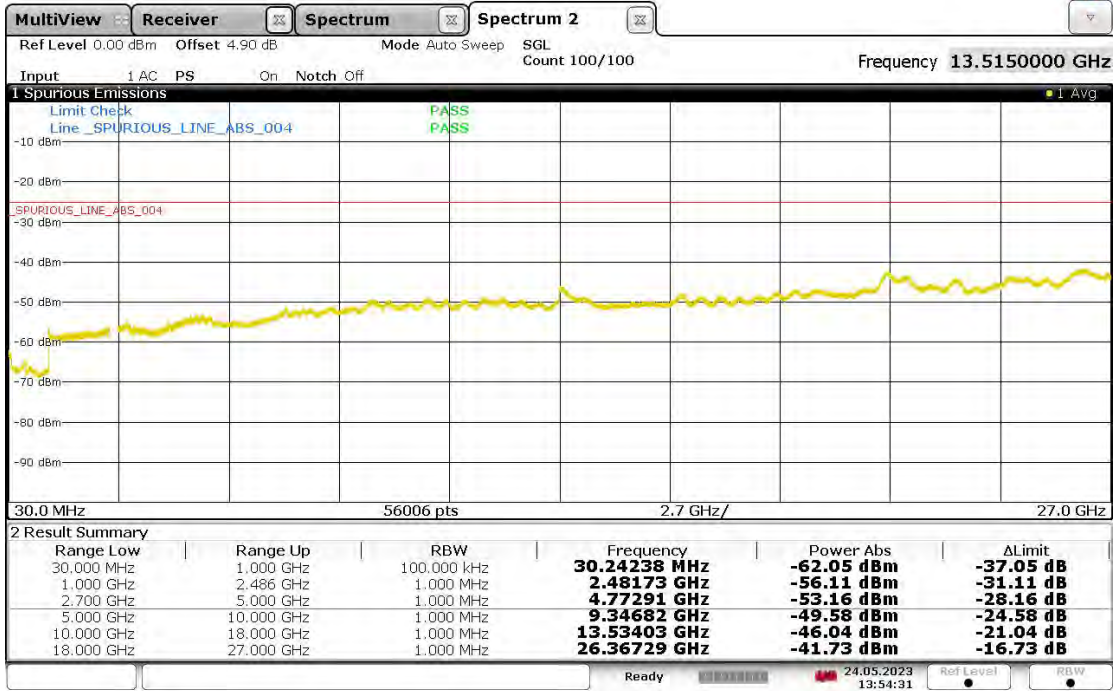

13:54:32 24.05.2023

41-41-20MHz-20MHz-64QAM-64QAM-40521-40719-100RB#0-100RB#0-1000~27000MHz

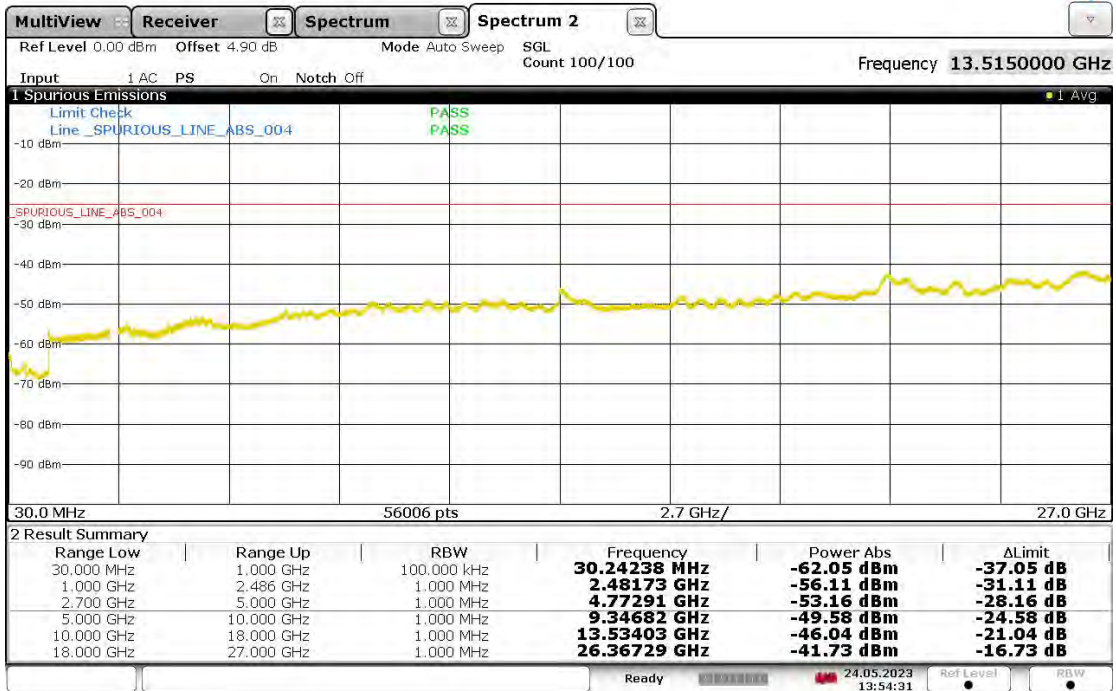


13:54:32 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-20MHz-64QAM-64QAM-41292-41490-100RB#0-100RB#0-30~1000MHz

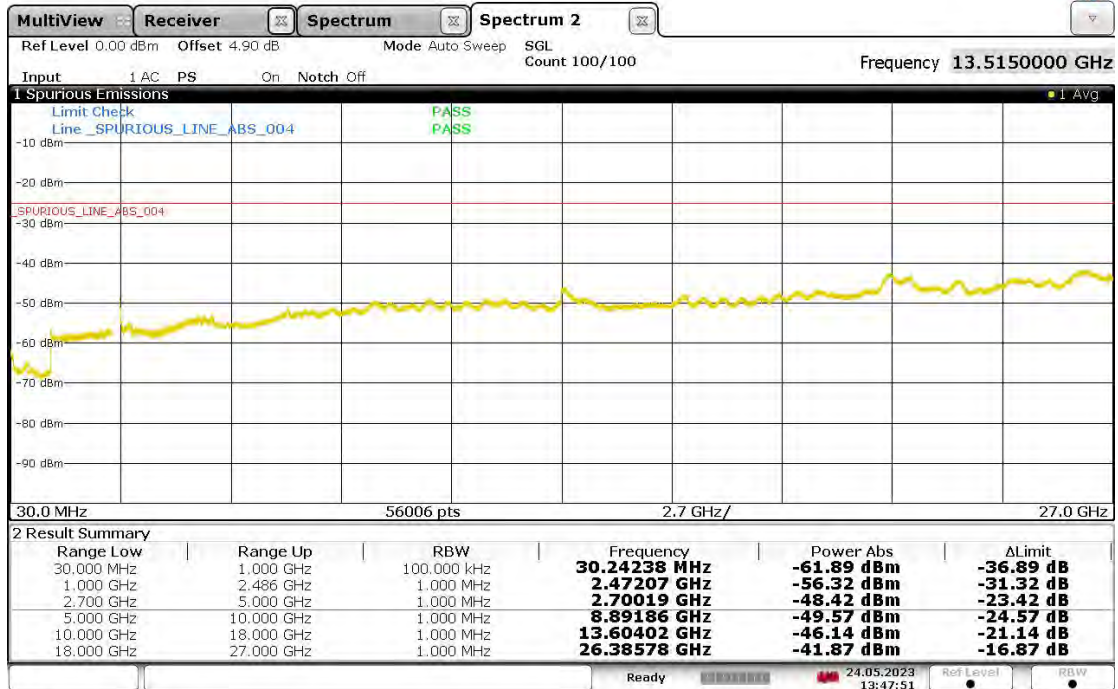

13:47:51 24.05.2023

41-41-20MHz-20MHz-64QAM-64QAM-41292-41490-100RB#0-100RB#0-1000~27000MHz

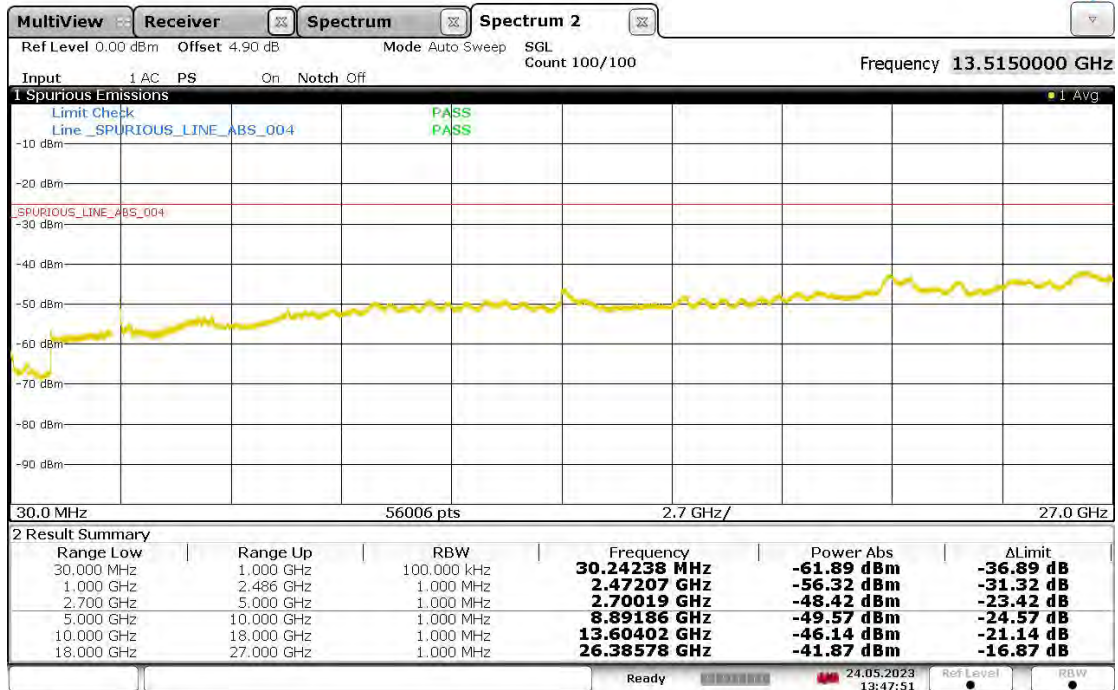


13:47:51 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-QPSK-QPSK-39750-39867-100RB#0-100RB#0-30~1000MHz

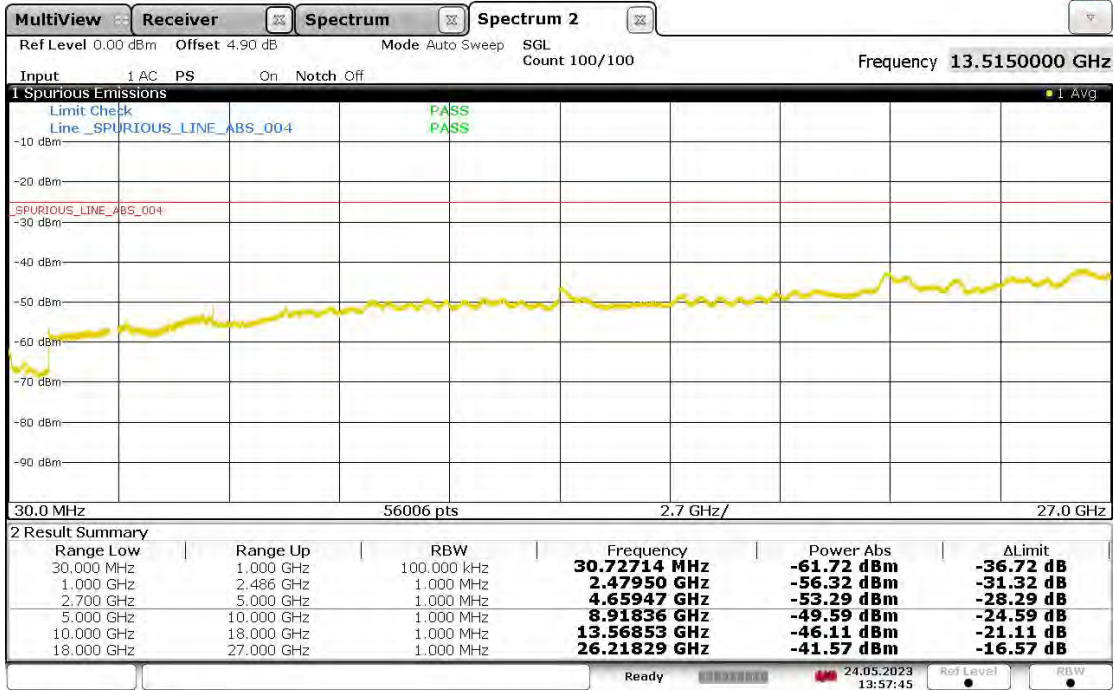

13:57:45 24.05.2023

41-41-20MHz-5MHz-QPSK-QPSK-39750-39867-100RB#0-100RB#0-1000~27000MHz

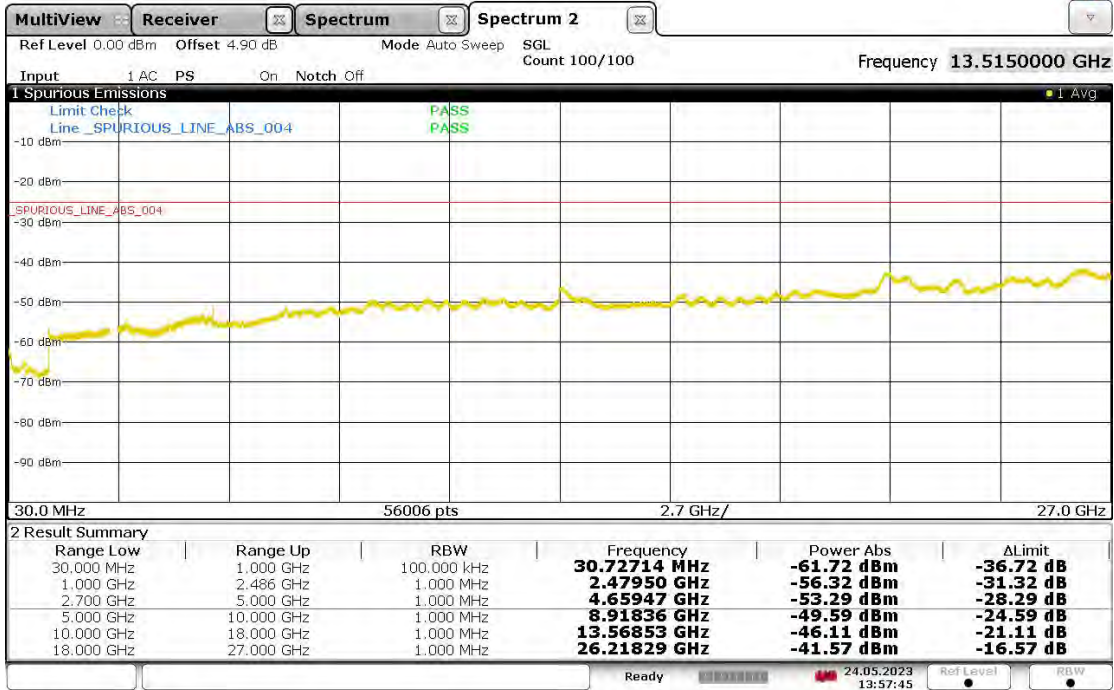


13:57:45 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-QPSK-QPSK-40595-40712-100RB#0-100RB#0-30~1000MHz

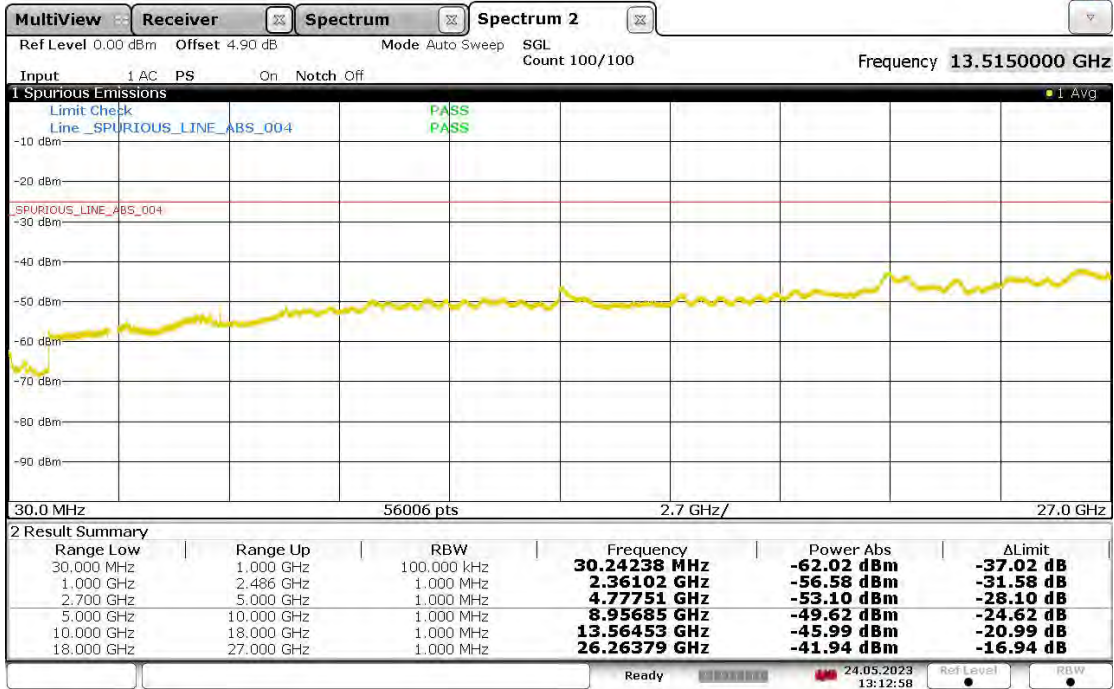

13:12:58 24.05.2023

41-41-20MHz-5MHz-QPSK-QPSK-40595-40712-100RB#0-100RB#0-1000~27000MHz

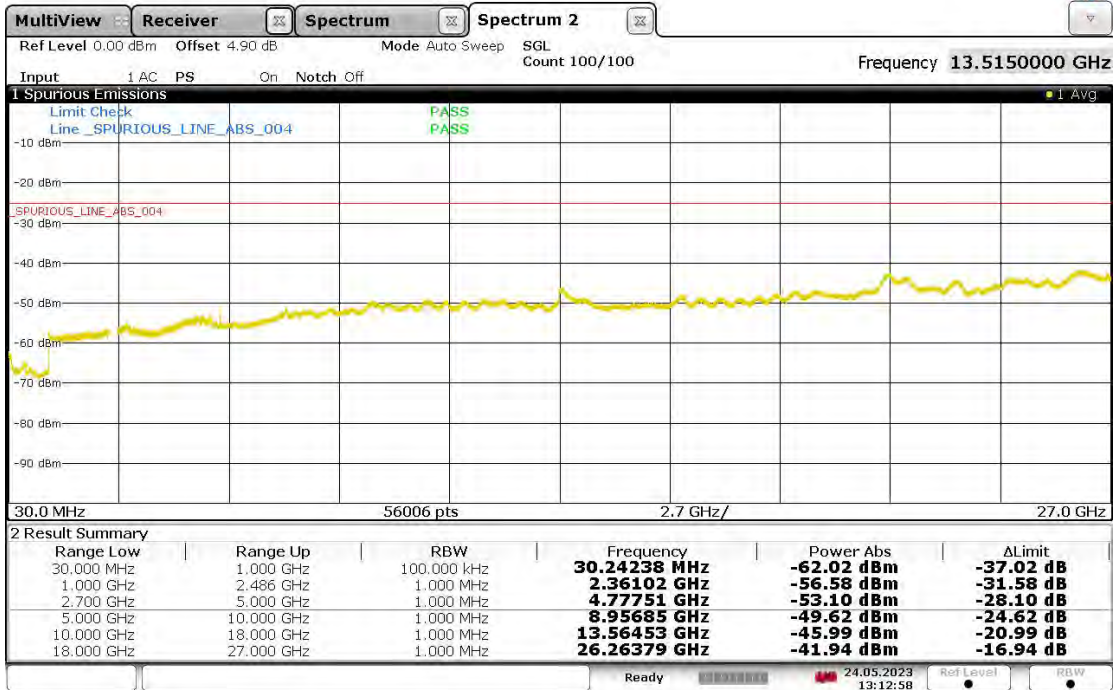


13:12:58 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-QPSK-QPSK-41440-41557-100RB#0-100RB#0-30~1000MHz

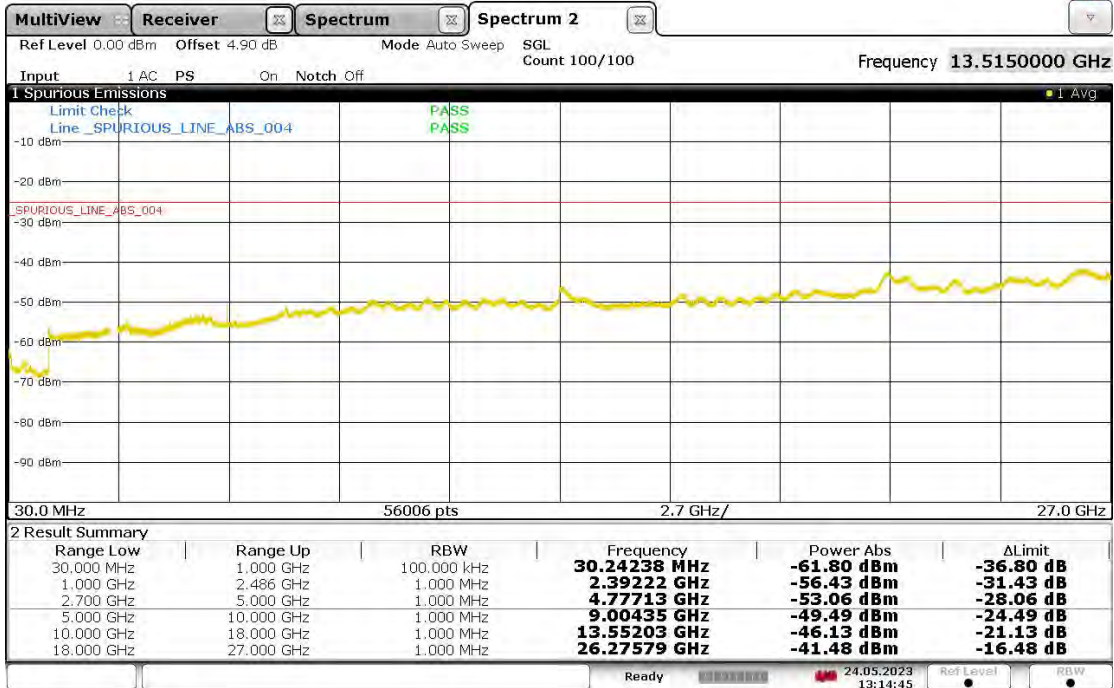

13:14:46 24.05.2023

41-41-20MHz-5MHz-QPSK-QPSK-41440-41557-100RB#0-100RB#0-1000~27000MHz

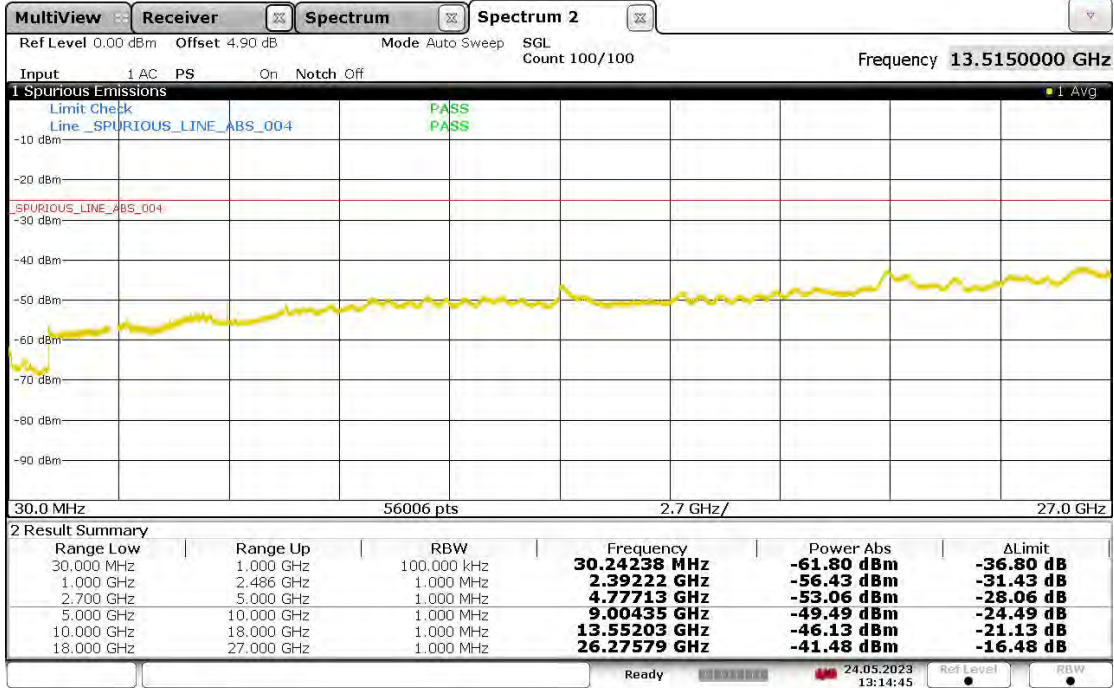


13:14:46 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-16QAM-16QAM-39750-39867-100RB#0-100RB#0-30~1000MHz

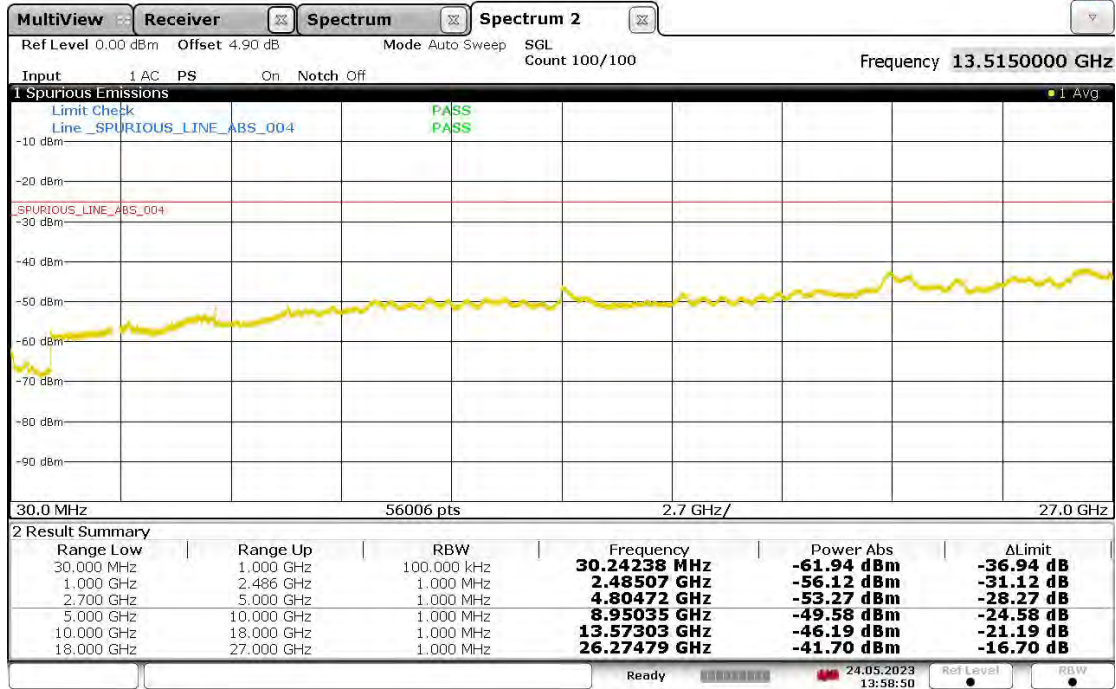

13:58:51 24.05.2023

41-41-20MHz-5MHz-16QAM-16QAM-39750-39867-100RB#0-100RB#0-1000~27000MHz

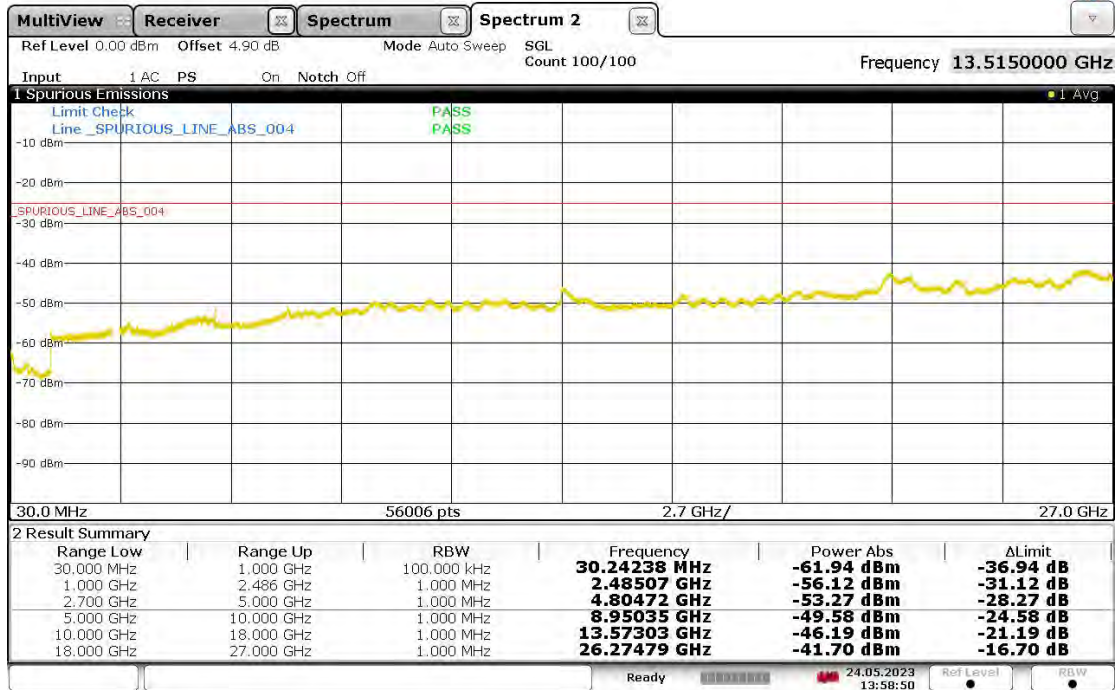


13:58:51 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-16QAM-16QAM-40595-40712-100RB#0-100RB#0-30~1000MHz

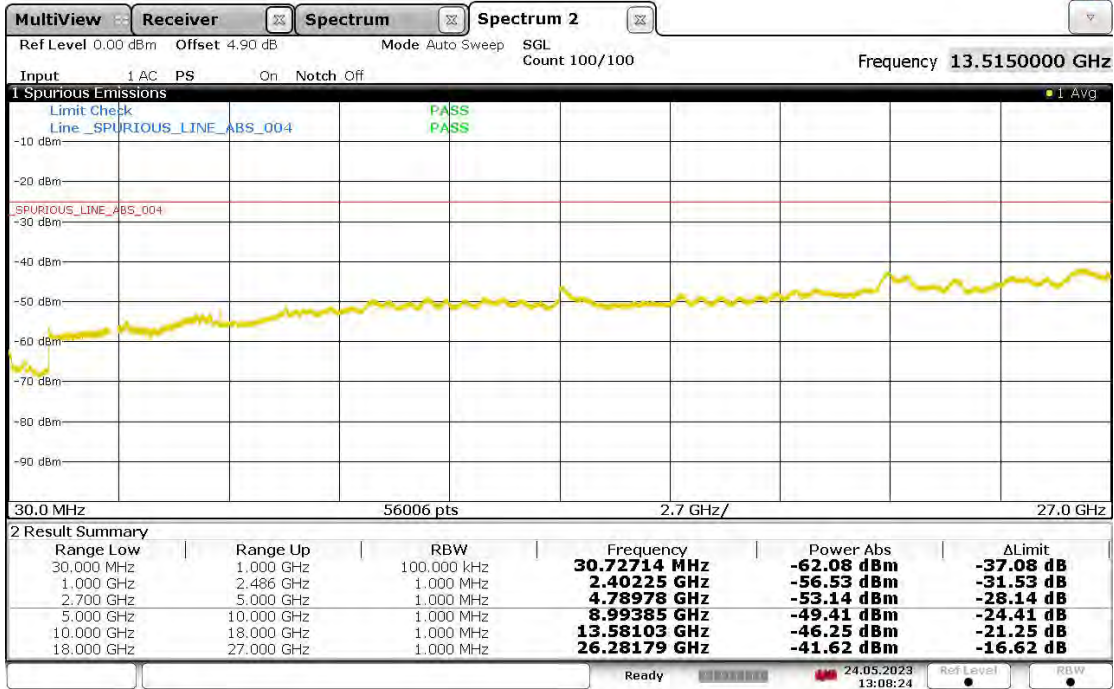

13:08:24 24.05.2023

41-41-20MHz-5MHz-16QAM-16QAM-40595-40712-100RB#0-100RB#0-1000~27000MHz

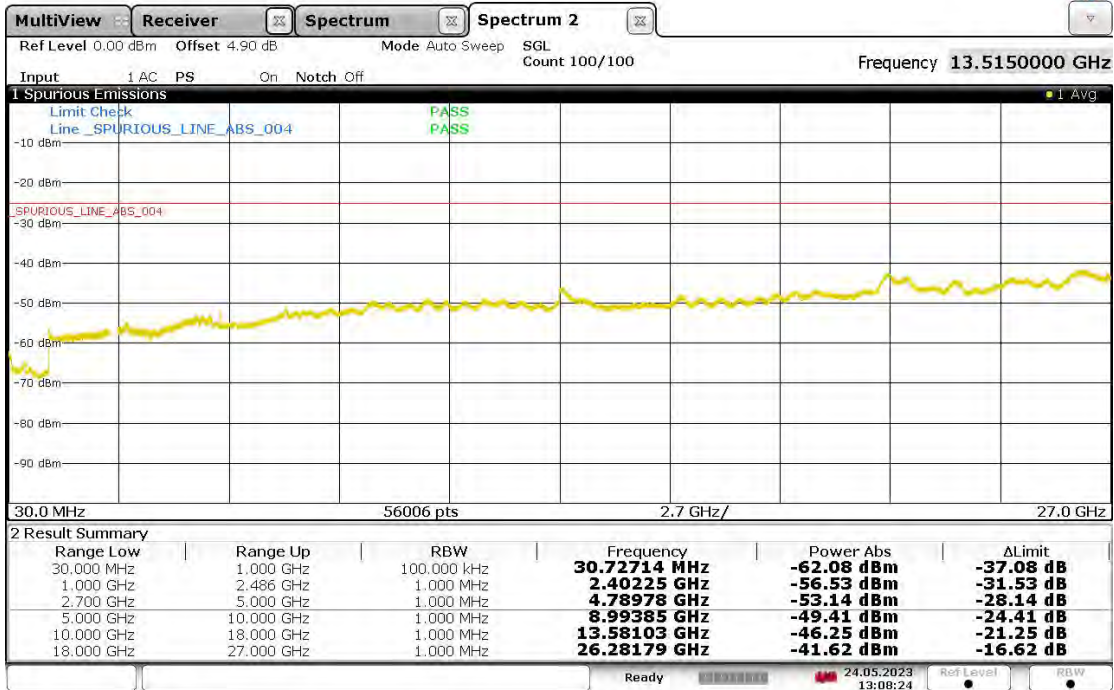


13:08:24 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-16QAM-16QAM-41440-41557-100RB#0-100RB#0-30~1000MHz

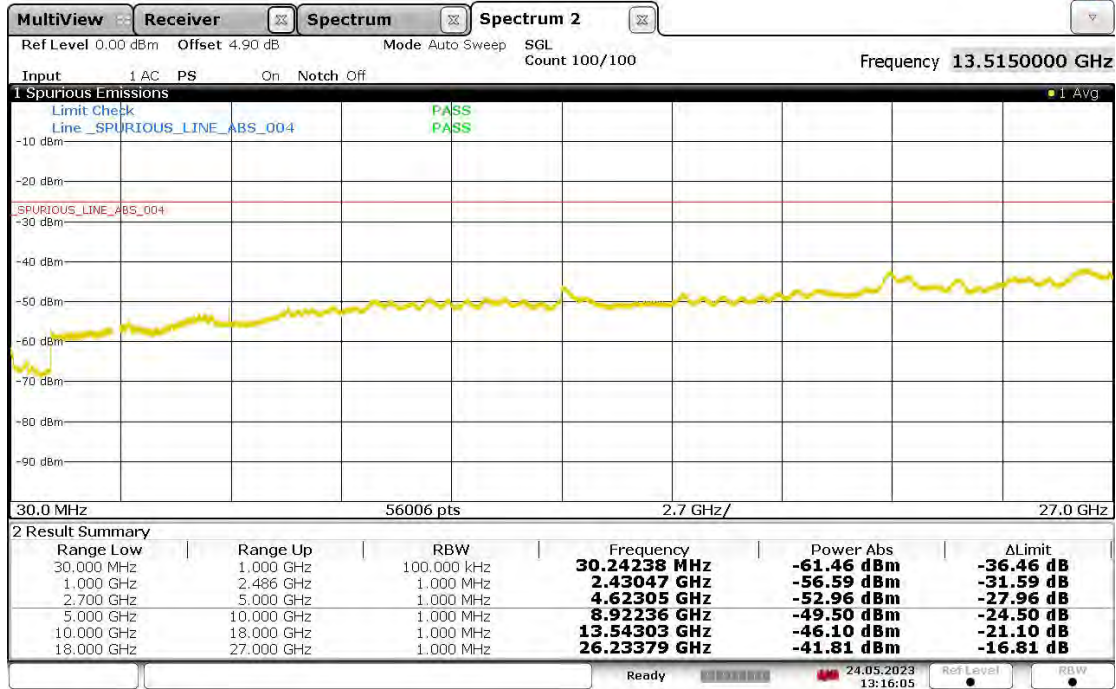

13:16:06 24.05.2023

41-41-20MHz-5MHz-16QAM-16QAM-41440-41557-100RB#0-100RB#0-1000~27000MHz

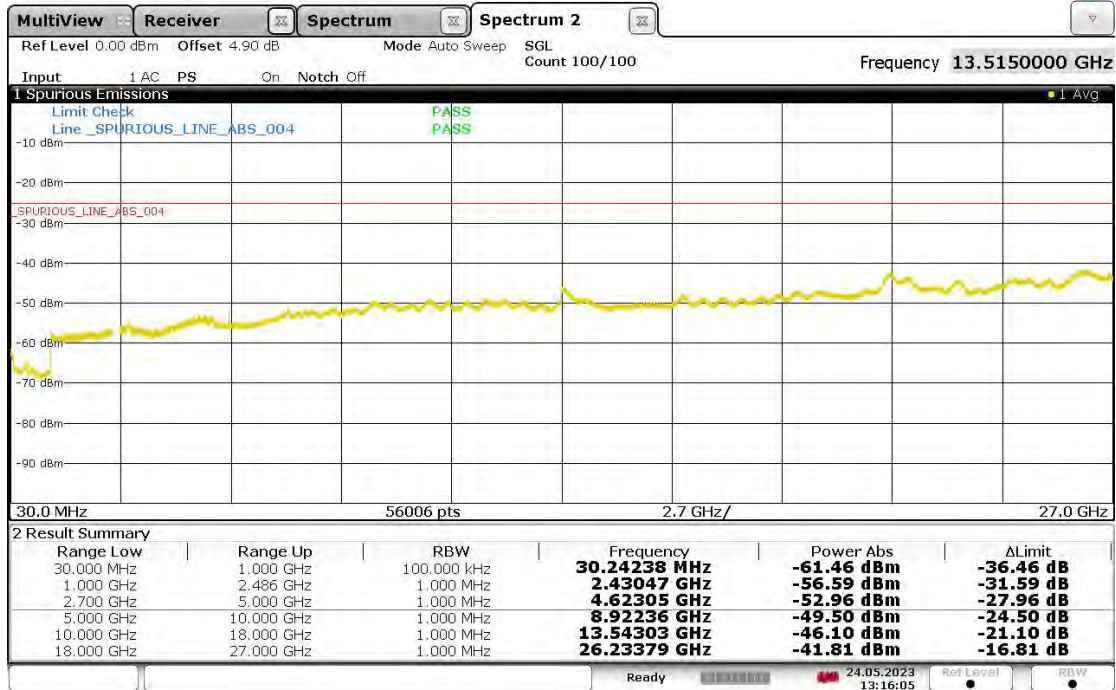


13:16:06 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-64QAM-64QAM-39750-39867-100RB#0-100RB#0-30~1000MHz

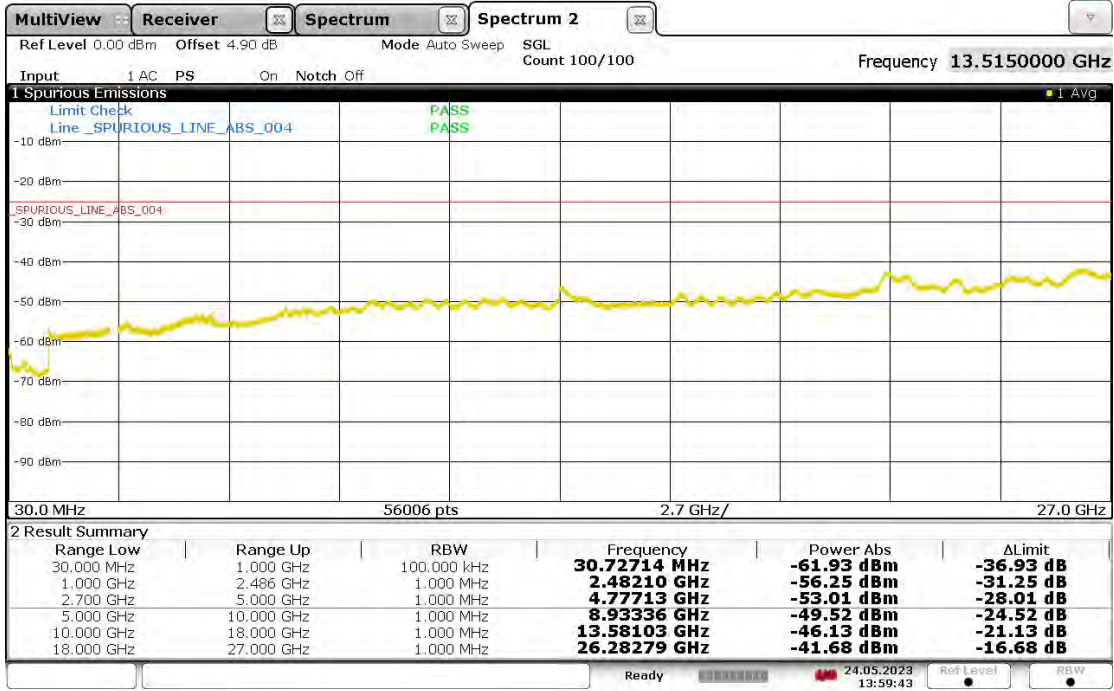

13:59:44 24.05.2023

41-41-20MHz-5MHz-64QAM-64QAM-39750-39867-100RB#0-100RB#0-1000~27000MHz

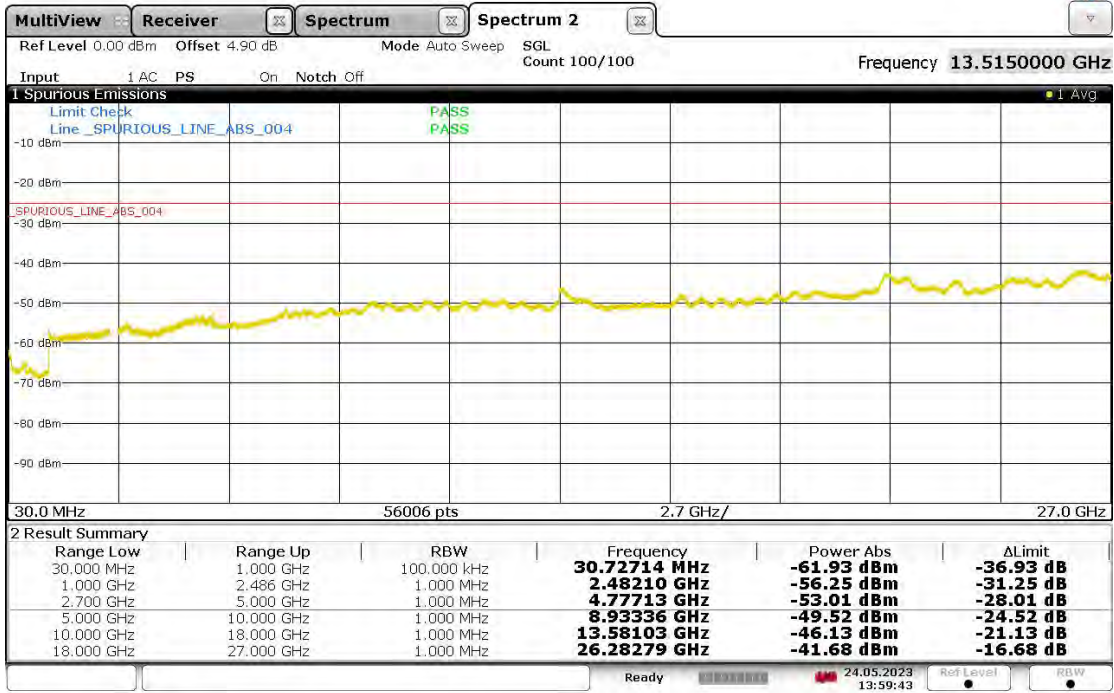


13:59:44 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-64QAM-64QAM-40595-40712-100RB#0-100RB#0-30~1000MHz

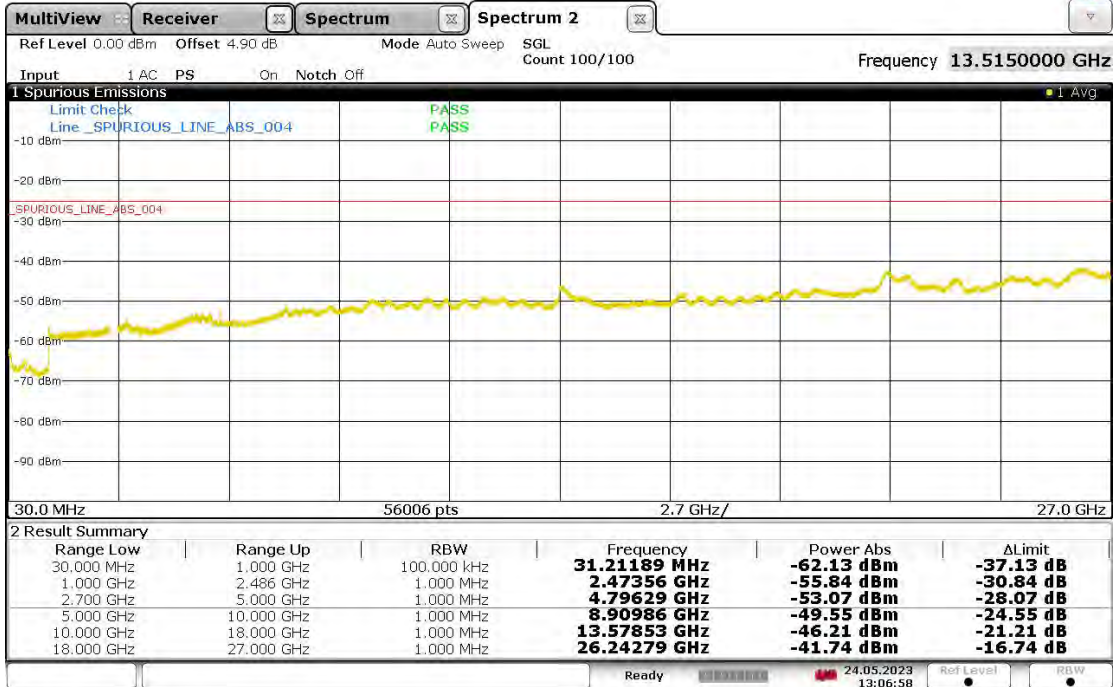

13:06:58 24.05.2023

41-41-20MHz-5MHz-64QAM-64QAM-40595-40712-100RB#0-100RB#0-1000~27000MHz

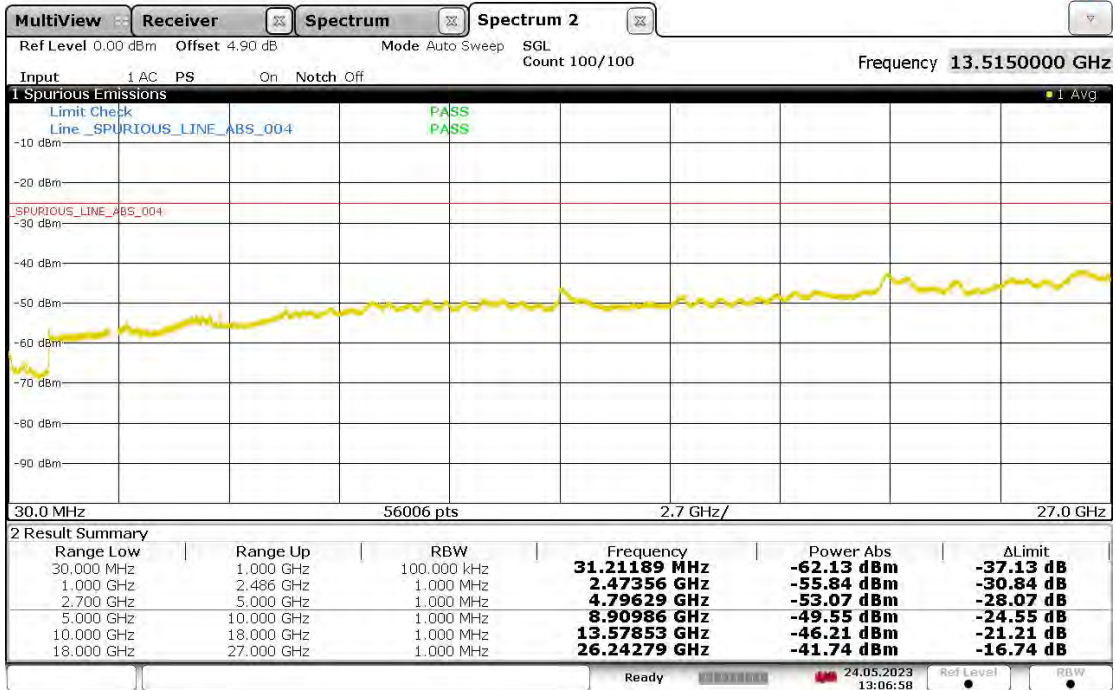


13:06:58 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-20MHz-5MHz-64QAM-64QAM-41440-41557-100RB#0-100RB#0-30~1000MHz

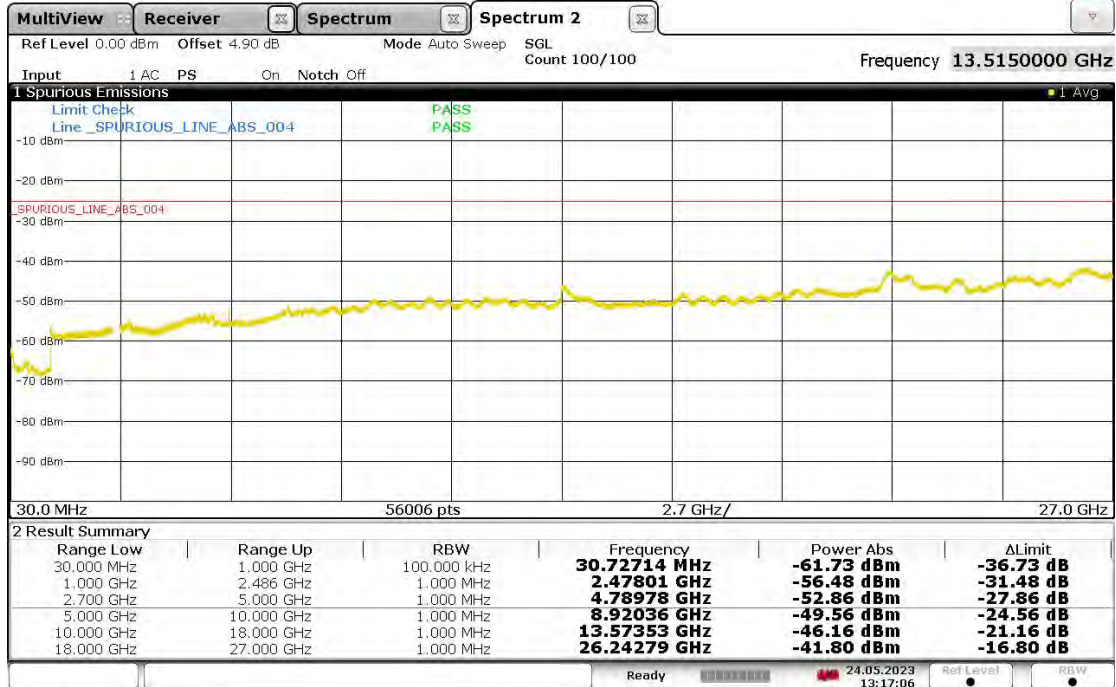

13:17:07 24.05.2023

41-41-20MHz-5MHz-64QAM-64QAM-41440-41557-100RB#0-100RB#0-1000~27000MHz

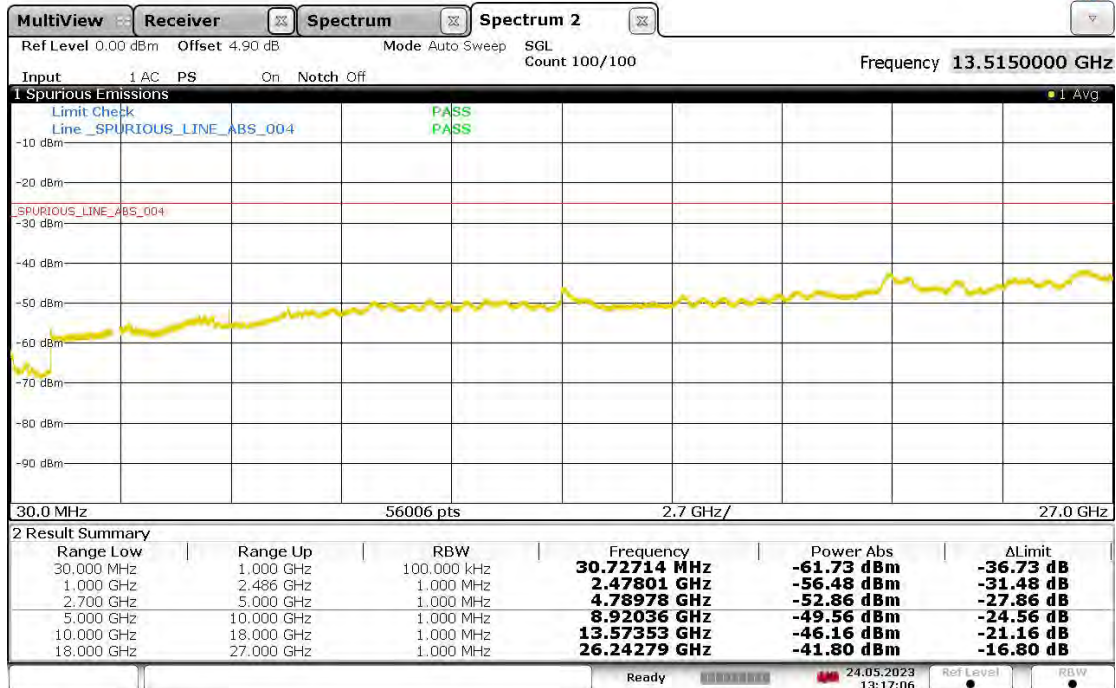


13:17:07 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-QPSK-QPSK-39683-39800-100RB#0-100RB#0-30~1000MHz

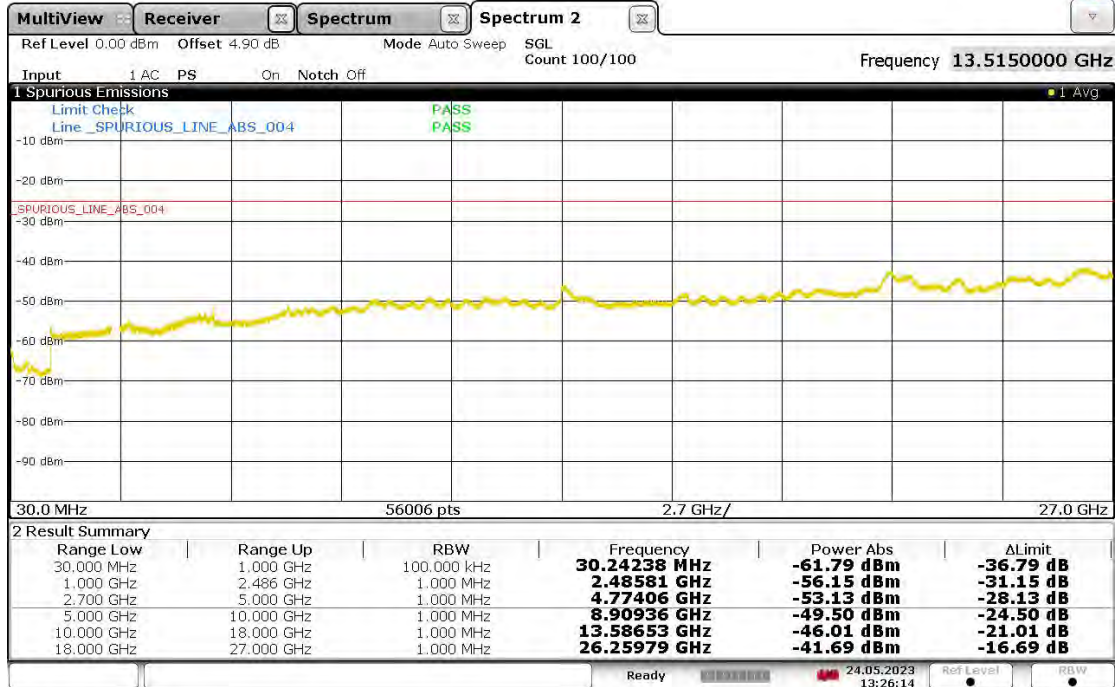

13:26:15 24.05.2023

41-41-5MHz-20MHz-QPSK-QPSK-39683-39800-100RB#0-100RB#0-1000~27000MHz

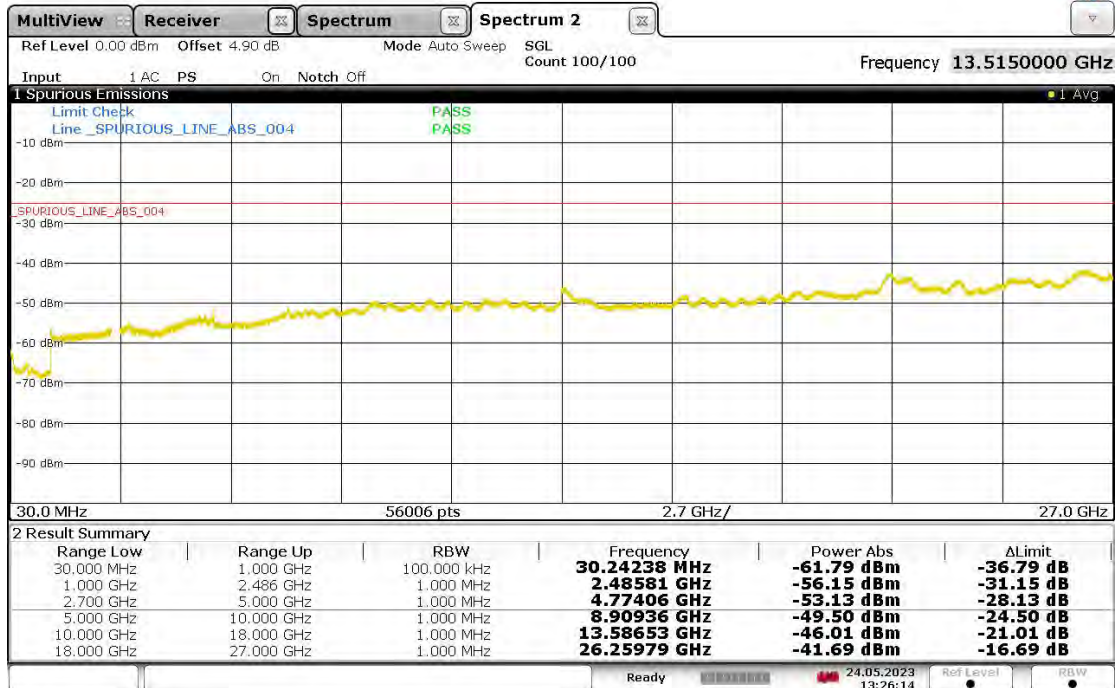


13:26:15 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-QPSK-QPSK-40528-40645-100RB#0-100RB#0-30~1000MHz

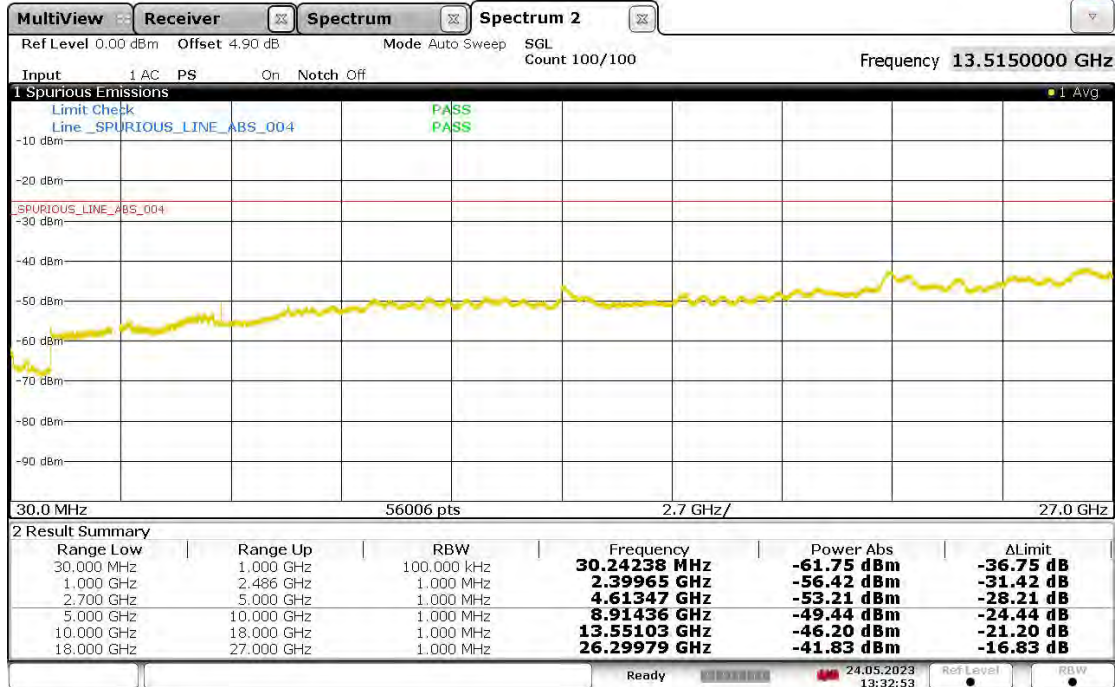

13:32:53 24.05.2023

41-41-5MHz-20MHz-QPSK-QPSK-40528-40645-100RB#0-100RB#0-1000~27000MHz

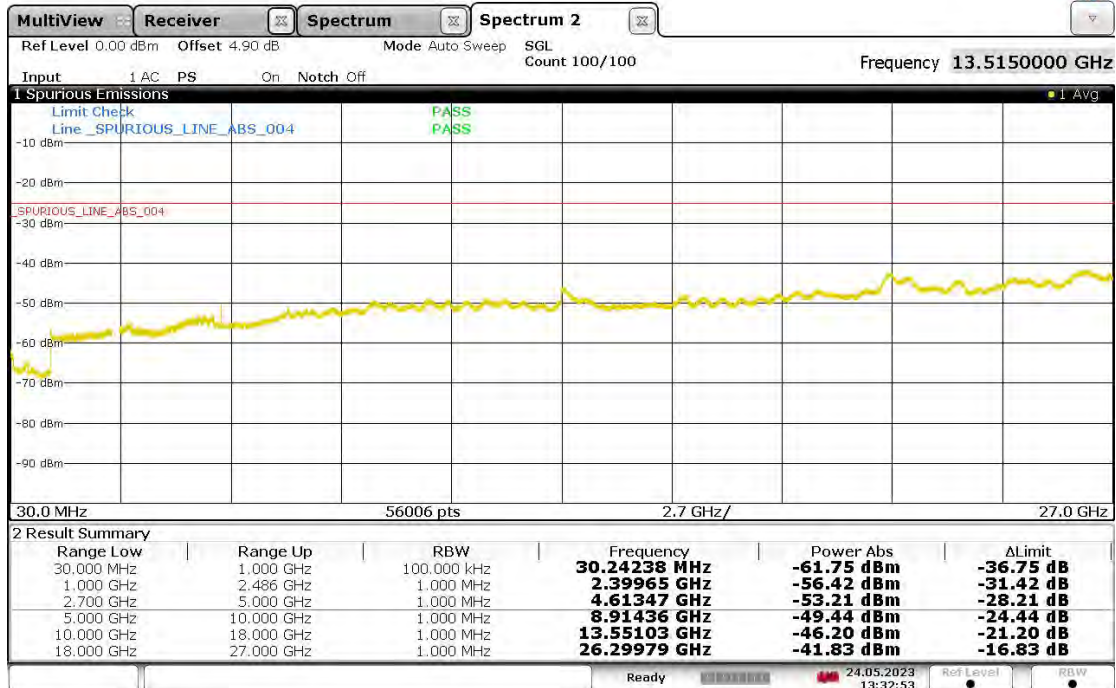


13:32:53 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-QPSK-QPSK-41373-41490-100RB#0-100RB#0-30~1000MHz

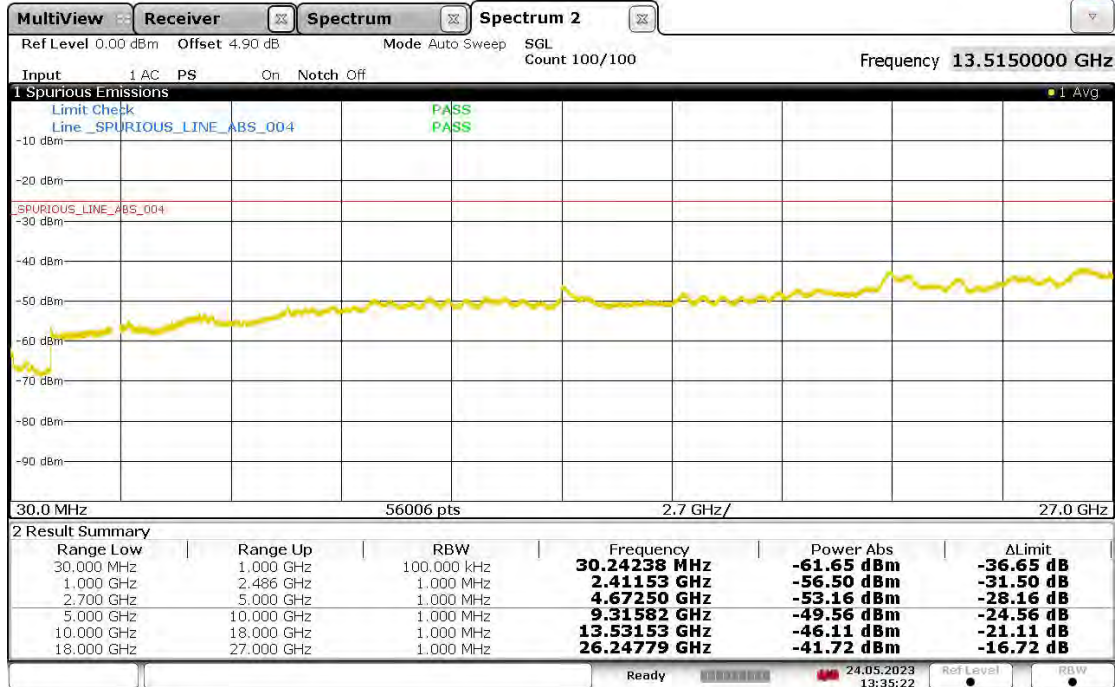

13:35:23 24.05.2023

41-41-5MHz-20MHz-QPSK-QPSK-41373-41490-100RB#0-100RB#0-1000~27000MHz

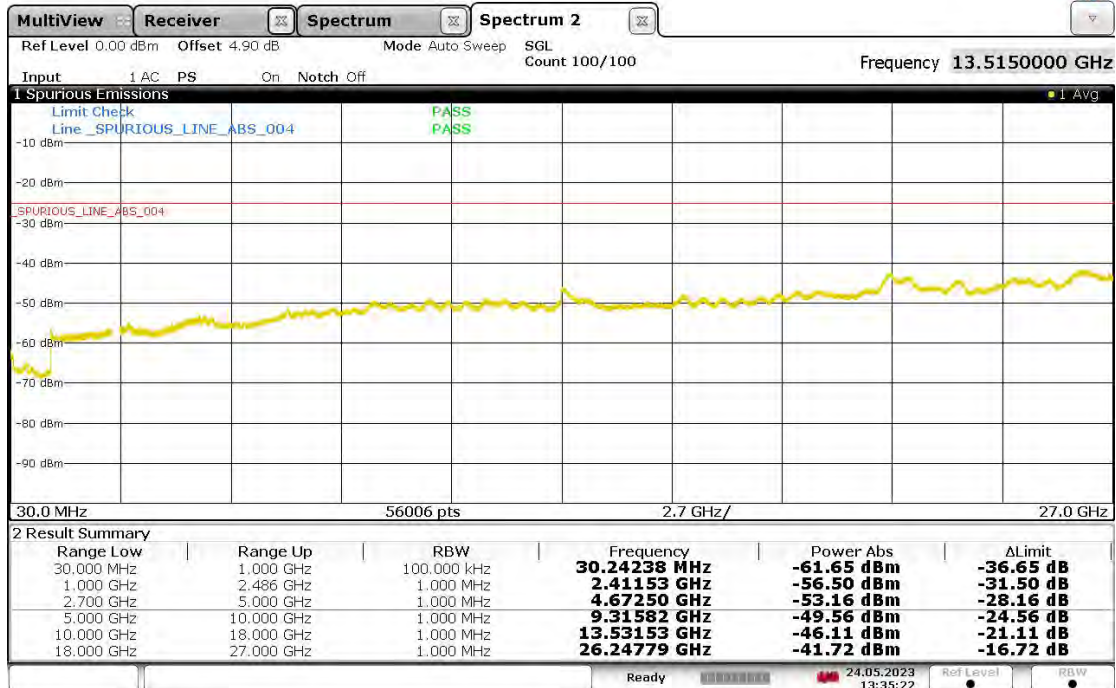


13:35:23 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-16QAM-16QAM-39683-39800-100RB#0-100RB#0-30~1000MHz

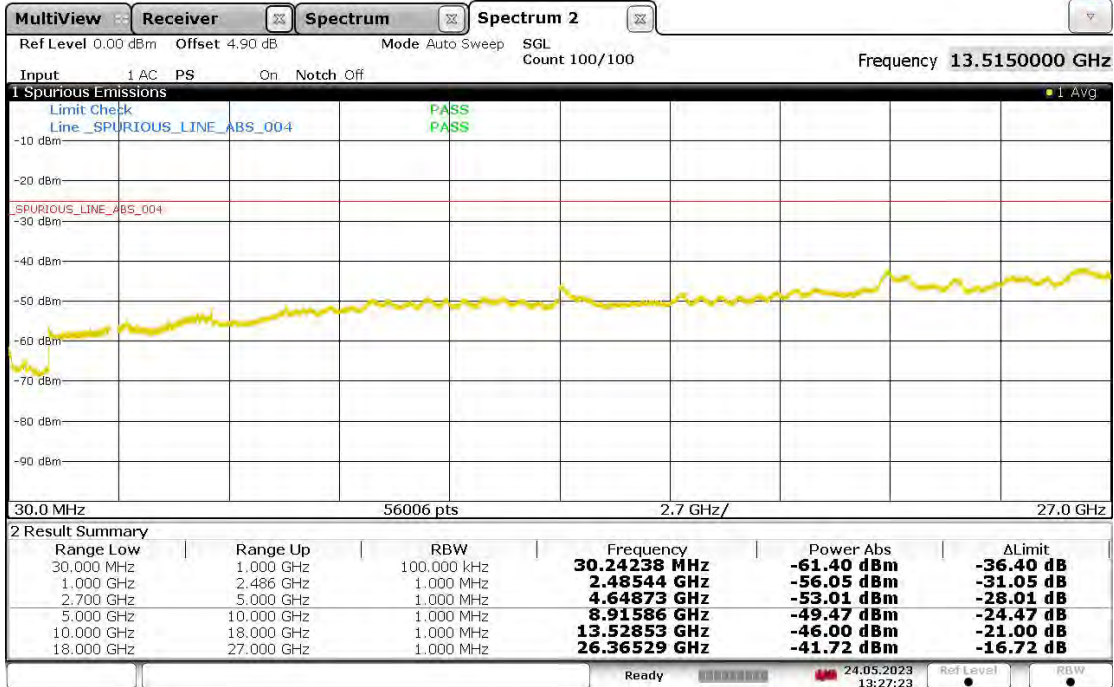

13:27:23 24.05.2023

41-41-5MHz-20MHz-16QAM-16QAM-39683-39800-100RB#0-100RB#0-1000~27000MHz

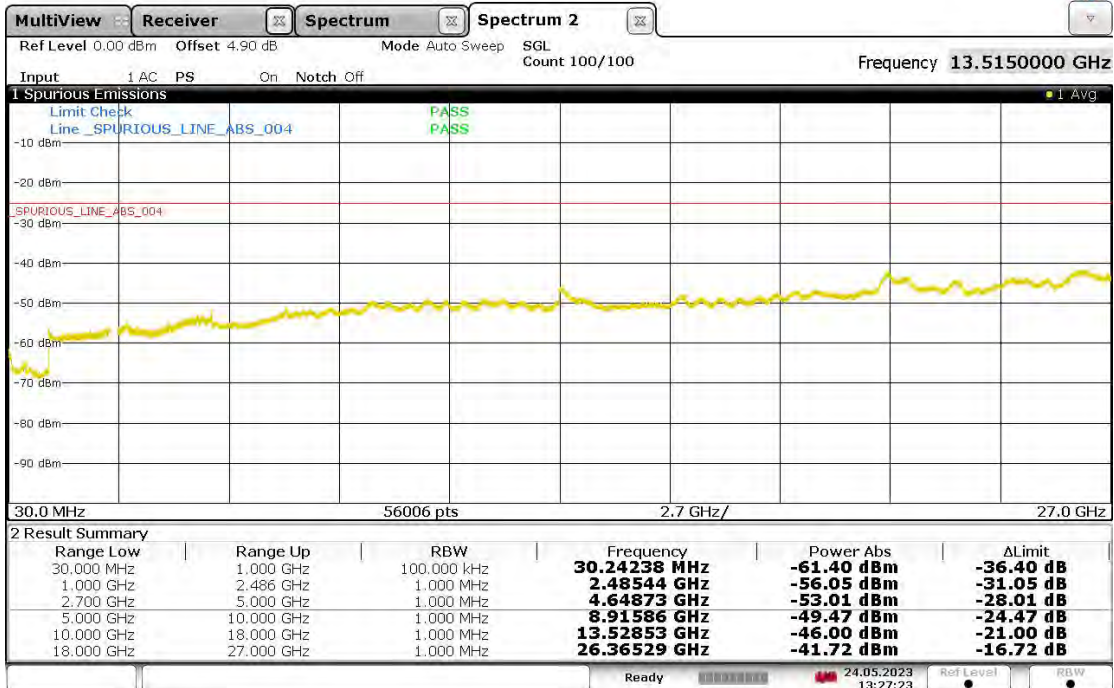


13:27:23 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-16QAM-16QAM-40528-40645-100RB#0-100RB#0-30~1000MHz

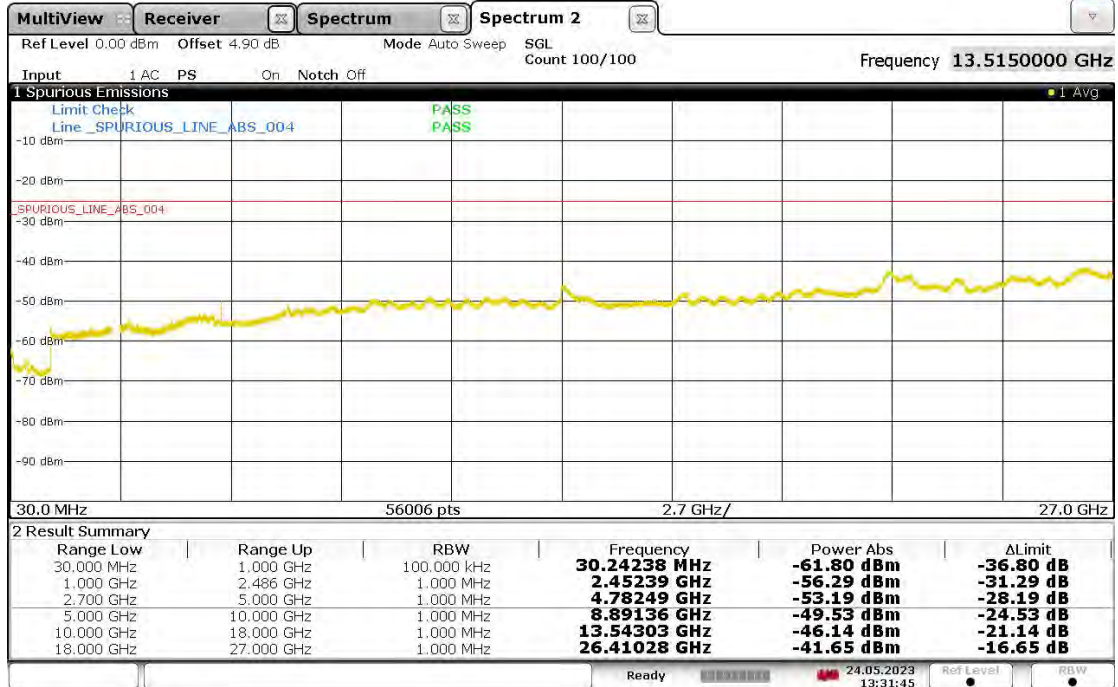

13:31:46 24.05.2023

41-41-5MHz-20MHz-16QAM-16QAM-40528-40645-100RB#0-100RB#0-1000~27000MHz

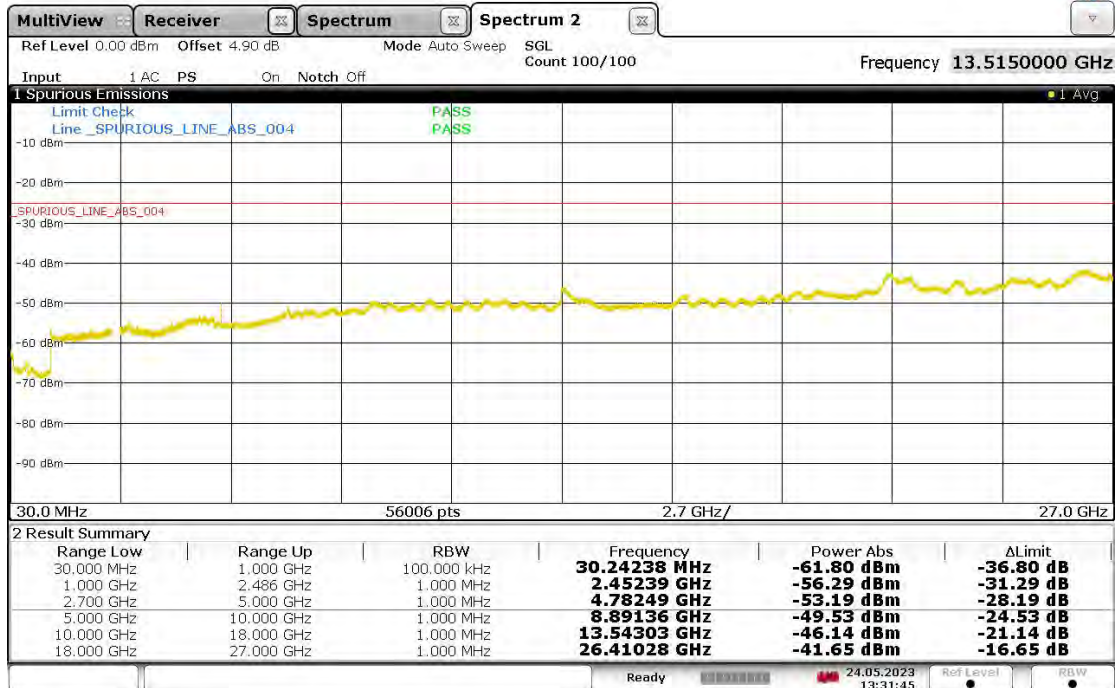


13:31:46 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-16QAM-16QAM-41373-41490-100RB#0-100RB#0-30~1000MHz

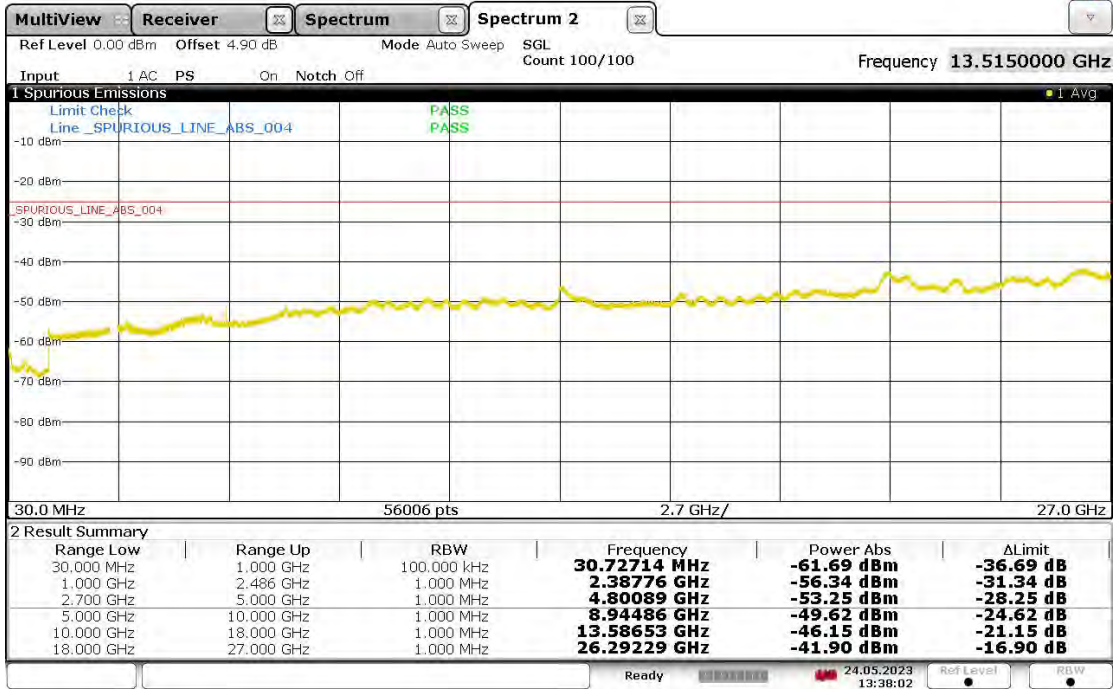

13:38:03 24.05.2023

41-41-5MHz-20MHz-16QAM-16QAM-41373-41490-100RB#0-100RB#0-1000~27000MHz

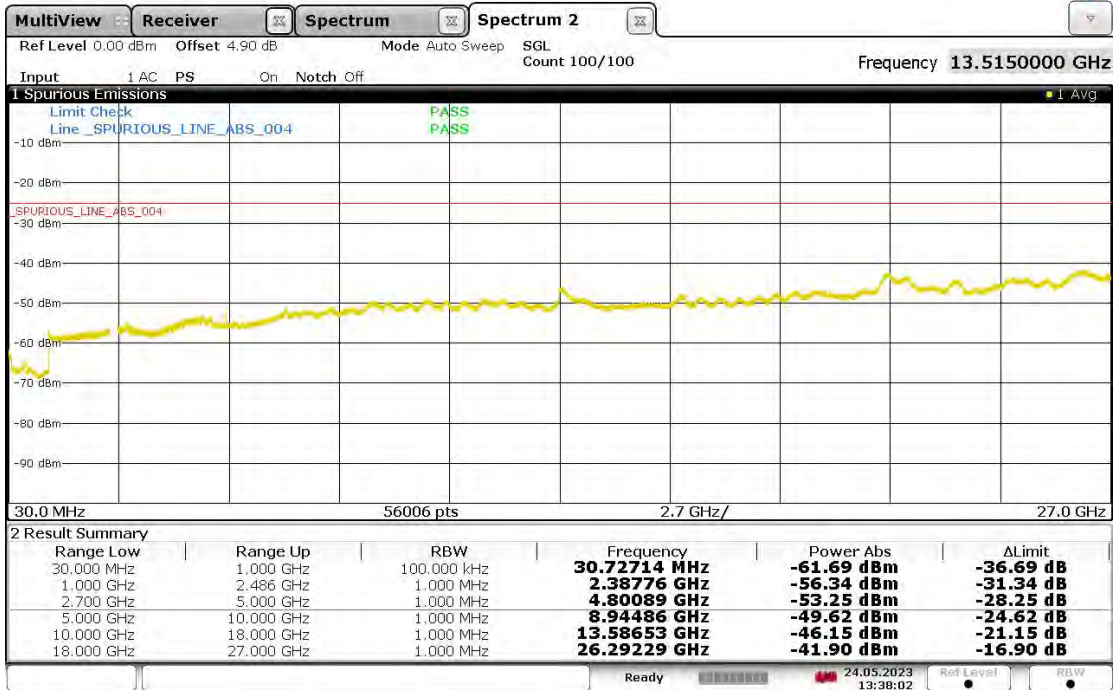


13:38:03 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-64QAM-64QAM-39683-39800-100RB#0-100RB#0-30~1000MHz

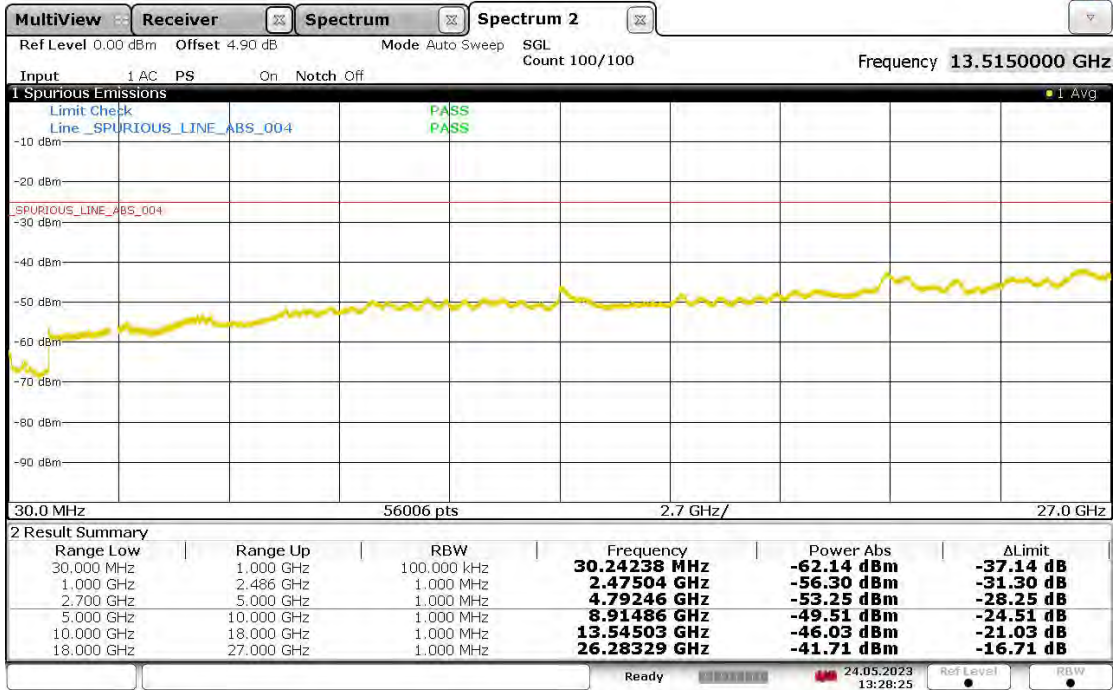

13:28:25 24.05.2023

41-41-5MHz-20MHz-64QAM-64QAM-39683-39800-100RB#0-100RB#0-1000~27000MHz

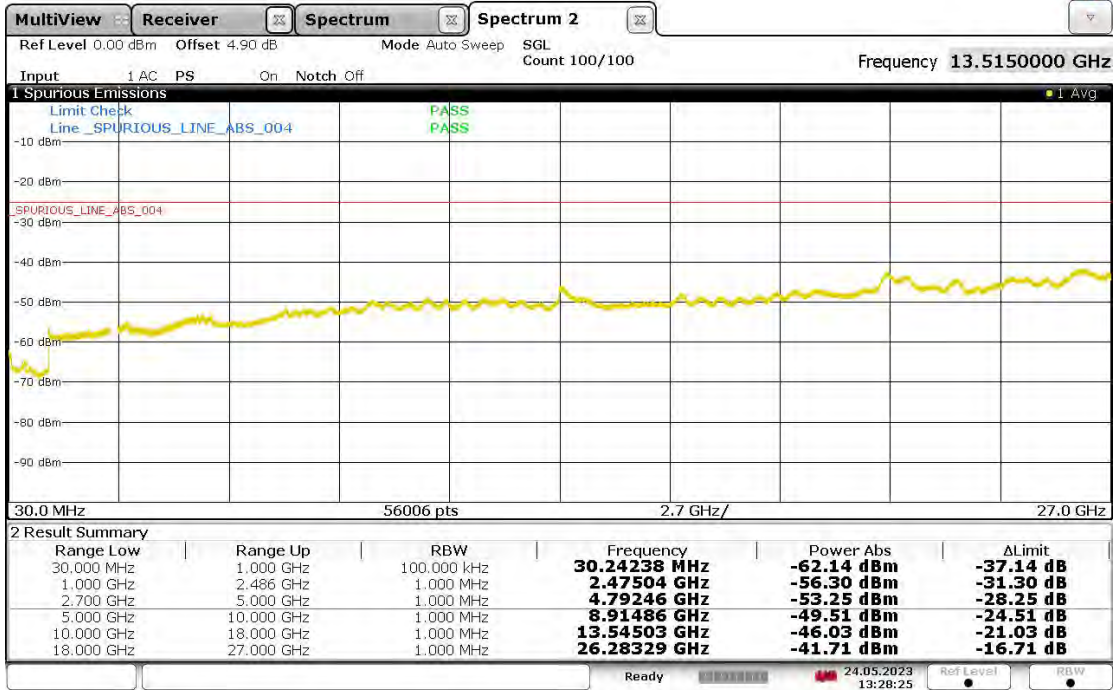


13:28:25 24.05.2023



BUREAU VERITAS


Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-64QAM-64QAM-40528-40645-100RB#0-100RB#0-30~1000MHz

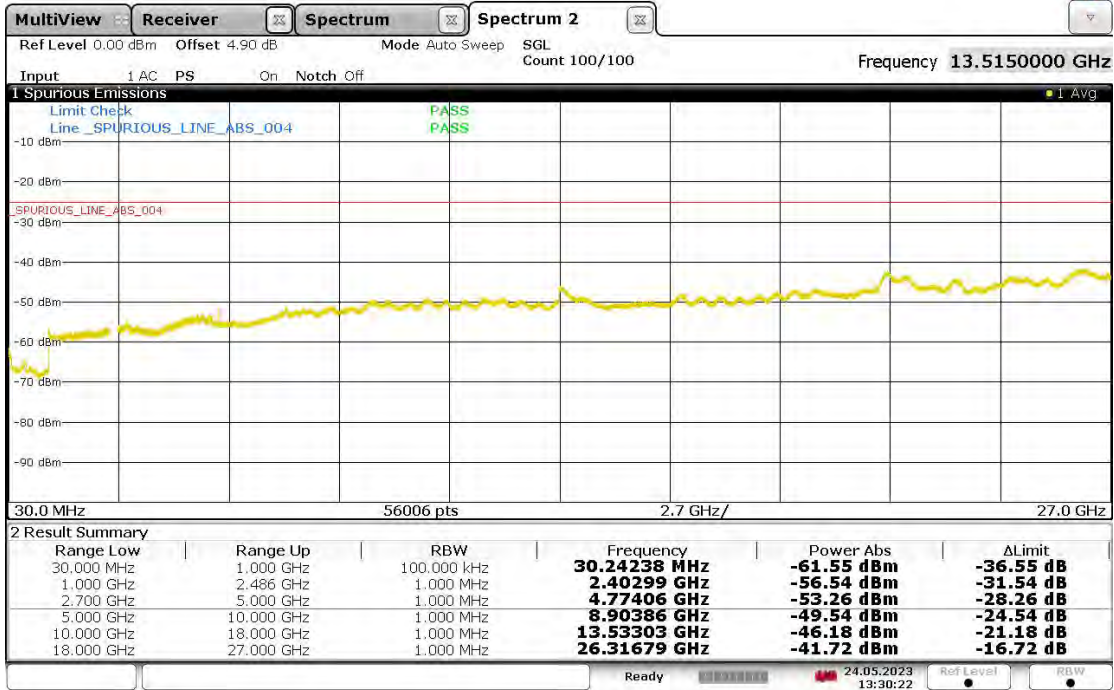

13:30:22 24.05.2023

41-41-5MHz-20MHz-64QAM-64QAM-40528-40645-100RB#0-100RB#0-1000~27000MHz

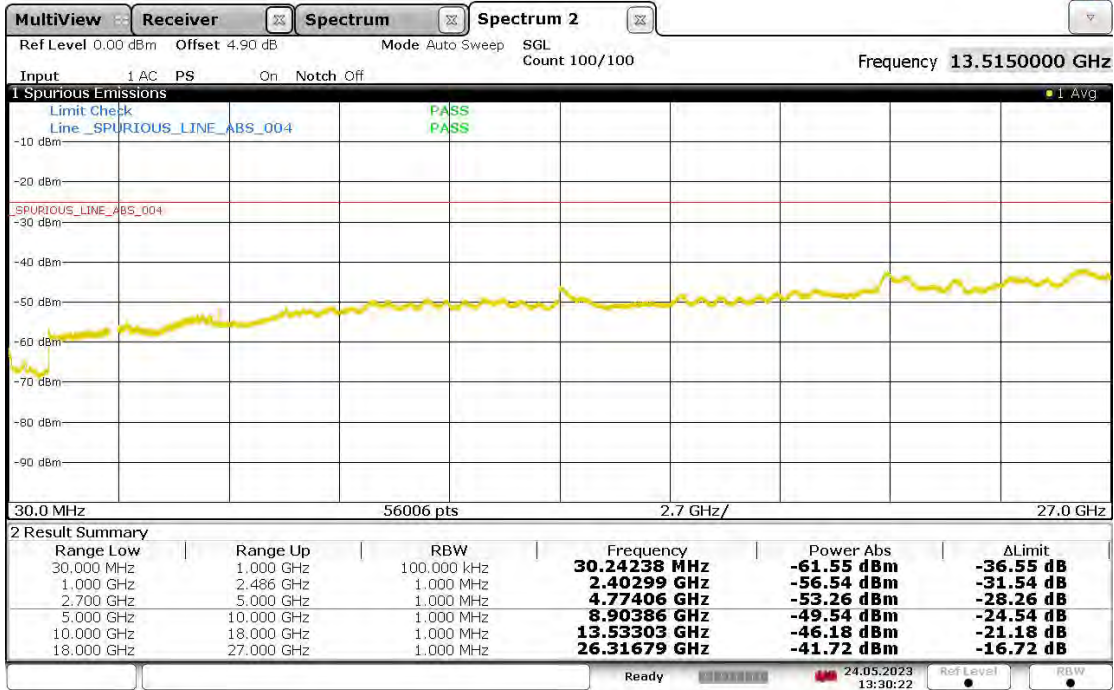


13:30:22 24.05.2023




Test Report No.: PSZ-NQN2303280110RF09

41-41-5MHz-20MHz-64QAM-64QAM-41373-41490-100RB#0-100RB#0-30~1000MHz

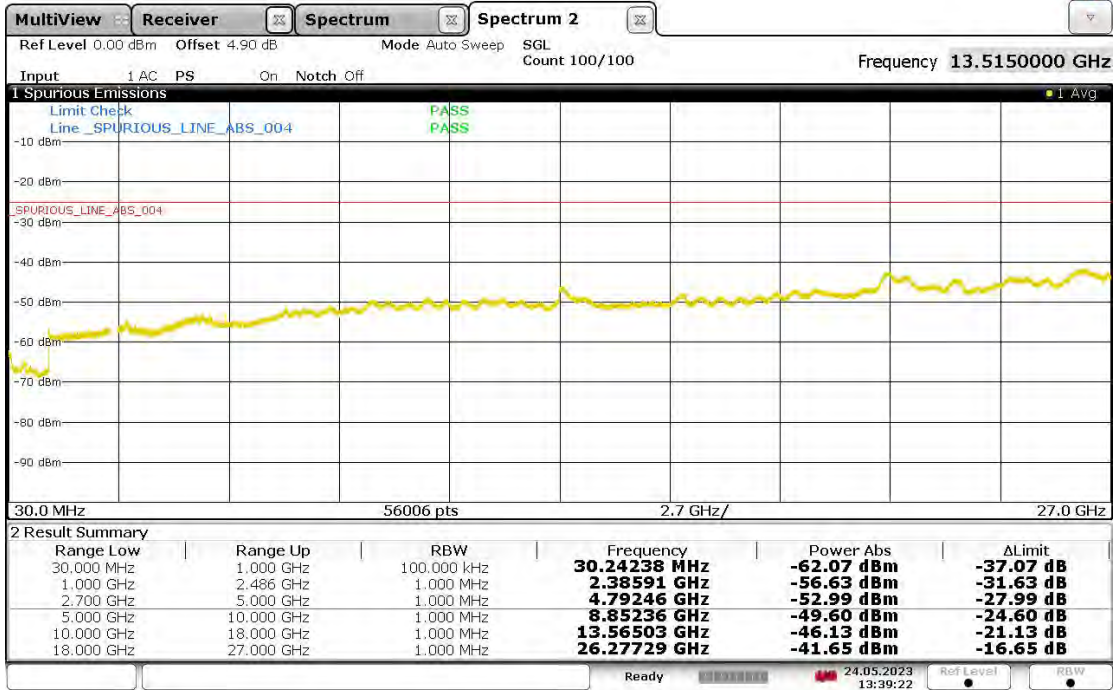

13:39:23 24.05.2023

41-41-5MHz-20MHz-64QAM-64QAM-41373-41490-100RB#0-100RB#0-1000~27000MHz

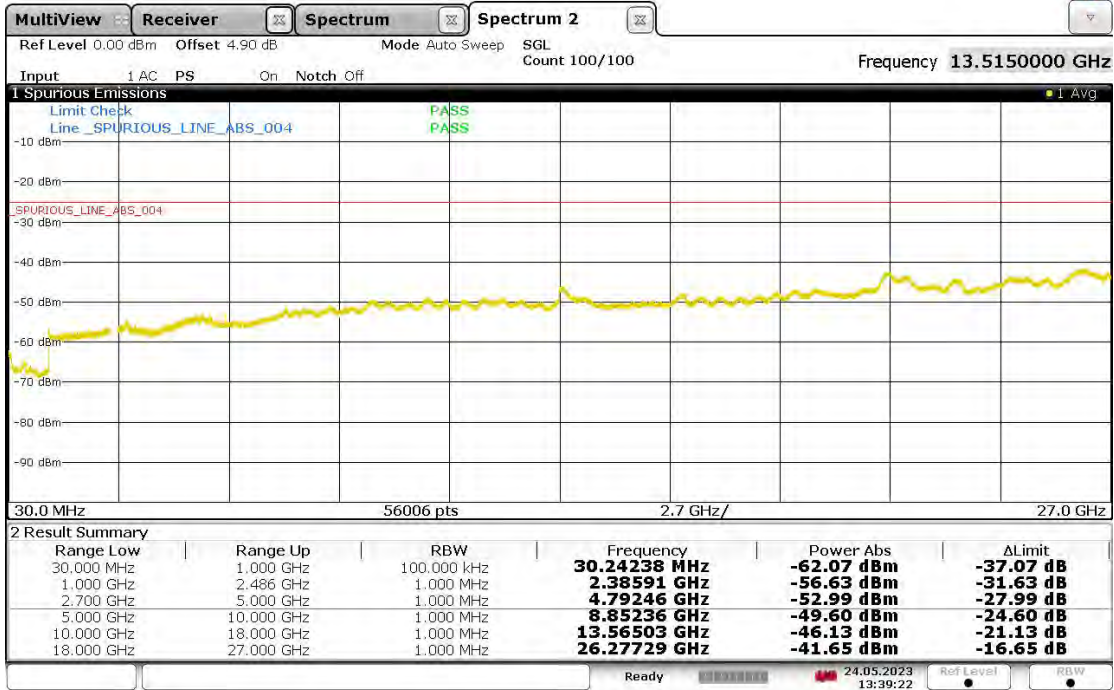

13:39:23 24.05.2023