






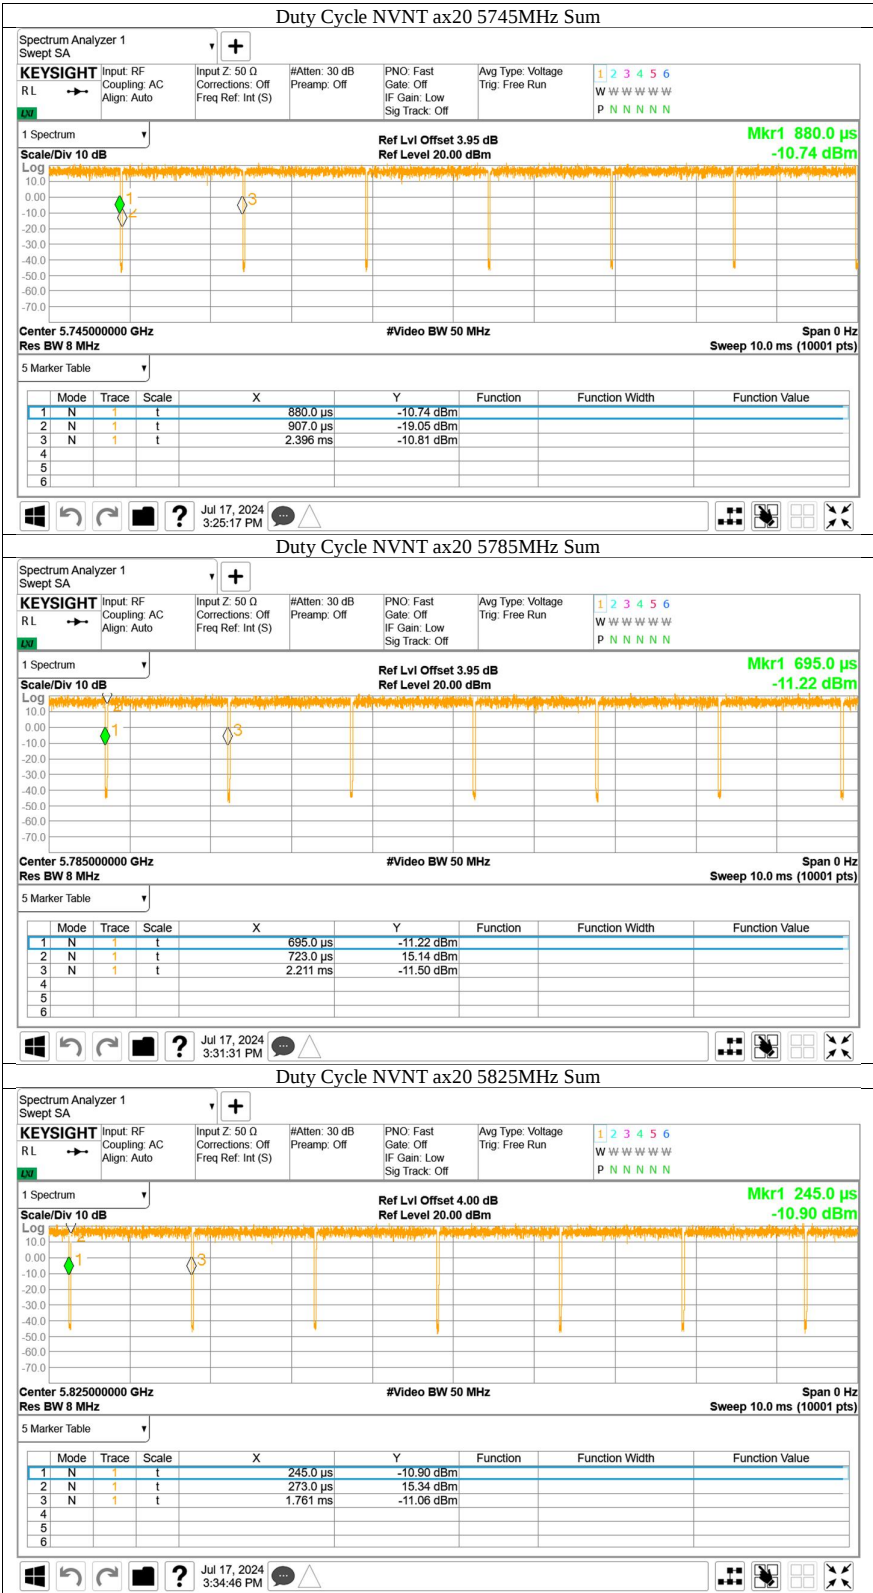


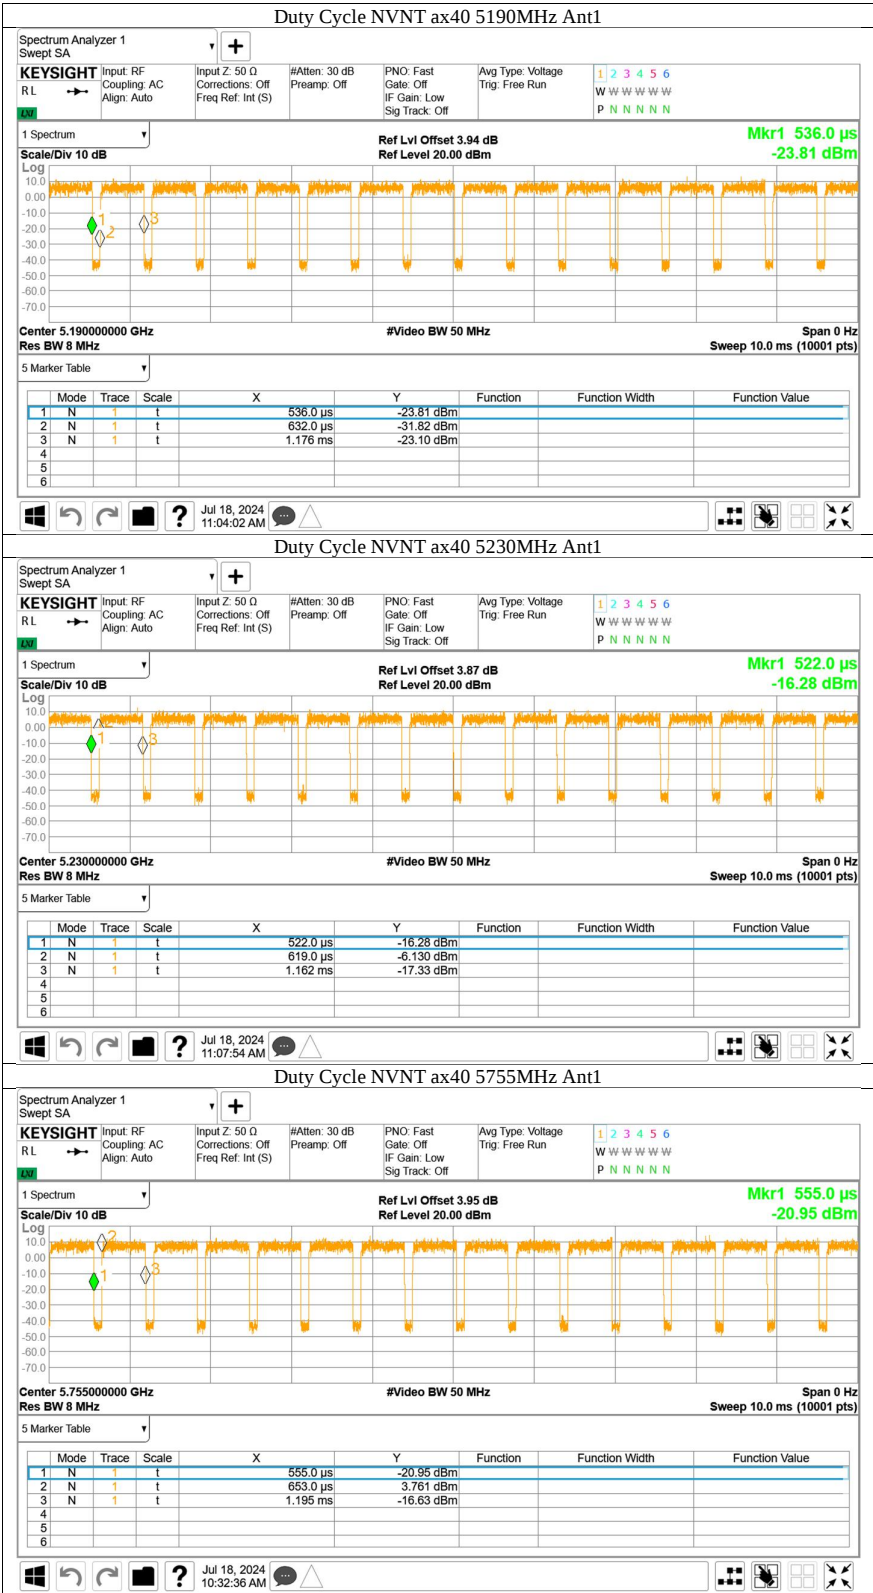


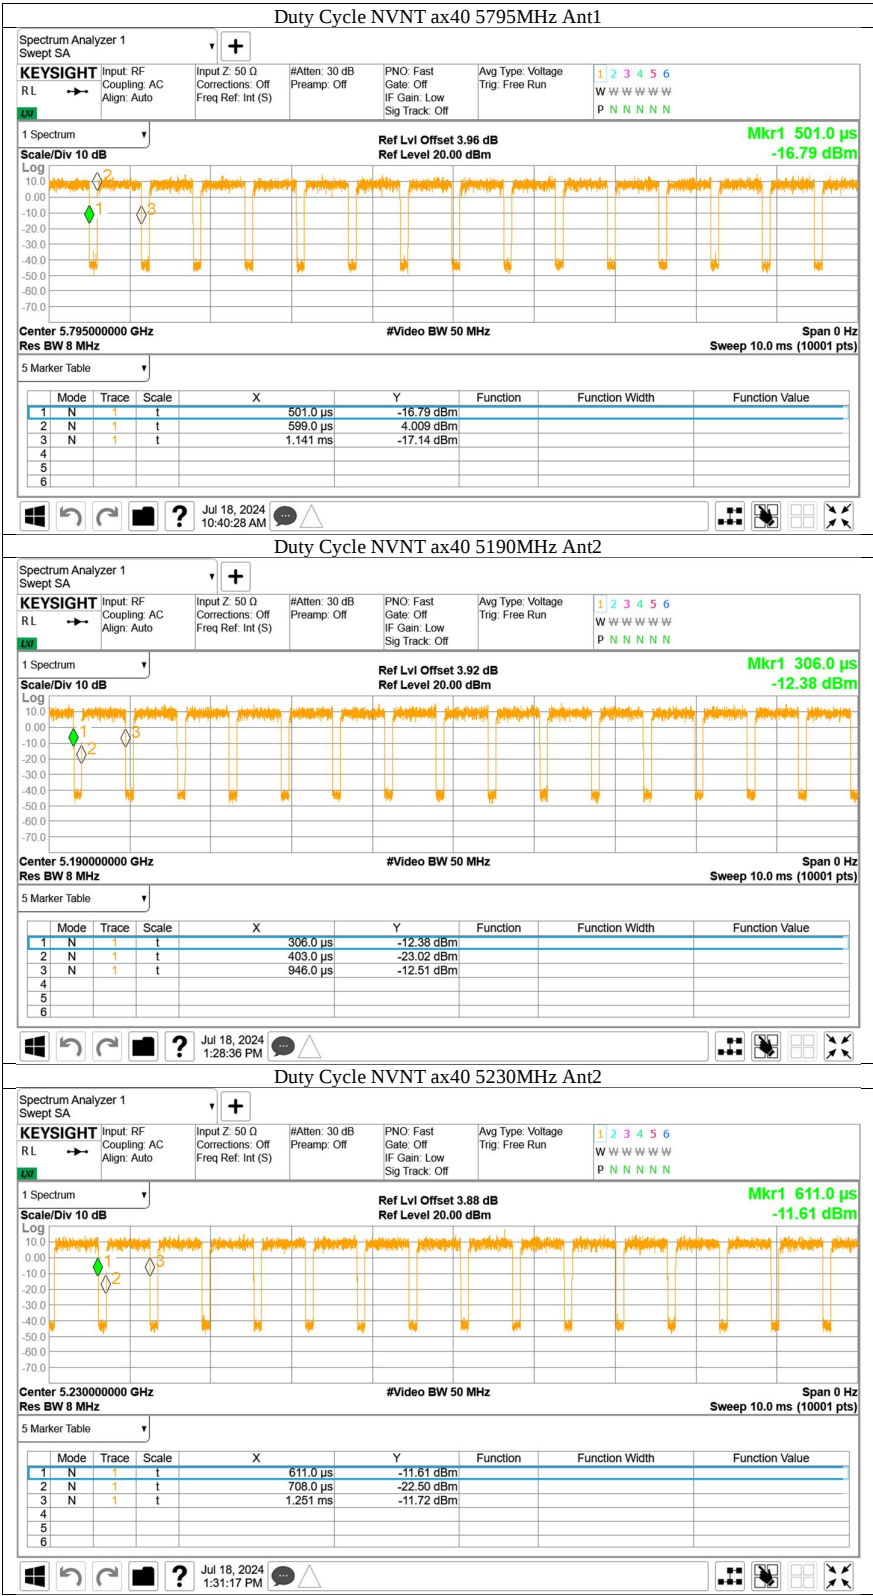

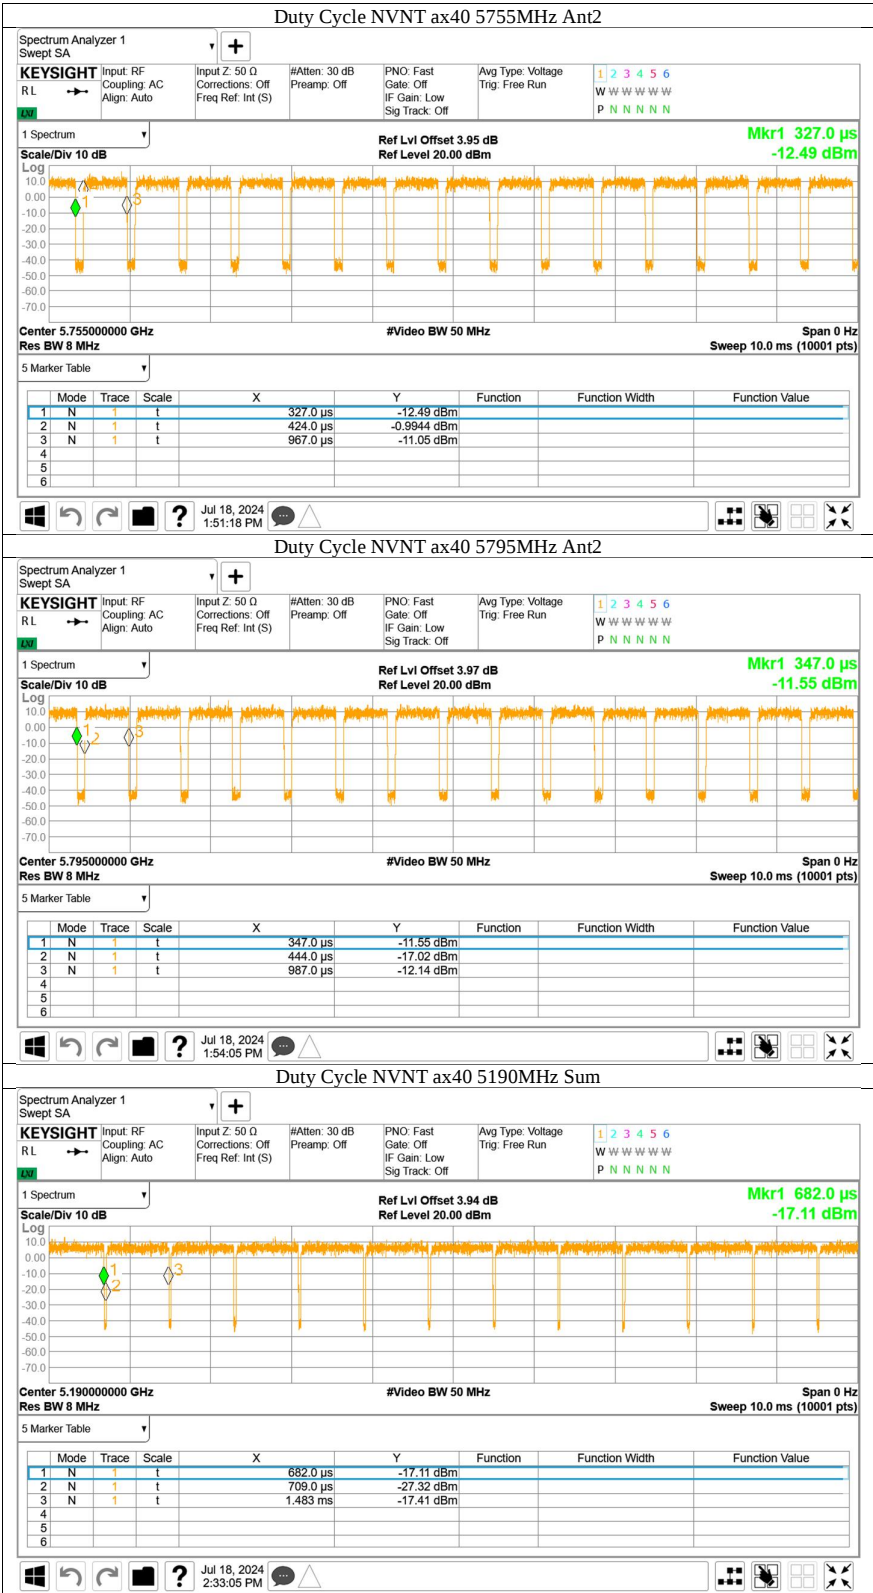

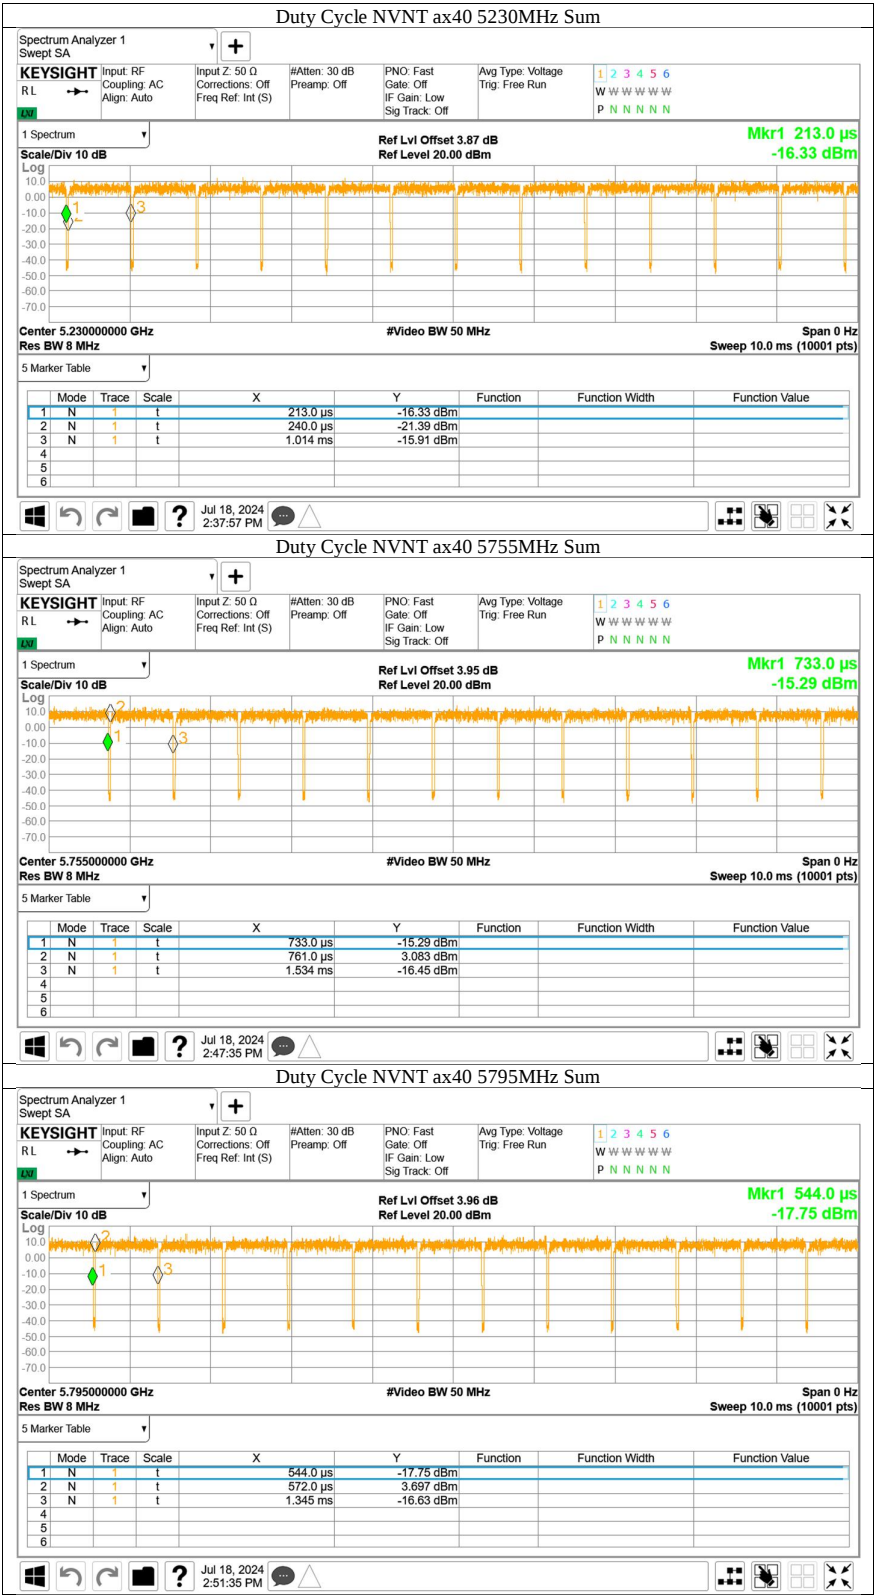

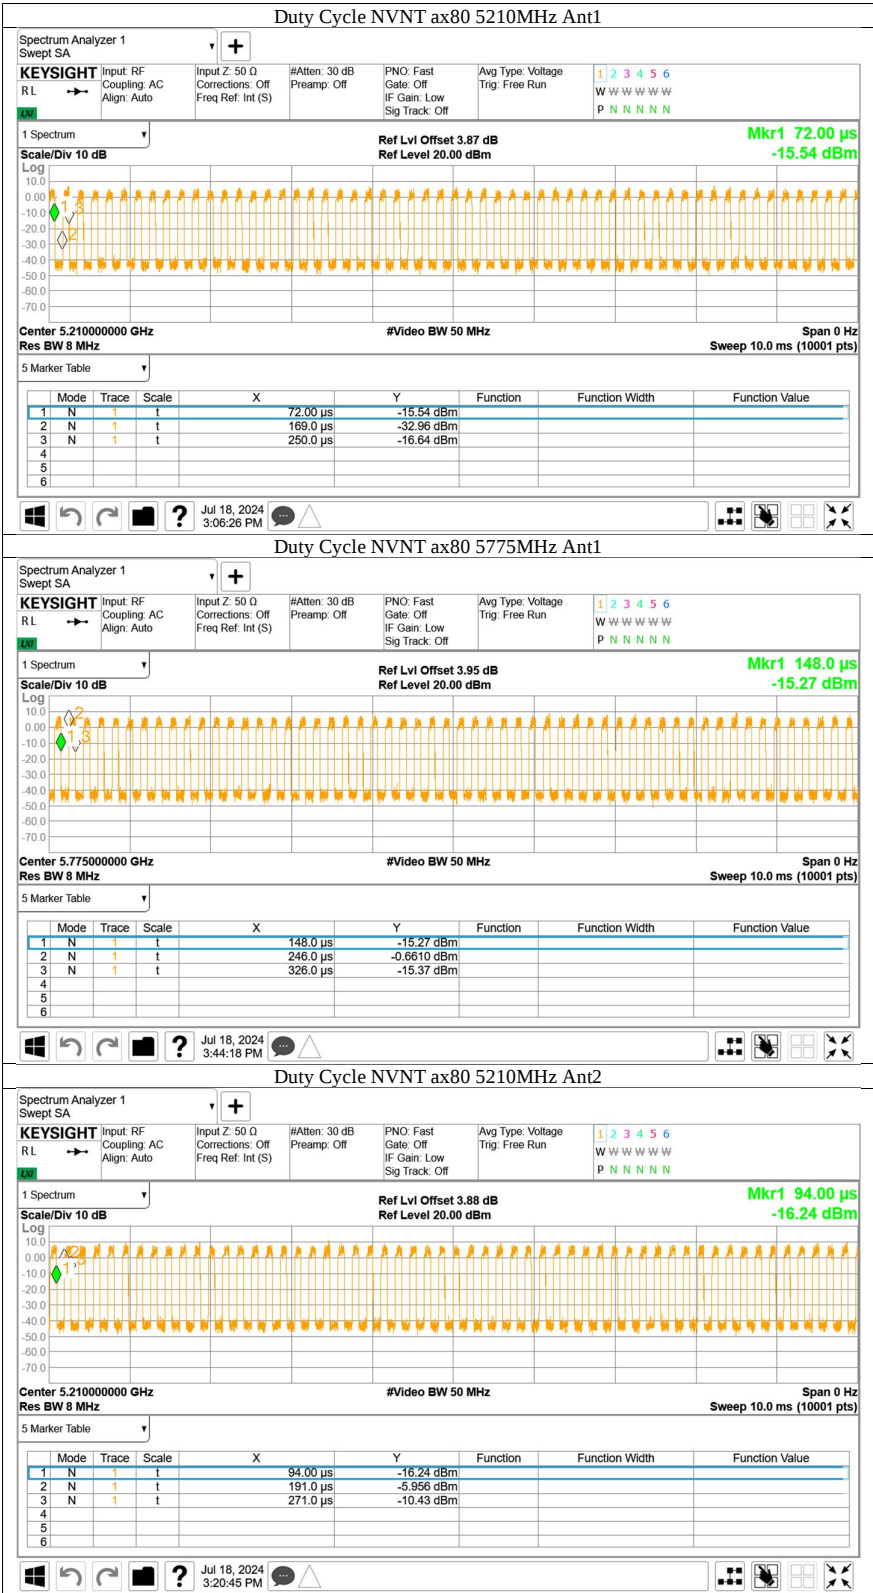

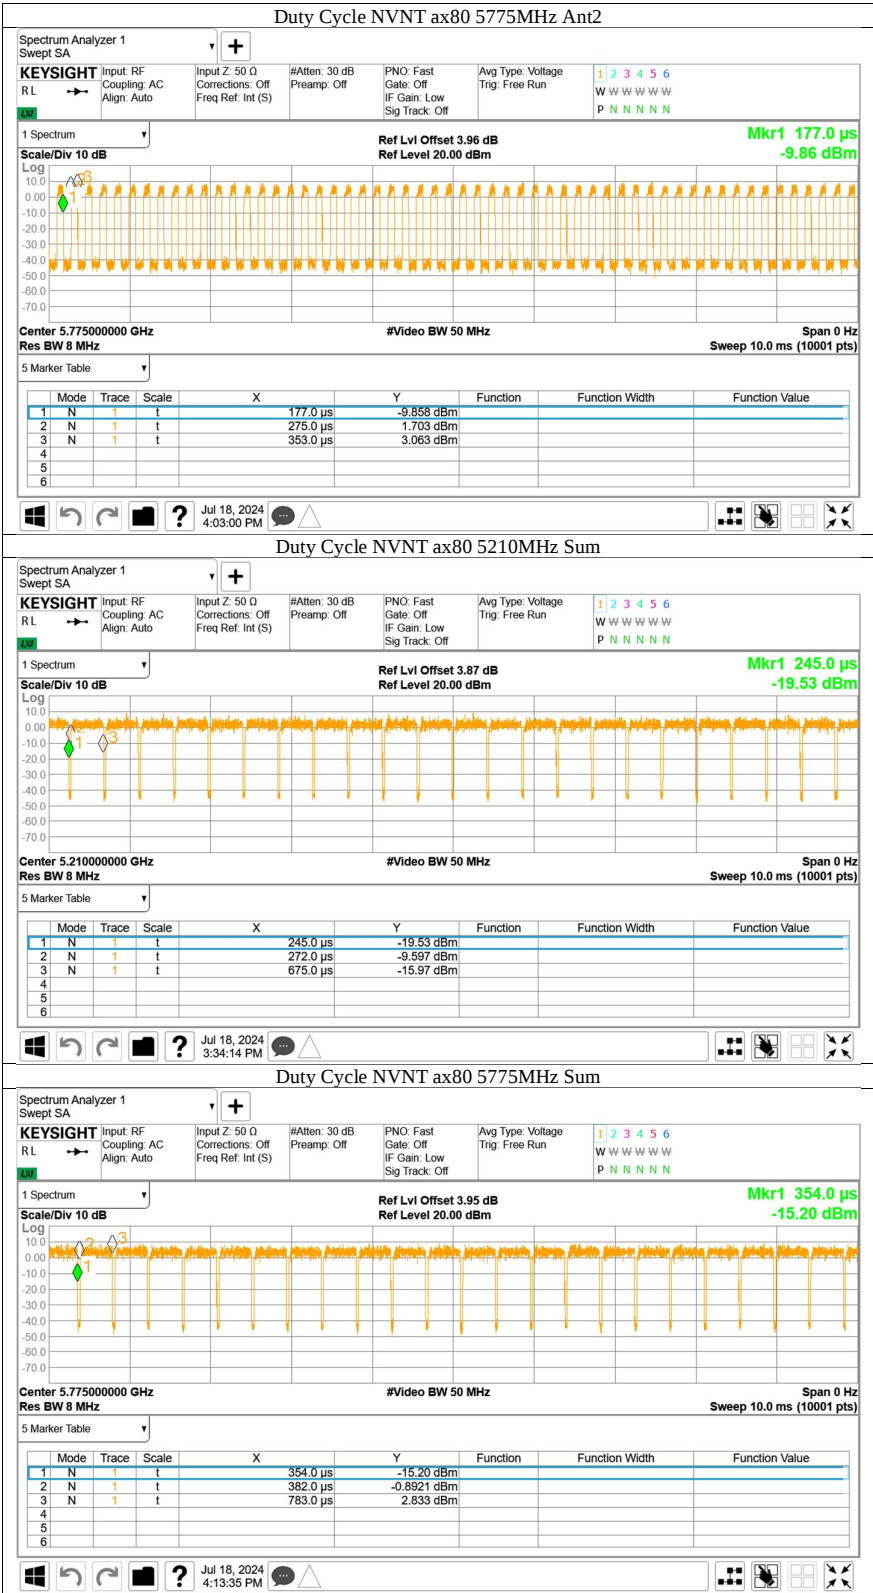

2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	FCC Limit (dBm)	IC Limit (dBm)	Gain (dBi)	E.I.R.P (dBm)	E.I.R.P Limit (dBm)	Verdict
NVNT	a	5180	Ant1	9.19	1.41	10.6	24	--	2.2	12.80	22.2	Pass
NVNT	a	5200	Ant1	11.64	1.42	13.06	24	--	2.2	15.26	22.2	Pass
NVNT	a	5240	Ant1	11.33	1.41	12.74	24	--	2.2	14.94	22.2	Pass
NVNT	a	5745	Ant1	12.88	1.42	14.3	30	30	2.2	16.5	--	Pass
NVNT	a	5785	Ant1	12.87	1.42	14.29	30	30	2.2	16.49	--	Pass
NVNT	a	5825	Ant1	13.13	1.42	14.55	30	30	2.2	16.75	--	Pass
NVNT	a	5180	Ant2	13.64	1.41	15.05	24	--	2.2	17.05	22.2	Pass
NVNT	a	5200	Ant2	14.4	1.41	15.81	24	--	2.2	18.01	22.2	Pass
NVNT	a	5240	Ant2	14.19	1.41	15.6	24	--	2.2	17.8	22.2	Pass
NVNT	a	5745	Ant2	13.87	1.41	15.28	30	30	2.2	17.48	--	Pass
NVNT	a	5785	Ant2	13.58	1.42	15	30	30	2.2	17.2	--	Pass
NVNT	a	5825	Ant2	13.84	1.39	15.23	30	30	2.2	17.43	--	Pass
NVNT	n20	5180	Ant1	9.57	2	11.57	24	--	2.2	13.77	22.2	Pass
NVNT	n20	5200	Ant1	8.78	1.98	10.76	24	--	2.2	12.96	22.2	Pass
NVNT	n20	5240	Ant1	10.84	2	12.84	24	--	2.2	15.04	22.2	Pass
NVNT	n20	5745	Ant1	12.67	1.41	14.08	30	30	2.2	16.28	--	Pass
NVNT	n20	5785	Ant1	12.95	1.42	14.37	30	30	2.2	16.57	--	Pass
NVNT	n20	5825	Ant1	13.18	1.41	14.59	30	30	2.2	16.79	--	Pass
NVNT	n20	5180	Ant2	8.78	1.98	10.76	24	--	2.2	17.7	22.2	Pass
NVNT	n20	5200	Ant2	12.99	2	14.99	24	--	2.2	17.75	22.2	Pass
NVNT	n20	5240	Ant2	13.52	2	15.52	24	--	2.2	17.72	22.2	Pass
NVNT	n20	5745	Ant2	13.17	2	15.17	30	30	2.2	17.37	--	Pass
NVNT	n20	5785	Ant2	13.22	2	15.22	30	30	2.2	17.42	--	Pass
NVNT	n20	5825	Ant2	13.39	2	15.39	30	30	2.2	17.59	--	Pass
NVNT	n20	5180	Ant1	10.64	0.31	10.95	24	--	2.2	13.15	22.2	Pass
NVNT	n20	5180	Ant2	14.31	0.31	14.62	24	--	2.2	16.82	22.2	Pass
NVNT	n20	5180	Sum	15.86	0.31	16.17	24	--	5.01	21.18	22.2	Pass
NVNT	n20	5200	Ant1	10.65	0.31	10.96	24	--	2.2	13.16	22.2	Pass
NVNT	n20	5200	Ant2	14.25	0.31	14.56	24	--	2.2	16.76	22.2	Pass
NVNT	n20	5200	Sum	15.82	0.31	16.13	24	--	5.01	21.14	22.2	Pass
NVNT	n20	5240	Ant1	11.5	0.31	11.81	24	--	2.2	14.01	22.2	Pass
NVNT	n20	5240	Ant2	14.07	0.31	14.38	24	--	2.2	16.58	22.2	Pass
NVNT	n20	5240	Sum	15.98	0.31	16.29	24	--	5.01	21.3	22.2	Pass
NVNT	n20	5745	Ant1	12.86	0.31	13.17	30	30	2.2	15.37	--	Pass
NVNT	n20	5745	Ant2	12.9	0.31	13.21	30	30	2.2	15.41	--	Pass
NVNT	n20	5745	Sum	15.89	0.31	16.2	30	30	5.01	21.21	--	Pass
NVNT	n20	5785	Ant1	12.9	0.31	13.21	30	30	2.2	15.41	--	Pass
NVNT	n20	5785	Ant2	14.51	0.31	14.82	30	30	2.2	17.02	--	Pass
NVNT	n20	5785	Sum	16.79	0.31	17.1	30	30	5.01	22.11	--	Pass
NVNT	n20	5825	Ant1	12.68	0.31	12.99	30	30	2.2	15.19	--	Pass
NVNT	n20	5825	Ant2	13.7	0.31	14.01	30	30	2.2	16.21	--	Pass
NVNT	n20	5825	Sum	16.23	0.31	16.54	30	30	5.01	21.55	--	Pass
NVNT	n40	5190	Ant1	4.36	2.9	7.26	24	--	2.2	9.46	23	Pass
NVNT	n40	5230	Ant1	4.1	2.9	7	24	--	2.2	9.2	23	Pass
NVNT	n40	5755	Ant1	5.95	2.9	8.85	30	30	2.2	11.05	--	Pass
NVNT	n40	5795	Ant1	6.58	2.95	9.53	30	30	2.2	11.73	--	Pass
NVNT	n40	5190	Ant2	8.26	2.95	11.21	24	--	2.2	13.41	23	Pass
NVNT	n40	5230	Ant2	7.91	2.9	10.81	24	--	2.2	13.01	23	Pass
NVNT	n40	5755	Ant2	8.12	2.9	11.02	30	30	2.2	13.22	--	Pass
NVNT	n40	5795	Ant2	8.38	2.9	11.28	30	30	2.2	13.48	--	Pass
NVNT	n40	5190	Ant1	7.09	1.06	8.15	24	--	2.2	10.35	23	Pass
NVNT	n40	5190	Ant2	10.12	1.06	11.18	24	--	2.2	13.38	23	Pass
NVNT	n40	5190	Sum	11.87	1.06	12.93	24	--	5.01	17.94	23	Pass
NVNT	n40	5230	Ant1	6.57	1.06	7.63	24	--	2.2	9.83	23	Pass
NVNT	n40	5230	Ant2	9.97	1.06	11.03	24	--	2.2	13.23	23	Pass
NVNT	n40	5230	Sum	11.6	1.06	12.66	24	--	5.01	17.67	23	Pass
NVNT	n40	5755	Ant1	8.31	1.06	9.37	30	30	2.2	11.57	--	Pass
NVNT	n40	5755	Ant2	10.07	1.06	11.13	30	30	2.2	13.33	--	Pass
NVNT	n40	5755	Sum	12.29	1.06	13.35	30	30	5.01	18.36	--	Pass
NVNT	n40	5795	Ant1	8.54	1.07	9.61	30	30	2.2	11.81	--	Pass
NVNT	n40	5795	Ant2	10.05	1.07	11.12	30	30	2.2	13.32	--	Pass
NVNT	n40	5795	Sum	12.37	1.07	13.44	30	30	5.01	18.45	--	Pass
NVNT	ac20	5180	Ant1	12.67	0	12.67	24	--	2.2	14.87	23	Pass



NVNT	ac20	5200	Ant1	12.98	0	12.98	24	--	2.2	15.18	23	Pass
NVNT	ac20	5240	Ant1	12.59	0	12.59	24	--	2.2	14.79	23	Pass
NVNT	ac20	5745	Ant1	14.12	0	14.12	30	30	2.2	16.32	--	Pass
NVNT	ac20	5785	Ant1	14.13	0	14.13	30	30	2.2	16.33	--	Pass
NVNT	ac20	5825	Ant1	14.27	0	14.27	30	30	2.2	16.47	--	Pass
NVNT	ac20	5180	Ant2	15.31	0.31	15.62	24	--	2.2	17.82	23	Pass
NVNT	ac20	5200	Ant2	15.54	0.31	15.85	24	--	2.2	18.05	23	Pass
NVNT	ac20	5240	Ant2	15.41	0.31	15.72	24	--	2.2	17.92	23	Pass
NVNT	ac20	5745	Ant2	15.04	0.31	15.35	30	30	2.2	17.55	--	Pass
NVNT	ac20	5785	Ant2	15	0.31	15.31	30	30	2.2	17.51	--	Pass
NVNT	ac20	5825	Ant2	15.4	0.31	15.71	30	30	2.2	17.91	--	Pass
NVNT	ac20	5180	Ant1	12.05	0	12.05	24	--	2.2	14.25	22.3	Pass
NVNT	ac20	5180	Ant2	15.43	0	15.43	24	--	2.2	17.63	22.3	Pass
NVNT	ac20	5180	Sum	17.07	0	17.07	24	--	5.01	22.08	22.3	Pass
NVNT	ac20	5200	Ant1	12.61	0	12.61	24	--	2.2	14.81	22.3	Pass
NVNT	ac20	5200	Ant2	15.37	0	15.37	24	--	2.2	17.57	22.3	Pass
NVNT	ac20	5200	Sum	17.22	0	17.22	24	--	5.01	22.23	22.3	Pass
NVNT	ac20	5240	Ant1	11.73	0	11.73	24	--	2.2	13.93	22.3	Pass
NVNT	ac20	5240	Ant2	14.27	0	14.27	24	--	2.2	16.47	22.3	Pass
NVNT	ac20	5240	Sum	16.19	0	16.19	24	--	5.01	21.2	22.3	Pass
NVNT	ac20	5745	Ant1	13.02	0	13.02	30	30	2.2	15.22	--	Pass
NVNT	ac20	5745	Ant2	14.44	0	14.44	30	30	2.2	16.64	--	Pass
NVNT	ac20	5745	Sum	16.8	0	16.8	30	30	5.01	21.81	--	Pass
NVNT	ac20	5785	Ant1	13.4	0	13.4	30	30	2.2	15.6	--	Pass
NVNT	ac20	5785	Ant2	14.01	0	14.01	30	30	2.2	16.21	--	Pass
NVNT	ac20	5785	Sum	16.73	0	16.73	30	30	5.01	21.74	--	Pass
NVNT	ac20	5825	Ant1	11.64	0	11.64	30	30	2.2	13.84	--	Pass
NVNT	ac20	5825	Ant2	13.71	0	13.71	30	30	2.2	15.91	--	Pass
NVNT	ac20	5825	Sum	15.81	0	15.81	30	30	5.01	20.82	--	Pass
NVNT	ac40	5190	Ant1	8.15	0	8.15	24	--	2.2	10.35	23	Pass
NVNT	ac40	5230	Ant1	7.59	0	7.59	24	--	2.2	9.79	23	Pass
NVNT	ac40	5755	Ant1	9.37	0	9.37	30	30	2.2	11.57	--	Pass
NVNT	ac40	5795	Ant1	9.05	0	9.05	30	30	2.2	11.25	--	Pass
NVNT	ac40	5190	Ant2	10.99	0	10.99	24	--	2.2	13.19	23	Pass
NVNT	ac40	5230	Ant2	10.87	0	10.87	24	--	2.2	13.07	23	Pass
NVNT	ac40	5755	Ant2	11.26	0	11.26	30	30	2.2	13.46	--	Pass
NVNT	ac40	5795	Ant2	11.18	0	11.18	30	30	2.2	13.38	--	Pass
NVNT	ac40	5190	Ant1	8.21	0	8.21	24	--	2.2	10.41	23	Pass
NVNT	ac40	5190	Ant2	11.44	0	11.44	24	--	2.2	13.64	23	Pass
NVNT	ac40	5190	Sum	13.13	0	13.13	24	--	5.01	18.14	23	Pass
NVNT	ac40	5230	Ant1	7.61	0	7.61	24	--	2.2	9.81	23	Pass
NVNT	ac40	5230	Ant2	10.98	0	10.98	24	--	2.2	13.18	23	Pass
NVNT	ac40	5230	Sum	12.62	0	12.62	24	--	5.01	17.63	23	Pass
NVNT	ac40	5755	Ant1	9.69	0	9.69	30	30	2.2	11.89	--	Pass
NVNT	ac40	5755	Ant2	11.27	0	11.27	30	30	2.2	13.47	--	Pass
NVNT	ac40	5755	Sum	13.56	0	13.56	30	30	5.01	18.57	--	Pass
NVNT	ac40	5795	Ant1	9.68	0	9.68	30	30	2.2	11.88	--	Pass
NVNT	ac40	5795	Ant2	11.23	0	11.23	30	30	2.2	13.43	--	Pass
NVNT	ac40	5795	Sum	13.53	0	13.53	30	30	5.01	18.54	--	Pass
NVNT	ac80	5210	Ant1	3.18	3.69	6.87	24	--	2.2	9.07	23	Pass
NVNT	ac80	5775	Ant1	5.11	3.73	8.84	30	30	2.2	11.04	--	Pass
NVNT	ac80	5210	Ant2	6.65	3.66	10.31	24	--	2.2	12.51	23	Pass
NVNT	ac80	5775	Ant2	6.41	3.75	10.16	30	30	2.2	12.36	--	Pass
NVNT	ac80	5210	Ant1	7.19	0	7.19	24	--	2.2	9.39	23	Pass
NVNT	ac80	5210	Ant2	10.4	0	10.4	24	--	2.2	12.6	23	Pass
NVNT	ac80	5210	Sum	12.1	0	12.1	24	--	5.01	17.11	23	Pass
NVNT	ac80	5775	Ant1	9.02	0	9.02	30	30	2.2	11.22	--	Pass
NVNT	ac80	5775	Ant2	10.28	0	10.28	30	30	2.2	12.48	--	Pass
NVNT	ac80	5775	Sum	12.71	0	12.71	30	30	5.01	17.72	--	Pass
NVNT	ax20	5180	Ant1	12.5	0.39	12.89	24	--	2.2	15.09	22.2	Pass
NVNT	ax20	5200	Ant1	12.78	0.39	13.17	24	--	2.2	15.37	22.2	Pass
NVNT	ax20	5240	Ant1	12.46	0.39	12.85	24	--	2.2	15.05	22.2	Pass
NVNT	ax20	5745	Ant1	14.05	0	14.05	30	30	2.2	16.25	--	Pass
NVNT	ax20	5785	Ant1	14.15	0	14.15	30	30	2.2	16.35	--	Pass
NVNT	ax20	5825	Ant1	14.08	0	14.08	30	30	2.2	16.28	--	Pass
NVNT	ax20	5180	Ant2	14.91	0.39	15.3	24	--	2.2	17.5	22.2	Pass
NVNT	ax20	5200	Ant2	15.18	0.39	15.57	24	--	2.2	17.77	22.2	Pass
NVNT	ax20	5240	Ant2	14.63	0.39	15.02	24	--	2.2	17.22	22.2	Pass
NVNT	ax20	5745	Ant2	14.74	0.39	15.13	30	30	2.2	17.33	--	Pass



NVNT	ax20	5785	Ant2	14.62	0.39	15.01	30	30	2.2	17.21	--	Pass
NVNT	ax20	5825	Ant2	14.57	0.39	14.96	30	30	2.2	17.16	--	Pass
NVNT	ax20	5180	Ant1	11.33	0	11.33	24	--	2.2	13.53	22.2	Pass
NVNT	ax20	5180	Ant2	14.81	0	14.81	24	--	2.2	17.01	22.2	Pass
NVNT	ax20	5180	Sum	16.42	0	16.42	24	--	5.01	21.43	22.2	Pass
NVNT	ax20	5200	Ant1	12.1	0	12.1	24	--	2.2	14.3	22.2	Pass
NVNT	ax20	5200	Ant2	14.46	0	14.46	24	--	2.2	16.66	22.2	Pass
NVNT	ax20	5200	Sum	16.45	0	16.45	24	--	5.01	21.46	22.2	Pass
NVNT	ax20	5240	Ant1	11.82	0	11.82	24	--	2.2	14.02	22.2	Pass
NVNT	ax20	5240	Ant2	12.88	0	12.88	24	--	2.2	15.08	22.2	Pass
NVNT	ax20	5240	Sum	15.39	0	15.39	24	--	5.01	20.4	22.2	Pass
NVNT	ax20	5745	Ant1	13.88	0	13.88	30	30	2.2	16.08	--	Pass
NVNT	ax20	5745	Ant2	11.41	0	11.41	30	30	2.2	13.61	--	Pass
NVNT	ax20	5745	Sum	15.83	0	15.83	30	30	5.01	20.84	--	Pass
NVNT	ax20	5785	Ant1	13.83	0	13.83	30	30	2.2	16.03	--	Pass
NVNT	ax20	5785	Ant2	14.48	0	14.48	30	30	2.2	16.68	--	Pass
NVNT	ax20	5785	Sum	17.18	0	17.18	30	30	5.01	22.19	--	Pass
NVNT	ax20	5825	Ant1	12.27	0	12.27	30	30	2.2	14.47	--	Pass
NVNT	ax20	5825	Ant2	13.57	0	13.57	30	30	2.2	15.77	--	Pass
NVNT	ax20	5825	Sum	15.98	0	15.98	30	30	5.01	20.99	--	Pass
NVNT	ax40	5190	Ant1	7.46	0.71	8.17	24	--	2.2	10.37	23	Pass
NVNT	ax40	5230	Ant1	6.88	0.71	7.59	24	--	2.2	9.79	23	Pass
NVNT	ax40	5755	Ant1	8.97	0.72	9.69	30	30	2.2	11.89	--	Pass
NVNT	ax40	5795	Ant1	9.12	0.72	9.84	30	30	2.2	12.04	--	Pass
NVNT	ax40	5190	Ant2	10.31	0.71	11.02	24	--	2.2	13.22	23	Pass
NVNT	ax40	5230	Ant2	10.19	0.71	10.9	24	--	2.2	13.1	23	Pass
NVNT	ax40	5755	Ant2	10.61	0.71	11.32	30	30	2.2	13.52	--	Pass
NVNT	ax40	5795	Ant2	10.43	0.71	11.14	30	30	2.2	13.34	--	Pass
NVNT	ax40	5190	Ant1	8.26	0.15	8.41	24	--	2.2	10.61	23	Pass
NVNT	ax40	5190	Ant2	11.16	0.15	11.31	24	--	2.2	13.51	23	Pass
NVNT	ax40	5190	Sum	12.96	0.15	13.11	24	--	5.01	18.12	23	Pass
NVNT	ax40	5230	Ant1	7.59	0.15	7.74	24	--	2.2	9.94	23	Pass
NVNT	ax40	5230	Ant2	10.87	0.15	11.02	24	--	2.2	13.22	23	Pass
NVNT	ax40	5230	Sum	12.54	0.15	12.69	24	--	5.01	17.7	23	Pass
NVNT	ax40	5755	Ant1	9.77	0.15	9.92	30	30	2.2	12.12	--	Pass
NVNT	ax40	5755	Ant2	11.25	0.15	11.4	30	30	2.2	13.6	--	Pass
NVNT	ax40	5755	Sum	13.58	0.15	13.73	30	30	5.01	18.74	--	Pass
NVNT	ax40	5795	Ant1	9.82	0.15	9.97	30	30	2.2	12.17	--	Pass
NVNT	ax40	5795	Ant2	11.12	0.15	11.27	30	30	2.2	13.47	--	Pass
NVNT	ax40	5795	Sum	13.53	0.15	13.68	30	30	5.01	18.69	--	Pass
NVNT	ax80	5210	Ant1	3.53	3.42	6.95	24	--	2.2	9.15	23	Pass
NVNT	ax80	5775	Ant1	5.47	3.47	8.94	30	30	2.2	11.14	--	Pass
NVNT	ax80	5210	Ant2	6.69	3.45	10.14	24	--	2.2	12.34	23	Pass
NVNT	ax80	5775	Ant2	6.79	3.53	10.32	30	30	2.2	12.52	--	Pass
NVNT	ax80	5210	Ant1	7.09	0.28	7.37	24	--	2.2	9.57	23	Pass
NVNT	ax80	5210	Ant2	10.49	0.28	10.77	24	--	2.2	12.97	23	Pass
NVNT	ax80	5210	Sum	12.12	0.28	12.4	24	--	5.01	17.41	23	Pass
NVNT	ax80	5775	Ant1	8.88	0.29	9.17	30	30	2.2	11.37	--	Pass
NVNT	ax80	5775	Ant2	10.22	0.29	10.51	30	30	2.2	12.71	--	Pass
NVNT	ax80	5775	Sum	12.61	0.29	12.9	30	30	5.01	17.91	--	Pass

