






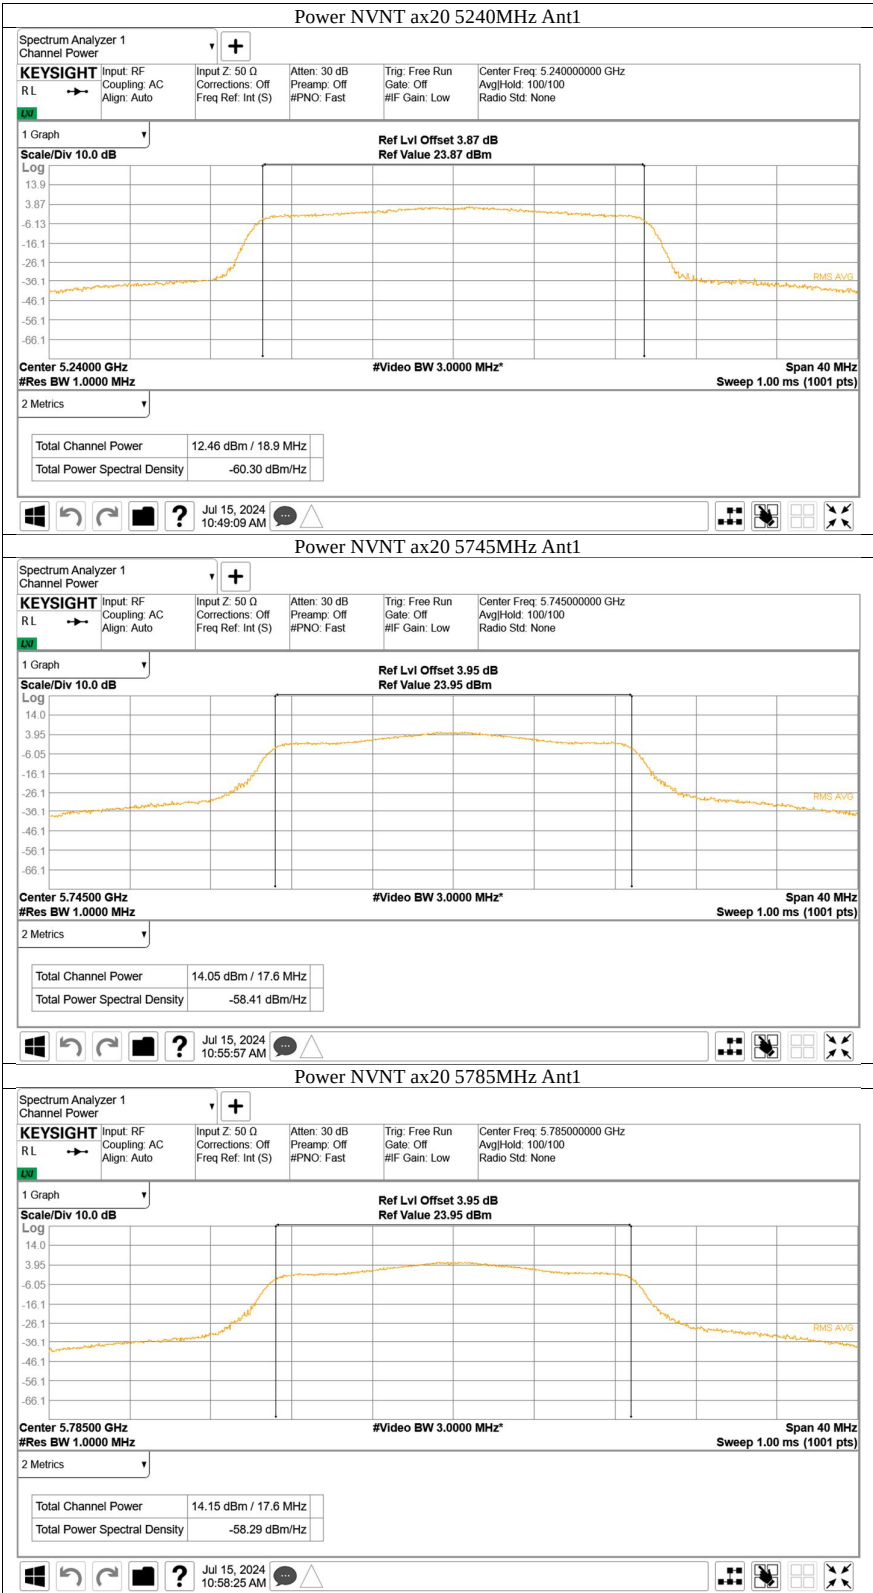


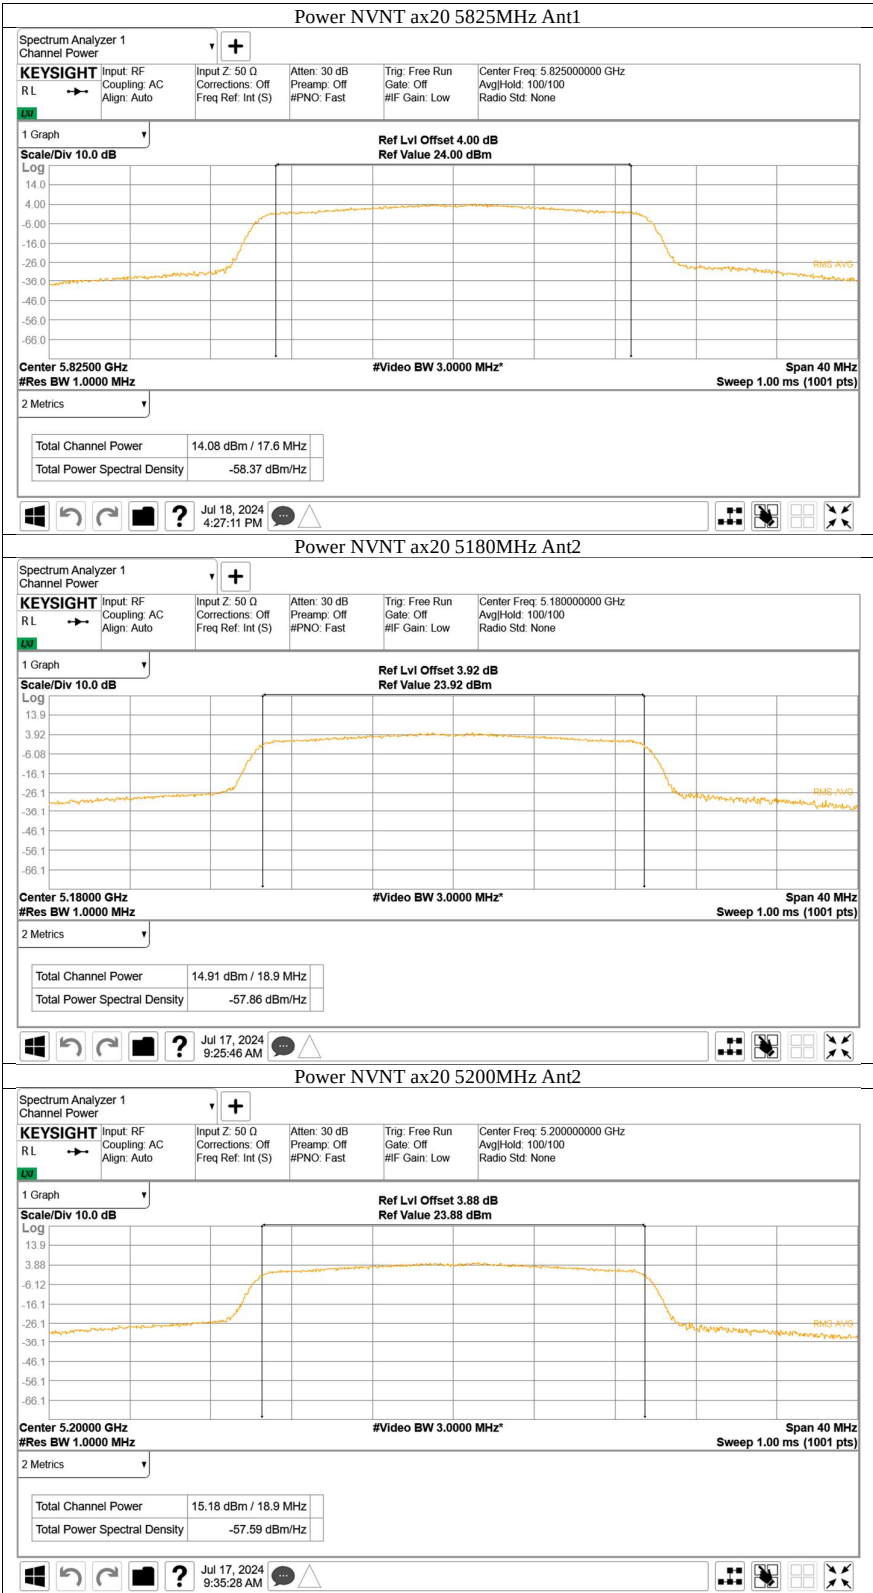


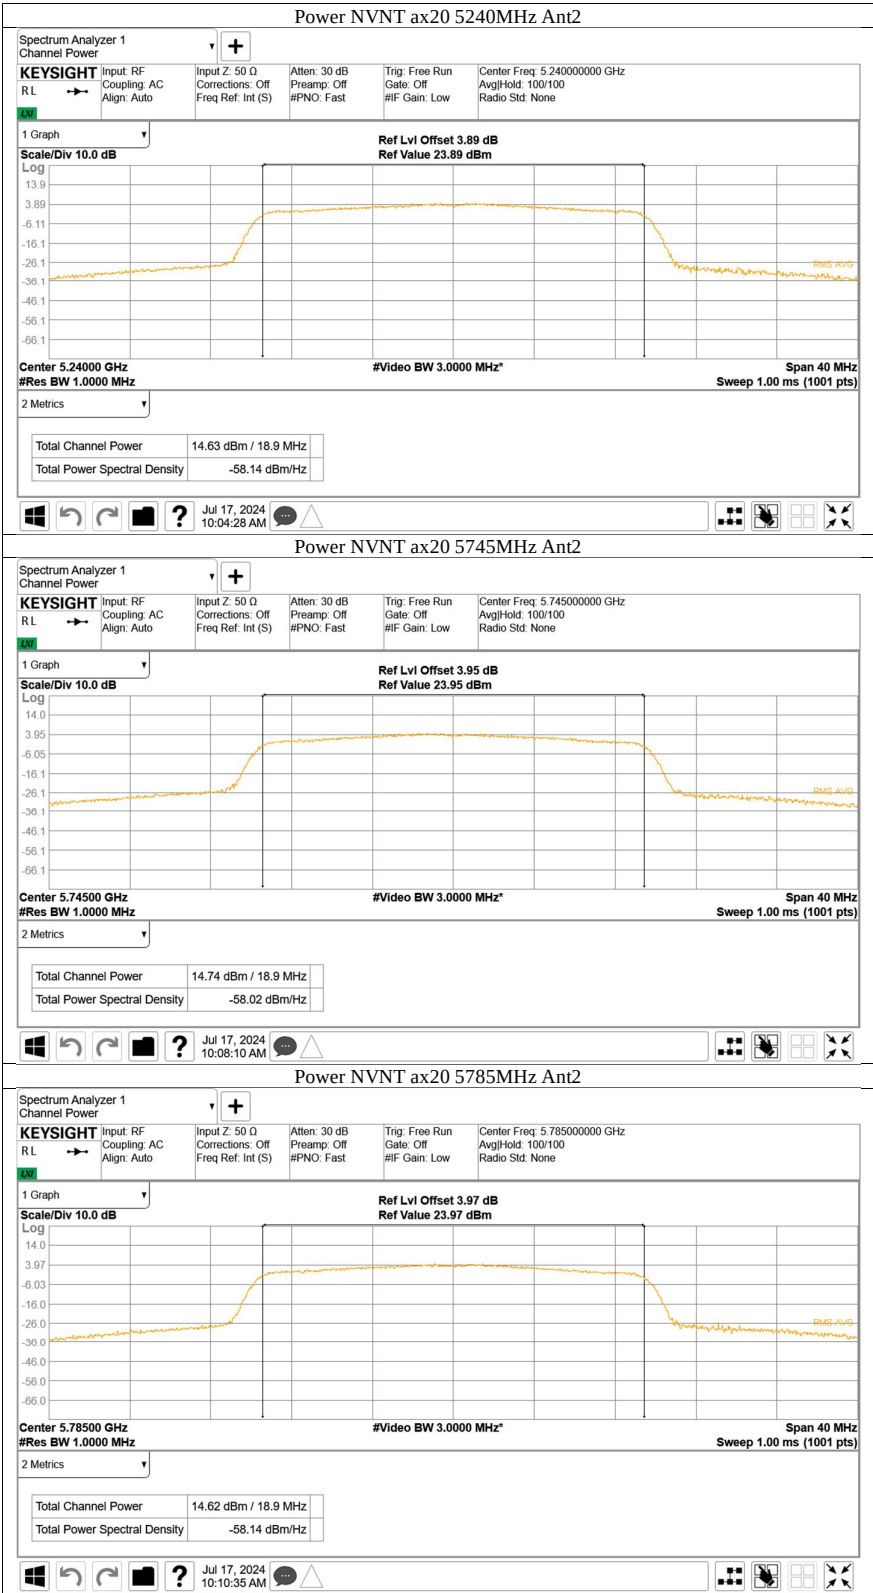

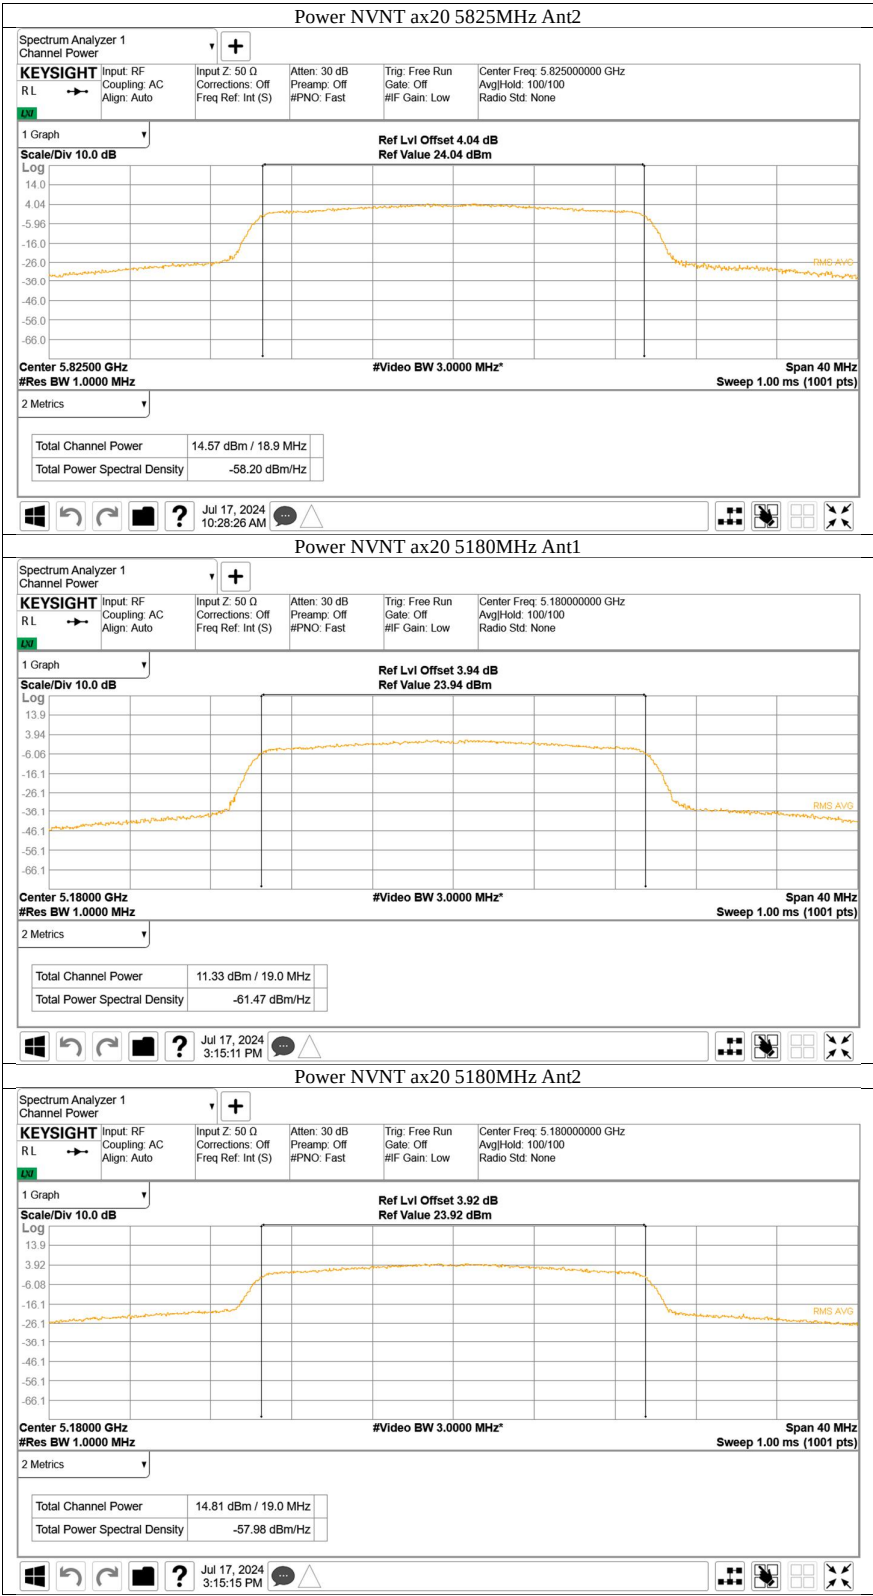


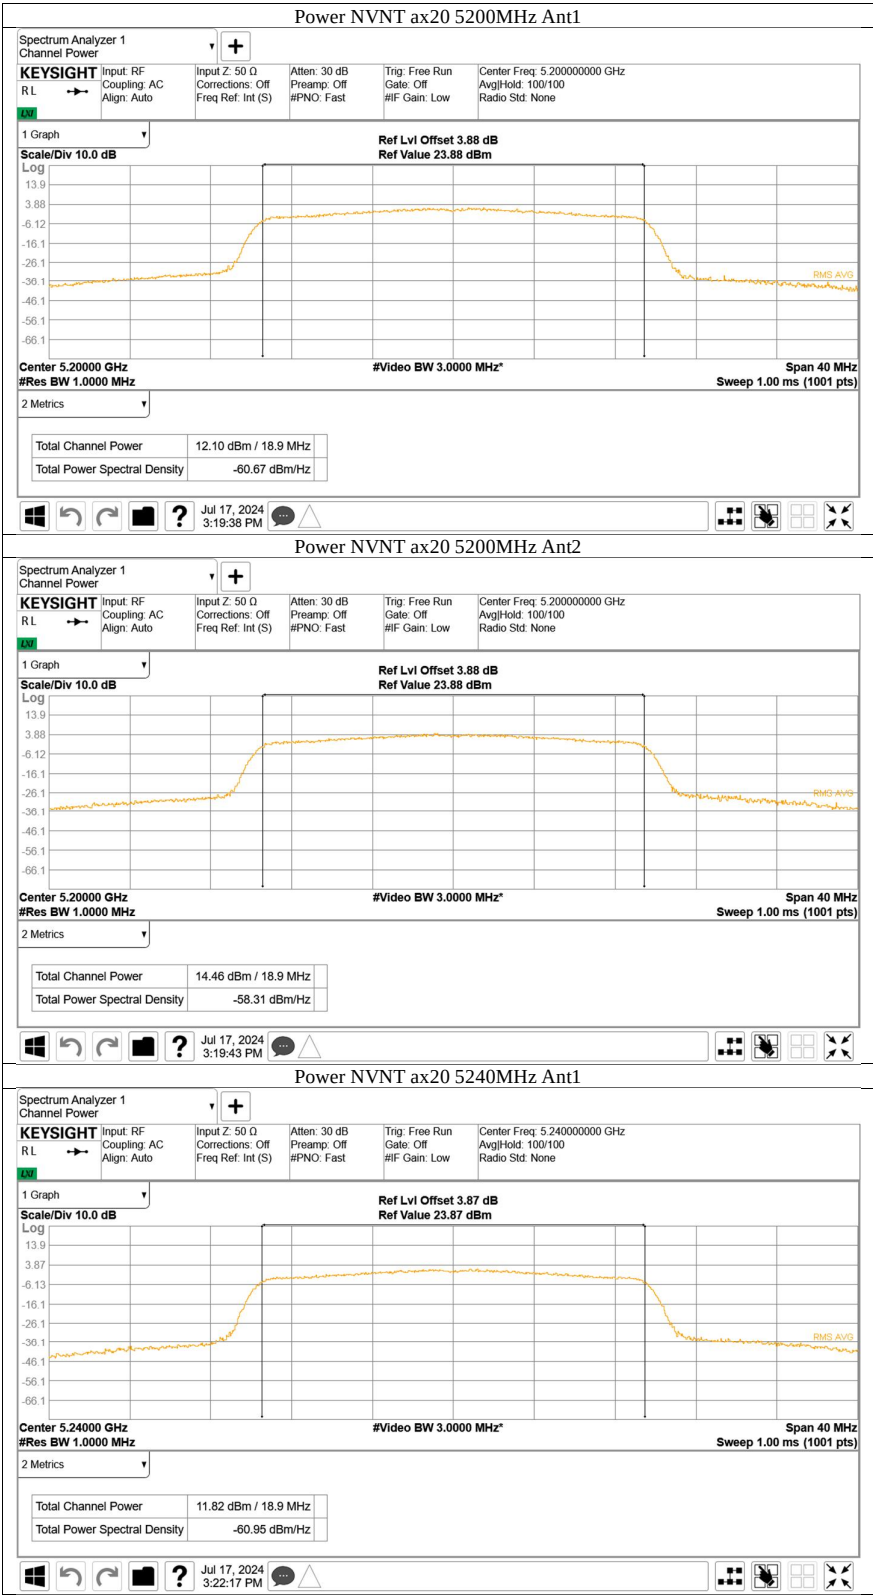

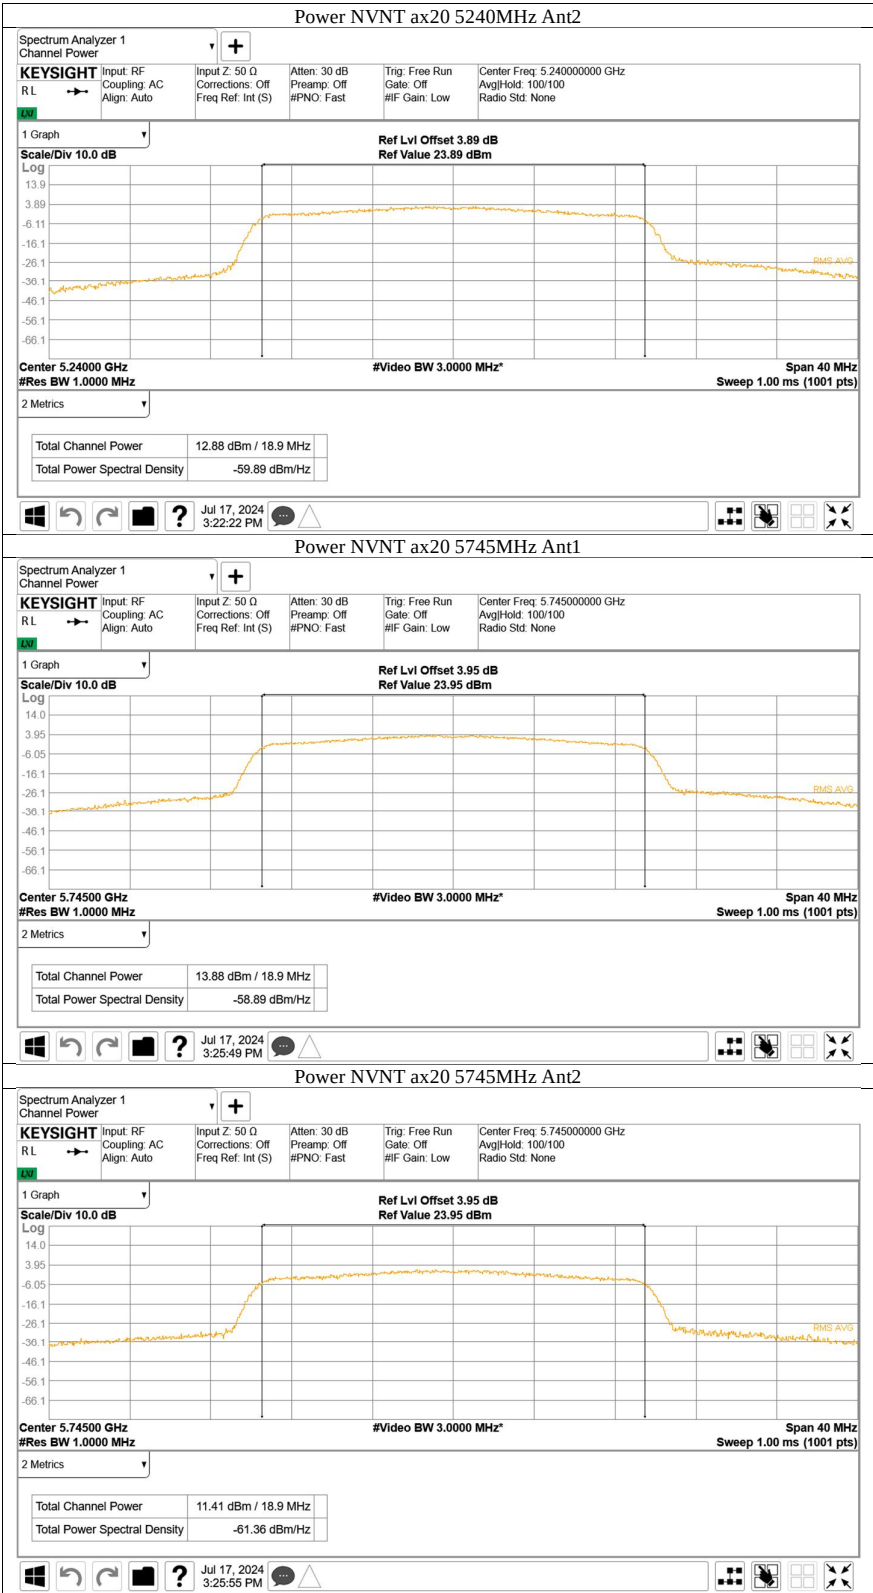


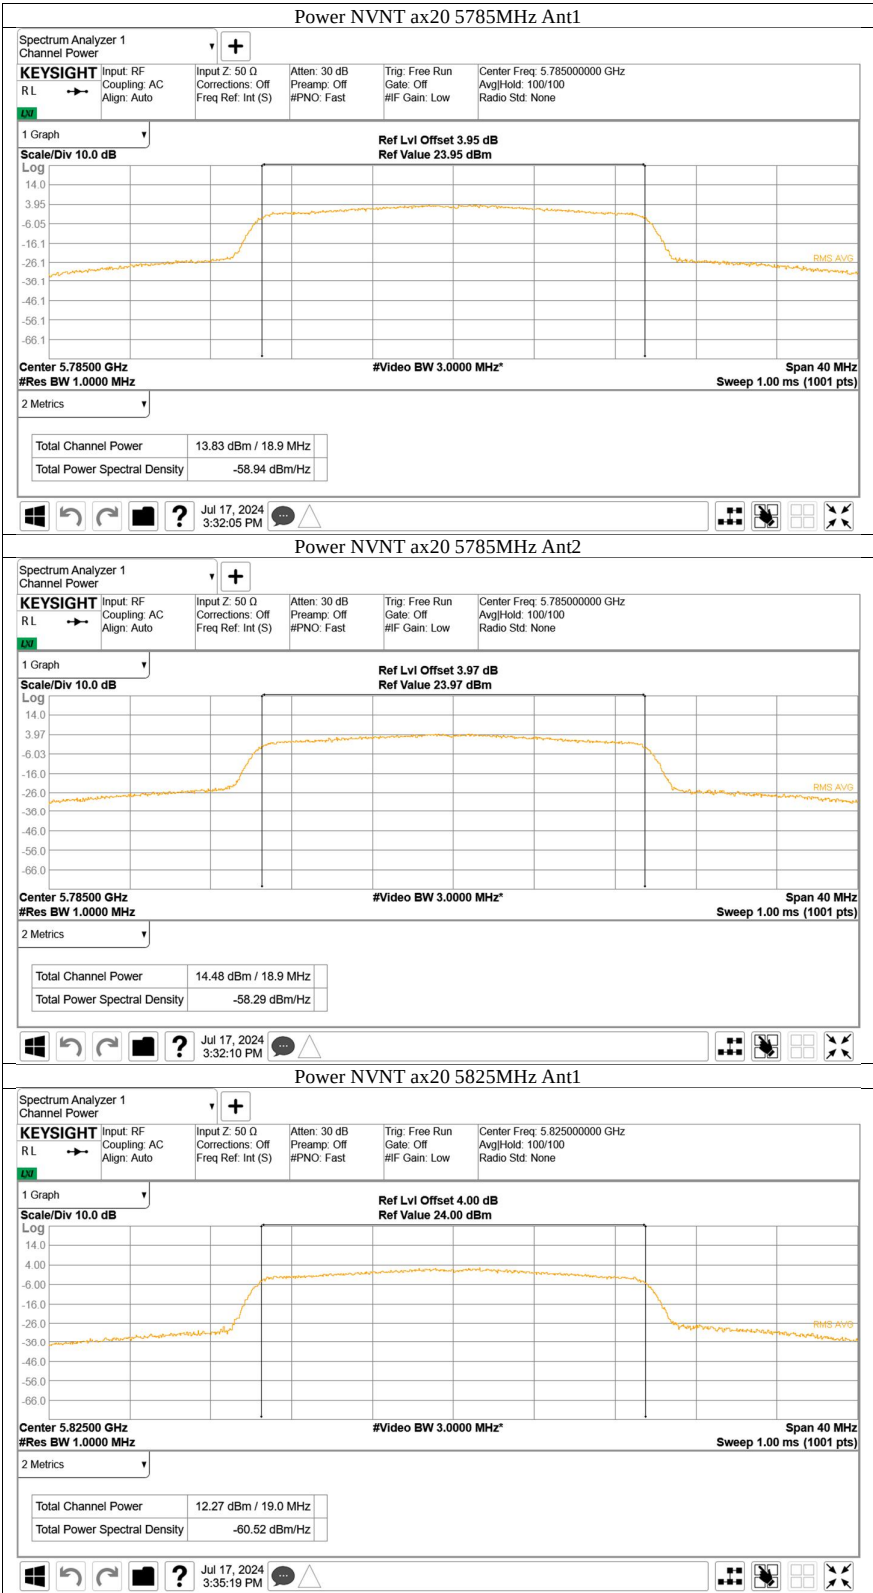





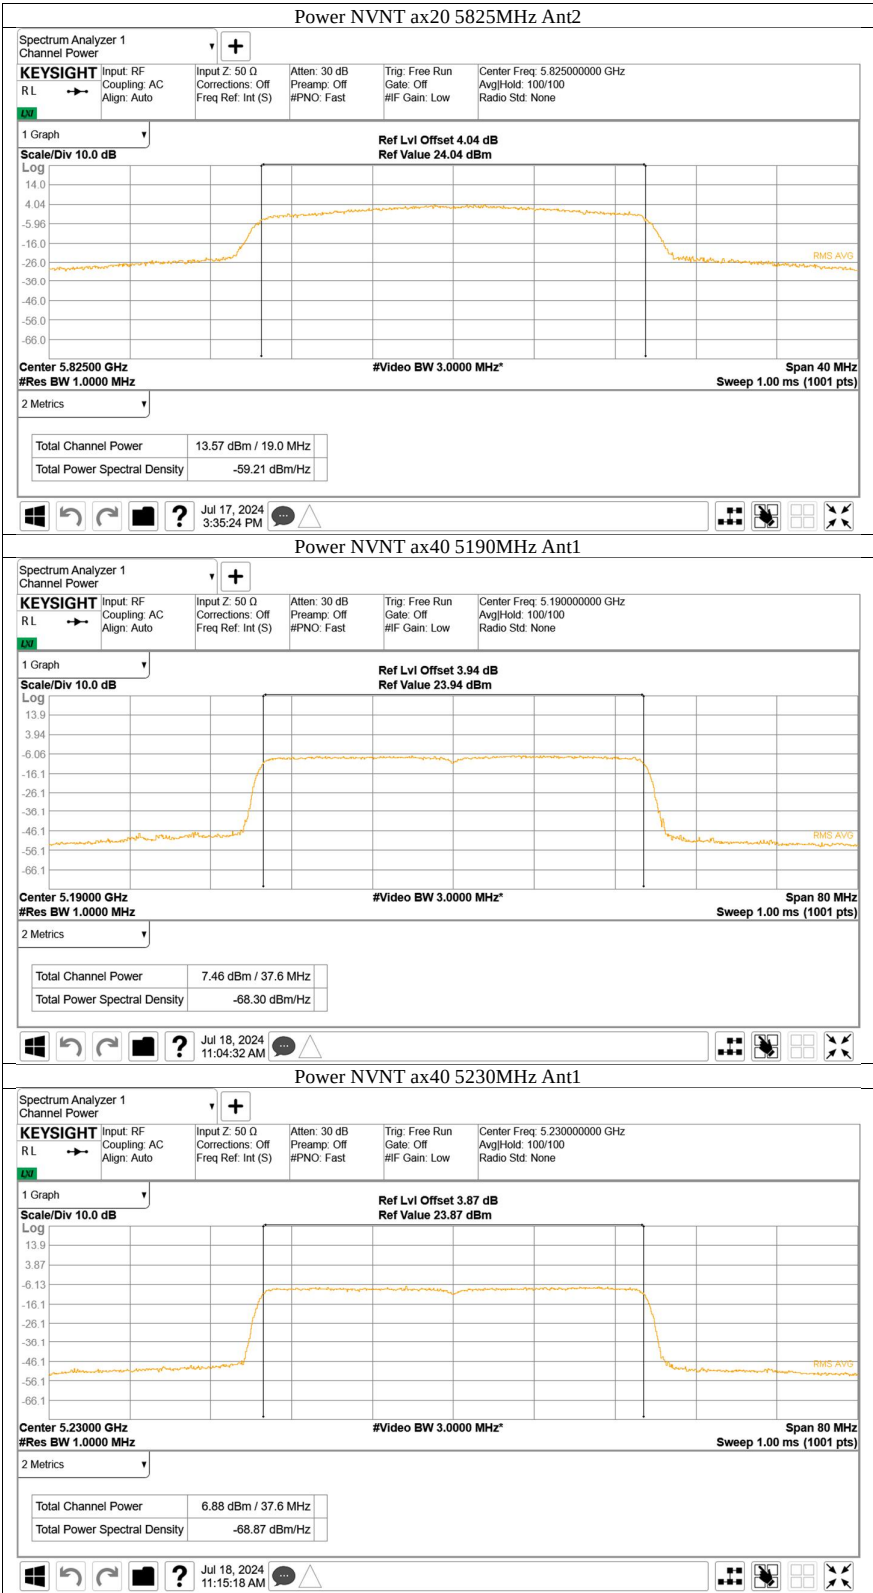





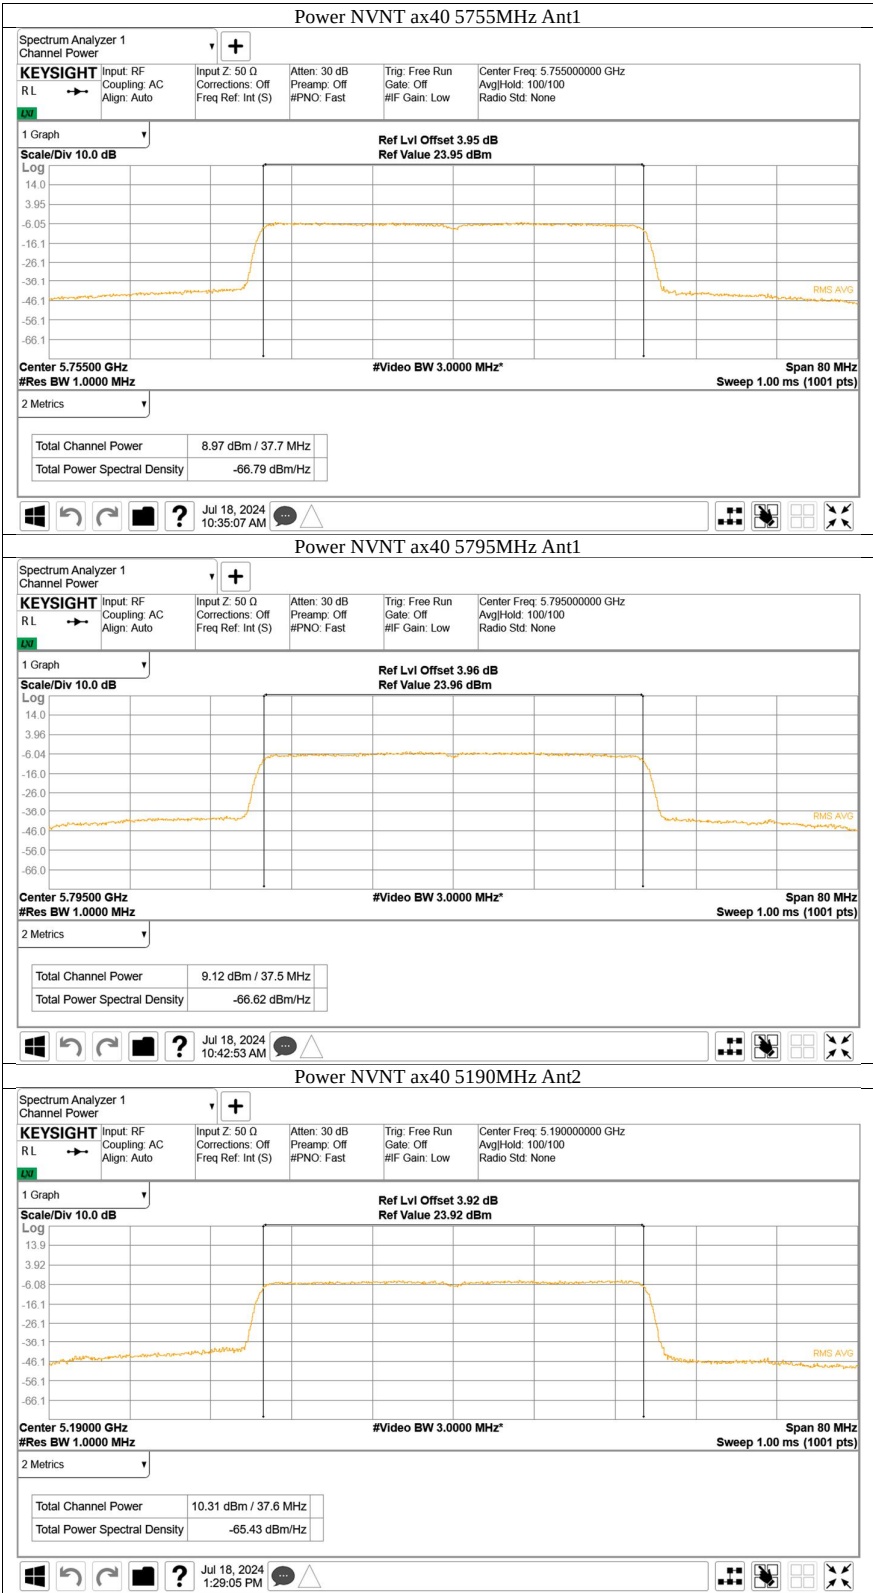


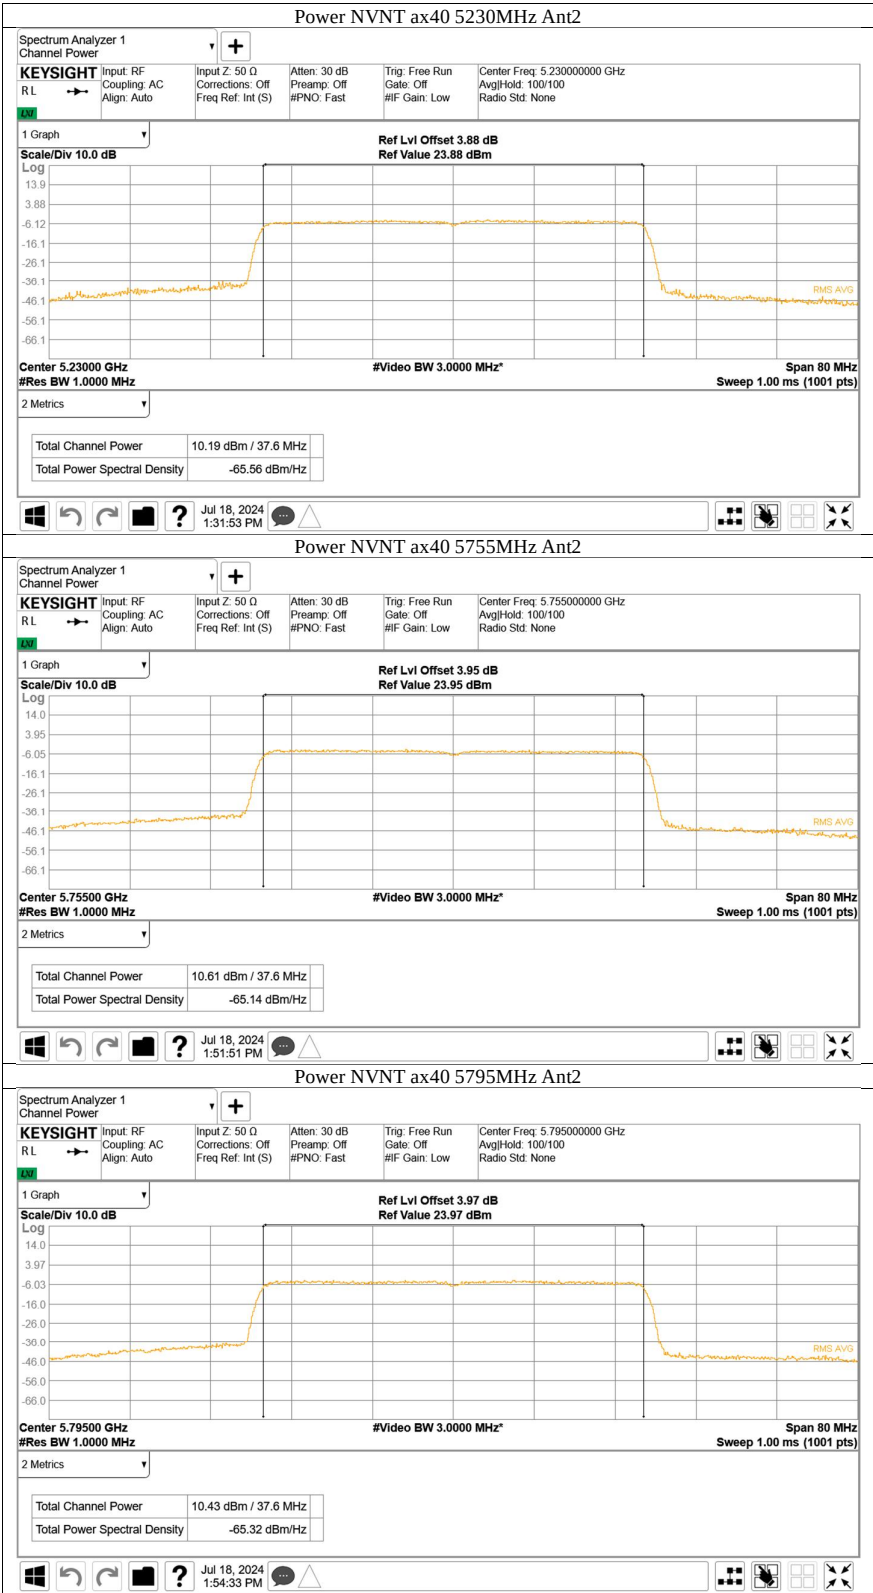


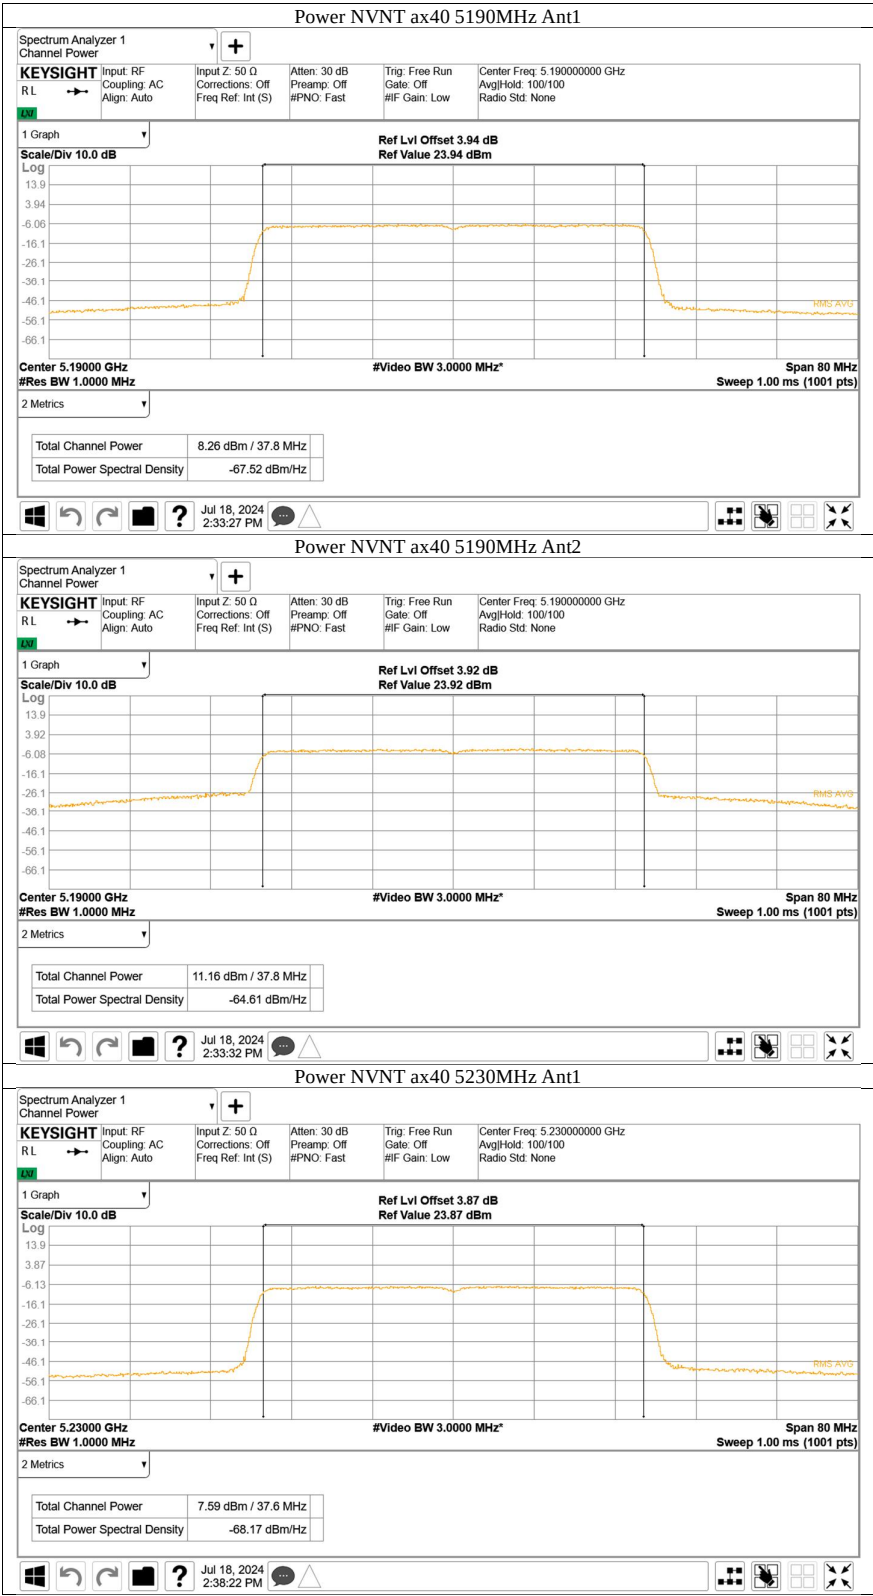

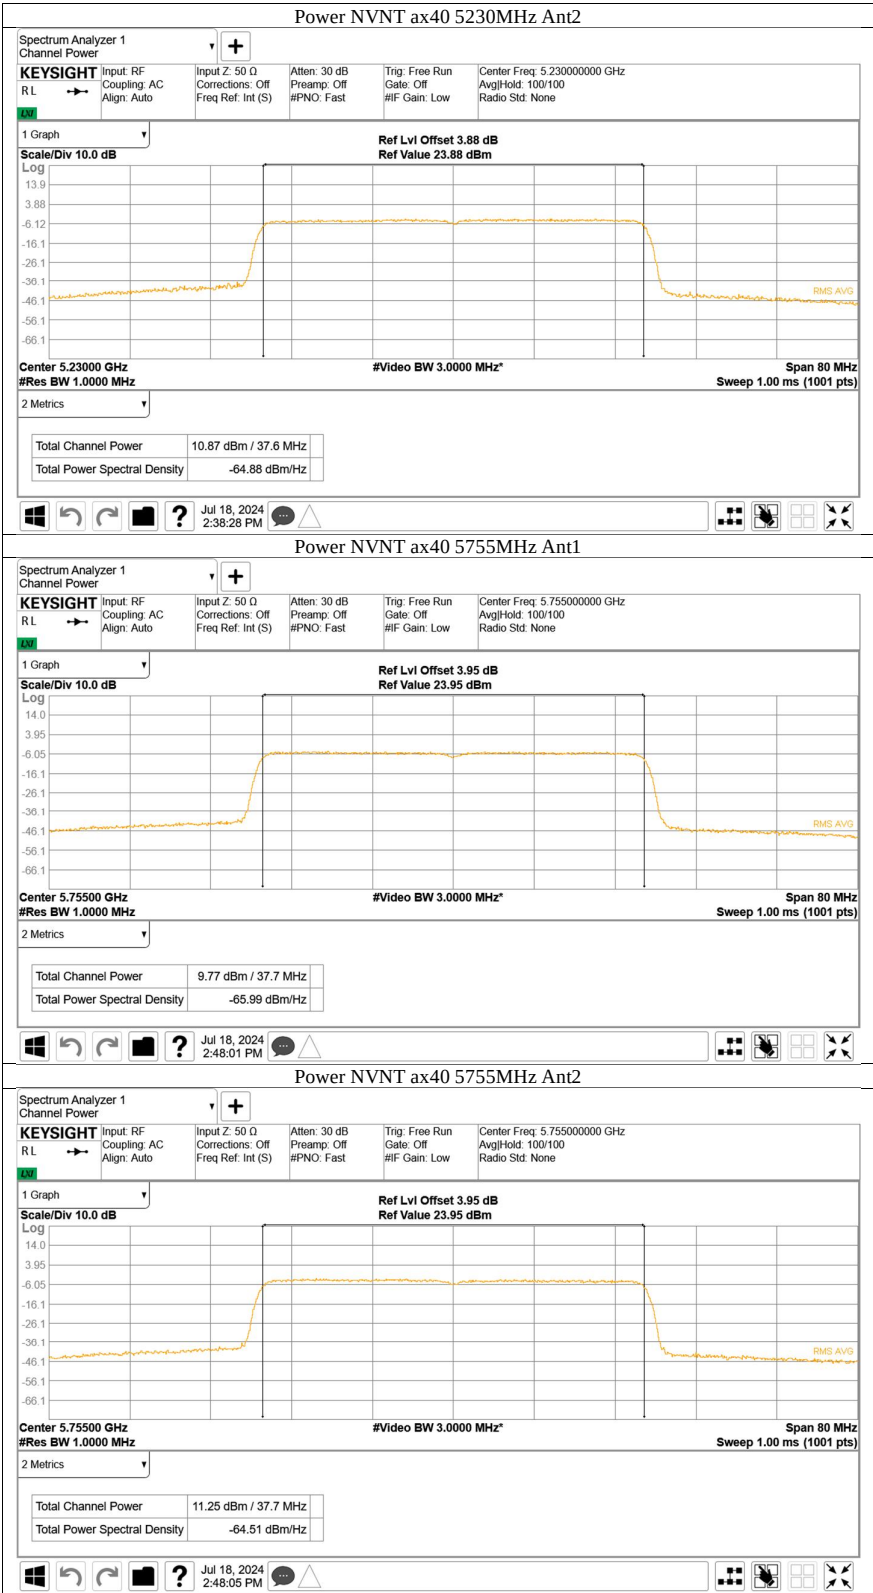


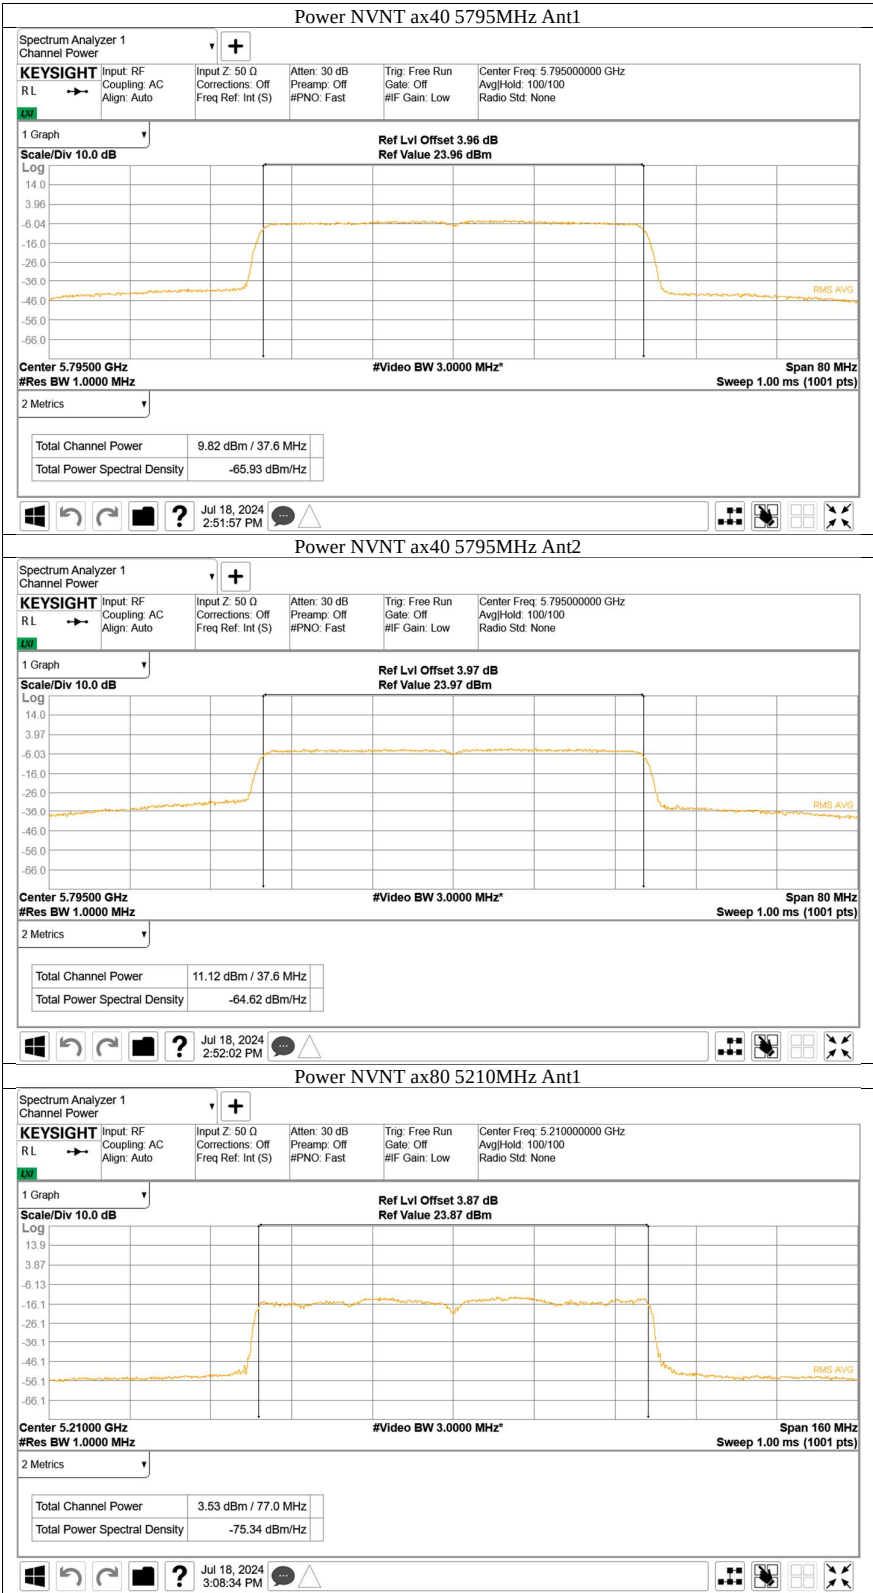

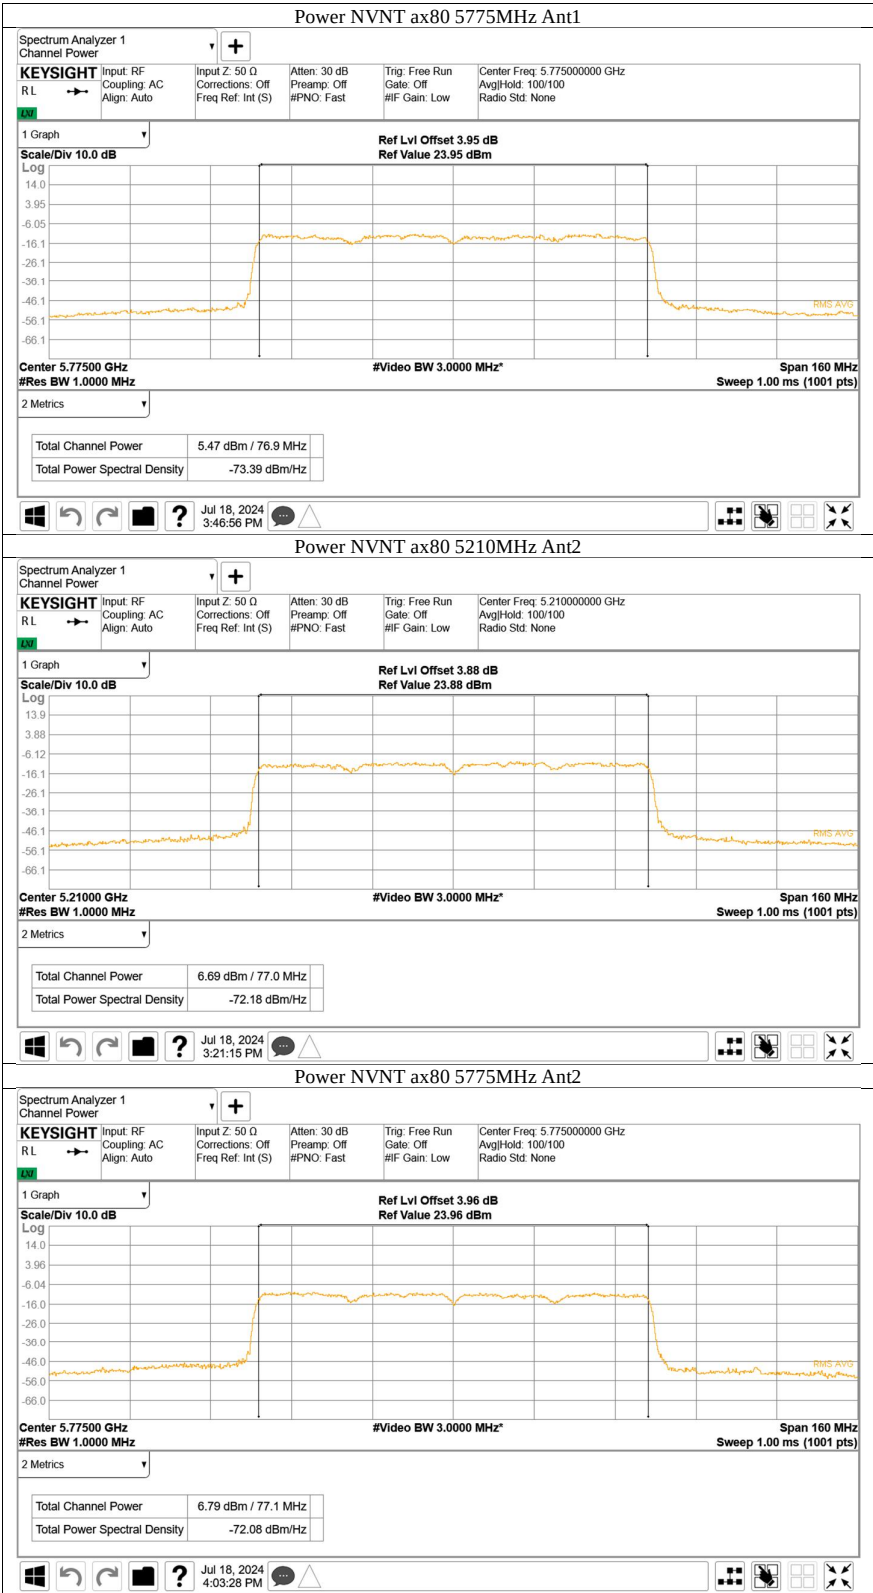

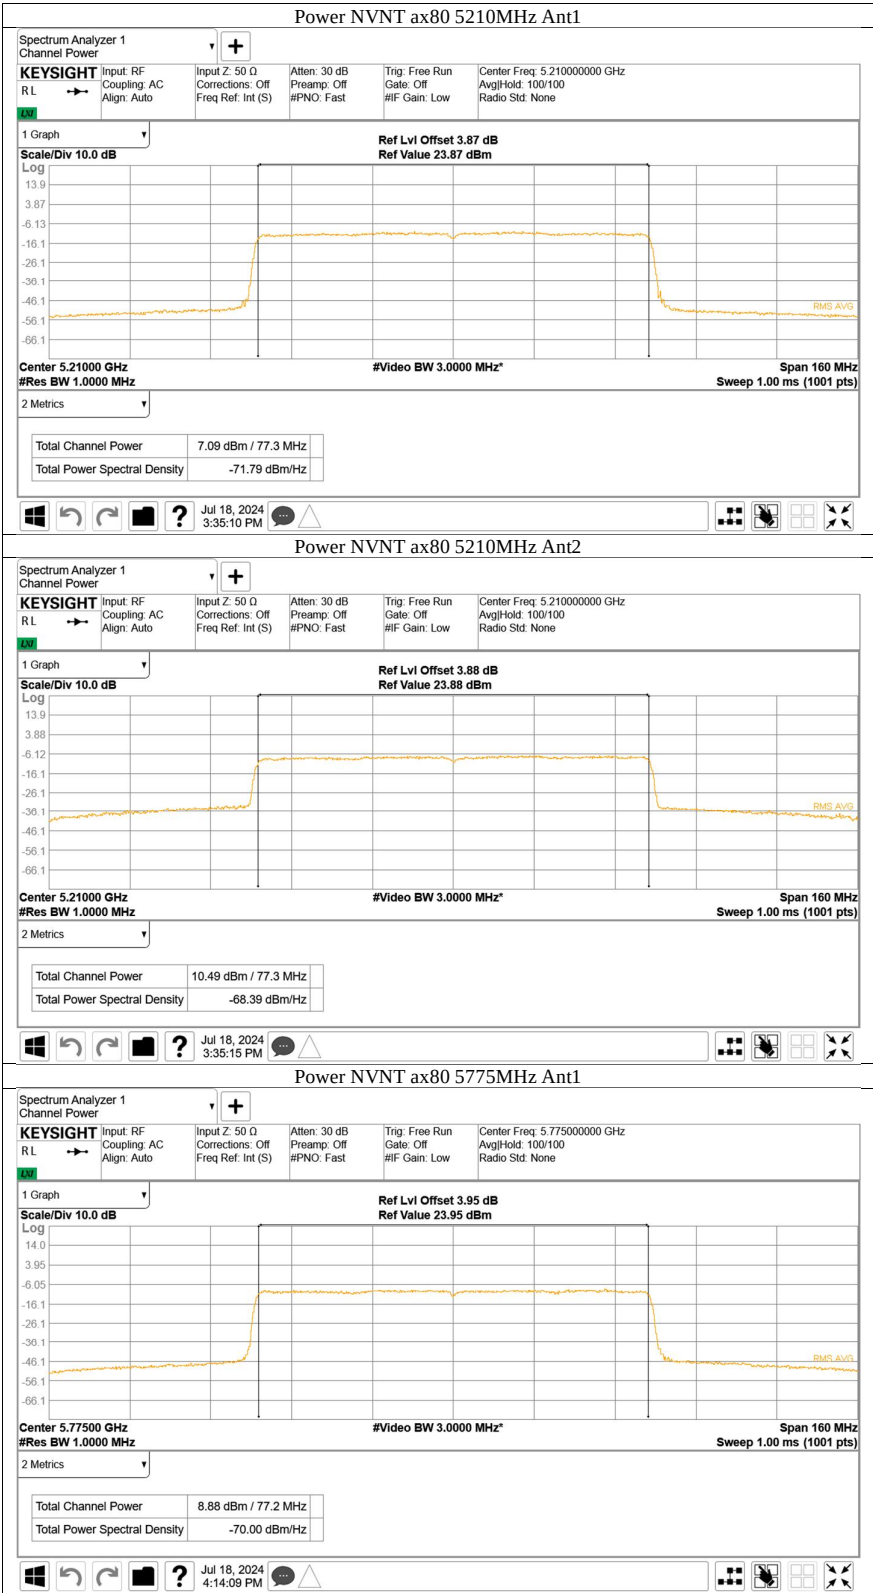



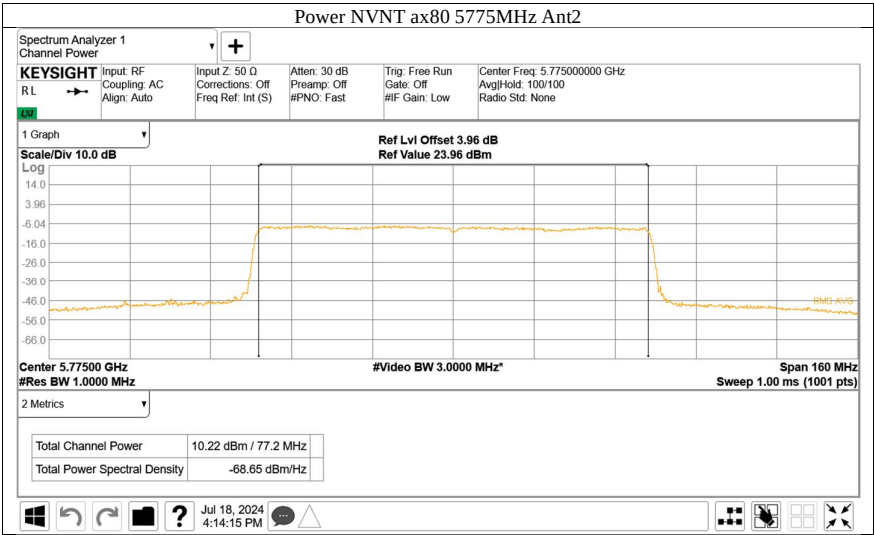

### 3 Maximum power spectral density

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm) | Duty Factor (dB) | Total PSD (dBm) | FCC Limit (dBm) | IC Limit (dBm) | Gain (dBi) | E.I.R.P PSD (dBm) | E.I.R.P PSD Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|---------------------|------------------|-----------------|-----------------|----------------|------------|-------------------|-------------------------|---------|
| NVNT      | a    | 5180            | Ant1    | 0.82                | 1.41             | 2.23            | 11              | --             | 2.2        | 4.43              | 10                      | Pass    |
| NVNT      | a    | 5200            | Ant1    | 1.34                | 1.42             | 2.76            | 11              | --             | 2.2        | 4.96              | 10                      | Pass    |
| NVNT      | a    | 5240            | Ant1    | 1.19                | 1.41             | 2.6             | 11              | --             | 2.2        | 4.8               | 10                      | Pass    |
| NVNT      | a    | 5745            | Ant1    | -0.04               | 1.42             | 1.38            | 30              | 30             | 2.2        | 3.58              | --                      | Pass    |
| NVNT      | a    | 5785            | Ant1    | -0.22               | 1.42             | 1.2             | 30              | 30             | 2.2        | 3.4               | --                      | Pass    |
| NVNT      | a    | 5825            | Ant1    | 0.1                 | 1.42             | 1.52            | 30              | 30             | 2.2        | 3.72              | --                      | Pass    |
| NVNT      | a    | 5180            | Ant2    | 4.26                | 1.41             | 5.67            | 11              | --             | 2.2        | 7.87              | 10                      | Pass    |
| NVNT      | a    | 5200            | Ant2    | 4.24                | 1.41             | 5.65            | 11              | --             | 2.2        | 7.85              | 10                      | Pass    |
| NVNT      | a    | 5240            | Ant2    | 4.12                | 1.41             | 5.53            | 11              | --             | 2.2        | 7.73              | 10                      | Pass    |
| NVNT      | a    | 5745            | Ant2    | 0.7                 | 1.41             | 2.11            | 30              | 30             | 2.2        | 4.31              | --                      | Pass    |
| NVNT      | a    | 5785            | Ant2    | 0.41                | 1.42             | 1.83            | 30              | 30             | 2.2        | 4.03              | --                      | Pass    |
| NVNT      | a    | 5825            | Ant2    | 0.62                | 1.39             | 2.01            | 30              | 30             | 2.2        | 4.21              | --                      | Pass    |
| NVNT      | n20  | 5180            | Ant1    | 0.56                | 2                | 2.56            | 11              | --             | 2.2        | 4.76              | 10                      | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 0.72                | 1.98             | 2.7             | 11              | --             | 2.2        | 4.9               | 10                      | Pass    |
| NVNT      | n20  | 5240            | Ant1    | 0.51                | 2                | 2.51            | 11              | --             | 2.2        | 4.71              | 10                      | Pass    |
| NVNT      | n20  | 5745            | Ant1    | -0.29               | 1.41             | 1.12            | 30              | 30             | 2.2        | 3.32              | --                      | Pass    |
| NVNT      | n20  | 5785            | Ant1    | -0.35               | 1.42             | 1.07            | 30              | 30             | 2.2        | 3.27              | --                      | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 0.24                | 1.41             | 1.65            | 30              | 30             | 2.2        | 3.85              | --                      | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 3.16                | 2                | 5.16            | 11              | --             | 2.2        | 7.36              | 10                      | Pass    |
| NVNT      | n20  | 5200            | Ant2    | 3.43                | 2                | 5.43            | 11              | --             | 2.2        | 7.63              | 10                      | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 3.26                | 2                | 5.26            | 11              | --             | 2.2        | 7.46              | 10                      | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 0.22                | 2                | 2.22            | 30              | 30             | 2.2        | 4.42              | --                      | Pass    |
| NVNT      | n20  | 5785            | Ant2    | 0.33                | 2                | 2.33            | 30              | 30             | 2.2        | 4.53              | --                      | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 0.5                 | 2                | 2.5             | 30              | 30             | 2.2        | 4.7               | --                      | Pass    |
| NVNT      | n20  | 5180            | Ant1    | -1.1                | 0.31             | -0.79           | 11              | --             | 2.2        | 1.41              | 10                      | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 2.35                | 0.31             | 2.66            | 11              | --             | 2.2        | 4.86              | 10                      | Pass    |
| NVNT      | n20  | 5180            | Sum     | 3.97                | 0.31             | 4.28            | 11              | --             | 5.01       | 9.29              | 10                      | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 0.05                | 0.31             | 0.36            | 11              | --             | 2.2        | 2.56              | 10                      | Pass    |
| NVNT      | n20  | 5200            | Ant2    | 2.5                 | 0.31             | 2.81            | 11              | --             | 2.2        | 5.01              | 10                      | Pass    |
| NVNT      | n20  | 5200            | Sum     | 4.46                | 0.31             | 4.77            | 11              | --             | 5.01       | 9.78              | 10                      | Pass    |
| NVNT      | n20  | 5240            | Ant1    | -1.33               | 0.31             | -1.02           | 11              | --             | 2.2        | 1.18              | 10                      | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 2.08                | 0.31             | 2.39            | 11              | --             | 2.2        | 4.59              | 10                      | Pass    |
| NVNT      | n20  | 5240            | Sum     | 3.71                | 0.31             | 4.02            | 11              | --             | 5.01       | 9.03              | 10                      | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 2.45                | 0.31             | 2.76            | 30              | 30             | 2.2        | 4.96              | --                      | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 2.71                | 0.31             | 3.02            | 30              | 30             | 2.2        | 5.22              | --                      | Pass    |
| NVNT      | n20  | 5745            | Sum     | 5.59                | 0.31             | 5.9             | 30              | 30             | 5.01       | 10.91             | --                      | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 1.78                | 0.31             | 2.09            | 30              | 30             | 2.2        | 4.29              | --                      | Pass    |
| NVNT      | n20  | 5785            | Ant2    | 2.73                | 0.31             | 3.04            | 30              | 30             | 2.2        | 5.24              | --                      | Pass    |
| NVNT      | n20  | 5785            | Sum     | 5.29                | 0.31             | 5.6             | 30              | 30             | 5.01       | 10.61             | --                      | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 2.14                | 0.31             | 2.45            | 30              | 30             | 2.2        | 4.65              | --                      | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 3.78                | 0.31             | 4.09            | 30              | 30             | 2.2        | 6.29              | --                      | Pass    |
| NVNT      | n20  | 5825            | Sum     | 6.05                | 0.31             | 6.36            | 30              | 30             | 5.01       | 11.37             | --                      | Pass    |
| NVNT      | n40  | 5190            | Ant1    | -8.54               | 2.9              | -5.64           | 11              | --             | 2.2        | -3.44             | 10                      | Pass    |
| NVNT      | n40  | 5230            | Ant1    | -9                  | 2.9              | -6.1            | 11              | --             | 2.2        | -3.9              | 10                      | Pass    |
| NVNT      | n40  | 5755            | Ant1    | -9.94               | 2.9              | -7.04           | 30              | 30             | 2.2        | -4.84             | --                      | Pass    |
| NVNT      | n40  | 5795            | Ant1    | -9.3                | 2.95             | -6.35           | 30              | 30             | 2.2        | -4.15             | --                      | Pass    |
| NVNT      | n40  | 5190            | Ant2    | -4.76               | 2.95             | -1.81           | 11              | --             | 2.2        | 0.39              | 10                      | Pass    |
| NVNT      | n40  | 5230            | Ant2    | -5.11               | 2.9              | -2.21           | 11              | --             | 2.2        | -0.01             | 10                      | Pass    |
| NVNT      | n40  | 5755            | Ant2    | -7.72               | 2.9              | -4.82           | 30              | 30             | 2.2        | -2.62             | --                      | Pass    |
| NVNT      | n40  | 5795            | Ant2    | -7.41               | 2.9              | -4.51           | 30              | 30             | 2.2        | -2.31             | --                      | Pass    |
| NVNT      | n40  | 5190            | Ant1    | -6.31               | 1.06             | -5.25           | 11              | --             | 2.2        | -3.05             | 10                      | Pass    |
| NVNT      | n40  | 5190            | Ant2    | -3.42               | 1.06             | -2.36           | 11              | --             | 2.2        | -0.16             | 10                      | Pass    |
| NVNT      | n40  | 5190            | Sum     | -1.62               | 1.06             | -0.56           | 11              | --             | 5.01       | 4.45              | 10                      | Pass    |
| NVNT      | n40  | 5230            | Ant1    | -7.12               | 1.06             | -6.06           | 11              | --             | 2.2        | -3.86             | 10                      | Pass    |
| NVNT      | n40  | 5230            | Ant2    | -3.66               | 1.06             | -2.6            | 11              | --             | 2.2        | -0.4              | 10                      | Pass    |
| NVNT      | n40  | 5230            | Sum     | -2.04               | 1.06             | -0.98           | 11              | --             | 5.01       | -0.4              | 10                      | Pass    |
| NVNT      | n40  | 5755            | Ant1    | -8.34               | 1.06             | -7.28           | 30              | 30             | 2.2        | -5.08             | --                      | Pass    |
| NVNT      | n40  | 5755            | Ant2    | -6.41               | 1.06             | -5.35           | 30              | 30             | 2.2        | -3.15             | --                      | Pass    |
| NVNT      | n40  | 5755            | Sum     | -4.26               | 1.06             | -3.2            | 30              | 30             | 5.01       | 1.81              | --                      | Pass    |
| NVNT      | n40  | 5795            | Ant1    | -8.04               | 1.07             | -6.97           | 30              | 30             | 2.2        | -4.77             | --                      | Pass    |
| NVNT      | n40  | 5795            | Ant2    | -6.58               | 1.07             | -5.51           | 30              | 30             | 2.2        | -3.31             | --                      | Pass    |



|      |      |      |      |        |      |        |    |    |      |       |    |      |
|------|------|------|------|--------|------|--------|----|----|------|-------|----|------|
| NVNT | n40  | 5795 | Sum  | -4.24  | 1.07 | -3.17  | 30 | 30 | 5.01 | 1.84  | -- | Pass |
| NVNT | ac20 | 5180 | Ant1 | 4.35   | 0    | 4.35   | 11 | -- | 2.2  | 6.55  | 10 | Pass |
| NVNT | ac20 | 5200 | Ant1 | 4.71   | 0    | 4.71   | 11 | -- | 2.2  | 6.91  | 10 | Pass |
| NVNT | ac20 | 5240 | Ant1 | 4.24   | 0    | 4.24   | 11 | -- | 2.2  | 6.44  | 10 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 3.13   | 0    | 3.13   | 30 | 30 | 2.2  | 5.33  | -- | Pass |
| NVNT | ac20 | 5785 | Ant1 | 3.52   | 0    | 3.52   | 30 | 30 | 2.2  | 5.72  | -- | Pass |
| NVNT | ac20 | 5825 | Ant1 | 3.44   | 0    | 3.44   | 30 | 30 | 2.2  | 5.64  | -- | Pass |
| NVNT | ac20 | 5180 | Ant2 | 7.06   | 0.31 | 7.37   | 11 | -- | 2.2  | 9.57  | 10 | Pass |
| NVNT | ac20 | 5200 | Ant2 | 7.37   | 0.31 | 7.68   | 11 | -- | 2.2  | 9.88  | 10 | Pass |
| NVNT | ac20 | 5240 | Ant2 | 6.99   | 0.31 | 7.3    | 11 | -- | 2.2  | 9.5   | 10 | Pass |
| NVNT | ac20 | 5745 | Ant2 | 3.97   | 0.31 | 4.28   | 30 | 30 | 2.2  | 6.48  | -- | Pass |
| NVNT | ac20 | 5785 | Ant2 | 4.16   | 0.31 | 4.47   | 30 | 30 | 2.2  | 6.67  | -- | Pass |
| NVNT | ac20 | 5825 | Ant2 | 4.48   | 0.31 | 4.79   | 30 | 30 | 2.2  | 6.99  | -- | Pass |
| NVNT | ac20 | 5180 | Ant1 | -0.4   | 0    | -0.4   | 11 | -- | 2.2  | 1.8   | 10 | Pass |
| NVNT | ac20 | 5180 | Ant2 | 2.91   | 0    | 2.91   | 11 | -- | 2.2  | 5.11  | 10 | Pass |
| NVNT | ac20 | 5180 | Sum  | 4.57   | 0    | 4.57   | 11 | -- | 5.01 | 9.58  | 10 | Pass |
| NVNT | ac20 | 5200 | Ant1 | 0.46   | 0    | 0.46   | 11 | -- | 2.2  | 2.66  | 10 | Pass |
| NVNT | ac20 | 5200 | Ant2 | 2.58   | 0    | 2.58   | 11 | -- | 2.2  | 4.78  | 10 | Pass |
| NVNT | ac20 | 5200 | Sum  | 4.66   | 0    | 4.66   | 11 | -- | 5.01 | 9.67  | 10 | Pass |
| NVNT | ac20 | 5240 | Ant1 | -0.4   | 0    | -0.4   | 11 | -- | 2.2  | 1.8   | 10 | Pass |
| NVNT | ac20 | 5240 | Ant2 | 2.72   | 0    | 2.72   | 11 | -- | 2.2  | 4.92  | 10 | Pass |
| NVNT | ac20 | 5240 | Sum  | 4.44   | 0    | 4.44   | 11 | -- | 5.01 | 9.45  | 10 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 2.37   | 0    | 2.37   | 30 | 30 | 2.2  | 4.57  | -- | Pass |
| NVNT | ac20 | 5745 | Ant2 | 3.11   | 0    | 3.11   | 30 | 30 | 2.2  | 5.31  | -- | Pass |
| NVNT | ac20 | 5745 | Sum  | 5.77   | 0    | 5.77   | 30 | 30 | 5.01 | 10.78 | -- | Pass |
| NVNT | ac20 | 5785 | Ant1 | 2.33   | 0    | 2.33   | 30 | 30 | 2.2  | 4.53  | -- | Pass |
| NVNT | ac20 | 5785 | Ant2 | 2.76   | 0    | 2.76   | 30 | 30 | 2.2  | 4.96  | -- | Pass |
| NVNT | ac20 | 5785 | Sum  | 5.56   | 0    | 5.56   | 30 | 30 | 5.01 | 10.57 | -- | Pass |
| NVNT | ac20 | 5825 | Ant1 | 1.54   | 0    | 1.54   | 30 | 30 | 2.2  | 3.74  | -- | Pass |
| NVNT | ac20 | 5825 | Ant2 | 3.46   | 0    | 3.46   | 30 | 30 | 2.2  | 5.66  | -- | Pass |
| NVNT | ac20 | 5825 | Sum  | 5.62   | 0    | 5.62   | 30 | 30 | 5.01 | 10.63 | -- | Pass |
| NVNT | ac40 | 5190 | Ant1 | -5.84  | 0    | -5.84  | 11 | -- | 2.2  | -3.64 | 10 | Pass |
| NVNT | ac40 | 5230 | Ant1 | -6.13  | 0    | -6.13  | 11 | -- | 2.2  | -3.93 | 10 | Pass |
| NVNT | ac40 | 5755 | Ant1 | -7.8   | 0    | -7.8   | 30 | 30 | 2.2  | -5.6  | -- | Pass |
| NVNT | ac40 | 5795 | Ant1 | -7.36  | 0    | -7.36  | 30 | 30 | 2.2  | -5.16 | -- | Pass |
| NVNT | ac40 | 5190 | Ant2 | -3.02  | 0    | -3.02  | 11 | -- | 2.2  | -0.82 | 10 | Pass |
| NVNT | ac40 | 5230 | Ant2 | -3.09  | 0    | -3.09  | 11 | -- | 2.2  | -0.89 | 10 | Pass |
| NVNT | ac40 | 5755 | Ant2 | -5.68  | 0    | -5.68  | 30 | 30 | 2.2  | -3.48 | -- | Pass |
| NVNT | ac40 | 5795 | Ant2 | -5.76  | 0    | -5.76  | 30 | 30 | 2.2  | -3.56 | -- | Pass |
| NVNT | ac40 | 5190 | Ant1 | -5.62  | 0    | -5.62  | 11 | -- | 2.2  | -3.42 | 10 | Pass |
| NVNT | ac40 | 5190 | Ant2 | -2.35  | 0    | -2.35  | 11 | -- | 2.2  | -0.15 | 10 | Pass |
| NVNT | ac40 | 5190 | Sum  | -0.67  | 0    | -0.67  | 11 | -- | 5.01 | 4.34  | 10 | Pass |
| NVNT | ac40 | 5230 | Ant1 | -6.25  | 0    | -6.25  | 11 | -- | 2.2  | -4.05 | 10 | Pass |
| NVNT | ac40 | 5230 | Ant2 | -2.77  | 0    | -2.77  | 11 | -- | 2.2  | -0.57 | 10 | Pass |
| NVNT | ac40 | 5230 | Sum  | -1.16  | 0    | -1.16  | 11 | -- | 5.01 | 3.85  | 10 | Pass |
| NVNT | ac40 | 5755 | Ant1 | -7.36  | 0    | -7.36  | 30 | 30 | 2.2  | -5.16 | -- | Pass |
| NVNT | ac40 | 5755 | Ant2 | -5.7   | 0    | -5.7   | 30 | 30 | 2.2  | -3.5  | -- | Pass |
| NVNT | ac40 | 5755 | Sum  | -3.44  | 0    | -3.44  | 30 | 30 | 5.01 | 1.57  | -- | Pass |
| NVNT | ac40 | 5795 | Ant1 | -7     | 0    | -7     | 30 | 30 | 2.2  | -4.8  | -- | Pass |
| NVNT | ac40 | 5795 | Ant2 | -5.53  | 0    | -5.53  | 30 | 30 | 2.2  | -3.33 | -- | Pass |
| NVNT | ac40 | 5795 | Sum  | -3.19  | 0    | -3.19  | 30 | 30 | 5.01 | 1.82  | -- | Pass |
| NVNT | ac80 | 5210 | Ant1 | -12.76 | 3.69 | -9.07  | 11 | -- | 2.2  | -6.87 | 10 | Pass |
| NVNT | ac80 | 5775 | Ant1 | -13.32 | 3.73 | -9.59  | 30 | 30 | 2.2  | -7.39 | -- | Pass |
| NVNT | ac80 | 5210 | Ant2 | -9.01  | 3.66 | -5.35  | 11 | -- | 2.2  | -3.15 | 10 | Pass |
| NVNT | ac80 | 5775 | Ant2 | -12.24 | 3.75 | -8.49  | 30 | 30 | 2.2  | -6.29 | -- | Pass |
| NVNT | ac80 | 5210 | Ant1 | -9.64  | 0    | -9.64  | 11 | -- | 2.2  | -7.44 | 10 | Pass |
| NVNT | ac80 | 5210 | Ant2 | -6.82  | 0    | -6.82  | 11 | -- | 2.2  | -4.62 | 10 | Pass |
| NVNT | ac80 | 5210 | Sum  | -4.99  | 0    | -4.99  | 11 | -- | 5.01 | 0.02  | 10 | Pass |
| NVNT | ac80 | 5775 | Ant1 | -11.31 | 0    | -11.31 | 30 | 30 | 2.2  | -9.11 | -- | Pass |
| NVNT | ac80 | 5775 | Ant2 | -9.7   | 0    | -9.7   | 30 | 30 | 2.2  | -7.5  | -- | Pass |
| NVNT | ac80 | 5775 | Sum  | -7.42  | 0    | -7.42  | 30 | 30 | 5.01 | -2.41 | -- | Pass |
| NVNT | ax20 | 5180 | Ant1 | 2.72   | 0.39 | 3.11   | 11 | -- | 2.2  | 5.31  | 10 | Pass |
| NVNT | ax20 | 5200 | Ant1 | 3.26   | 0.39 | 3.65   | 11 | -- | 2.2  | 5.85  | 10 | Pass |
| NVNT | ax20 | 5240 | Ant1 | 2.71   | 0.39 | 3.1    | 11 | -- | 2.2  | 5.3   | 10 | Pass |
| NVNT | ax20 | 5745 | Ant1 | 3.47   | 0    | 3.47   | 30 | 30 | 2.2  | 5.67  | -- | Pass |
| NVNT | ax20 | 5785 | Ant1 | 3.18   | 0    | 3.18   | 30 | 30 | 2.2  | 5.38  | -- | Pass |
| NVNT | ax20 | 5825 | Ant1 | 3.99   | 0    | 3.99   | 30 | 30 | 2.2  | 6.19  | -- | Pass |
| NVNT | ax20 | 5180 | Ant2 | 5.39   | 0.39 | 5.78   | 11 | -- | 2.2  | 7.98  | 10 | Pass |
| NVNT | ax20 | 5200 | Ant2 | 5.73   | 0.39 | 6.12   | 11 | -- | 2.2  | 8.32  | 10 | Pass |



|      |      |      |      |        |      |        |    |    |      |       |    |      |
|------|------|------|------|--------|------|--------|----|----|------|-------|----|------|
| NVNT | ax20 | 5240 | Ant2 | 5.21   | 0.39 | 5.6    | 11 | -- | 2.2  | 7.8   | 10 | Pass |
| NVNT | ax20 | 5745 | Ant2 | 2.64   | 0.39 | 3.03   | 30 | 30 | 2.2  | 5.23  | -- | Pass |
| NVNT | ax20 | 5785 | Ant2 | 2.25   | 0.39 | 2.64   | 30 | 30 | 2.2  | 4.84  | -- | Pass |
| NVNT | ax20 | 5825 | Ant2 | 1.91   | 0.39 | 2.3    | 30 | 30 | 2.2  | 4.5   | -- | Pass |
| NVNT | ax20 | 5180 | Ant1 | -0.33  | 0    | -0.33  | 11 | -- | 2.2  | 1.87  | 10 | Pass |
| NVNT | ax20 | 5180 | Ant2 | 2.14   | 0    | 2.14   | 11 | -- | 2.2  | 4.34  | 10 | Pass |
| NVNT | ax20 | 5180 | Sum  | 4.09   | 0    | 4.09   | 11 | -- | 5.01 | 9.1   | 10 | Pass |
| NVNT | ax20 | 5200 | Ant1 | -0.17  | 0    | -0.17  | 11 | -- | 2.2  | 2.03  | 10 | Pass |
| NVNT | ax20 | 5200 | Ant2 | 2.62   | 0    | 2.62   | 11 | -- | 2.2  | 4.82  | 10 | Pass |
| NVNT | ax20 | 5200 | Sum  | 4.46   | 0    | 4.46   | 11 | -- | 5.01 | 9.47  | 10 | Pass |
| NVNT | ax20 | 5240 | Ant1 | -0.34  | 0    | -0.34  | 11 | -- | 2.2  | 1.86  | 10 | Pass |
| NVNT | ax20 | 5240 | Ant2 | 1.76   | 0    | 1.76   | 11 | -- | 2.2  | 3.96  | 10 | Pass |
| NVNT | ax20 | 5240 | Sum  | 3.85   | 0    | 3.85   | 11 | -- | 5.01 | 8.86  | 10 | Pass |
| NVNT | ax20 | 5745 | Ant1 | 0.71   | 0    | 0.71   | 30 | 30 | 2.2  | 2.91  | -- | Pass |
| NVNT | ax20 | 5745 | Ant2 | 1      | 0    | 1      | 30 | 30 | 2.2  | 3.2   | -- | Pass |
| NVNT | ax20 | 5745 | Sum  | 3.87   | 0    | 3.87   | 30 | 30 | 5.01 | 8.88  | -- | Pass |
| NVNT | ax20 | 5785 | Ant1 | 0.55   | 0    | 0.55   | 30 | 30 | 2.2  | 2.75  | -- | Pass |
| NVNT | ax20 | 5785 | Ant2 | 1.06   | 0    | 1.06   | 30 | 30 | 2.2  | 3.26  | -- | Pass |
| NVNT | ax20 | 5785 | Sum  | 3.82   | 0    | 3.82   | 30 | 30 | 5.01 | 8.83  | -- | Pass |
| NVNT | ax20 | 5825 | Ant1 | -0.3   | 0    | -0.3   | 30 | 30 | 2.2  | 1.9   | -- | Pass |
| NVNT | ax20 | 5825 | Ant2 | 1.96   | 0    | 1.96   | 30 | 30 | 2.2  | 4.16  | -- | Pass |
| NVNT | ax20 | 5825 | Sum  | 3.99   | 0    | 3.99   | 30 | 30 | 5.01 | 9     | -- | Pass |
| NVNT | ax40 | 5190 | Ant1 | -6.39  | 0.71 | -5.68  | 11 | -- | 2.2  | -3.48 | 10 | Pass |
| NVNT | ax40 | 5230 | Ant1 | -7.09  | 0.71 | -6.38  | 11 | -- | 2.2  | -4.18 | 10 | Pass |
| NVNT | ax40 | 5755 | Ant1 | -8.12  | 0.72 | -7.4   | 30 | 30 | 2.2  | -5.2  | -- | Pass |
| NVNT | ax40 | 5795 | Ant1 | -7.71  | 0.72 | -6.99  | 30 | 30 | 2.2  | -5.2  | -- | Pass |
| NVNT | ax40 | 5190 | Ant2 | -3.39  | 0.71 | -2.68  | 11 | -- | 2.2  | -0.48 | 10 | Pass |
| NVNT | ax40 | 5230 | Ant2 | -3.34  | 0.71 | -2.63  | 11 | -- | 2.2  | -0.43 | 10 | Pass |
| NVNT | ax40 | 5755 | Ant2 | -6.24  | 0.71 | -5.53  | 30 | 30 | 2.2  | -3.33 | -- | Pass |
| NVNT | ax40 | 5795 | Ant2 | -6.05  | 0.71 | -5.34  | 30 | 30 | 2.2  | -3.14 | -- | Pass |
| NVNT | ax40 | 5190 | Ant1 | -5.6   | 0.15 | -5.45  | 11 | -- | 2.2  | -3.25 | 10 | Pass |
| NVNT | ax40 | 5190 | Ant2 | -2.93  | 0.15 | -2.78  | 11 | -- | 2.2  | -0.58 | 10 | Pass |
| NVNT | ax40 | 5190 | Sum  | -1.05  | 0.15 | -0.9   | 11 | -- | 5.01 | 4.11  | 10 | Pass |
| NVNT | ax40 | 5230 | Ant1 | -6.48  | 0.15 | -6.33  | 11 | -- | 2.2  | -4.13 | 10 | Pass |
| NVNT | ax40 | 5230 | Ant2 | -3.06  | 0.15 | -2.91  | 11 | -- | 2.2  | -0.71 | 10 | Pass |
| NVNT | ax40 | 5230 | Sum  | -1.43  | 0.15 | -1.28  | 11 | -- | 5.01 | 3.73  | 10 | Pass |
| NVNT | ax40 | 5755 | Ant1 | -7.2   | 0.15 | -7.05  | 30 | 30 | 2.2  | -4.85 | -- | Pass |
| NVNT | ax40 | 5755 | Ant2 | -5.2   | 0.15 | -5.05  | 30 | 30 | 2.2  | -2.85 | -- | Pass |
| NVNT | ax40 | 5755 | Sum  | -3.08  | 0.15 | -2.93  | 30 | 30 | 5.01 | 2.08  | -- | Pass |
| NVNT | ax40 | 5795 | Ant1 | -7.06  | 0.15 | -6.91  | 30 | 30 | 2.2  | -4.71 | -- | Pass |
| NVNT | ax40 | 5795 | Ant2 | -5.59  | 0.15 | -5.44  | 30 | 30 | 2.2  | -3.24 | -- | Pass |
| NVNT | ax40 | 5795 | Sum  | -3.25  | 0.15 | -3.1   | 30 | 30 | 5.01 | -0.58 | -- | Pass |
| NVNT | ax80 | 5210 | Ant1 | -12.68 | 3.42 | -9.26  | 11 | -- | 2.2  | 4.11  | 10 | Pass |
| NVNT | ax80 | 5775 | Ant1 | -13.31 | 3.47 | -9.84  | 30 | 30 | 2.2  | -4.13 | -- | Pass |
| NVNT | ax80 | 5210 | Ant2 | -9.5   | 3.45 | -6.05  | 11 | -- | 2.2  | -0.71 | 10 | Pass |
| NVNT | ax80 | 5775 | Ant2 | -12.3  | 3.53 | -8.77  | 30 | 30 | 2.2  | 3.73  | -- | Pass |
| NVNT | ax80 | 5210 | Ant1 | -9.7   | 0.28 | -9.42  | 11 | -- | 2.2  | -4.85 | 10 | Pass |
| NVNT | ax80 | 5210 | Ant2 | -5.87  | 0.28 | -5.59  | 11 | -- | 2.2  | -2.85 | 10 | Pass |
| NVNT | ax80 | 5210 | Sum  | -4.37  | 0.28 | -4.09  | 11 | -- | 5.01 | 2.08  | 10 | Pass |
| NVNT | ax80 | 5775 | Ant1 | -11.16 | 0.29 | -10.87 | 30 | 30 | 2.2  | -4.71 | -- | Pass |
| NVNT | ax80 | 5775 | Ant2 | -9.57  | 0.29 | -9.28  | 30 | 30 | 2.2  | -3.24 | -- | Pass |
| NVNT | ax80 | 5775 | Sum  | -7.28  | 0.29 | -6.99  | 30 | 30 | 5.01 | -1.98 | -- | Pass |

