


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 176 of 248

802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

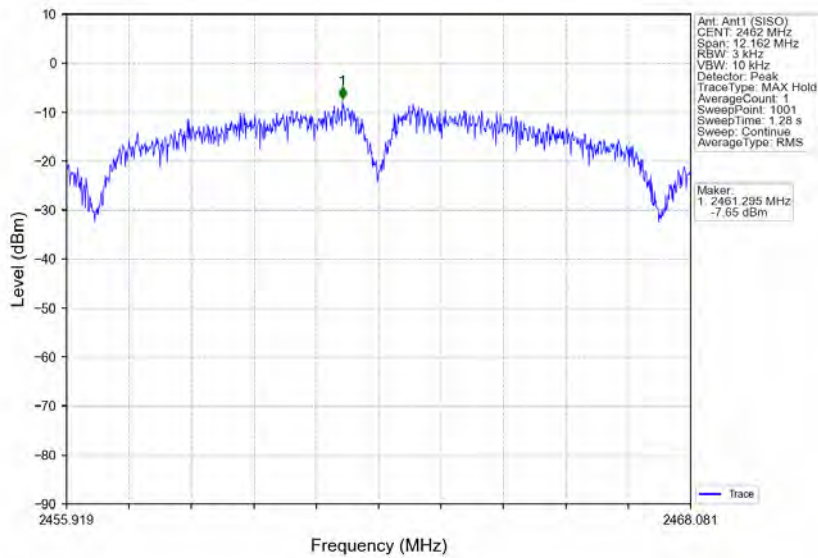

802.11b_HCH_2462MHz_Ant2 (SISO)_NTNV

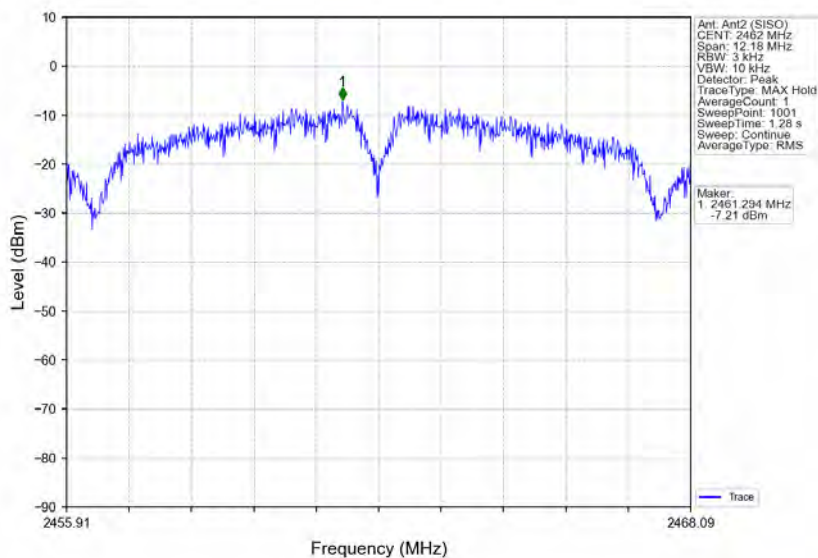


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 177 of 248


802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

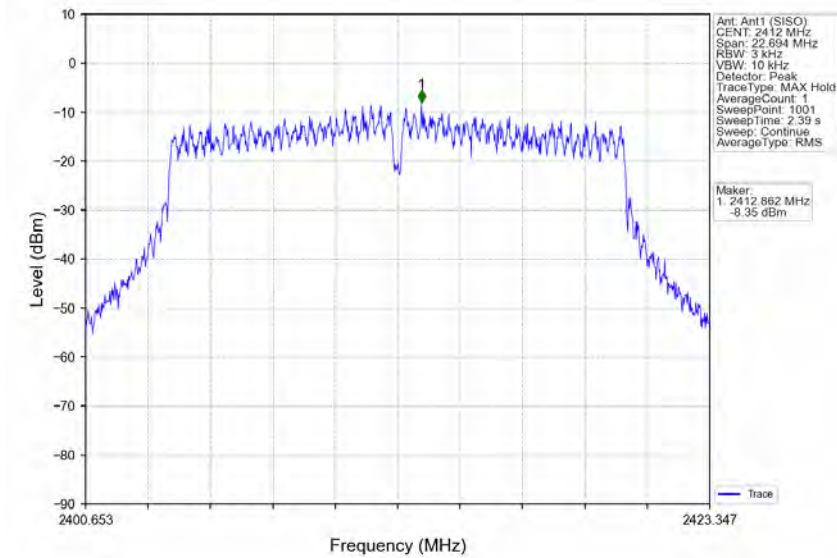


802.11g_LCH_2412MHz_Ant2 (SISO)_NTNV

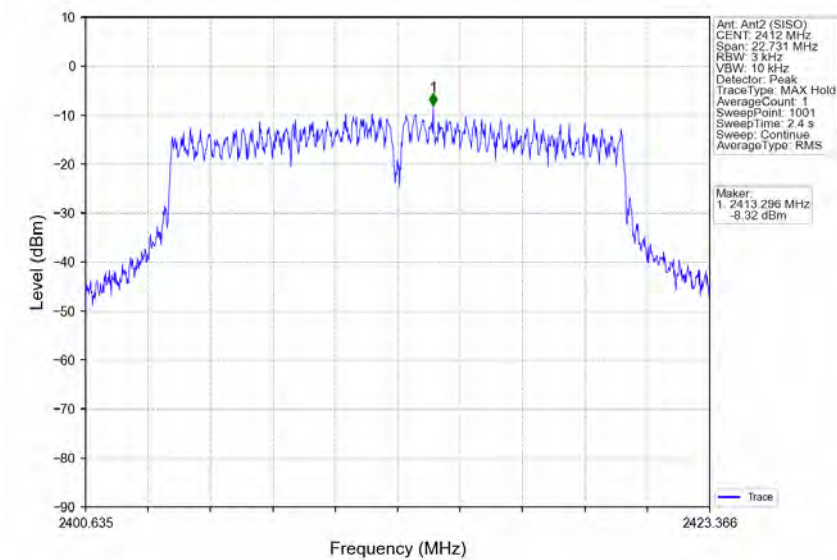


802.11g_MCH_2437MHz_Ant1 (SISO)_NTNV

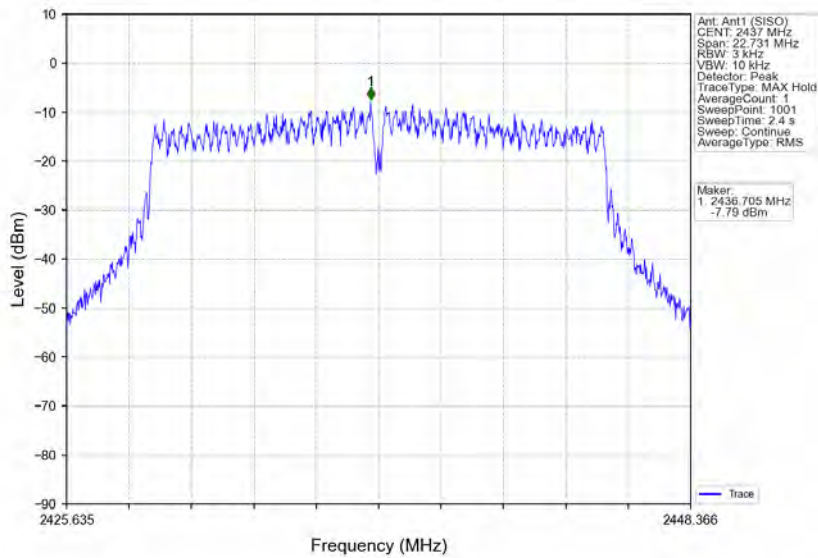


802.11g_MCH_2437MHz_Ant2 (SISO)_NTNV

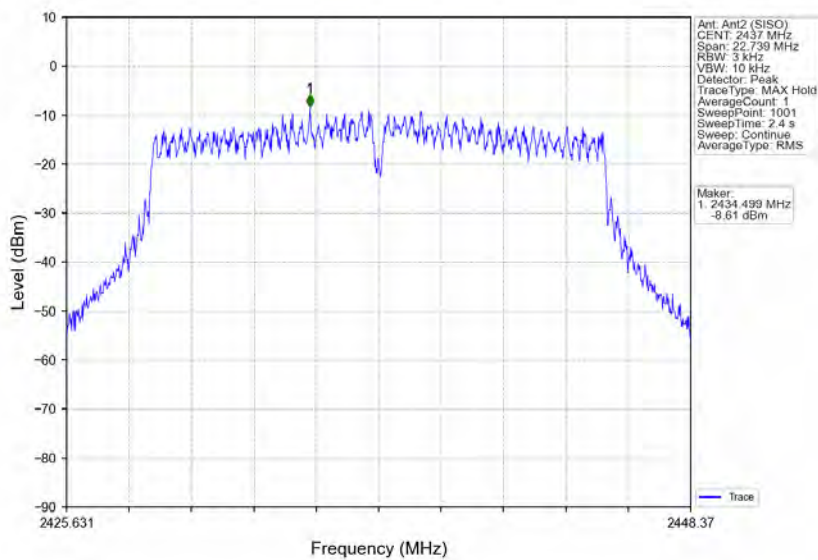

802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

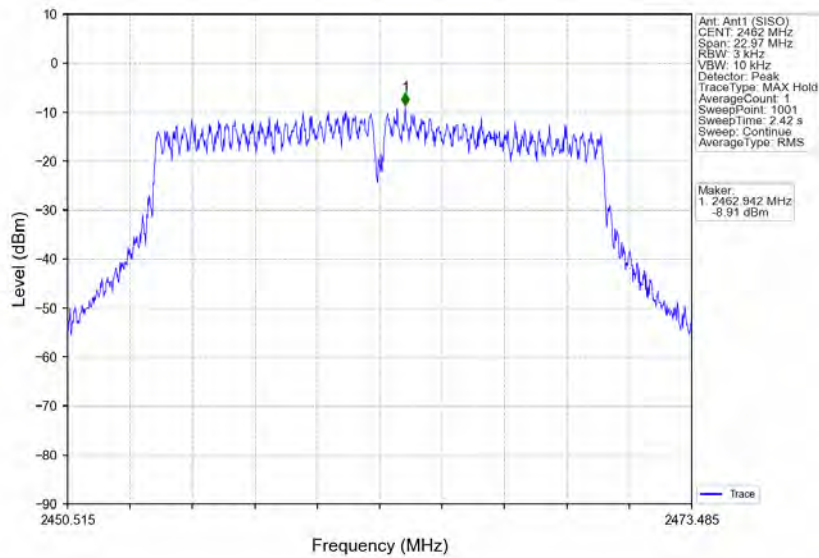

802.11g_HCH_2462MHz_Ant2 (SISO)_NTNV

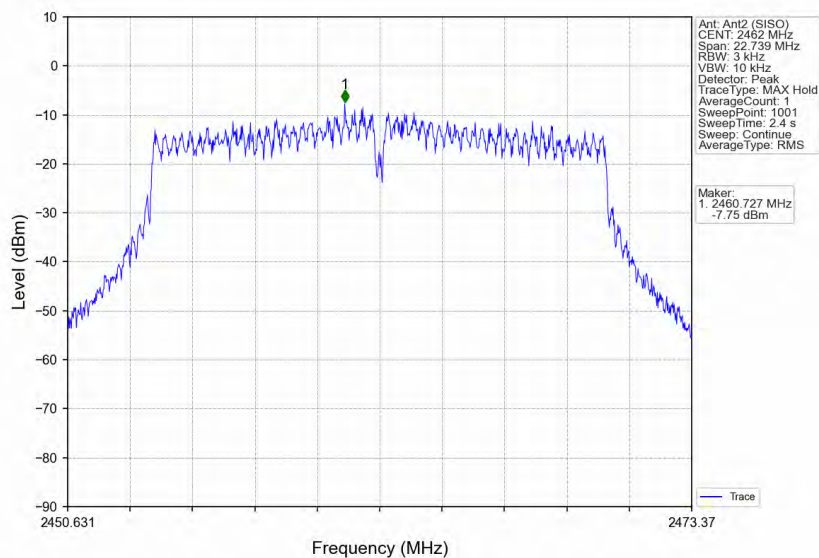


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 180 of 248

802.11n(HT20)_LCH_2412MHz_Ant1 (MIMO)_NTNV

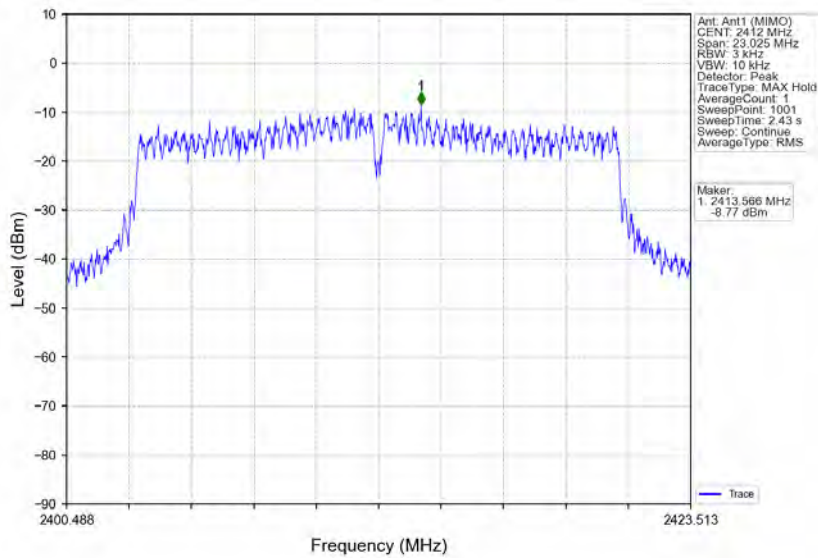

802.11n(HT20)_LCH_2412MHz_Ant2 (MIMO)_NTNV

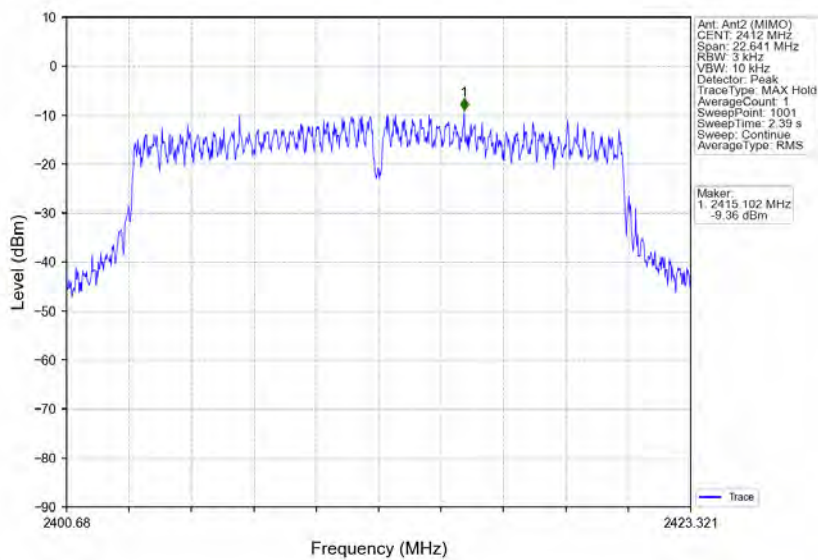


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 181 of 248


802.11n(HT20)_LCH_2412MHz_MIMO_NTNV

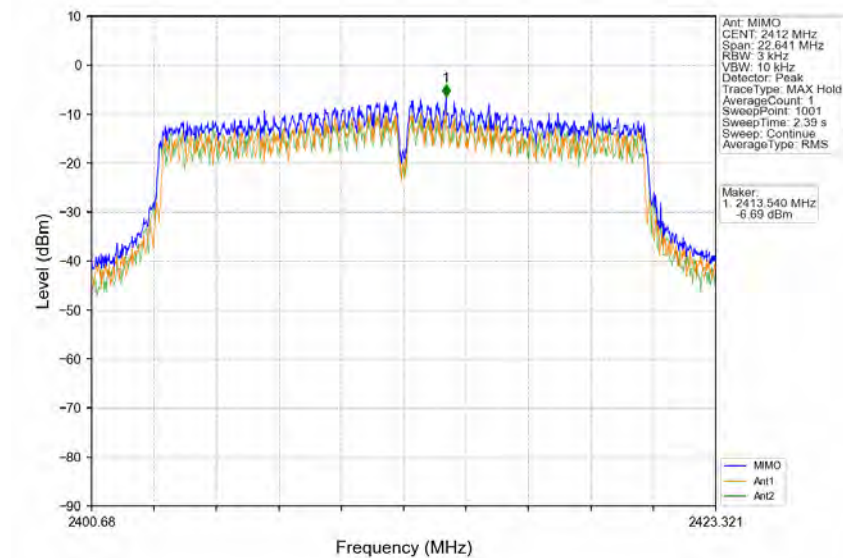


802.11n(HT20)_MCH_2437MHz_Ant1 (MIMO)_NTNV

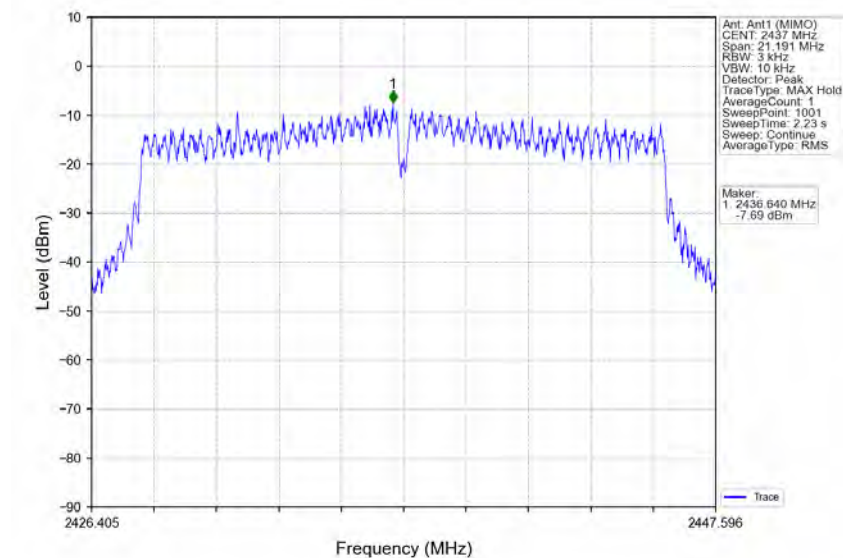

802.11n(HT20)_MCH_2437MHz_Ant2 (MIMO)_NTNV

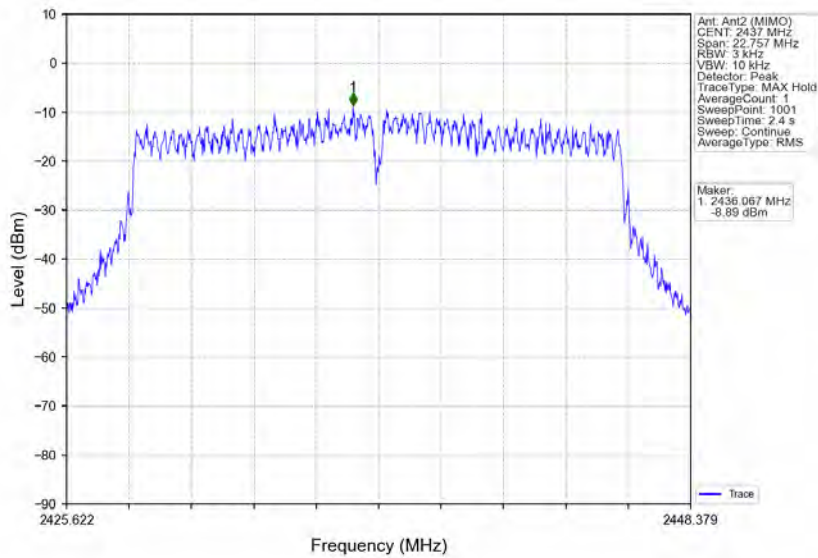

802.11n(HT20)_MCH_2437MHz_MIMO_NTNV

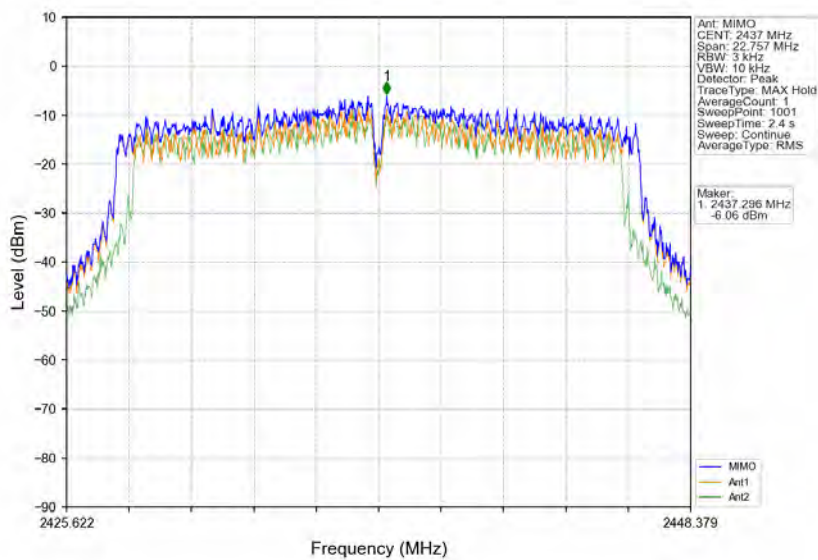


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 183 of 248

802.11n(HT20)_HCH_2462MHz_Ant1 (MIMO)_NTNV

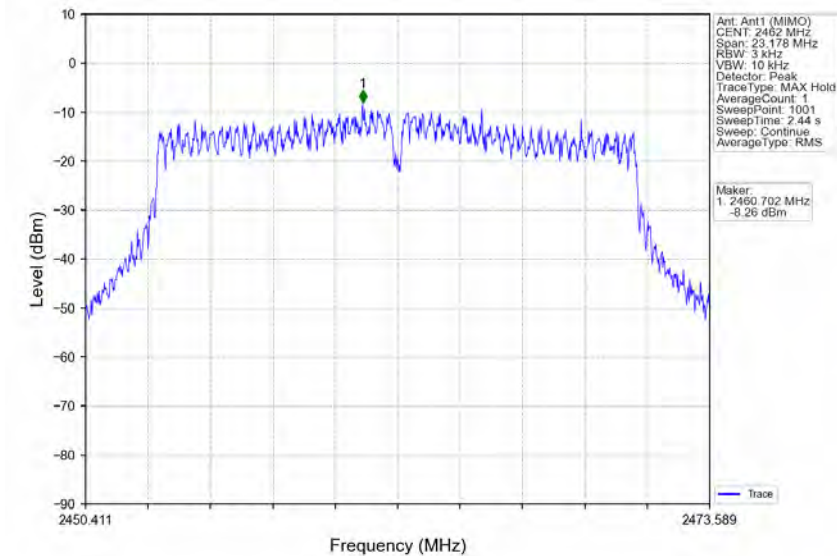

802.11n(HT20)_HCH_2462MHz_Ant2 (MIMO)_NTNV

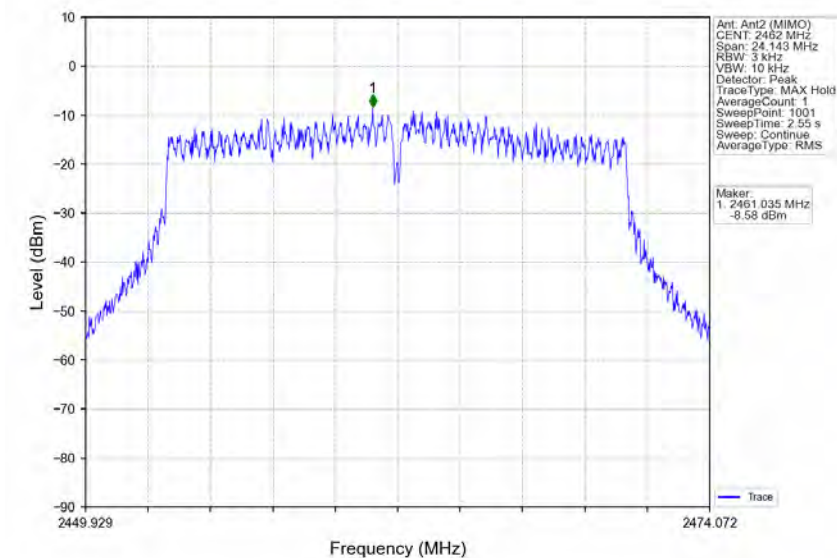


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 184 of 248

802.11n(HT20)_HCH_2462MHz_MIMO_NTNV

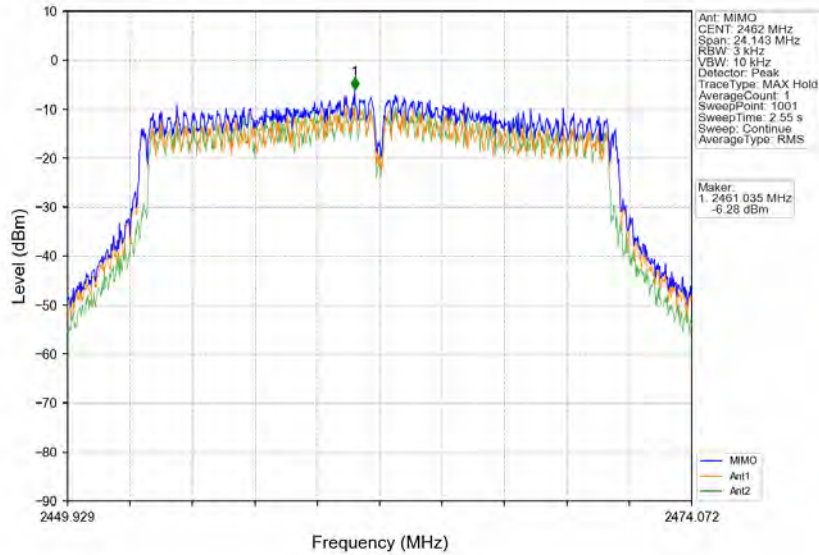

802.11n(HT40)_LCH_2422MHz_Ant1 (MIMO)_NTNV

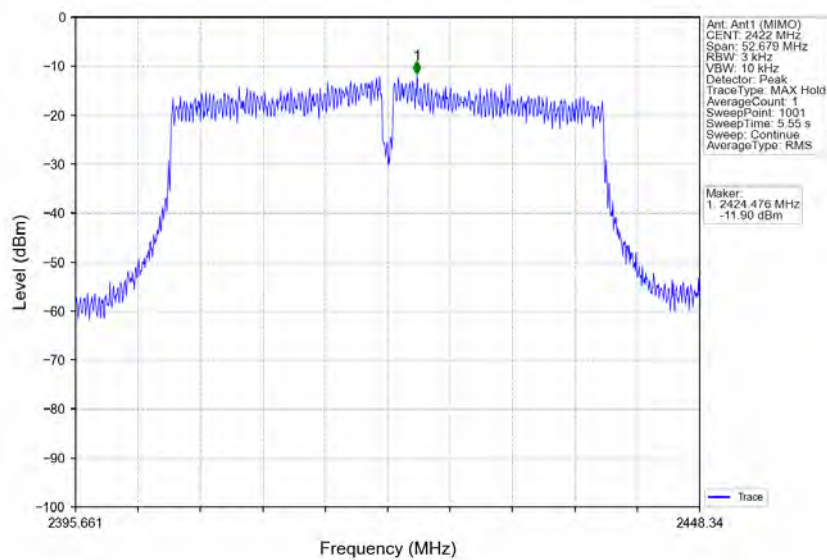


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 185 of 248

802.11n(HT40)_LCH_2422MHz_Ant2 (MIMO)_NTNV

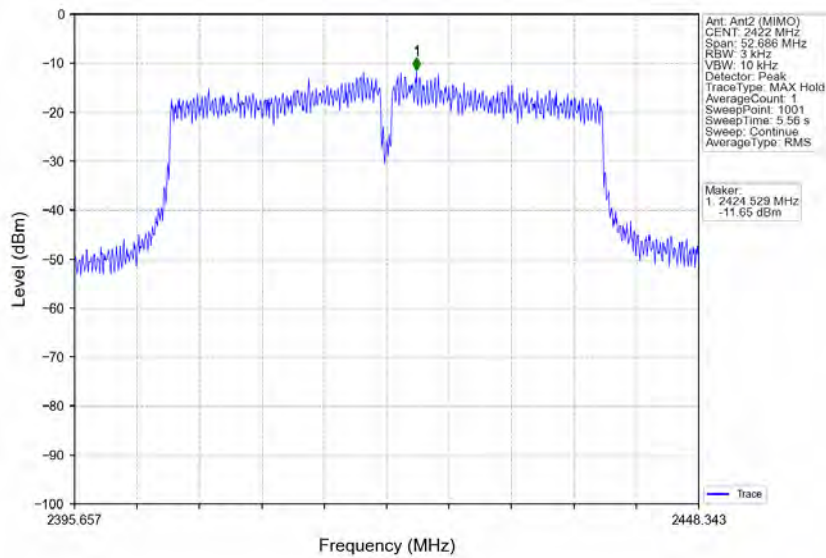

802.11n(HT40)_LCH_2422MHz_MIMO_NTNV

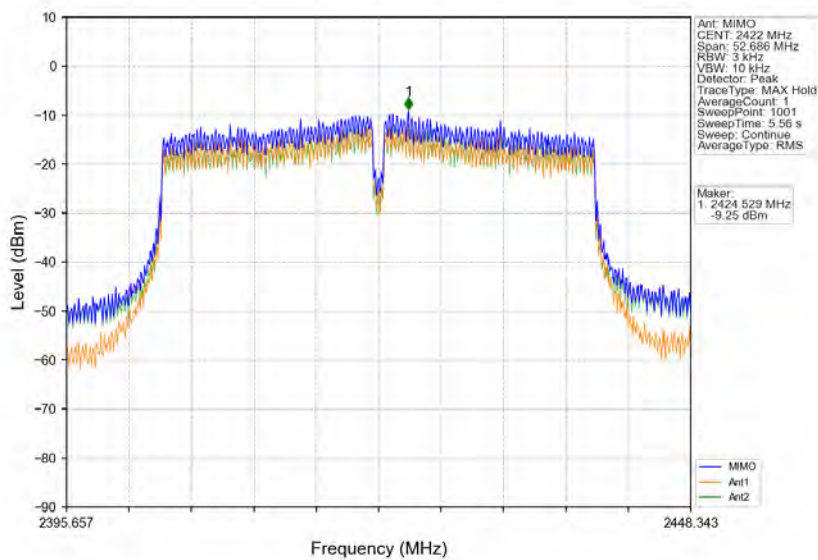


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 186 of 248

802.11n(HT40)_MCH_2437MHz_Ant1 (MIMO)_NTNV

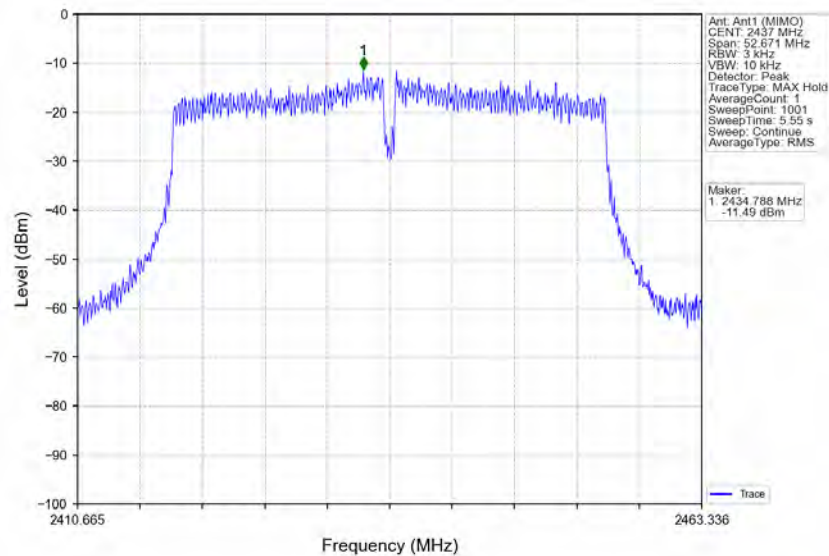

802.11n(HT40)_MCH_2437MHz_Ant2 (MIMO)_NTNV

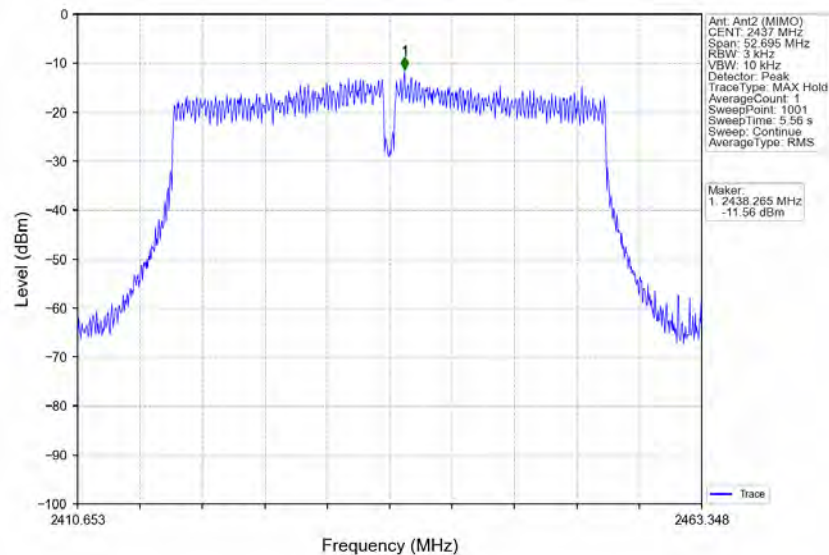


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 187 of 248

802.11n(HT40)_MCH_2437MHz_MIMO_NTNV

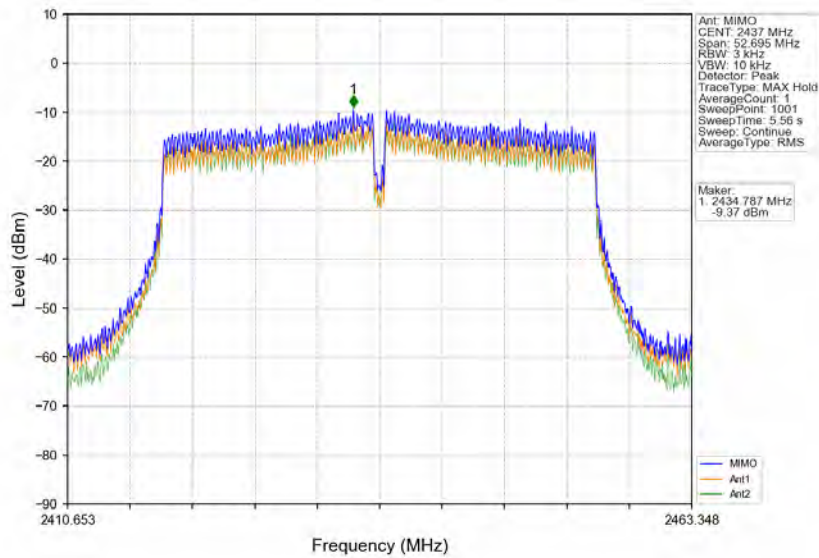

802.11n(HT40)_HCH_2452MHz_Ant1 (MIMO)_NTNV

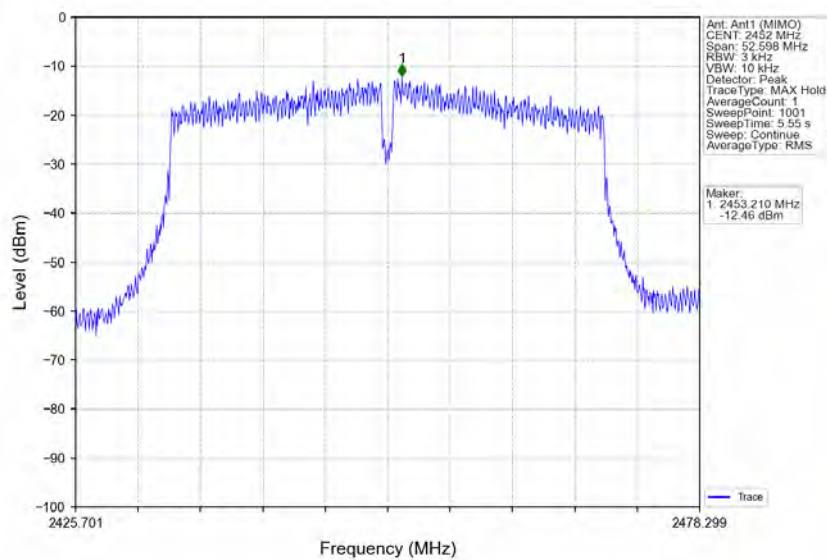


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 188 of 248

802.11n(HT40)_HCH_2452MHz_Ant2 (MIMO)_NTNV

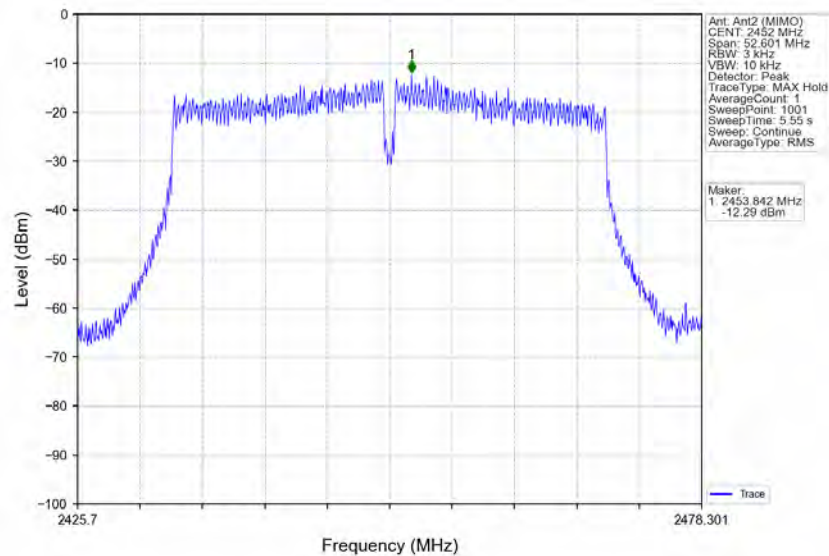

802.11n(HT40)_HCH_2452MHz_MIMO_NTNV

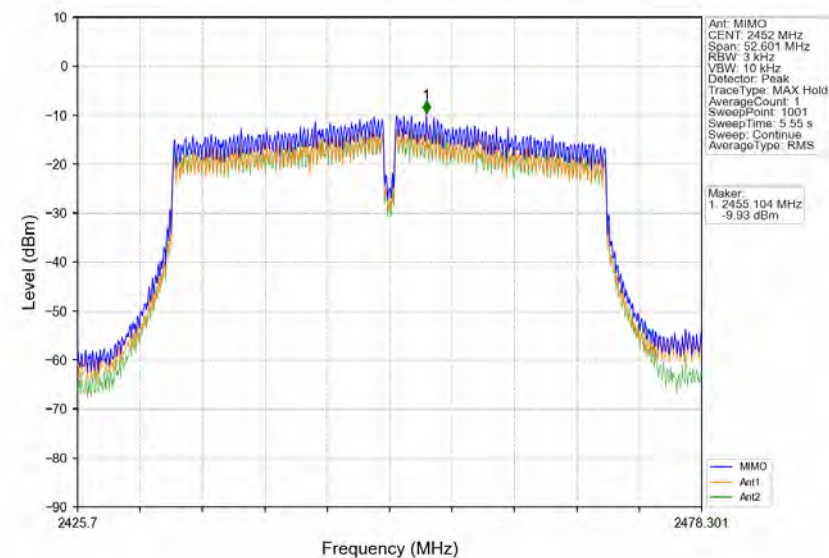


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 189 of 248


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant1 (MIMO)_NTNV

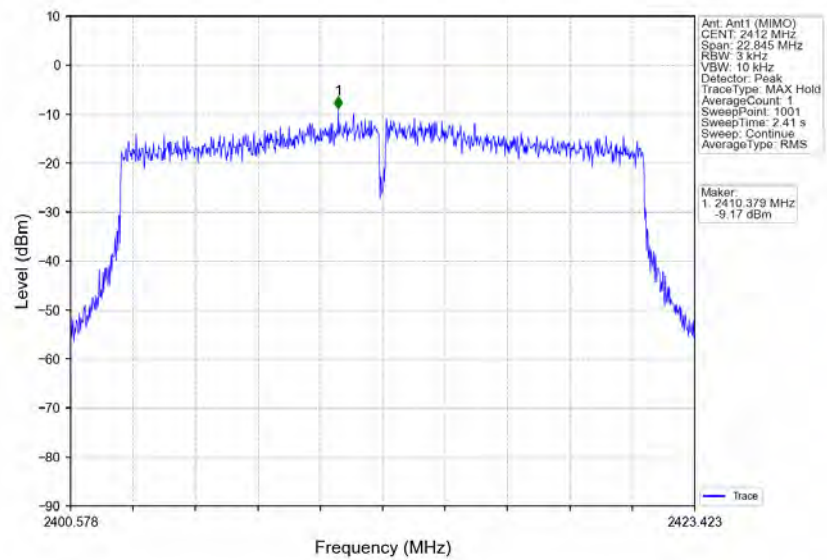


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant2 (MIMO)_NTNV

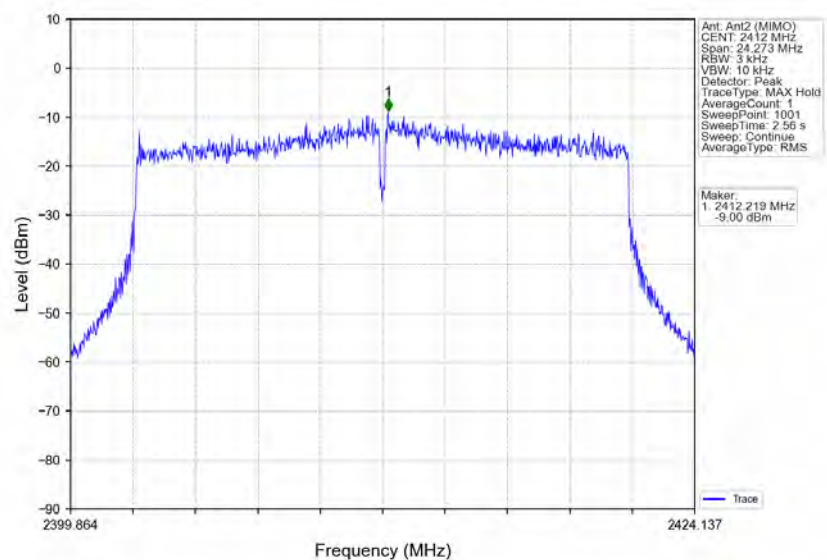

802.11ax(HEW20)_LCH_2412MHz_RU242_Left_MIMO_NTNV

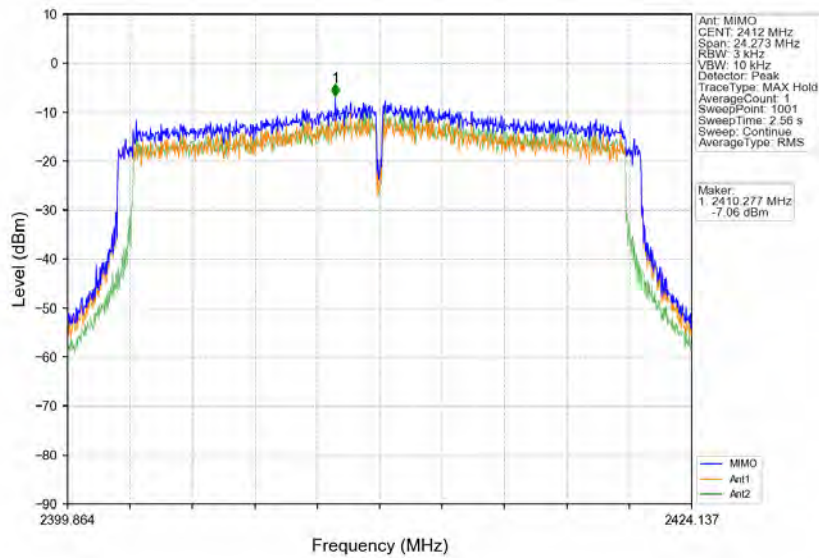

802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant1 (MIMO)_NTNV

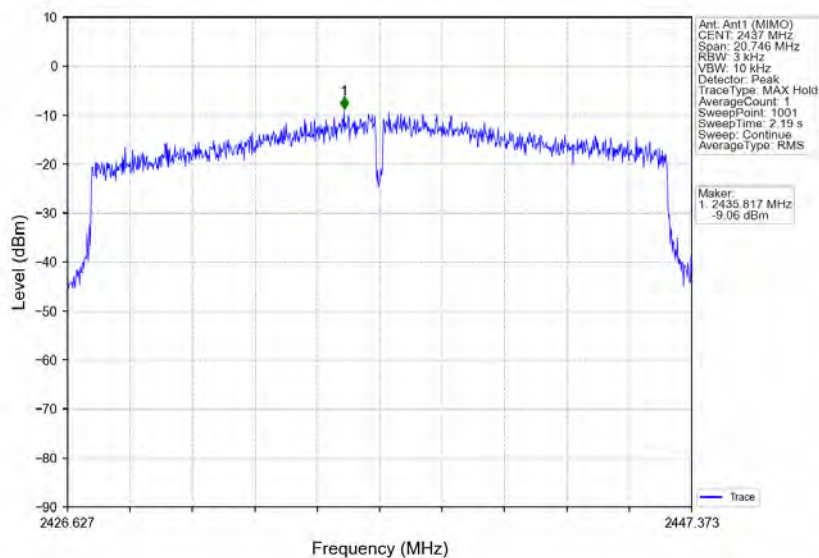


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 191 of 248


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant2 (MIMO)_NTNV

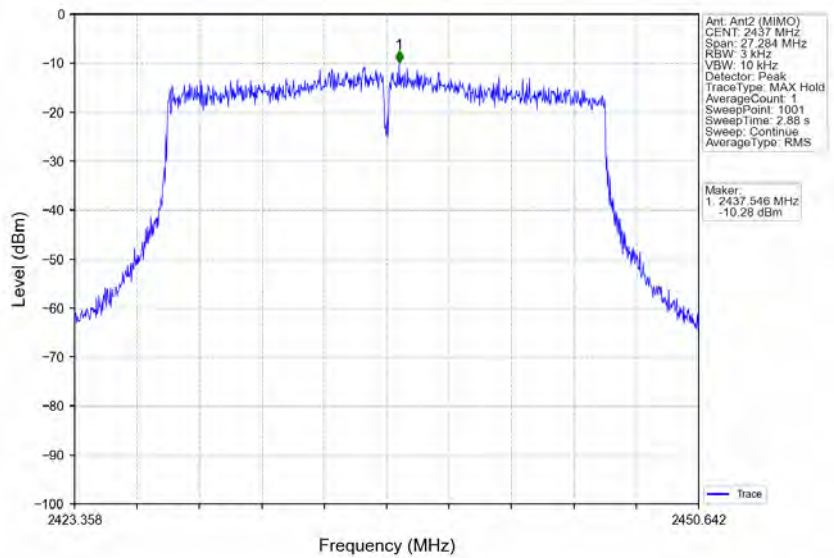


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_MIMO_NTNV

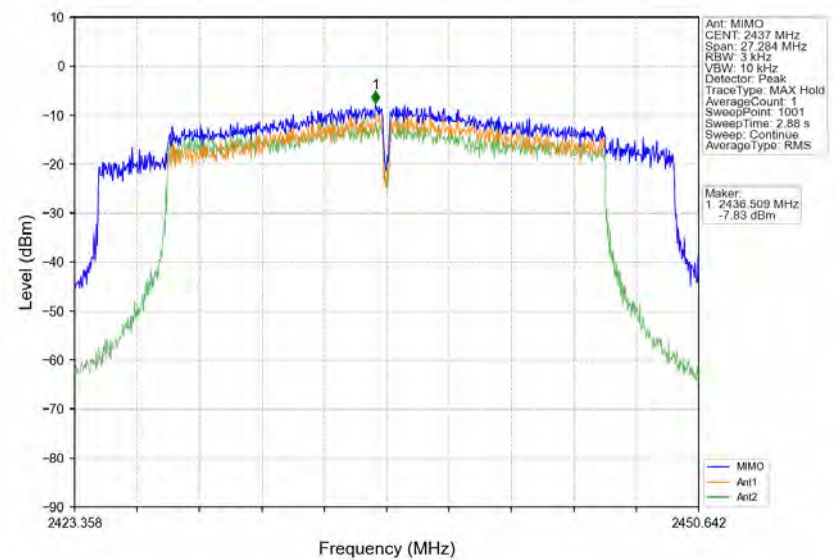


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant1 (MIMO)_NTNV

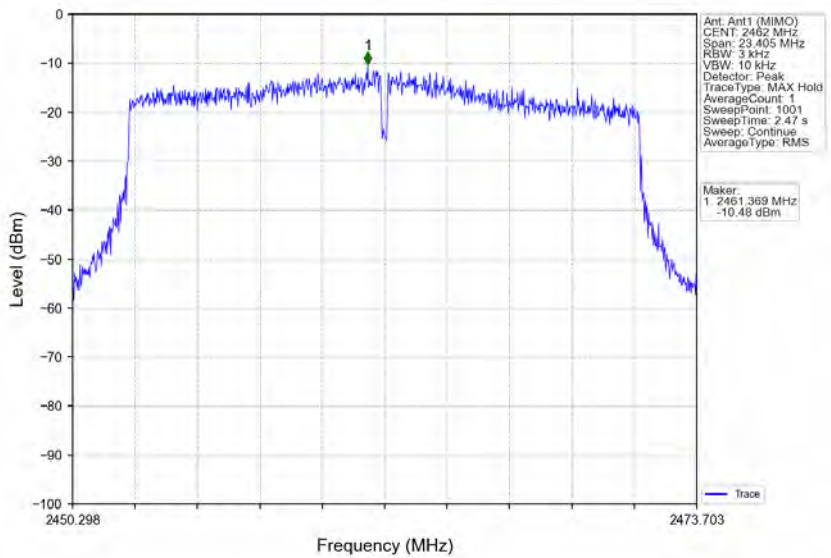


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant2 (MIMO)_NTNV

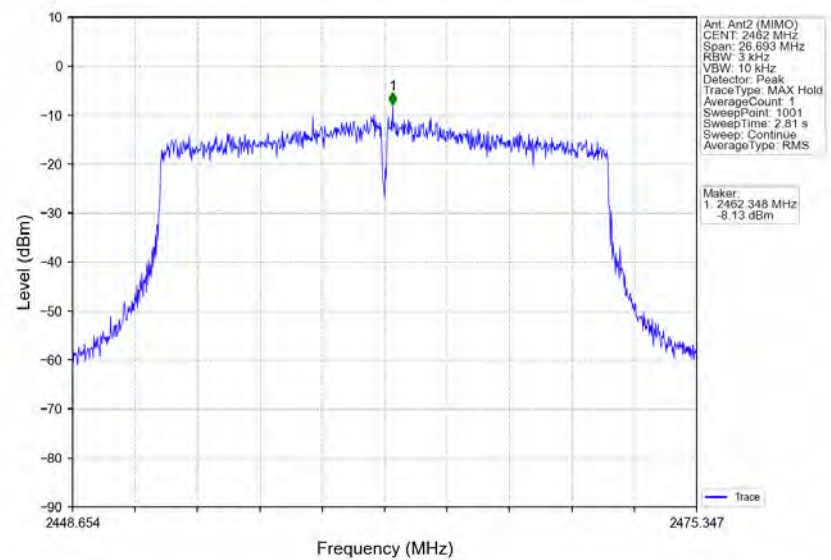


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_MIMO_NTNV

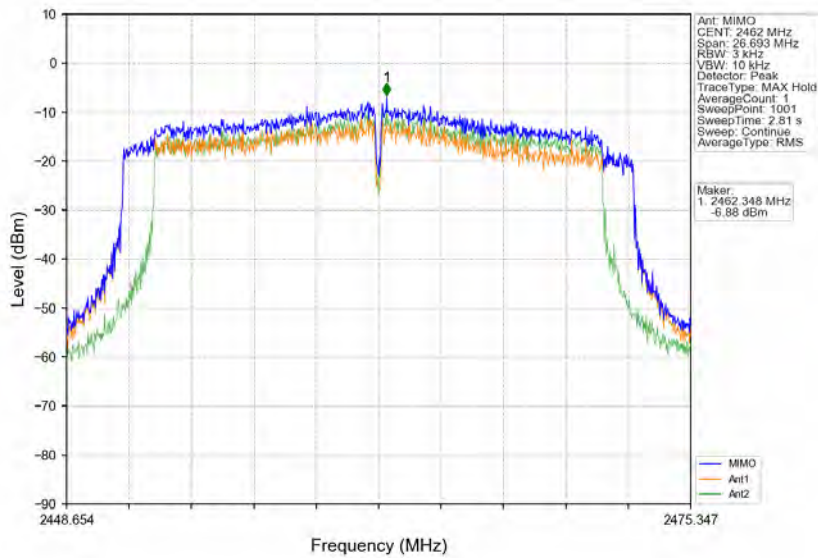


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant1 (MIMO)_NTNV

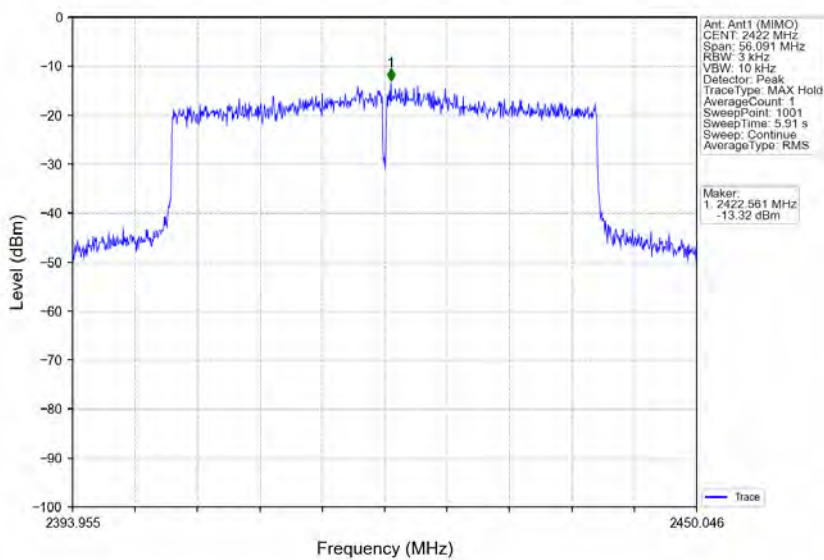


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant2 (MIMO)_NTNV

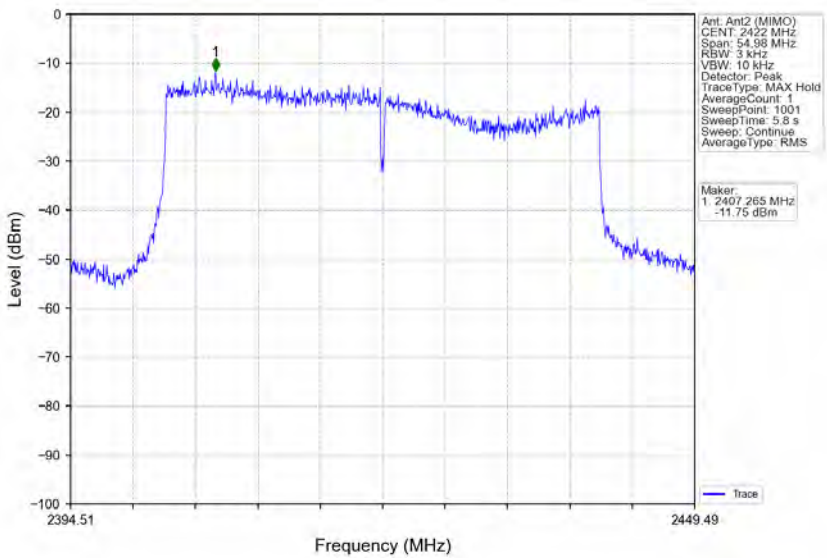


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_MIMO_NTNV

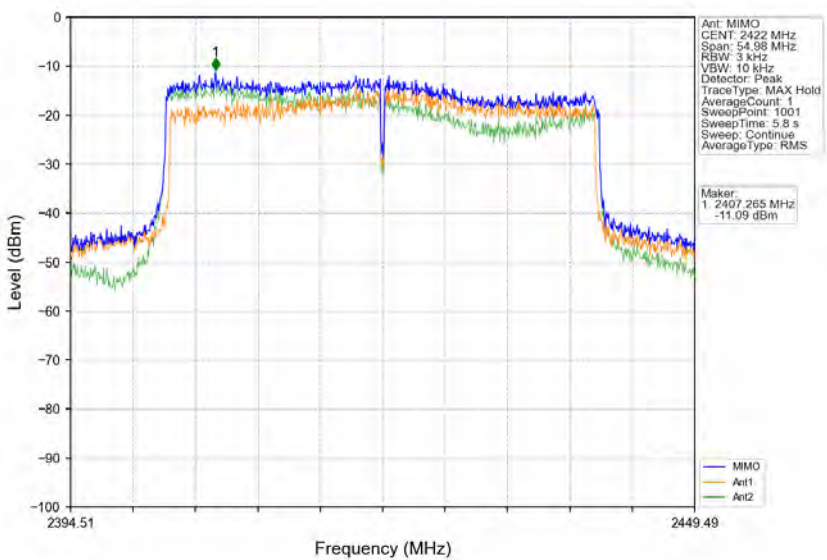


802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant1 (MIMO)_NTNV

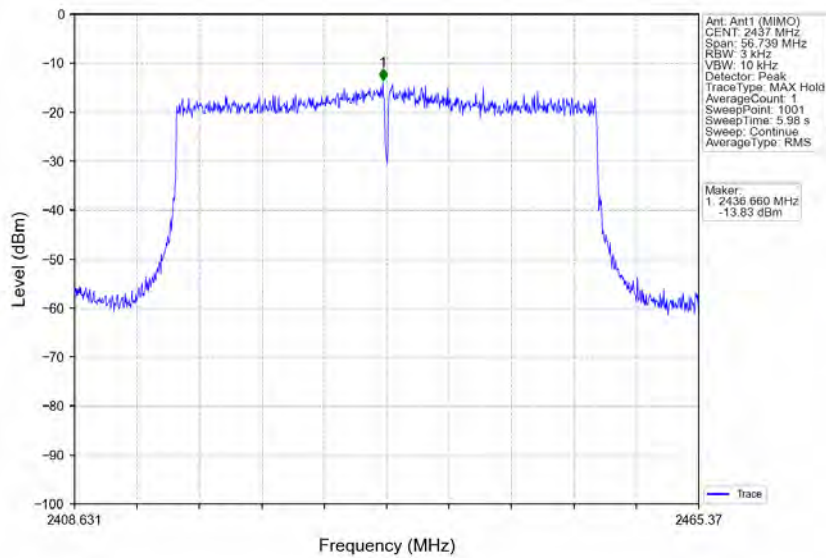


802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant2 (MIMO)_NTNV

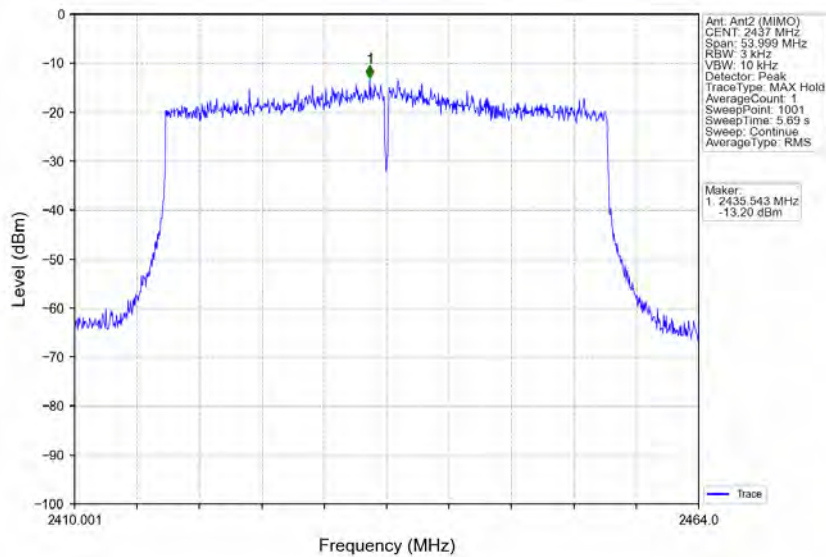

802.11ax(HEW40)_MCH_2437MHz_RU484_Left_MIMO_NTNV

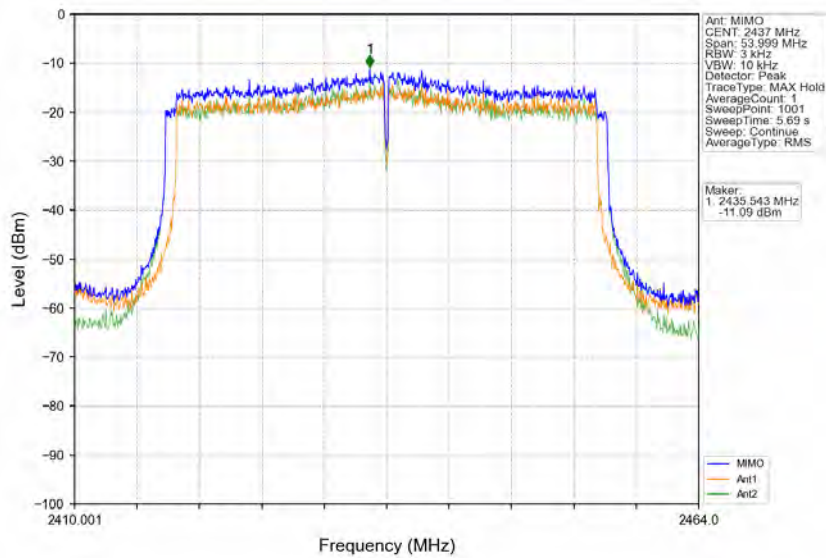

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant1 (MIMO)_NTNV

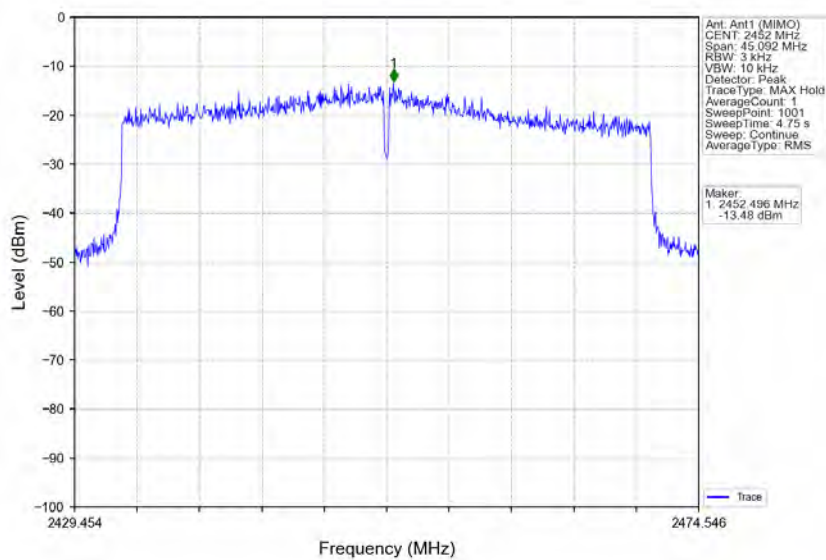


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 197 of 248

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant2 (MIMO)_NTNV

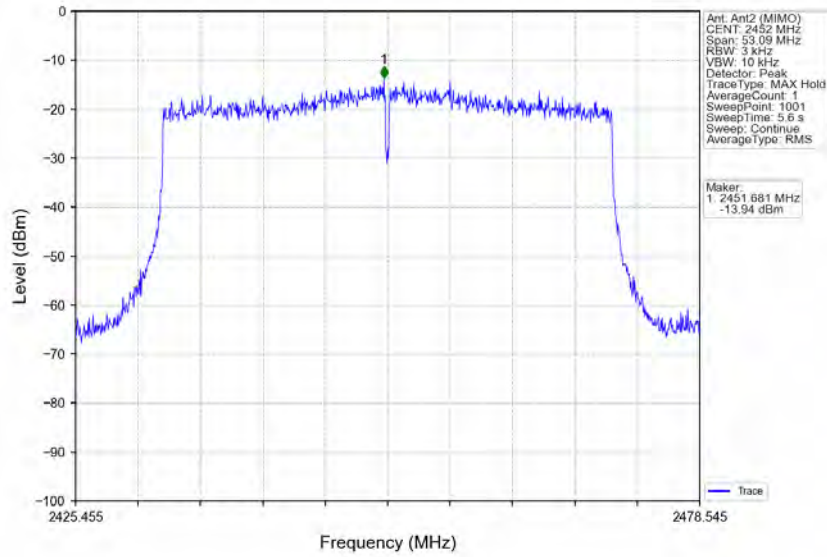

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_MIMO_NTNV

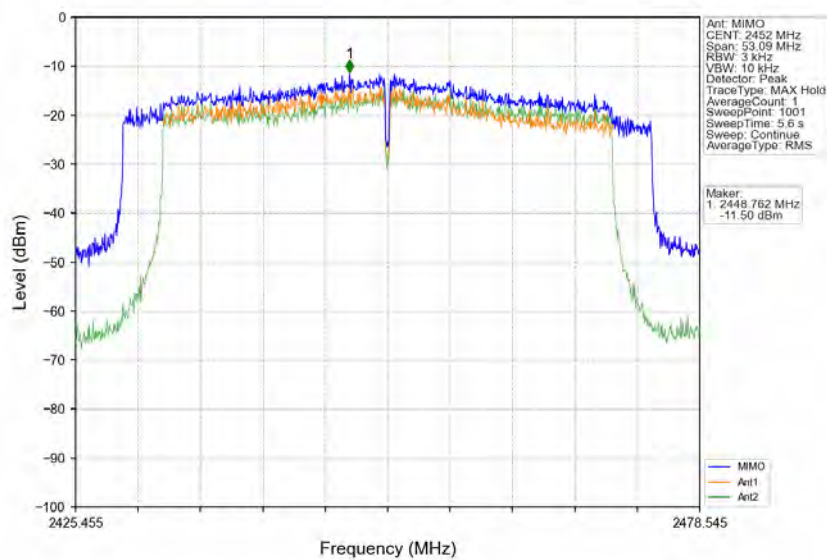

5. Unwanted Emissions In Non-restricted Frequency Bands

5.1 Test Result

5.1.1 Ref

Mode	TX Type	Frequency (MHz)	RU	RU Pos	ANT	Level of Reference (dBm)
802.11b	SISO	2412	/	/	1	7.93
					2	7.91
		2437	/	/	1	8.62
					2	5.61
		2462	/	/	1	7.76
					2	8.11
802.11g	SISO	2412	/	/	1	6.23
					2	6.26
		2437	/	/	1	6.23
					2	5.76
		2462	/	/	1	5.92
					2	5.99
802.11n (HT20)	MIMO	2412	/	/	1	5.89
					2	6.07
		2437	/	/	1	6.63
					2	6.31
		2462	/	/	1	5.28
					2	5.21
802.11n (HT40)	MIMO	2422	/	/	1	1.91
					2	2.40
		2437	/	/	1	2.24
					2	2.05
		2452	/	/	1	1.15
					2	1.06
802.11ax (HEW20)	MIMO	2412	RU242	Left	1	5.70
					2	5.23
		2437	RU242	Left	1	5.54

Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100001

Page: 199 of 248

					2	4.47
		2462	RU242	Left	1	3.25
					2	5.37
802.11ax (HEW40)	MIMO	2422	RU484	Left	1	1.57
					2	2.77
		2437	RU484	Left	1	0.93
					2	1.35
		2452	RU484	Left	1	1.50
					2	0.87

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.

5.1.2 CSE

Mode	TX Type	Frequency (MHz)	RU	RU Pos	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
802.11b	SISO	2412	/	/	1	8.62	-11.38	Pass
					2	8.11	-11.89	Pass
		2437	/	/	1	8.62	-11.38	Pass
					2	8.11	-11.89	Pass
		2462	/	/	1	8.62	-11.38	Pass
					2	8.11	-11.89	Pass
802.11g	SISO	2412	/	/	1	6.23	-13.77	Pass
					2	6.26	-13.74	Pass
		2437	/	/	1	6.23	-13.77	Pass
					2	6.26	-13.74	Pass
		2462	/	/	1	6.23	-13.77	Pass
					2	6.26	-13.74	Pass
802.11n (HT20)	MIMO	2412	/	/	1	6.63	-13.37	Pass
					2	6.31	-13.69	Pass
		2437	/	/	1	6.63	-13.37	Pass
					2	6.31	-13.69	Pass
		2462	/	/	1	6.63	-13.37	Pass
					2	6.31	-13.69	Pass
802.11n (HT40)	MIMO	2422	/	/	1	2.24	-17.76	Pass
					2	2.40	-17.60	Pass
		2437	/	/	1	2.24	-17.76	Pass
					2	2.40	-17.60	Pass
		2452	/	/	1	2.24	-17.76	Pass
					2	2.40	-17.60	Pass
802.11ax (HEW20)	MIMO	2412	RU242	Left	1	5.70	-14.30	Pass
					2	5.37	-14.63	Pass



Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100001


Page: 200 of 248

		2437	RU242	Left	1	5.70	-14.30	Pass
					2	5.37	-14.63	Pass
		2462	RU242	Left	1	5.70	-14.30	Pass
					2	5.37	-14.63	Pass
802.11ax (HEW40)	MIMO	2422	RU484	Left	1	1.57	-18.43	Pass
					2	2.77	-17.23	Pass
		2437	RU484	Left	1	1.57	-18.43	Pass
					2	2.77	-17.23	Pass
		2452	RU484	Left	1	1.57	-18.43	Pass
					2	2.77	-17.23	Pass

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.

5.2 Test Graph

5.2.1 Ref

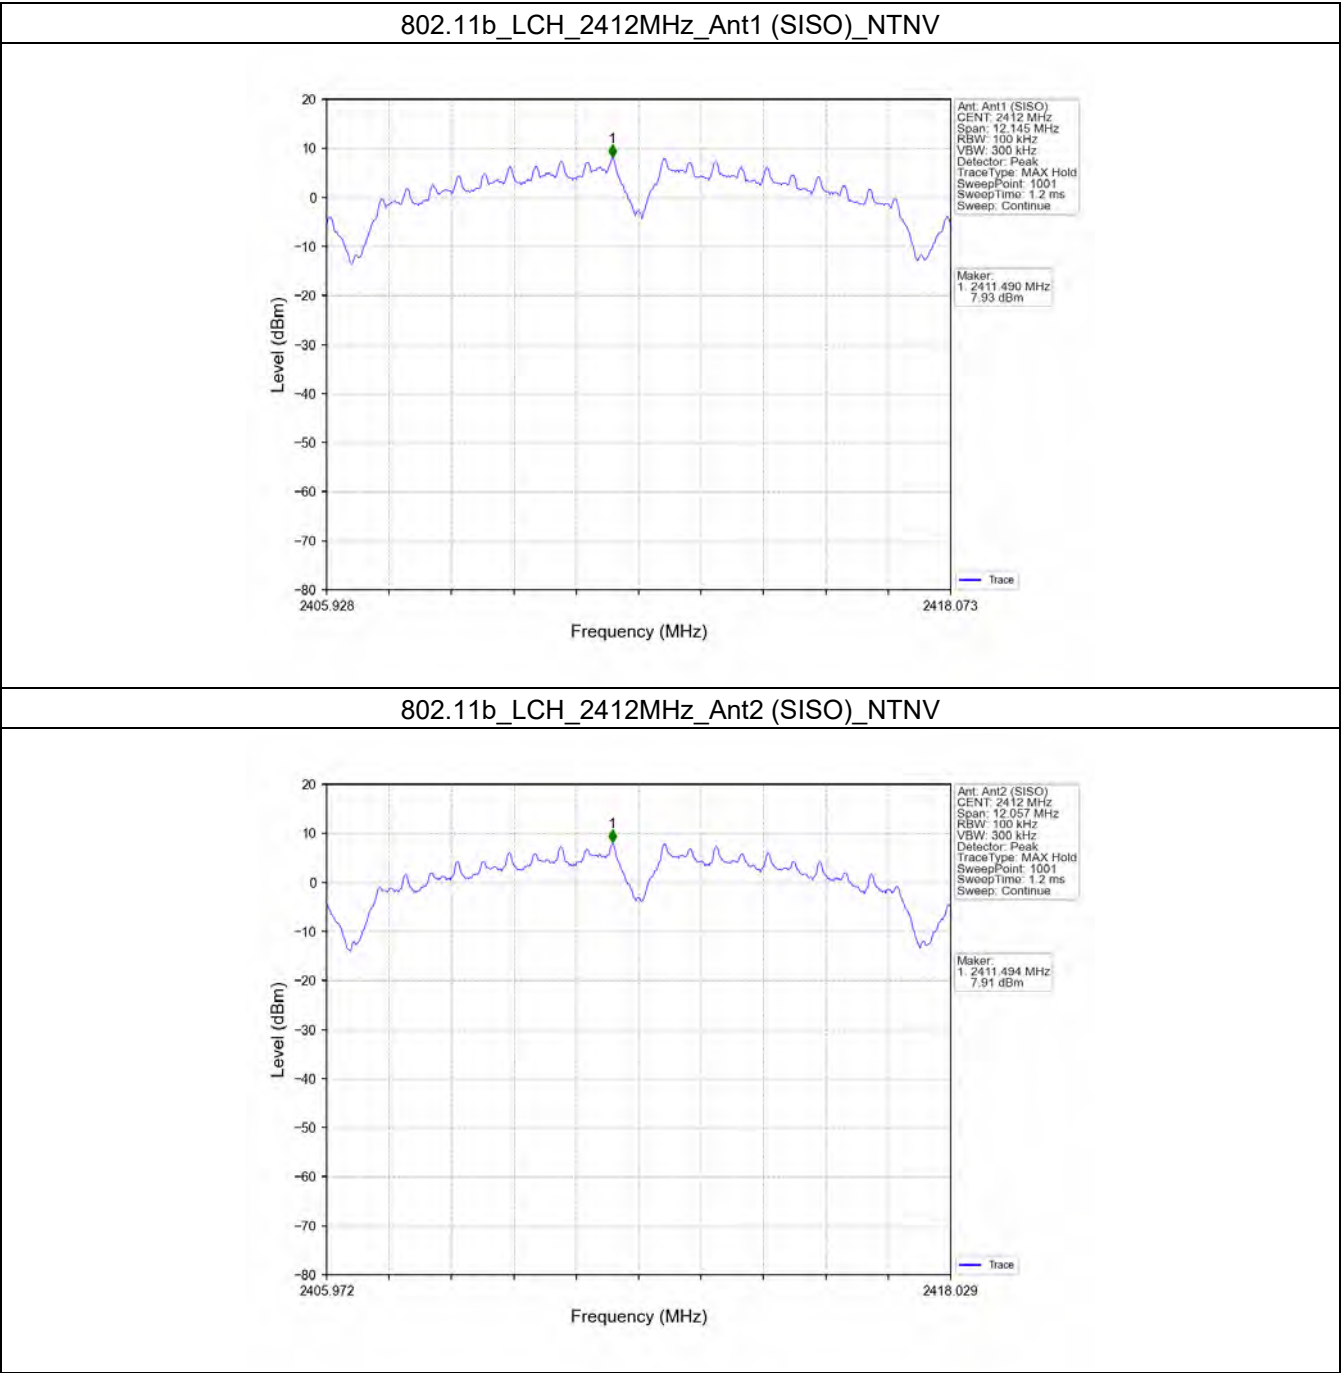


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 202 of 248


802.11b_MCH_2437MHz_Ant1 (SISO)_NTNV

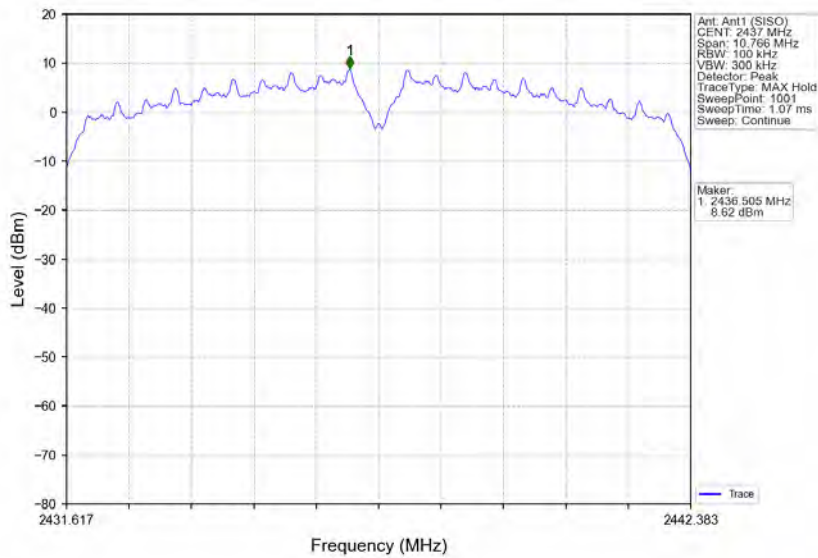


802.11b_MCH_2437MHz_Ant2 (SISO)_NTNV

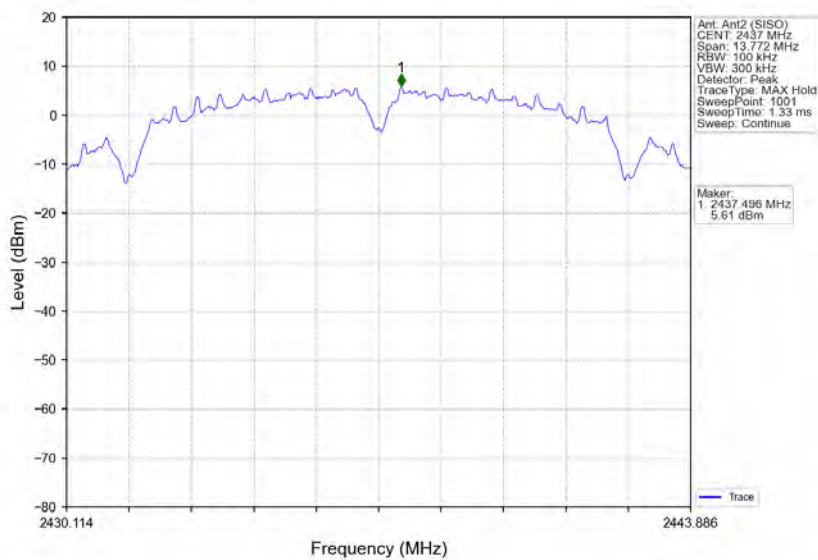

802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

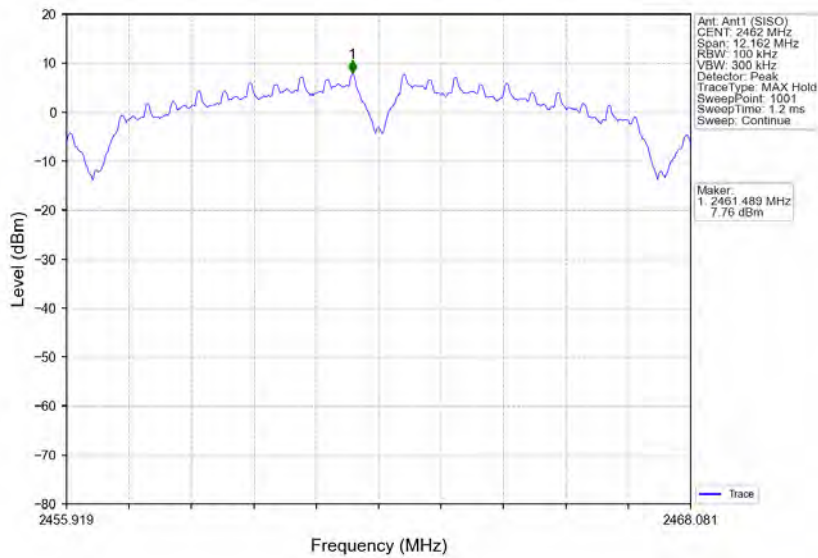

802.11b_HCH_2462MHz_Ant2 (SISO)_NTNV

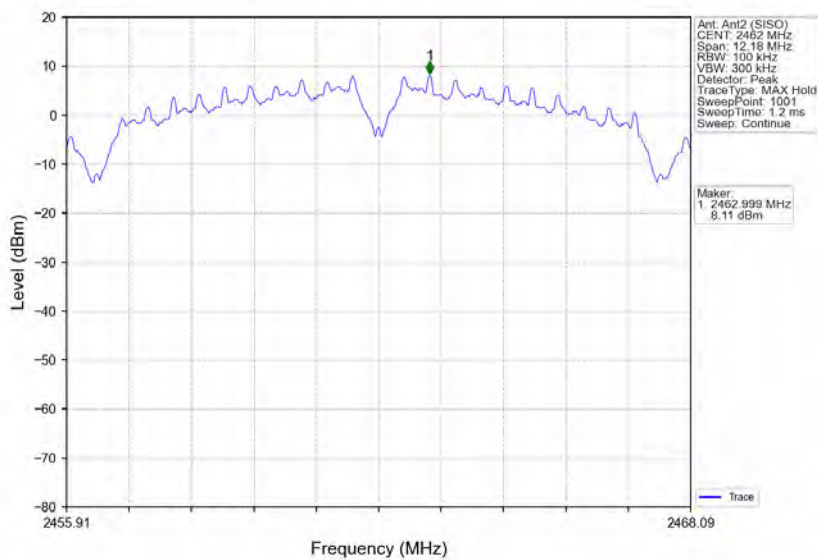


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 204 of 248

802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

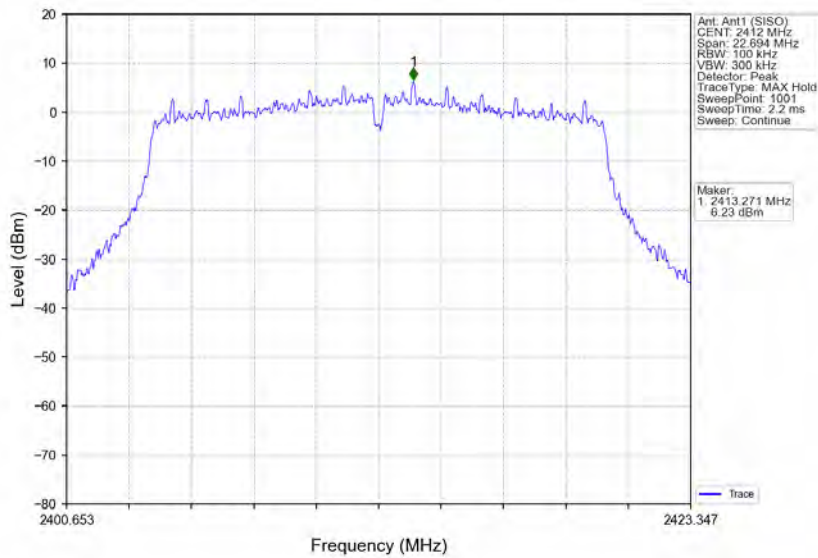

802.11g_LCH_2412MHz_Ant2 (SISO)_NTNV

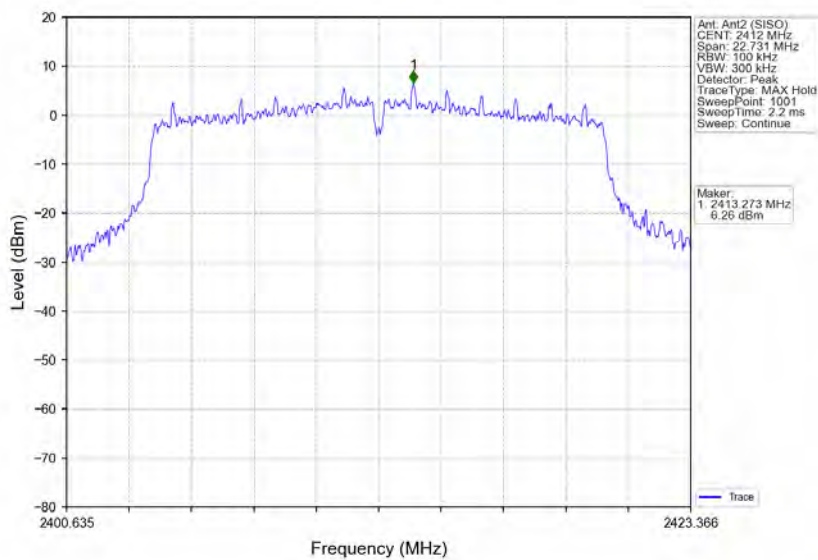


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 205 of 248

802.11g_MCH_2437MHz_Ant1 (SISO)_NTNV

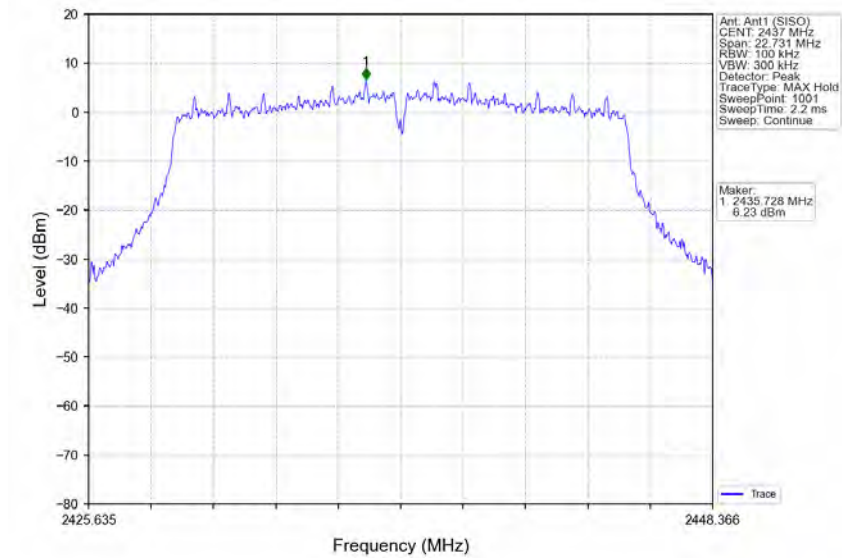

802.11g_MCH_2437MHz_Ant2 (SISO)_NTNV

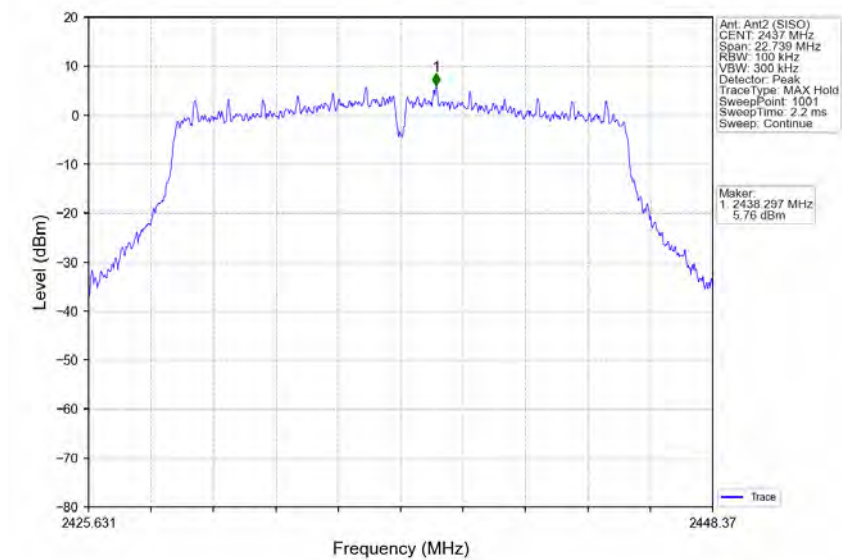


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 206 of 248

802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

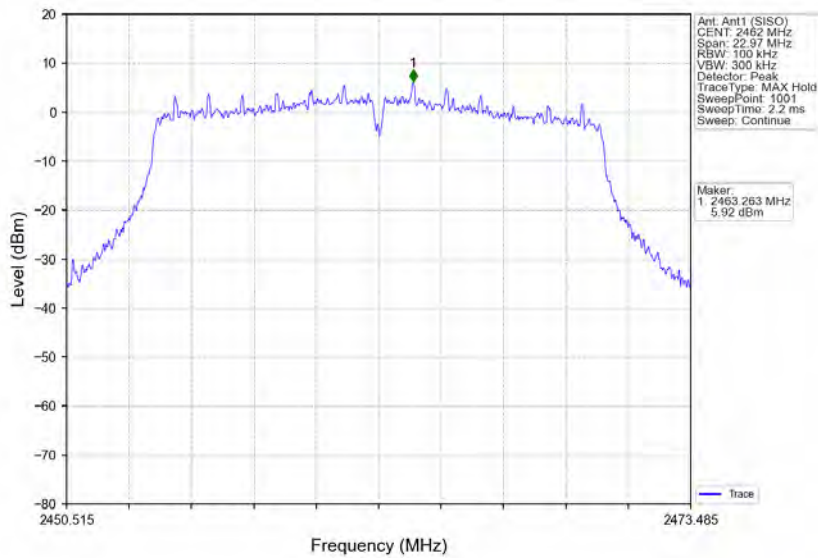

802.11g_HCH_2462MHz_Ant2 (SISO)_NTNV

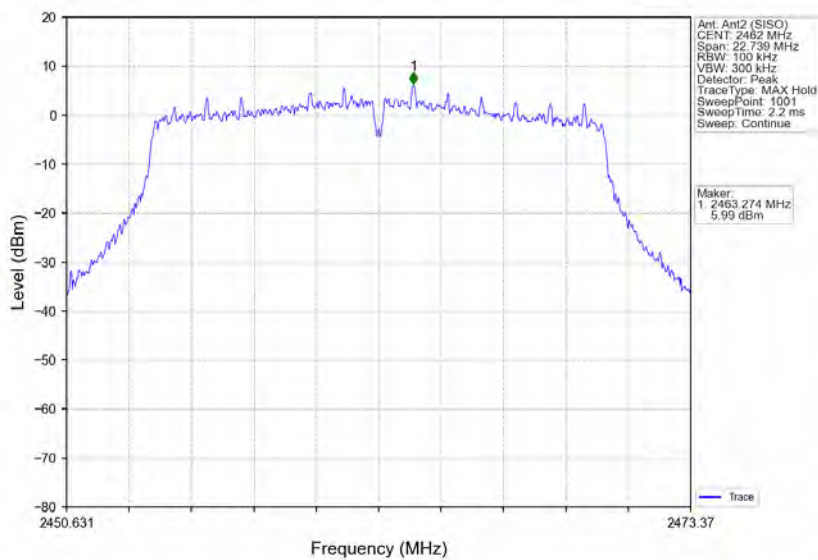


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 207 of 248


802.11n(HT20)_LCH_2412MHz_Ant1 (MIMO)_NTNV

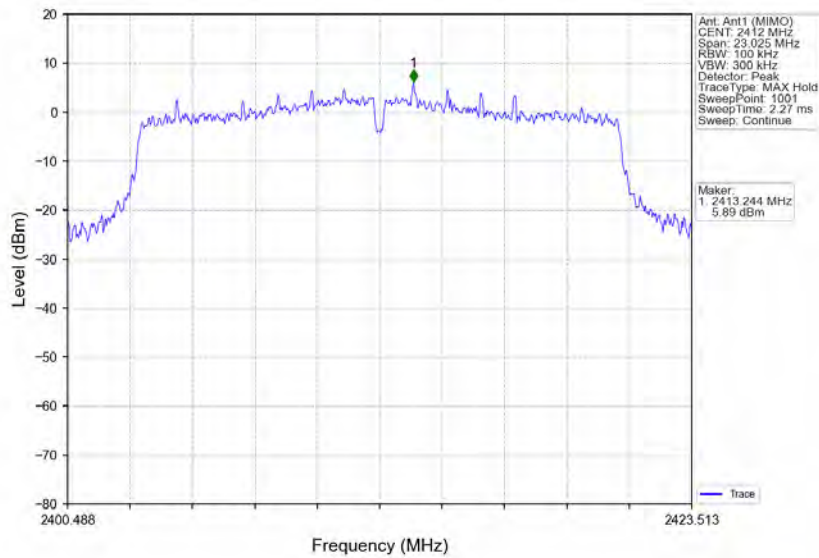


802.11n(HT20)_LCH_2412MHz_Ant2 (MIMO)_NTNV

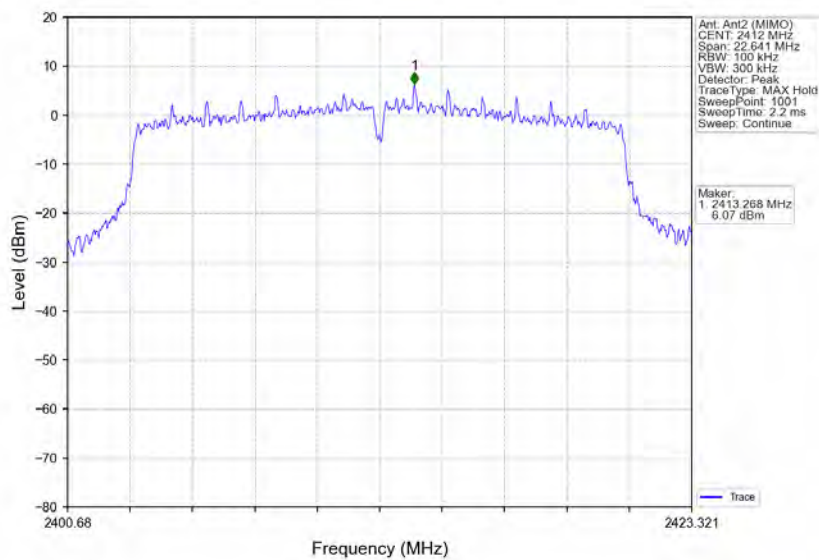

802.11n(HT20)_MCH_2437MHz_Ant1 (MIMO)_NTNV

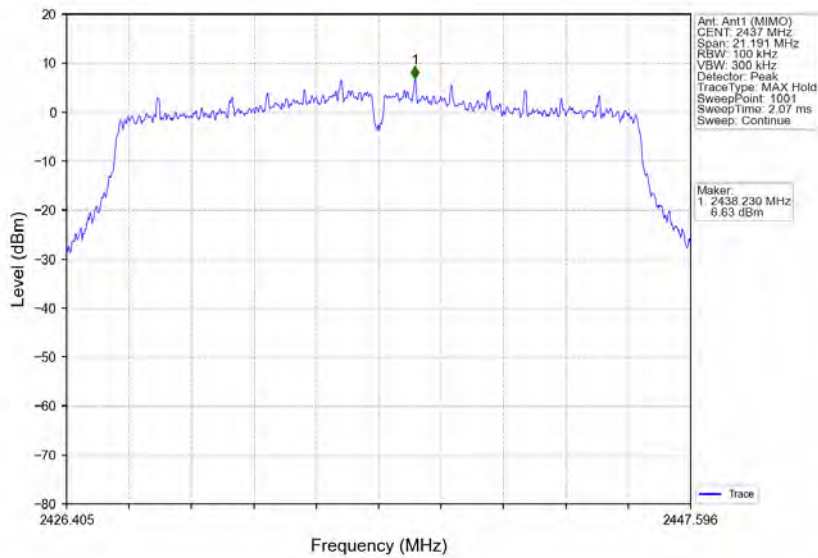

802.11n(HT20)_MCH_2437MHz_Ant2 (MIMO)_NTNV

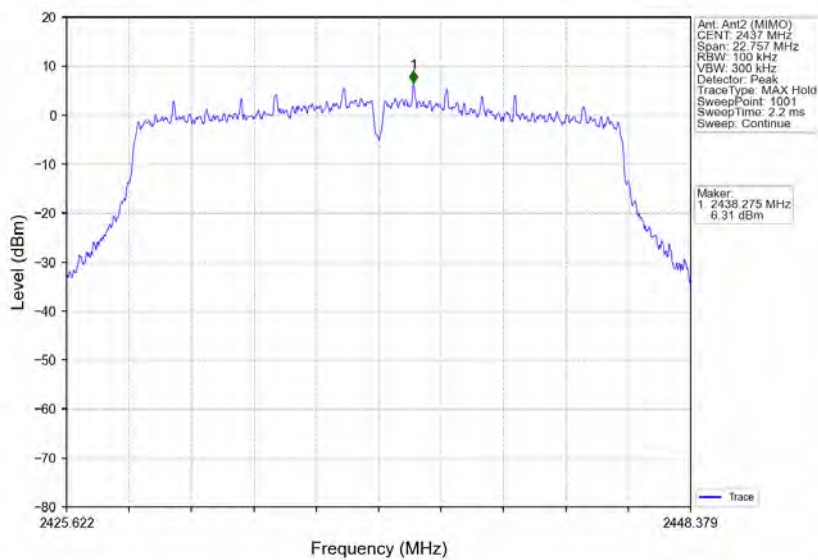


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 209 of 248

802.11n(HT20)_HCH_2462MHz_Ant1 (MIMO)_NTNV

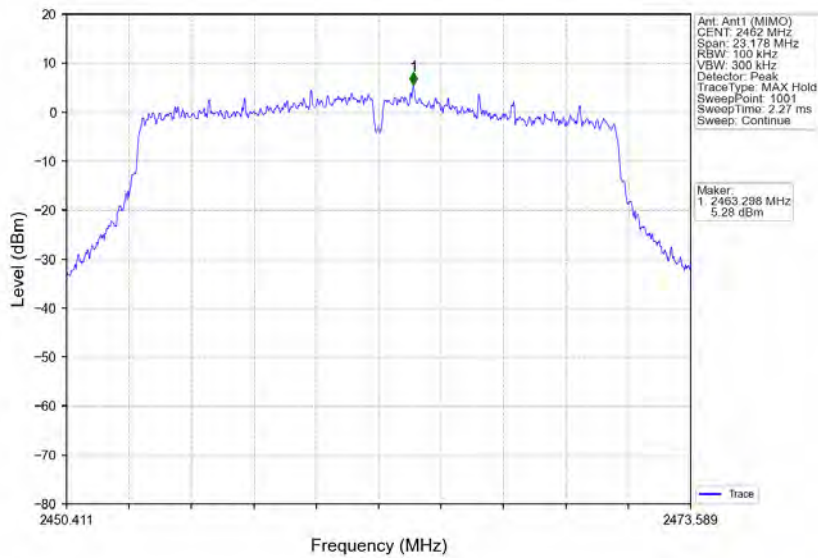

802.11n(HT20)_HCH_2462MHz_Ant2 (MIMO)_NTNV

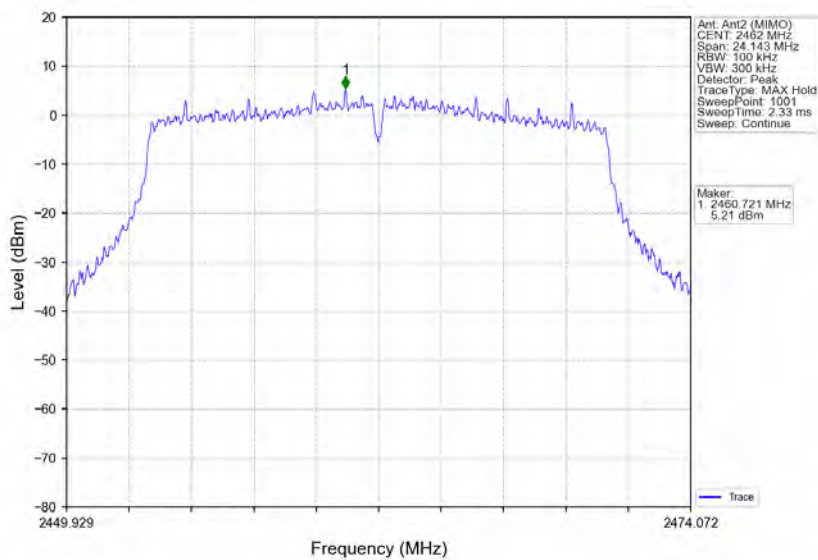


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 210 of 248

802.11n(HT40)_LCH_2422MHz_Ant1 (MIMO)_NTNV

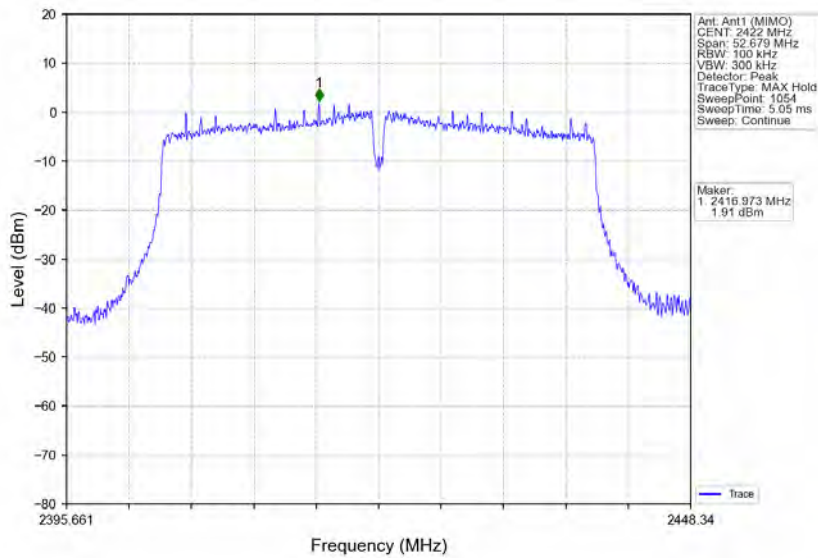

802.11n(HT40)_LCH_2422MHz_Ant2 (MIMO)_NTNV

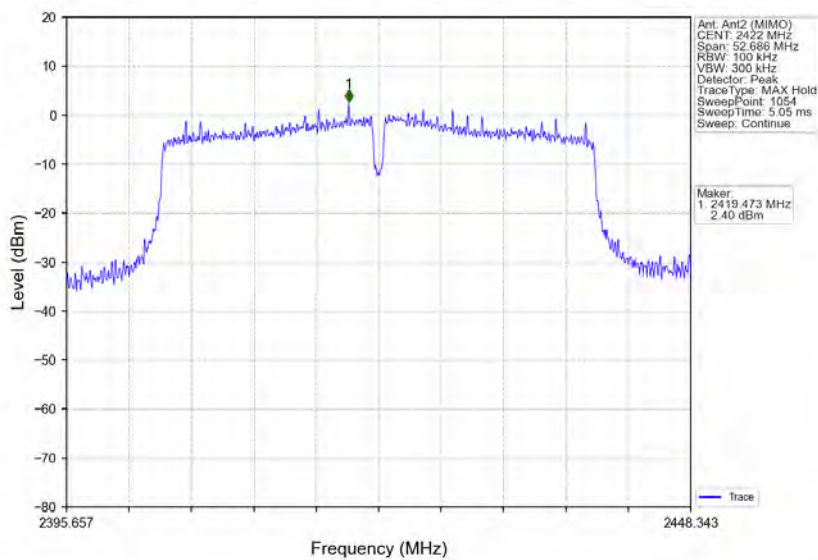


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 211 of 248

802.11n(HT40)_MCH_2437MHz_Ant1 (MIMO)_NTNV

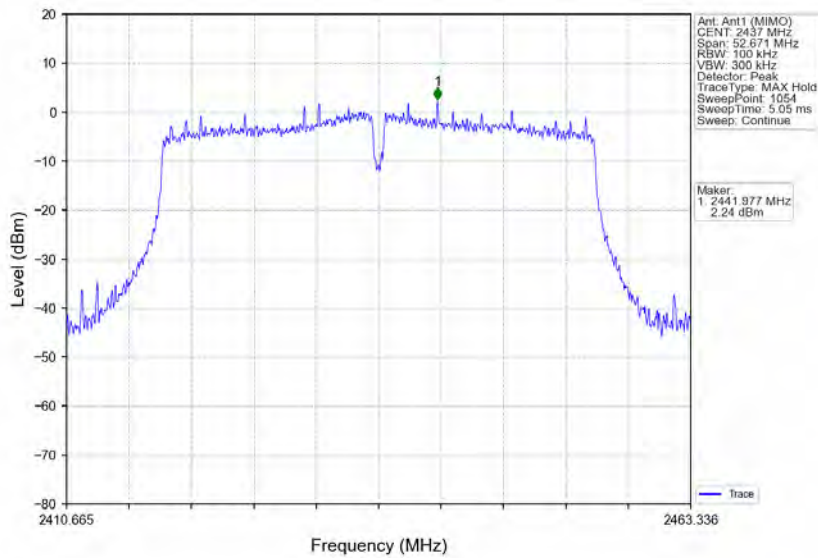

802.11n(HT40)_MCH_2437MHz_Ant2 (MIMO)_NTNV

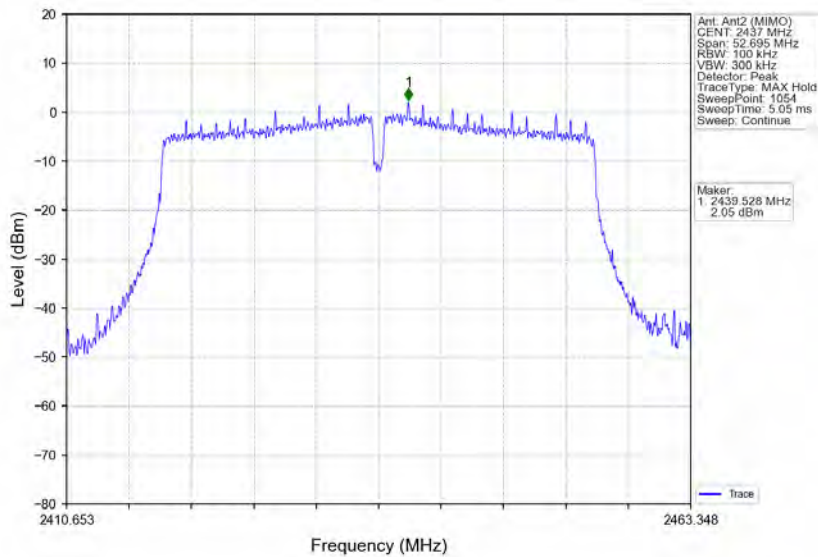


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 212 of 248


802.11n(HT40)_HCH_2452MHz_Ant1 (MIMO)_NTNV

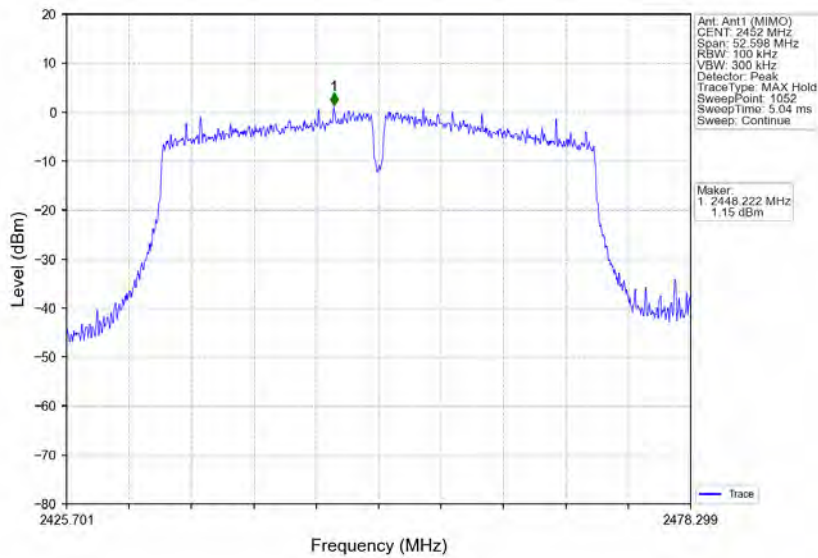


802.11n(HT40)_HCH_2452MHz_Ant2 (MIMO)_NTNV

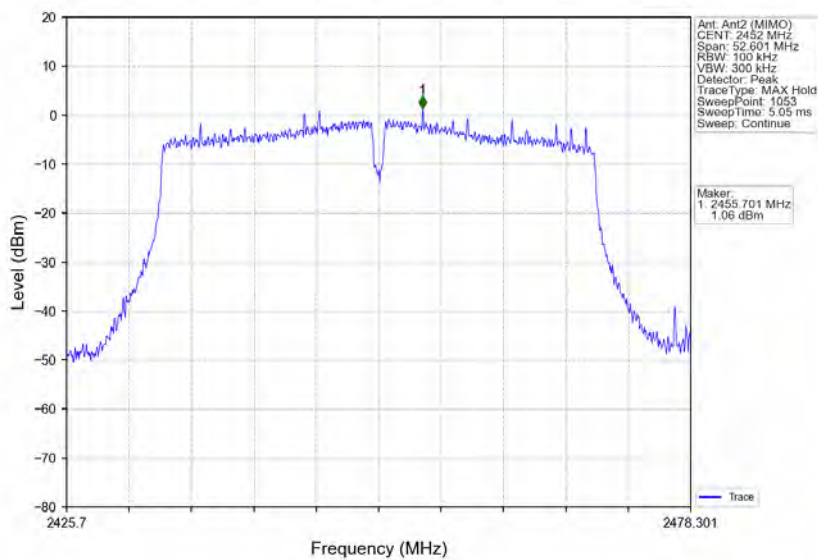

802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant1 (MIMO)_NTNV

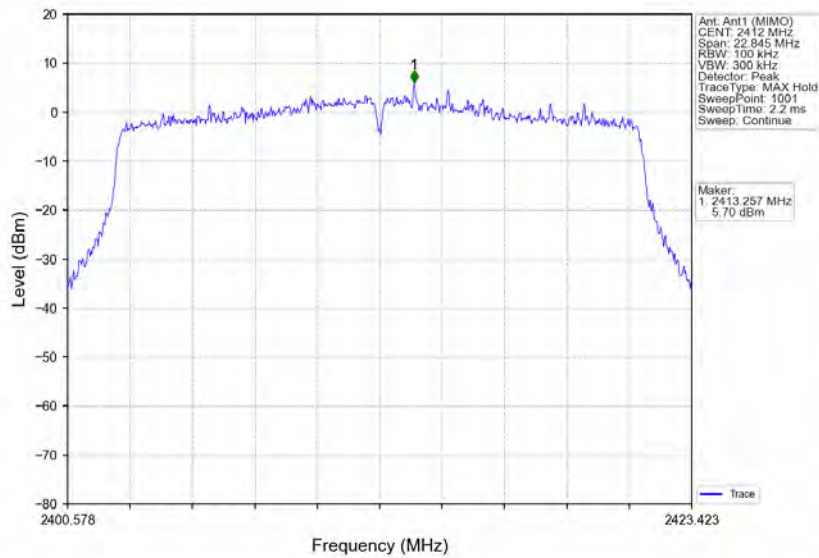

802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant2 (MIMO)_NTNV

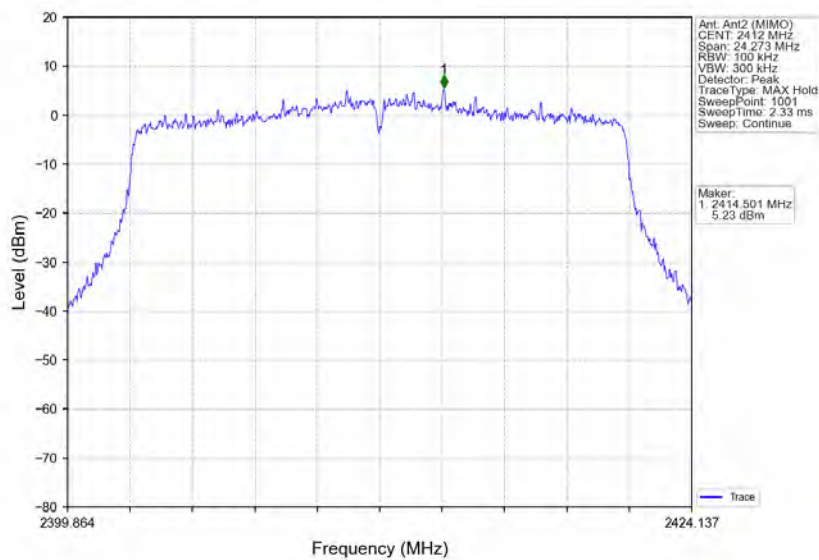


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 214 of 248


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant1 (MIMO)_NTNV

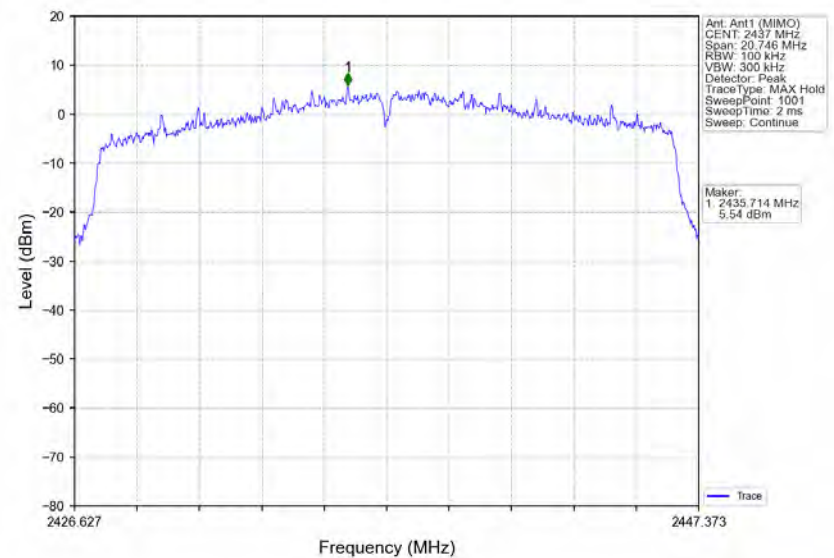


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant2 (MIMO)_NTNV

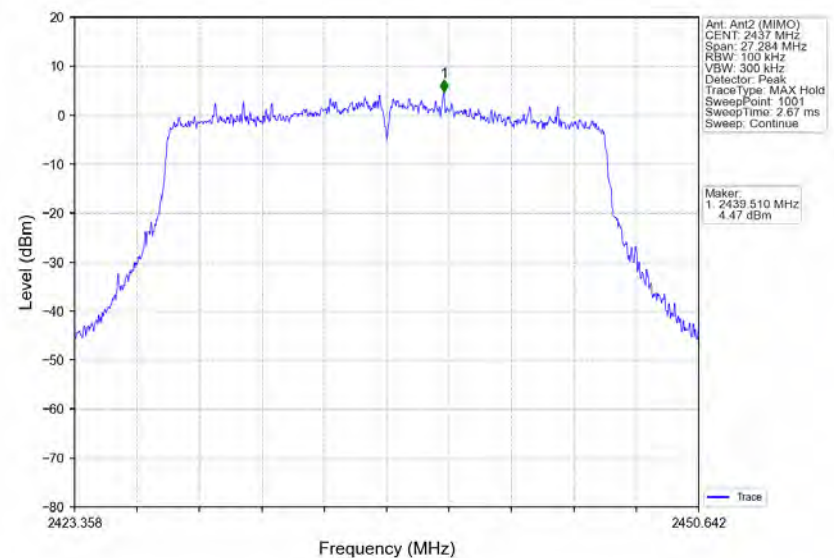

802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant1 (MIMO)_NTNV

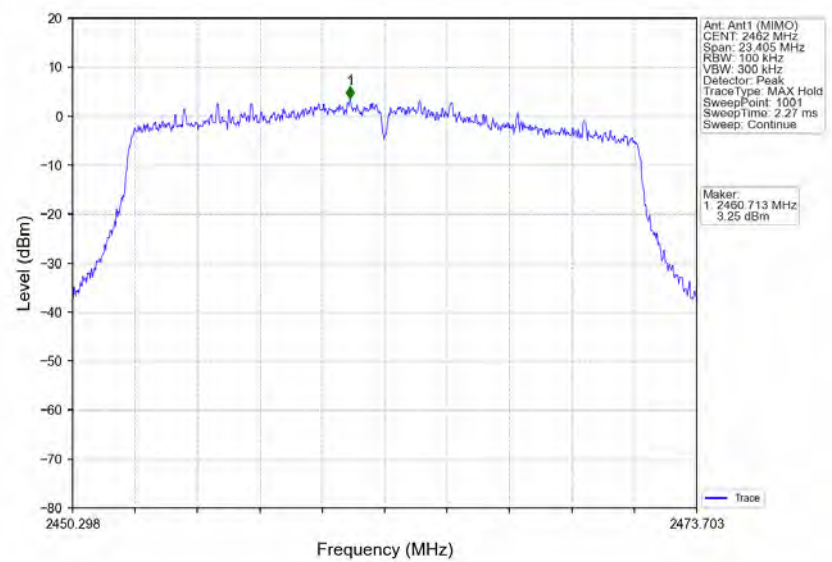

802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant2 (MIMO)_NTNV

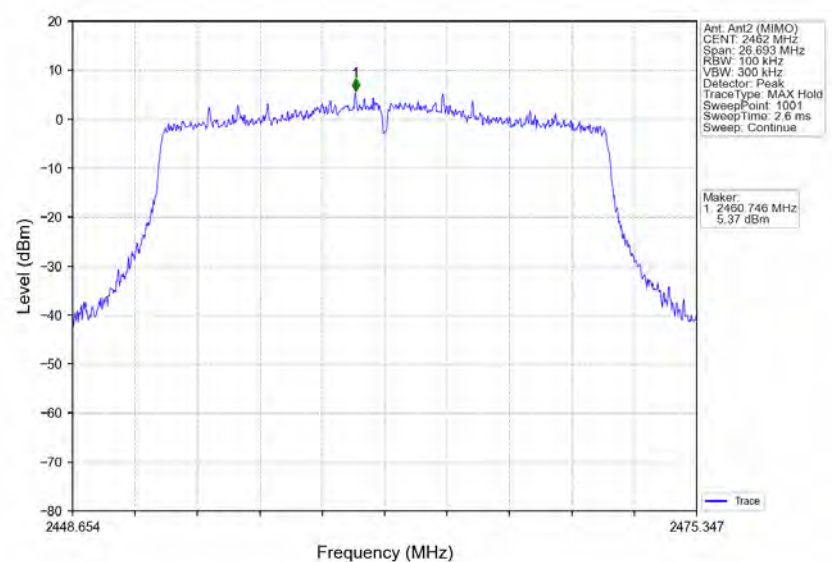


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 216 of 248


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant1 (MIMO)_NTNV

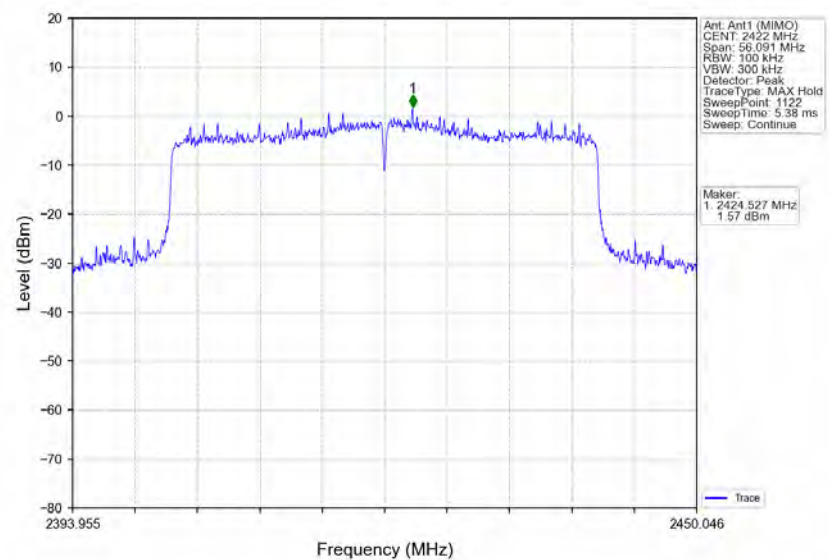


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant2 (MIMO)_NTNV

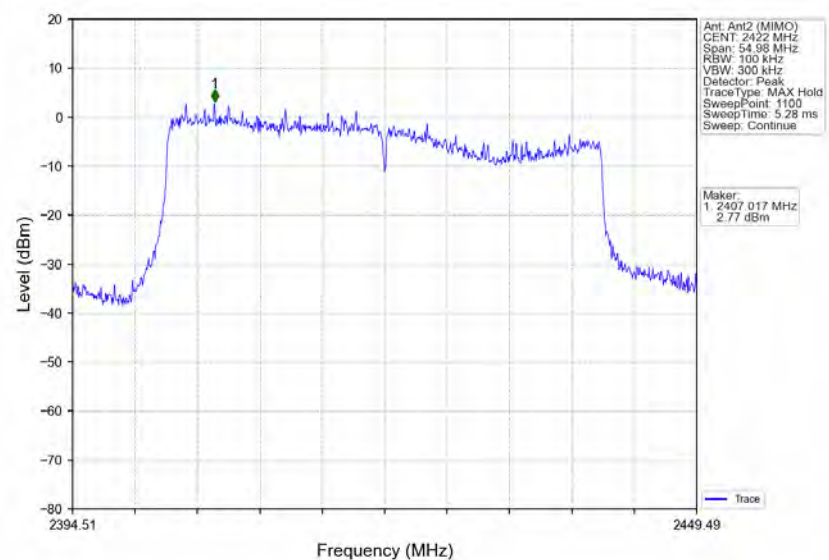

802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant1 (MIMO)_NTNV

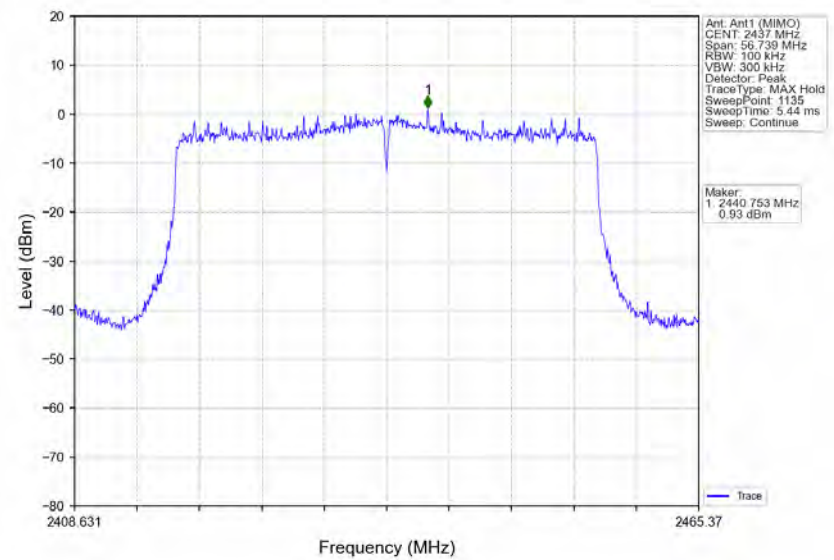

802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant2 (MIMO)_NTNV

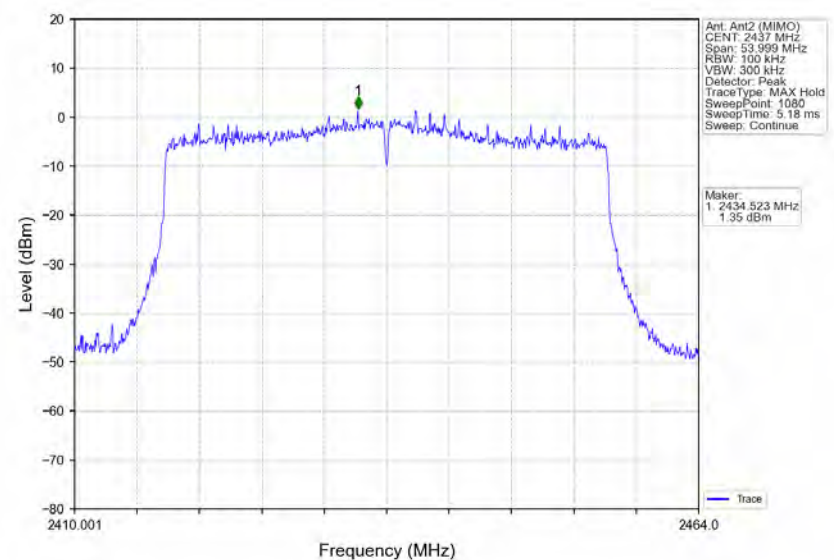


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 218 of 248


802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant1 (MIMO)_NTNV

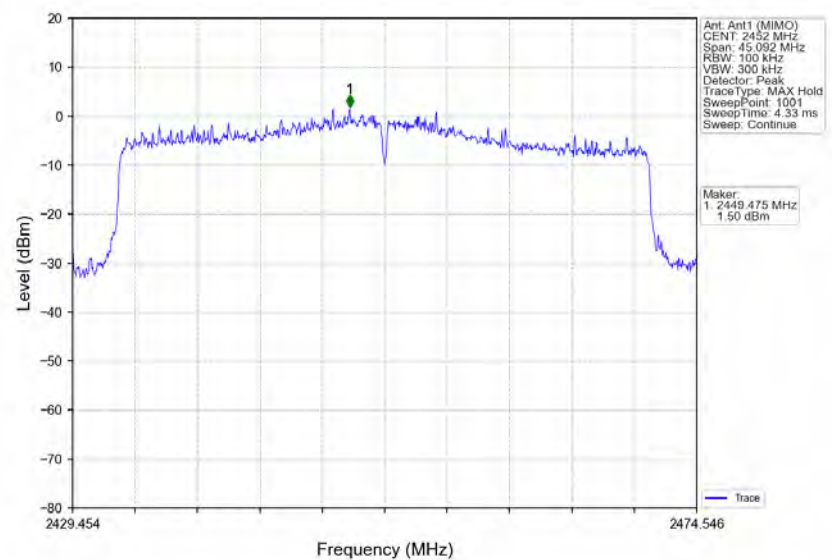

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant2 (MIMO)_NTNV

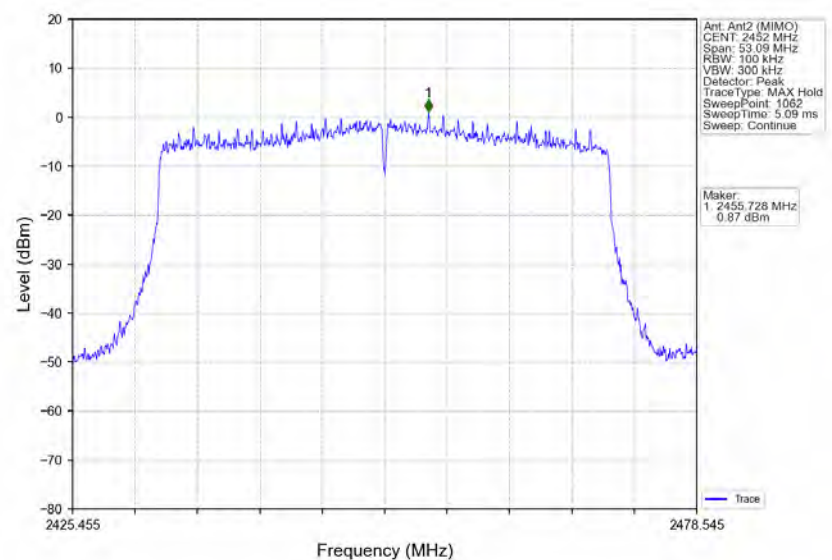

5.2.2 CSE

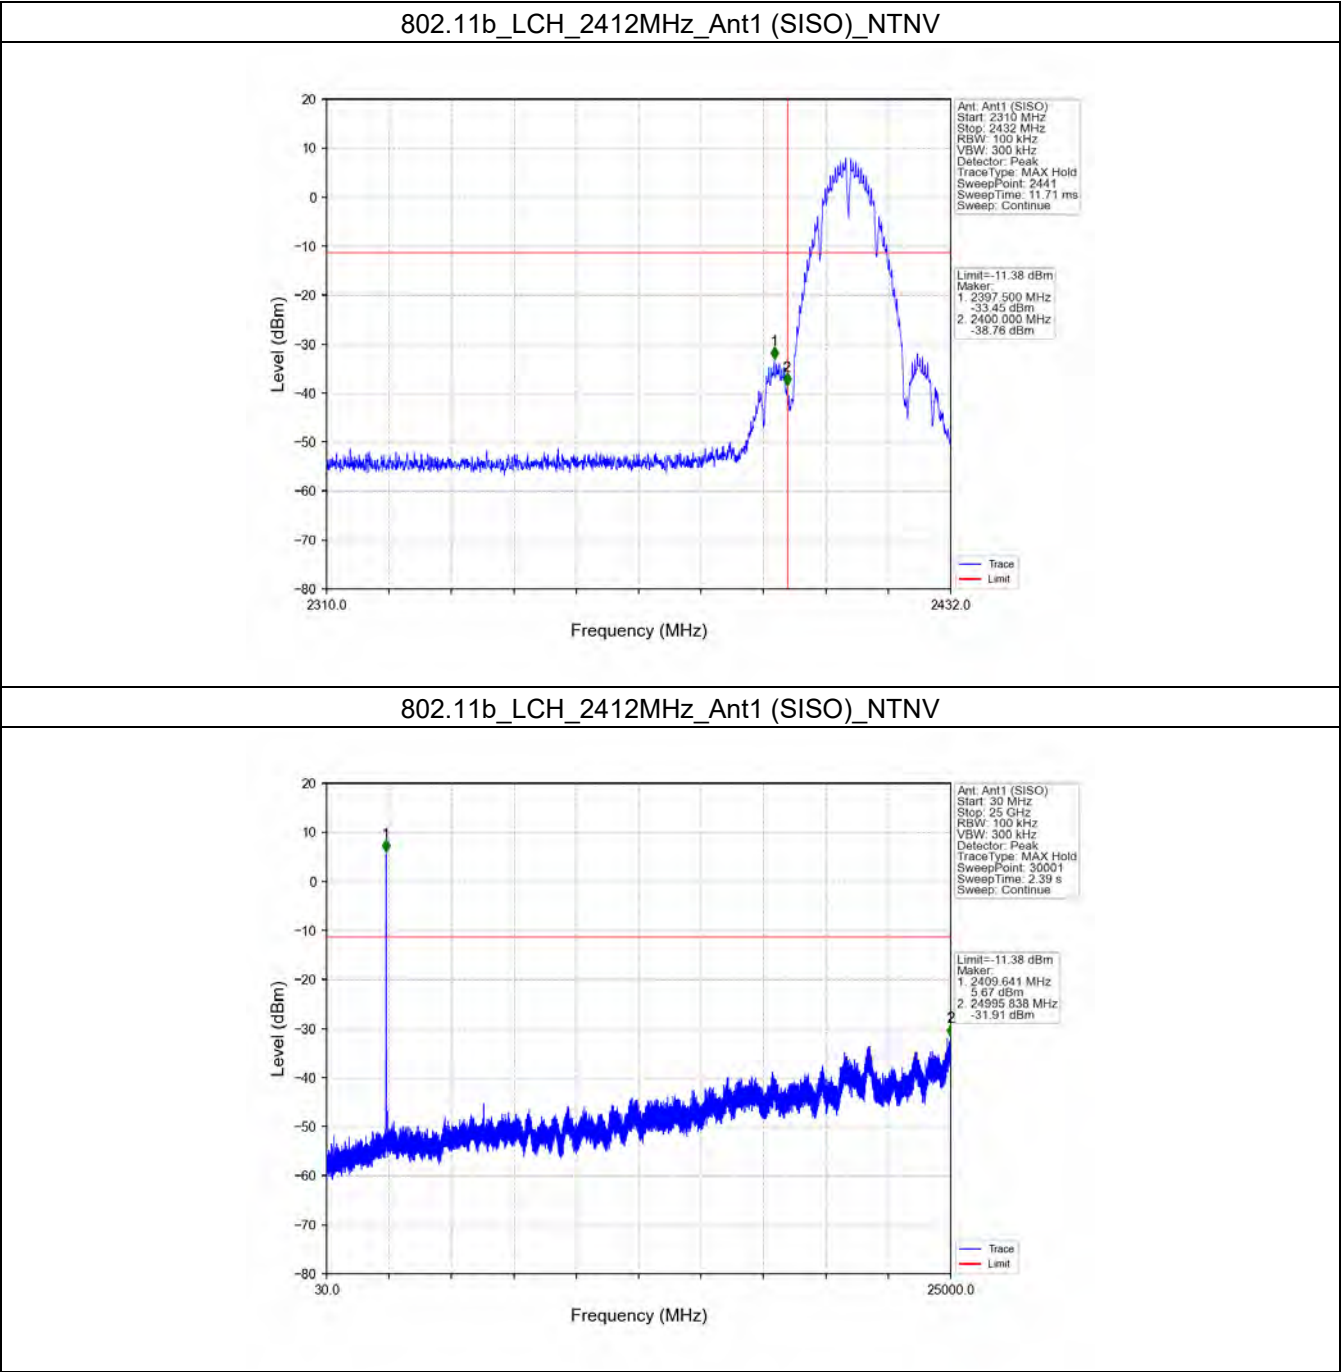


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 220 of 248


802.11b_LCH_2412MHz_Ant2 (SISO)_NTNV

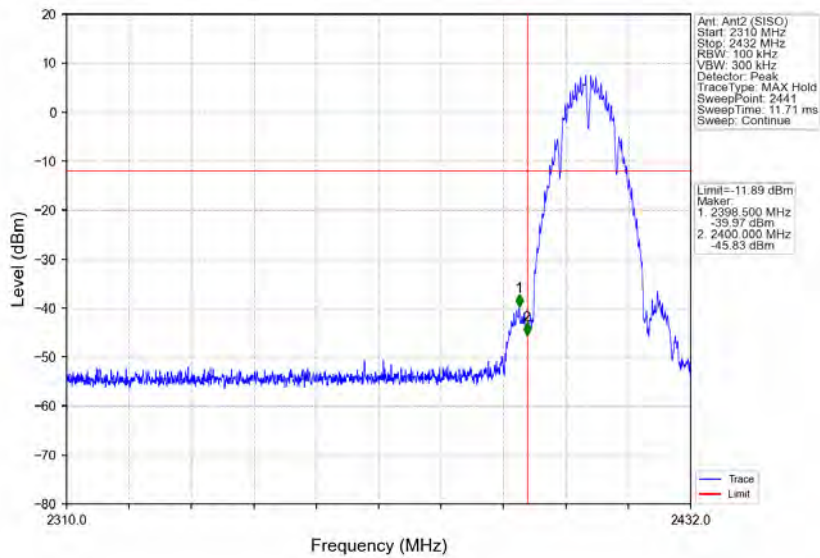


802.11b_LCH_2412MHz_Ant2 (SISO)_NTNV

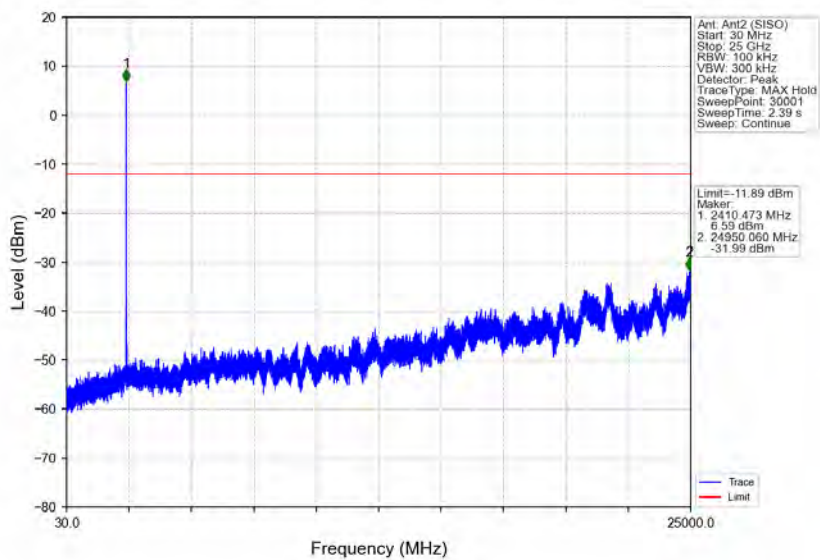

802.11b_MCH_2437MHz_Ant1 (SISO)_NTNV

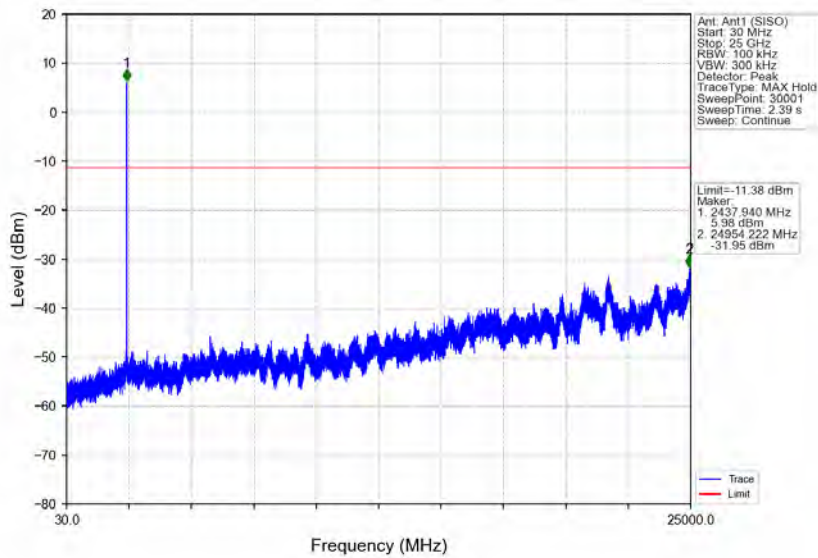

802.11b_MCH_2437MHz_Ant2 (SISO)_NTNV

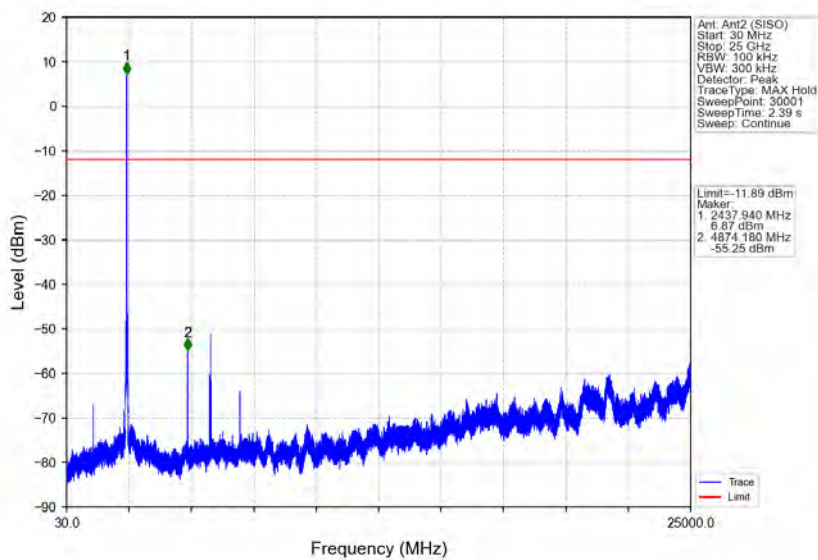


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 222 of 248


802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

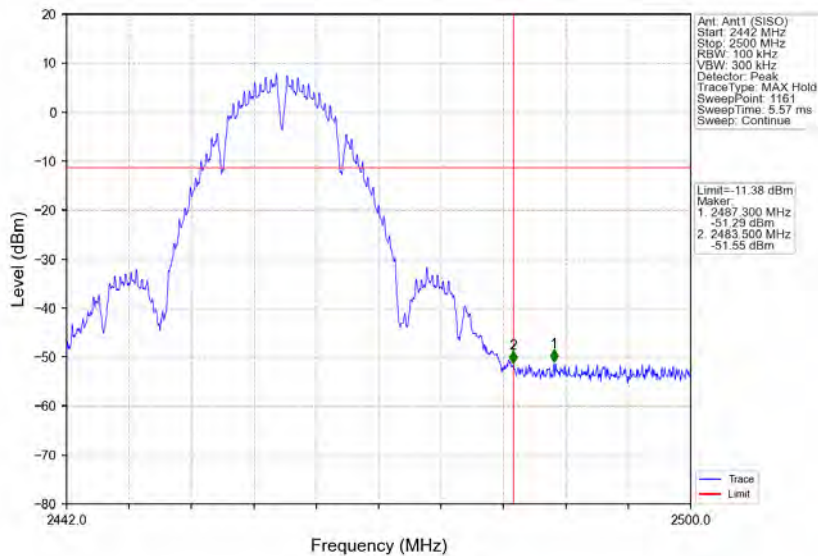


802.11b_HCH_2462MHz_Ant1 (SISO)_NTNV

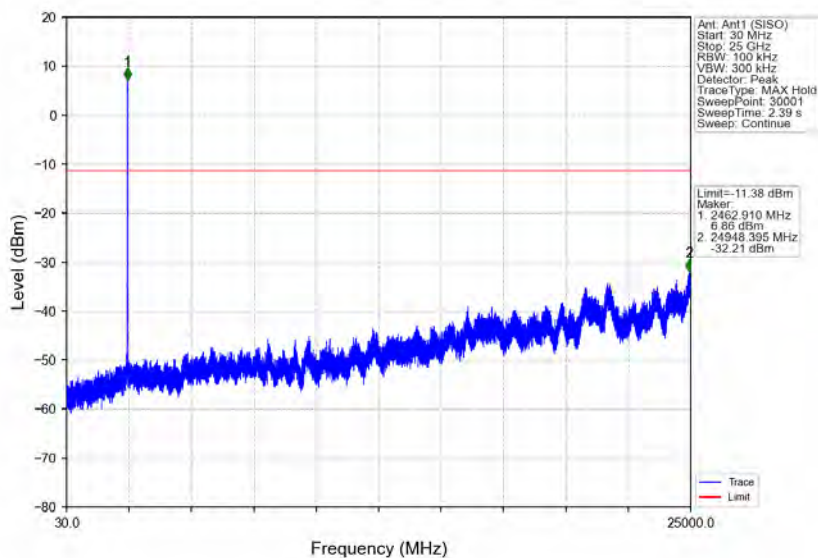


802.11b_HCH_2462MHz_Ant2 (SISO)_NTNV

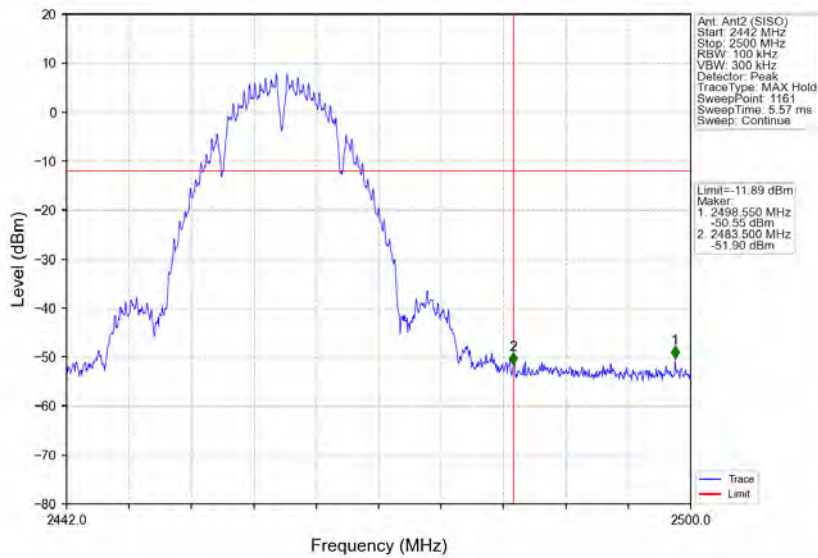


802.11b_HCH_2462MHz_Ant2 (SISO)_NTNV

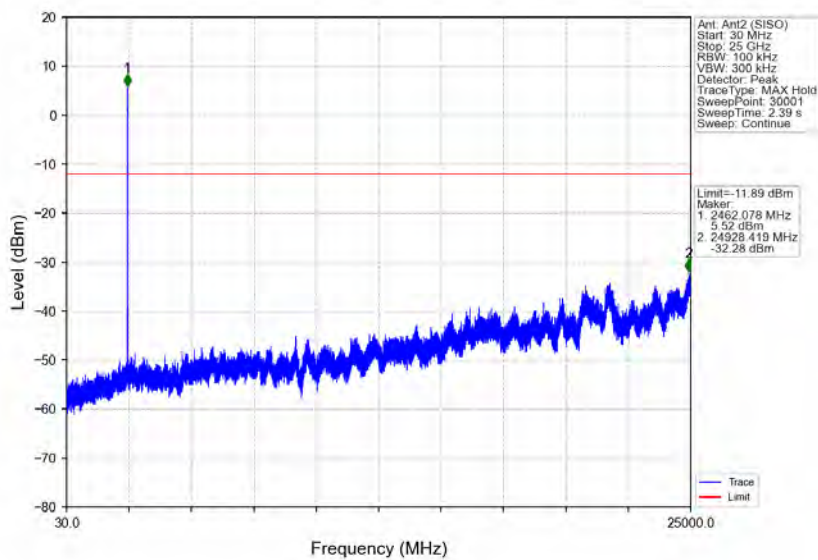


802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

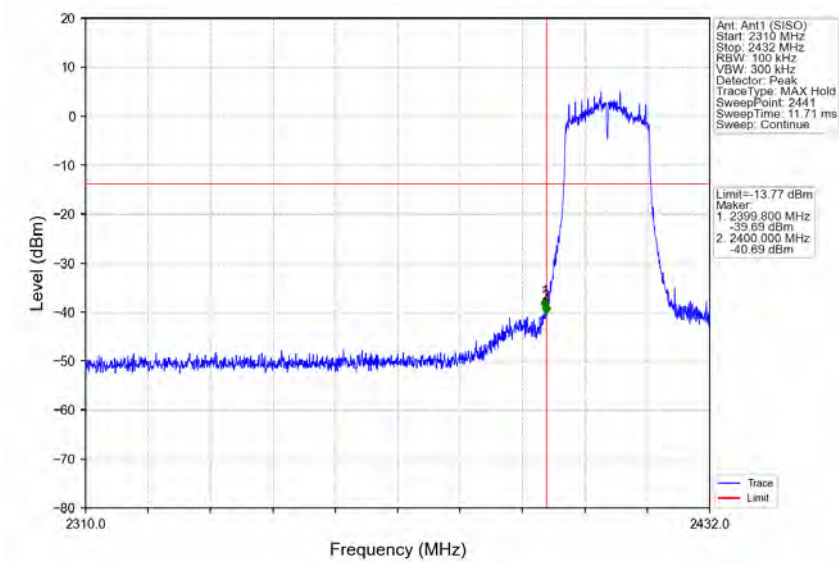


802.11g_LCH_2412MHz_Ant1 (SISO)_NTNV

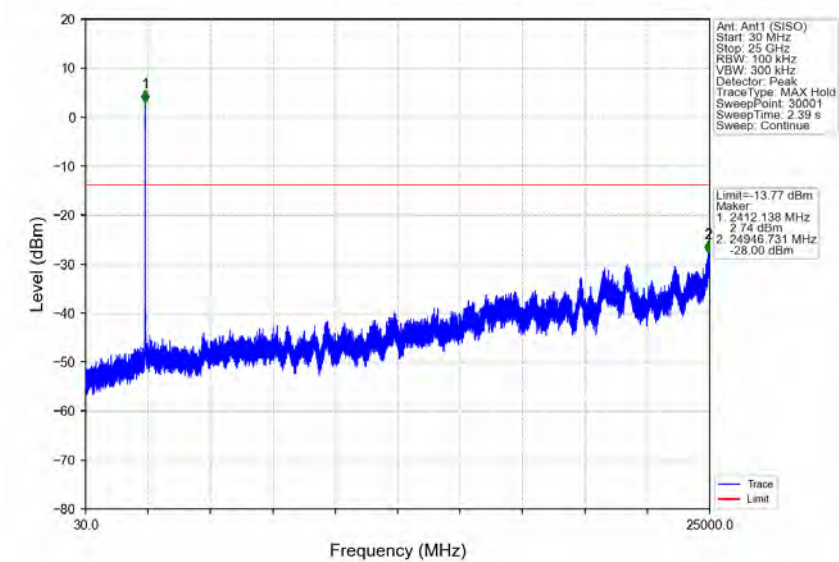


802.11g_LCH_2412MHz_Ant2 (SISO)_NTNV

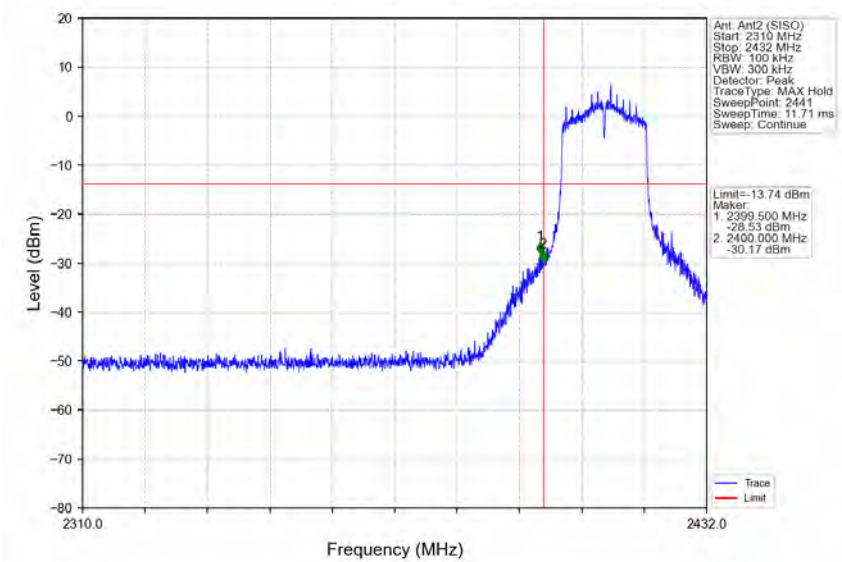


802.11g_LCH_2412MHz_Ant2 (SISO)_NTNV

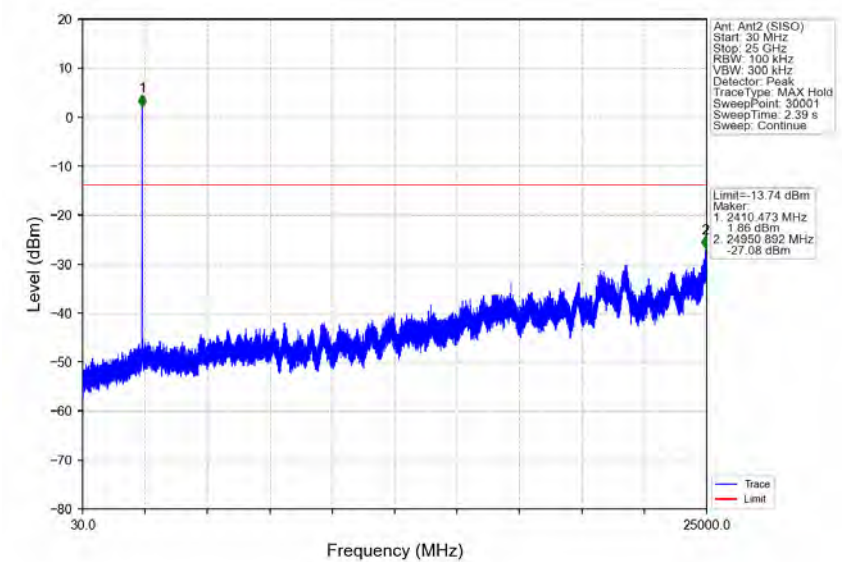


802.11g_MCH_2437MHz_Ant1 (SISO)_NTNV

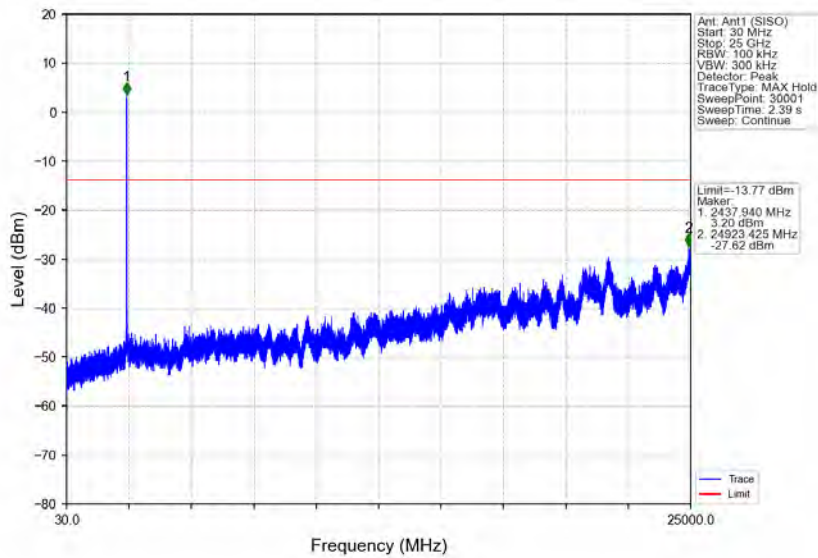


802.11g_MCH_2437MHz_Ant2 (SISO)_NTNV

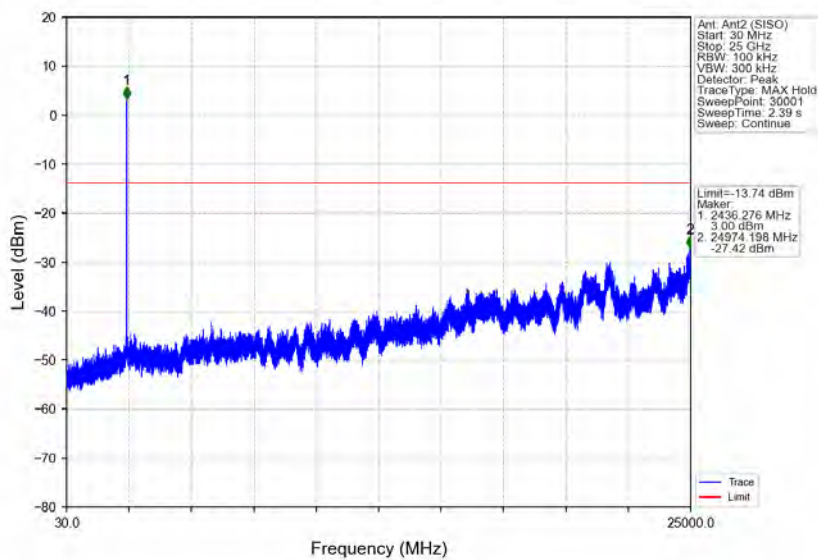


802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

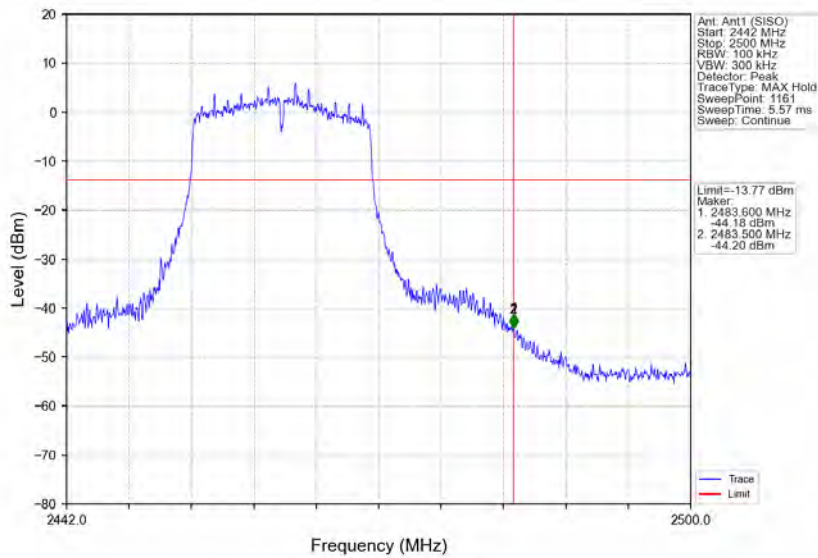


802.11g_HCH_2462MHz_Ant1 (SISO)_NTNV

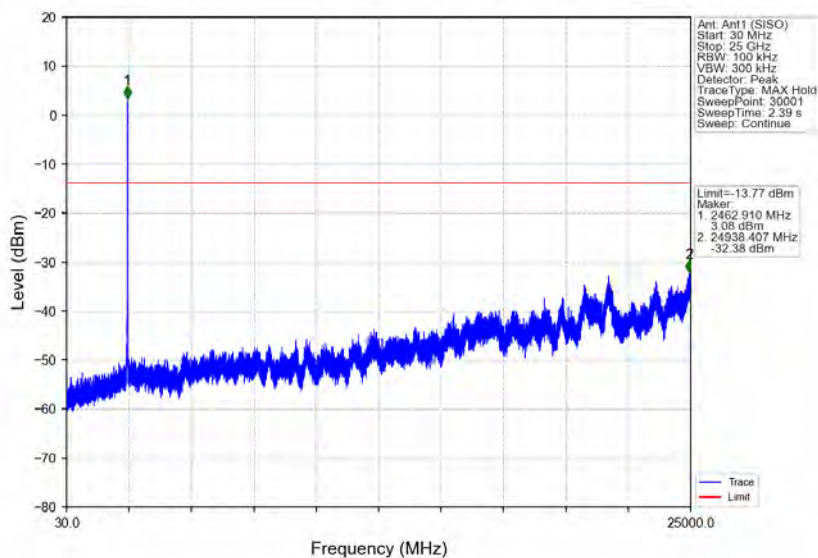


802.11g_HCH_2462MHz_Ant2 (SISO)_NTNV

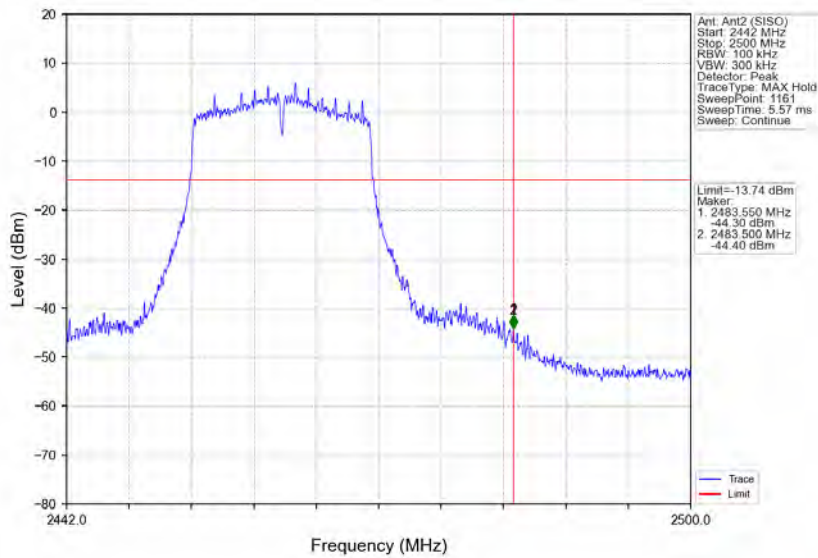


802.11g_HCH_2462MHz_Ant2 (SISO)_NTNV

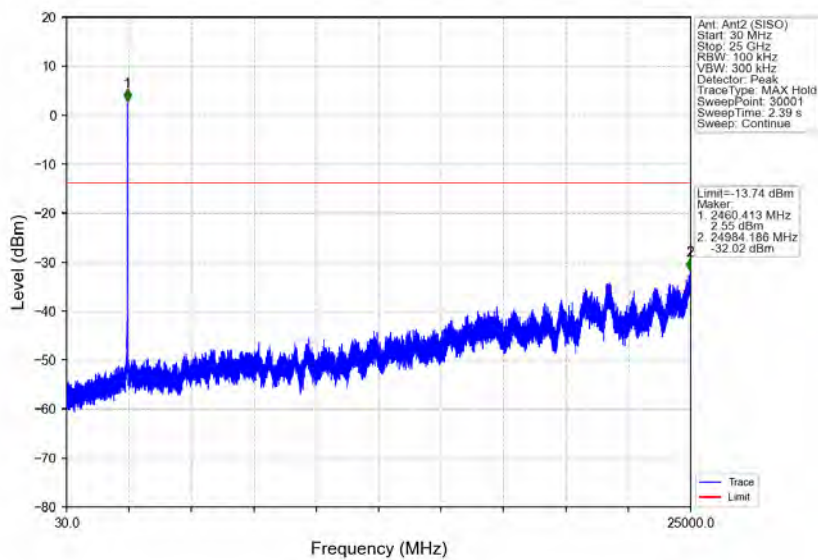

802.11n(HT20)_LCH_2412MHz_Ant1 (MIMO)_NTNV

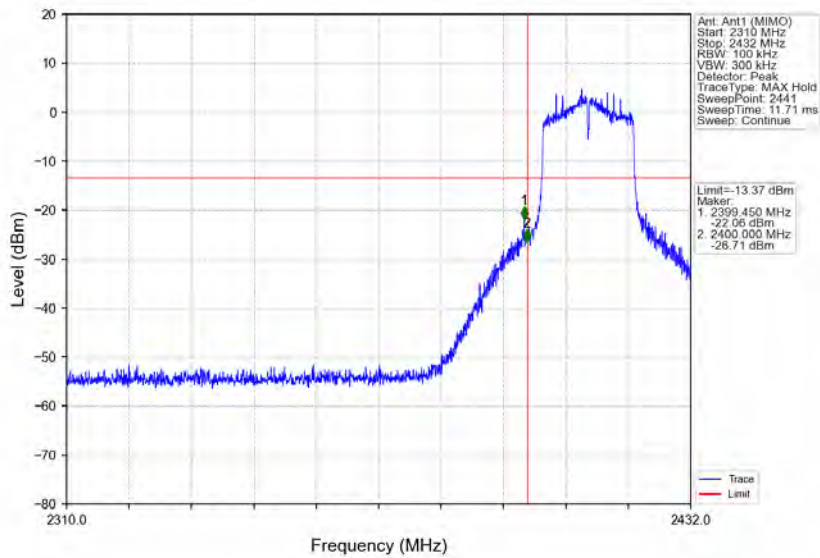

802.11n(HT20)_LCH_2412MHz_Ant1 (MIMO)_NTNV

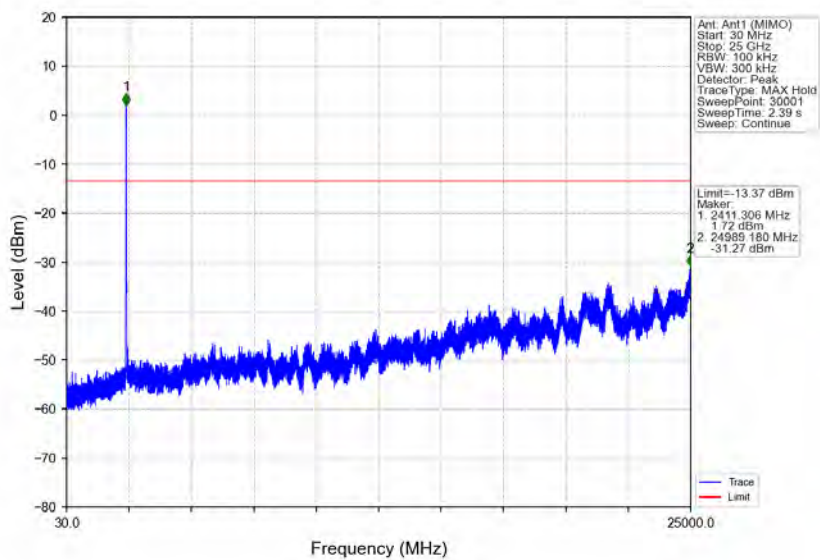


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 230 of 248


802.11n(HT20)_LCH_2412MHz_Ant2 (MIMO)_NTNV

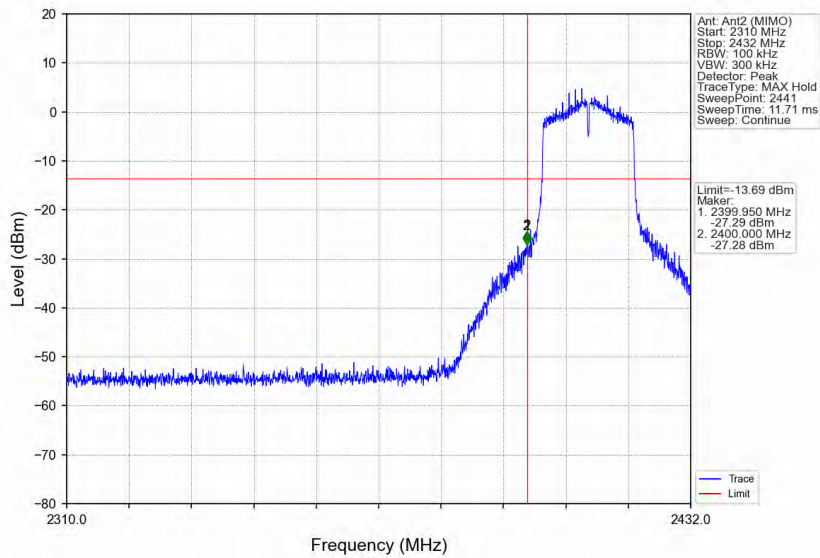


802.11n(HT20)_LCH_2412MHz_Ant2 (MIMO)_NTNV

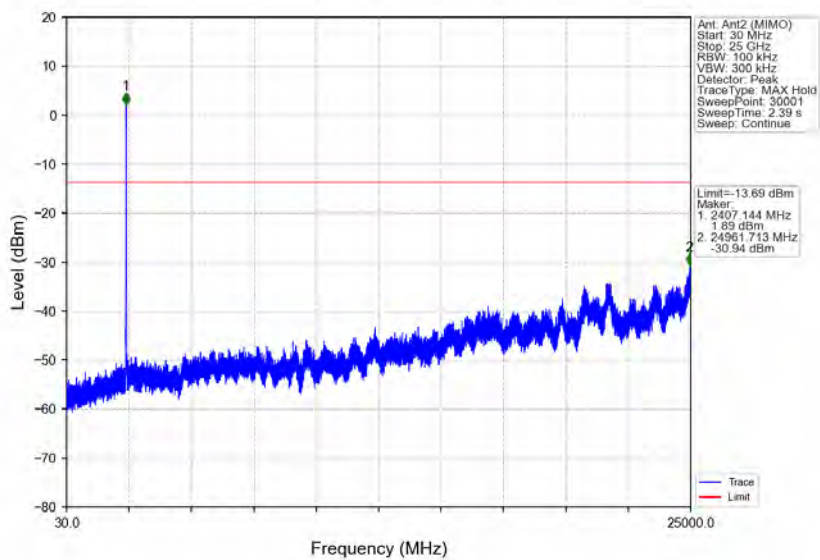

802.11n(HT20)_MCH_2437MHz_Ant1 (MIMO)_NTNV

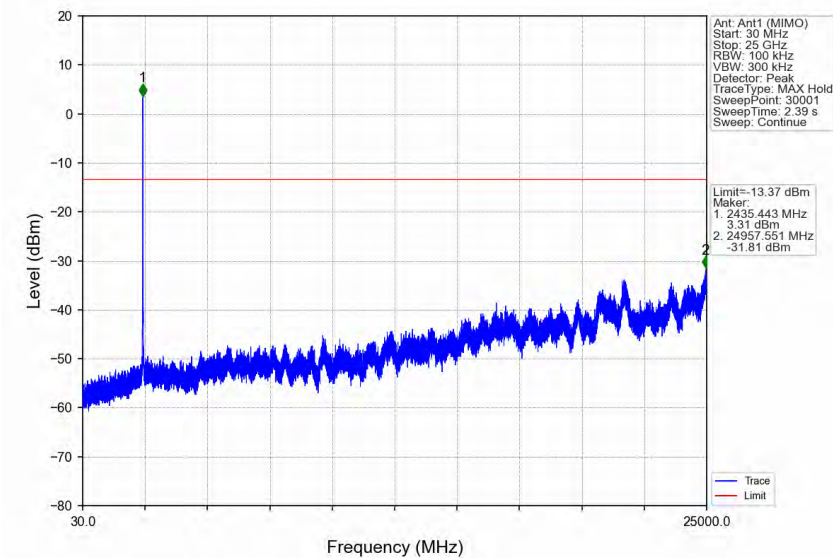

802.11n(HT20)_MCH_2437MHz_Ant2 (MIMO)_NTNV

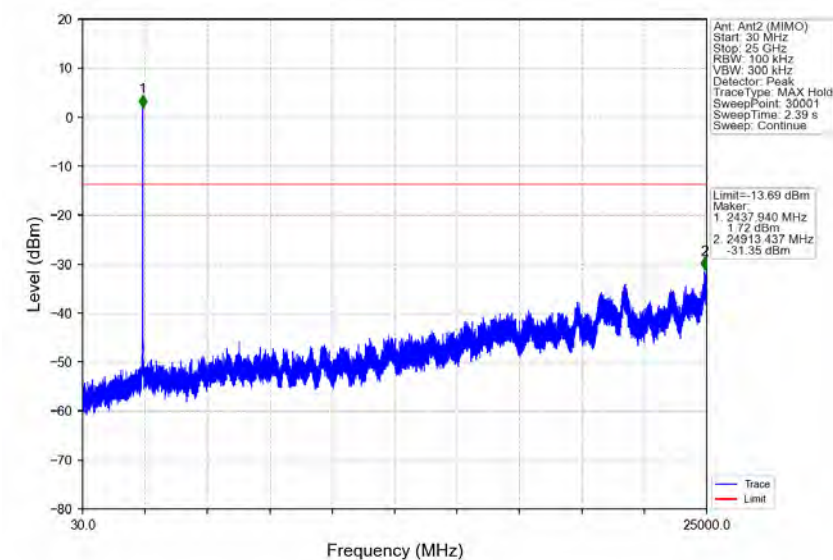


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 232 of 248

802.11n(HT20)_HCH_2462MHz_Ant1 (MIMO)_NTNV

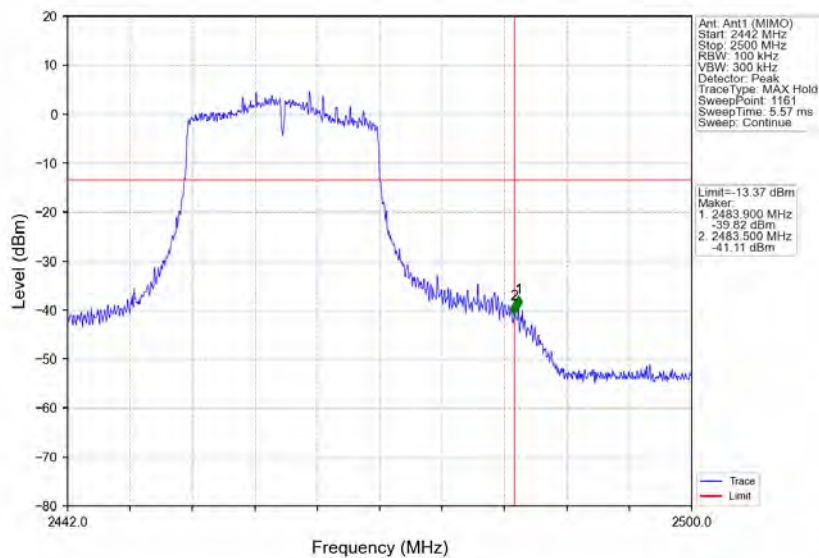

802.11n(HT20)_HCH_2462MHz_Ant1 (MIMO)_NTNV

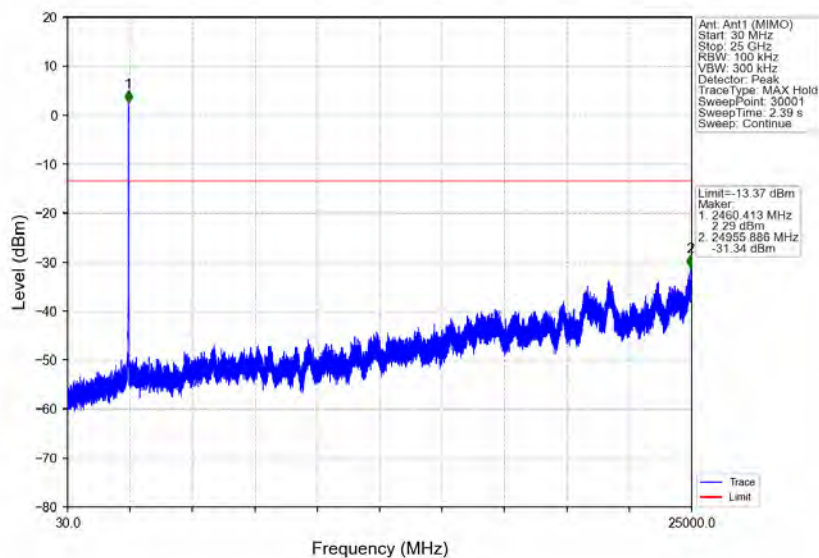


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 233 of 248


802.11n(HT20)_HCH_2462MHz_Ant2 (MIMO)_NTNV

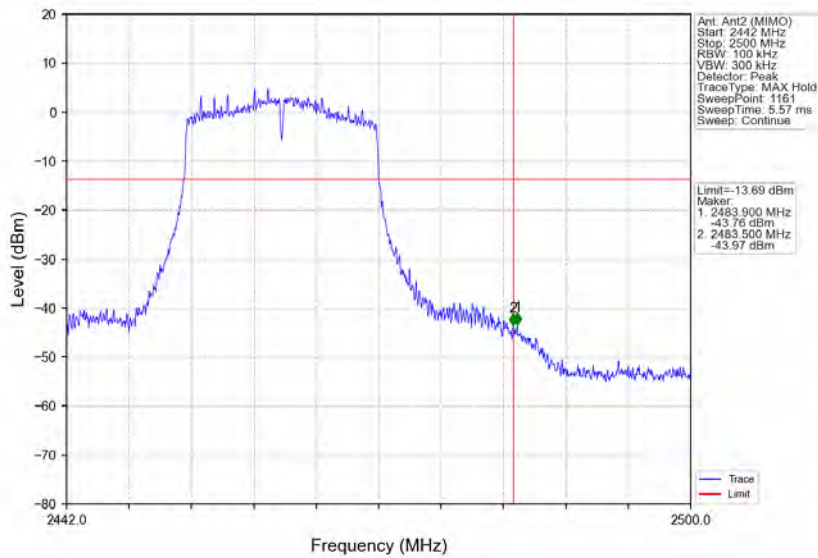


802.11n(HT20)_HCH_2462MHz_Ant2 (MIMO)_NTNV

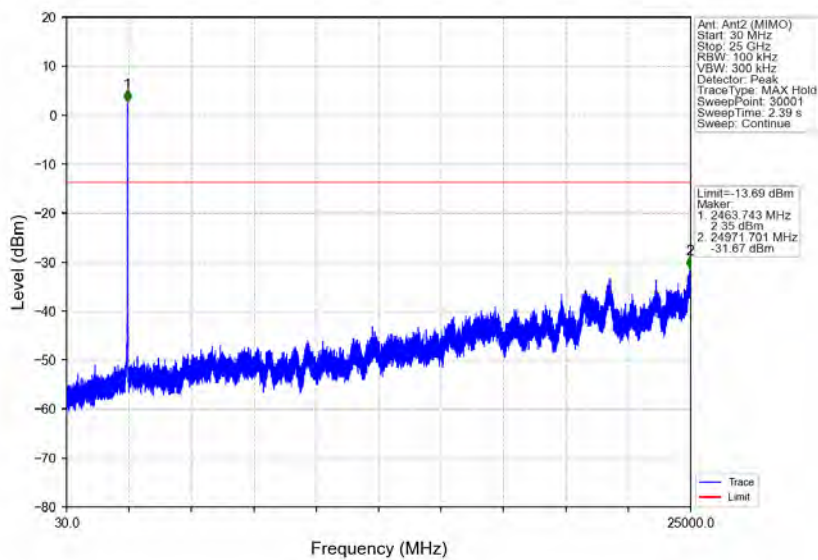


802.11n(HT40)_LCH_2422MHz_Ant1 (MIMO)_NTNV

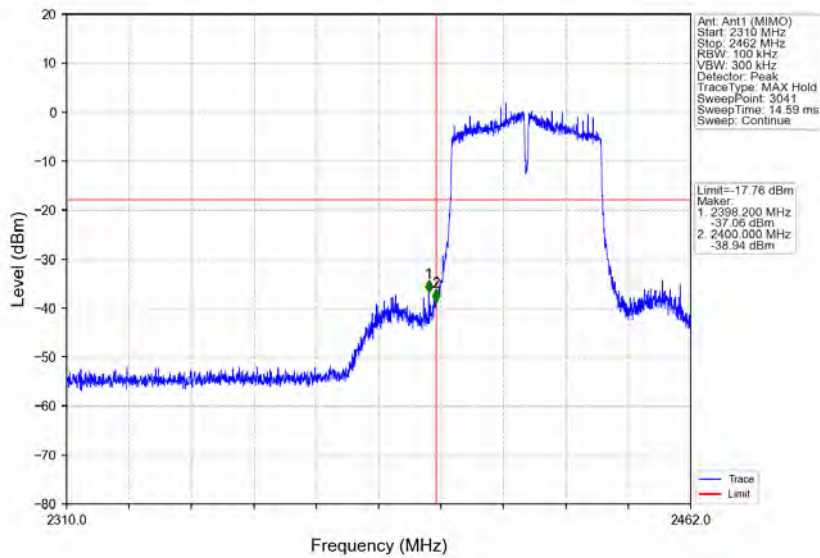


802.11n(HT40)_LCH_2422MHz_Ant1 (MIMO)_NTNV

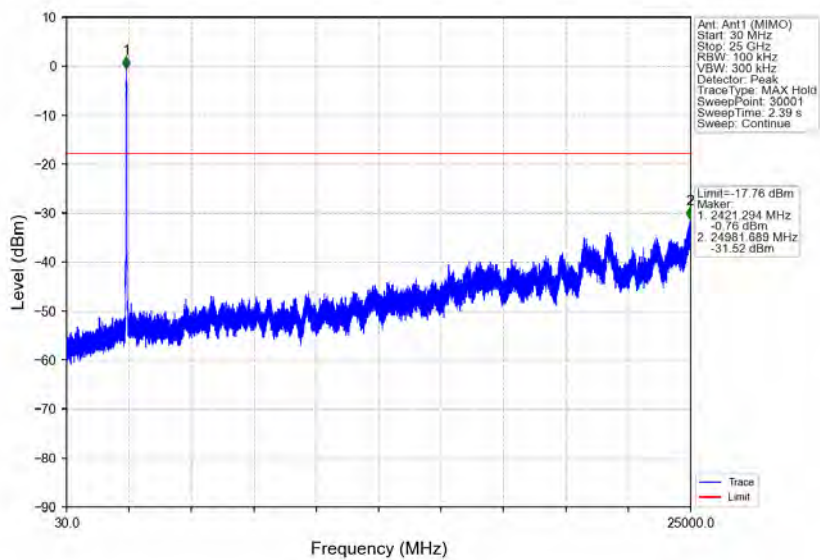


802.11n(HT40)_LCH_2422MHz_Ant2 (MIMO)_NTNV

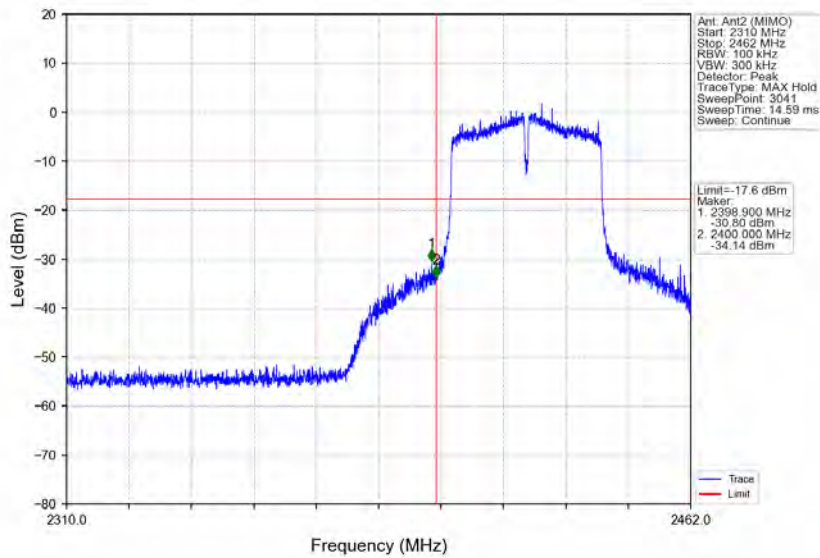


802.11n(HT40)_LCH_2422MHz_Ant2 (MIMO)_NTNV

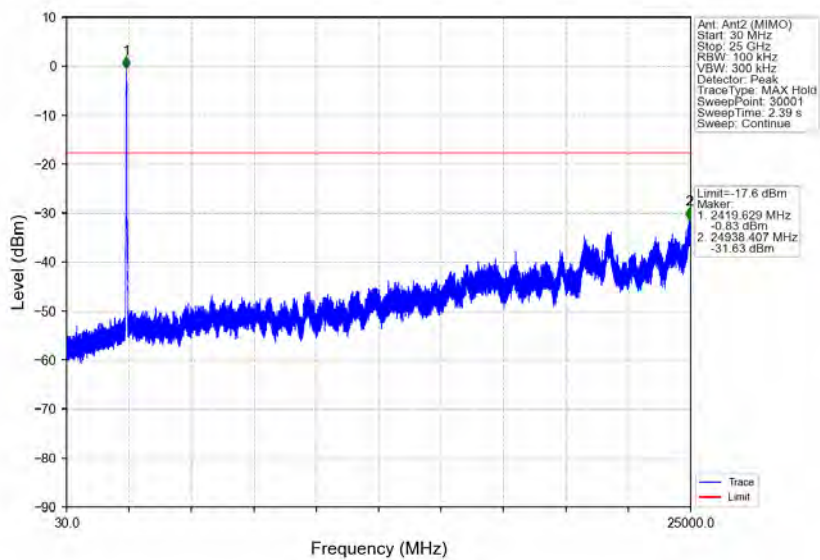

802.11n(HT40)_MCH_2437MHz_Ant1 (MIMO)_NTNV

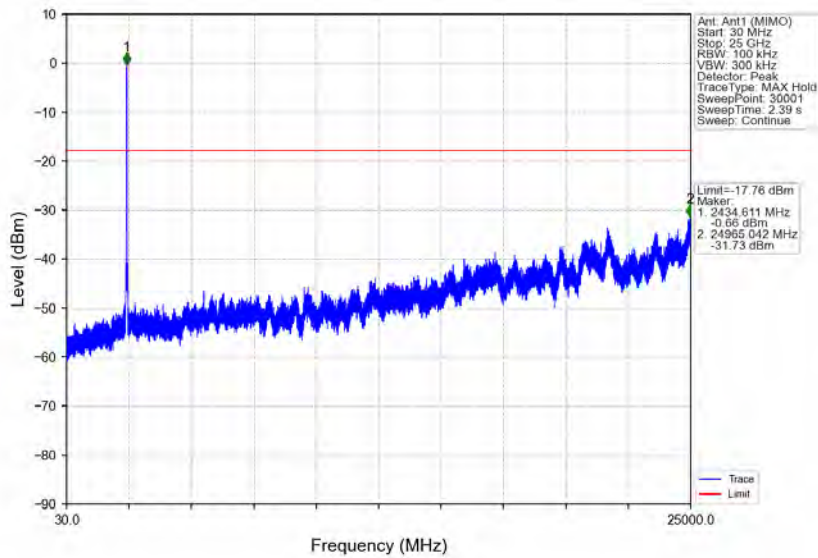

802.11n(HT40)_MCH_2437MHz_Ant2 (MIMO)_NTNV

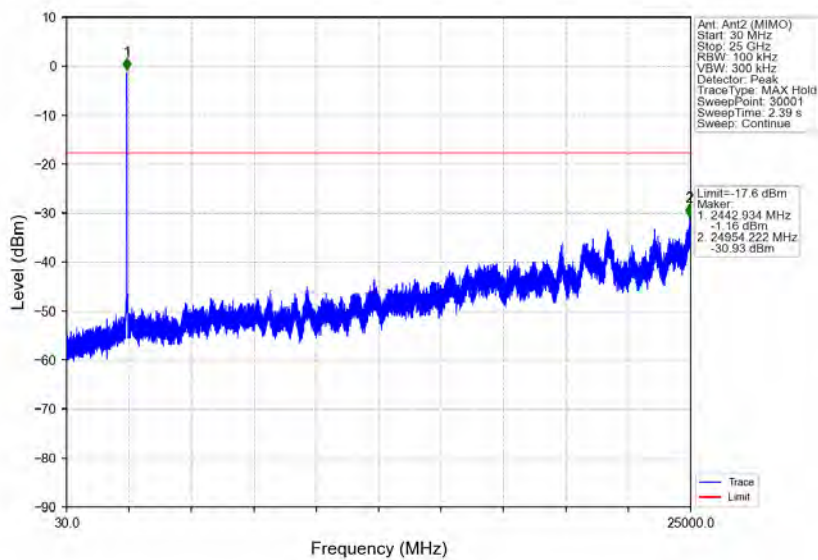


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 237 of 248

802.11n(HT40)_HCH_2452MHz_Ant1 (MIMO)_NTNV

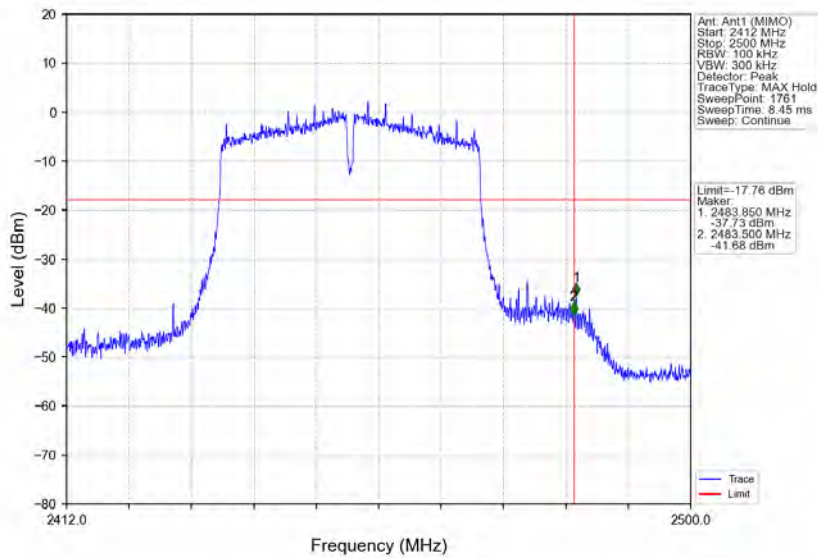

802.11n(HT40)_HCH_2452MHz_Ant1 (MIMO)_NTNV

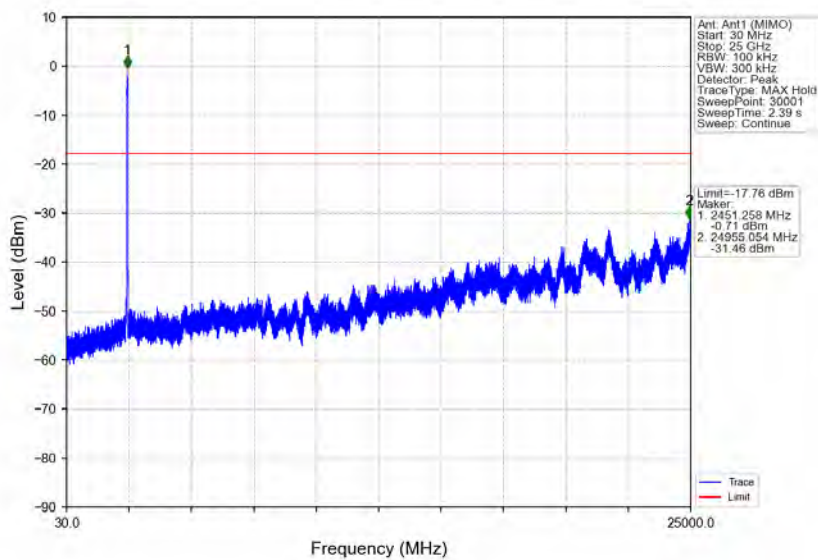


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100001

Page: 238 of 248


802.11n(HT40)_HCH_2452MHz_Ant2 (MIMO)_NTNV

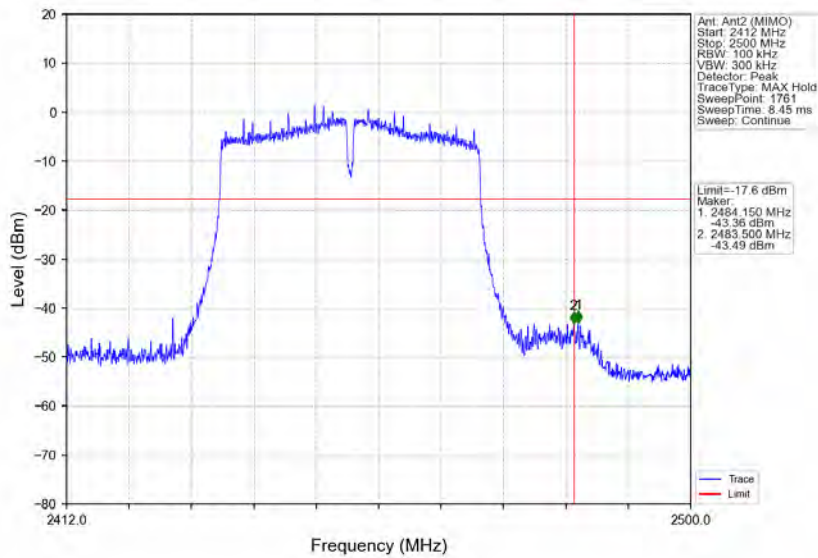


802.11n(HT40)_HCH_2452MHz_Ant2 (MIMO)_NTNV

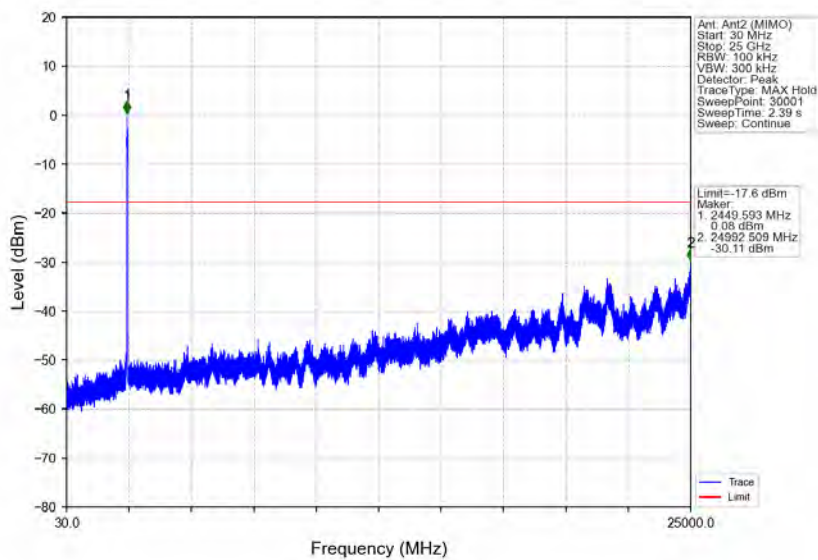


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant1 (MIMO)_NTNV

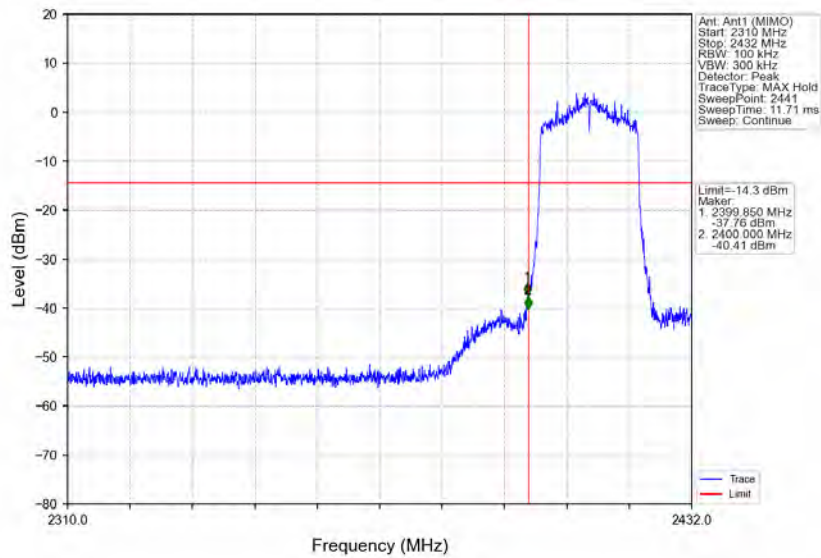


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant1 (MIMO)_NTNV

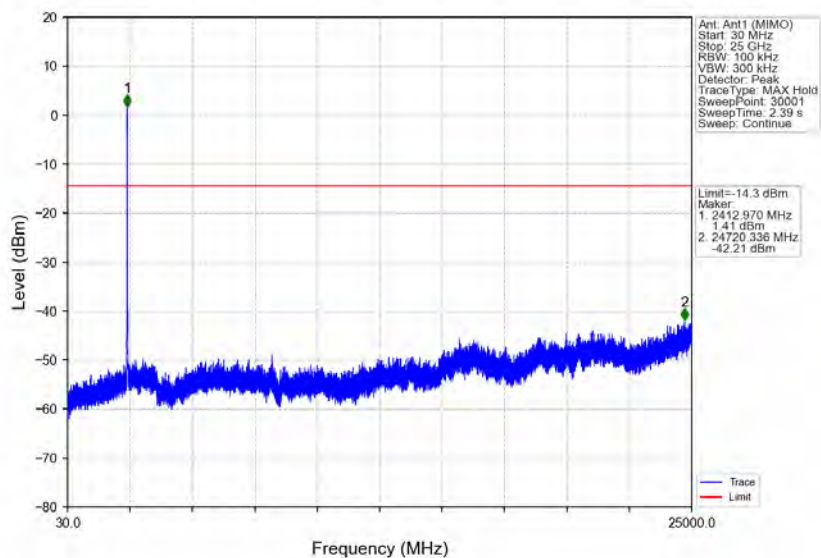


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant2 (MIMO)_NTNV

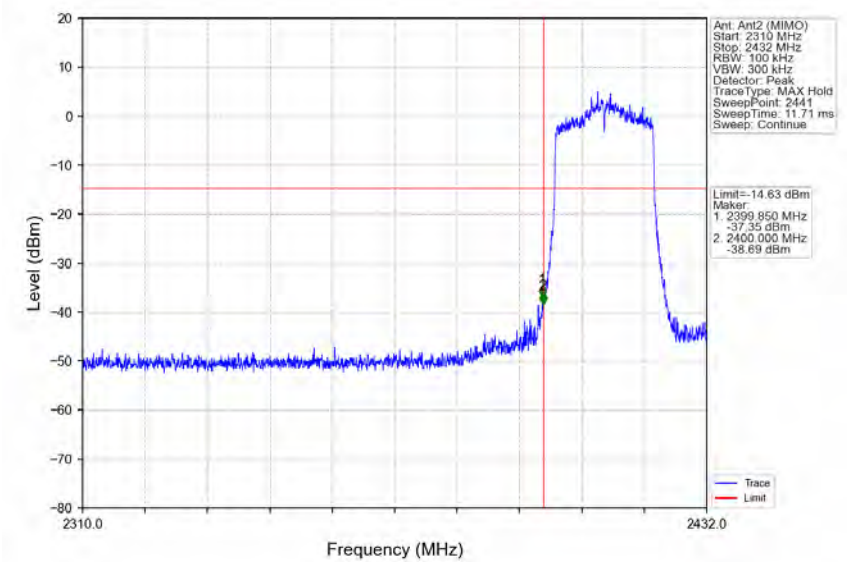


802.11ax(HEW20)_LCH_2412MHz_RU242_Left_Ant2 (MIMO)_NTNV

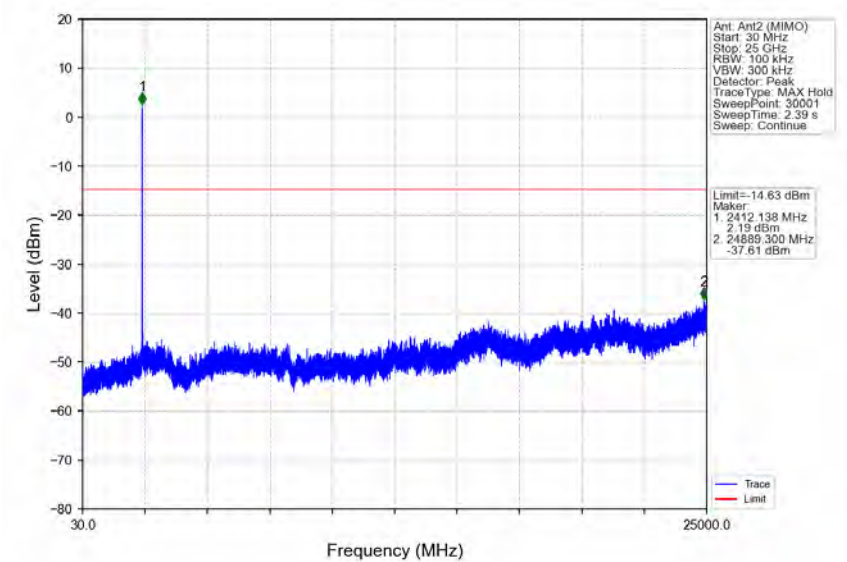


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant1 (MIMO)_NTNV

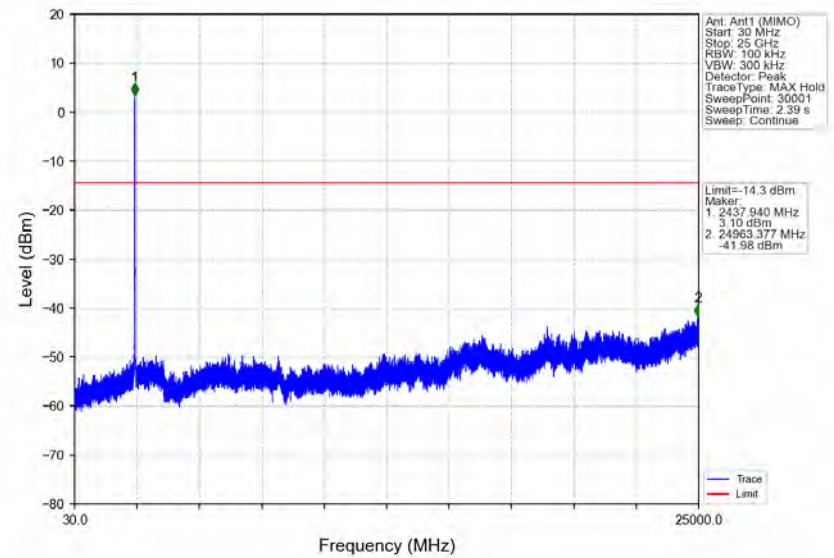


802.11ax(HEW20)_MCH_2437MHz_RU242_Left_Ant2 (MIMO)_NTNV

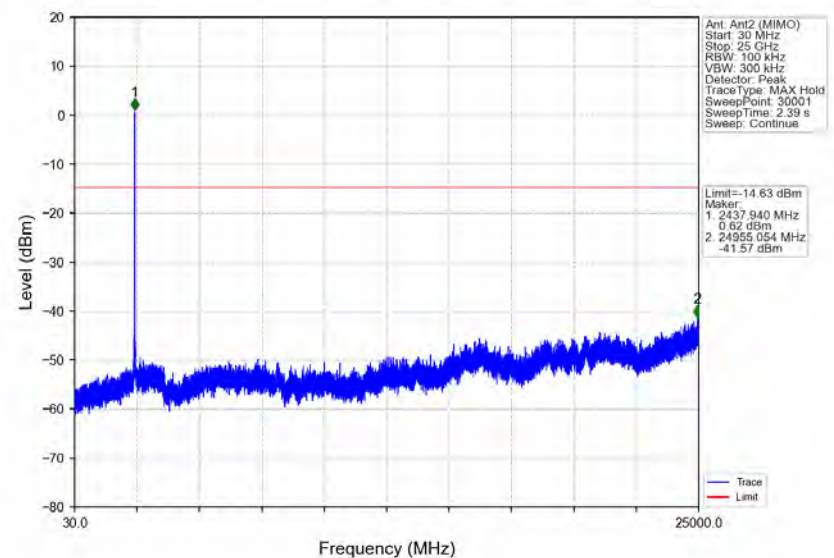


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant1 (MIMO)_NTNV

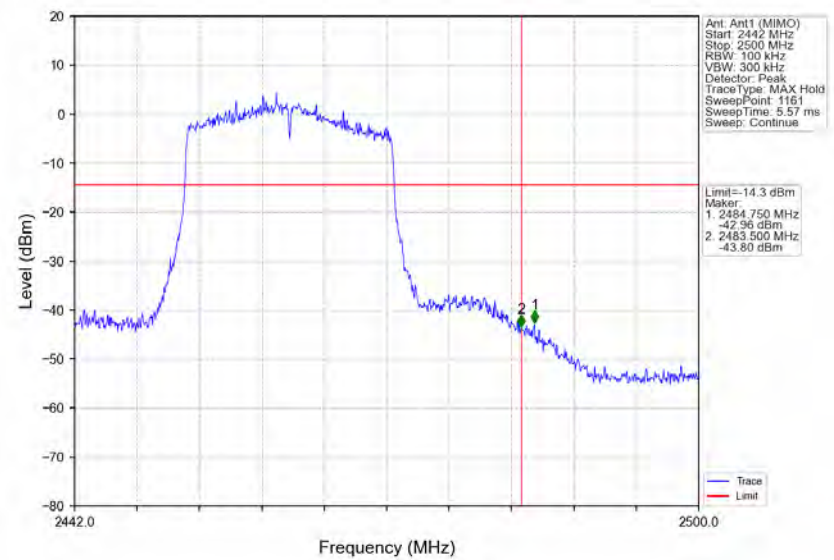


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant1 (MIMO)_NTNV

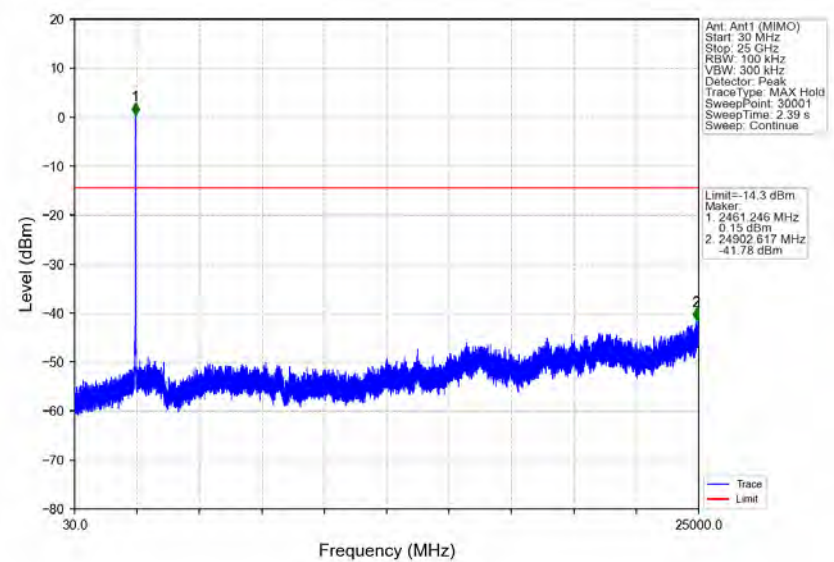


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant2 (MIMO)_NTNV

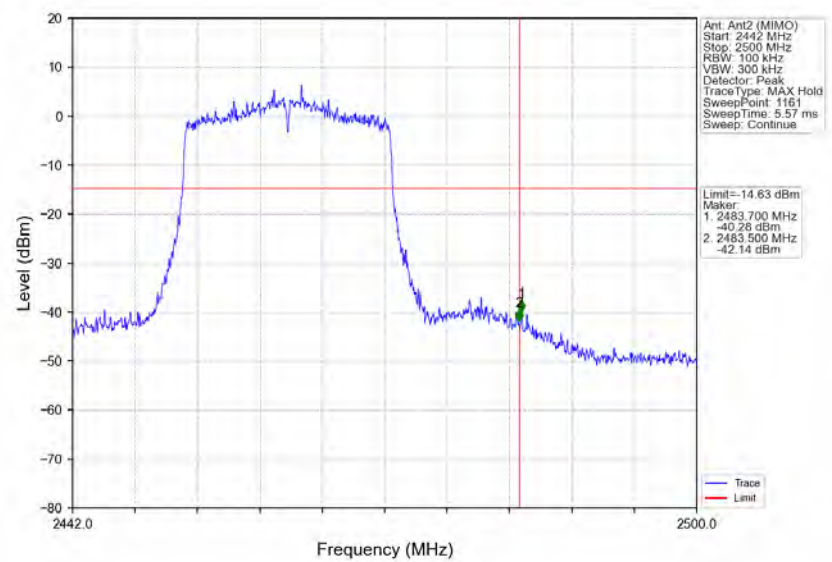


802.11ax(HEW20)_HCH_2462MHz_RU242_Left_Ant2 (MIMO)_NTNV

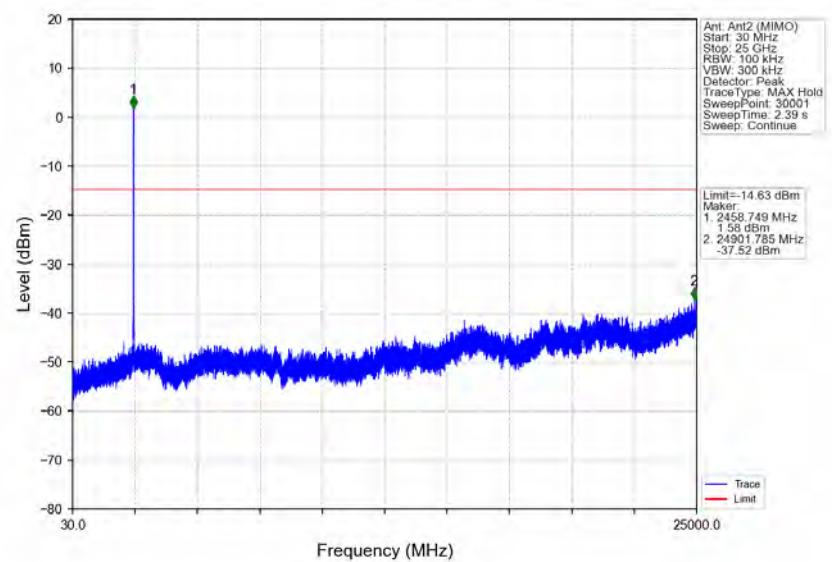


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant1 (MIMO)_NTNV

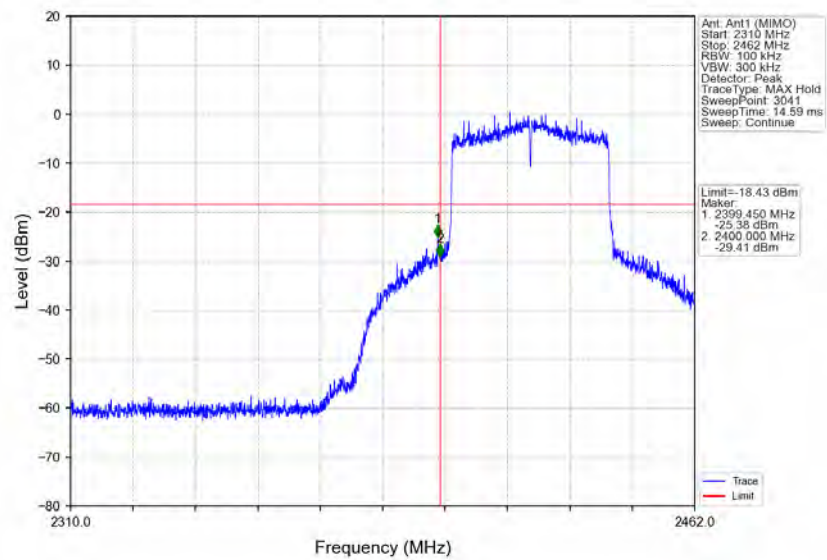


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant1 (MIMO)_NTNV

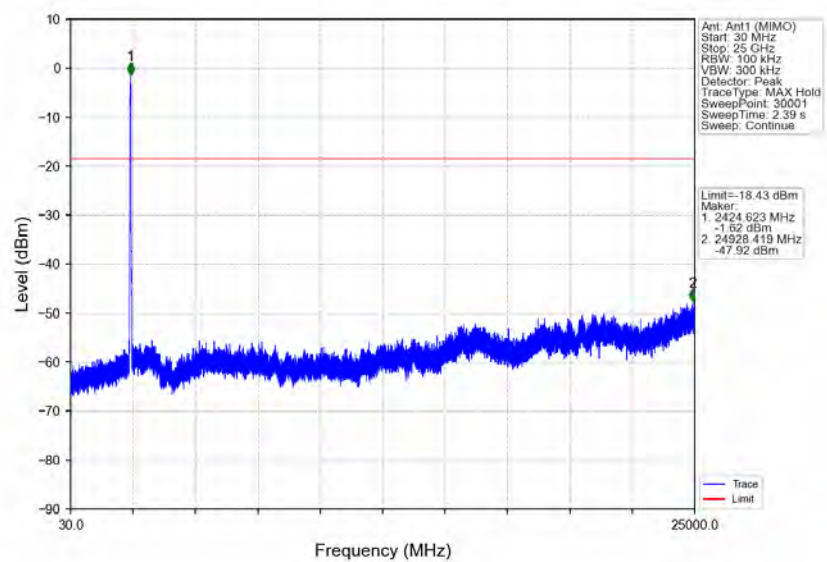


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant2 (MIMO)_NTNV

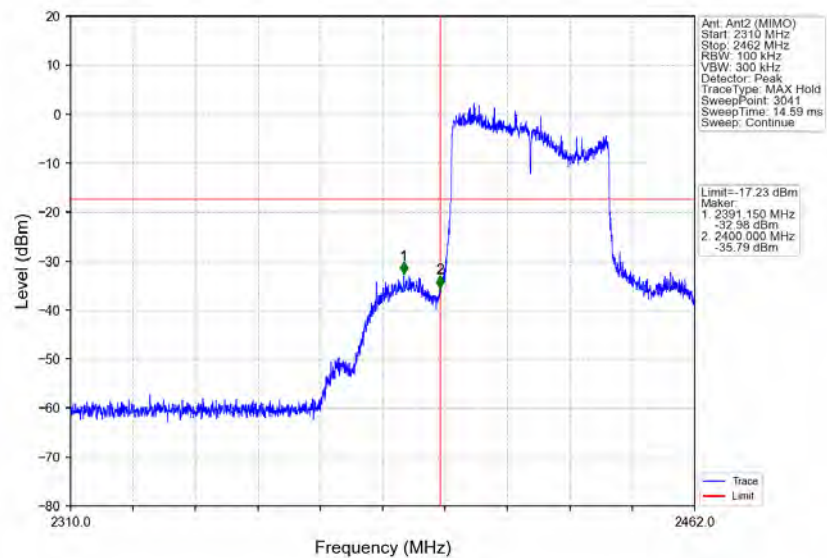


802.11ax(HEW40)_LCH_2422MHz_RU484_Left_Ant2 (MIMO)_NTNV

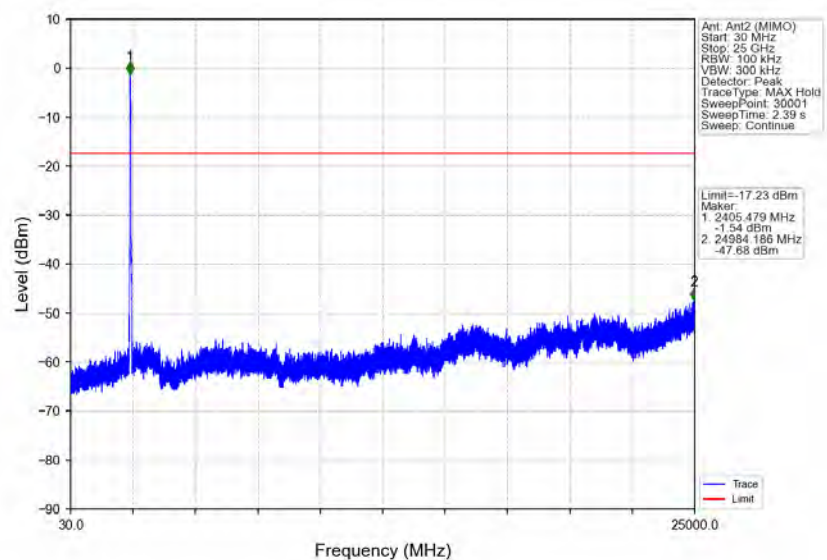


802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant1 (MIMO)_NTNV

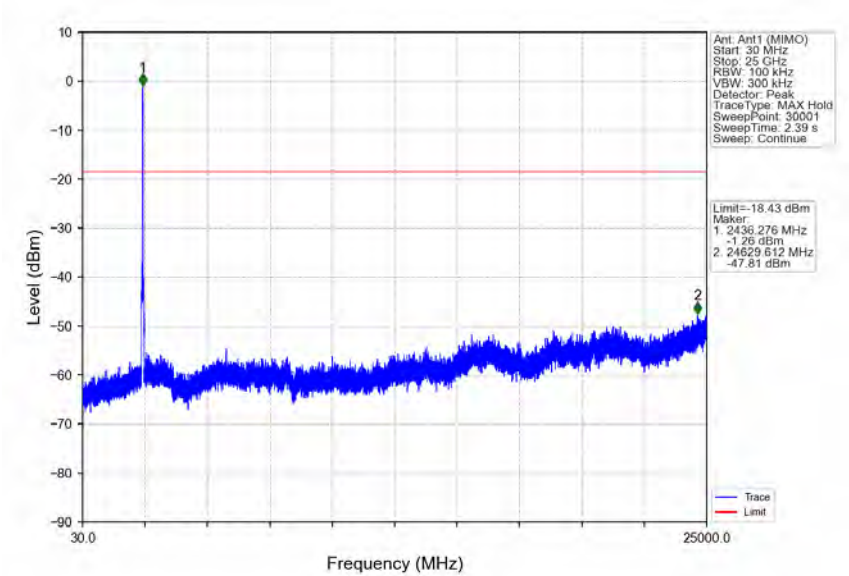


802.11ax(HEW40)_MCH_2437MHz_RU484_Left_Ant2 (MIMO)_NTNV

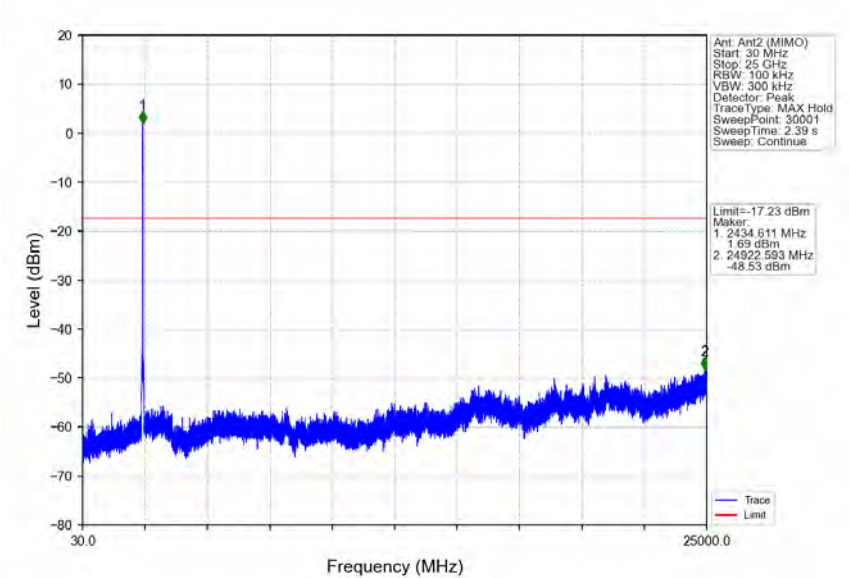


802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant1 (MIMO)_NTNV

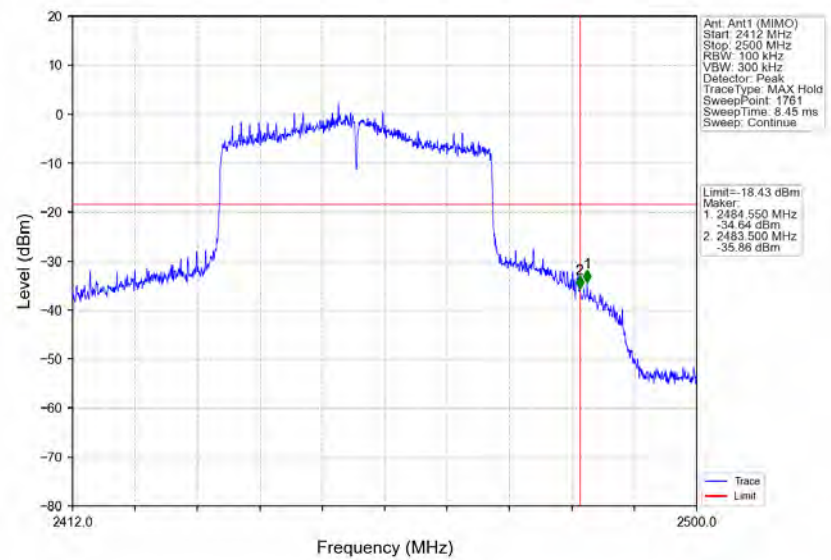


802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant1 (MIMO)_NTNV

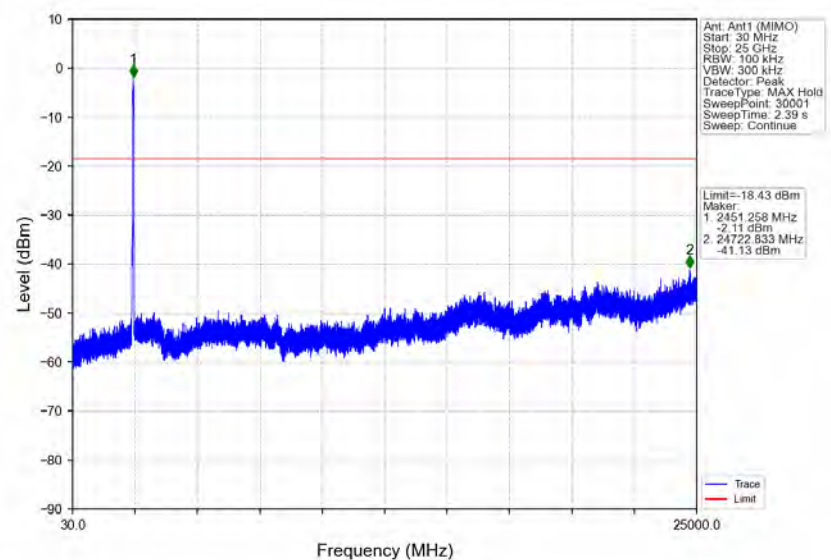

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant2 (MIMO)_NTNV

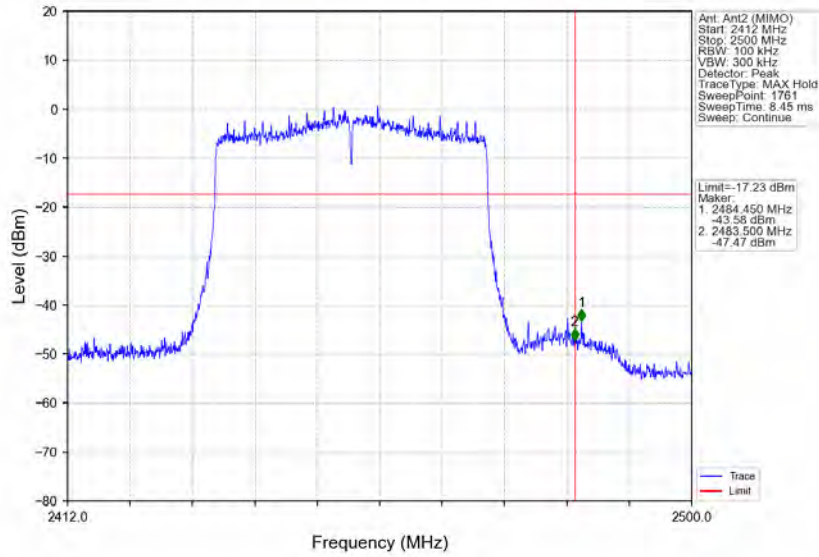

802.11ax(HEW40)_HCH_2452MHz_RU484_Left_Ant2 (MIMO)_NTNV

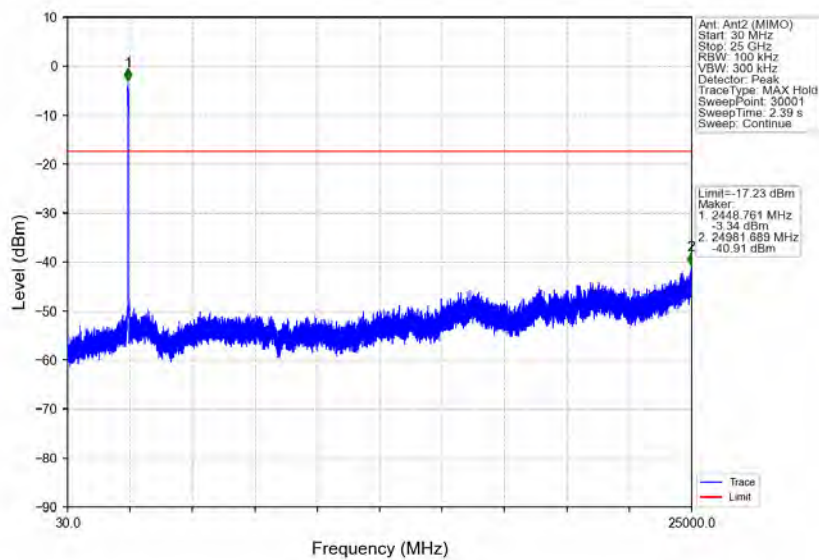

- End of the Report -