




802.11a_MCH_5785MHz_Ant1_NTNV

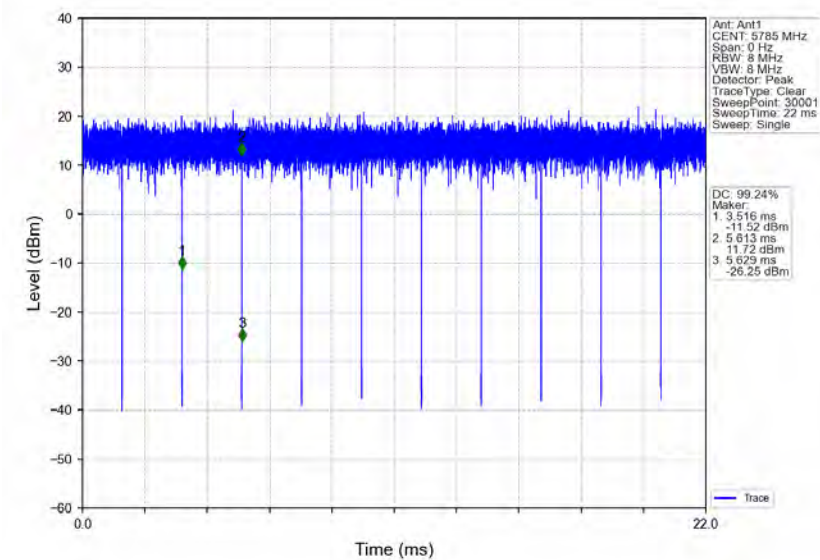


802.11a_HCH_5825MHz_Ant1_NTNV

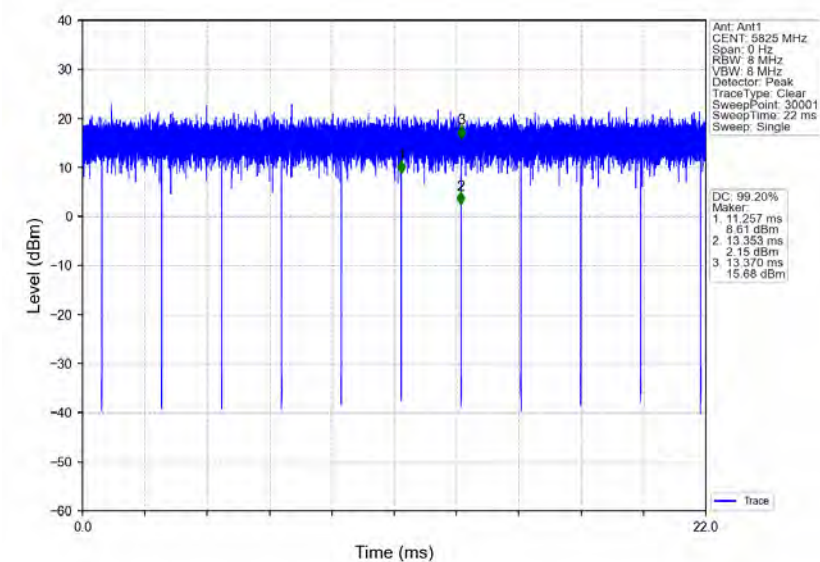


802.11n(HT20)_LCH_5180MHz_Ant1_NTNV

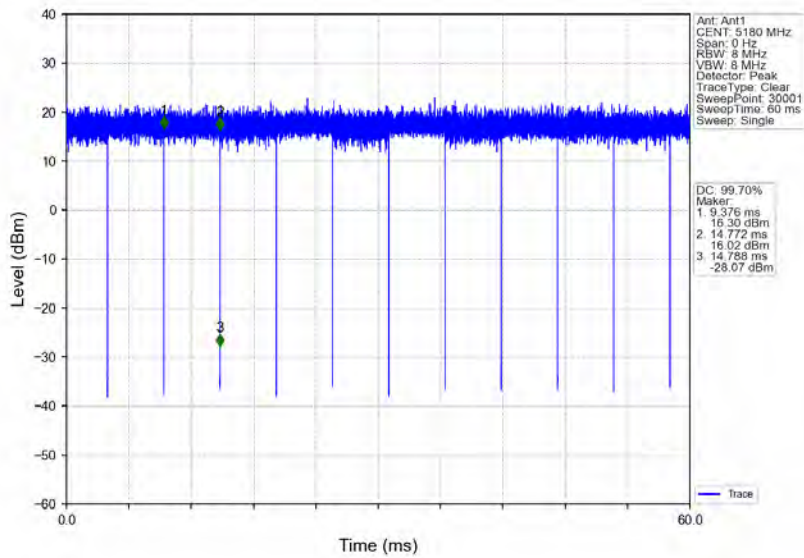


802.11n(HT20)_MCH_5200MHz_Ant1_NTNV

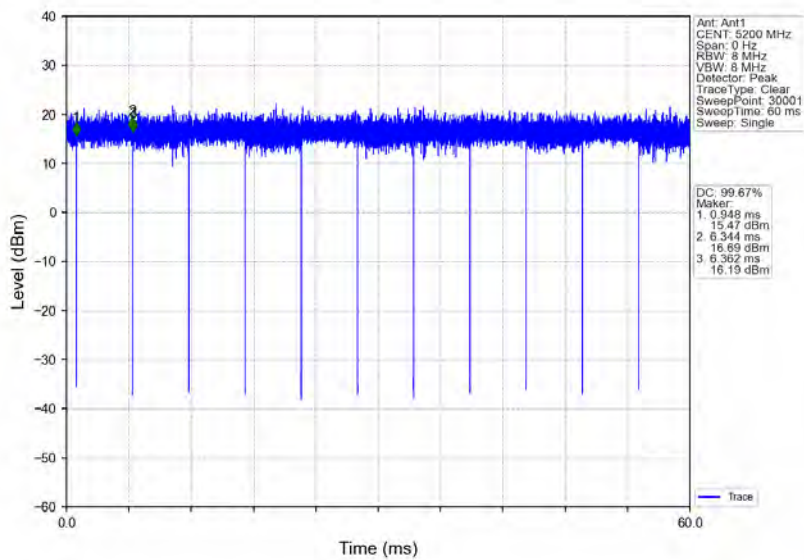


802.11n(HT20)_HCH_5240MHz_Ant1_NTNV

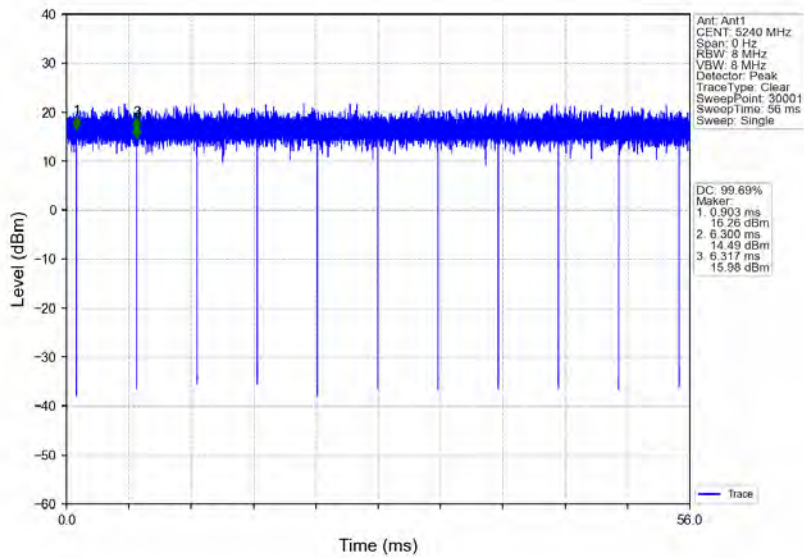


802.11n(HT20)_LCH_5260MHz_Ant1_NTNV

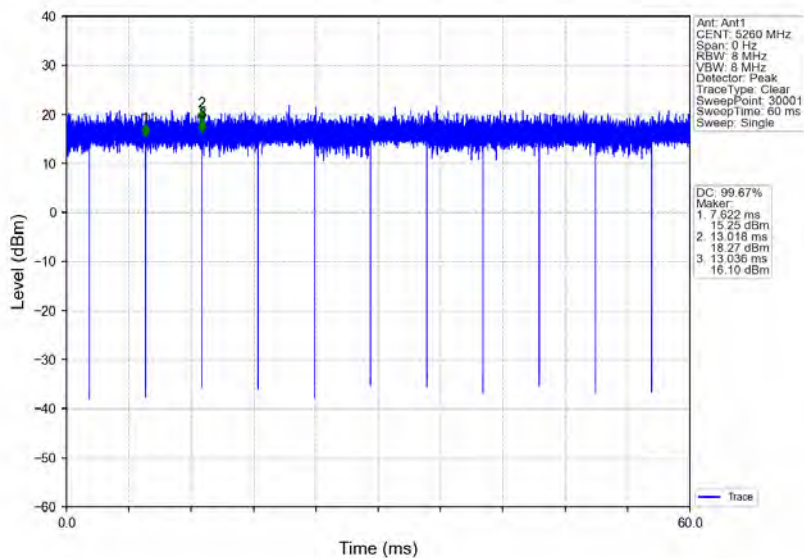


802.11n(HT20)_MCH_5300MHz_Ant1_NTNV

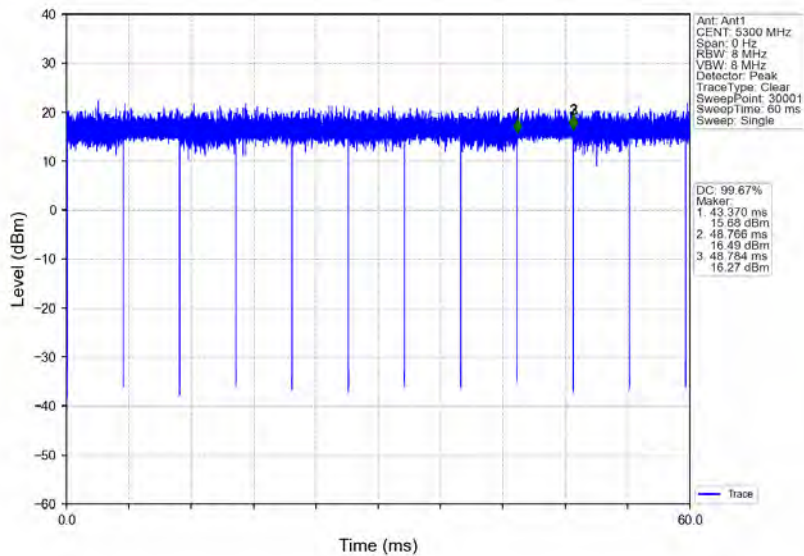


802.11n(HT20)_HCH_5320MHz_Ant1_NTNV

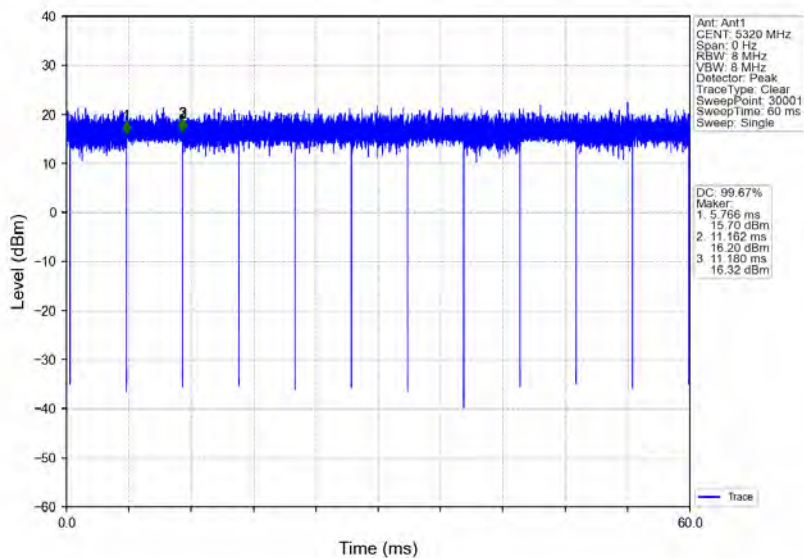


802.11n(HT20)_LCH_5500MHz_Ant1_NTNV

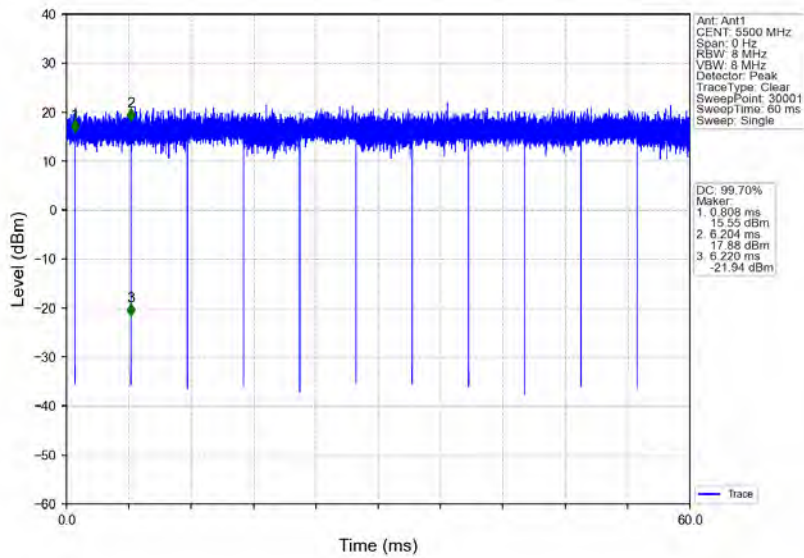


802.11n(HT20)_MCH_5580MHz_Ant1_NTNV

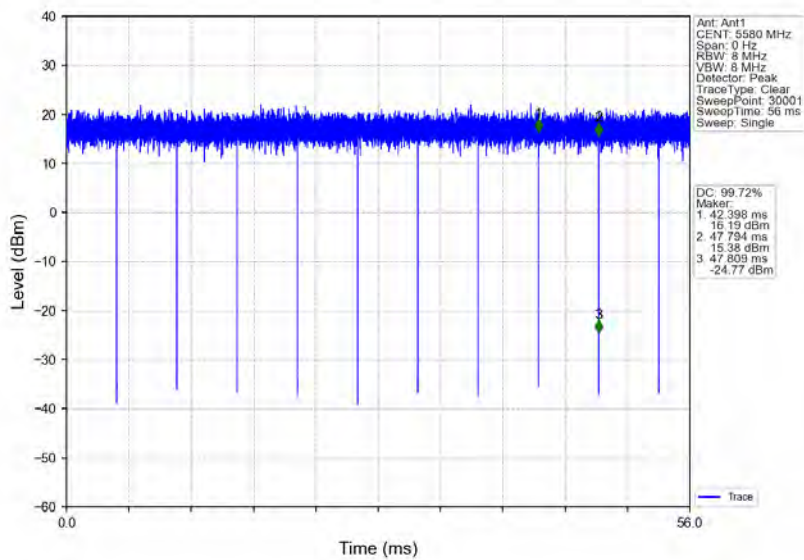


802.11n(HT20)_HCH_5700MHz_Ant1_NTNV

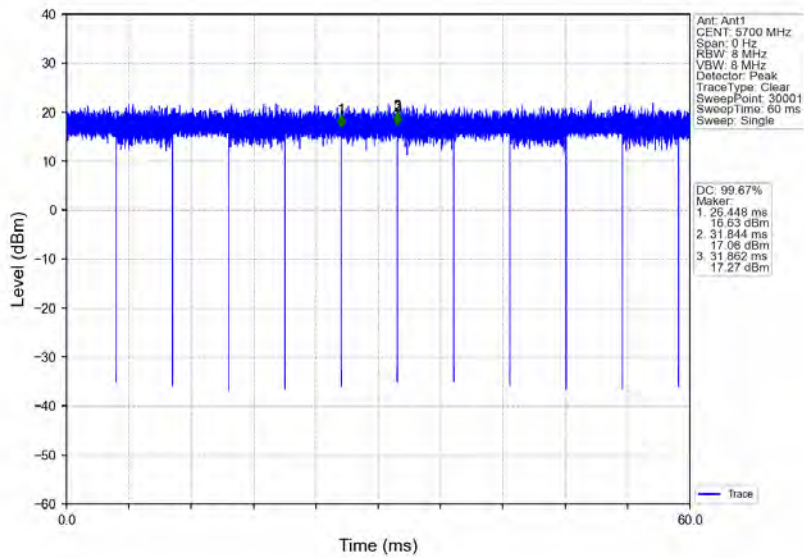


802.11n(HT20)_LCH_5745MHz_Ant1_NTNV

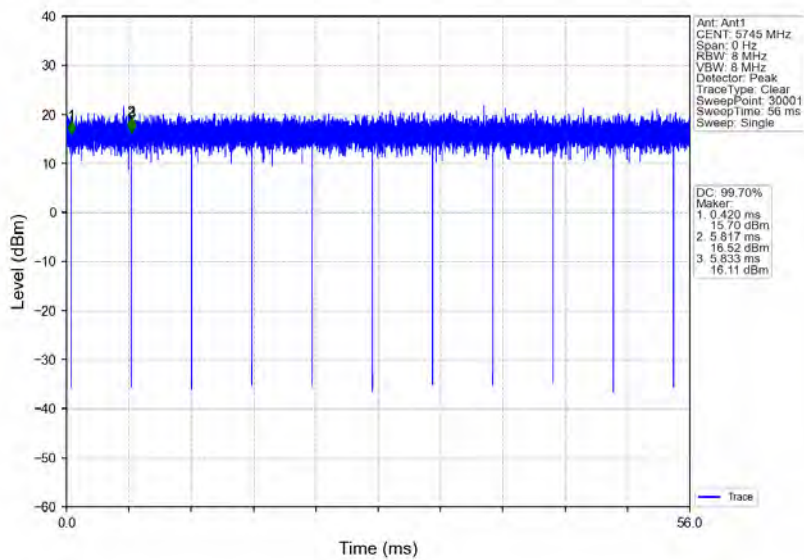

802.11n(HT20)_MCH_5785MHz_Ant1_NTNV

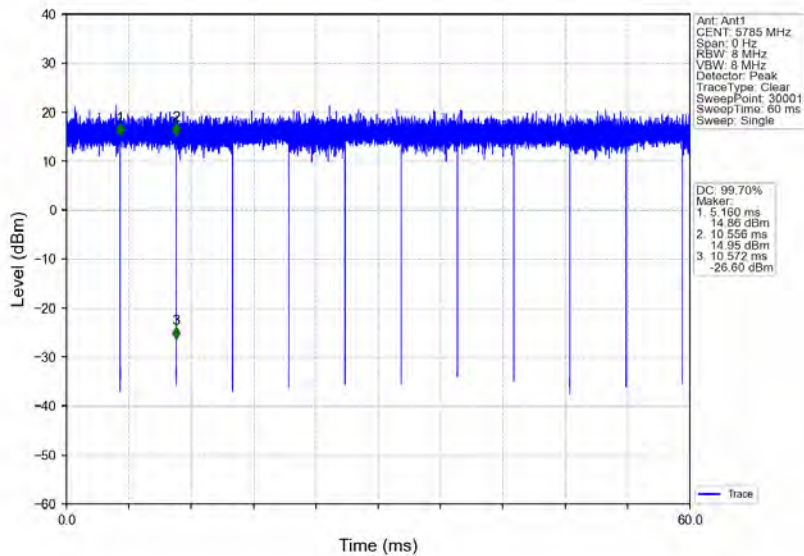

802.11n(HT20)_HCH_5825MHz_Ant1_NTNV

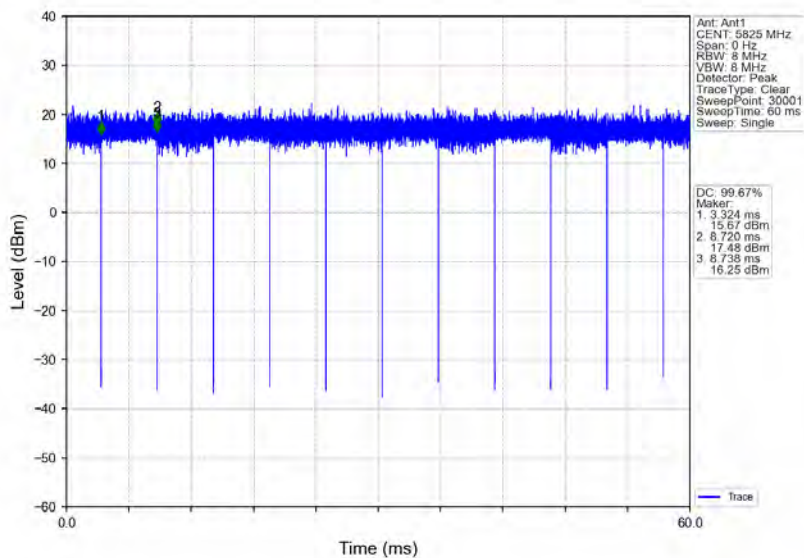


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 295 of 648


802.11n(HT40)_LCH_5190MHz_Ant1_NTNV

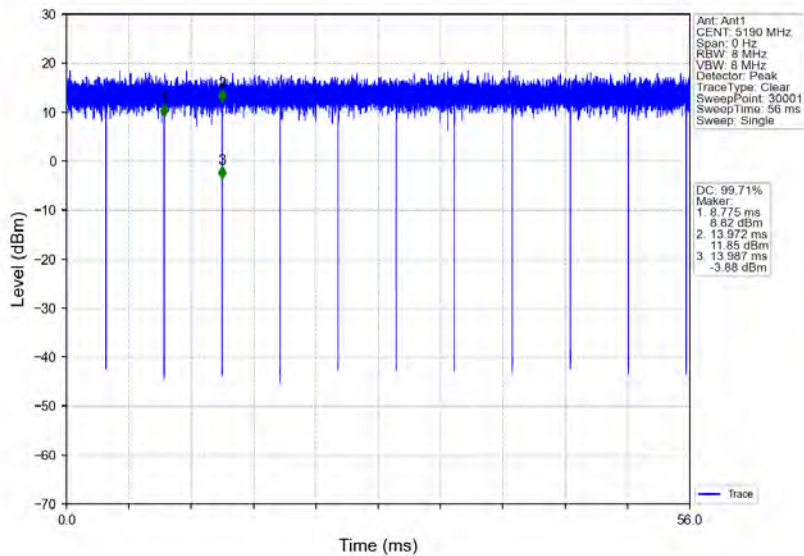


802.11n(HT40)_HCH_5230MHz_Ant1_NTNV

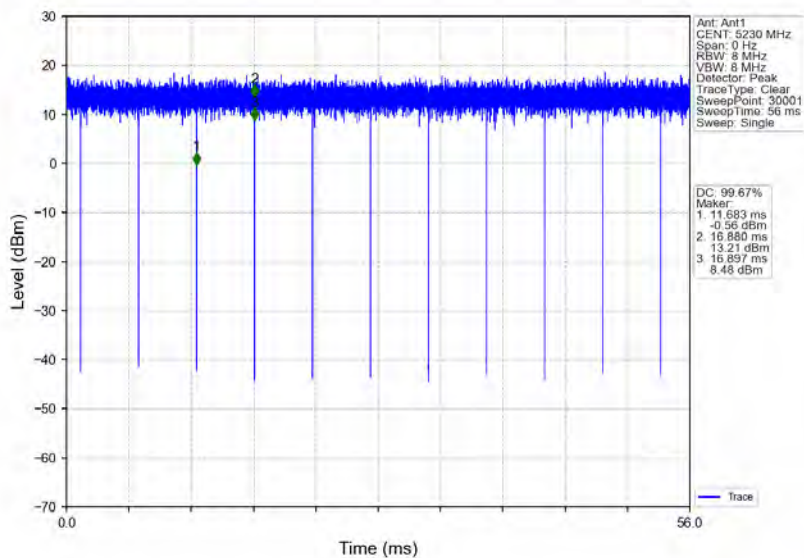


802.11n(HT40)_LCH_5270MHz_Ant1_NTNV

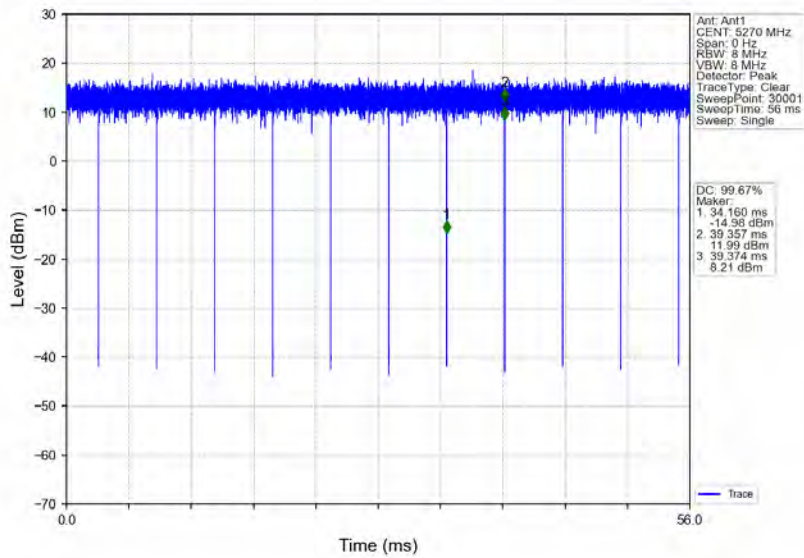


802.11n(HT40)_HCH_5310MHz_Ant1_NTNV

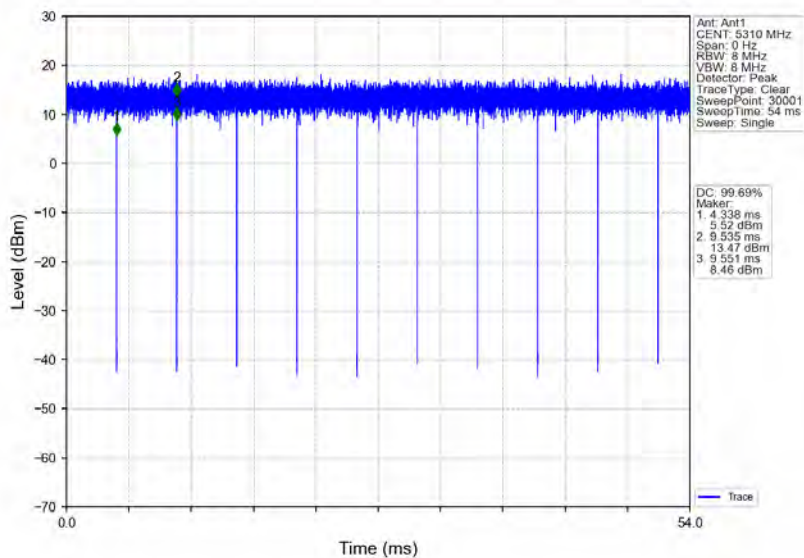


802.11n(HT40)_LCH_5510MHz_Ant1_NTNV

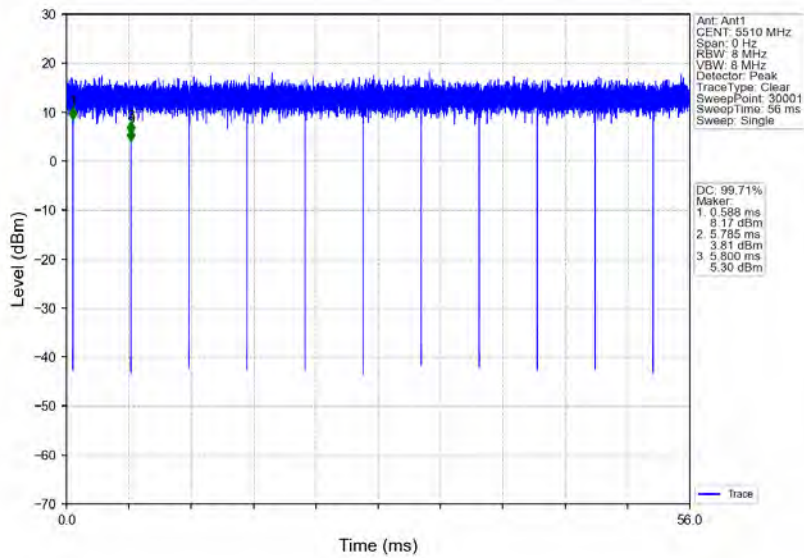


802.11n(HT40)_MCH_5550MHz_Ant1_NTNV

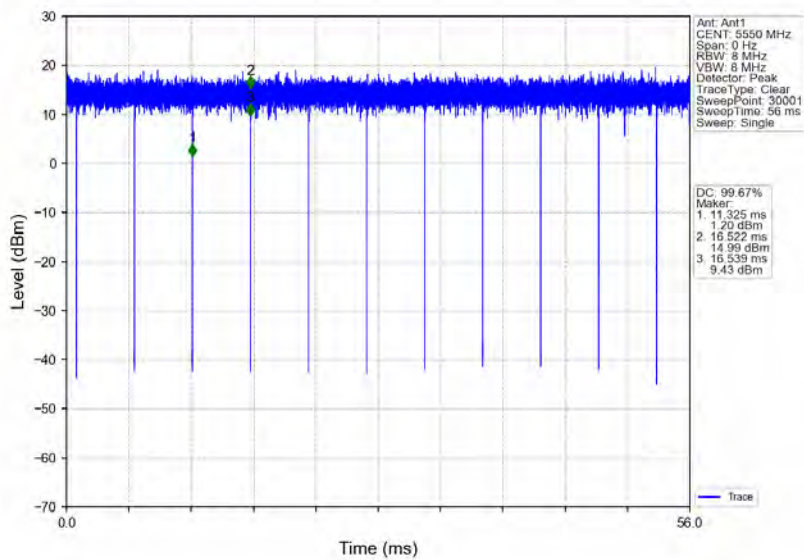


802.11n(HT40)_HCH_5670MHz_Ant1_NTNV

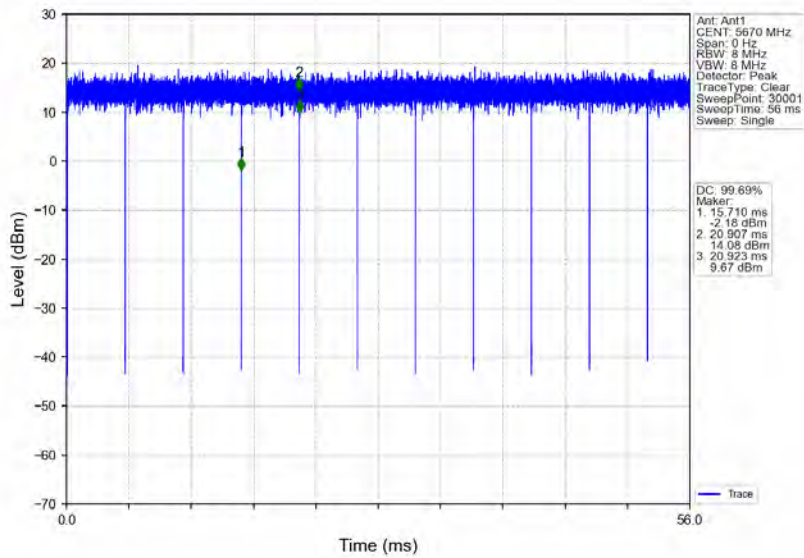


802.11n(HT40)_LCH_5755MHz_Ant1_NTNV

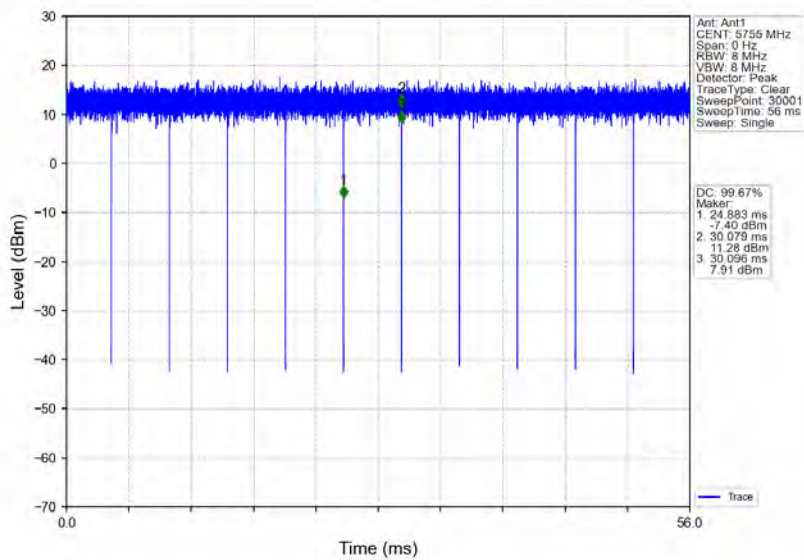


802.11n(HT40)_HCH_5795MHz_Ant1_NTNV

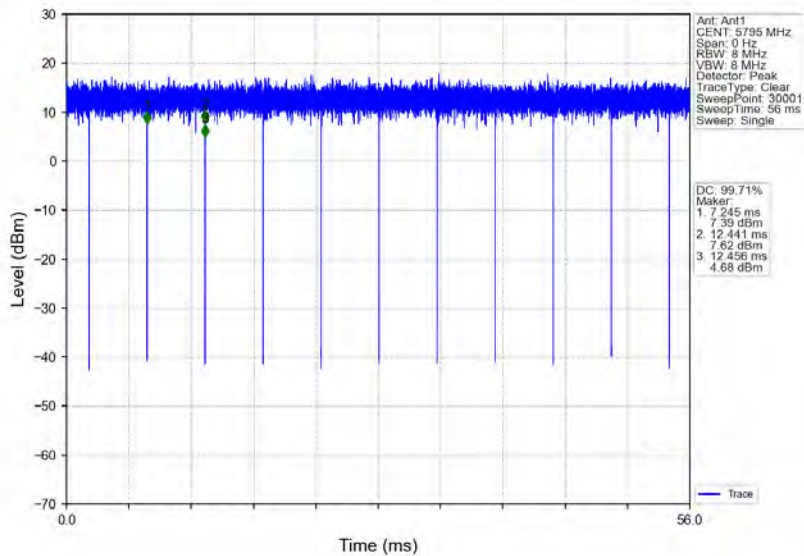


802.11ac(VHT80)_MCH_5210MHz_Ant1_NTNV

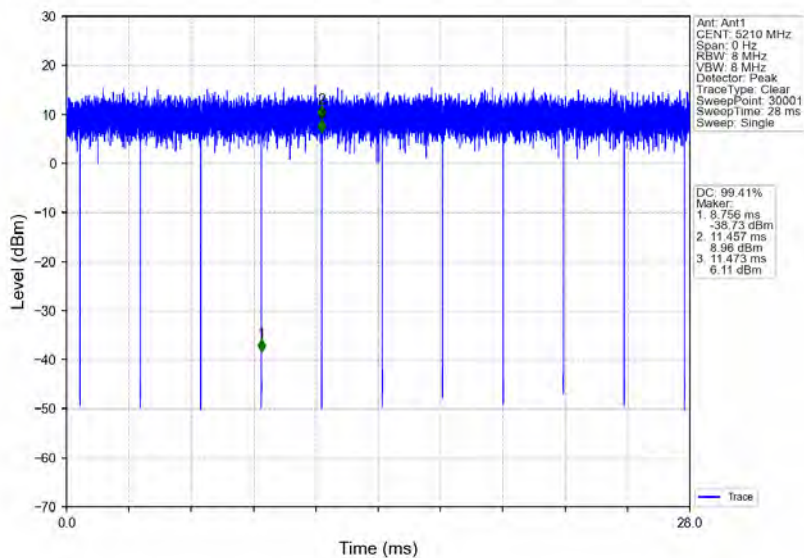


802.11ac(VHT80)_MCH_5290MHz_Ant1_NTNV

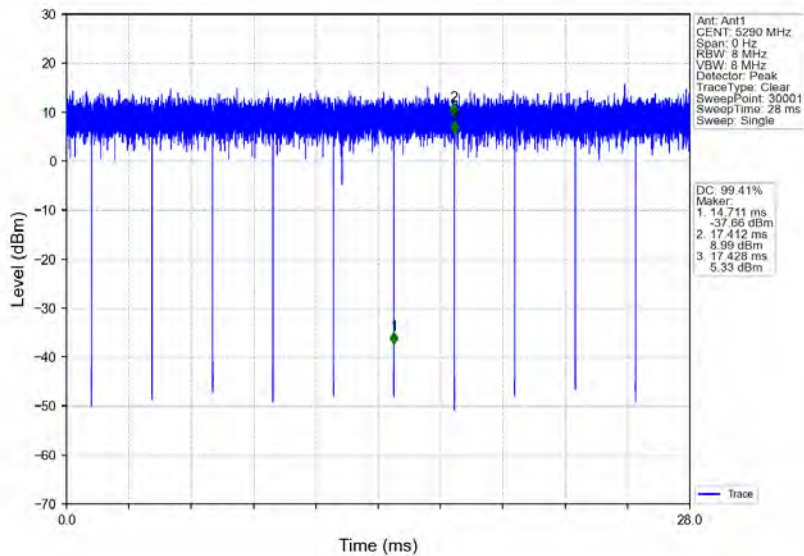


802.11ac(VHT80)_LCH_5530MHz_Ant1_NTNV

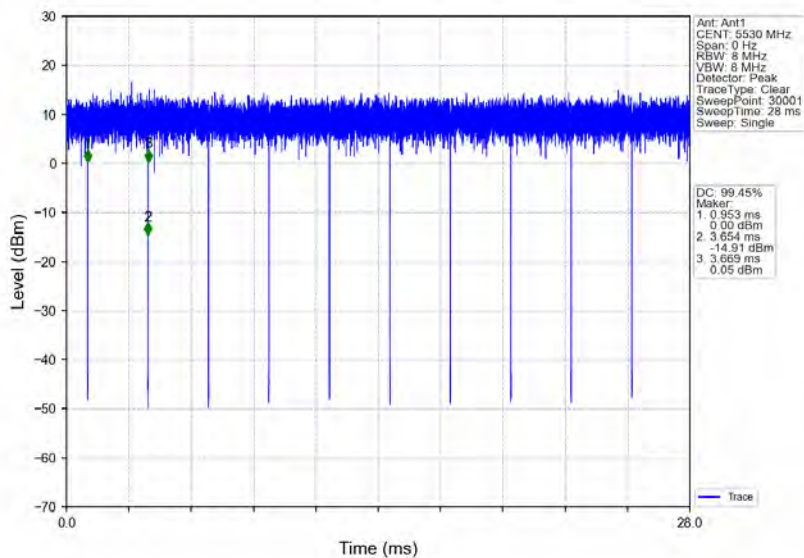

802.11ac(VHT80)_HCH_5610MHz_Ant1_NTNV

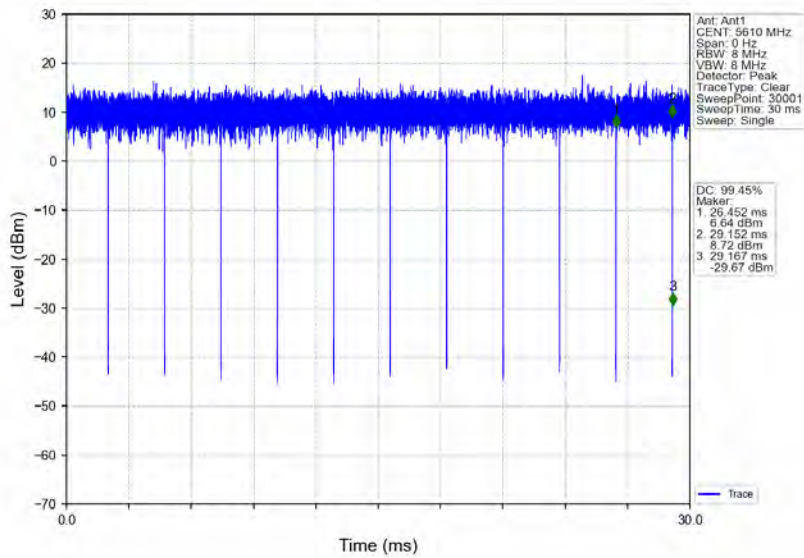

802.11ac(VHT80)_MCH_5775MHz_Ant1_NTNV

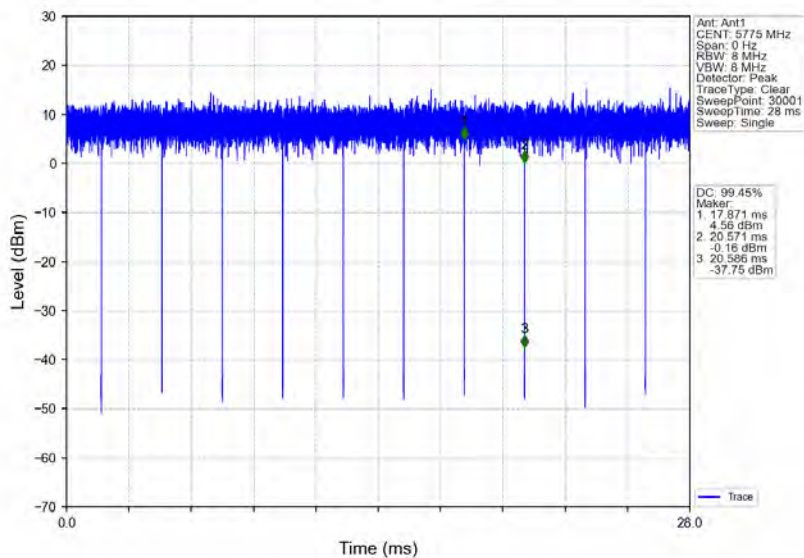


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 302 of 648


802.11ax(HEW20)_LCH_5180MHz_RU242_Left_Ant1_NTNV

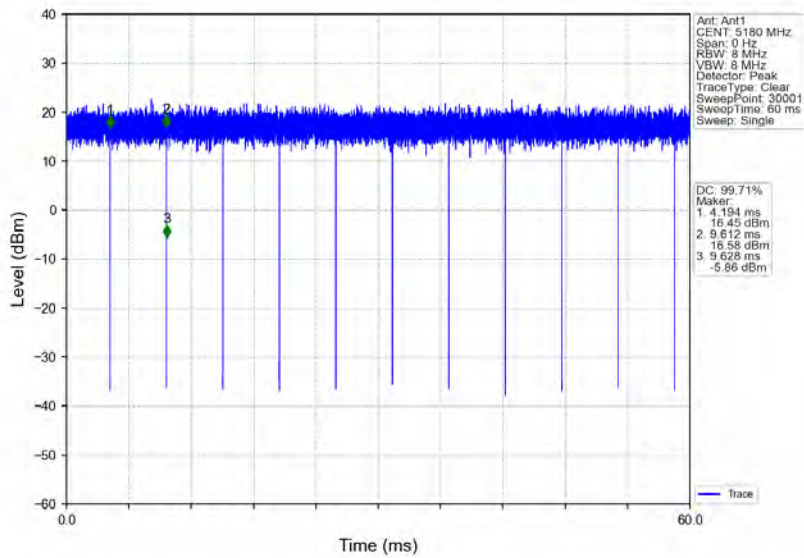


802.11ax(HEW20)_MCH_5200MHz_RU242_Left_Ant1_NTNV

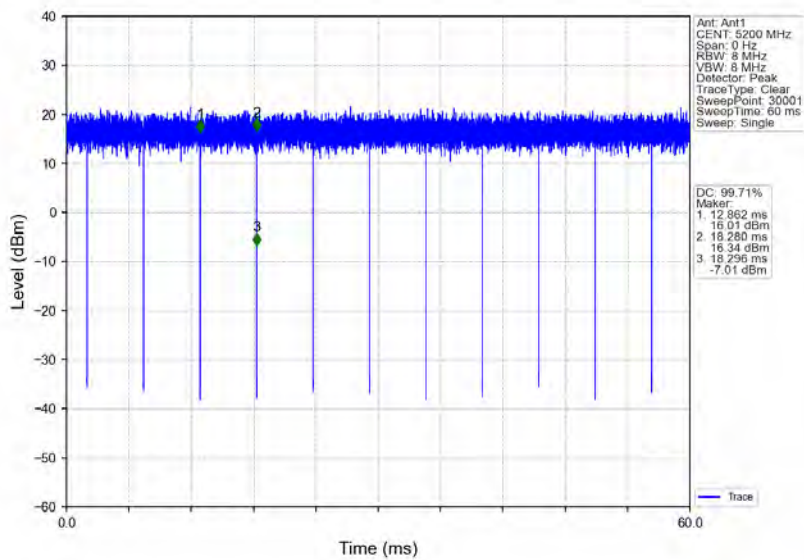


802.11ax(HEW20)_HCH_5240MHz_RU242_Left_Ant1_NTNV

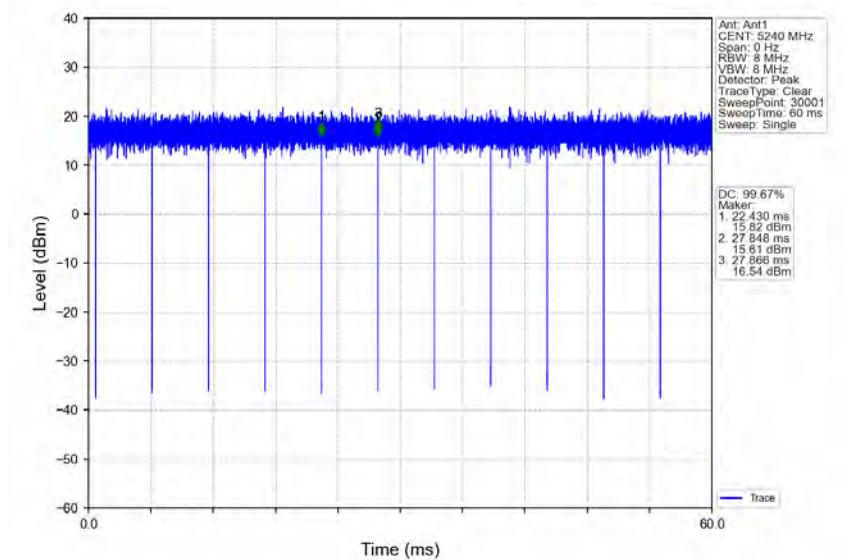


802.11ax(HEW20)_LCH_5260MHz_RU242_Left_Ant1_NTNV

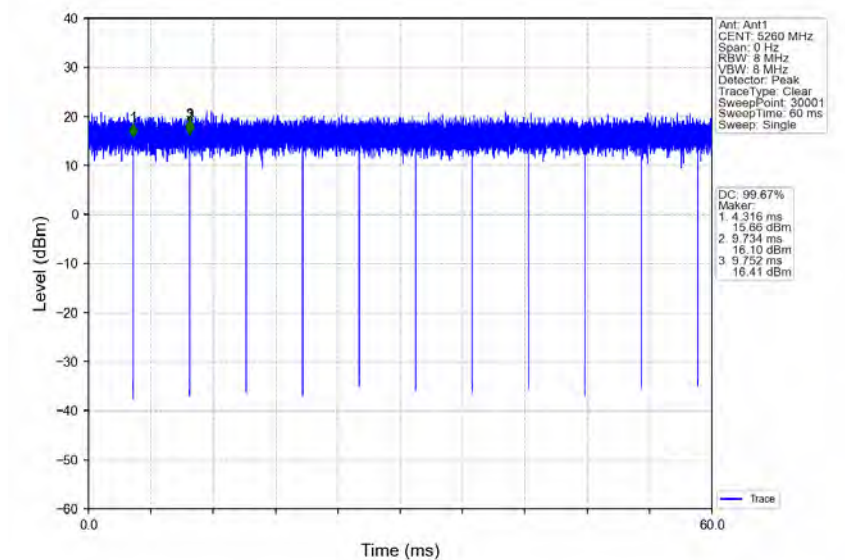

802.11ax(HEW20)_MCH_5300MHz_RU242_Left_Ant1_NTNV

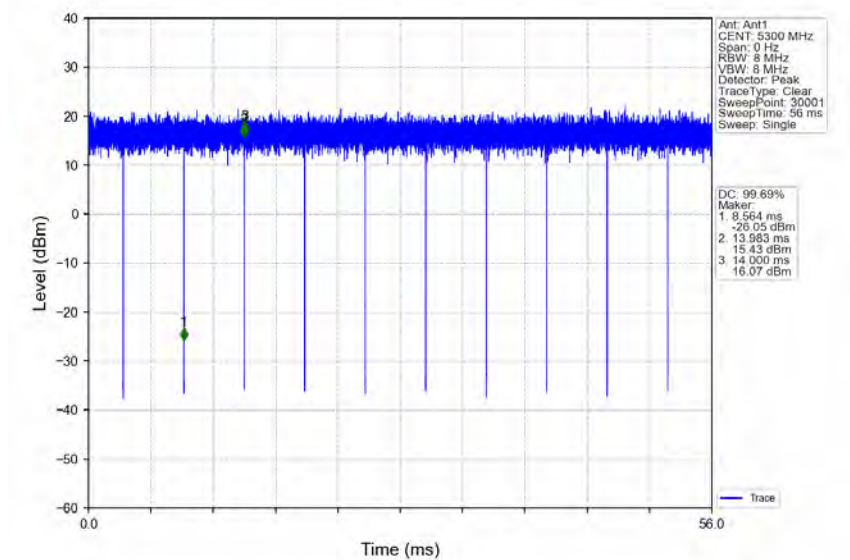

802.11ax(HEW20)_HCH_5320MHz_RU242_Left_Ant1_NTNV

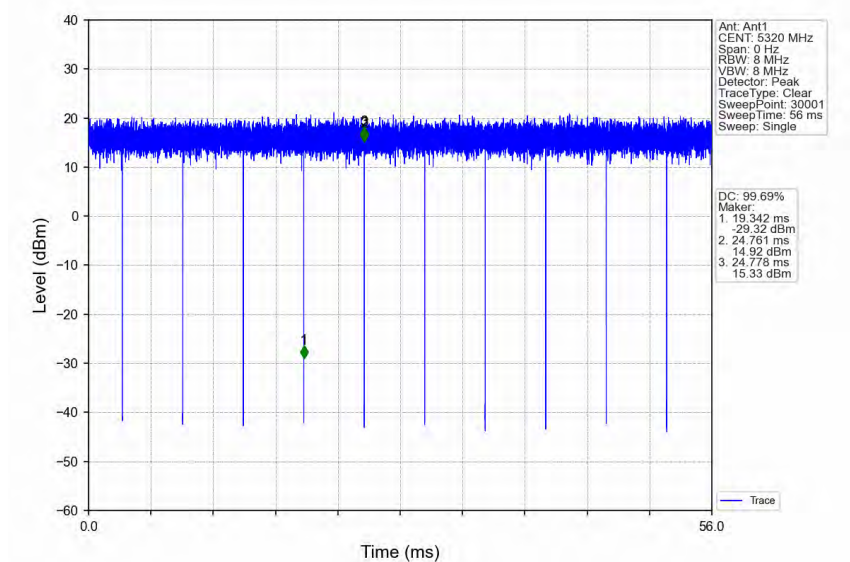


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 305 of 648


802.11ax(HEW20)_LCH_5500MHz_RU242_Left_Ant1_NTNV

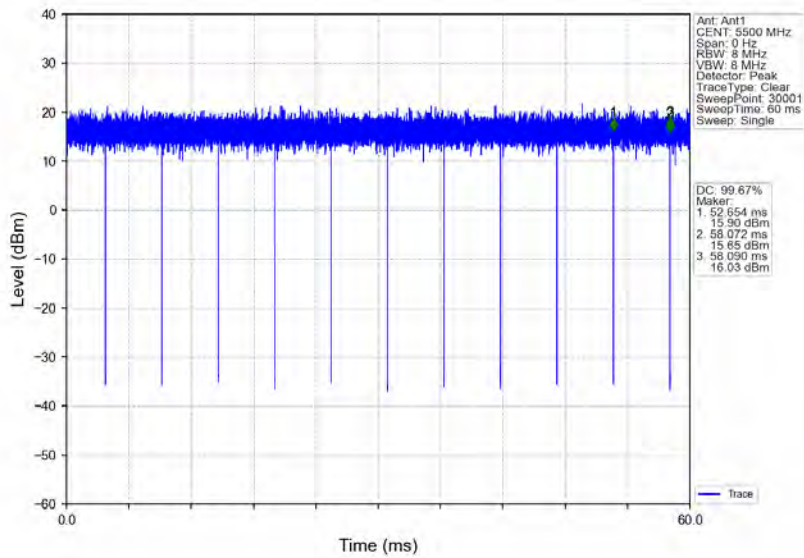


802.11ax(HEW20)_MCH_5580MHz_RU242_Left_Ant1_NTNV

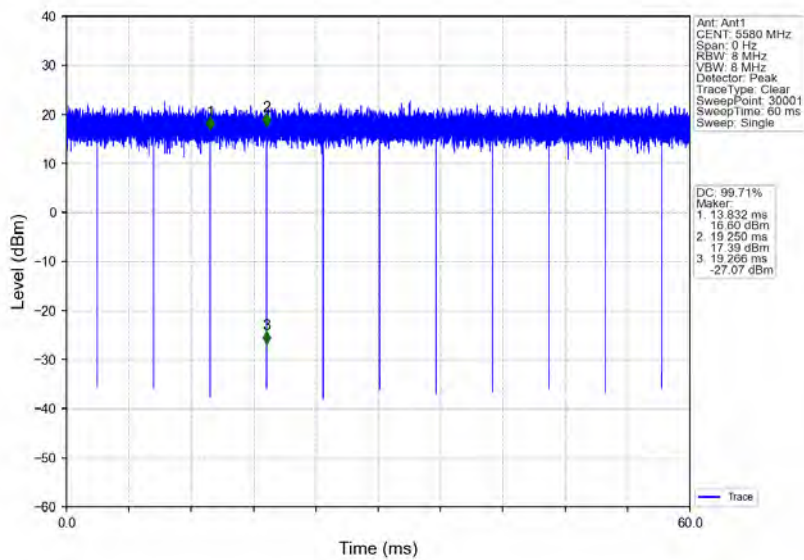


802.11ax(HEW20)_HCH_5700MHz_RU242_Left_Ant1_NTNV

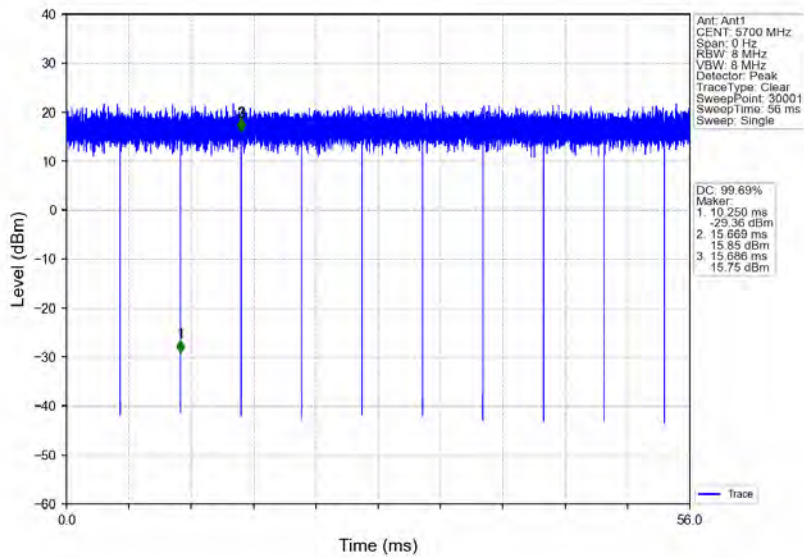


802.11ax(HEW20)_LCH_5745MHz_RU242_Left_Ant1_NTNV

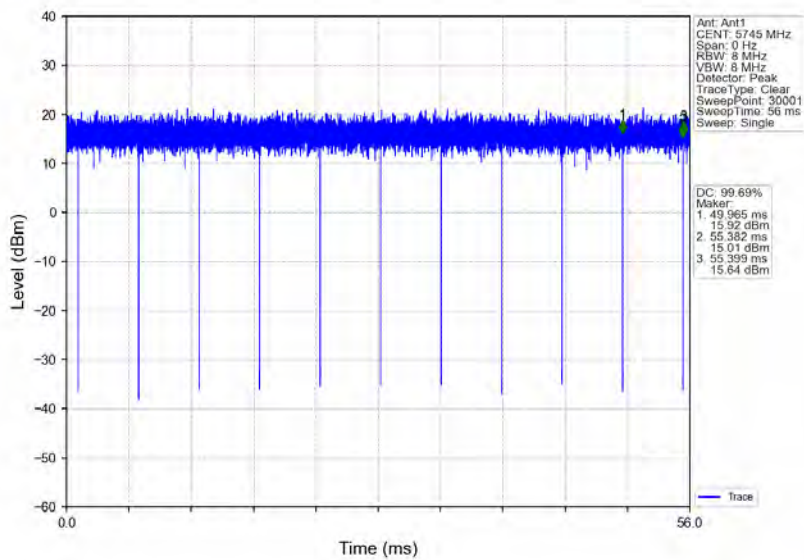


802.11ax(HEW20)_MCH_5785MHz_RU242_Left_Ant1_NTNV

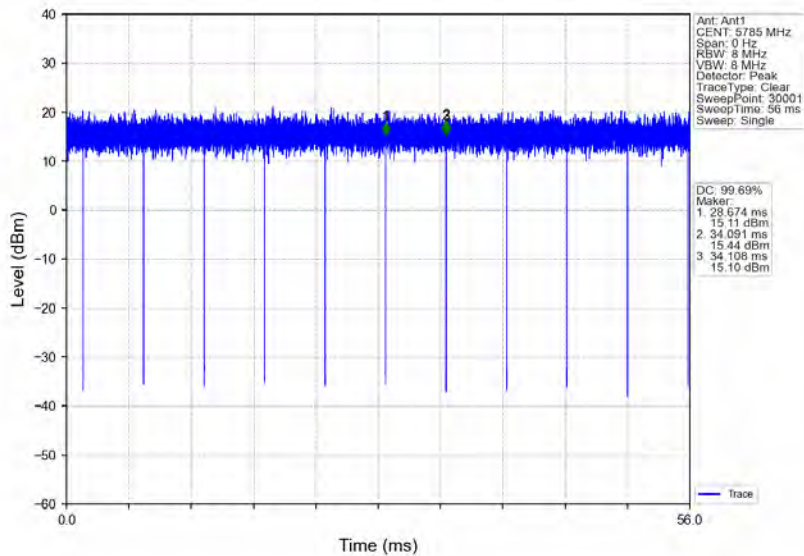


802.11ax(HEW20)_HCH_5825MHz_RU242_Left_Ant1_NTNV

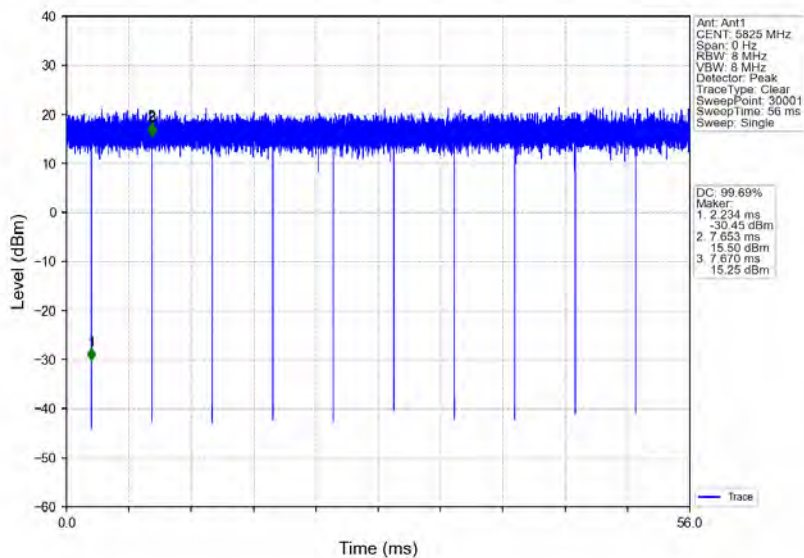

802.11ax(HEW40)_LCH_5190MHz_RU484_Left_Ant1_NTNV

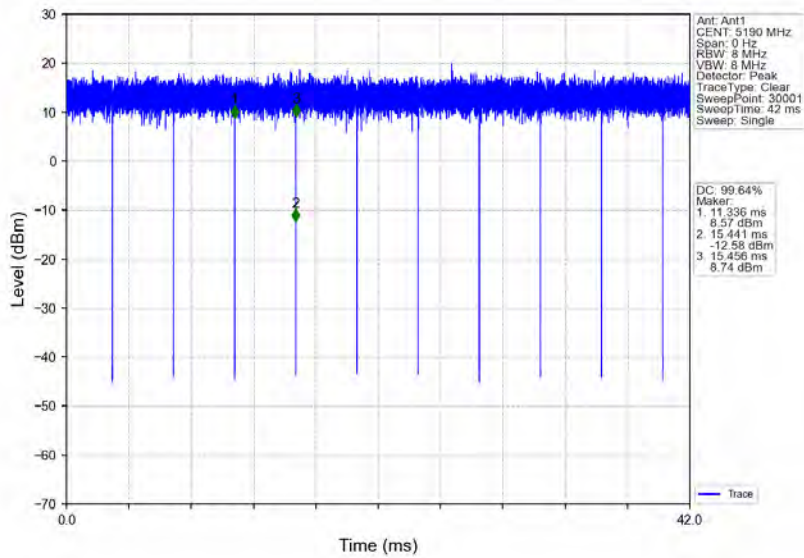

802.11ax(HEW40)_HCH_5230MHz_RU484_Left_Ant1_NTNV

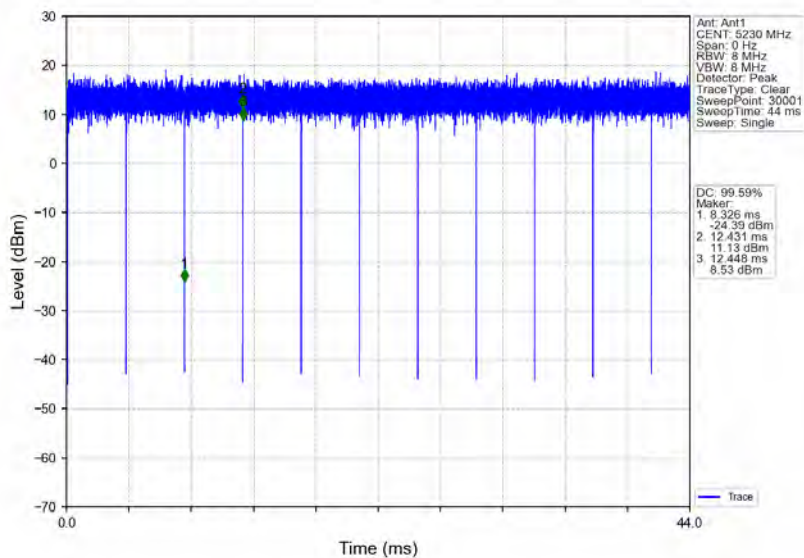


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 309 of 648


802.11ax(HEW40)_LCH_5270MHz_RU484_Left_Ant1_NTNV

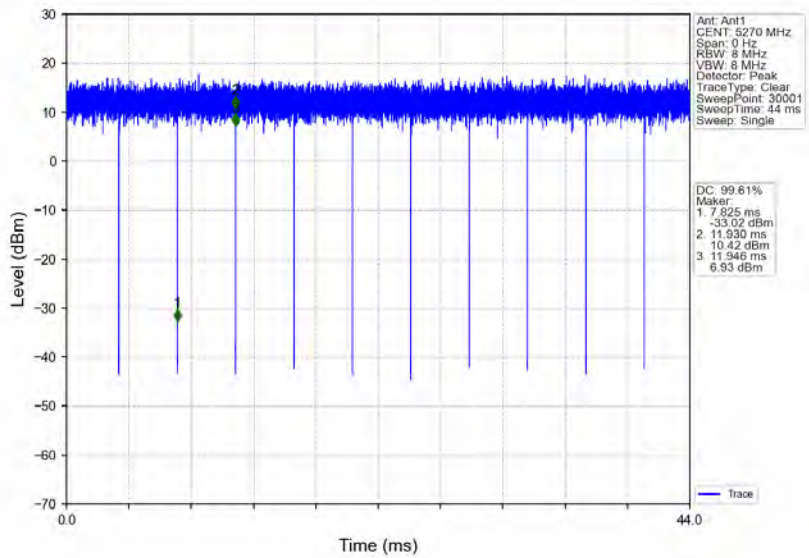


802.11ax(HEW40)_HCH_5310MHz_RU484_Left_Ant1_NTNV

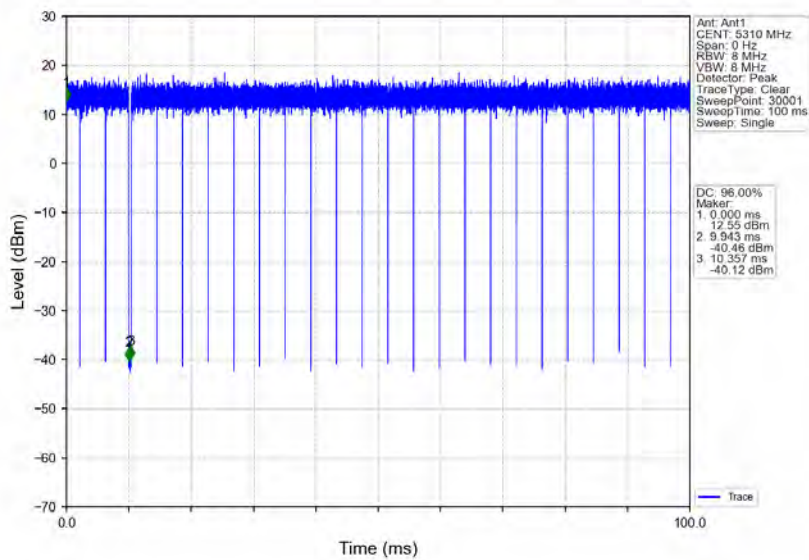


802.11ax(HEW40)_LCH_5510MHz_RU484_Left_Ant1_NTNV

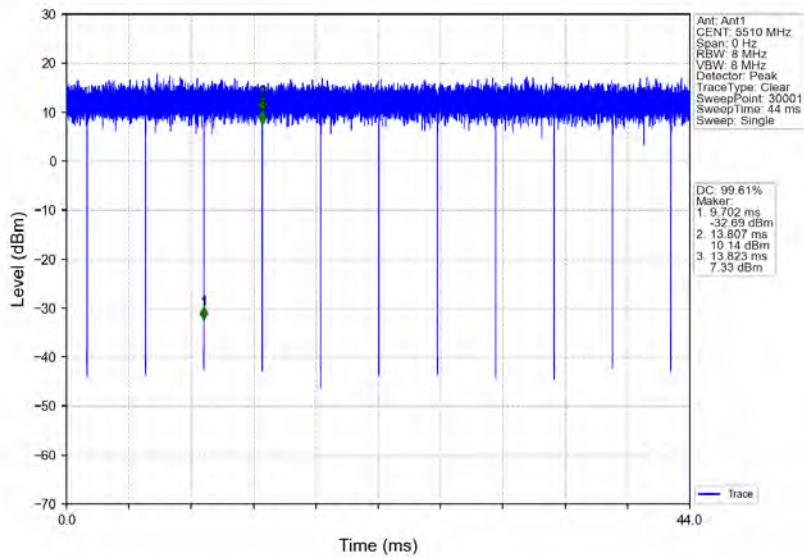


802.11ax(HEW40)_MCH_5550MHz_RU484_Left_Ant1_NTNV

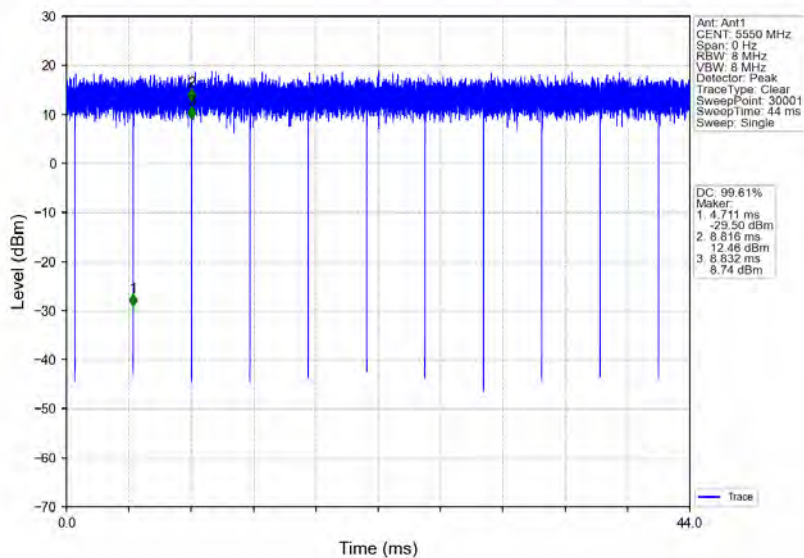

802.11ax(HEW40)_HCH_5670MHz_RU484_Left_Ant1_NTNV

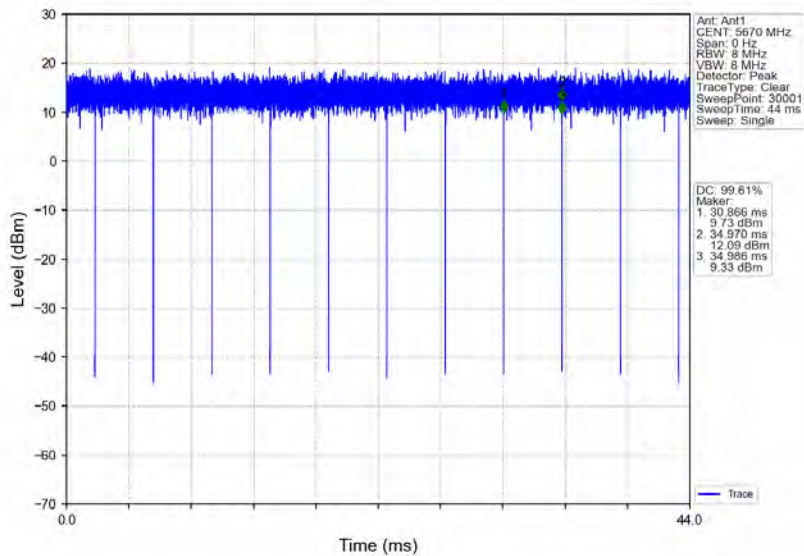

802.11ax(HEW40)_LCH_5755MHz_RU484_Left_Ant1_NTNV

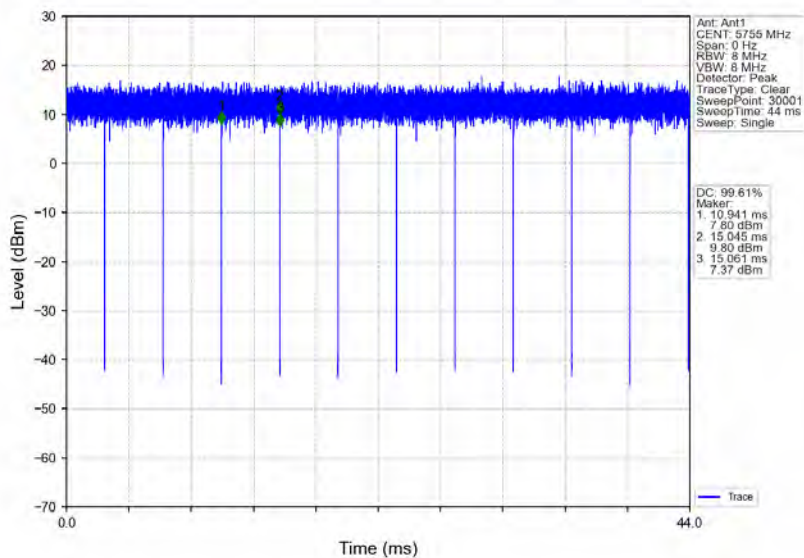


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 312 of 648


802.11ax(HEW40)_HCH_5795MHz_RU484_Left_Ant1_NTNV

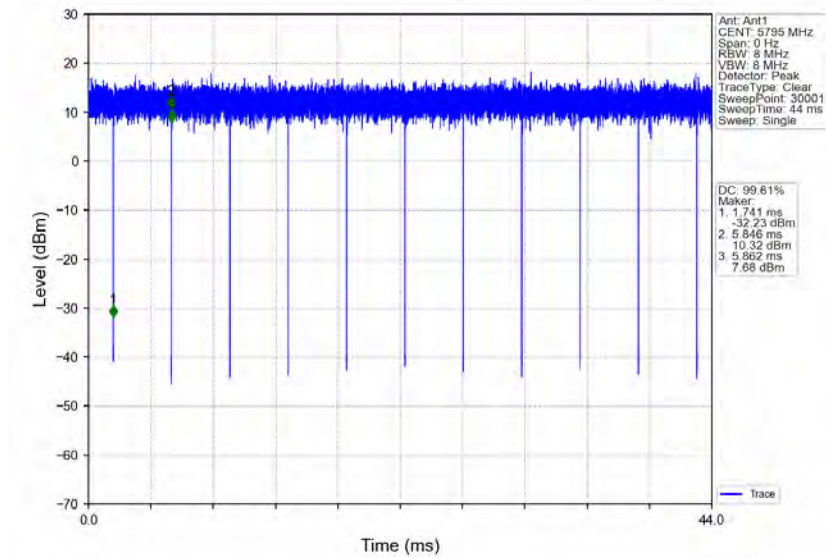


802.11ax(HEW80)_MCH_5210MHz_RU996_Left_Ant1_NTNV

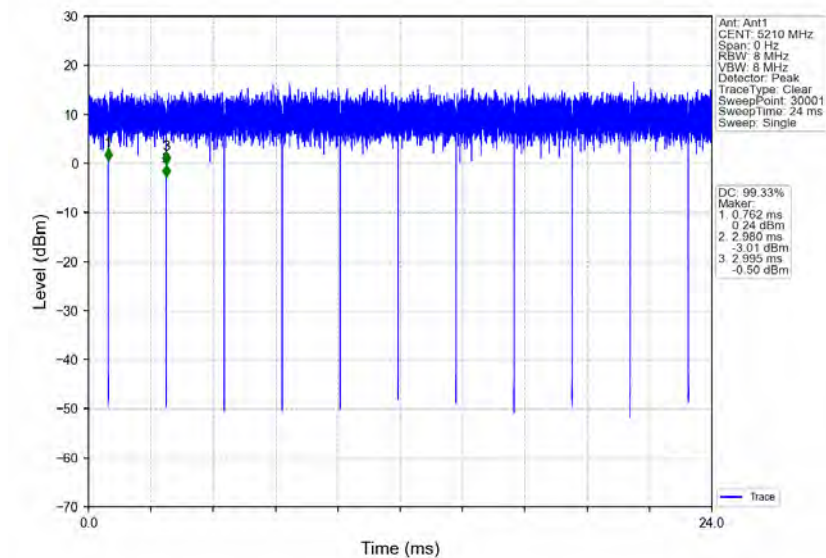


802.11ax(HEW80)_MCH_5290MHz_RU996_Left_Ant1_NTNV

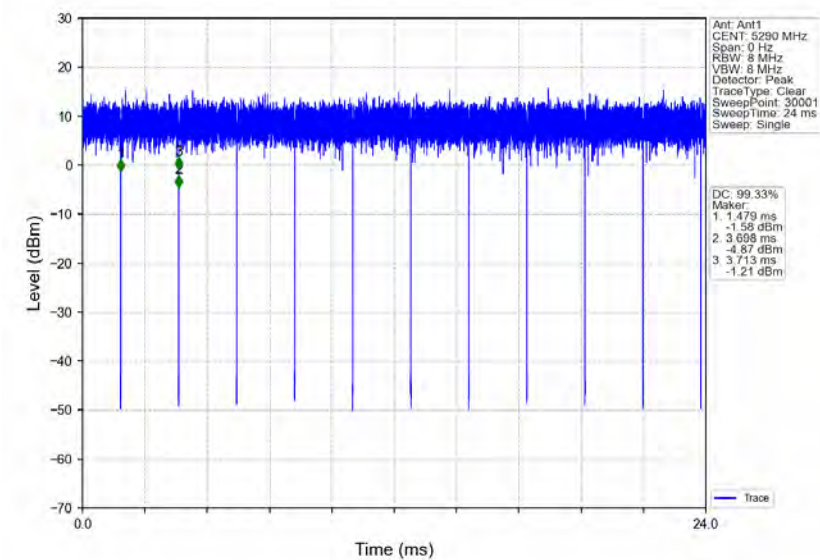


802.11ax(HEW80)_LCH_5530MHz_RU996_Left_Ant1_NTNV

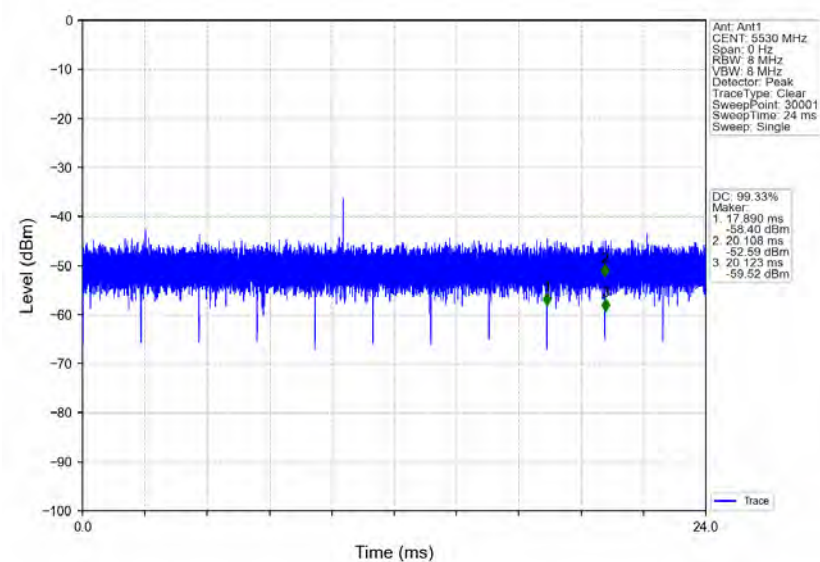

802.11ax(HEW80)_HCH_5610MHz_RU996_Left_Ant1_NTNV

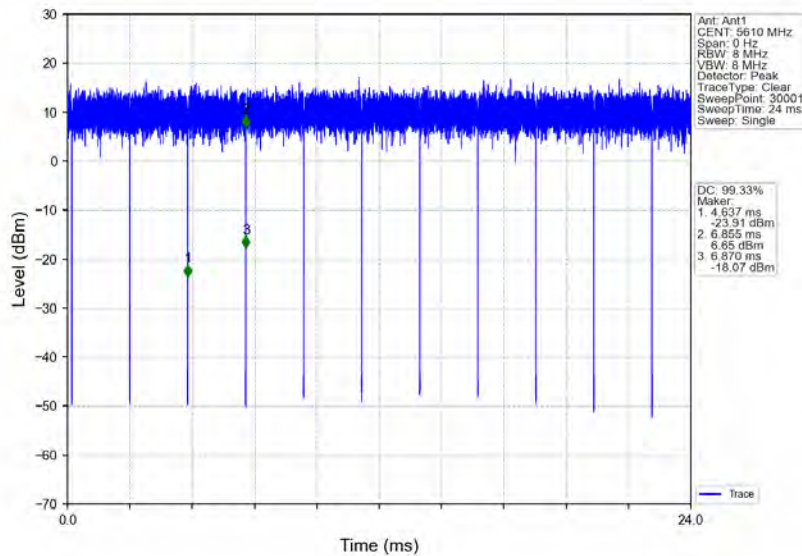

802.11ax(HEW80)_MCH_5775MHz_RU996_Left_Ant1_NTNV

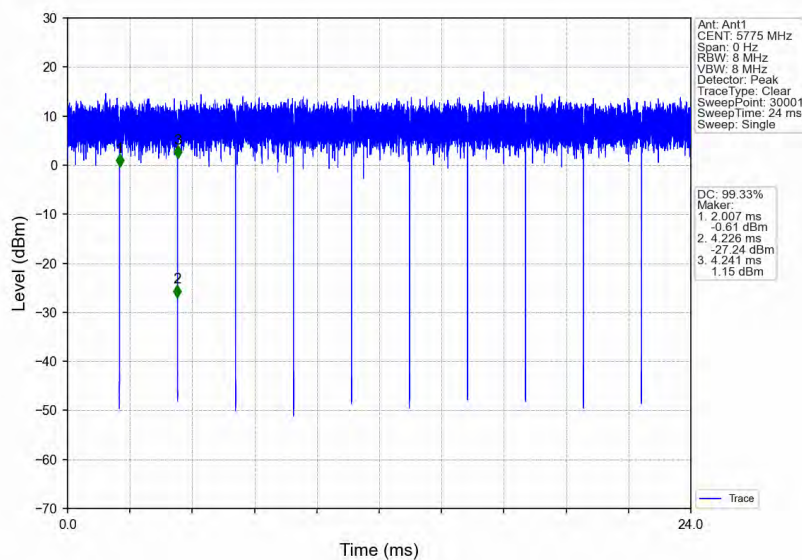

Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002

Page: 315 of 648

2. Bandwidth

2.1 OBW

2.1.1 Test Result

Mode	TX Type	Frequency (MHz)	RU	RU Pos	ANT	99% Occupied Bandwidth (MHz)		Verdict
						Result	Limit	
802.11a	SISO	5180	/	/	1	16.649	/	Pass
					2	16.652	/	Pass
		5200	/	/	1	16.672	/	Pass
					2	16.685	/	Pass
		5240	/	/	1	16.676	/	Pass
					2	16.644	/	Pass
		5260	/	/	1	16.666	/	Pass
					2	16.668	/	Pass
		5300	/	/	1	16.663	/	Pass
					2	16.652	/	Pass
		5320	/	/	1	16.643	/	Pass
					2	16.651	/	Pass
		5500	/	/	1	16.644	/	Pass
					2	16.688	/	Pass
		5580	/	/	1	16.669	/	Pass
					2	16.682	/	Pass
		5700	/	/	1	16.673	/	Pass
					2	16.675	/	Pass
		5745	/	/	1	16.633	/	Pass
					2	16.626	/	Pass
		5785	/	/	1	16.655	/	Pass
					2	16.726	/	Pass
		5825	/	/	1	16.656	/	Pass
					2	16.719	/	Pass
802.11n (HT20)	MIMO	5180	/	/	1	17.795	/	Pass
					2	18.038	/	Pass
		5200	/	/	1	17.809	/	Pass
					2	17.677	/	Pass
		5240	/	/	1	17.804	/	Pass
					2	17.863	/	Pass
		5260	/	/	1	17.784	/	Pass
					2	17.784	/	Pass
		5300	/	/	1	17.816	/	Pass
					2	17.821	/	Pass
		5320	/	/	1	17.789	/	Pass
					2	18.812	/	Pass

Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002

Page: 316 of 648

		5500	/	/	1	17.792	/	Pass
					2	17.982	/	Pass
		5580	/	/	1	17.849	/	Pass
					2	18.103	/	Pass
		5700	/	/	1	17.828	/	Pass
					2	17.808	/	Pass
		5745	/	/	1	17.804	/	Pass
					2	17.955	/	Pass
		5785	/	/	1	17.823	/	Pass
					2	19.698	/	Pass
		5825	/	/	1	17.837	/	Pass
					2	18.013	/	Pass
802.11n (HT40)	MIMO	5190	/	/	1	36.060	/	Pass
					2	36.193	/	Pass
		5230	/	/	1	36.027	/	Pass
					2	35.911	/	Pass
		5270	/	/	1	36.069	/	Pass
					2	35.582	/	Pass
		5310	/	/	1	36.022	/	Pass
					2	36.542	/	Pass
		5510	/	/	1	36.055	/	Pass
					2	36.964	/	Pass
		5550	/	/	1	36.076	/	Pass
					2	35.835	/	Pass
		5670	/	/	1	36.095	/	Pass
					2	35.566	/	Pass
		5755	/	/	1	36.055	/	Pass
					2	36.144	/	Pass
		5795	/	/	1	36.050	/	Pass
					2	36.129	/	Pass
802.11ac (VHT80)	MIMO	5210	/	/	1	75.341	/	Pass
					2	74.012	/	Pass
		5290	/	/	1	75.355	/	Pass
					2	74.434	/	Pass
		5530	/	/	1	75.759	/	Pass
					2	74.985	/	Pass
		5610	/	/	1	75.619	/	Pass
					2	73.755	/	Pass
		5775	/	/	1	75.606	/	Pass
					2	76.576	/	Pass
802.11ax (HEW20)	MIMO	5180	RU242	Left	1	19.017	/	Pass
					2	19.284	/	Pass
		5200	RU242	Left	1	19.021	/	Pass
					2	18.937	/	Pass

Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002

Page: 317 of 648

		5240	RU242	Left	1	19.021	/	Pass
					2	19.082	/	Pass
		5260	RU242	Left	1	19.036	/	Pass
					2	18.999	/	Pass
		5300	RU242	Left	1	18.996	/	Pass
					2	19.049	/	Pass
		5320	RU242	Left	1	19.025	/	Pass
					2	19.599	/	Pass
		5500	RU242	Left	1	18.984	/	Pass
					2	19.208	/	Pass
		5580	RU242	Left	1	19.102	/	Pass
					2	19.319	/	Pass
		5700	RU242	Left	1	19.058	/	Pass
					2	19.074	/	Pass
		5745	RU242	Left	1	19.051	/	Pass
					2	19.130	/	Pass
802.11ax (HEW40)	MIMO	5190	RU484	Left	1	37.817	/	Pass
					2	37.913	/	Pass
		5230	RU484	Left	1	37.774	/	Pass
					2	37.610	/	Pass
		5270	RU484	Left	1	37.845	/	Pass
					2	37.315	/	Pass
		5310	RU484	Left	1	37.829	/	Pass
					2	38.296	/	Pass
		5510	RU484	Left	1	37.897	/	Pass
					2	38.484	/	Pass
		5550	RU484	Left	1	37.872	/	Pass
					2	37.706	/	Pass
		5670	RU484	Left	1	37.886	/	Pass
					2	37.386	/	Pass
		5755	RU484	Left	1	37.916	/	Pass
					2	37.839	/	Pass
802.11ax (HEW80)	MIMO	5210	RU996	Left	1	77.371	/	Pass
					2	75.566	/	Pass
		5290	RU996	Left	1	77.143	/	Pass
					2	76.330	/	Pass
		5530	RU996	Left	1	156.889	/	Pass
					2	76.632	/	Pass

Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002

Page: 318 of 648

		5610	RU996	Left	1	77.230	/	Pass
					2	75.400	/	Pass
		5775	RU996	Left	1	77.214	/	Pass
					2	78.353	/	Pass

2.2 6dB BW

2.2.1 Test Result

Mode	TX Type	Frequency (MHz)	RU	RU Pos	ANT	6dB Bandwidth (MHz)		Verdict
						Result	Limit	
802.11a	SISO	5745	/	/	1	15.152	≥ 0.5	Pass
					2	15.162	≥ 0.5	Pass
		5785	/	/	1	15.135	≥ 0.5	Pass
					2	15.150	≥ 0.5	Pass
		5825	/	/	1	15.092	≥ 0.5	Pass
					2	15.150	≥ 0.5	Pass
802.11n (HT20)	MIMO	5745	/	/	1	12.645	≥ 0.5	Pass
					2	15.757	≥ 0.5	Pass
		5785	/	/	1	14.573	≥ 0.5	Pass
					2	15.464	≥ 0.5	Pass
		5825	/	/	1	14.967	≥ 0.5	Pass
					2	16.080	≥ 0.5	Pass
802.11n (HT40)	MIMO	5755	/	/	1	35.088	≥ 0.5	Pass
					2	31.732	≥ 0.5	Pass
		5795	/	/	1	35.146	≥ 0.5	Pass
					2	34.041	≥ 0.5	Pass
802.11ac (VHT80)	MIMO	5775	/	/	1	75.106	≥ 0.5	Pass
					2	75.495	≥ 0.5	Pass
802.11ax (HEW20)	MIMO	5745	RU242	Left	1	18.113	≥ 0.5	Pass
					2	16.621	≥ 0.5	Pass
		5785	RU242	Left	1	16.208	≥ 0.5	Pass
					2	18.567	≥ 0.5	Pass
		5825	RU242	Left	1	18.711	≥ 0.5	Pass
					2	16.908	≥ 0.5	Pass
802.11ax (HEW40)	MIMO	5755	RU484	Left	1	36.405	≥ 0.5	Pass
					2	35.226	≥ 0.5	Pass
		5795	RU484	Left	1	37.330	≥ 0.5	Pass
					2	27.148	≥ 0.5	Pass
802.11ax (HEW80)	MIMO	5775	RU996	Left	1	72.595	≥ 0.5	Pass
					2	77.706	≥ 0.5	Pass

2.3 26dB BW

2.3.1 Test Result

Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002

Page: 319 of 648

Mode	TX Type	Frequency (MHz)	RU	RU Pos	ANT	26dB Bandwidth (MHz)		Verdict
						Result	Limit	
802.11a	SISO	5180	/	/	1	18.573	/	Pass
					2	18.833	/	Pass
		5200	/	/	1	18.658	/	Pass
					2	18.634	/	Pass
		5240	/	/	1	18.863	/	Pass
					2	18.792	/	Pass
		5260	/	/	1	18.765	/	Pass
					2	18.615	/	Pass
		5300	/	/	1	18.670	/	Pass
					2	18.768	/	Pass
		5320	/	/	1	18.673	/	Pass
					2	18.745	/	Pass
		5500	/	/	1	18.709	/	Pass
					2	18.692	/	Pass
		5580	/	/	1	18.813	/	Pass
					2	18.751	/	Pass
		5700	/	/	1	18.718	/	Pass
					2	18.867	/	Pass
802.11n (HT20)	MIMO	5180	/	/	1	19.825	/	Pass
					2	22.164	/	Pass
		5200	/	/	1	19.782	/	Pass
					2	19.392	/	Pass
		5240	/	/	1	19.779	/	Pass
					2	20.285	/	Pass
		5260	/	/	1	19.815	/	Pass
					2	20.019	/	Pass
		5300	/	/	1	19.805	/	Pass
					2	19.838	/	Pass
		5320	/	/	1	19.778	/	Pass
					2	33.568	/	Pass
		5500	/	/	1	19.693	/	Pass
					2	20.544	/	Pass
		5580	/	/	1	19.769	/	Pass
					2	22.413	/	Pass
		5700	/	/	1	19.840	/	Pass
					2	19.817	/	Pass
802.11n (HT40)	MIMO	5190	/	/	1	39.311	/	Pass
					2	39.359	/	Pass
		5230	/	/	1	39.488	/	Pass
					2	38.994	/	Pass
		5270	/	/	1	39.335	/	Pass
					2	38.381	/	Pass

Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002

Page: 320 of 648

		5310	/	/	1	39.317	/	Pass
					2	39.972	/	Pass
		5510	/	/	1	39.226	/	Pass
					2	43.552	/	Pass
		5550	/	/	1	39.563	/	Pass
					2	39.103	/	Pass
		5670	/	/	1	39.050	/	Pass
					2	38.568	/	Pass
802.11ac (VHT80)	MIMO	5210	/	/	1	80.790	/	Pass
					2	79.464	/	Pass
		5290	/	/	1	80.662	/	Pass
					2	79.528	/	Pass
		5530	/	/	1	80.883	/	Pass
					2	79.550	/	Pass
		5610	/	/	1	81.309	/	Pass
					2	78.948	/	Pass
802.11ax (HEW20)	MIMO	5180	RU242	Left	1	20.971	/	Pass
					2	22.915	/	Pass
		5200	RU242	Left	1	20.917	/	Pass
					2	20.405	/	Pass
		5240	RU242	Left	1	20.595	/	Pass
					2	22.178	/	Pass
		5260	RU242	Left	1	20.776	/	Pass
					2	20.649	/	Pass
		5300	RU242	Left	1	20.767	/	Pass
					2	20.702	/	Pass
		5320	RU242	Left	1	20.699	/	Pass
					2	32.012	/	Pass
		5500	RU242	Left	1	20.906	/	Pass
					2	23.270	/	Pass
		5580	RU242	Left	1	20.730	/	Pass
					2	24.534	/	Pass
		5700	RU242	Left	1	20.692	/	Pass
					2	20.312	/	Pass
802.11ax (HEW40)	MIMO	5190	RU484	Left	1	40.317	/	Pass
					2	40.127	/	Pass
		5230	RU484	Left	1	40.495	/	Pass
					2	39.874	/	Pass
		5270	RU484	Left	1	40.173	/	Pass
					2	39.621	/	Pass
		5310	RU484	Left	1	39.884	/	Pass
					2	40.767	/	Pass
5510	RU484	Left	1	40.268	/	Pass		
			2	41.465	/	Pass		



Compliance Certification Services (Kunshan) Inc.


CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002


Page: 321 of 648

		5550	RU484	Left	1	40.235	/	Pass
					2	40.347	/	Pass
		5670	RU484	Left	1	40.771	/	Pass
					2	39.647	/	Pass
802.11ax (HEW80)	MIMO	5210	RU996	Left	1	81.617	/	Pass
					2	80.359	/	Pass
		5290	RU996	Left	1	81.320	/	Pass
					2	80.633	/	Pass
		5530	RU996	Left	1	81.583	/	Pass
					2	80.493	/	Pass
		5610	RU996	Left	1	81.437	/	Pass
					2	80.523	/	Pass


2.1.2 Test Graph

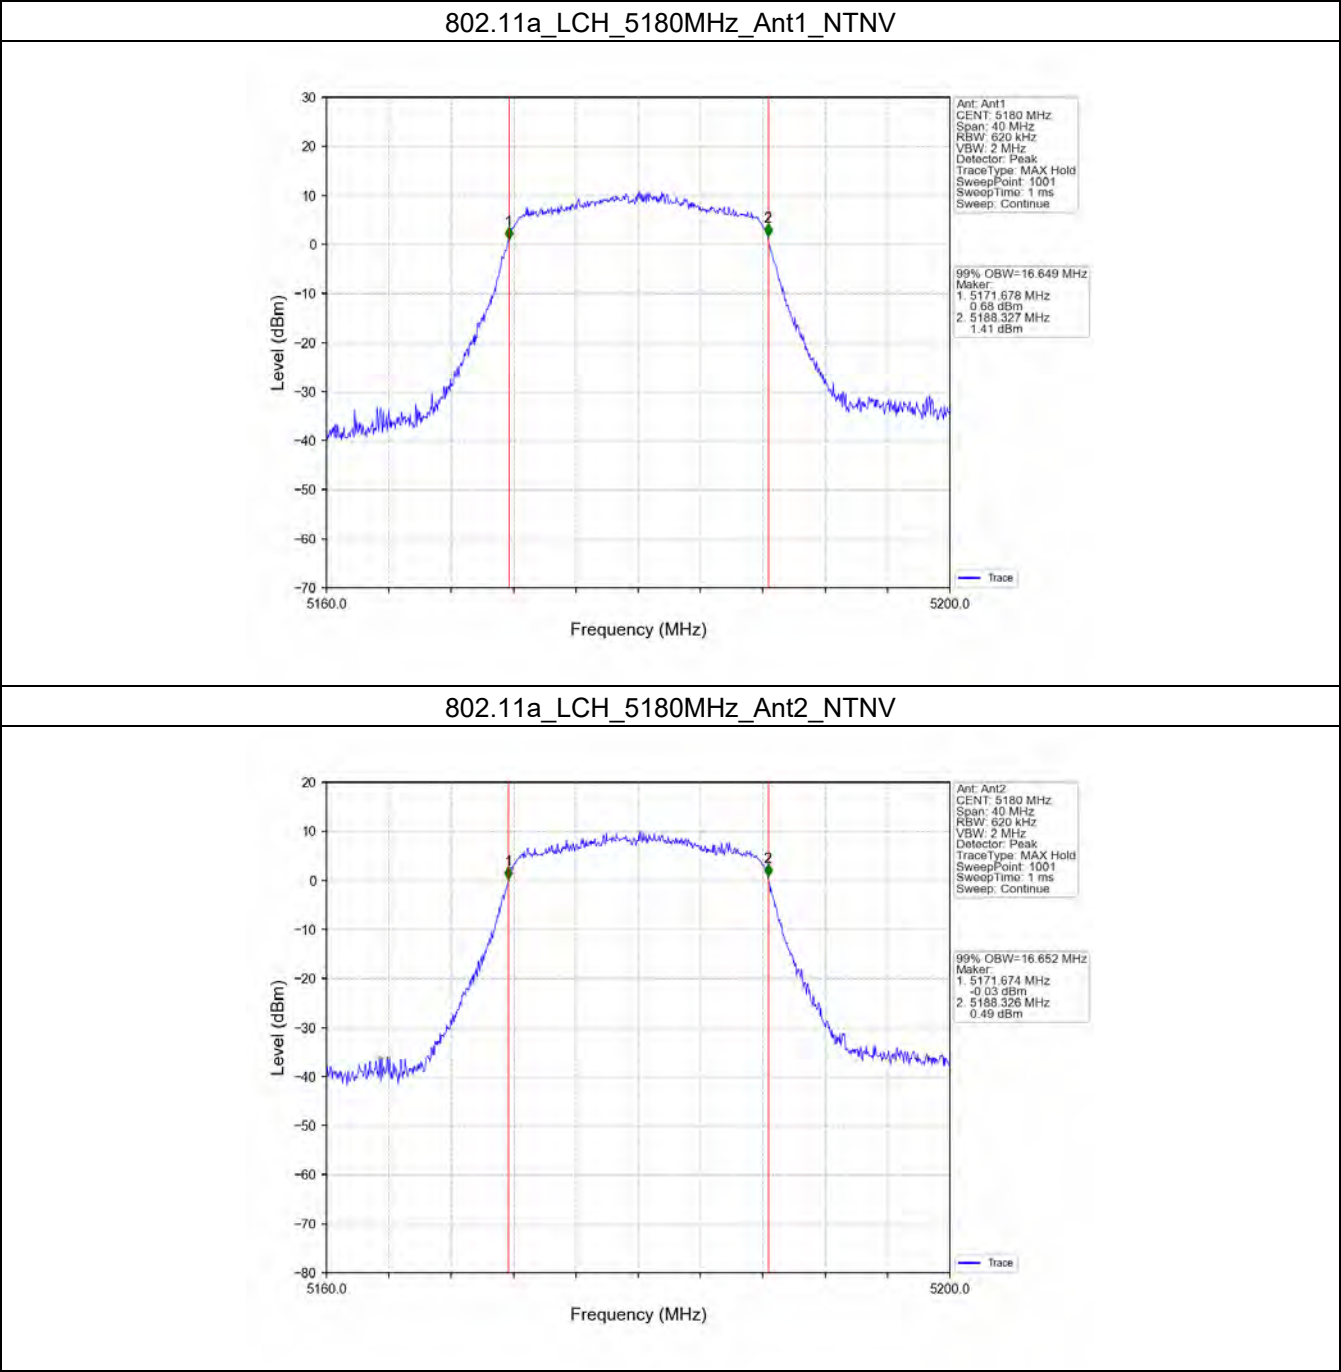


802.11a_MCH_5200MHz_Ant1_NTNV

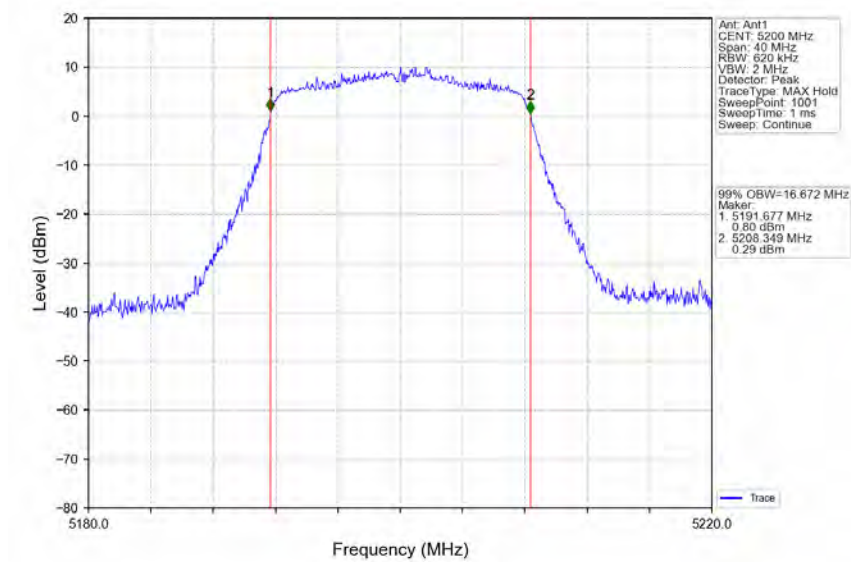


802.11a_MCH_5200MHz_Ant2_NTNV

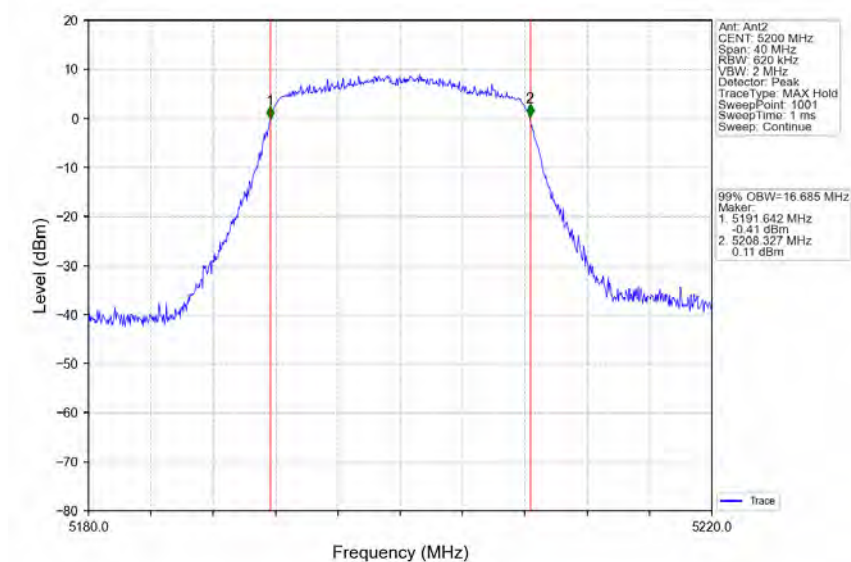

802.11a_HCH_5240MHz_Ant1_NTNV

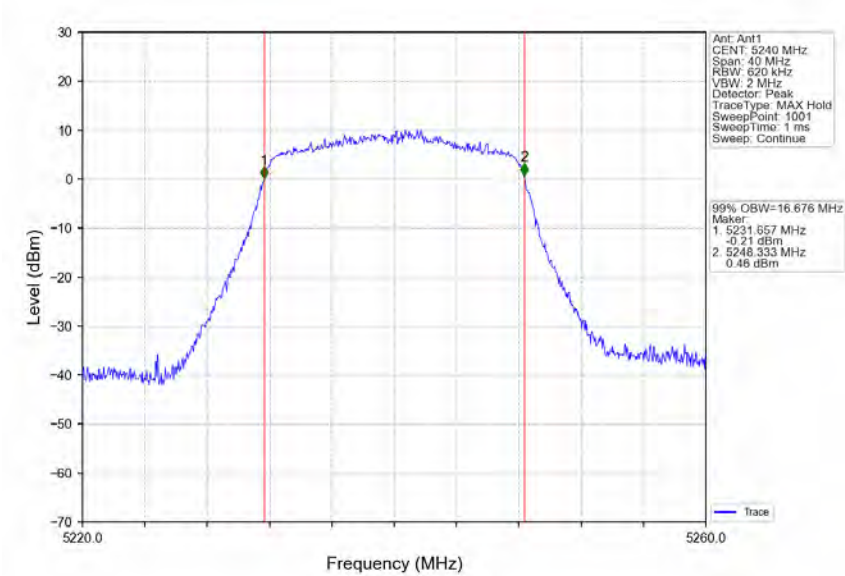

802.11a_HCH_5240MHz_Ant2_NTNV

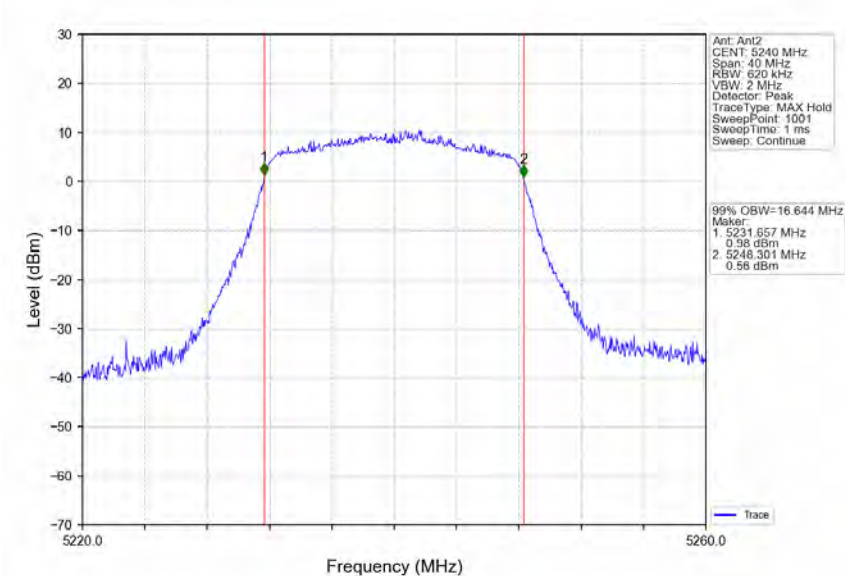


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 325 of 648


802.11a_LCH_5260MHz_Ant1_NTNV

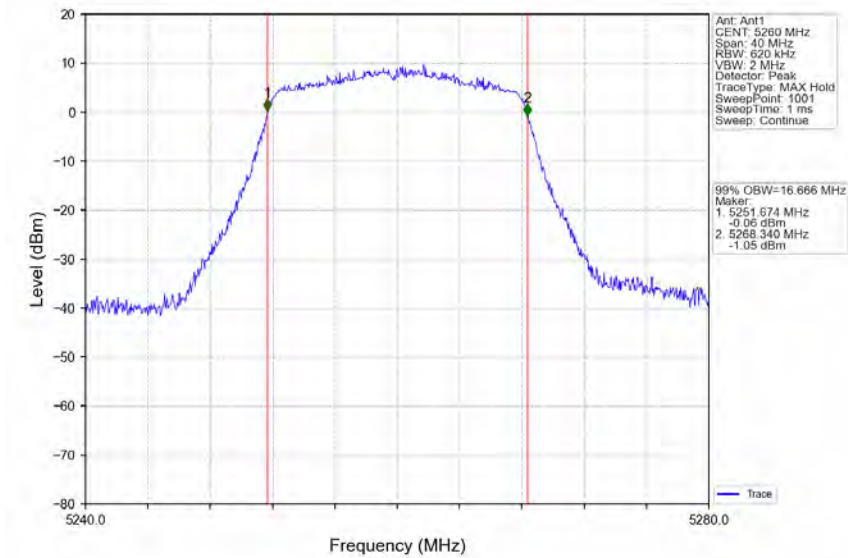


802.11a_LCH_5260MHz_Ant2_NTNV

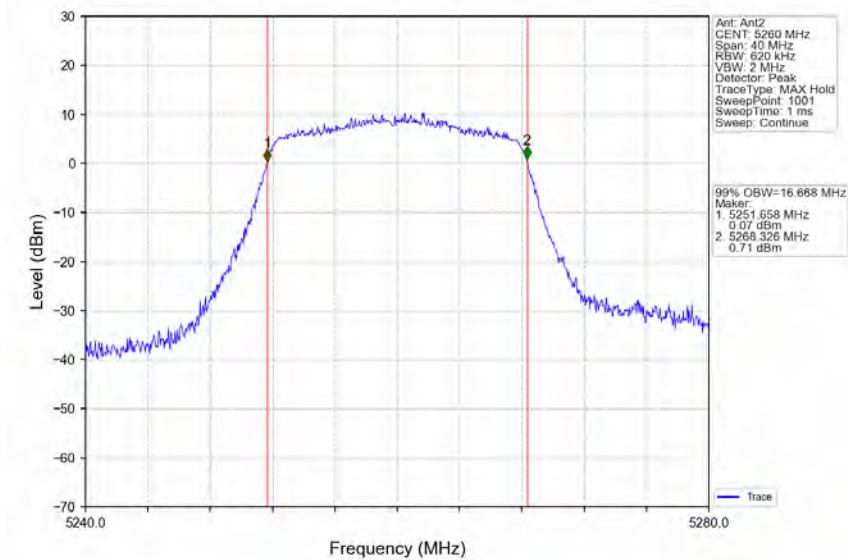

802.11a_MCH_5300MHz_Ant1_NTNV

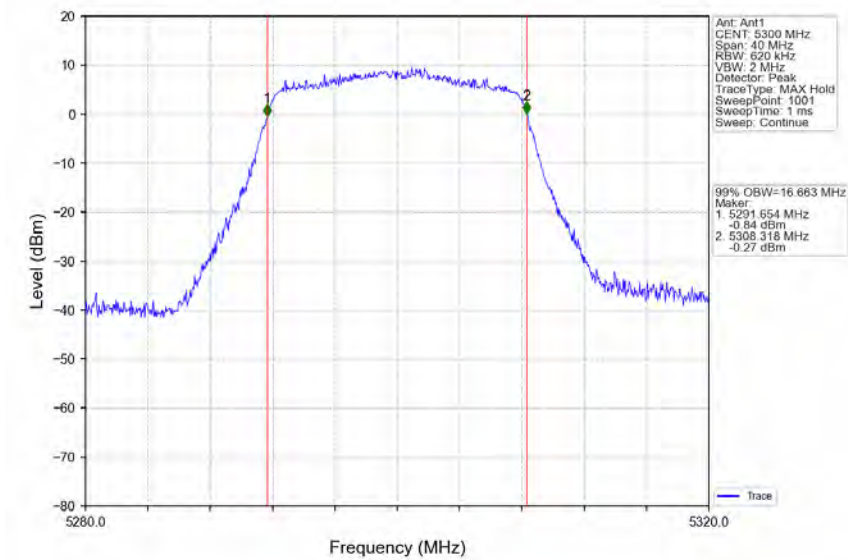

802.11a_MCH_5300MHz_Ant2_NTNV

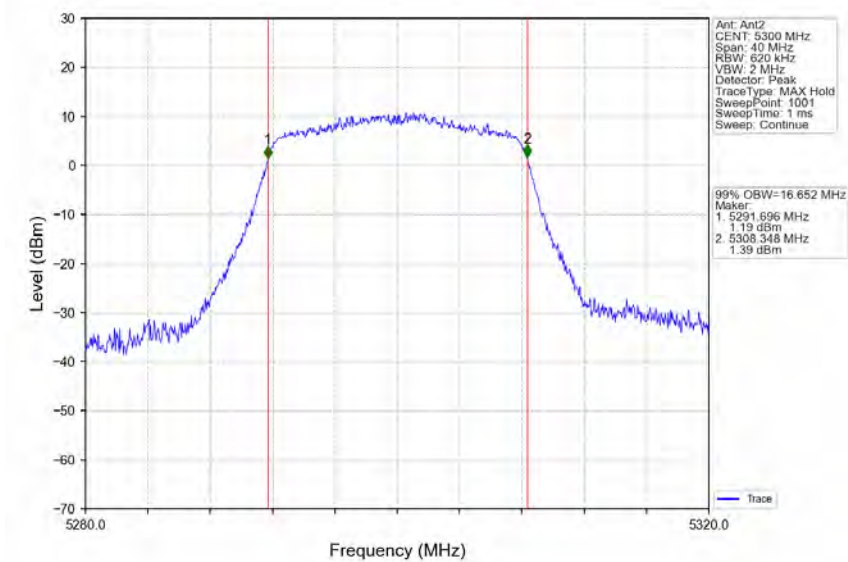


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 327 of 648

802.11a_HCH_5320MHz_Ant1_NTNV

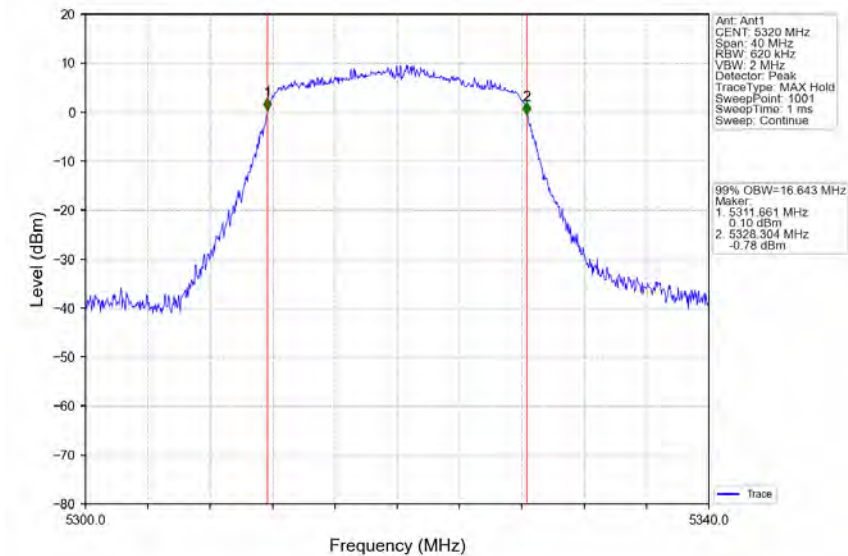

802.11a_HCH_5320MHz_Ant2_NTNV

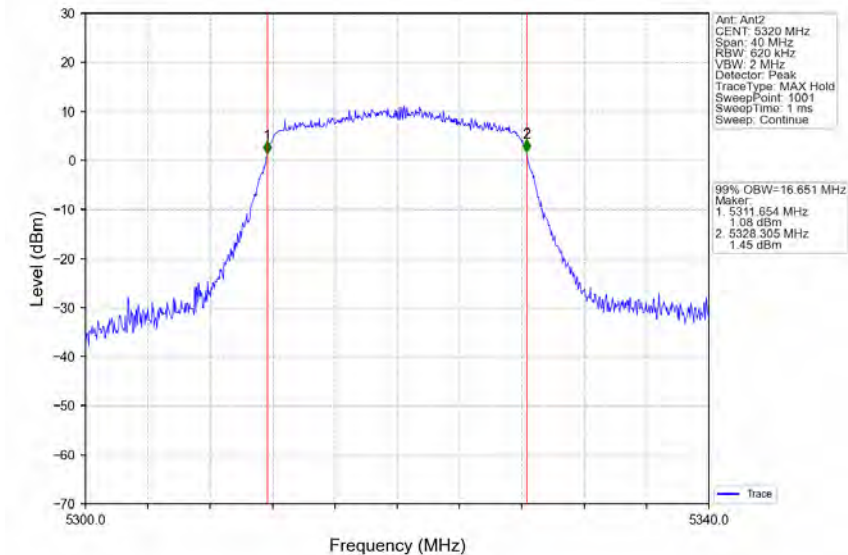


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 328 of 648

802.11a_LCH_5500MHz_Ant1_NTNV

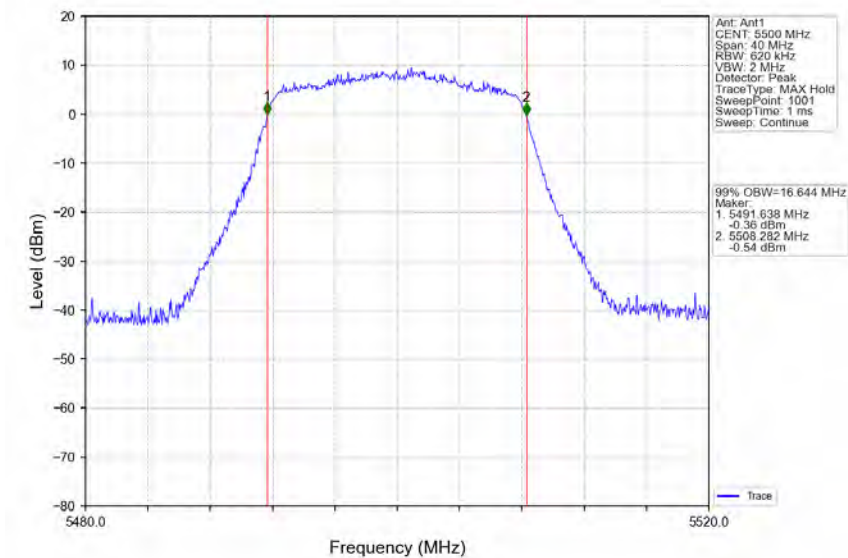

802.11a_LCH_5500MHz_Ant2_NTNV

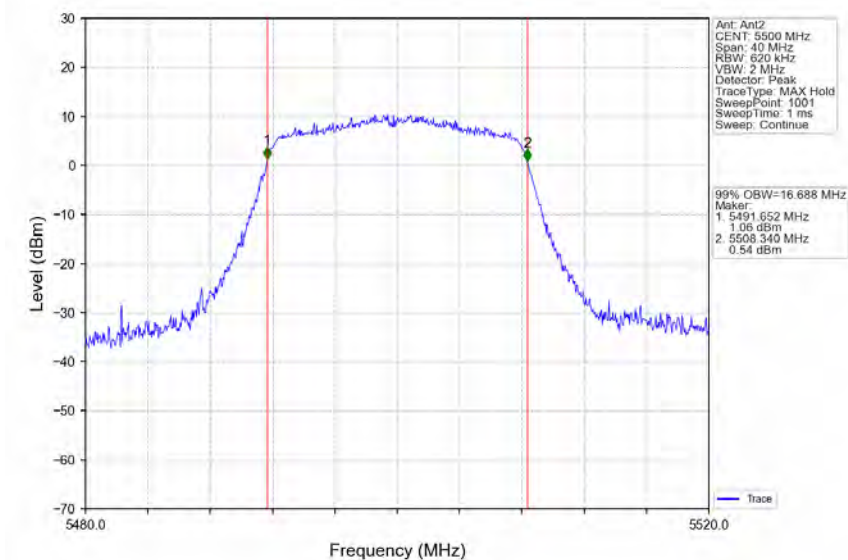


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 329 of 648

802.11a_MCH_5580MHz_Ant1_NTNV

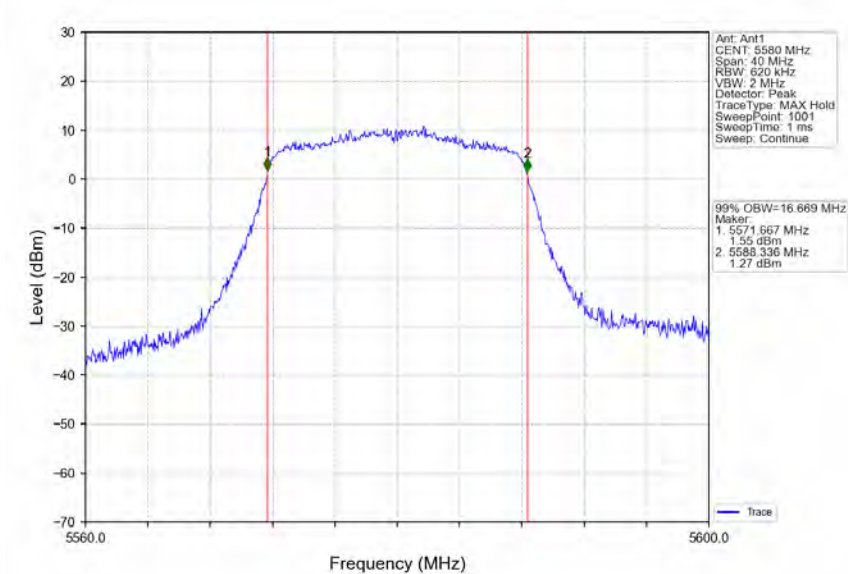

802.11a_MCH_5580MHz_Ant2_NTNV

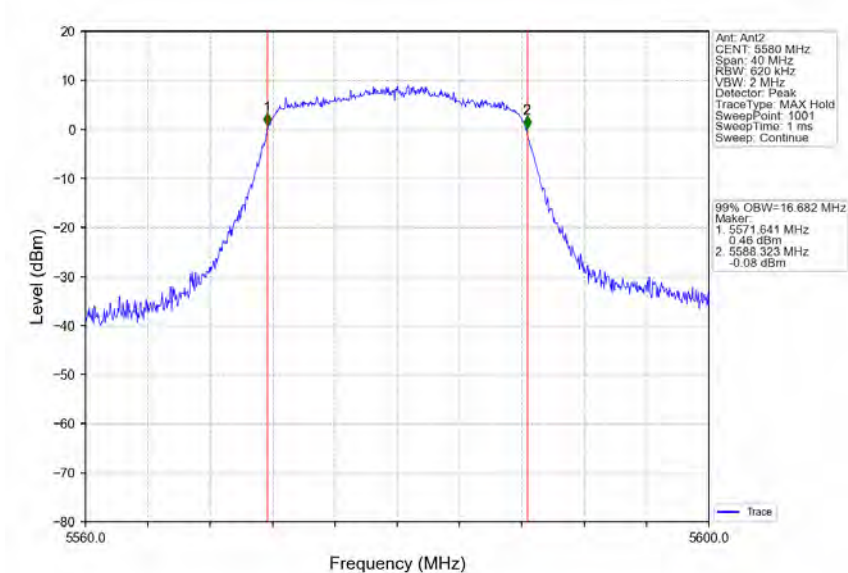


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 330 of 648


802.11a_HCH_5700MHz_Ant1_NTNV

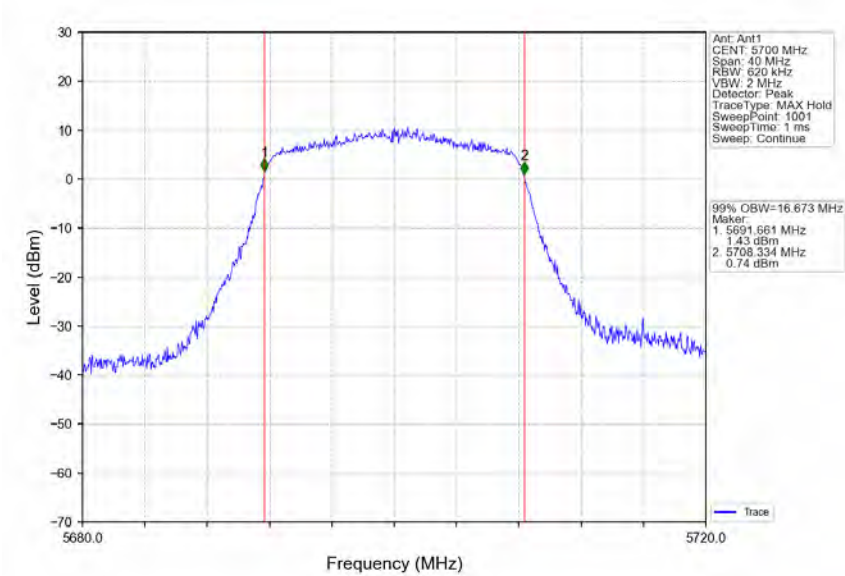


802.11a_HCH_5700MHz_Ant2_NTNV

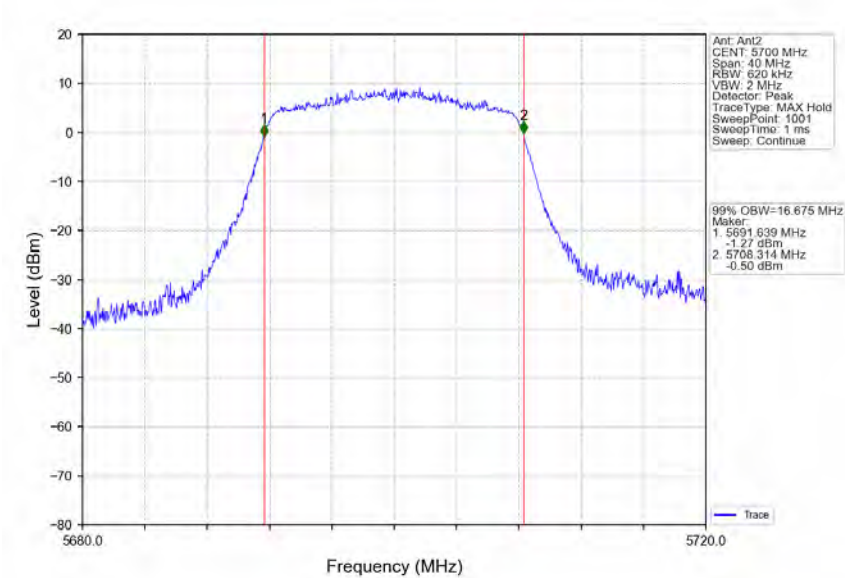


802.11a_LCH_5745MHz_Ant1_NTNV

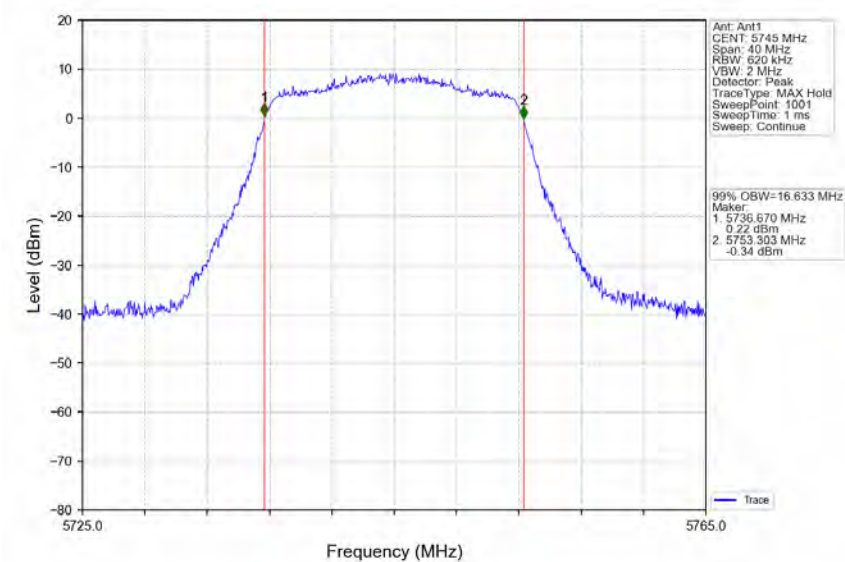


802.11a_LCH_5745MHz_Ant2_NTNV

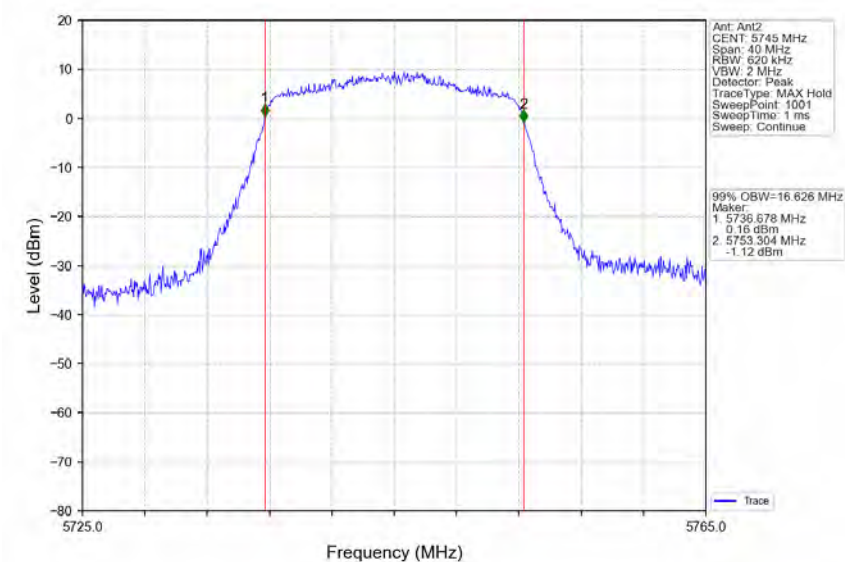

802.11a_MCH_5785MHz_Ant1_NTNV

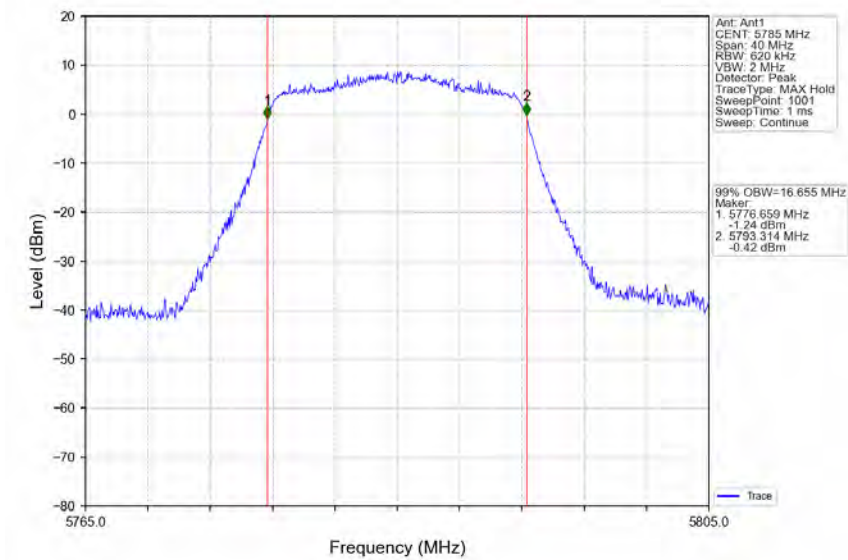

802.11a_MCH_5785MHz_Ant2_NTNV

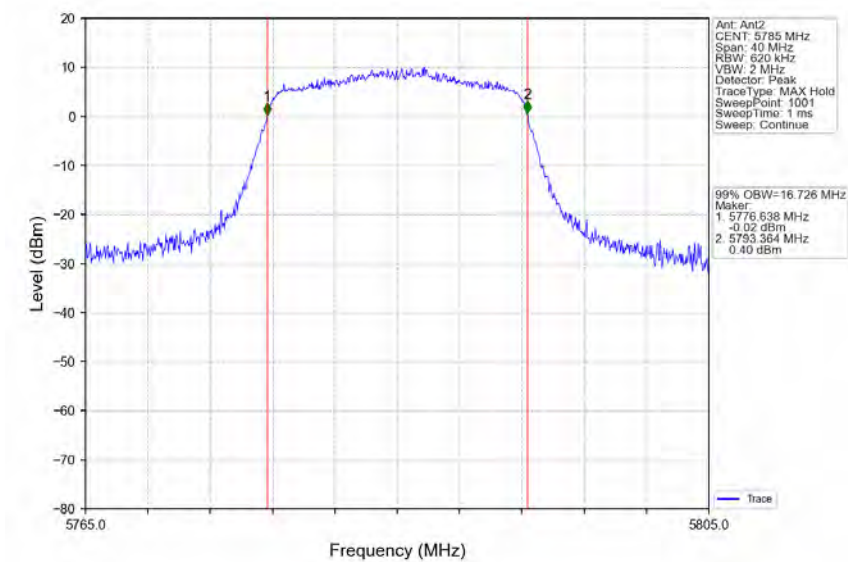


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 333 of 648


802.11a_HCH_5825MHz_Ant1_NTNV

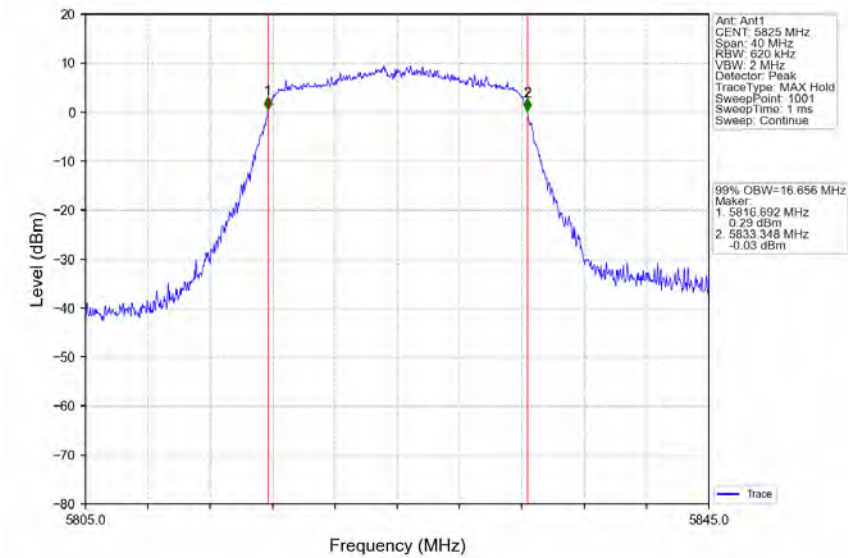


802.11a_HCH_5825MHz_Ant2_NTNV

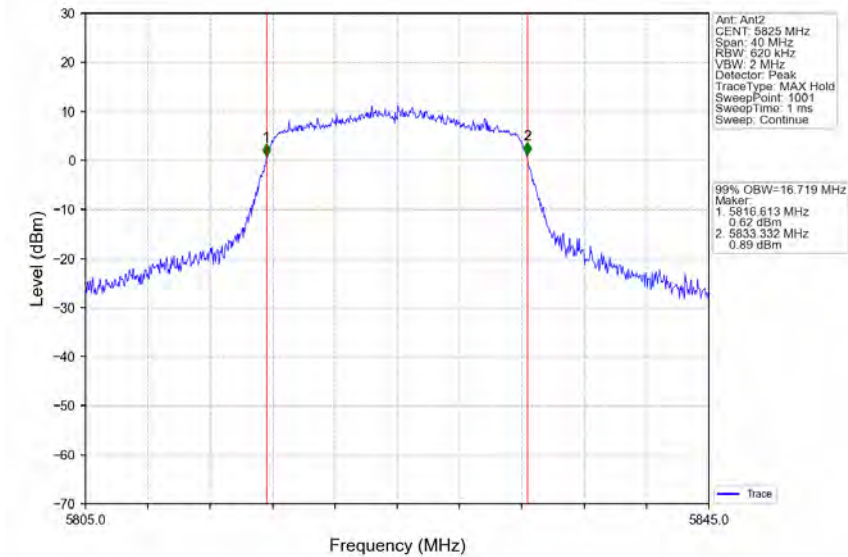


802.11n(HT20)_LCH_5180MHz_Ant1_NTNV

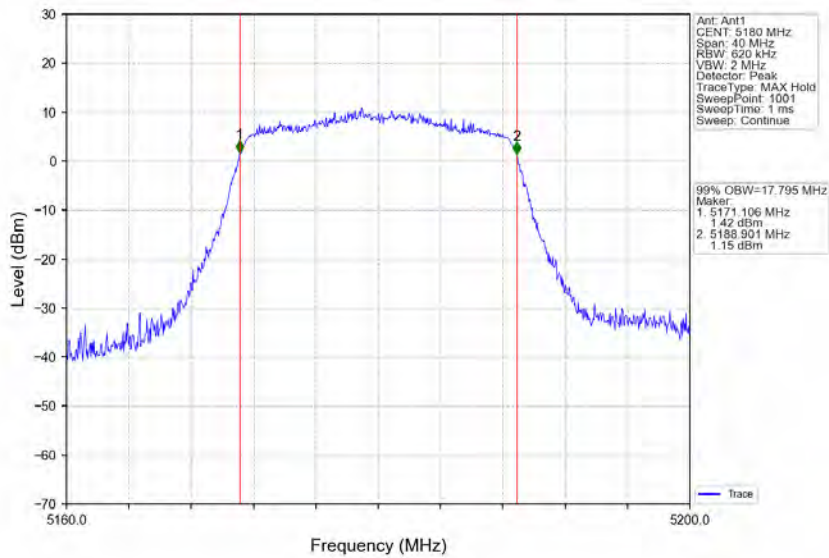


802.11n(HT20)_LCH_5180MHz_Ant2_NTNV

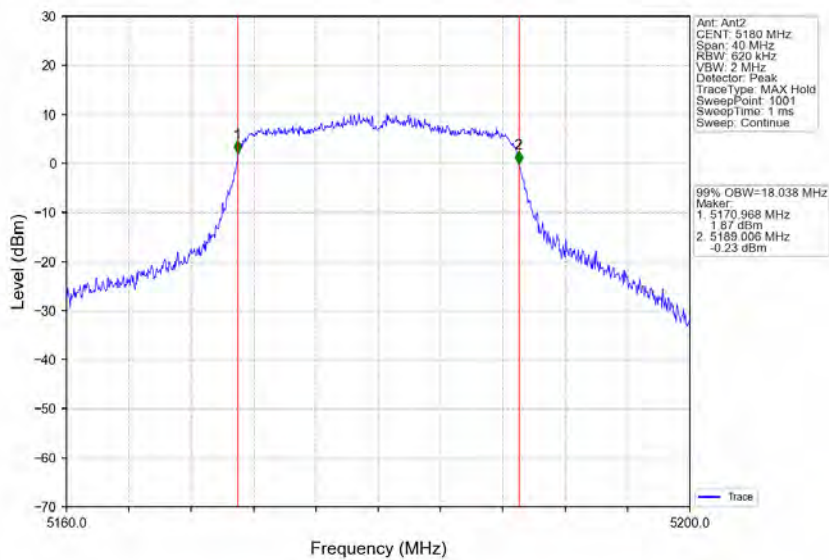


802.11n(HT20)_MCH_5200MHz_Ant1_NTNV

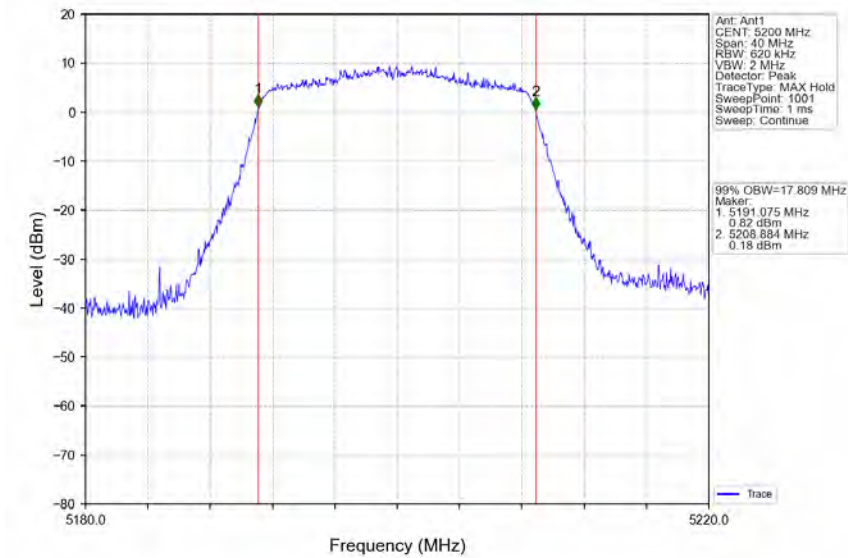


802.11n(HT20)_MCH_5200MHz_Ant2_NTNV

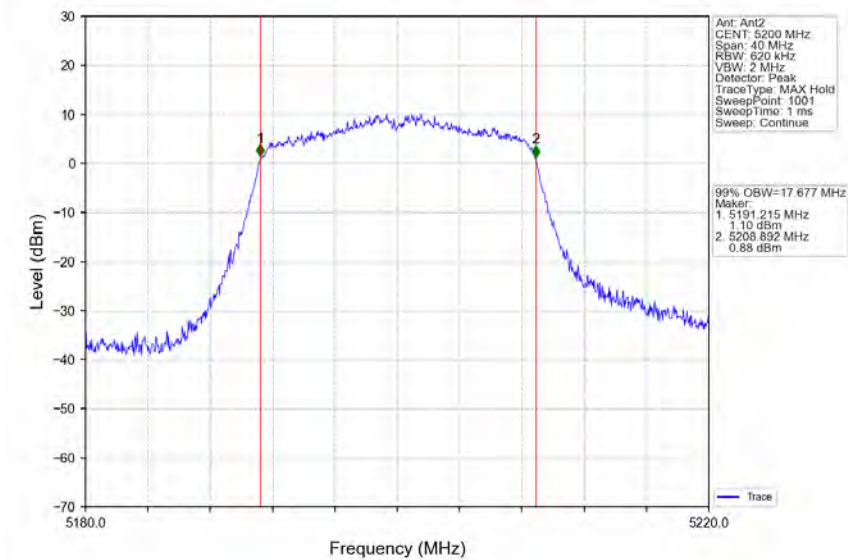


802.11n(HT20)_HCH_5240MHz_Ant1_NTNV

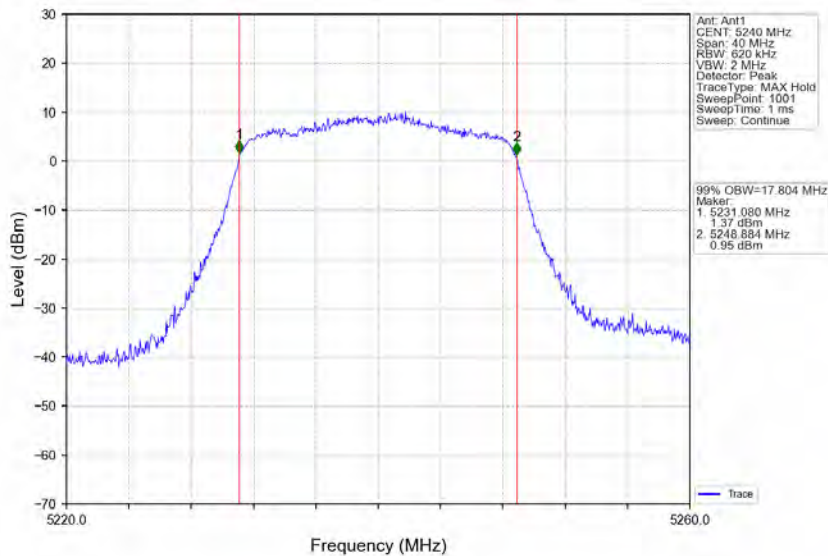


802.11n(HT20)_HCH_5240MHz_Ant2_NTNV

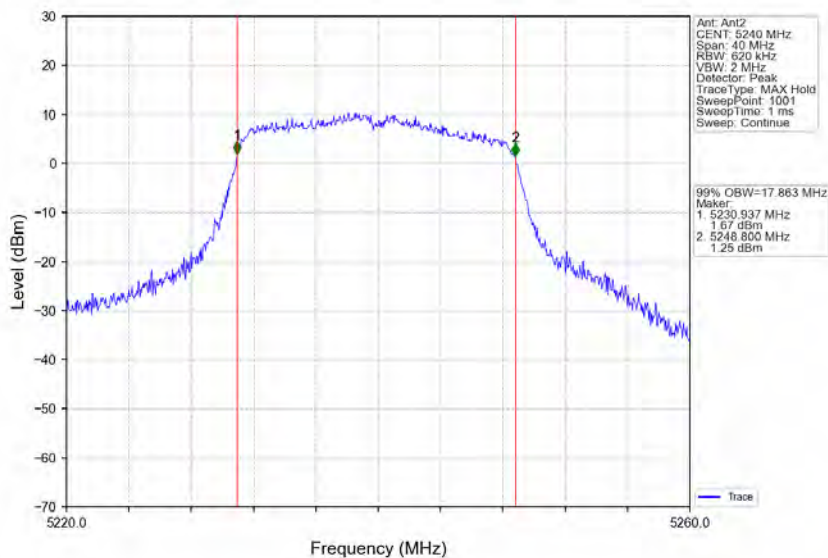


802.11n(HT20)_LCH_5260MHz_Ant1_NTNV

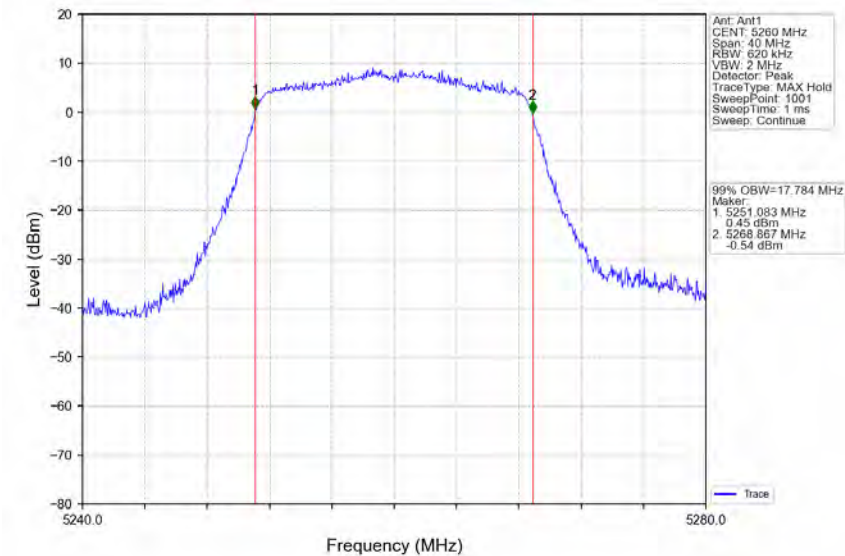


802.11n(HT20)_LCH_5260MHz_Ant2_NTNV

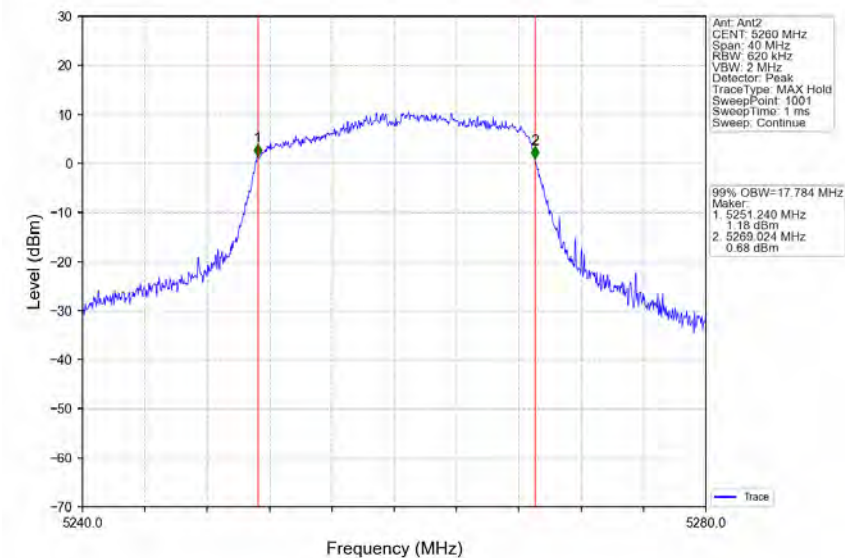


802.11n(HT20)_MCH_5300MHz_Ant1_NTNV

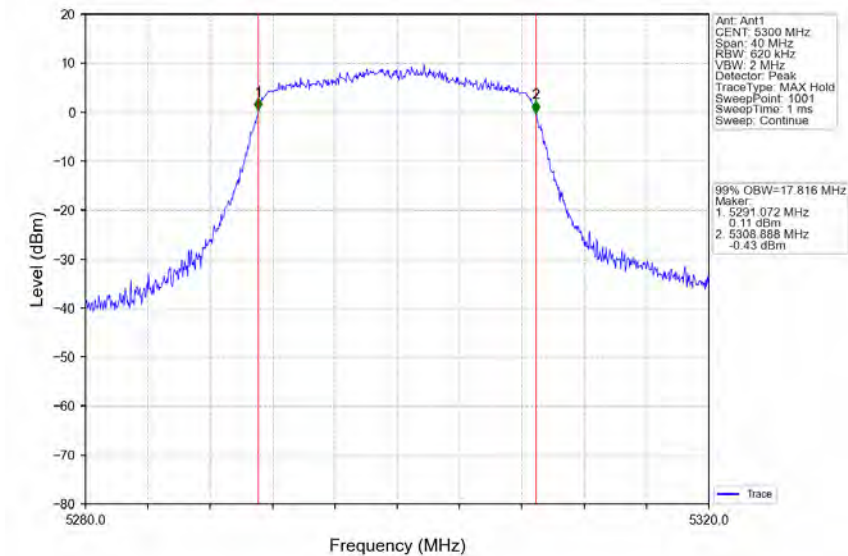


802.11n(HT20)_MCH_5300MHz_Ant2_NTNV

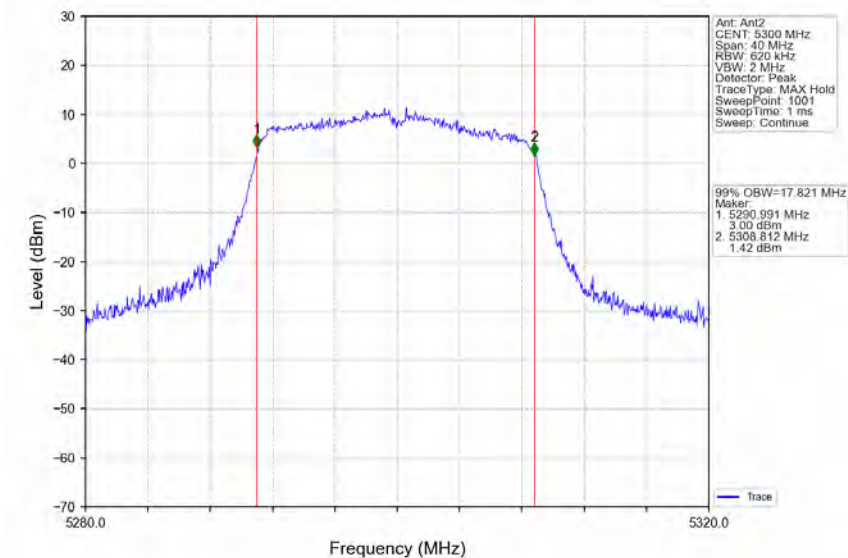


802.11n(HT20)_HCH_5320MHz_Ant1_NTNV

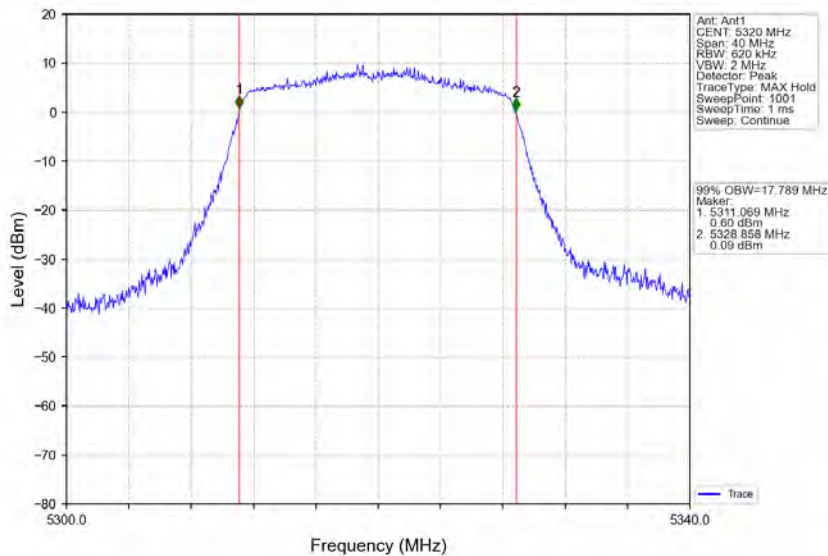


802.11n(HT20)_HCH_5320MHz_Ant2_NTNV

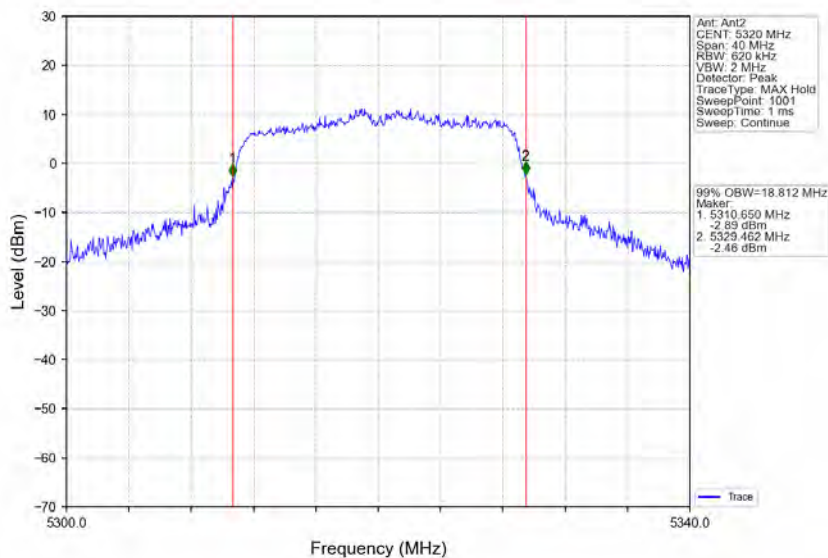

802.11n(HT20)_LCH_5500MHz_Ant1_NTNV

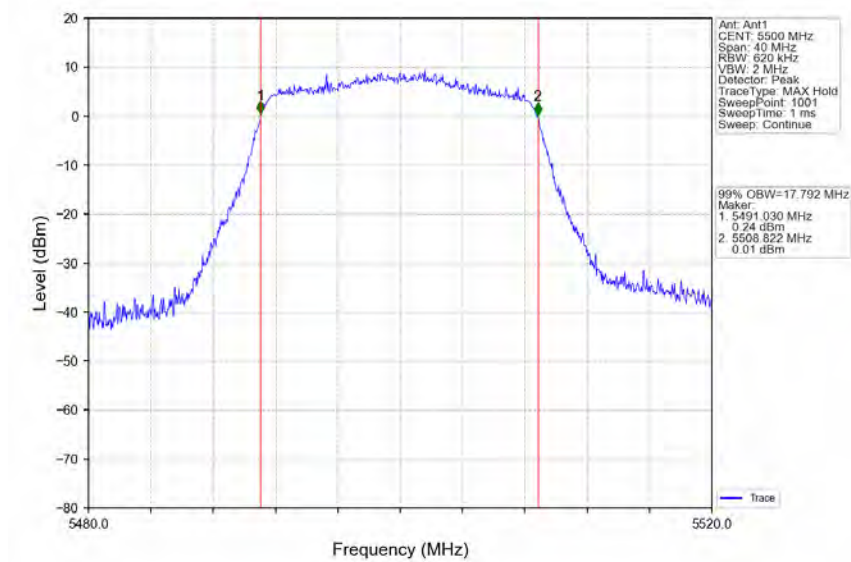

802.11n(HT20)_LCH_5500MHz_Ant2_NTNV

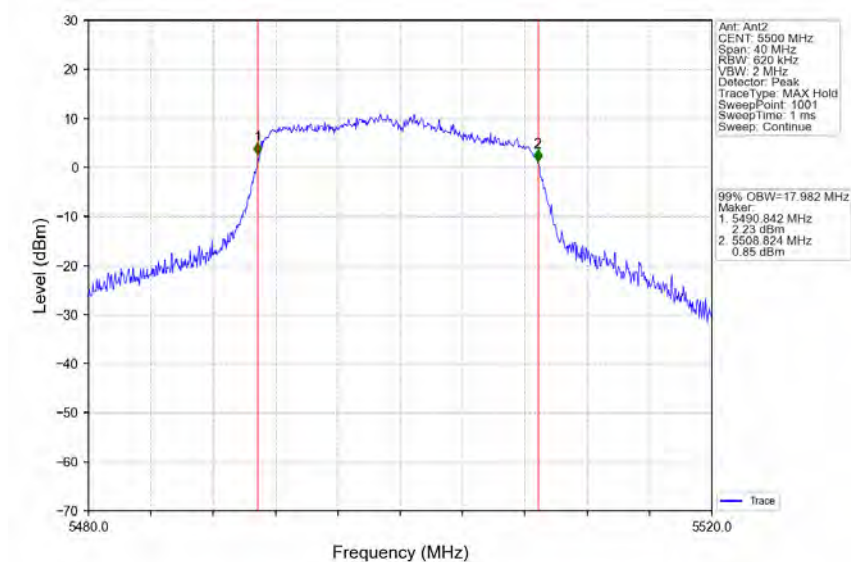


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 341 of 648


802.11n(HT20)_MCH_5580MHz_Ant1_NTNV

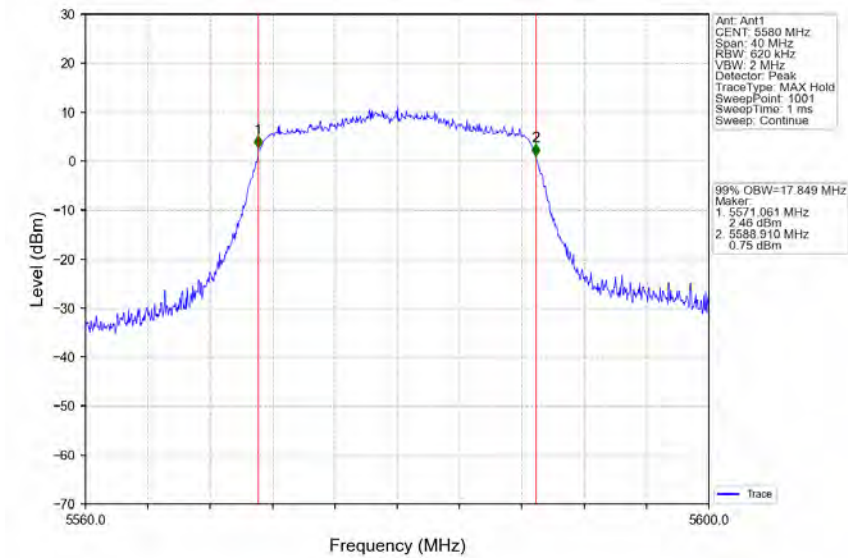


802.11n(HT20)_MCH_5580MHz_Ant2_NTNV

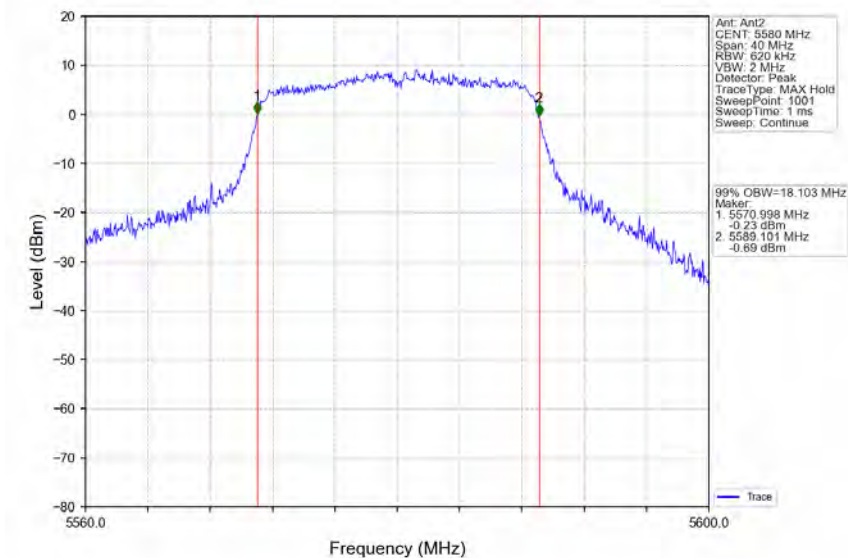


802.11n(HT20)_HCH_5700MHz_Ant1_NTNV

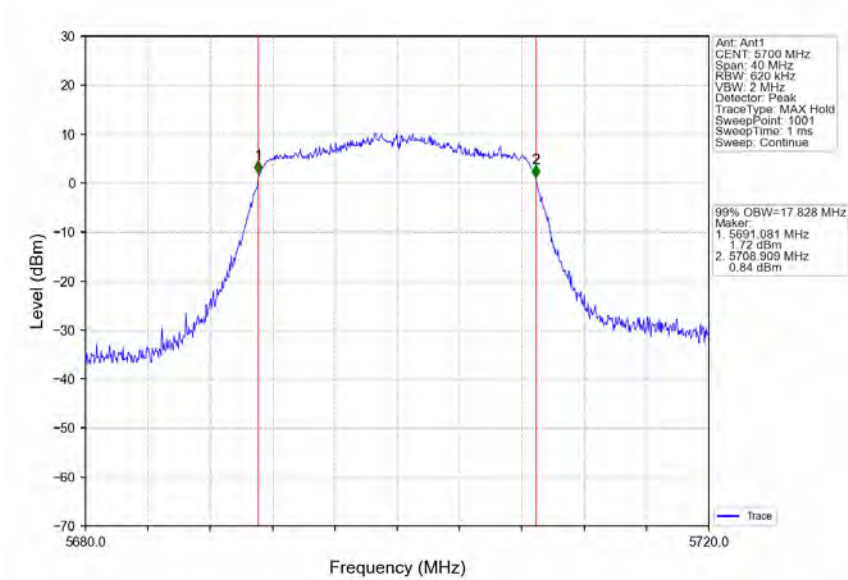


802.11n(HT20)_HCH_5700MHz_Ant2_NTNV

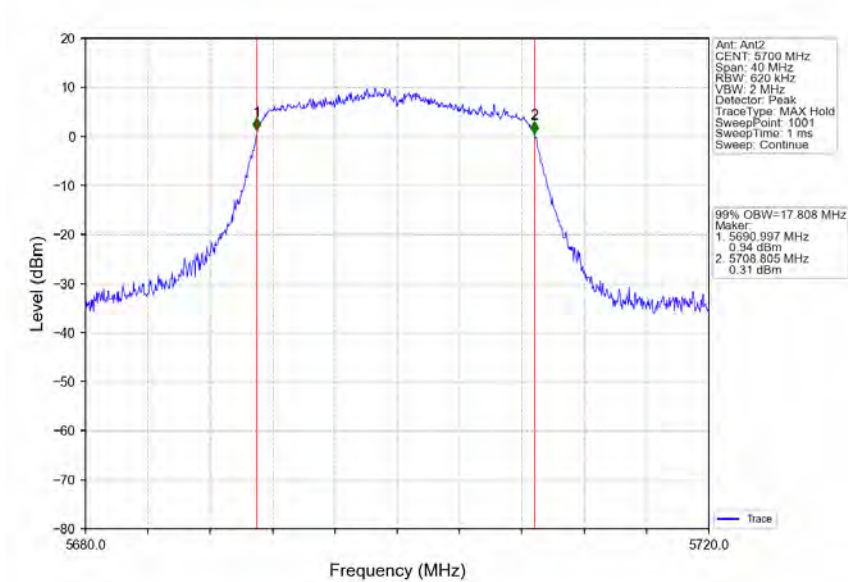

802.11n(HT20)_LCH_5745MHz_Ant1_NTNV

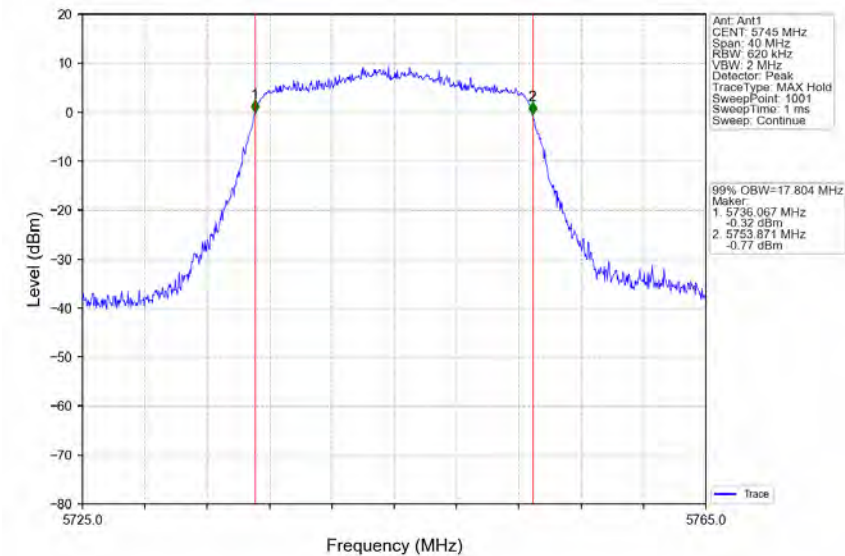

802.11n(HT20)_LCH_5745MHz_Ant2_NTNV

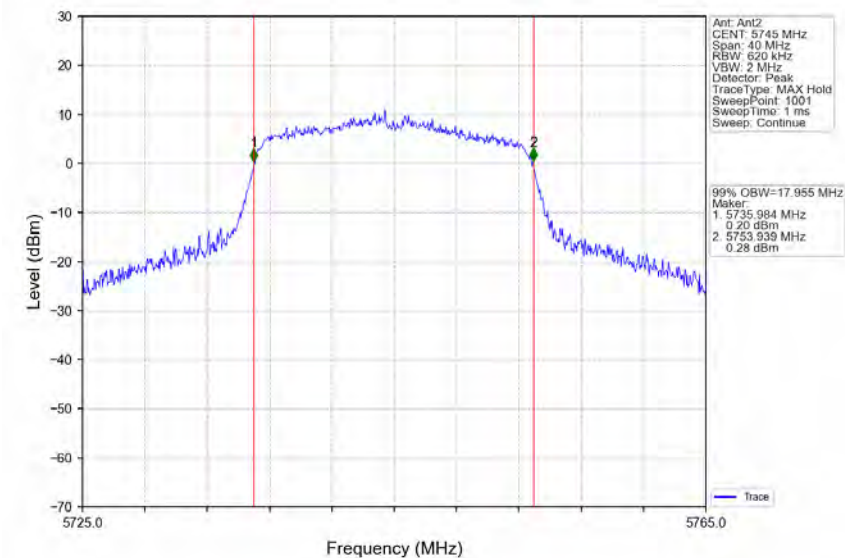


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 344 of 648

802.11n(HT20)_MCH_5785MHz_Ant1_NTNV

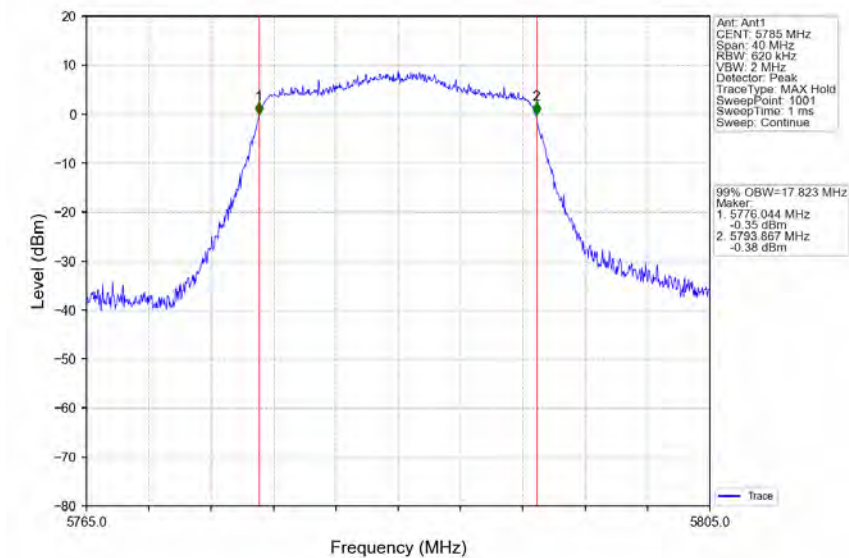

802.11n(HT20)_MCH_5785MHz_Ant2_NTNV

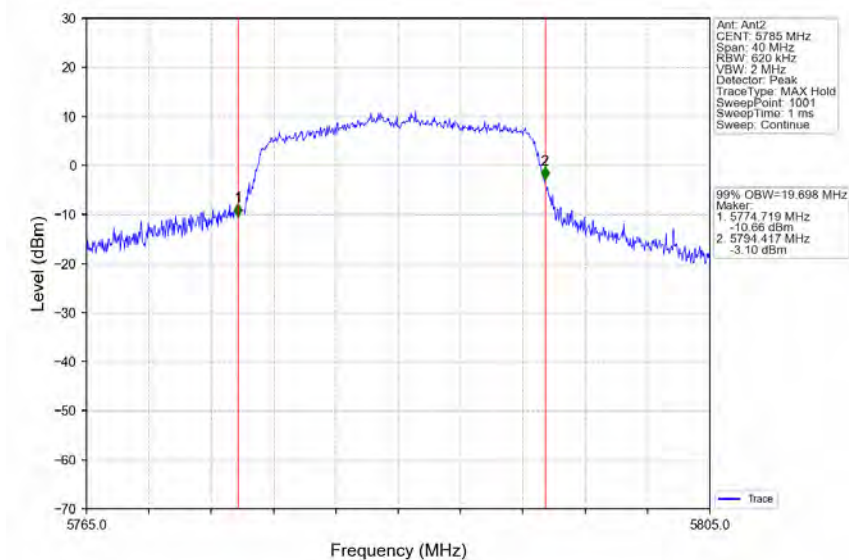


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 345 of 648

802.11n(HT20)_HCH_5825MHz_Ant1_NTNV

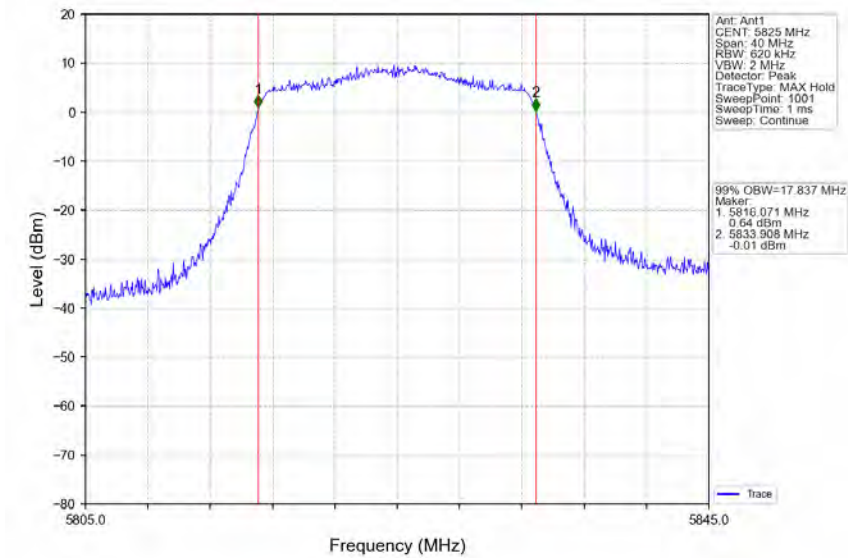

802.11n(HT20)_HCH_5825MHz_Ant2_NTNV

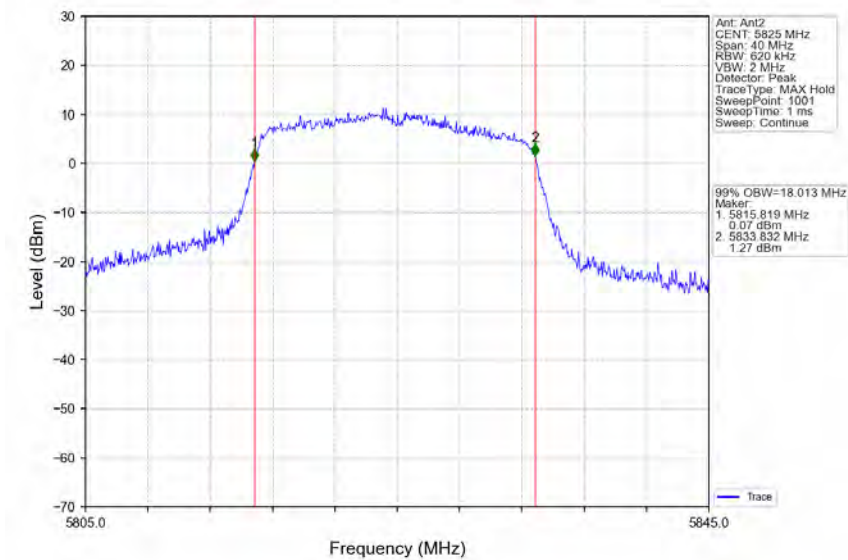


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 346 of 648


802.11n(HT40)_LCH_5190MHz_Ant1_NTNV

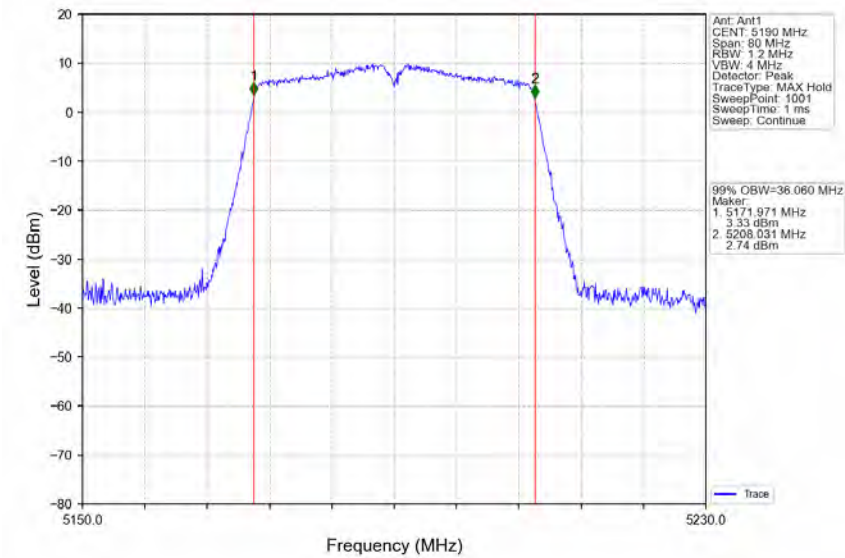


802.11n(HT40)_LCH_5190MHz_Ant2_NTNV

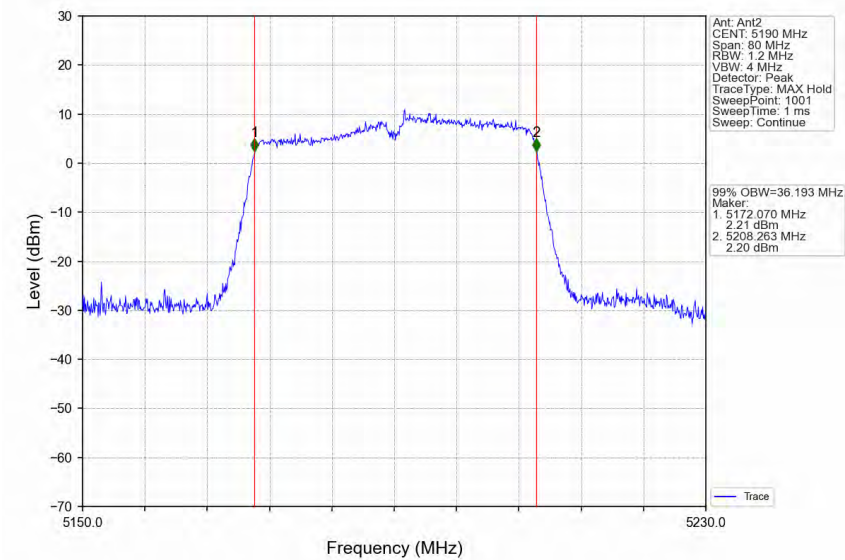

802.11n(HT40)_HCH_5230MHz_Ant1_NTNV

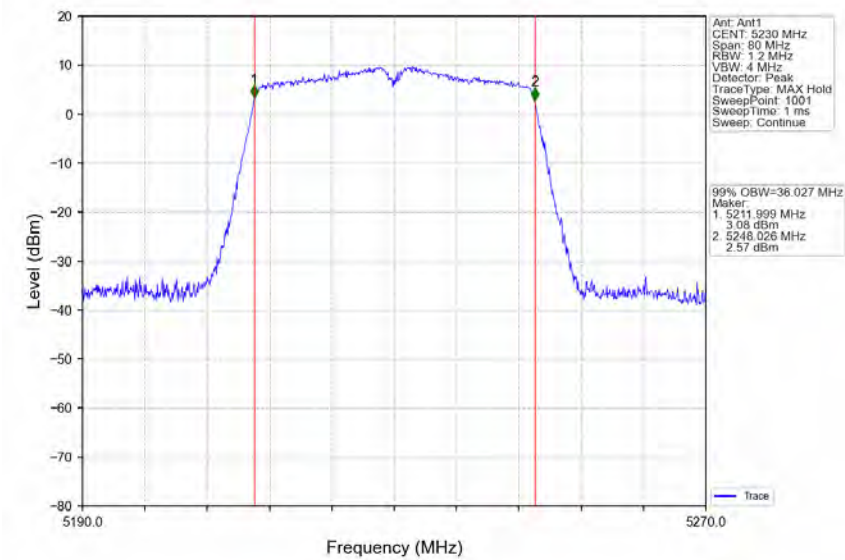

802.11n(HT40)_HCH_5230MHz_Ant2_NTNV

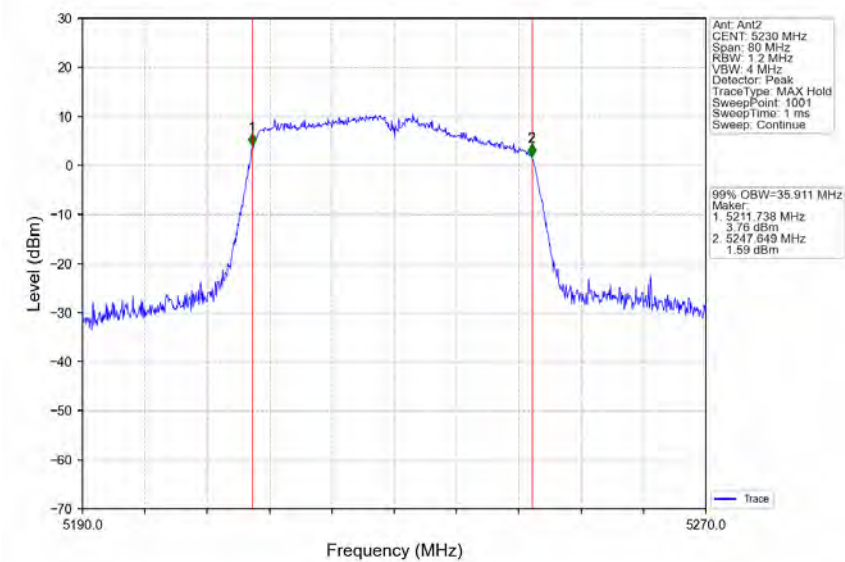


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 348 of 648


802.11n(HT40)_LCH_5270MHz_Ant1_NTNV

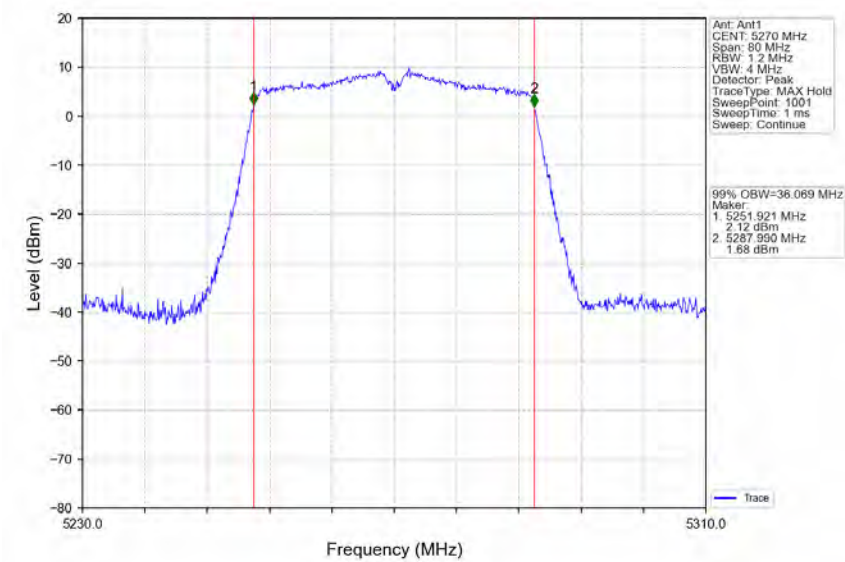


802.11n(HT40)_LCH_5270MHz_Ant2_NTNV

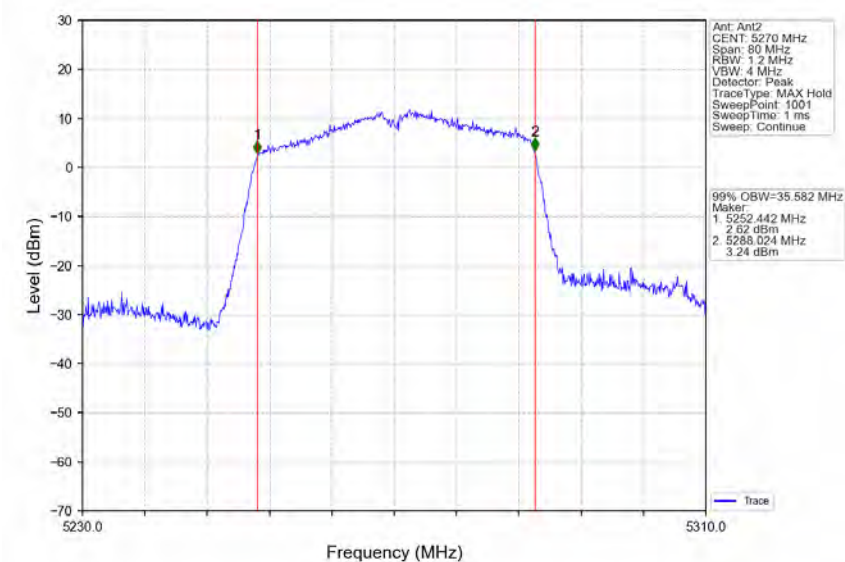


802.11n(HT40)_HCH_5310MHz_Ant1_NTNV

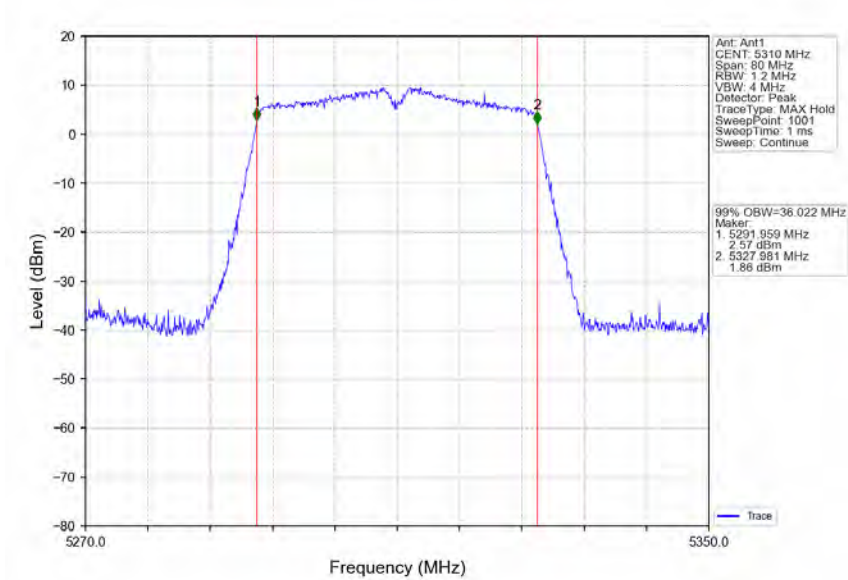


802.11n(HT40)_HCH_5310MHz_Ant2_NTNV

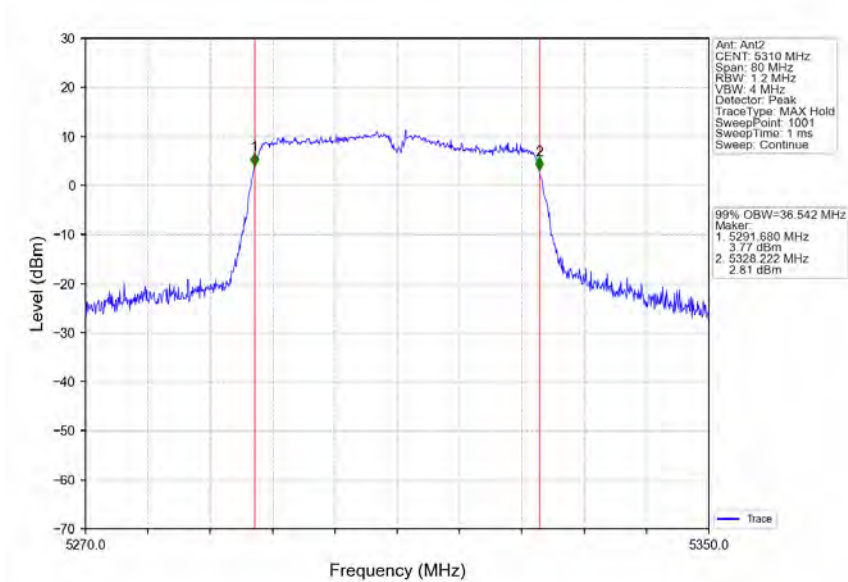


802.11n(HT40)_LCH_5510MHz_Ant1_NTNV

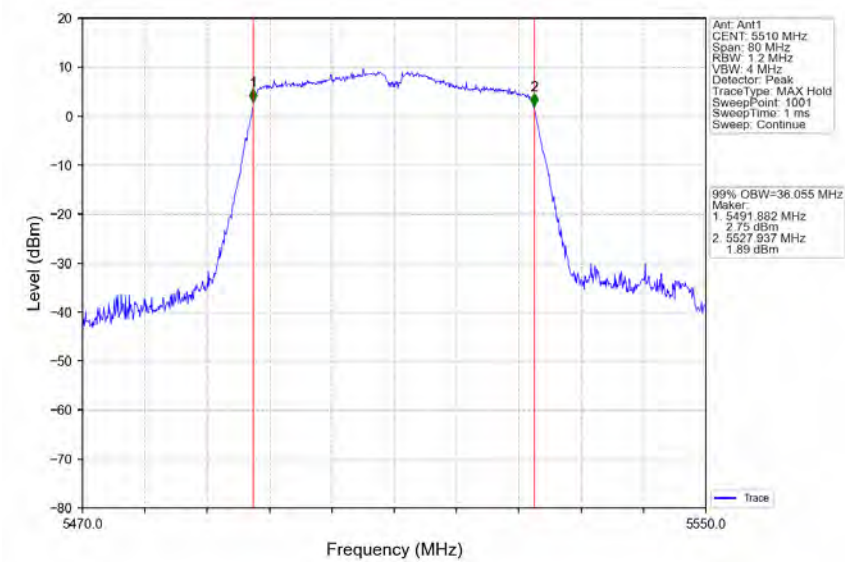


802.11n(HT40)_LCH_5510MHz_Ant2_NTNV

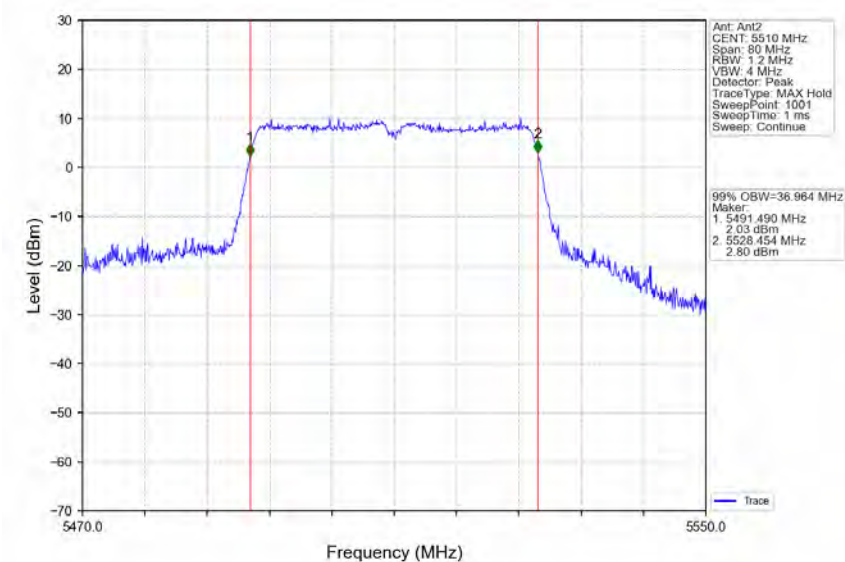


802.11n(HT40)_MCH_5550MHz_Ant1_NTNV

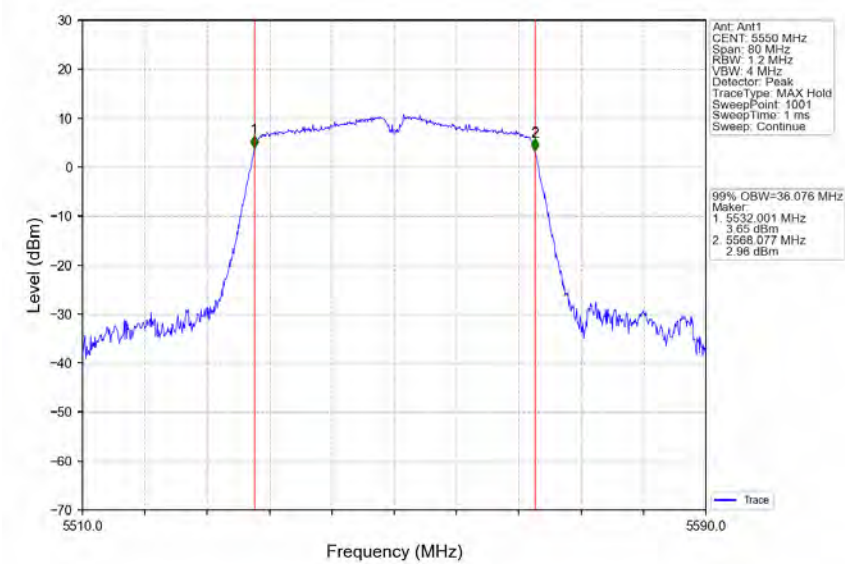


802.11n(HT40)_MCH_5550MHz_Ant2_NTNV

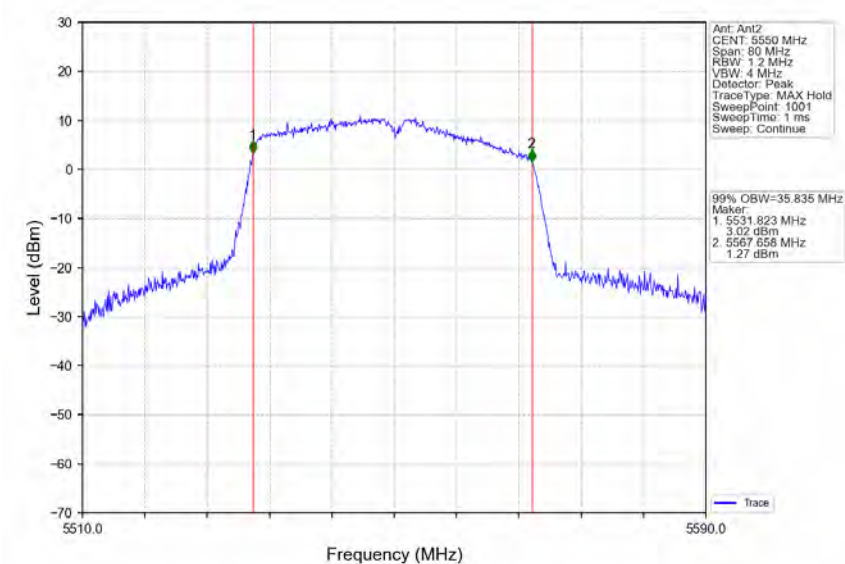


802.11n(HT40)_HCH_5670MHz_Ant1_NTNV

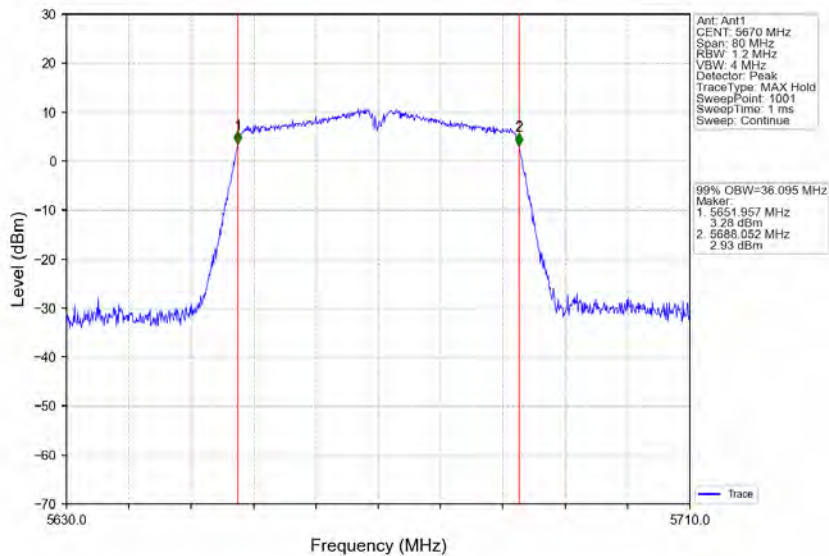


802.11n(HT40)_HCH_5670MHz_Ant2_NTNV

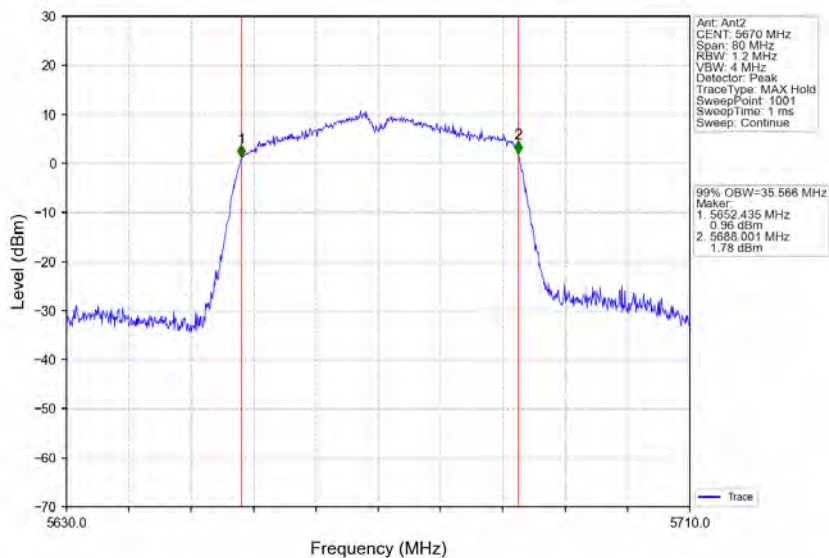


802.11n(HT40)_LCH_5755MHz_Ant1_NTNV

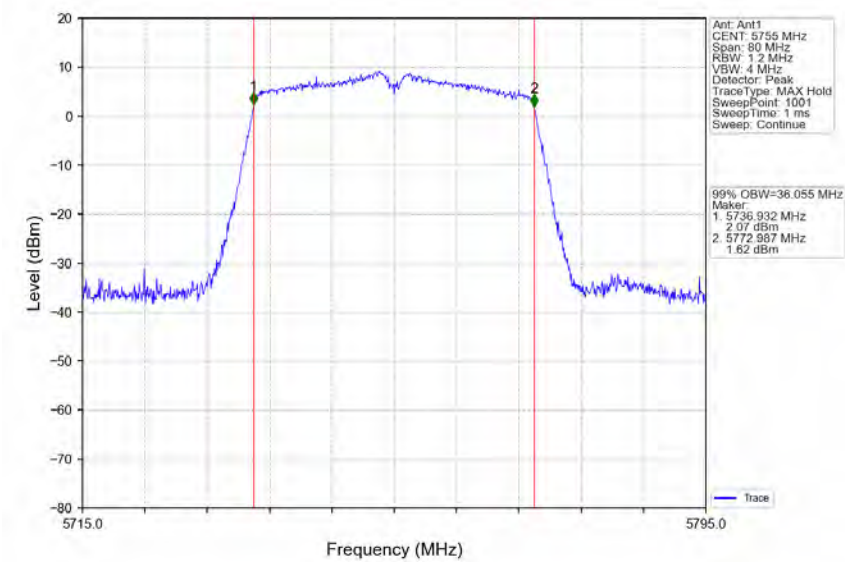


802.11n(HT40)_LCH_5755MHz_Ant2_NTNV

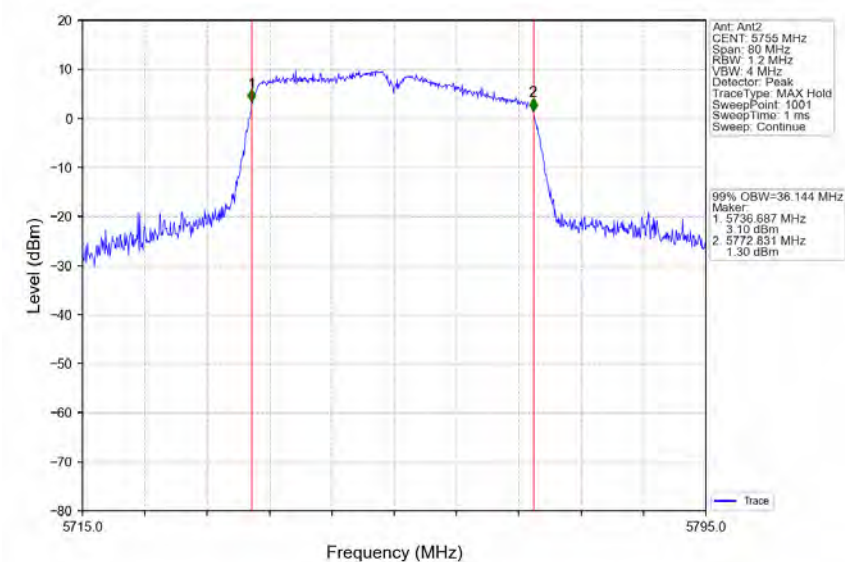


802.11n(HT40)_HCH_5795MHz_Ant1_NTNV

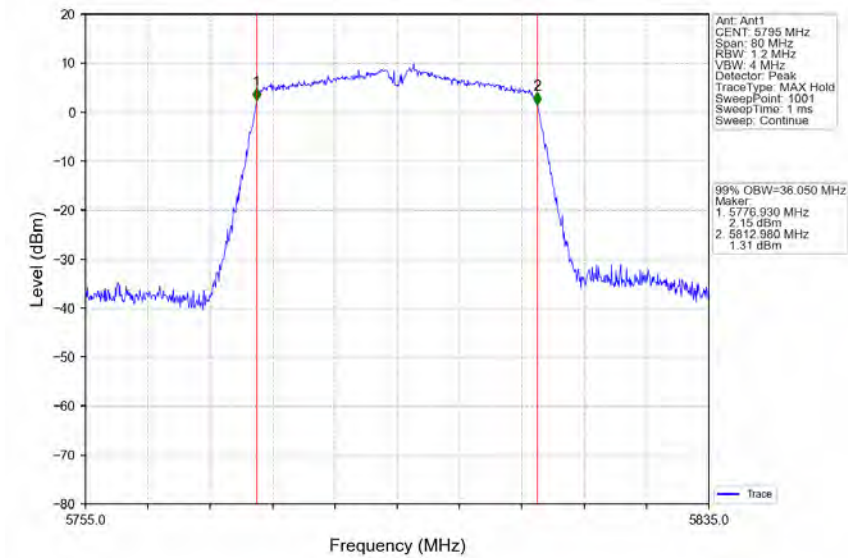


802.11n(HT40)_HCH_5795MHz_Ant2_NTNV

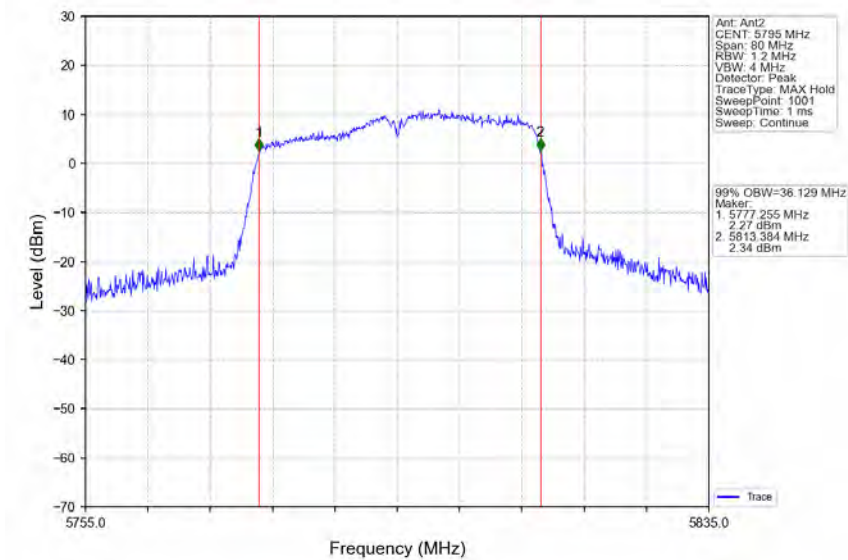


802.11ac(VHT80)_MCH_5210MHz_Ant1_NTNV

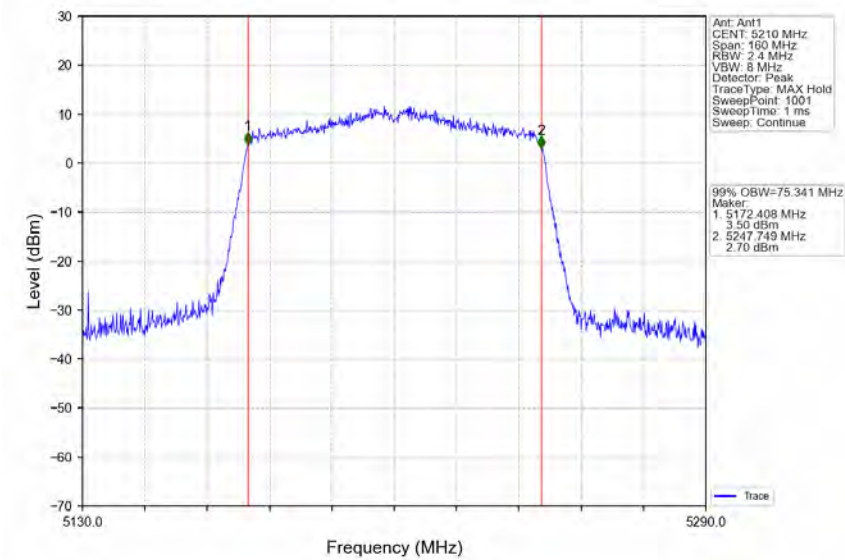


802.11ac(VHT80)_MCH_5210MHz_Ant2_NTNV

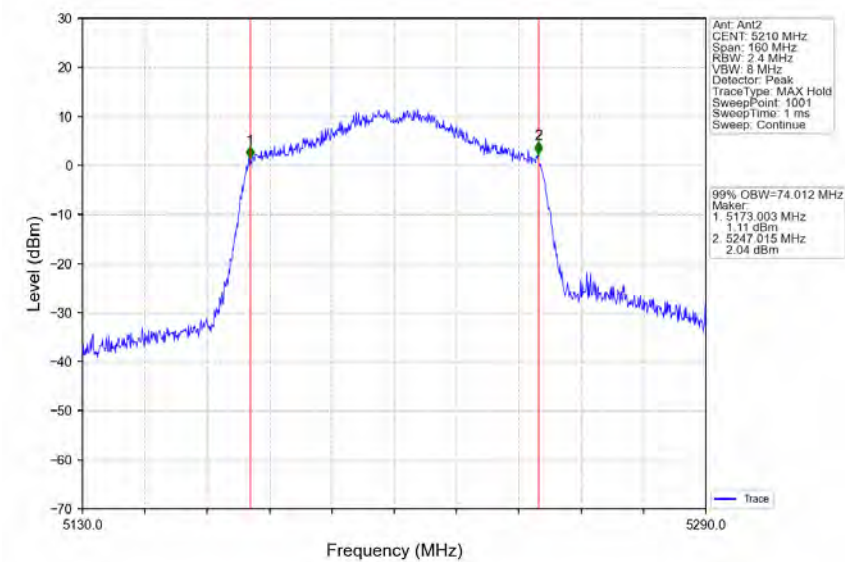


802.11ac(VHT80)_MCH_5290MHz_Ant1_NTNV

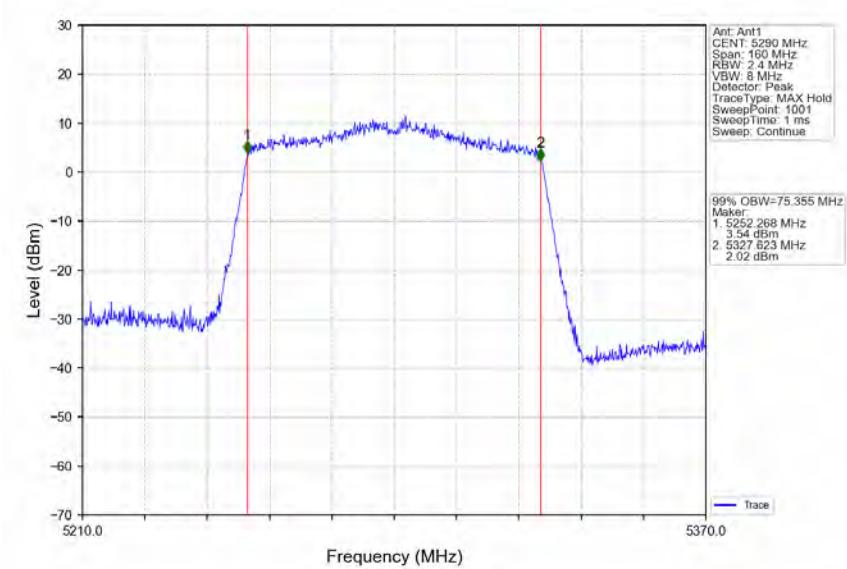


802.11ac(VHT80)_MCH_5290MHz_Ant2_NTNV

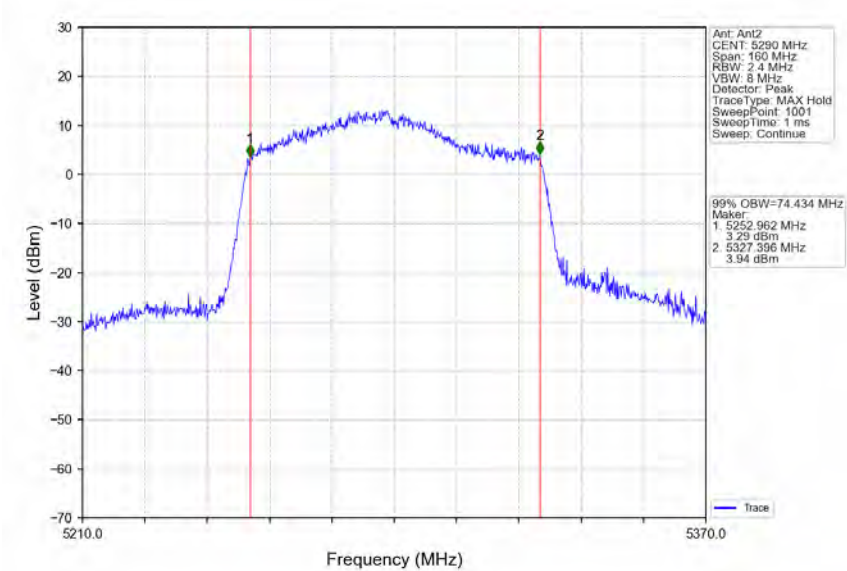


802.11ac(VHT80)_LCH_5530MHz_Ant1_NTNV

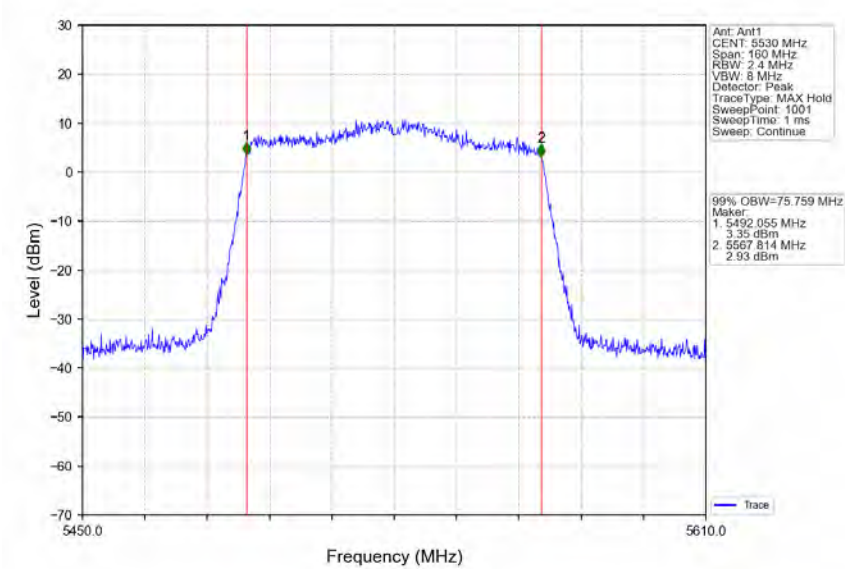


802.11ac(VHT80)_LCH_5530MHz_Ant2_NTNV

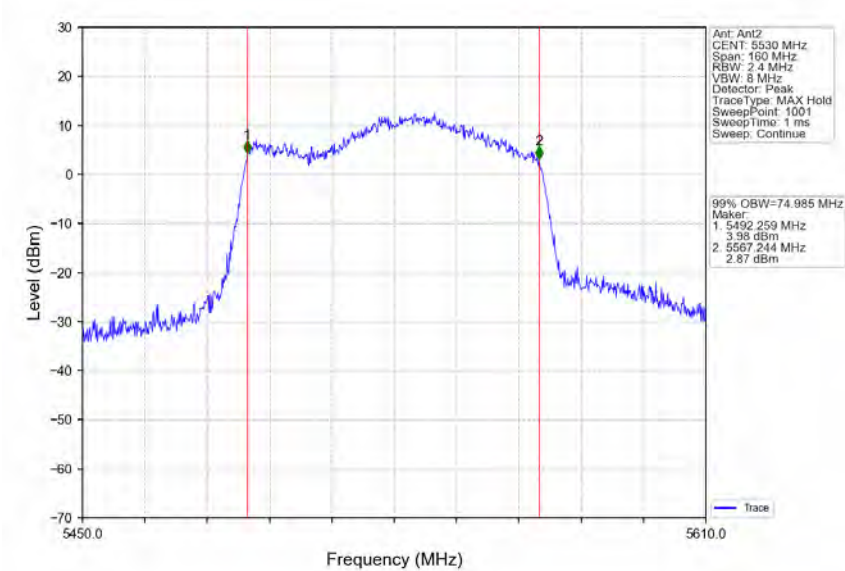


802.11ac(VHT80)_HCH_5610MHz_Ant1_NTNV

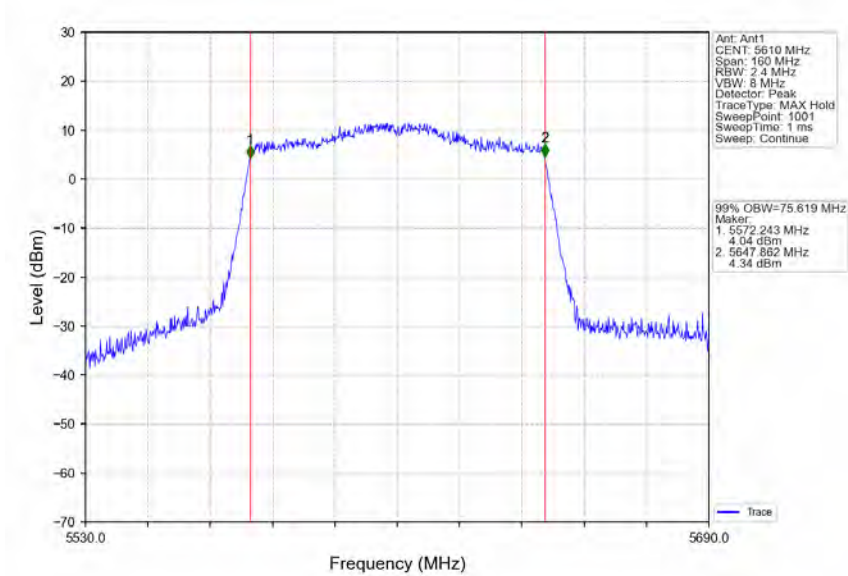


802.11ac(VHT80)_HCH_5610MHz_Ant2_NTNV

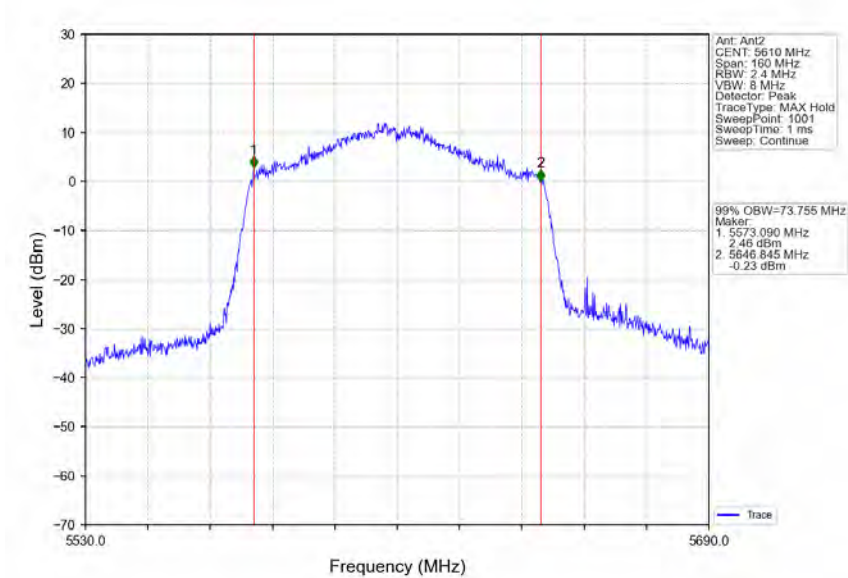

802.11ac(VHT80)_MCH_5775MHz_Ant1_NTNV

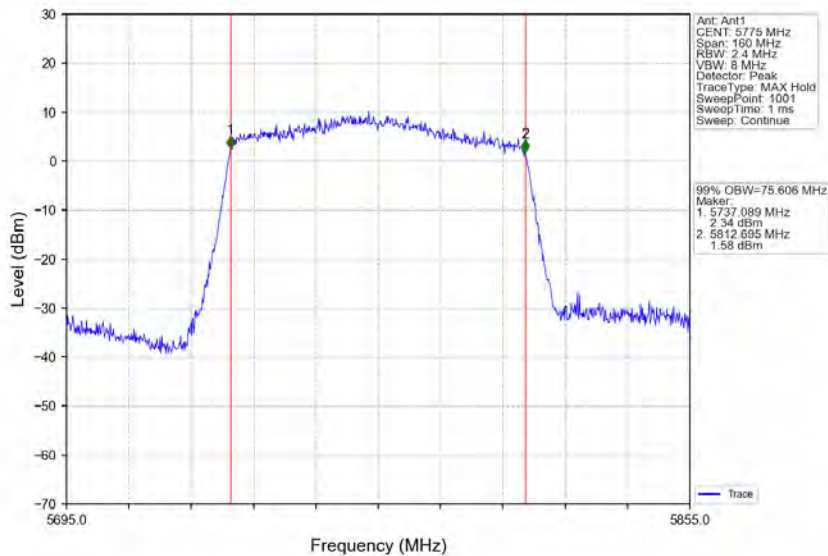

802.11ac(VHT80)_MCH_5775MHz_Ant2_NTNV

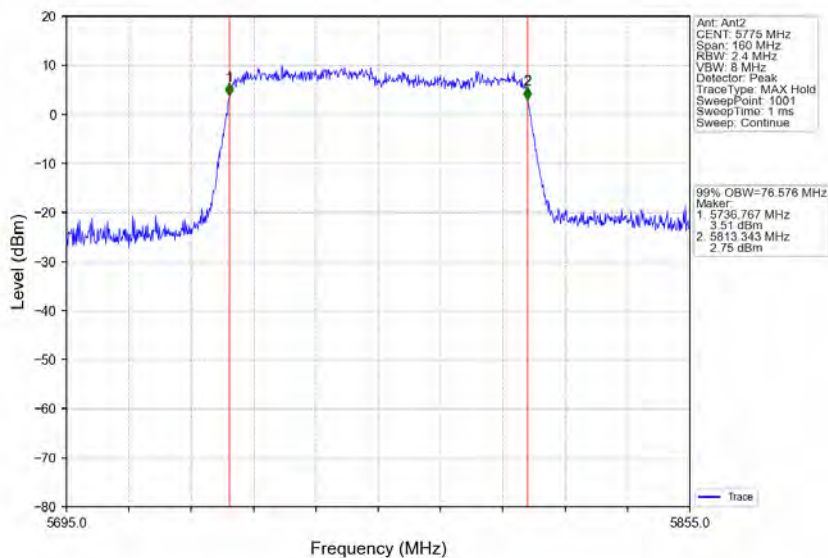


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 360 of 648


802.11ax(HEW20)_LCH_5180MHz_RU242_Left_Ant1_NTNV

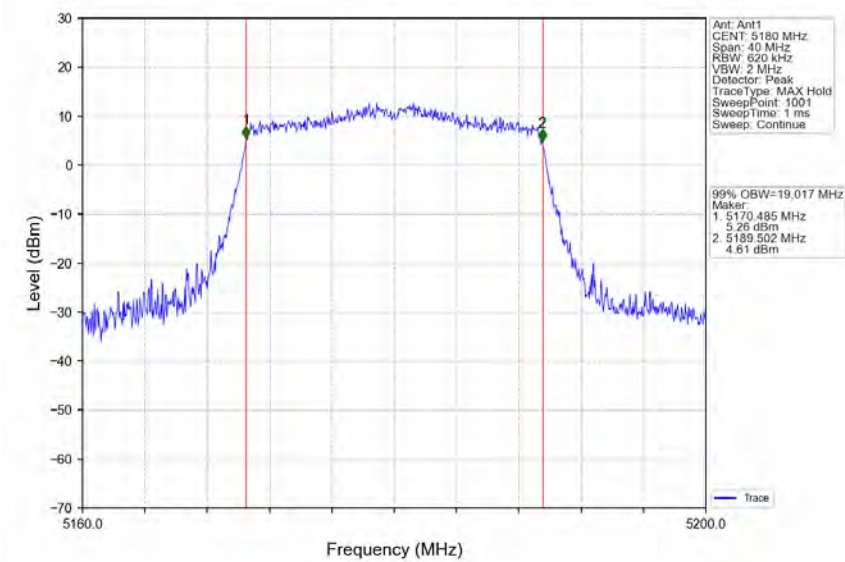


802.11ax(HEW20)_LCH_5180MHz_RU242_Left_Ant2_NTNV

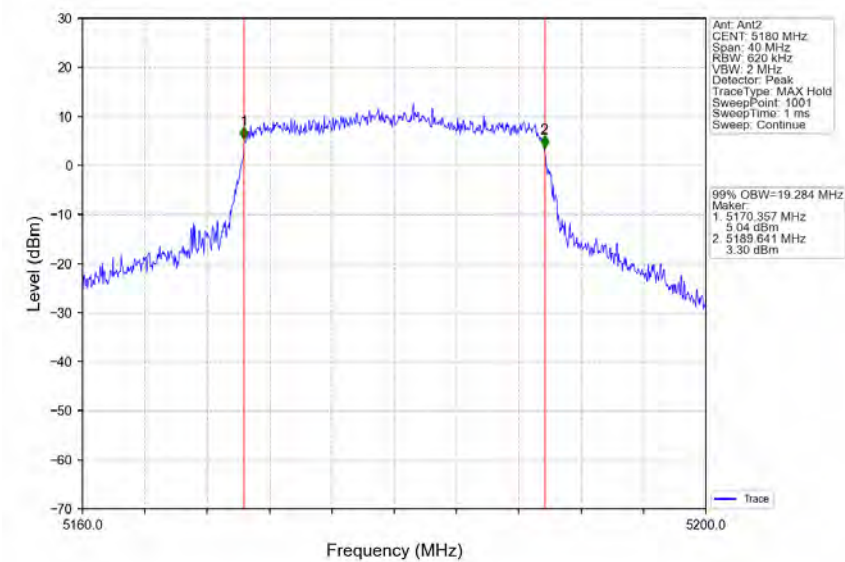


802.11ax(HEW20)_MCH_5200MHz_RU242_Left_Ant1_NTNV

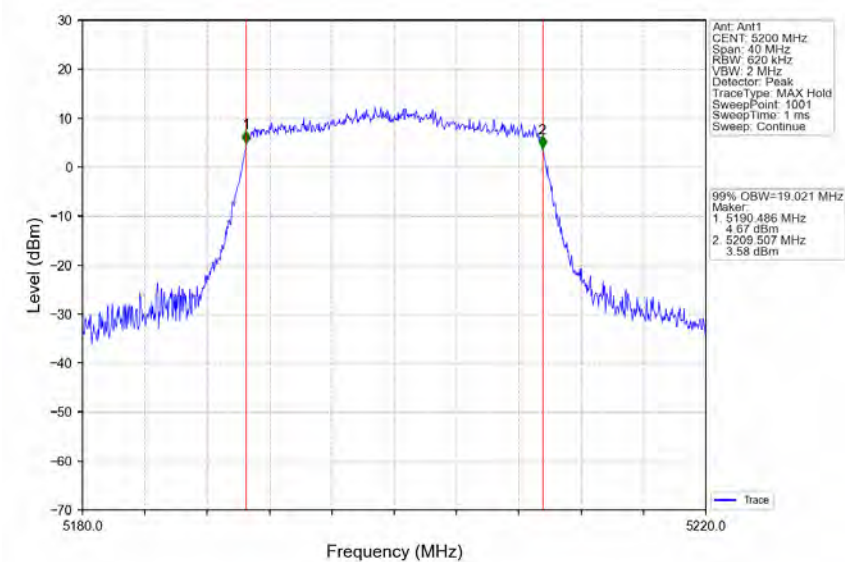


802.11ax(HEW20)_MCH_5200MHz_RU242_Left_Ant2_NTNV

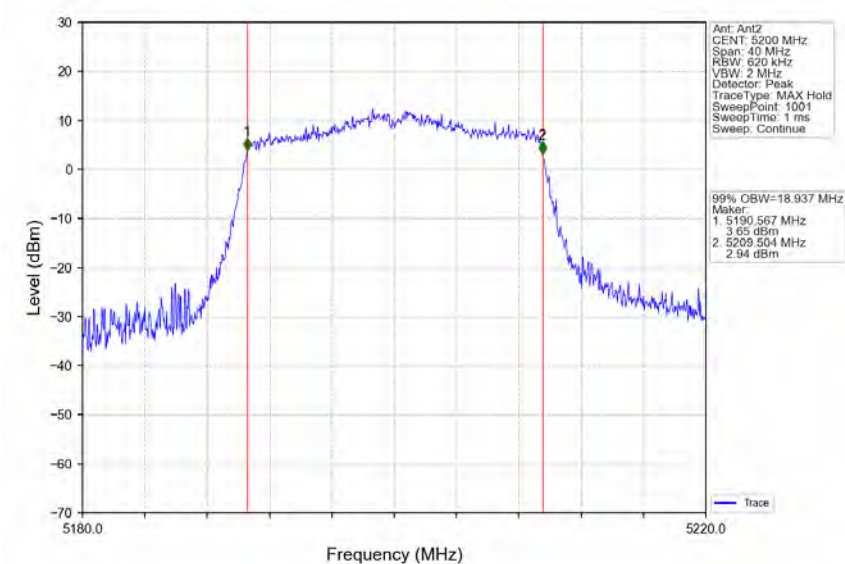

802.11ax(HEW20)_HCH_5240MHz_RU242_Left_Ant1_NTNV

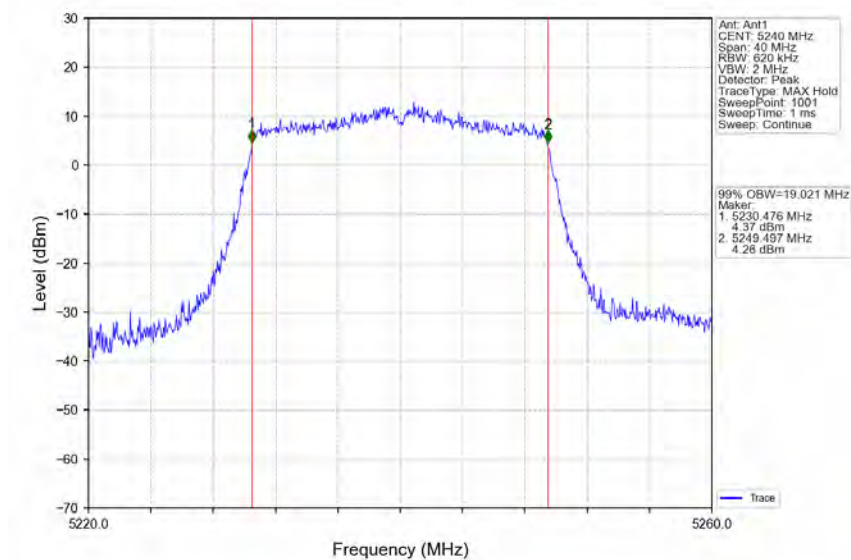

802.11ax(HEW20)_HCH_5240MHz_RU242_Left_Ant2_NTNV

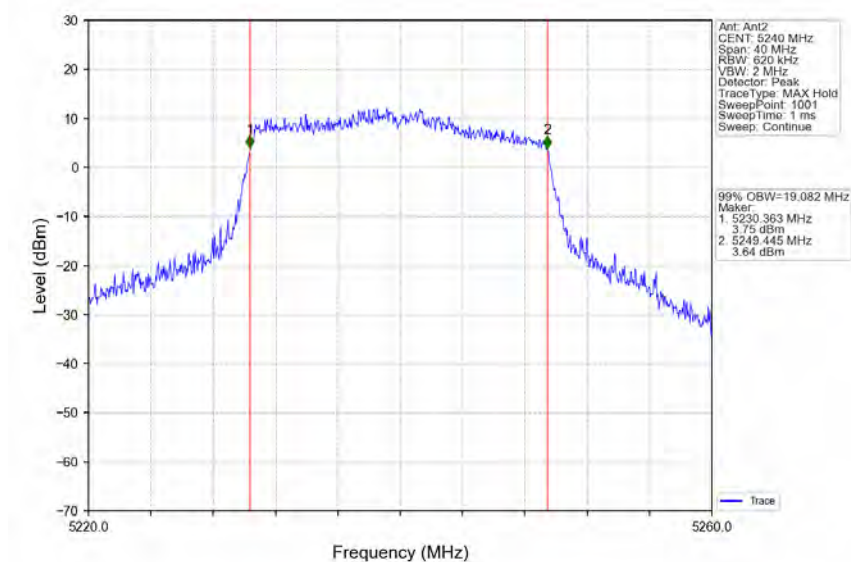


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 363 of 648

802.11ax(HEW20)_LCH_5260MHz_RU242_Left_Ant1_NTNV

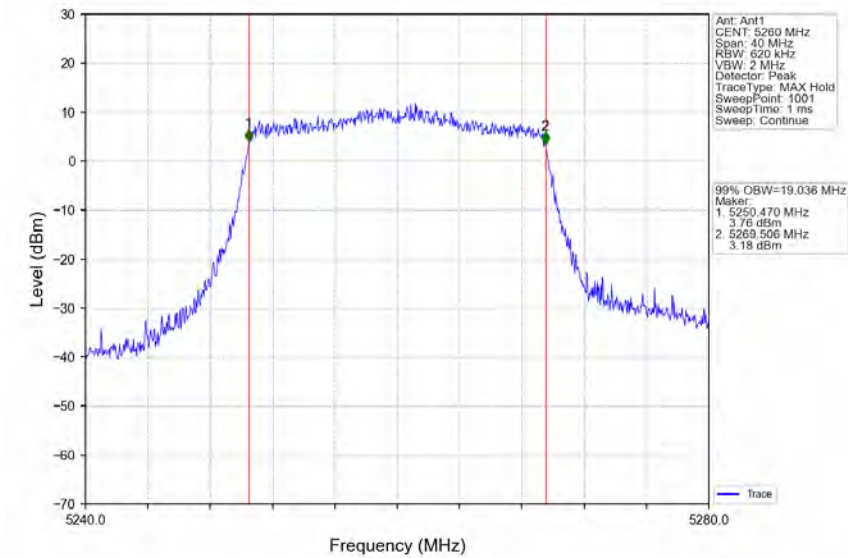

802.11ax(HEW20)_LCH_5260MHz_RU242_Left_Ant2_NTNV

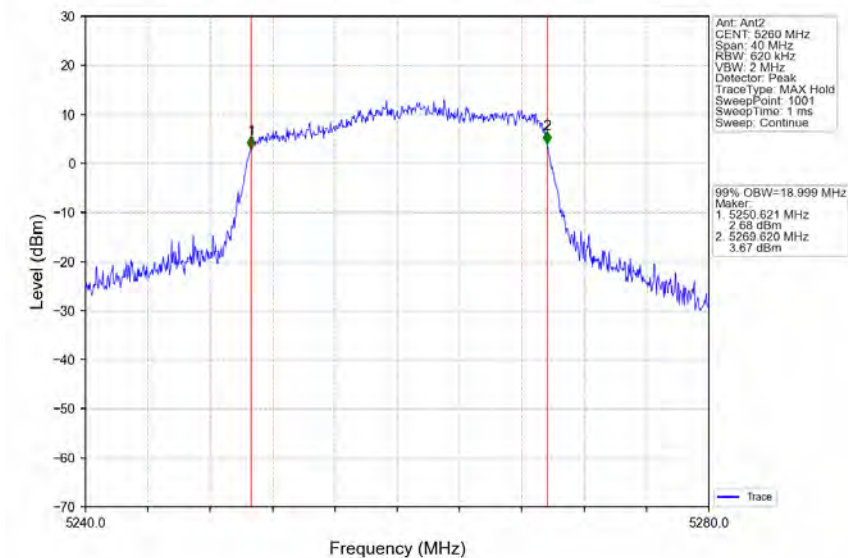


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 364 of 648

802.11ax(HEW20)_MCH_5300MHz_RU242_Left_Ant1_NTNV

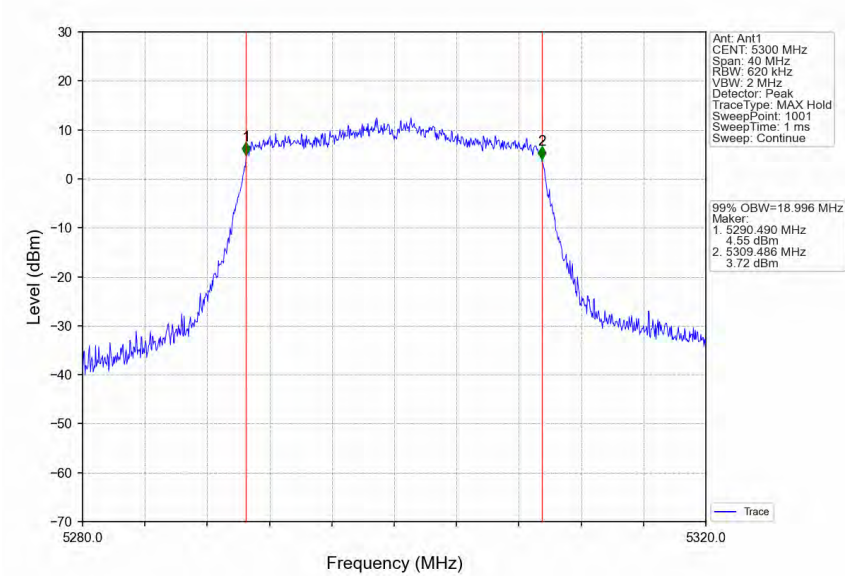

802.11ax(HEW20)_MCH_5300MHz_RU242_Left_Ant2_NTNV

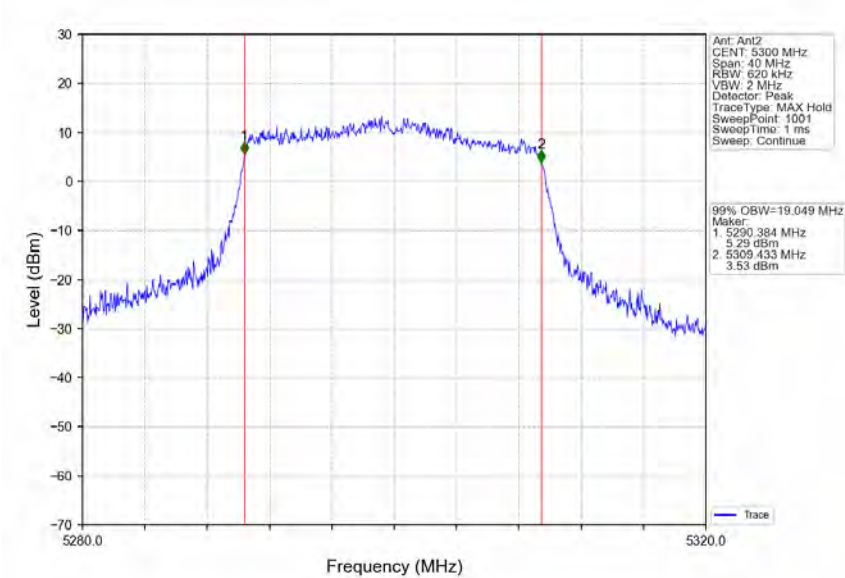


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 365 of 648


802.11ax(HEW20)_HCH_5320MHz_RU242_Left_Ant1_NTNV

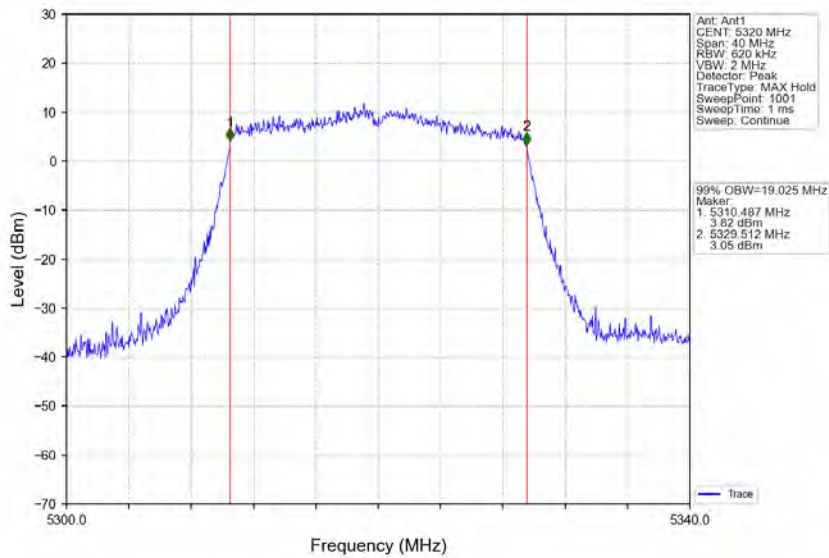


802.11ax(HEW20)_HCH_5320MHz_RU242_Left_Ant2_NTNV

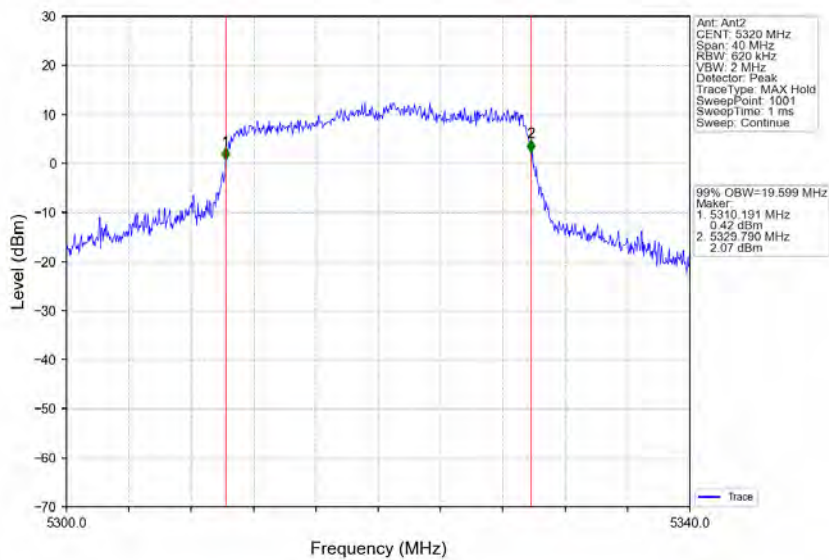


802.11ax(HEW20)_LCH_5500MHz_RU242_Left_Ant1_NTNV

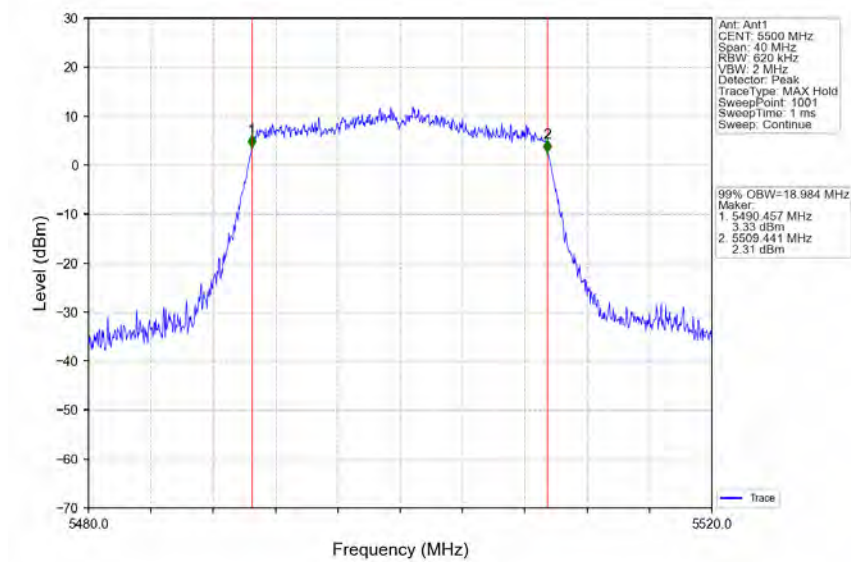


802.11ax(HEW20)_LCH_5500MHz_RU242_Left_Ant2_NTNV

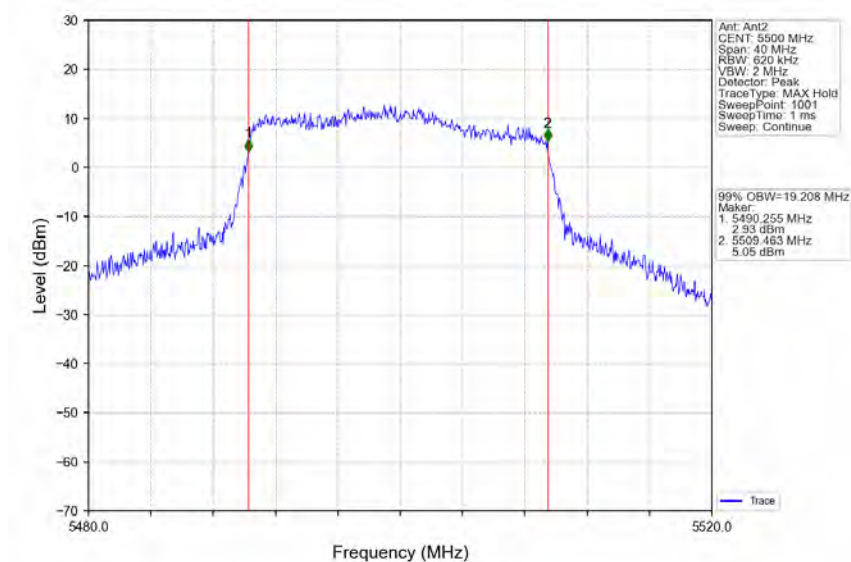


802.11ax(HEW20)_MCH_5580MHz_RU242_Left_Ant1_NTNV

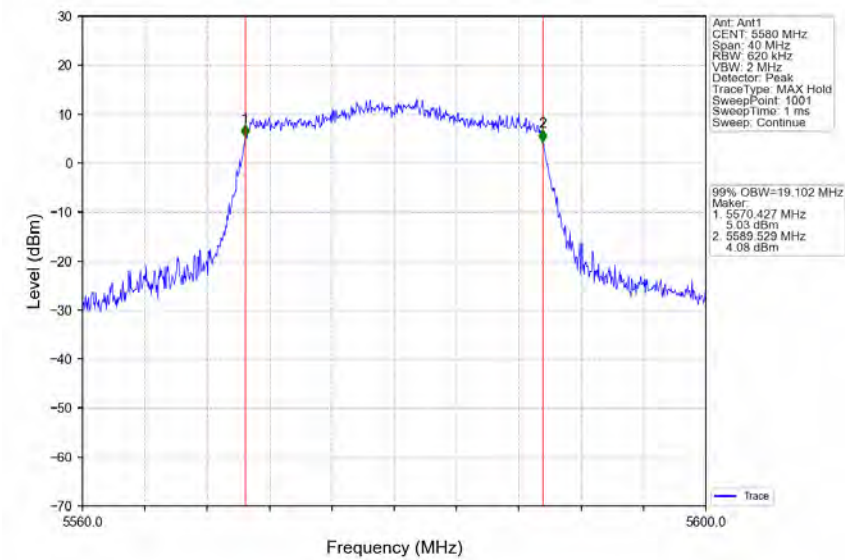


802.11ax(HEW20)_MCH_5580MHz_RU242_Left_Ant2_NTNV

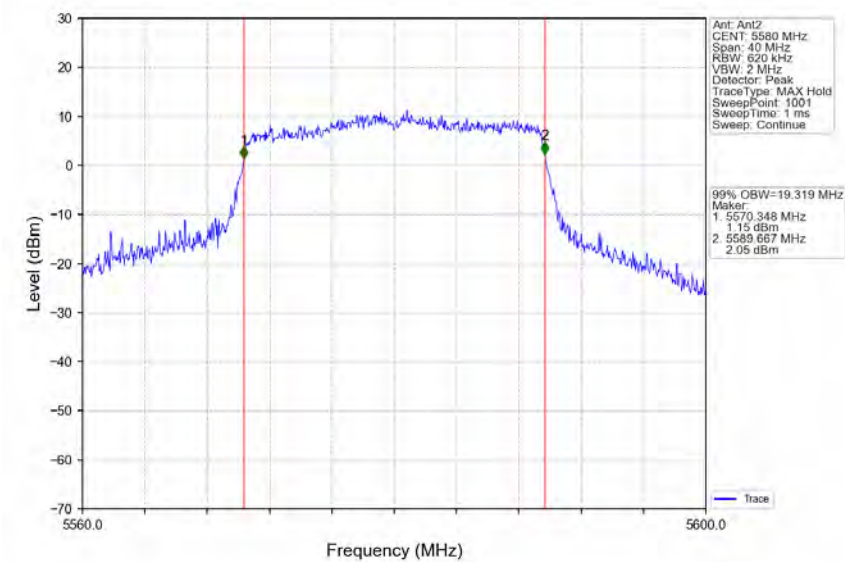

802.11ax(HEW20)_HCH_5700MHz_RU242_Left_Ant1_NTNV

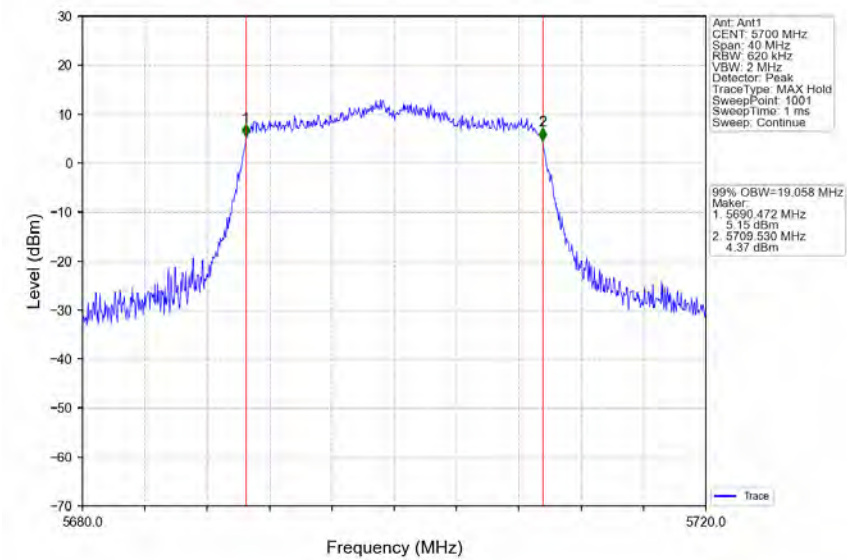

802.11ax(HEW20)_HCH_5700MHz_RU242_Left_Ant2_NTNV

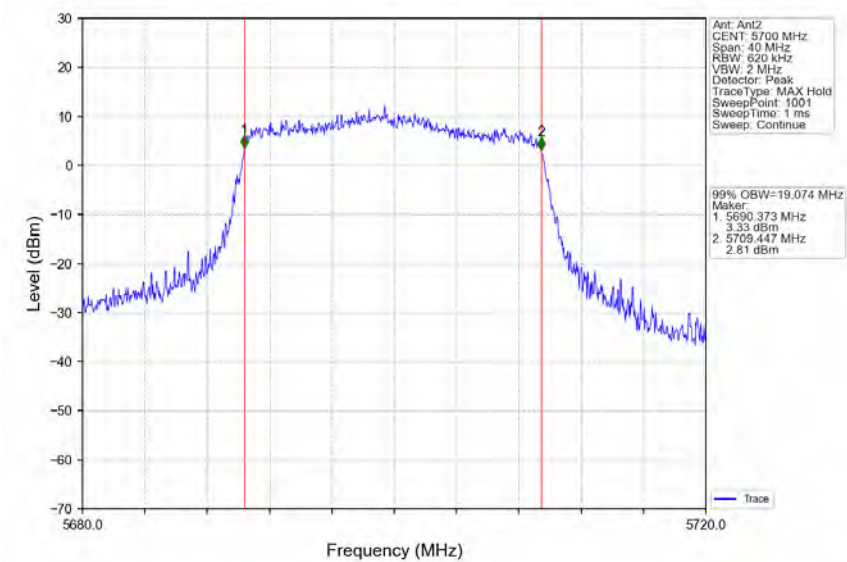


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 369 of 648

802.11ax(HEW20)_LCH_5745MHz_RU242_Left_Ant1_NTNV

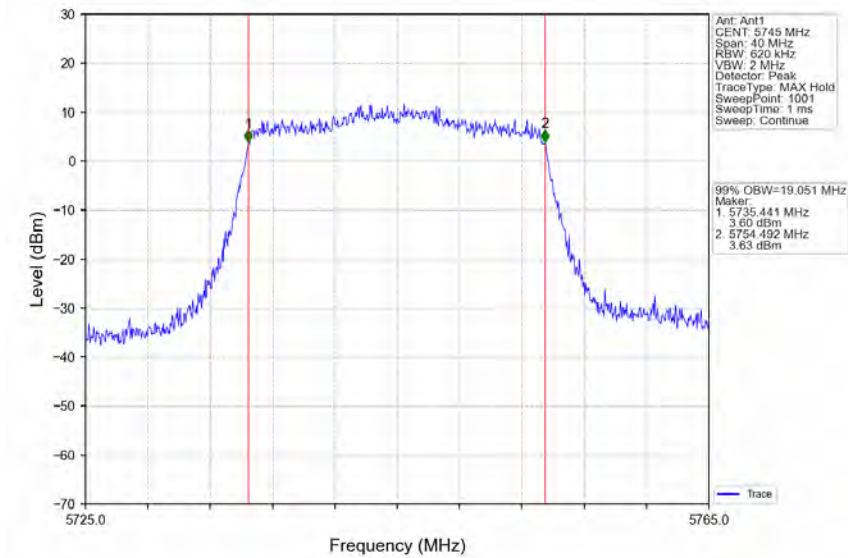

802.11ax(HEW20)_LCH_5745MHz_RU242_Left_Ant2_NTNV

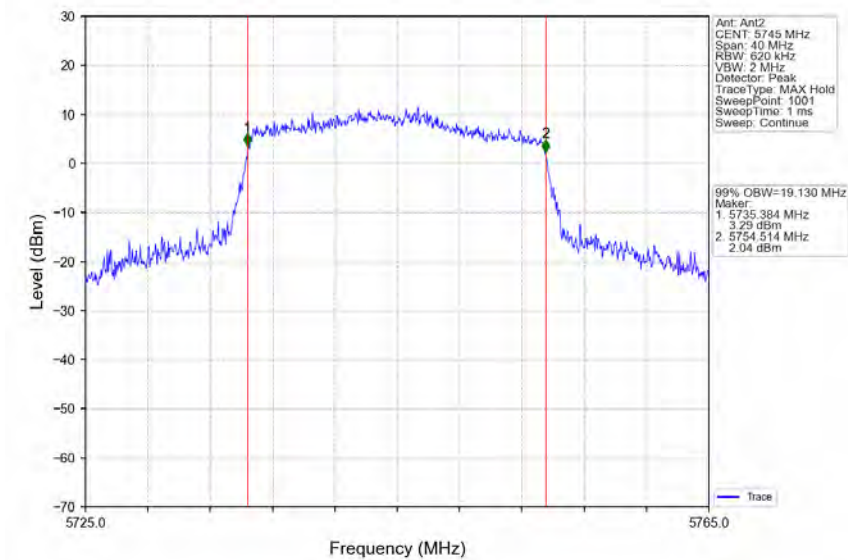


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 370 of 648


802.11ax(HEW20)_MCH_5785MHz_RU242_Left_Ant1_NTNV

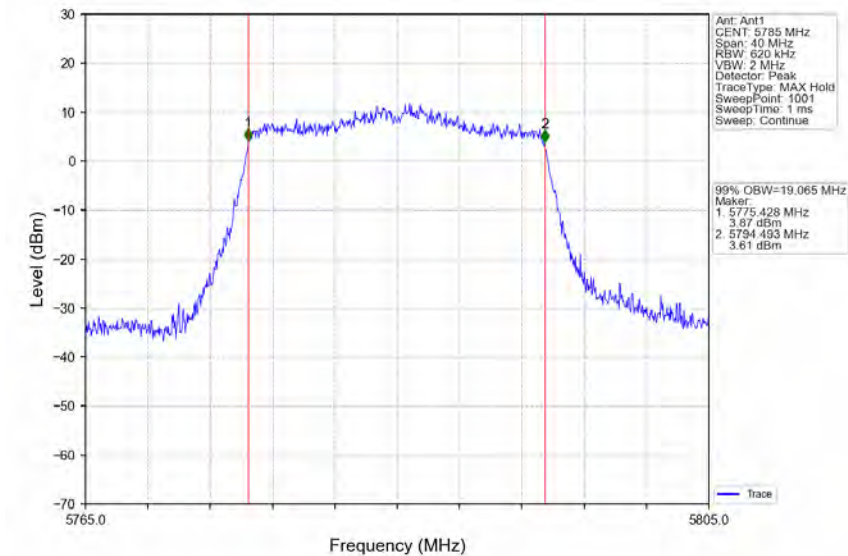


802.11ax(HEW20)_MCH_5785MHz_RU242_Left_Ant2_NTNV

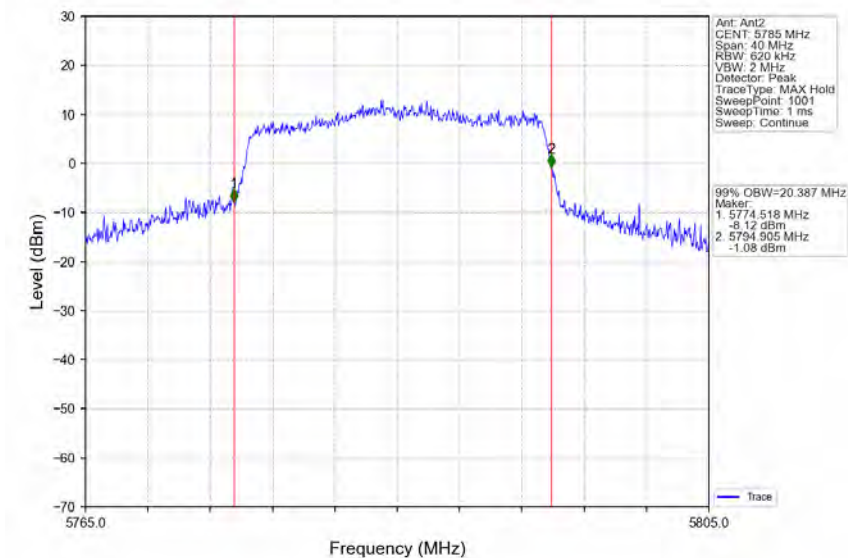

802.11ax(HEW20)_HCH_5825MHz_RU242_Left_Ant1_NTNV

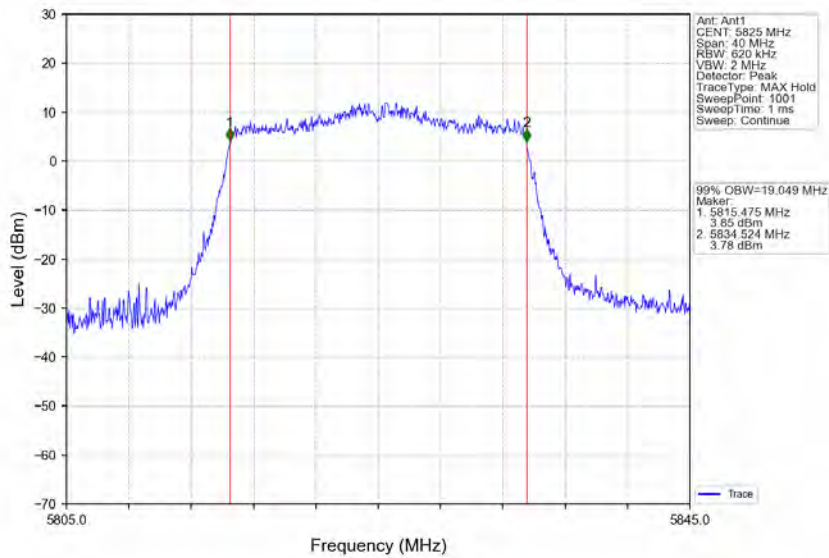

802.11ax(HEW20)_HCH_5825MHz_RU242_Left_Ant2_NTNV

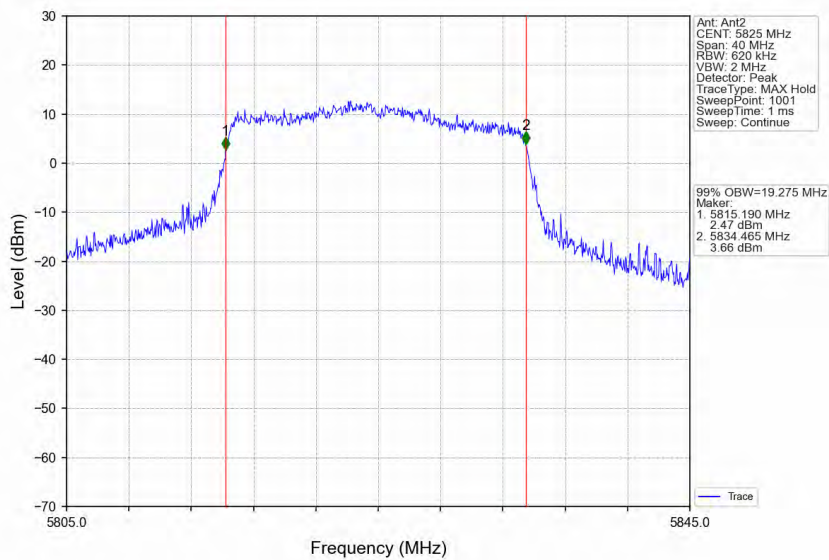


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 372 of 648


802.11ax(HEW40)_LCH_5190MHz_RU484_Left_Ant1_NTNV

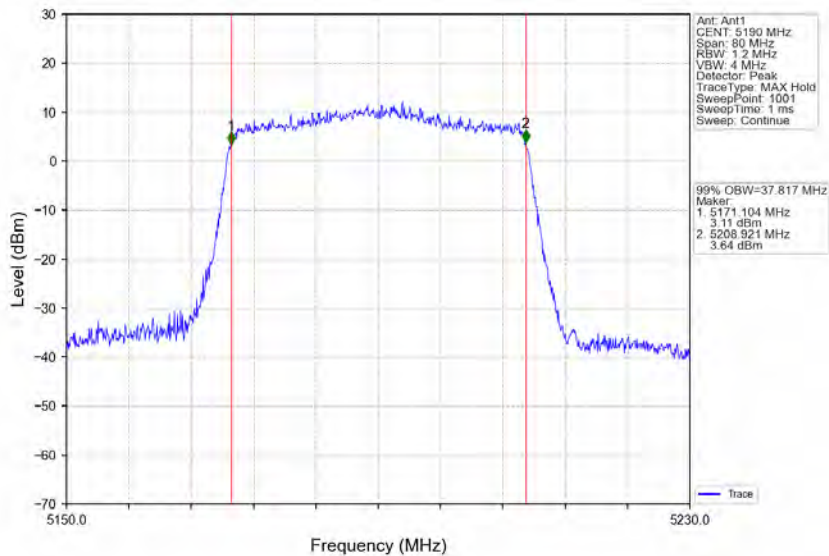


802.11ax(HEW40)_LCH_5190MHz_RU484_Left_Ant2_NTNV

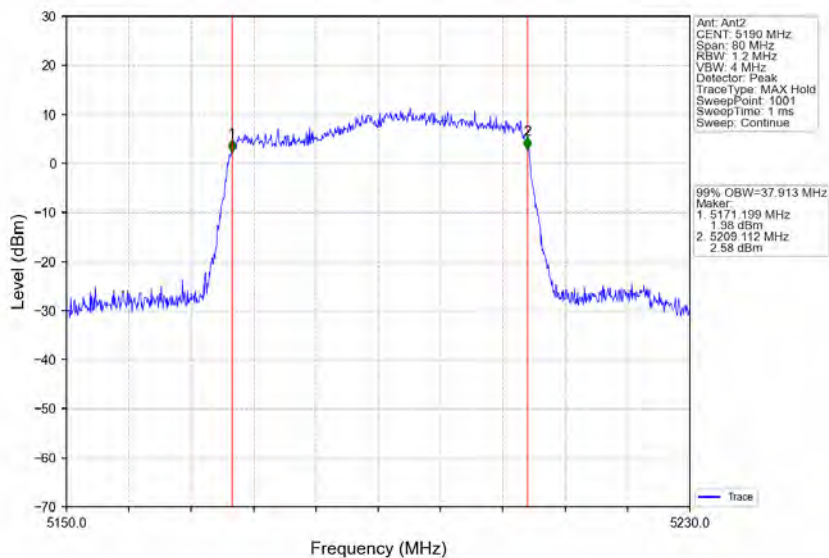


802.11ax(HEW40)_HCH_5230MHz_RU484_Left_Ant1_NTNV

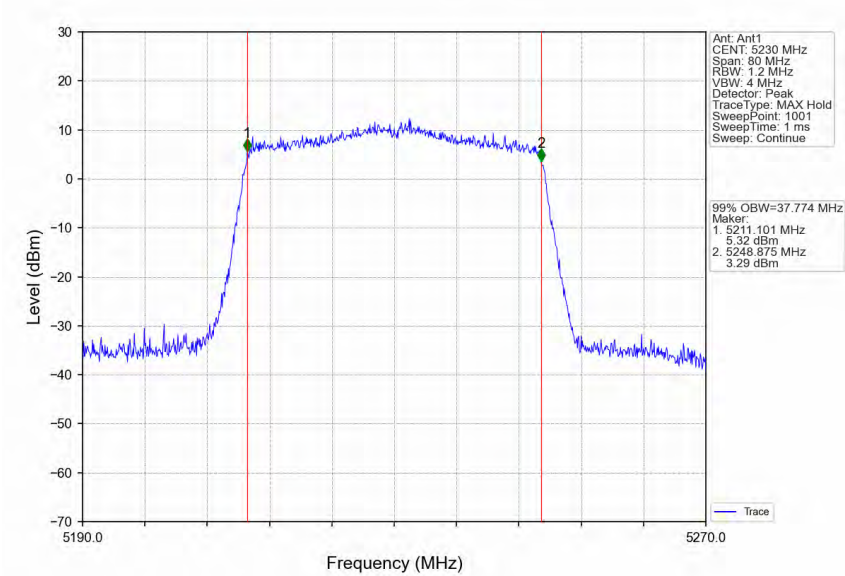


802.11ax(HEW40)_HCH_5230MHz_RU484_Left_Ant2_NTNV

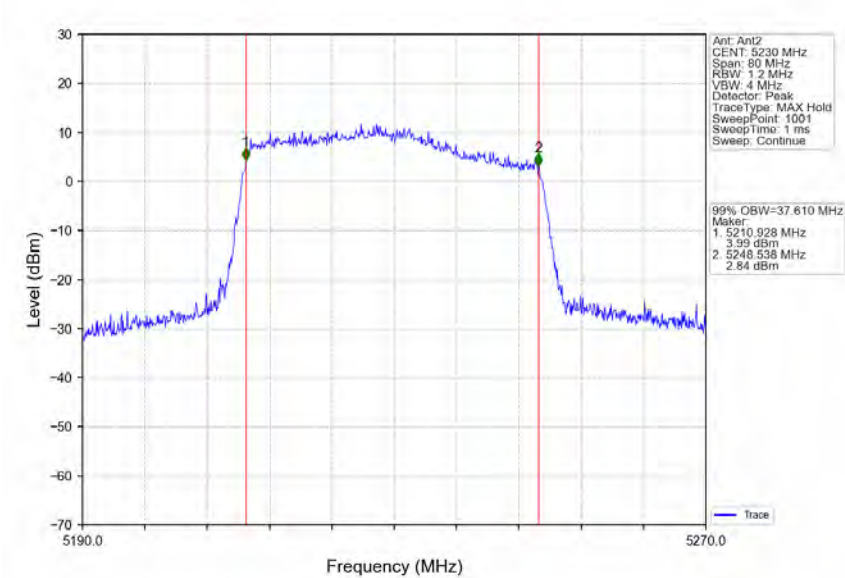


802.11ax(HEW40)_LCH_5270MHz_RU484_Left_Ant1_NTNV

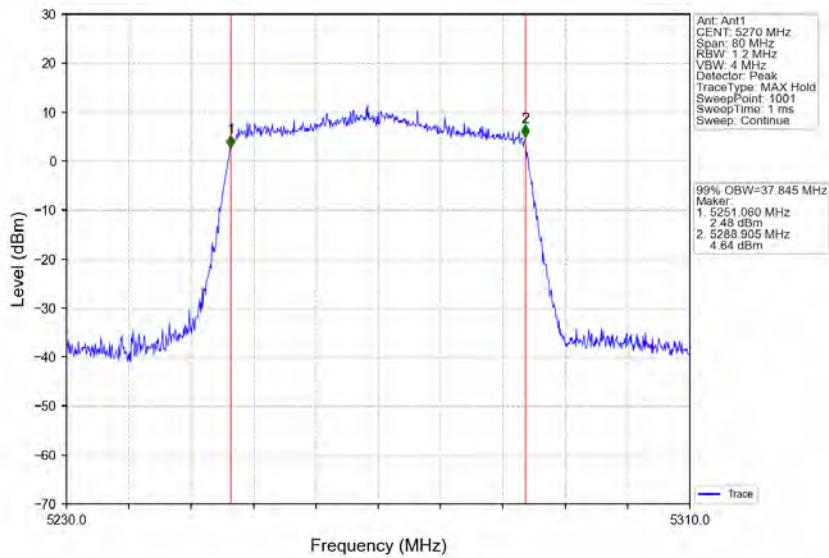


802.11ax(HEW40)_LCH_5270MHz_RU484_Left_Ant2_NTNV

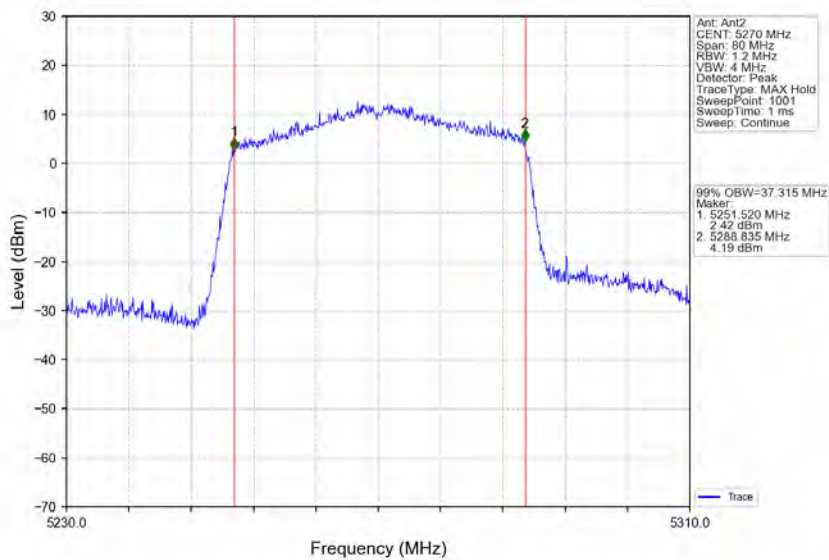


802.11ax(HEW40)_HCH_5310MHz_RU484_Left_Ant1_NTNV

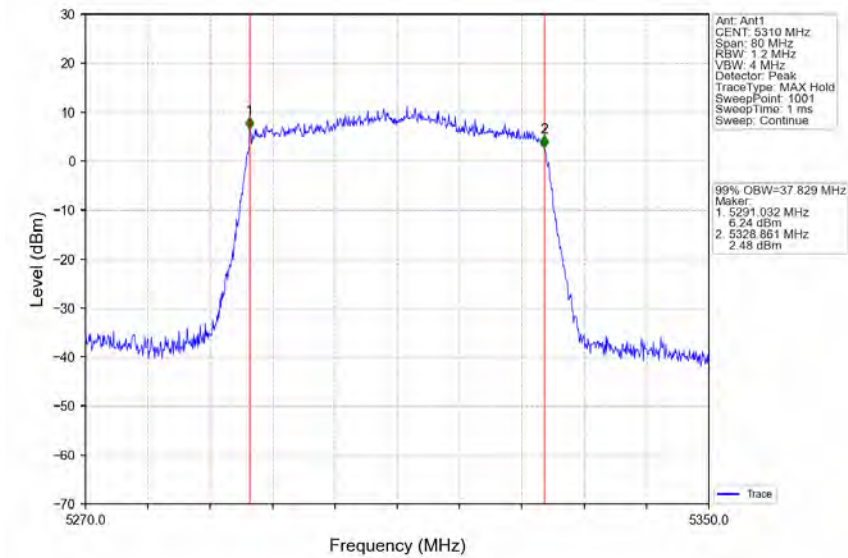


802.11ax(HEW40)_HCH_5310MHz_RU484_Left_Ant2_NTNV

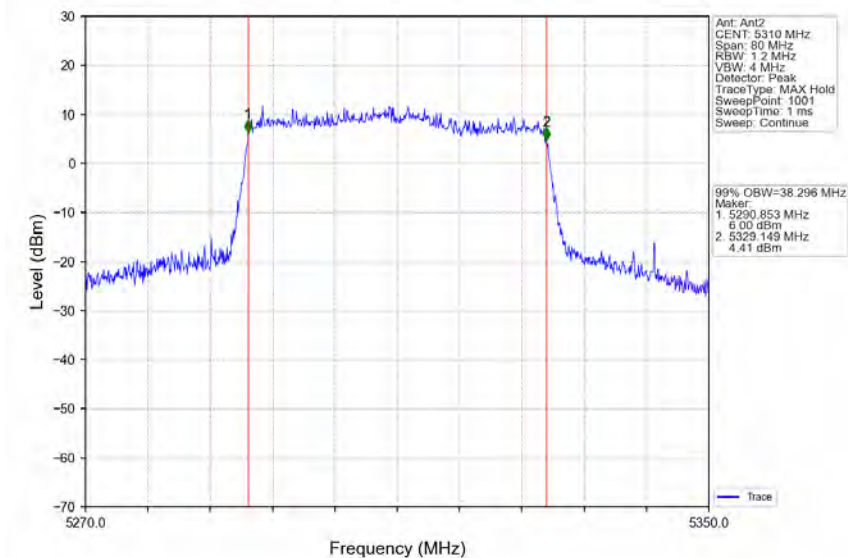

802.11ax(HEW40)_LCH_5510MHz_RU484_Left_Ant1_NTNV

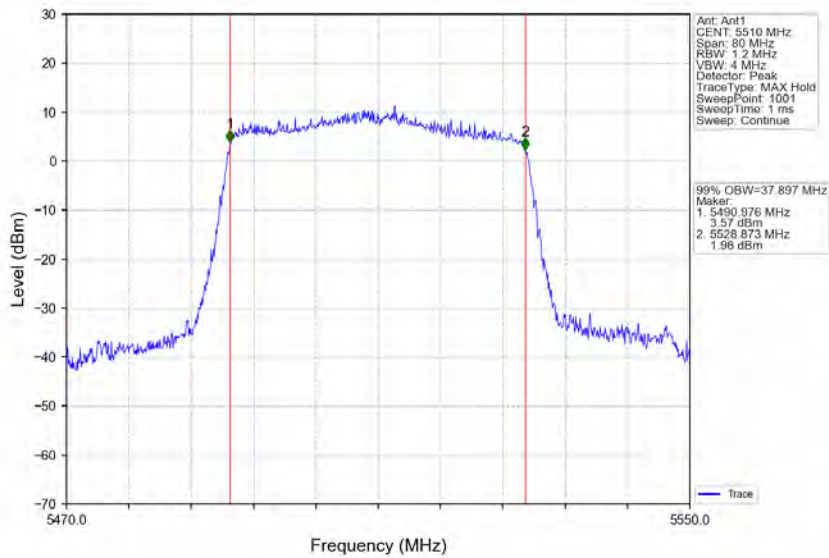

802.11ax(HEW40)_LCH_5510MHz_RU484_Left_Ant2_NTNV

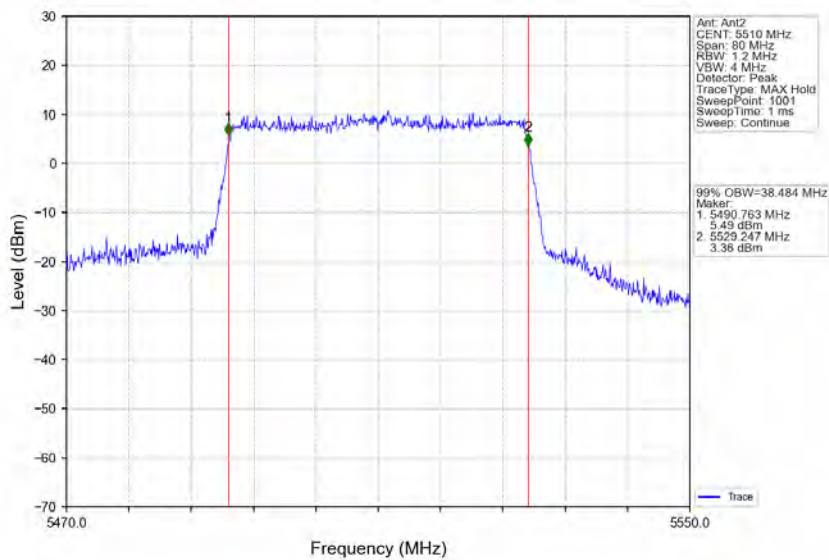


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 377 of 648


802.11ax(HEW40)_MCH_5550MHz_RU484_Left_Ant1_NTNV

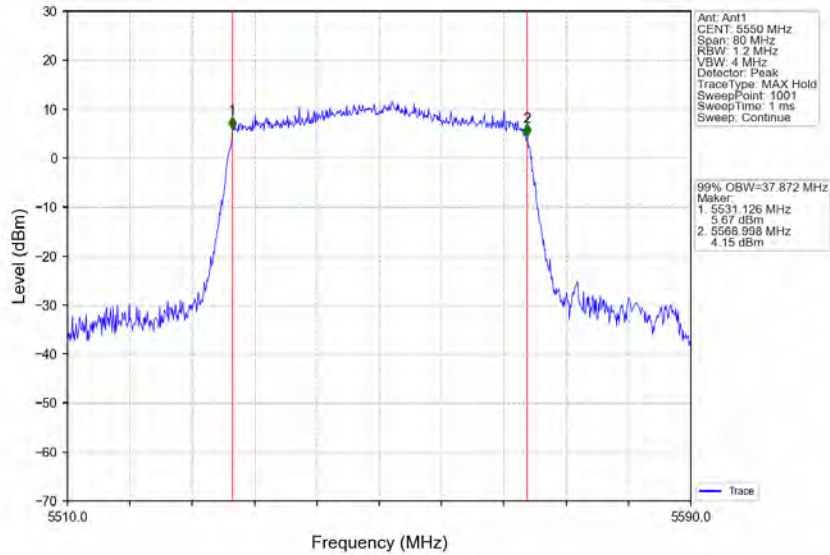


802.11ax(HEW40)_MCH_5550MHz_RU484_Left_Ant2_NTNV

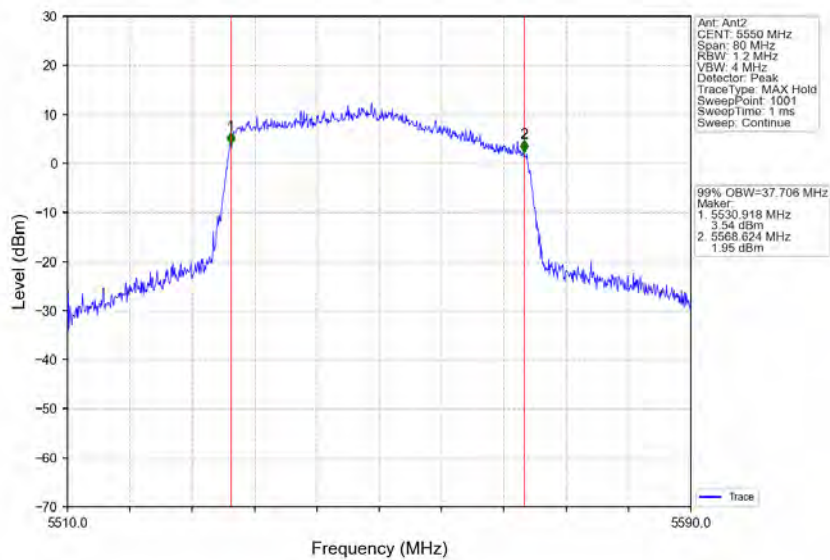


802.11ax(HEW40)_HCH_5670MHz_RU484_Left_Ant1_NTNV

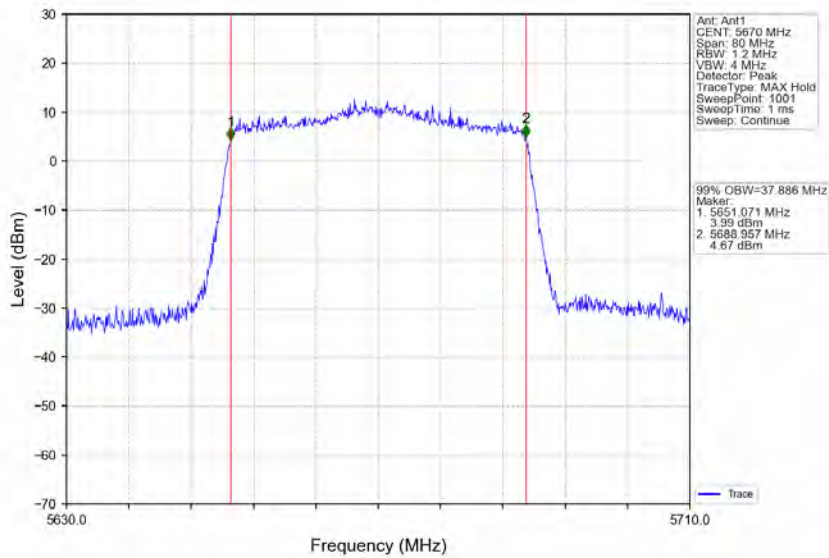


802.11ax(HEW40)_HCH_5670MHz_RU484_Left_Ant2_NTNV

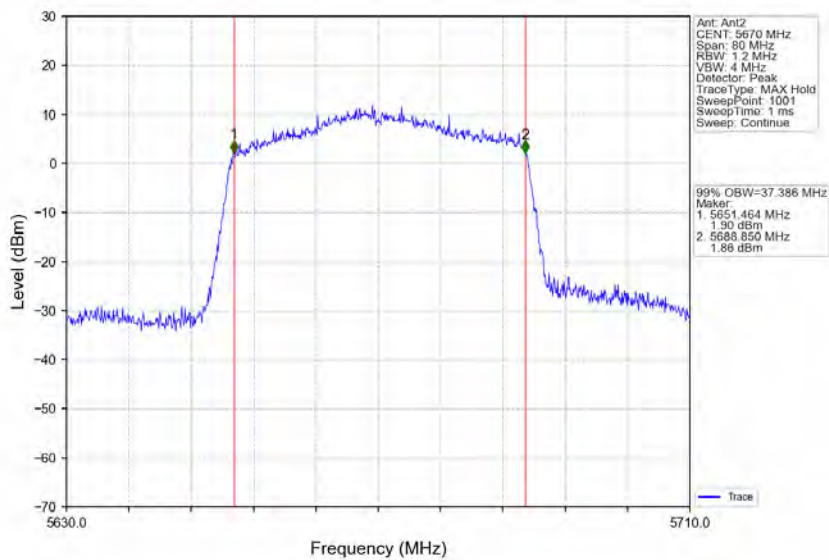


802.11ax(HEW40)_LCH_5755MHz_RU484_Left_Ant1_NTNV

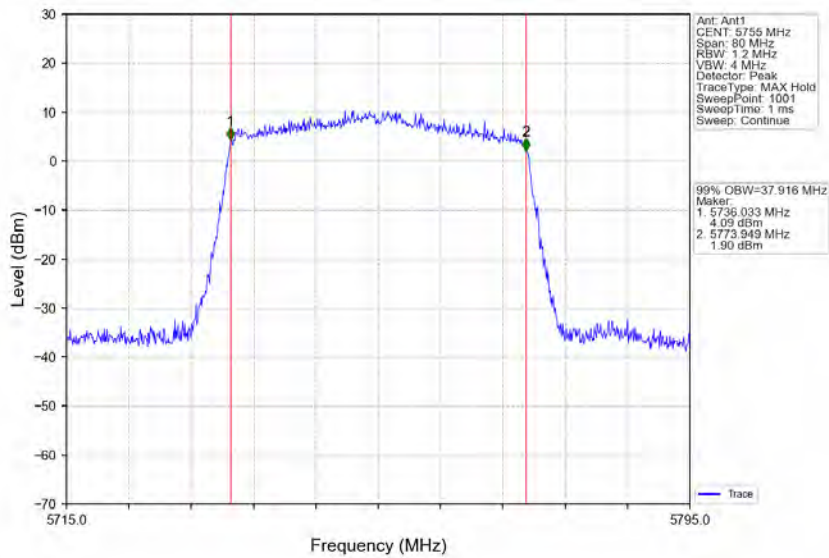


802.11ax(HEW40)_LCH_5755MHz_RU484_Left_Ant2_NTNV

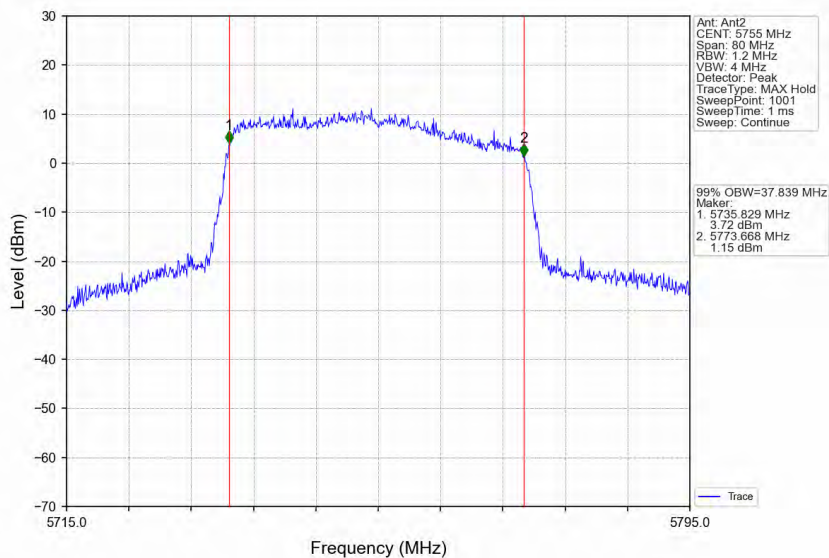

802.11ax(HEW40)_HCH_5795MHz_RU484_Left_Ant1_NTNV

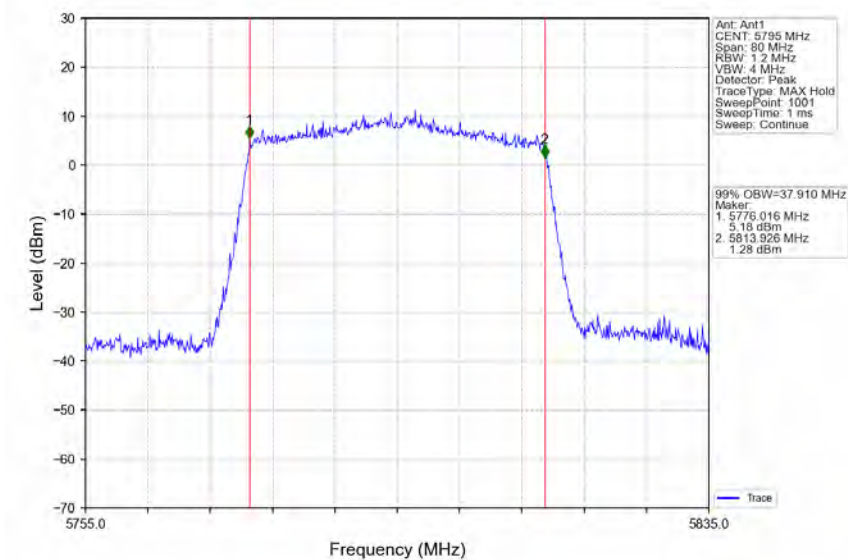

802.11ax(HEW40)_HCH_5795MHz_RU484_Left_Ant2_NTNV

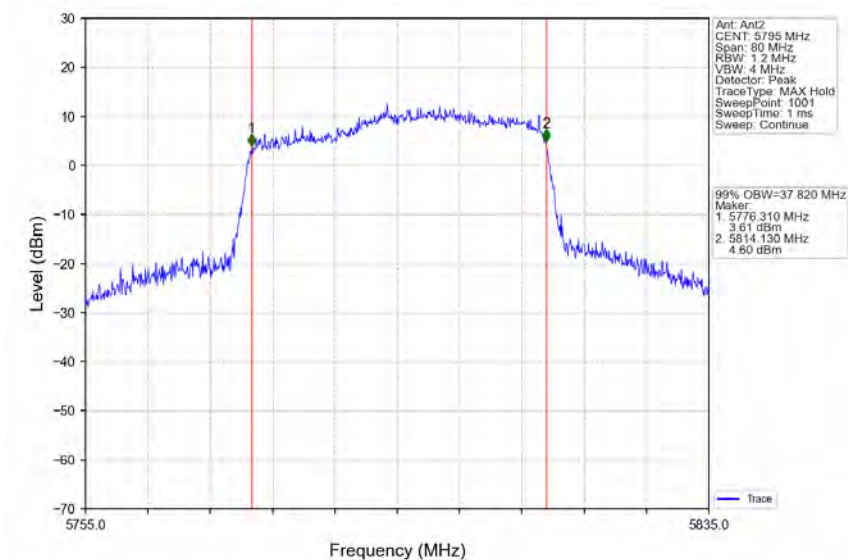


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 381 of 648


802.11ax(HEW80)_MCH_5210MHz_RU996_Left_Ant1_NTNV

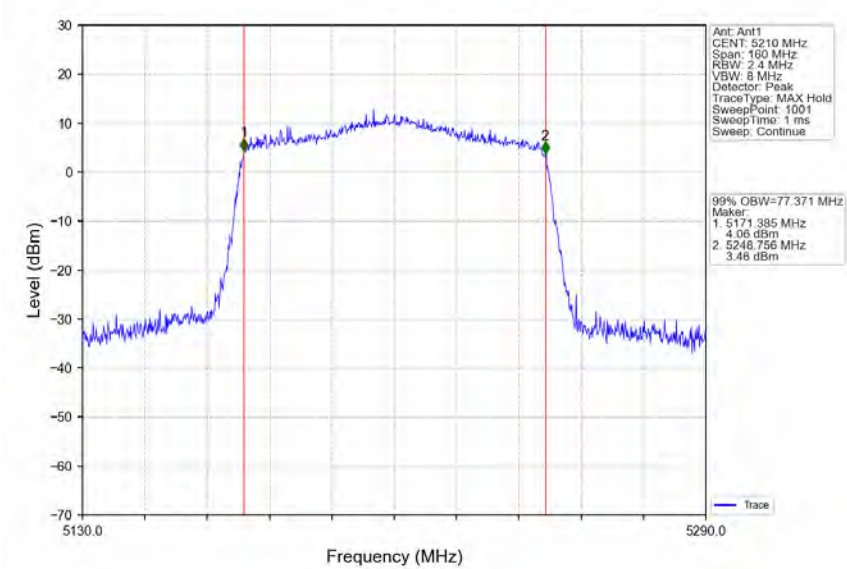


802.11ax(HEW80)_MCH_5210MHz_RU996_Left_Ant2_NTNV

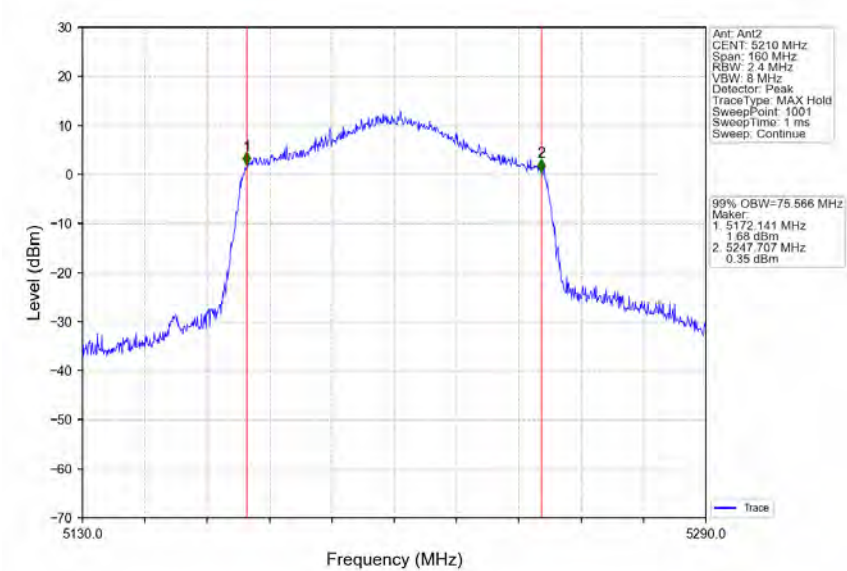


802.11ax(HEW80)_MCH_5290MHz_RU996_Left_Ant1_NTNV

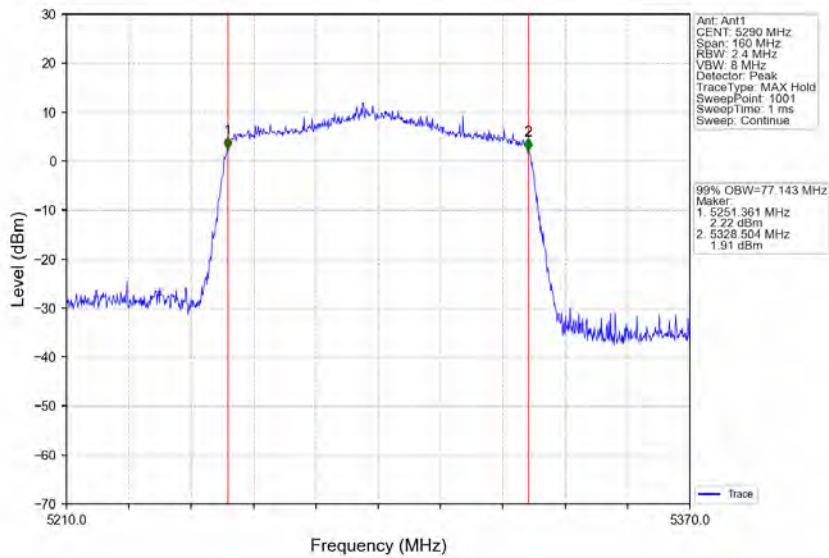


802.11ax(HEW80)_MCH_5290MHz_RU996_Left_Ant2_NTNV

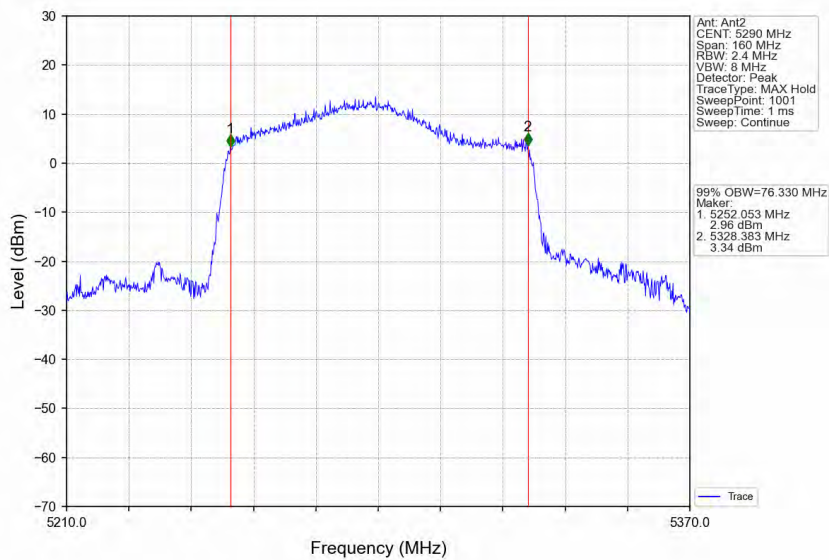

802.11ax(HEW80)_LCH_5530MHz_RU996_Left_Ant1_NTNV

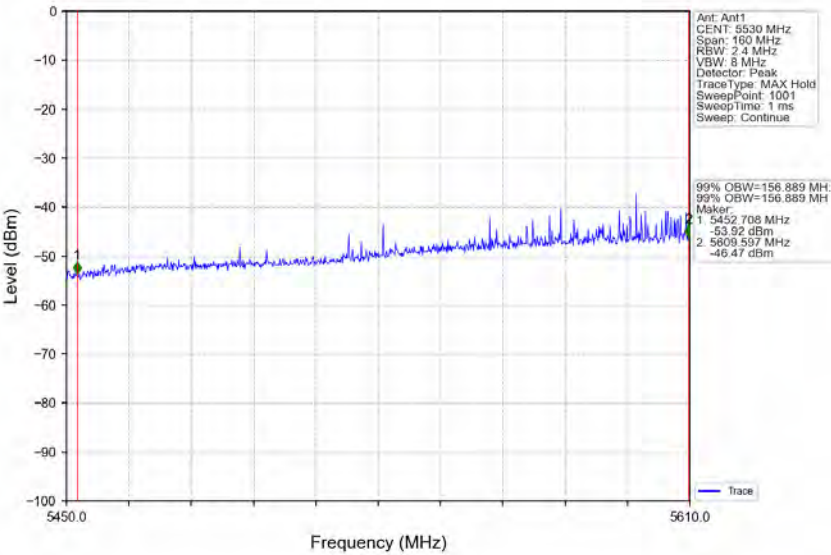

802.11ax(HEW80)_LCH_5530MHz_RU996_Left_Ant2_NTNV

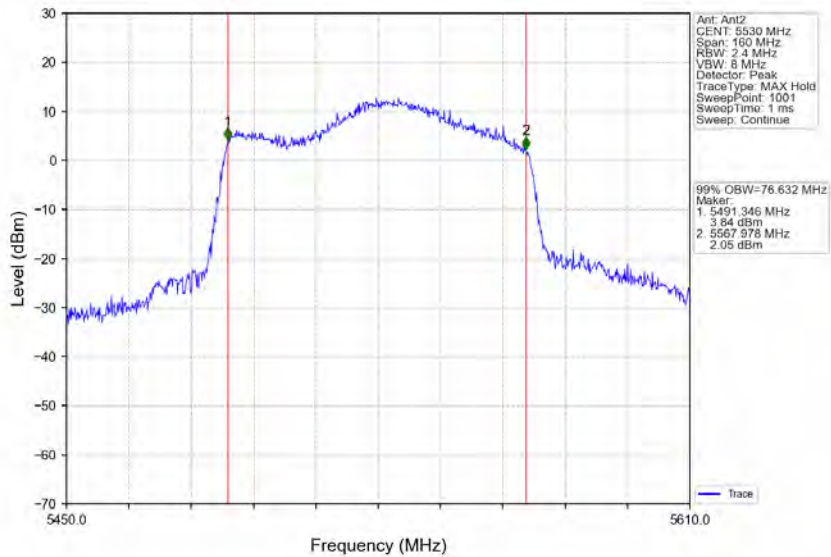


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 384 of 648


802.11ax(HEW80)_HCH_5610MHz_RU996_Left_Ant1_NTNV

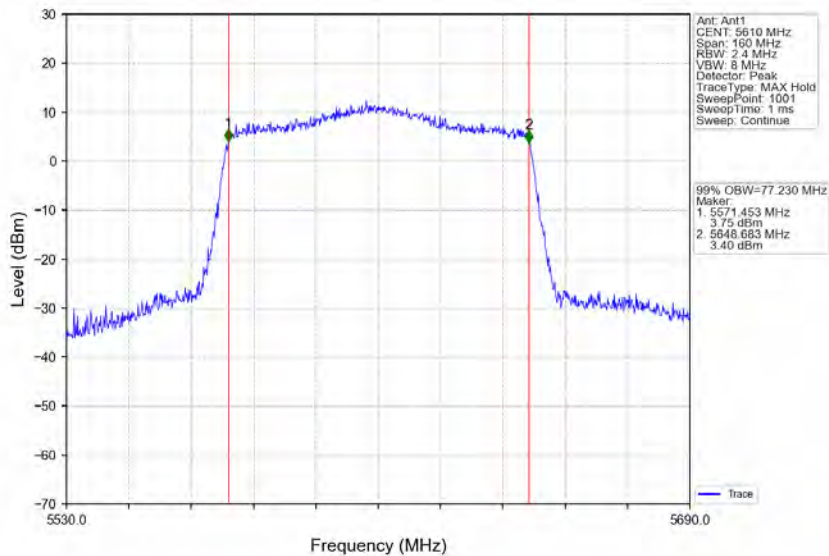


802.11ax(HEW80)_HCH_5610MHz_RU996_Left_Ant2_NTNV

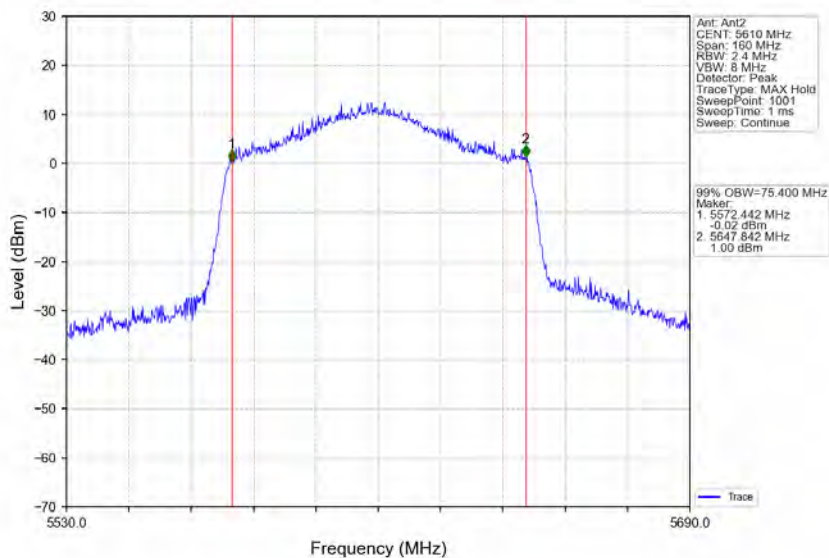

802.11ax(HEW80)_MCH_5775MHz_RU996_Left_Ant1_NTNV

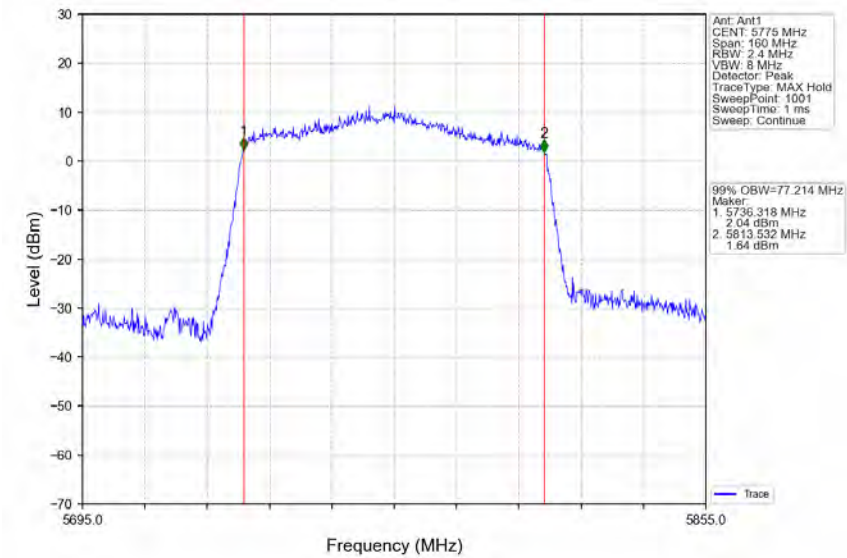

802.11ax(HEW80)_MCH_5775MHz_RU996_Left_Ant2_NTNV

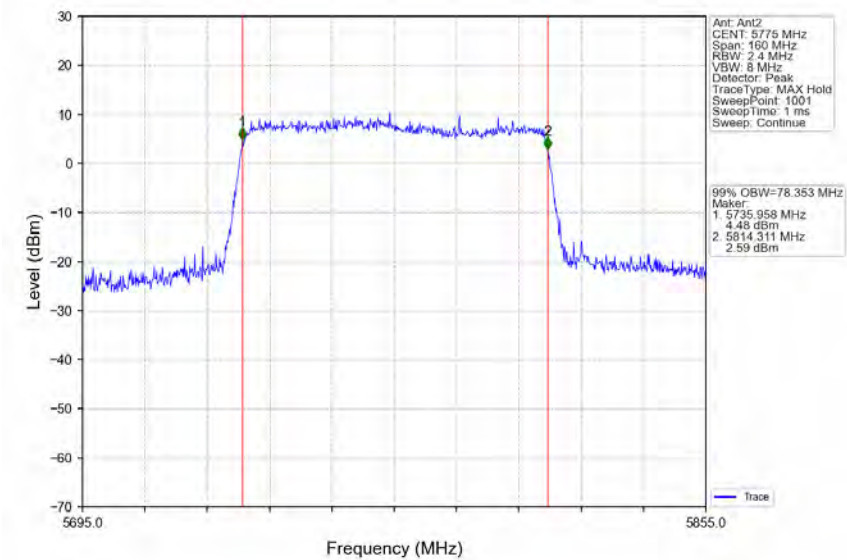



Compliance Certification Services (Kunshan) Inc.


CCSEM-TRF-001 Rev. 02 Sep 01, 2023

Report No.: KSCR240600100002


Page: 386 of 648

2.2 6dB BW


2.2.2 Test Graph

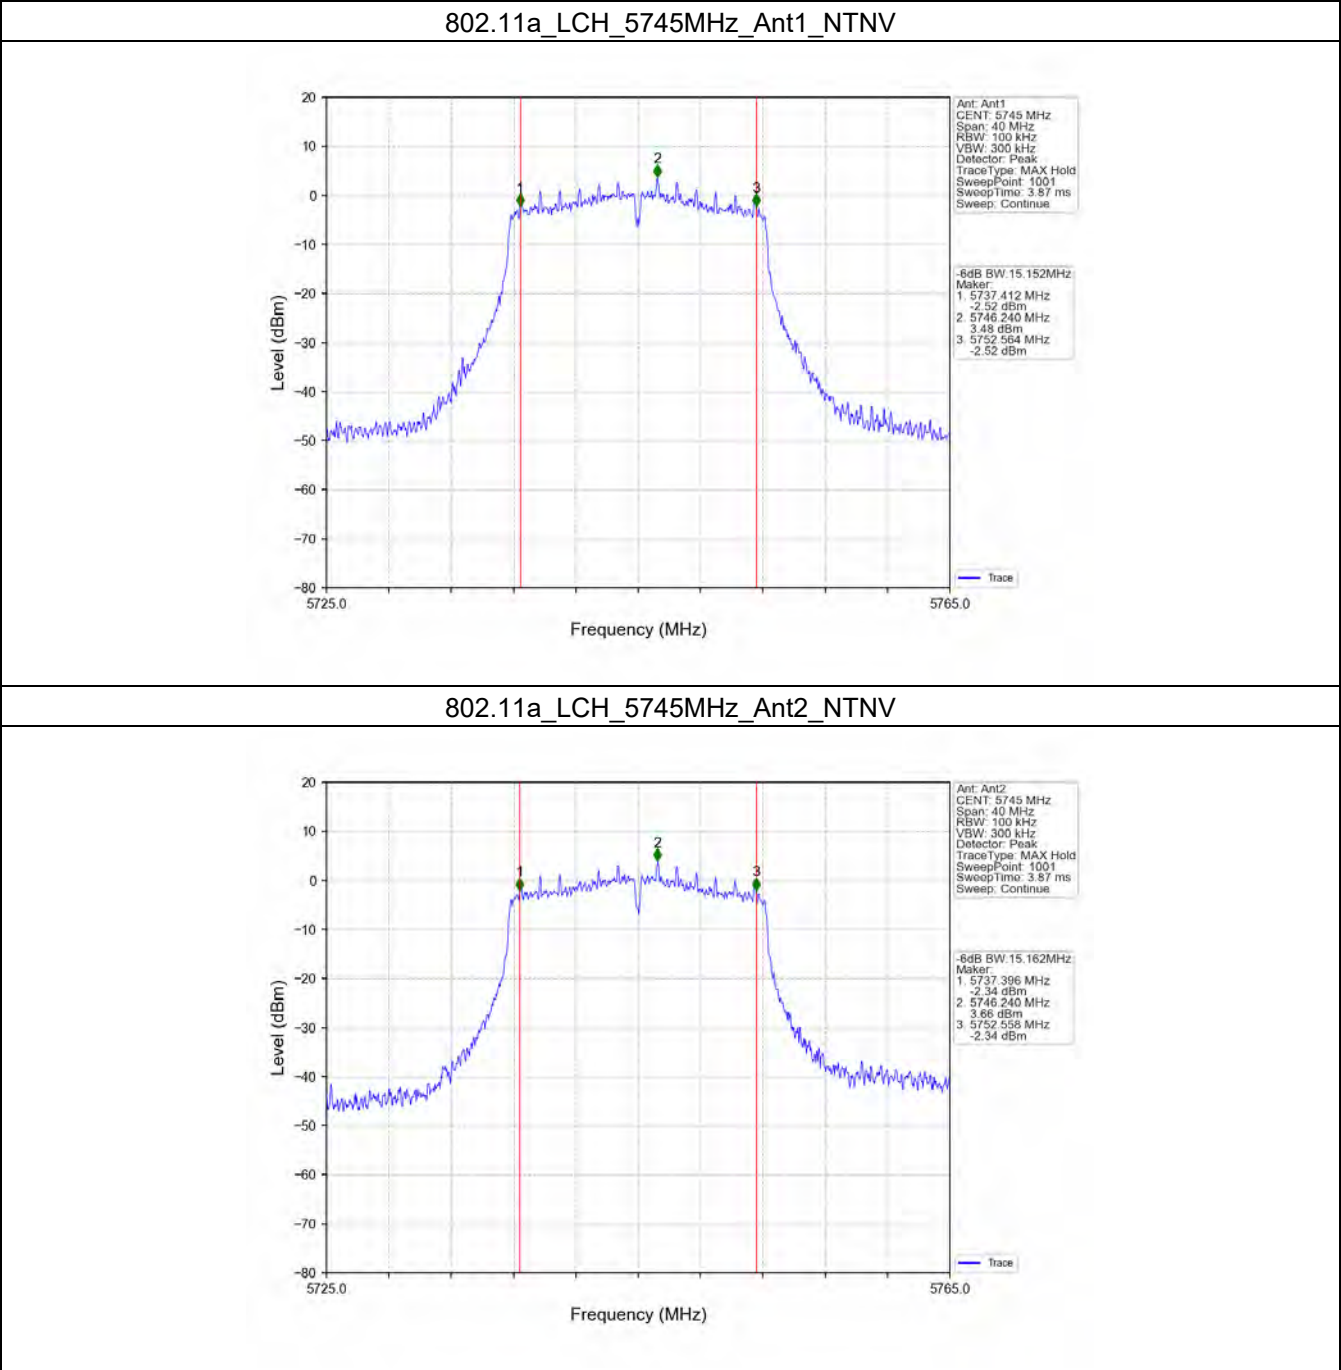


802.11a_MCH_5785MHz_Ant1_NTNV

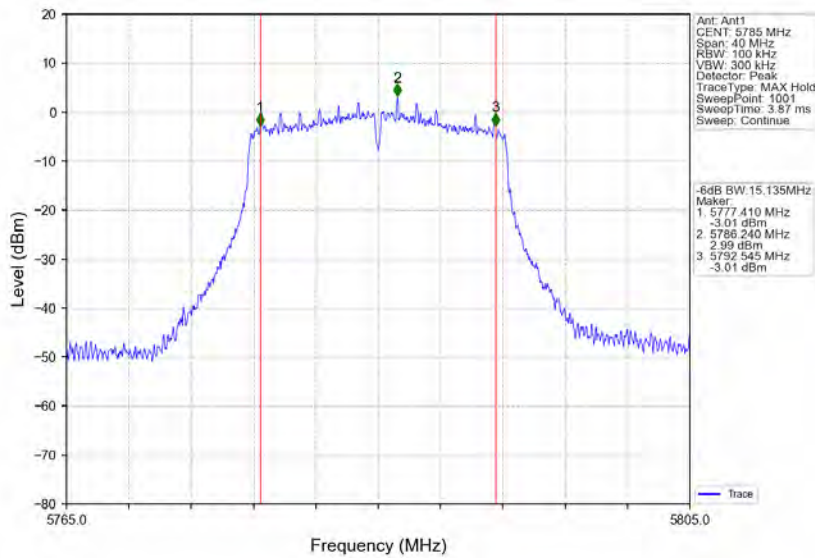


802.11a_MCH_5785MHz_Ant2_NTNV

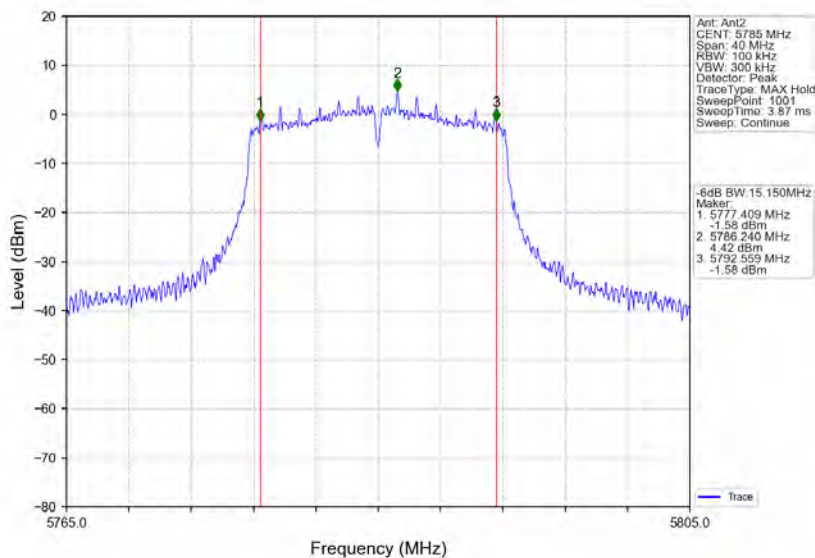


802.11a_HCH_5825MHz_Ant1_NTNV

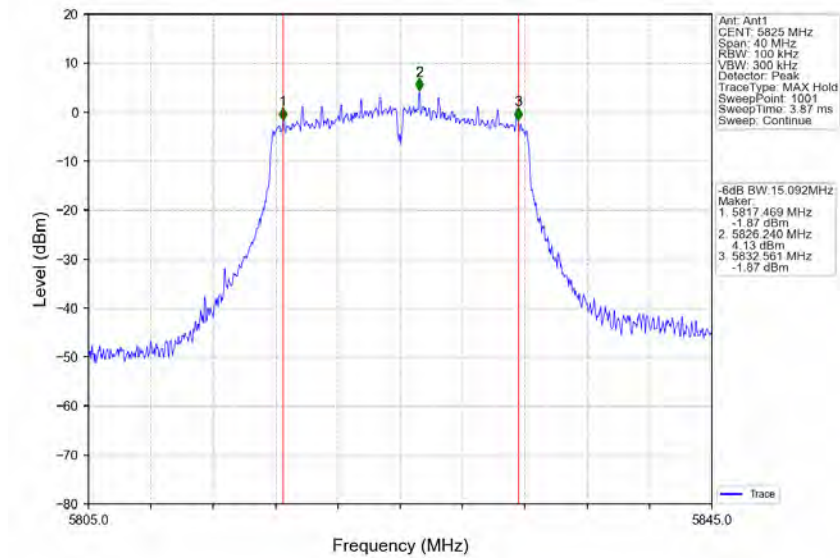


802.11a_HCH_5825MHz_Ant2_NTNV

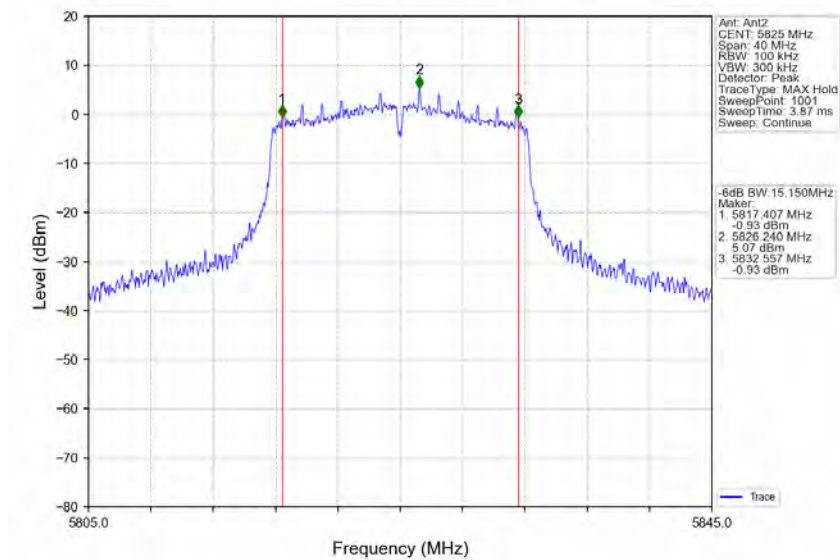

802.11n(HT20)_LCH_5745MHz_Ant1_NTNV

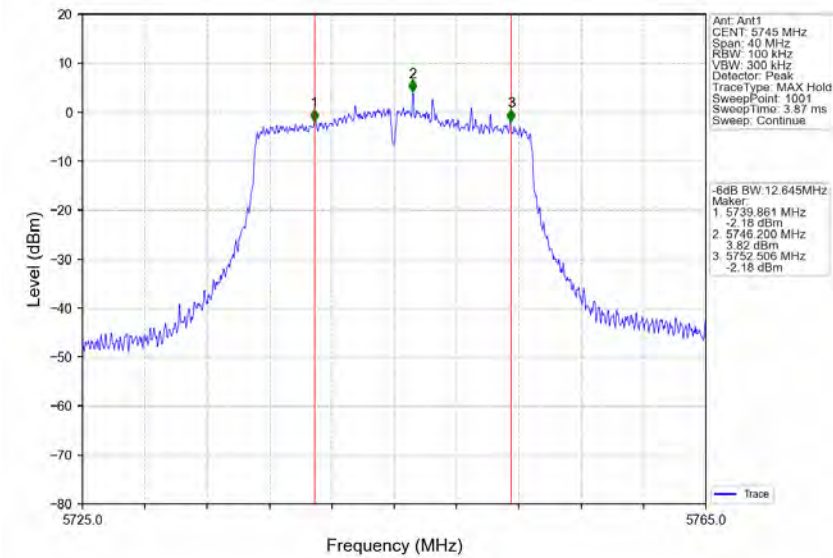

802.11n(HT20)_LCH_5745MHz_Ant2_NTNV

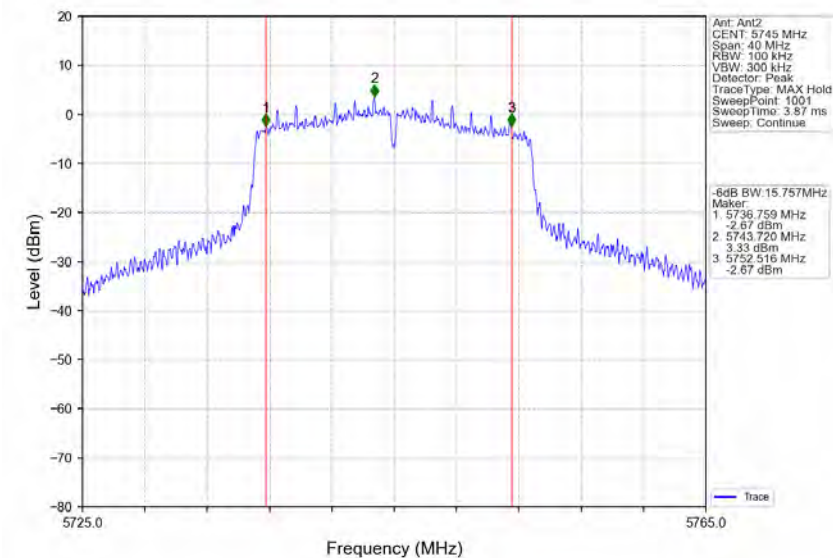


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 391 of 648


802.11n(HT20)_MCH_5785MHz_Ant1_NTNV

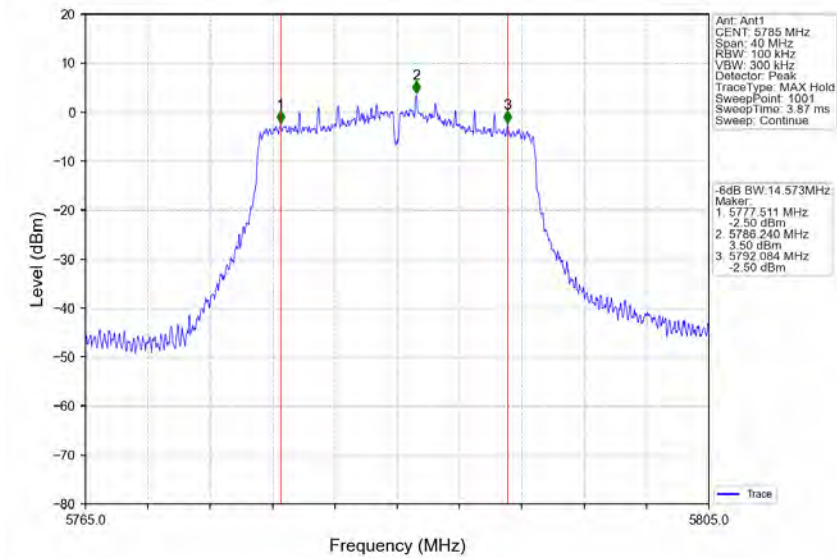


802.11n(HT20)_MCH_5785MHz_Ant2_NTNV

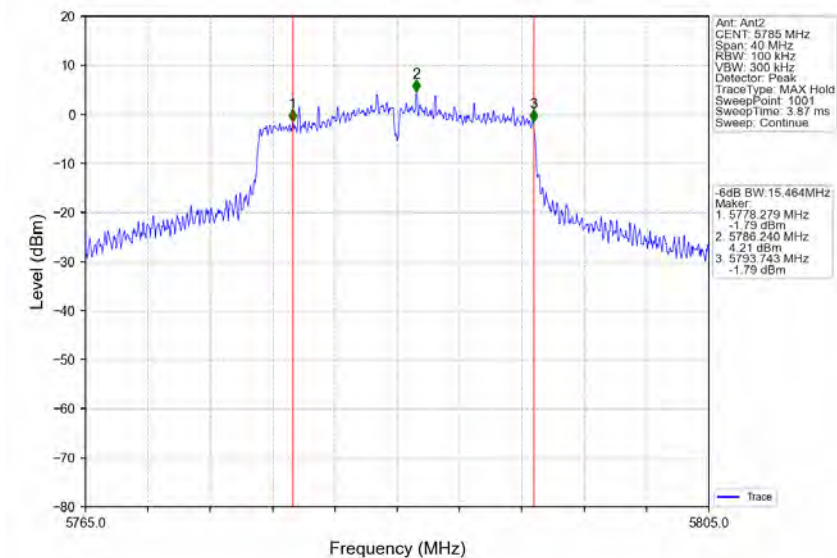


802.11n(HT20)_HCH_5825MHz_Ant1_NTNV

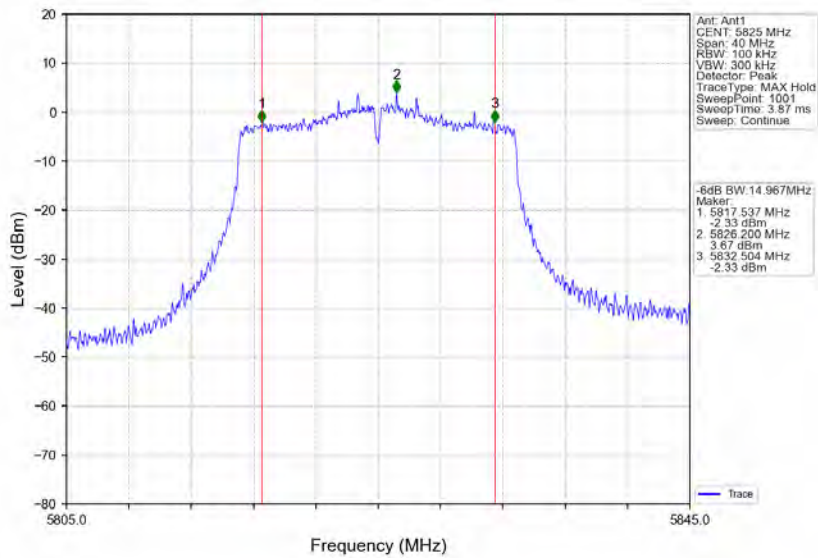


802.11n(HT20)_HCH_5825MHz_Ant2_NTNV

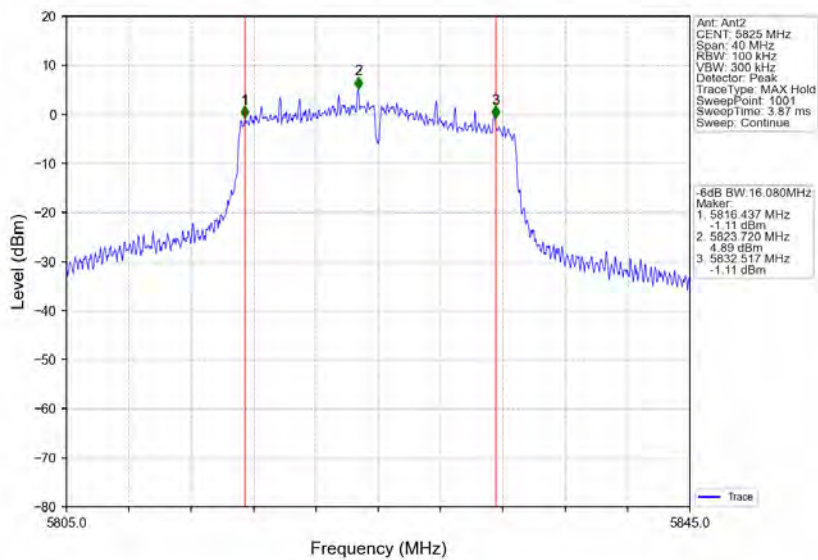


802.11n(HT40)_LCH_5755MHz_Ant1_NTNV

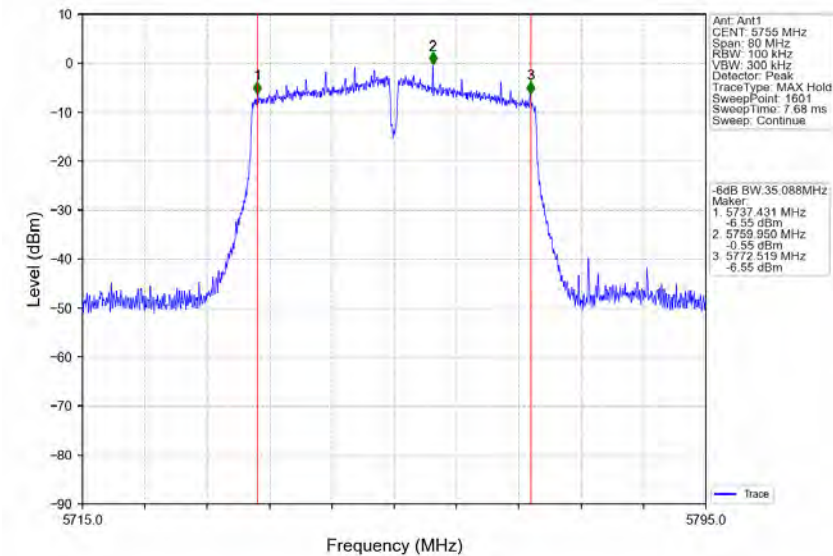


802.11n(HT40)_LCH_5755MHz_Ant2_NTNV

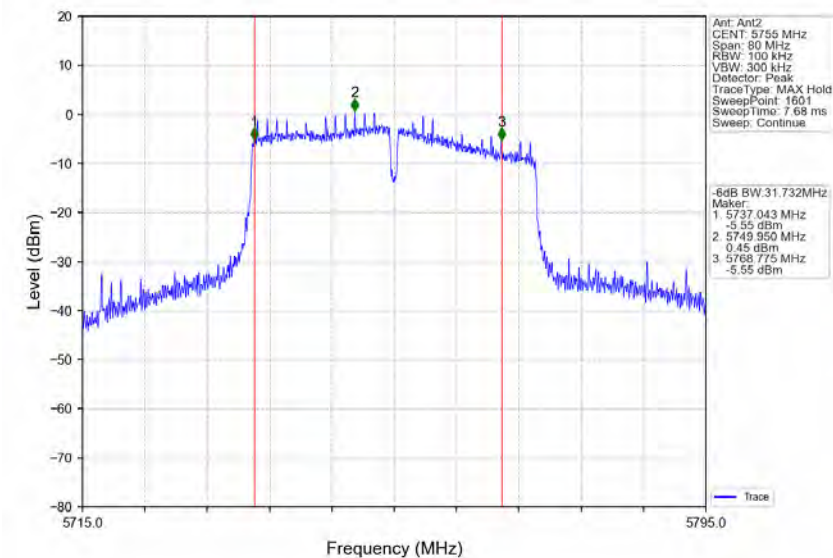

802.11n(HT40)_HCH_5795MHz_Ant1_NTNV

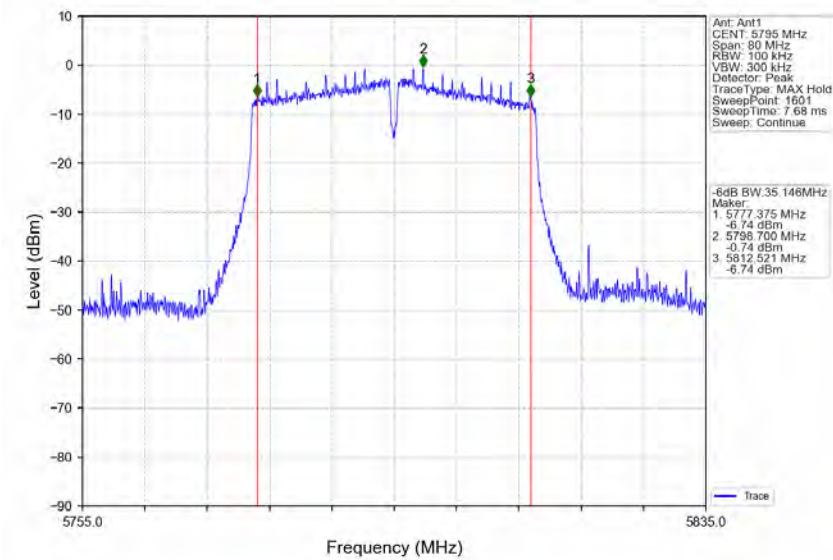

802.11n(HT40)_HCH_5795MHz_Ant2_NTNV

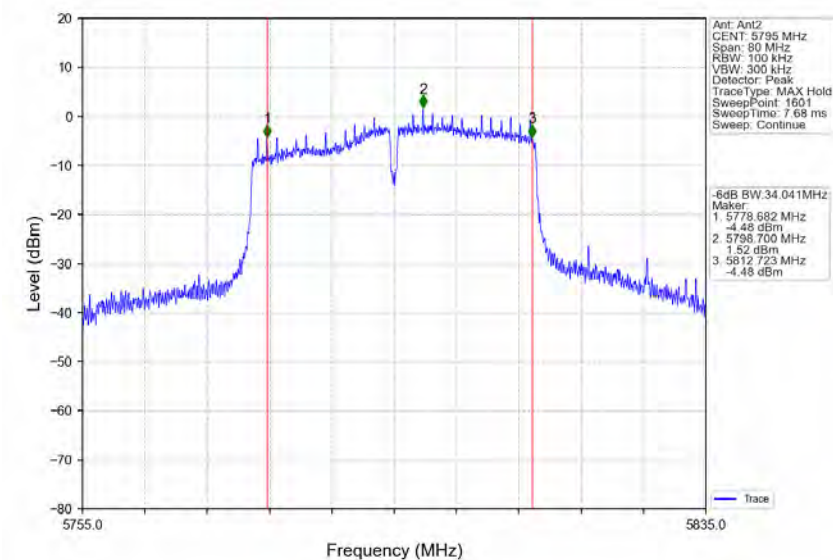


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 395 of 648

802.11ac(VHT80)_MCH_5775MHz_Ant1_NTNV

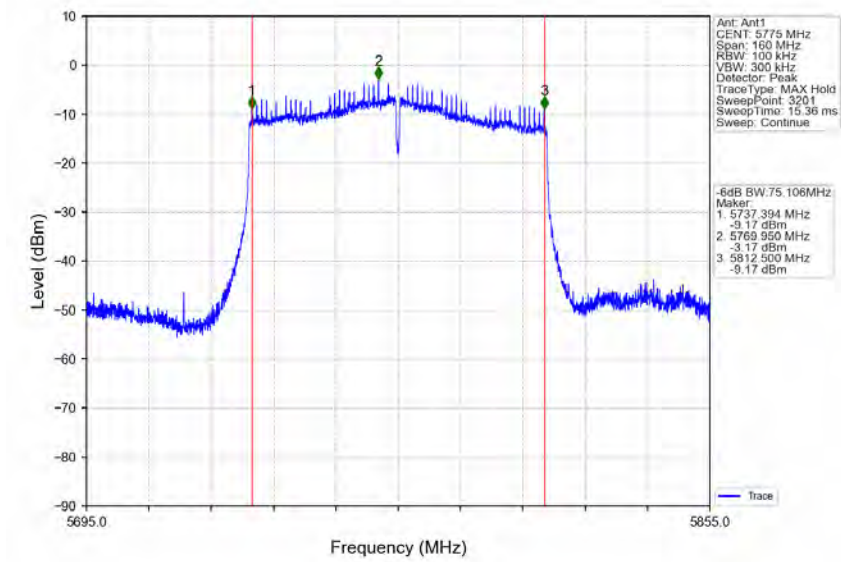

802.11ac(VHT80)_MCH_5775MHz_Ant2_NTNV

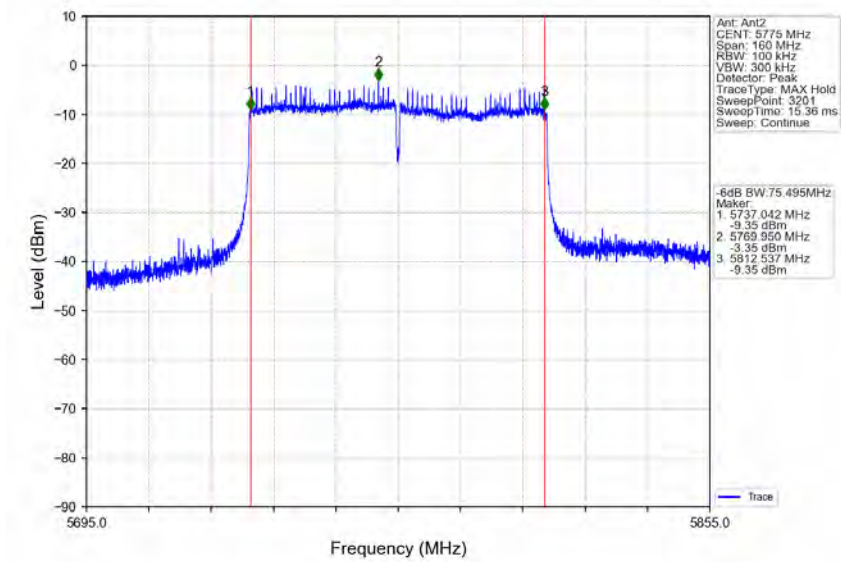


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 396 of 648


802.11ax(HEW20)_LCH_5745MHz_RU242_Left_Ant1_NTNV

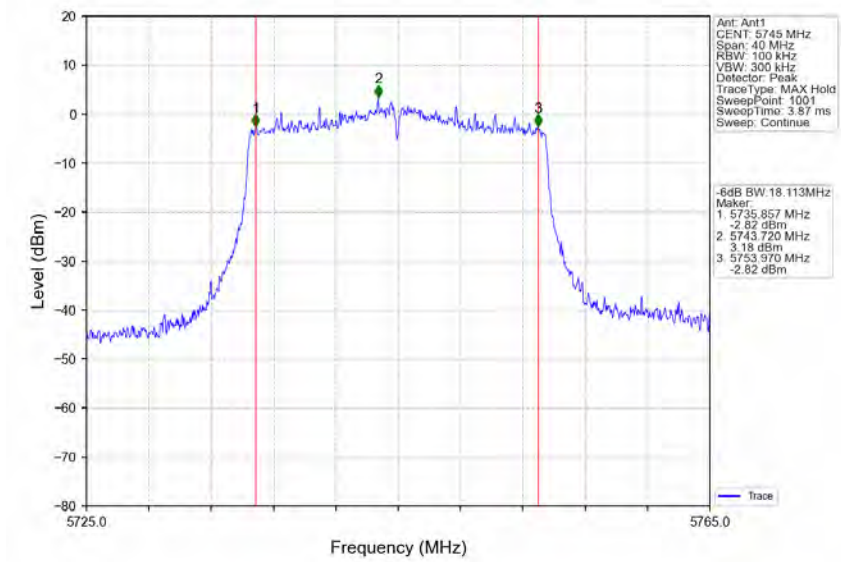


802.11ax(HEW20)_LCH_5745MHz_RU242_Left_Ant2_NTNV

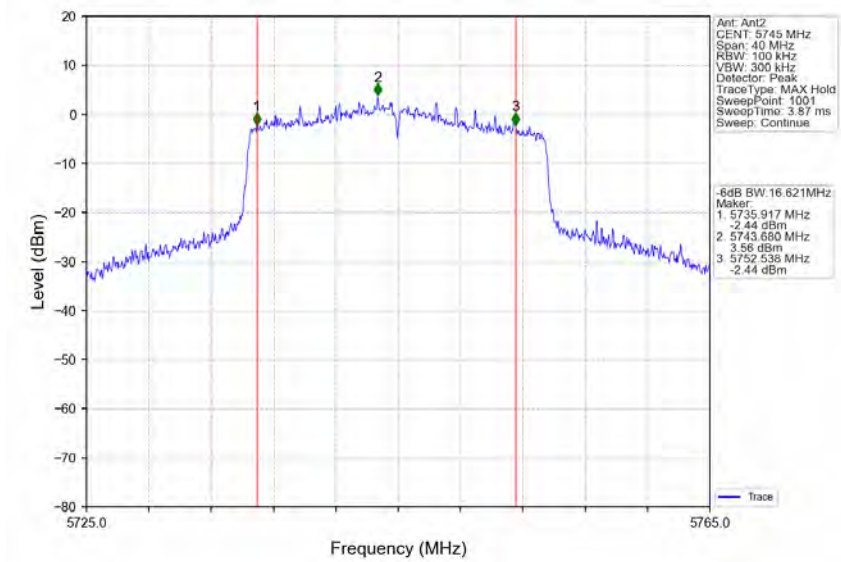


802.11ax(HEW20)_MCH_5785MHz_RU242_Left_Ant1_NTNV

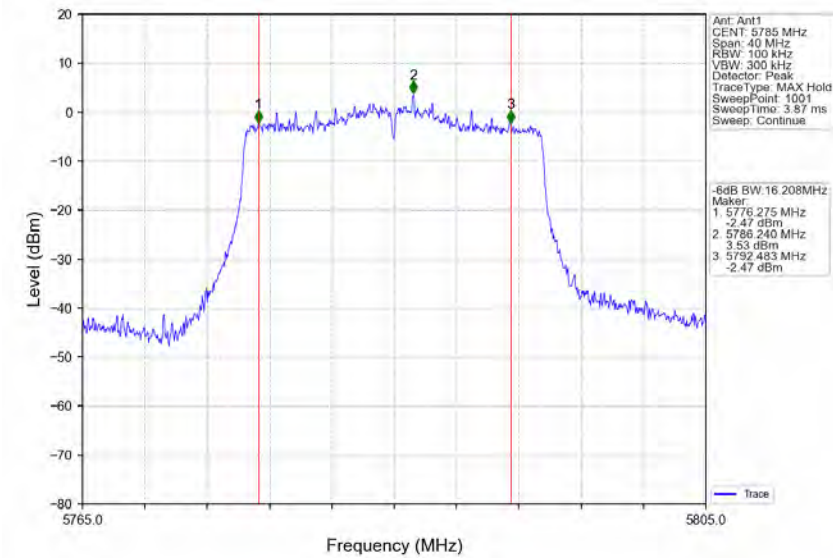


802.11ax(HEW20)_MCH_5785MHz_RU242_Left_Ant2_NTNV

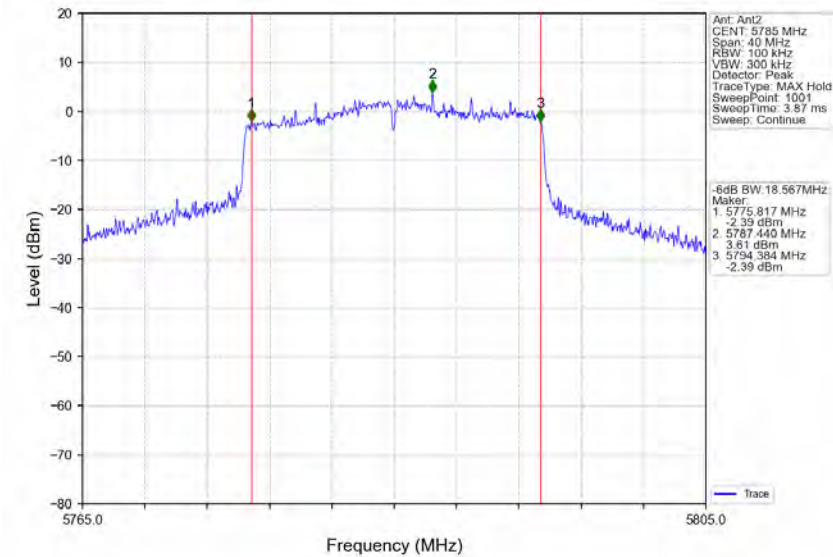

802.11ax(HEW20)_HCH_5825MHz_RU242_Left_Ant1_NTNV

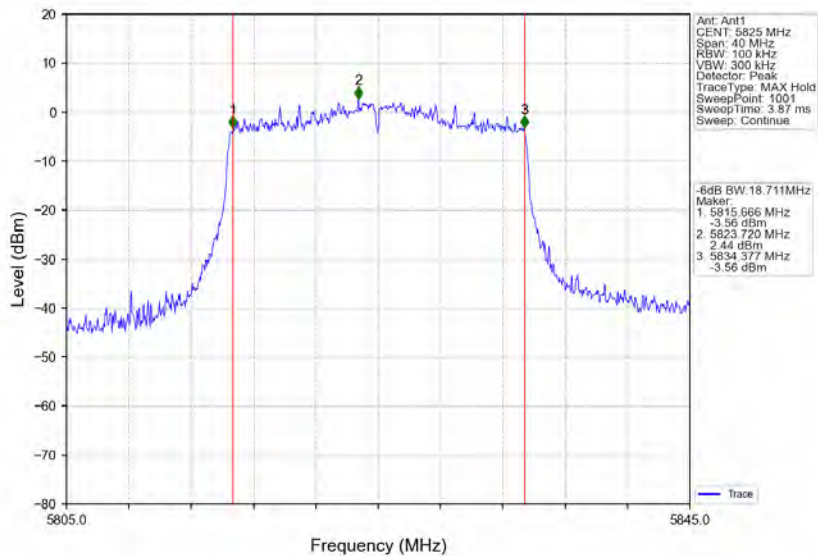

802.11ax(HEW20)_HCH_5825MHz_RU242_Left_Ant2_NTNV

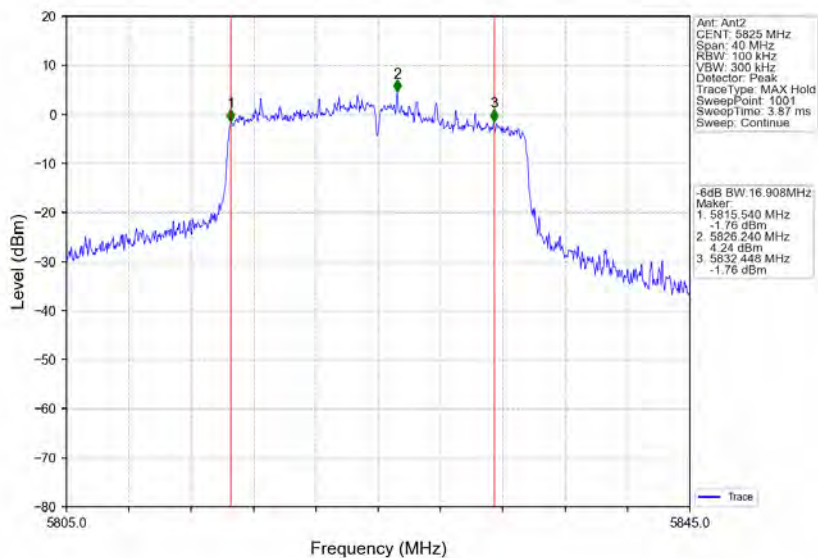


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 399 of 648


802.11ax(HEW40)_LCH_5755MHz_RU484_Left_Ant1_NTNV

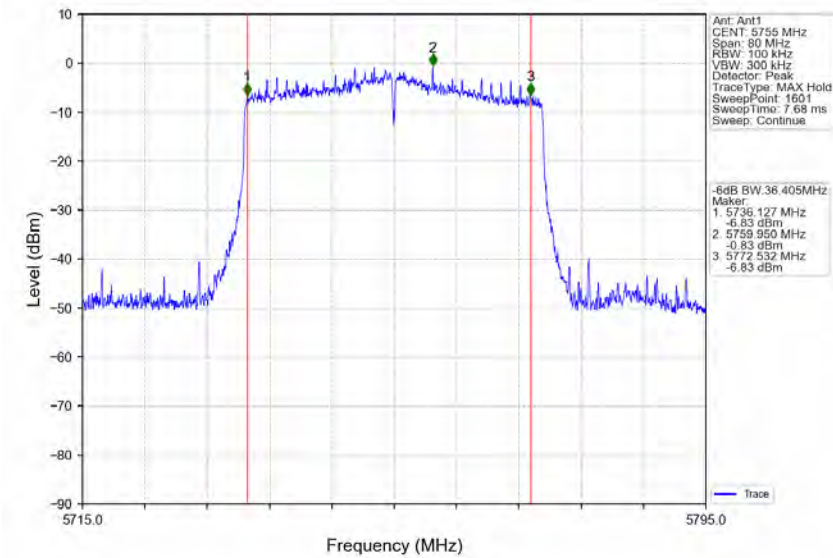


802.11ax(HEW40)_LCH_5755MHz_RU484_Left_Ant2_NTNV

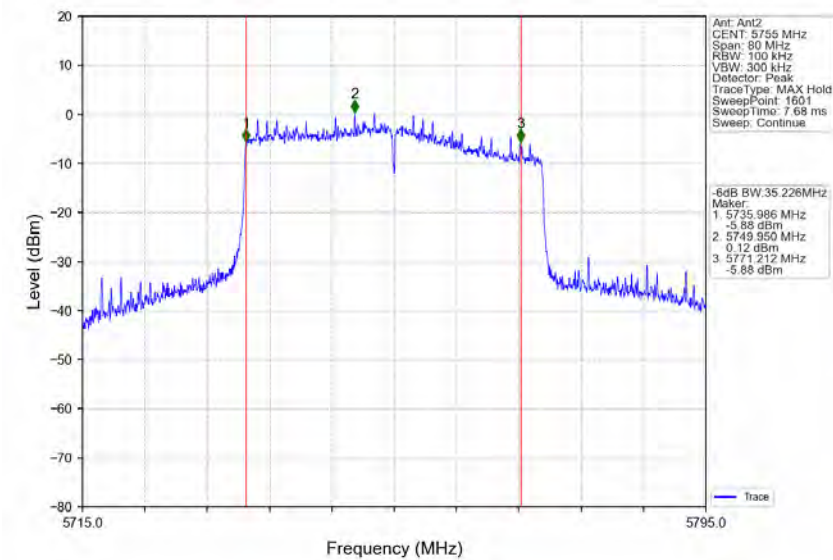


802.11ax(HEW40)_HCH_5795MHz_RU484_Left_Ant1_NTNV

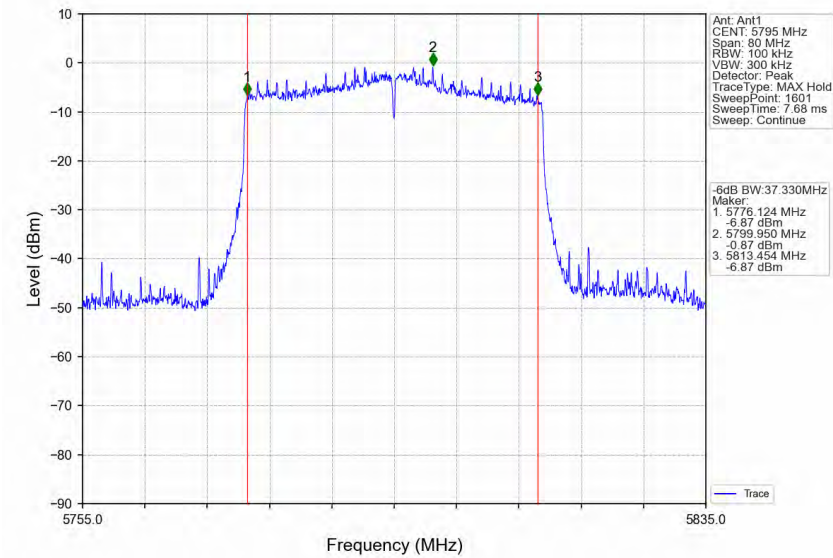


802.11ax(HEW40)_HCH_5795MHz_RU484_Left_Ant2_NTNV

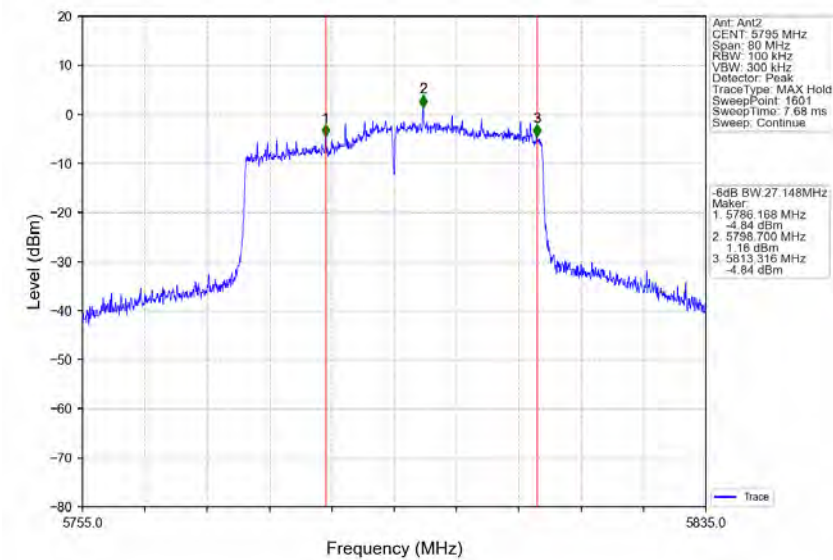


802.11ax(HEW80)_MCH_5775MHz_RU996_Left_Ant1_NTNV

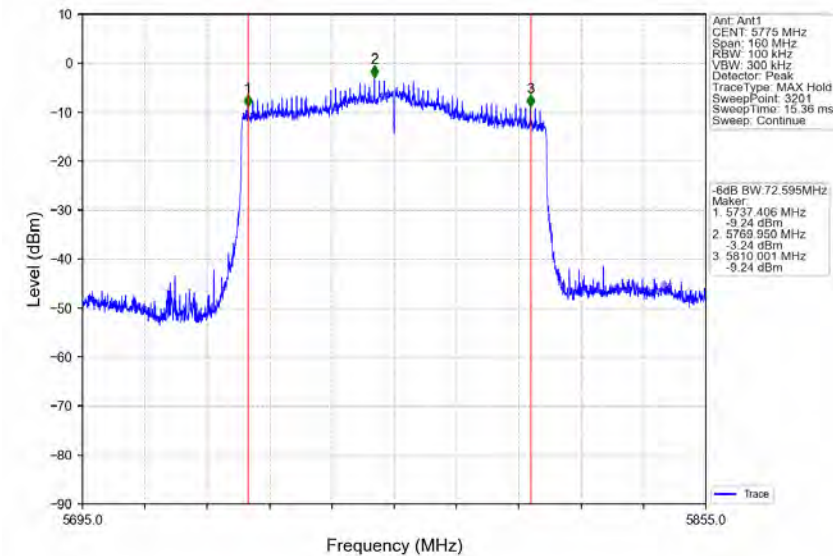


802.11ax(HEW80)_MCH_5775MHz_RU996_Left_Ant2_NTNV

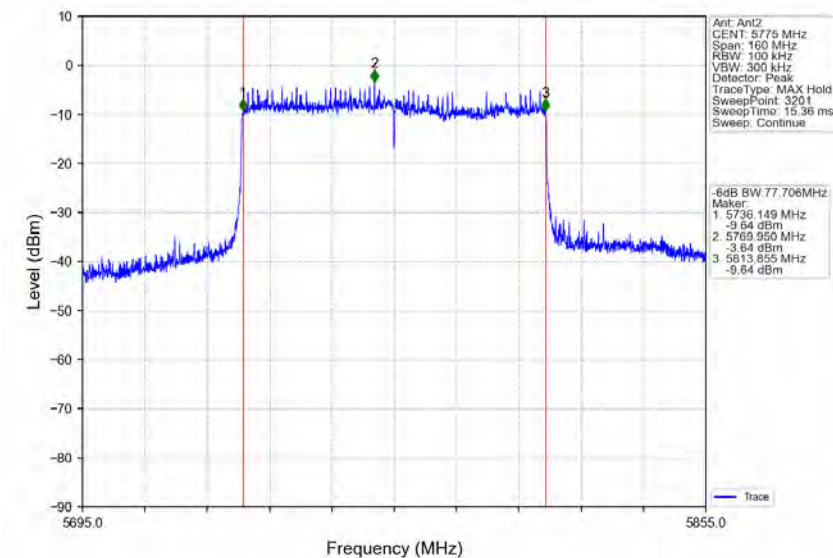


2.3.2 Test Graph

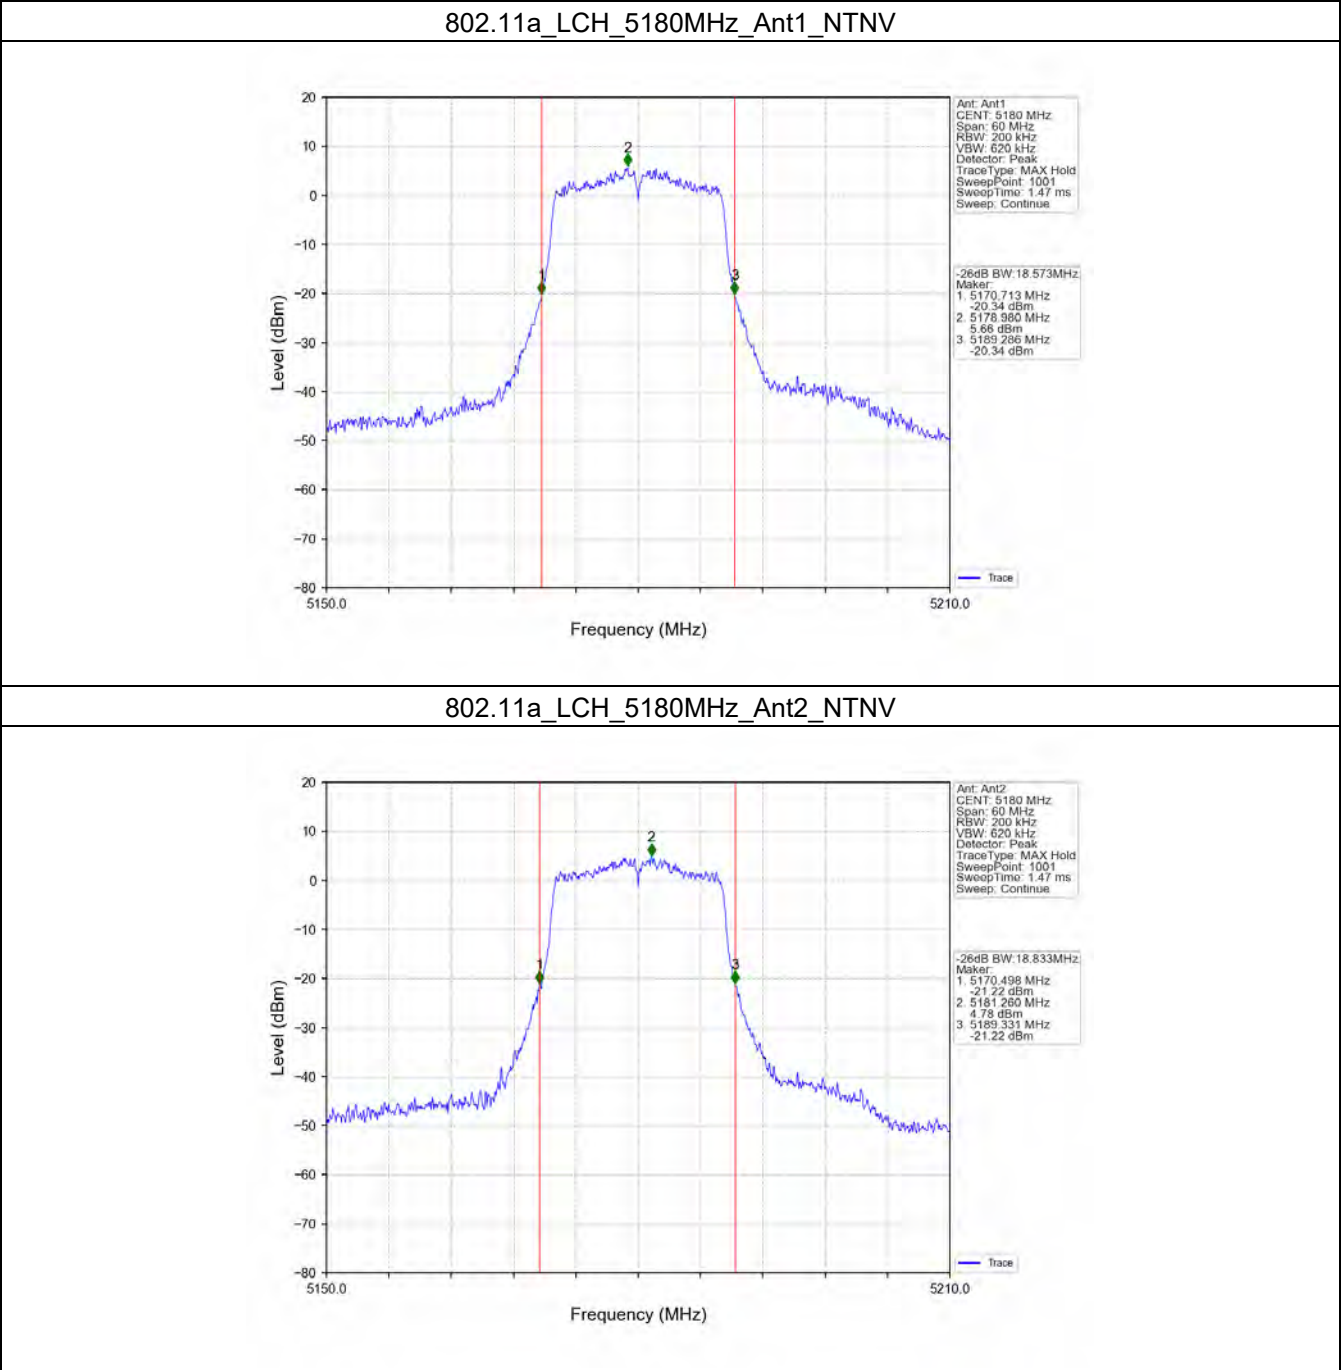

802.11a_MCH_5200MHz_Ant1_NTNV

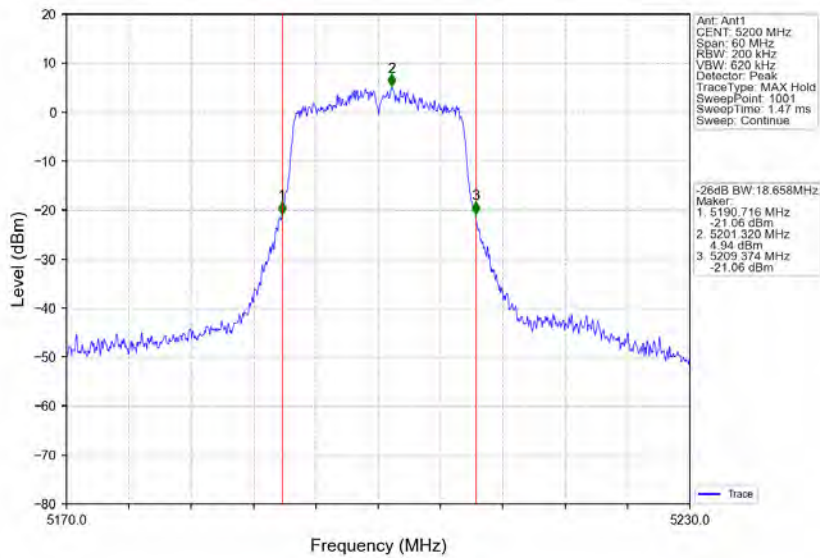

802.11a_MCH_5200MHz_Ant2_NTNV

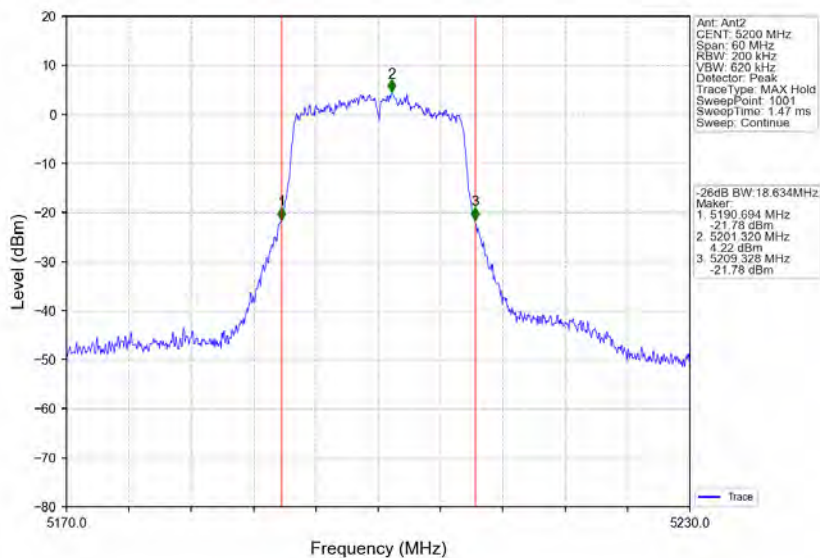


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 404 of 648

802.11a_HCH_5240MHz_Ant1_NTNV

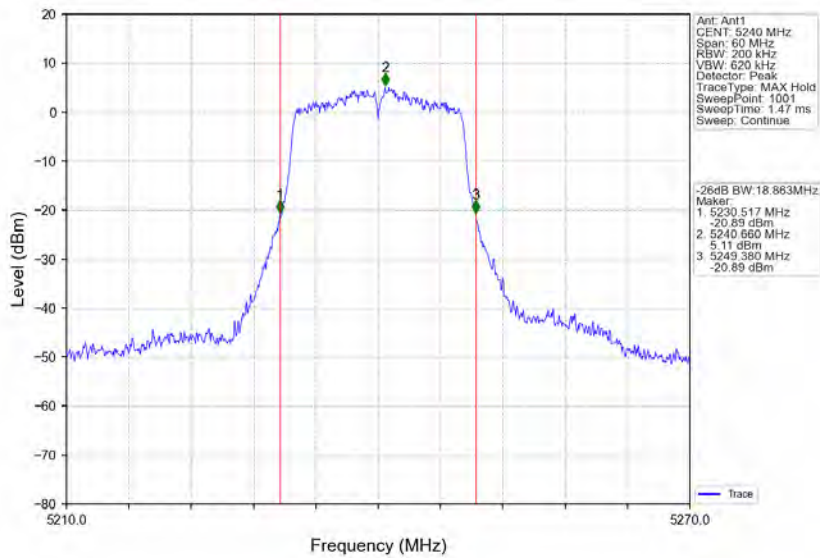

802.11a_HCH_5240MHz_Ant2_NTNV

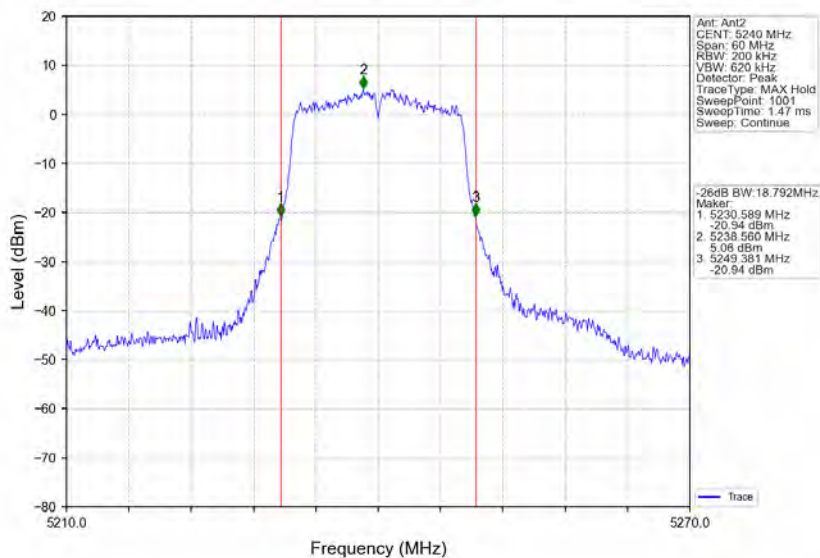


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 405 of 648

802.11a_LCH_5260MHz_Ant1_NTNV

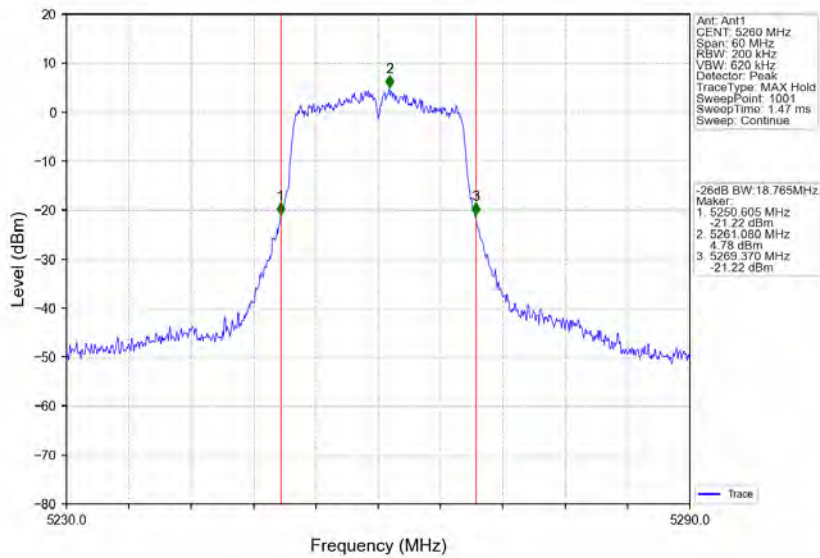

802.11a_LCH_5260MHz_Ant2_NTNV

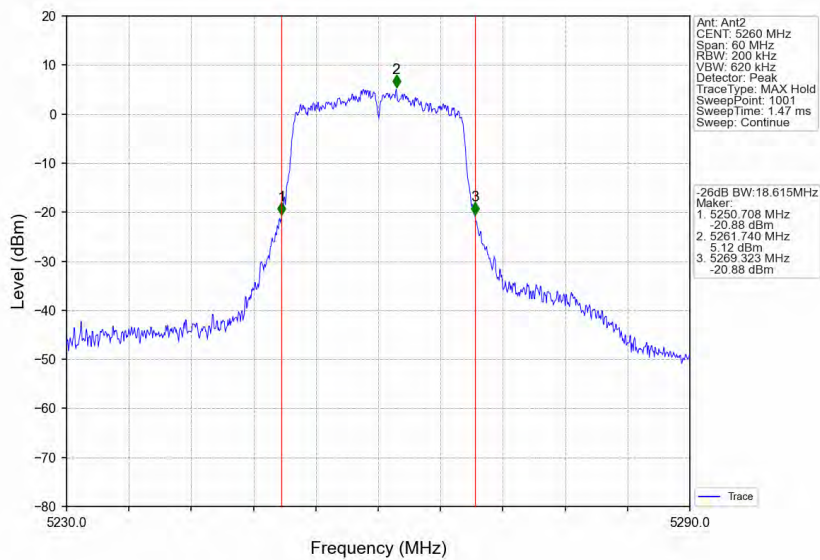


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 406 of 648

802.11a_MCH_5300MHz_Ant1_NTNV

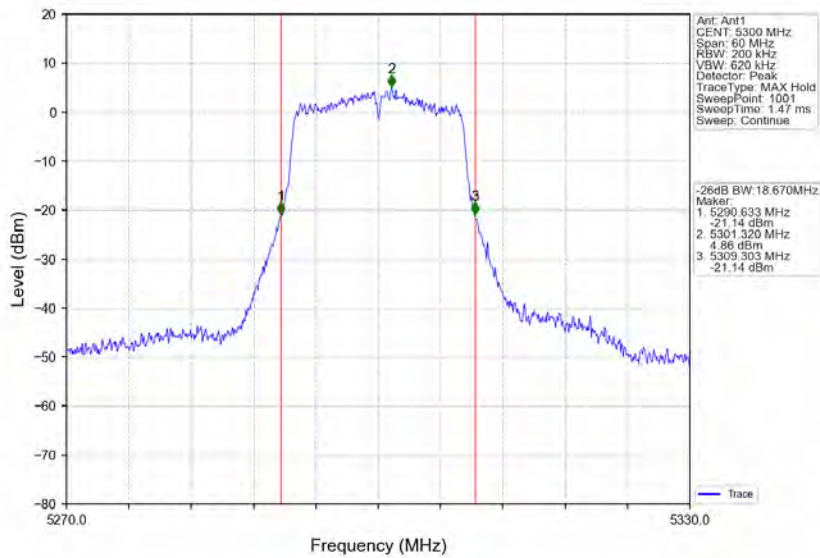

802.11a_MCH_5300MHz_Ant2_NTNV

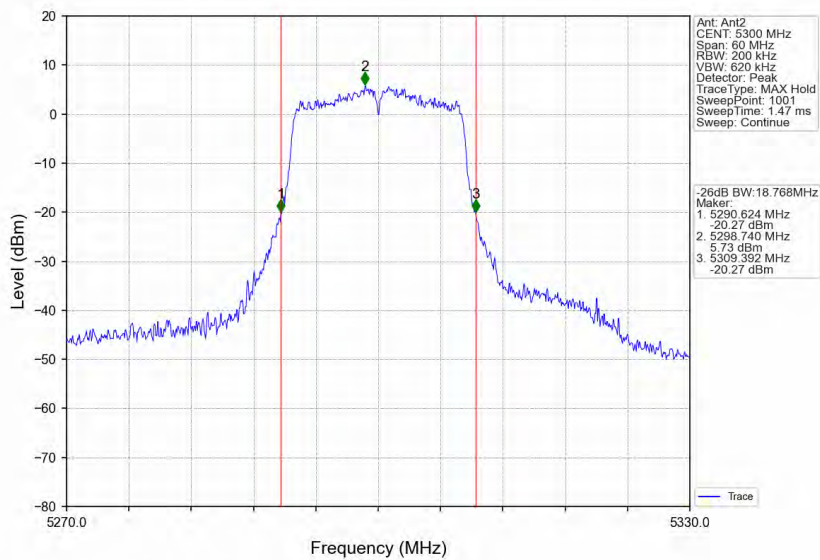


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 407 of 648

802.11a_HCH_5320MHz_Ant1_NTNV

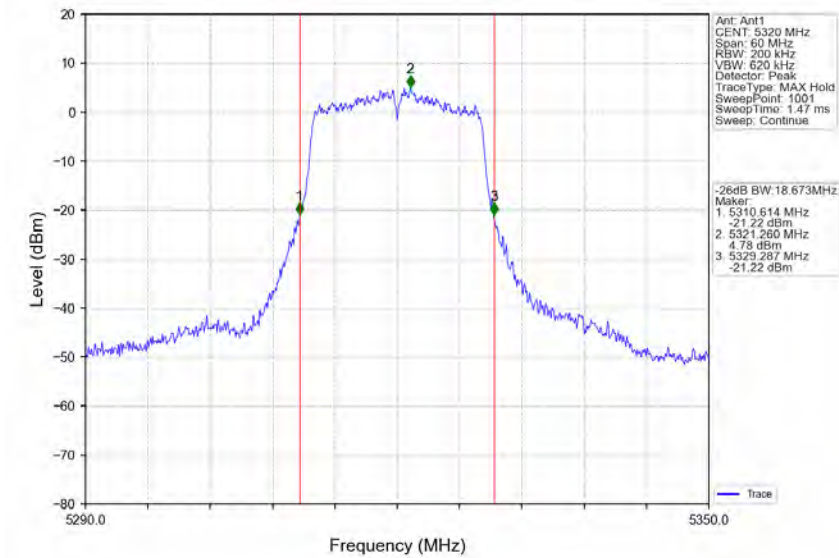

802.11a_HCH_5320MHz_Ant2_NTNV

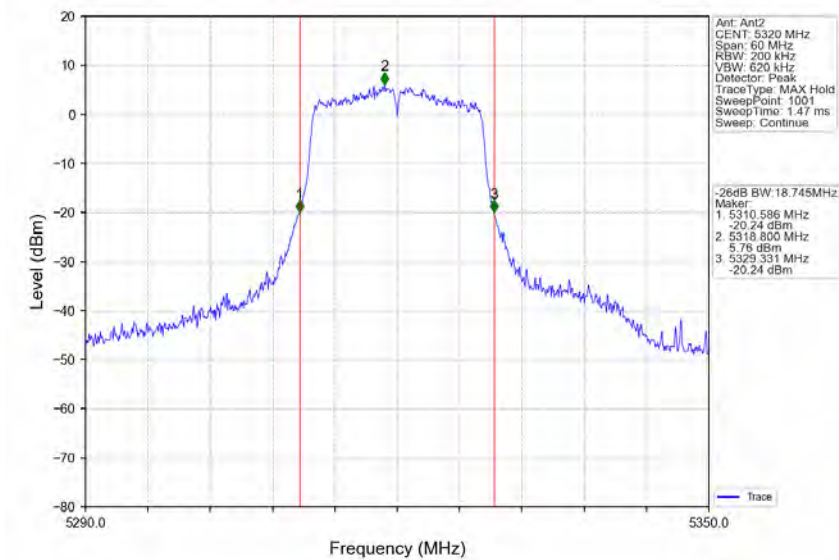


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 408 of 648


802.11a_LCH_5500MHz_Ant1_NTNV

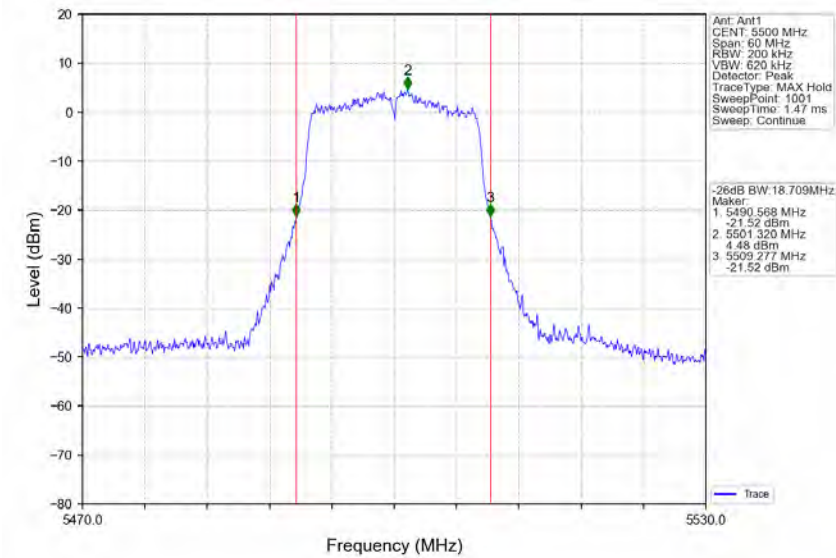


802.11a_LCH_5500MHz_Ant2_NTNV

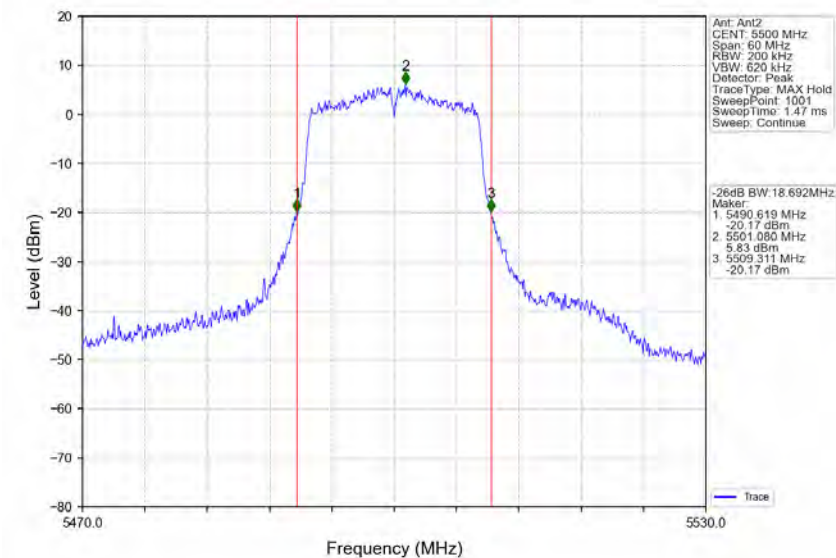

802.11a_MCH_5580MHz_Ant1_NTNV

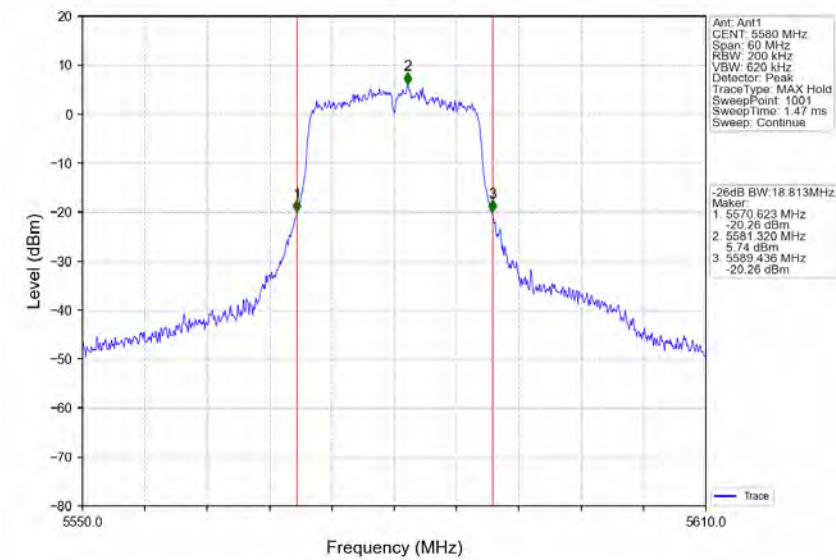

802.11a_MCH_5580MHz_Ant2_NTNV

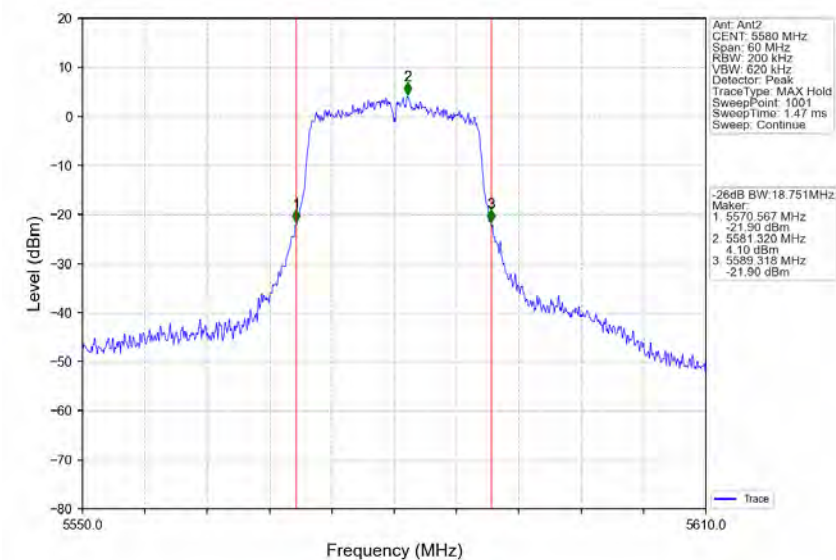


Compliance Certification Services (Kunshan) Inc.

CCSEM-TRF-001 Rev. 02 Sep 01, 2023


Report No.: KSCR240600100002

Page: 410 of 648


802.11a_HCH_5700MHz_Ant1_NTNV

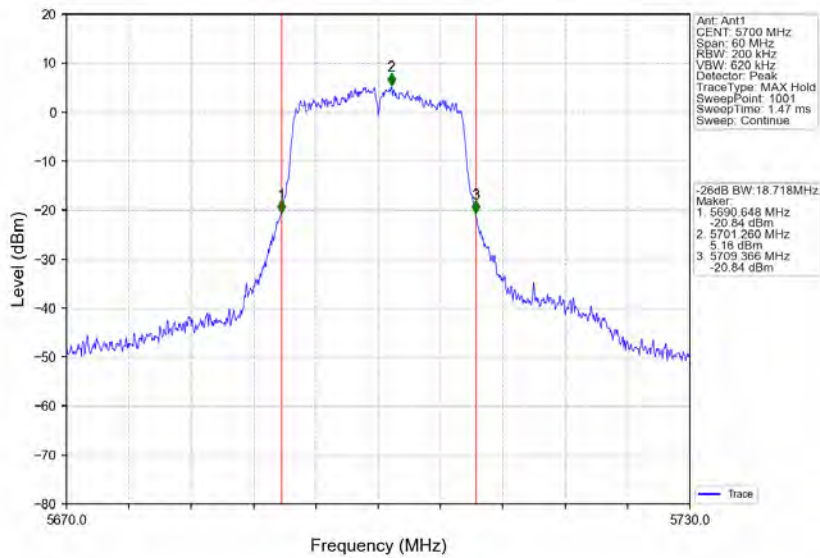


802.11a_HCH_5700MHz_Ant2_NTNV

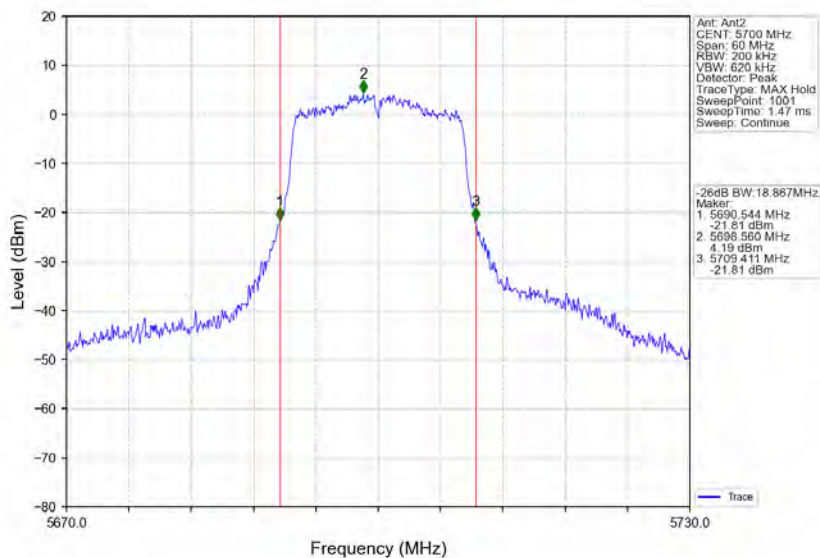


802.11n(HT20)_LCH_5180MHz_Ant1_NTNV

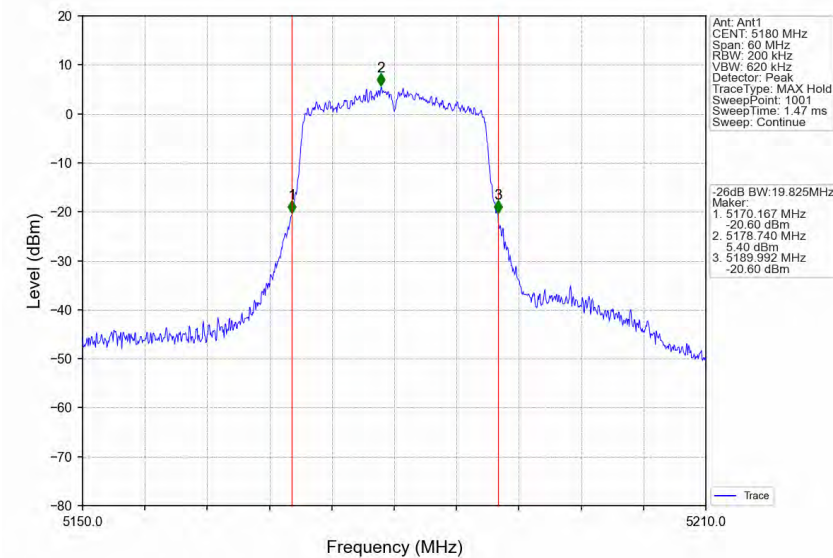


802.11n(HT20)_LCH_5180MHz_Ant2_NTNV

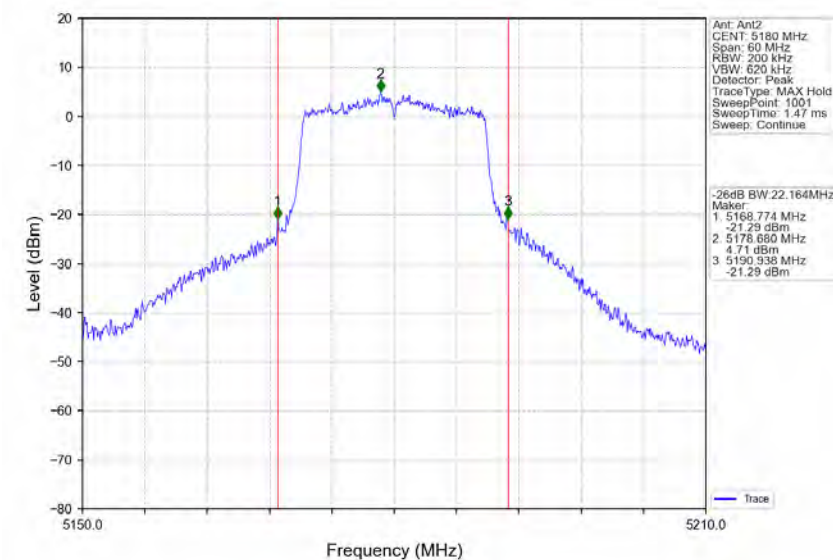


802.11n(HT20)_MCH_5200MHz_Ant1_NTNV

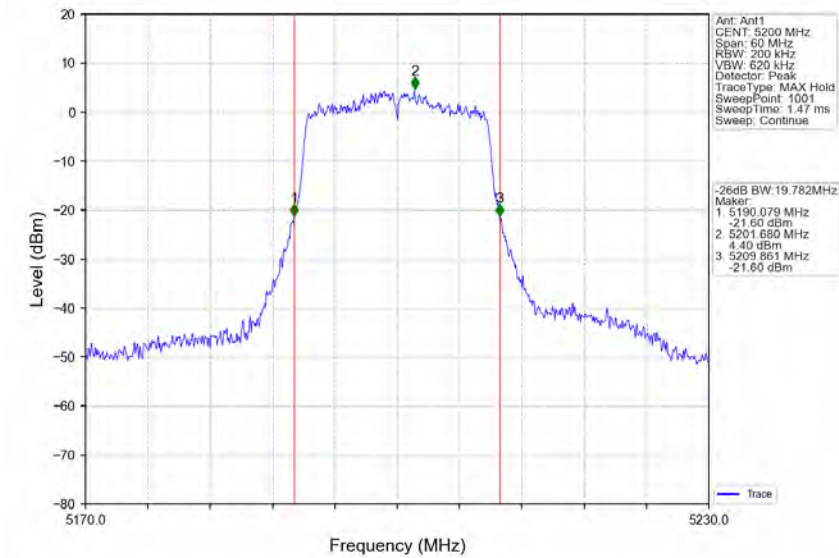


802.11n(HT20)_MCH_5200MHz_Ant2_NTNV

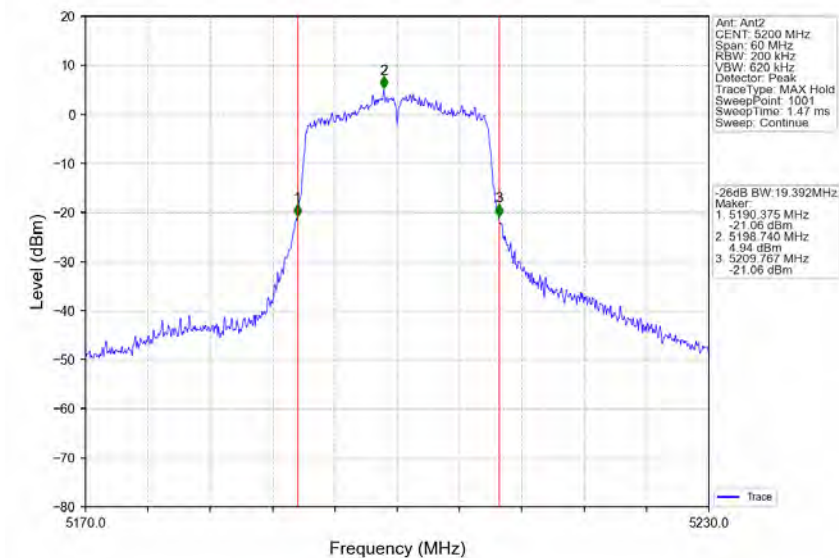


802.11n(HT20)_HCH_5240MHz_Ant1_NTNV

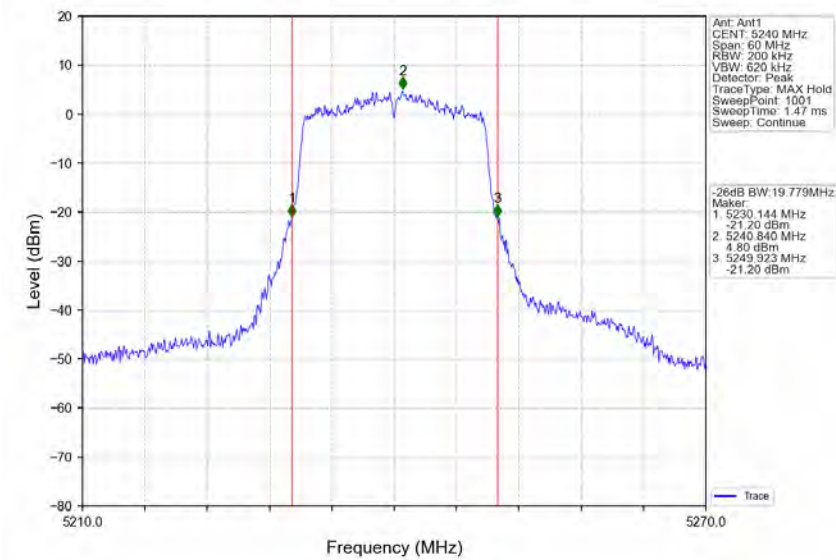


802.11n(HT20)_HCH_5240MHz_Ant2_NTNV

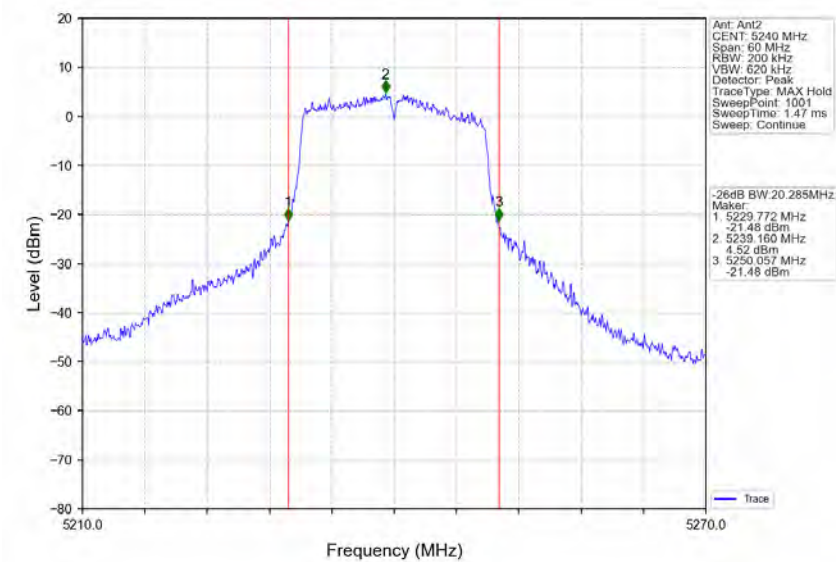


802.11n(HT20)_LCH_5260MHz_Ant1_NTNV

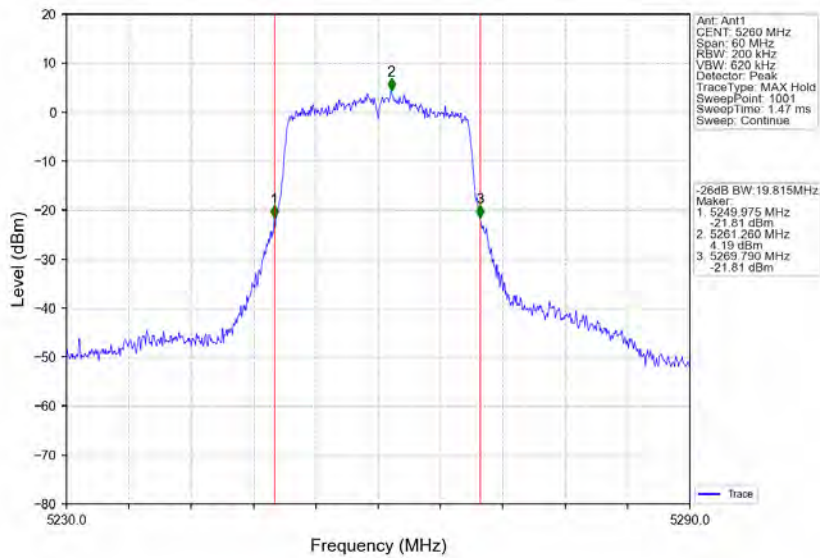


802.11n(HT20)_LCH_5260MHz_Ant2_NTNV

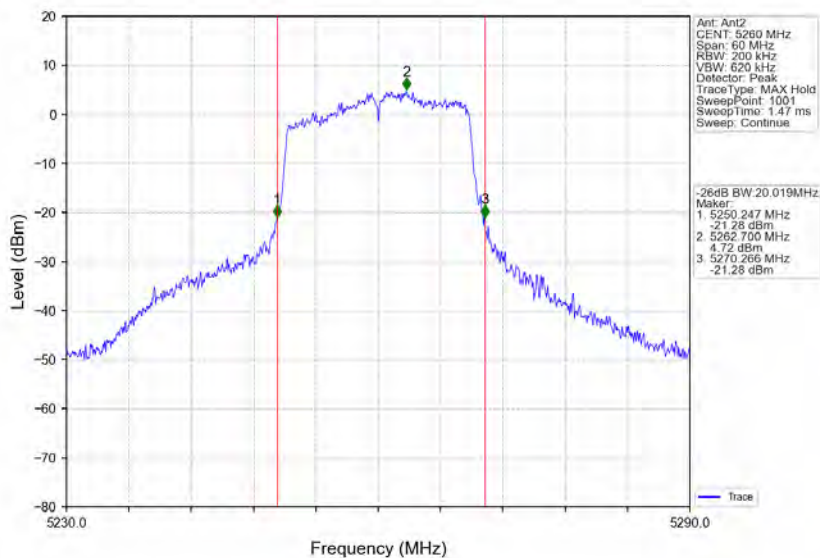


802.11n(HT20)_MCH_5300MHz_Ant1_NTNV

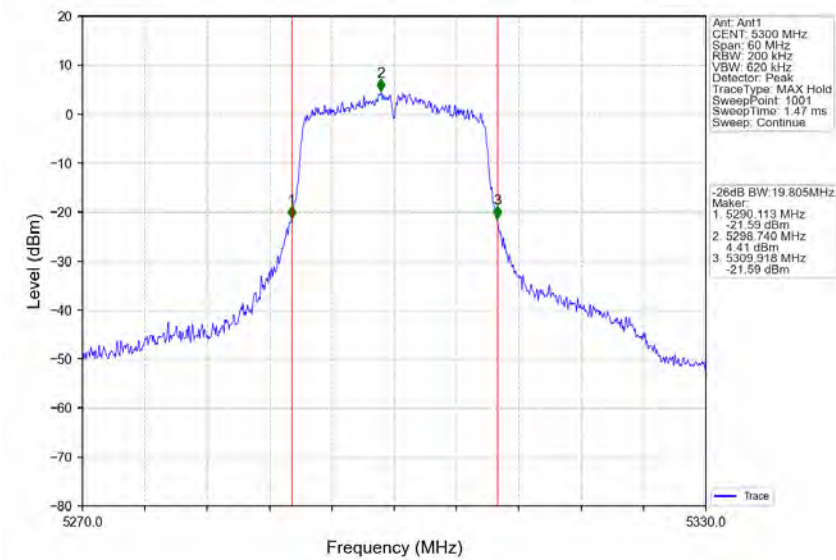


802.11n(HT20)_MCH_5300MHz_Ant2_NTNV

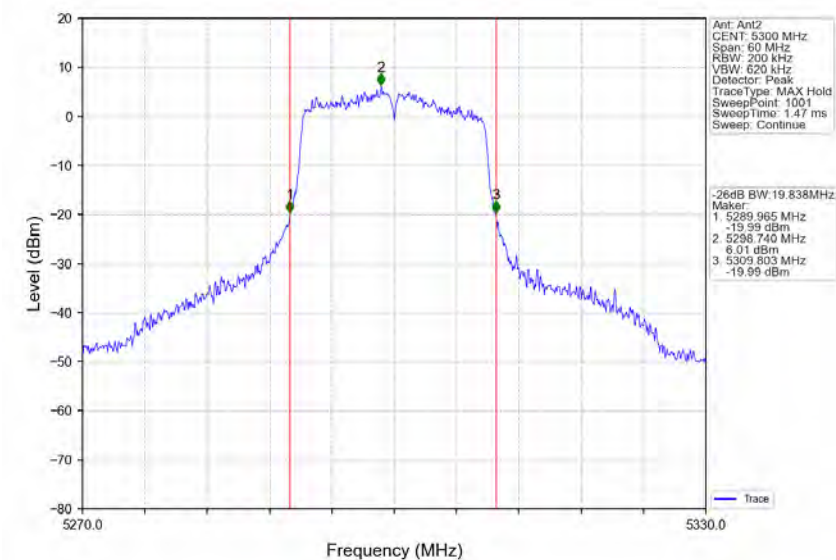


802.11n(HT20)_HCH_5320MHz_Ant1_NTNV

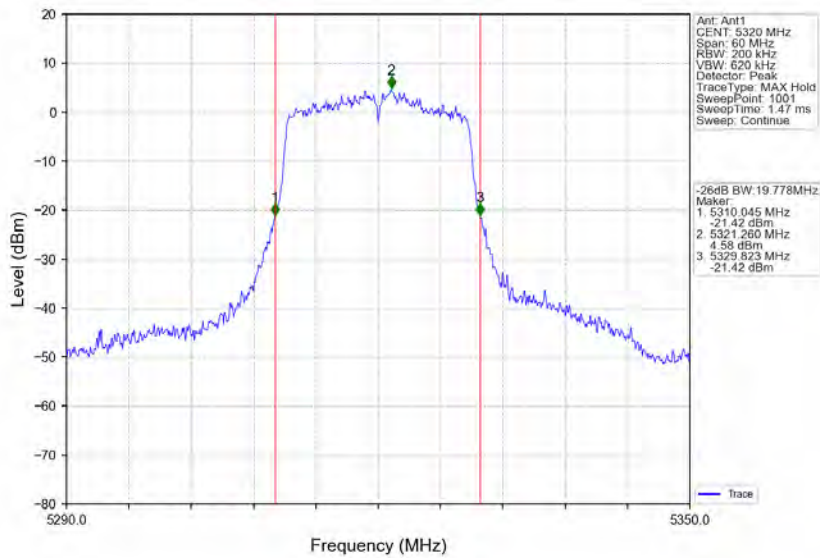

802.11n(HT20)_HCH_5320MHz_Ant2_NTNV

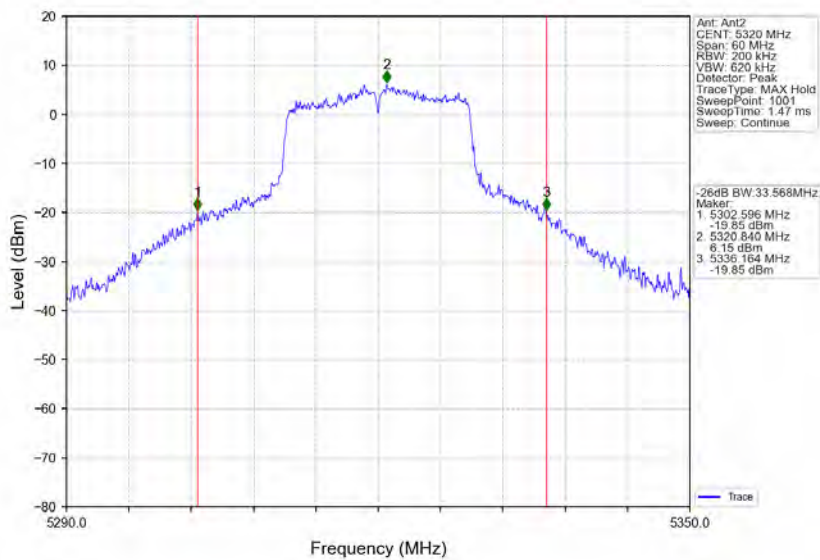

802.11n(HT20)_LCH_5500MHz_Ant1_NTNV

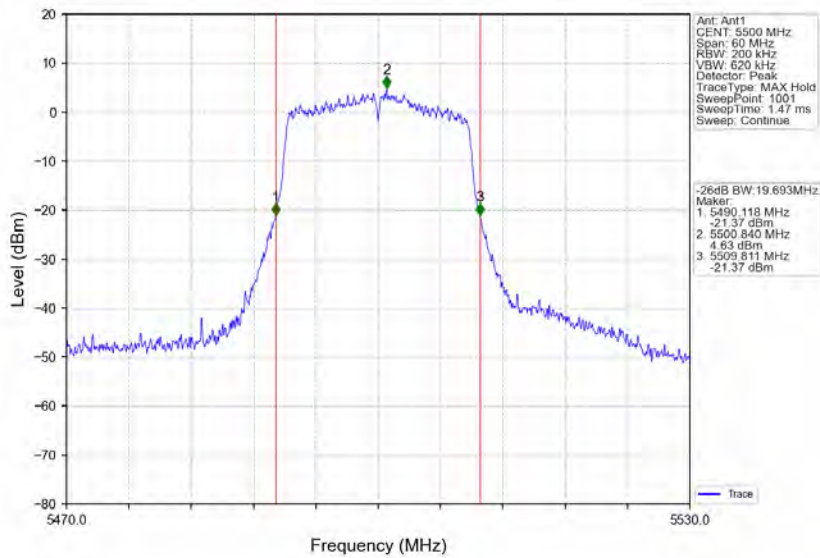

802.11n(HT20)_LCH_5500MHz_Ant2_NTNV

