




Mode	802.11a	Channel	52
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	89.35	18.88	108.23	N/A	N/A	PK
	@	5260	80.59	18.88	99.47	N/A	N/A	AVG
		5450.4	41.24	19.52	60.76	74	-13.24	PK
		5456.4	28.62	19.55	48.17	54	-5.83	AVG
Vertical	@	5260	91.51	18.88	110.39	N/A	N/A	PK
	@	5260	82.93	18.88	101.81	N/A	N/A	AVG
		5449.2	39.91	19.51	59.42	74	-14.58	PK
		5451.9	28.62	19.53	48.15	54	-5.85	AVG

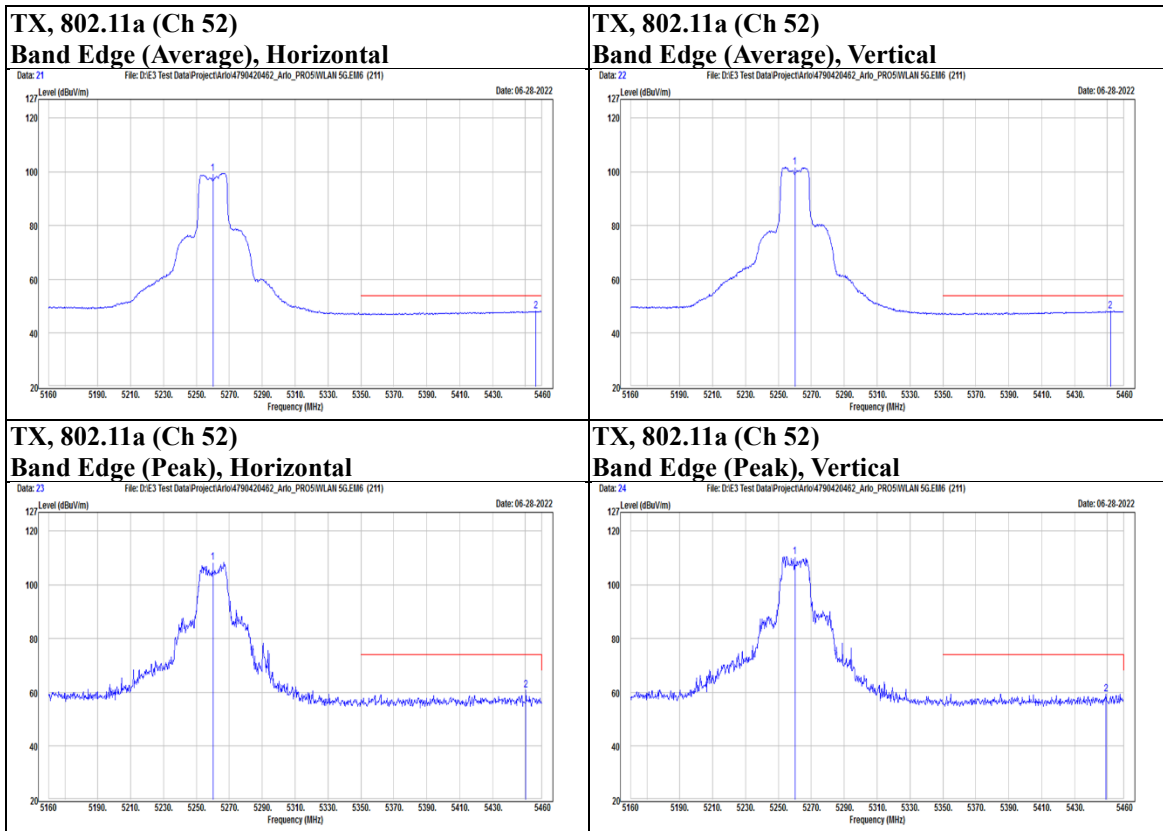

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790420462-US-R1-V0
Page : 68 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	60
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	89.29	18.77	108.06	N/A	N/A	PK
	@	5300	80.89	18.77	99.66	N/A	N/A	AVG
		5351.1	30.2	19.01	49.21	54	-4.79	AVG
		5452.8	40.17	19.53	59.7	74	-14.3	PK
	*	10600	30.13	18.04	48.17	68.2	-20.03	PK
Vertical	@	5300	91.51	18.77	110.28	N/A	N/A	PK
	@	5300	82.62	18.77	101.39	N/A	N/A	AVG
		5350.2	31.39	19.01	50.4	54	-3.6	AVG
		5351.1	41.92	19.01	60.93	74	-13.07	PK
	*	10600	30.96	18.04	49	68.2	-19.2	PK







Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

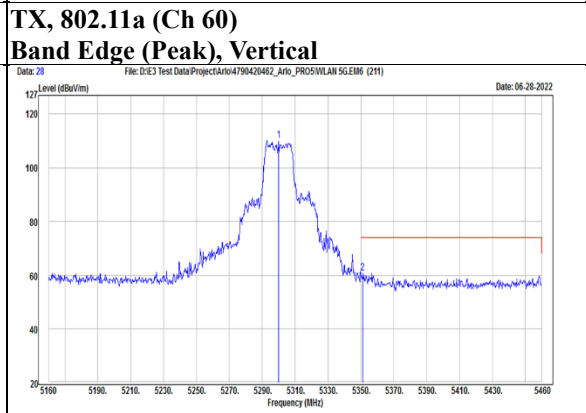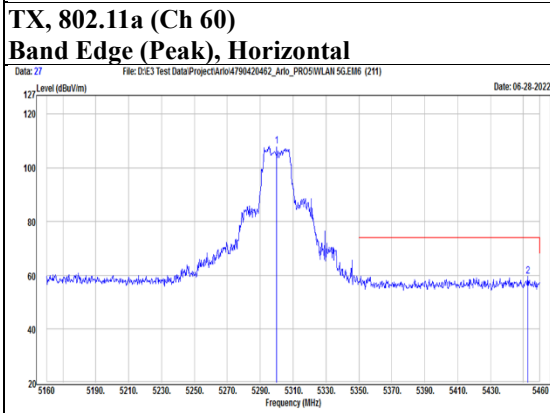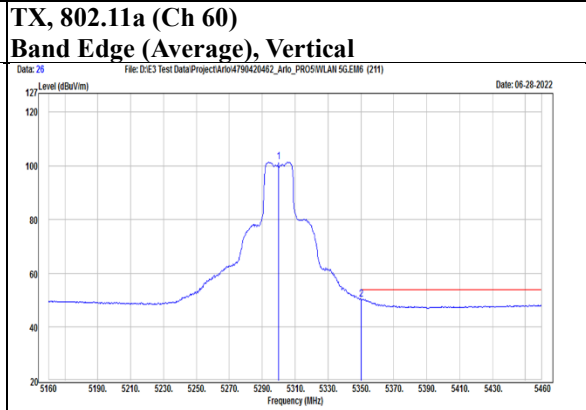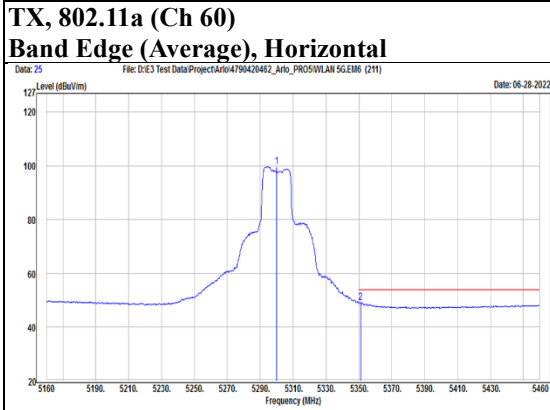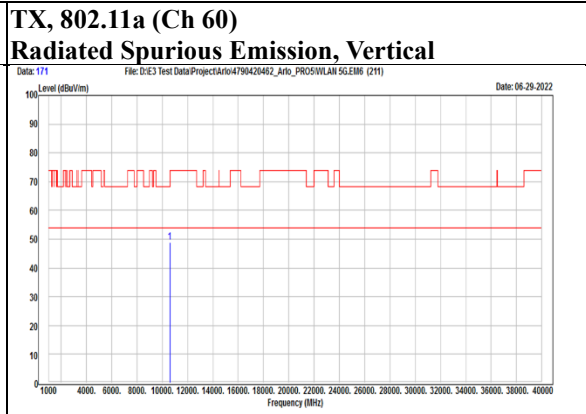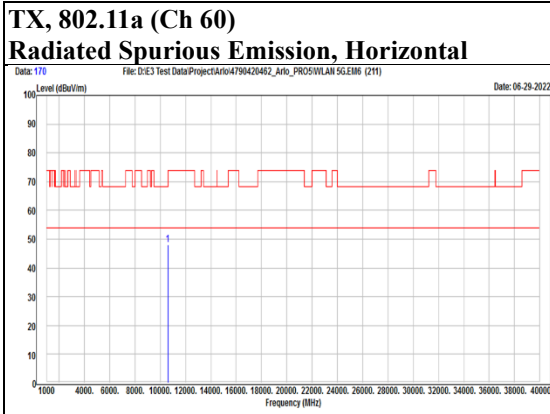



Test report No. : 4790420462-US-R1-V0
Page : 70 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11a	Channel	64
------	---------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	87.39	18.86	106.25	N/A	N/A	PK
	@	5320	78.89	18.86	97.75	N/A	N/A	AVG
		5350.5	47.83	19.01	66.84	74	-7.16	PK
		5350.5	31.98	19.01	50.99	54	-3.01	AVG
	*	10640	30.79	18.03	48.82	74	-25.18	PK
Vertical	@	5320	90.3	18.86	109.16	N/A	N/A	PK
	@	5320	80.76	18.86	99.62	N/A	N/A	AVG
		5350.2	45.87	19.01	64.88	74	-9.12	PK
		5350.5	34.12	19.01	53.13	54	-0.87	AVG
	*	10640	31.38	18.03	49.41	74	-24.59	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948





Doc No: 17-EM-F0878 / 6.0

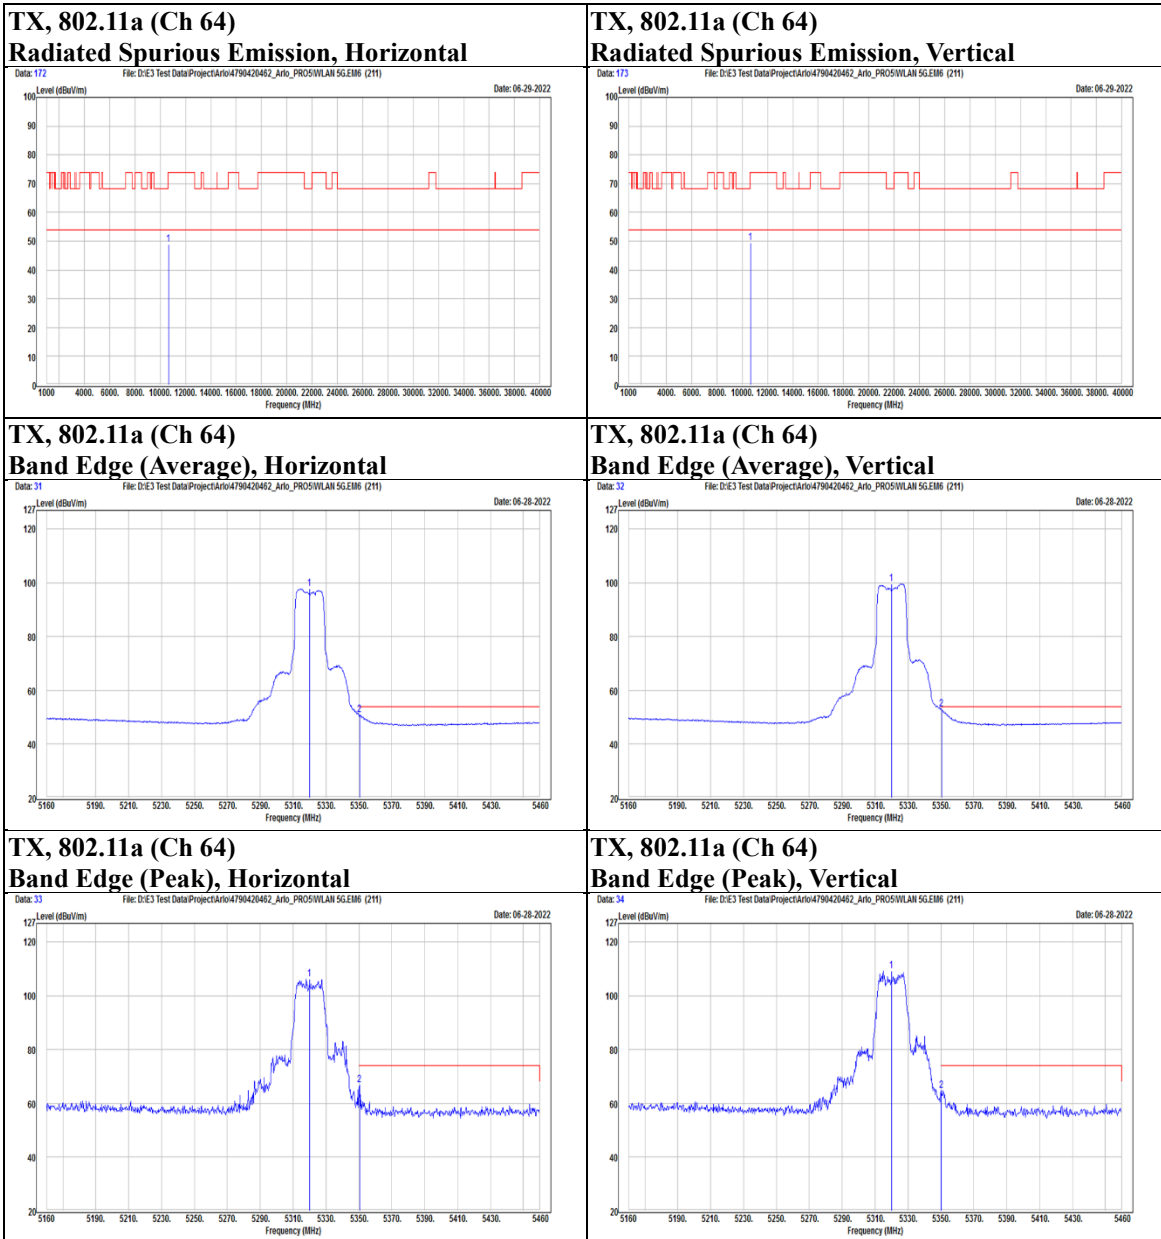



Mode	802.11a	Channel	100
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5436.4	39.9	19.46	59.36	74	-14.64	PK
		5436.4	28.89	19.46	48.35	54	-5.65	AVG
		5467.55	42.29	19.61	61.9	68.2	-6.3	PK
	@	5500	82.24	19.77	102.01	N/A	N/A	PK
	@	5500	74.48	19.77	94.25	N/A	N/A	AVG
	*	11000	30.62	18.41	49.03	74	-24.97	PK
Vertical		5412.95	40.28	19.33	59.61	74	-14.39	PK
		5436.4	29.46	19.46	48.92	54	-5.08	AVG
		5466.85	47.64	19.61	67.25	68.2	-0.95	PK
	@	5500	87.75	19.77	107.52	N/A	N/A	PK
	@	5500	78.4	19.77	98.17	N/A	N/A	AVG
	*	11000	29.92	18.41	48.33	74	-25.67	PK

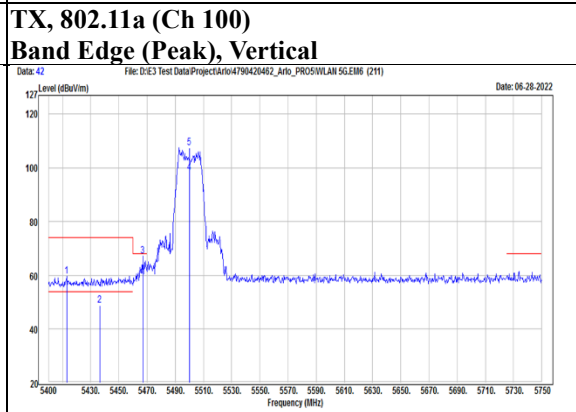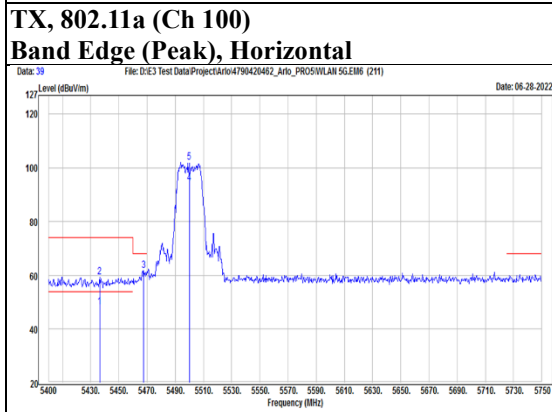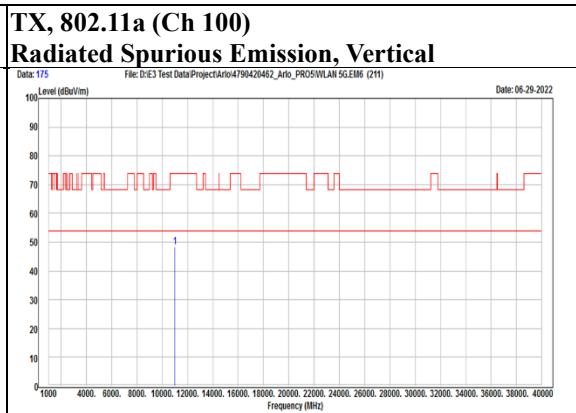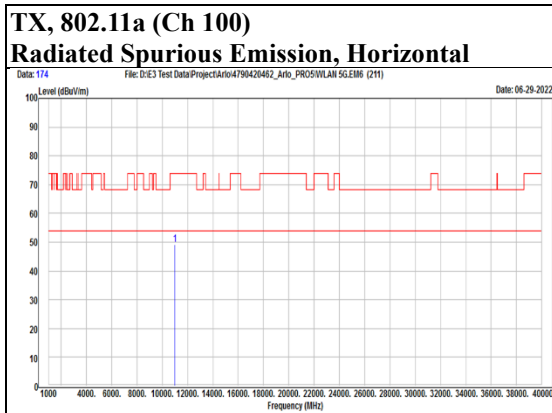

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	116
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5429.4	39.34	19.42	58.76	74	-15.24	PK
		5450.75	28.7	19.52	48.22	54	-5.78	AVG
		5460.2	39.55	19.57	59.12	68.2	-9.08	PK
	@	5580	85.61	19.76	105.37	N/A	N/A	PK
	@	5580	76.87	19.76	96.63	N/A	N/A	AVG
		5737.4	39.88	20.08	59.96	68.2	-8.24	PK
Vertical	*	11160	30.06	18.47	48.53	74	-25.47	PK
		5450.75	40.26	19.52	59.78	74	-14.22	PK
		5450.75	28.7	19.52	48.22	54	-5.78	AVG
		5467.9	39.53	19.61	59.14	68.2	-9.06	PK
	@	5580	90.29	19.76	110.05	N/A	N/A	PK
	@	5580	82.47	19.76	102.23	N/A	N/A	AVG
	5746.15	39.83	20.16	59.99	68.2	-8.21	PK	
*	11160	31.03	18.47	49.5	74	-24.5	PK	

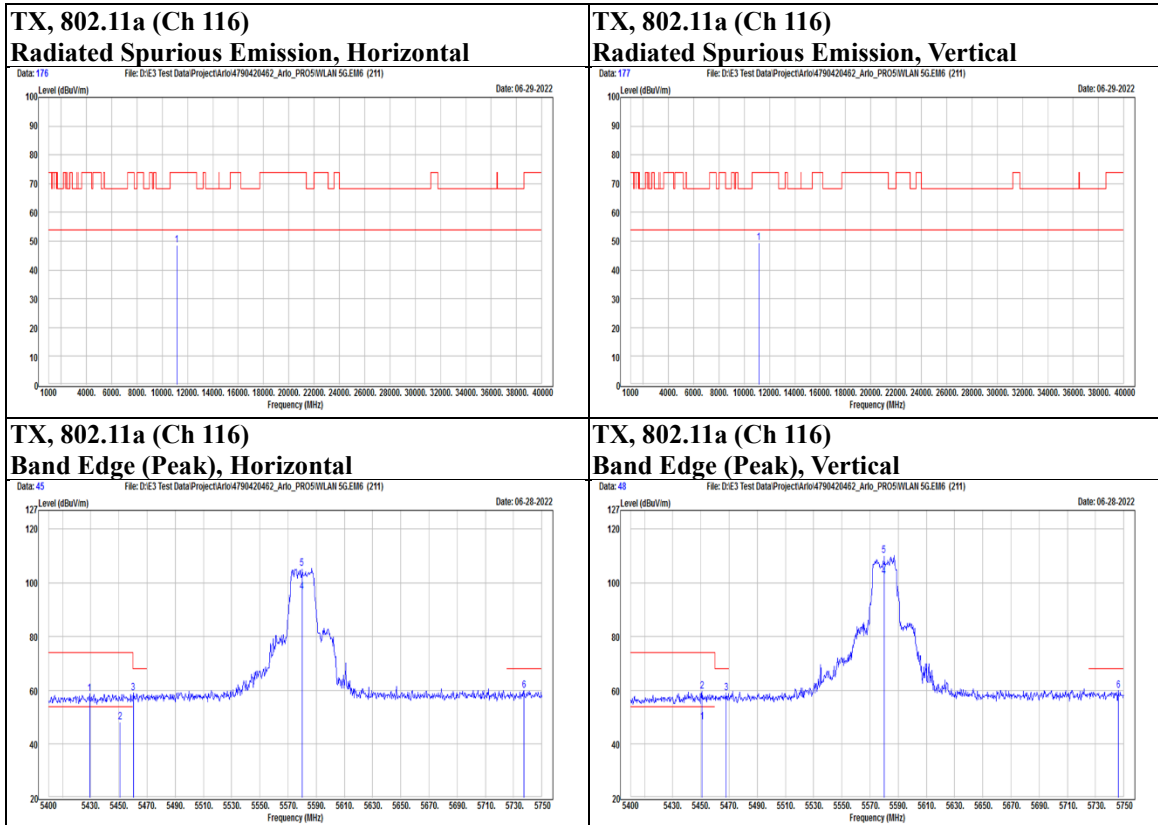

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	140
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	86.17	19.73	105.9	N/A	N/A	PK
	@	5700	75.7	19.73	95.43	N/A	N/A	AVG
		5725	43.74	19.96	63.7	68.2	-4.5	PK
	*	11400	30.46	18.85	49.31	74	-24.69	PK
Vertical	@	5700	89.7	19.73	109.43	N/A	N/A	PK
	@	5700	79.29	19.73	99.02	N/A	N/A	AVG
		5725.15	47.76	19.96	67.72	68.2	-0.48	PK
	*	11400	30.19	18.85	49.04	74	-24.96	PK

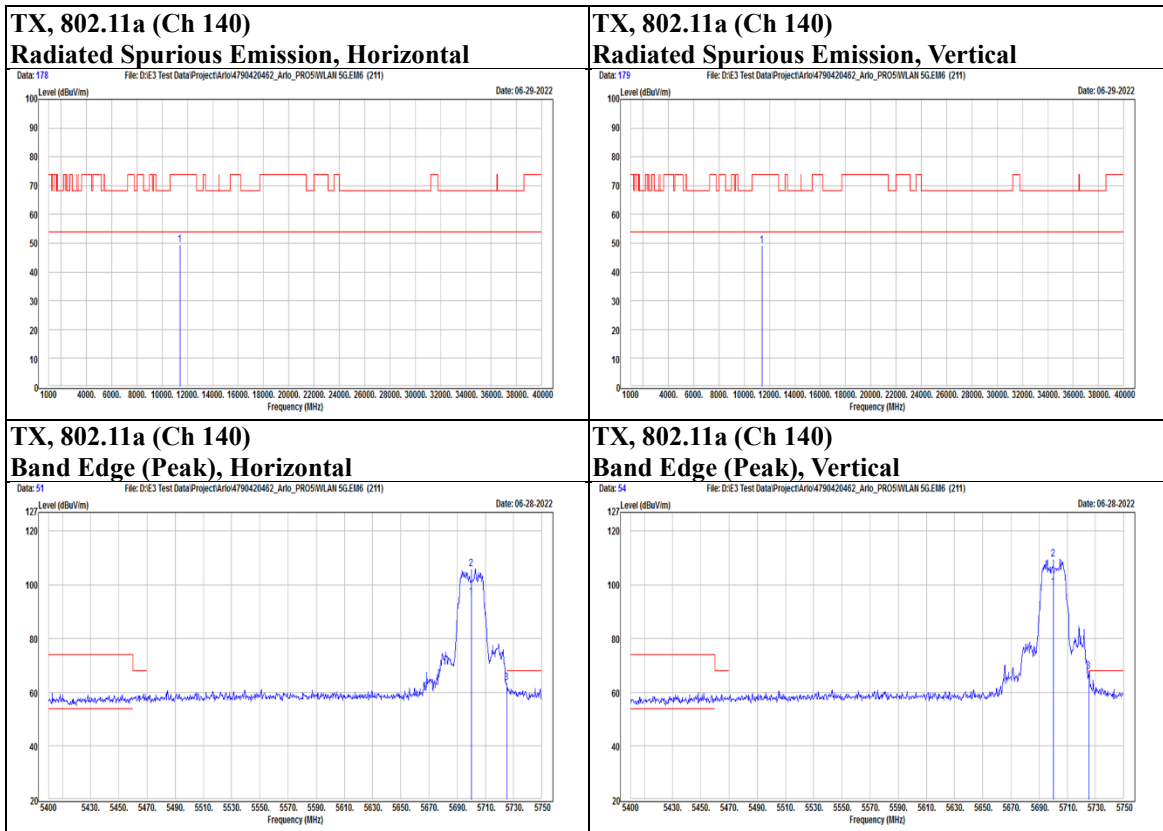

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	144
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11440	30.13	19.06	49.19	74	-24.81	PK
Vertical	*	11440	30.05	19.06	49.11	74	-24.89	PK

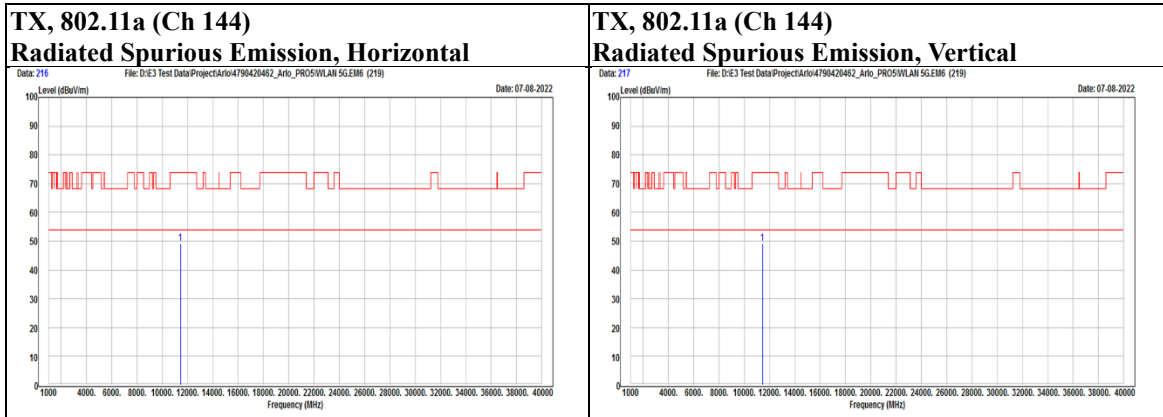

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5593	40.46	19.72	60.18	68.2	-8.02	PK
		5698.5	43.05	19.73	62.78	104.09	-41.31	PK
	@	5745	86.52	20.15	106.67	N/A	N/A	PK
	*	11490	31	19.33	50.33	74	-23.67	PK
Vertical		5589.5	40.69	19.73	60.42	68.2	-7.78	PK
		5699.5	48.67	19.73	68.4	104.83	-36.43	PK
	@	5745	89.79	20.15	109.94	N/A	N/A	PK
	*	11490	30.02	19.33	49.35	74	-24.65	PK

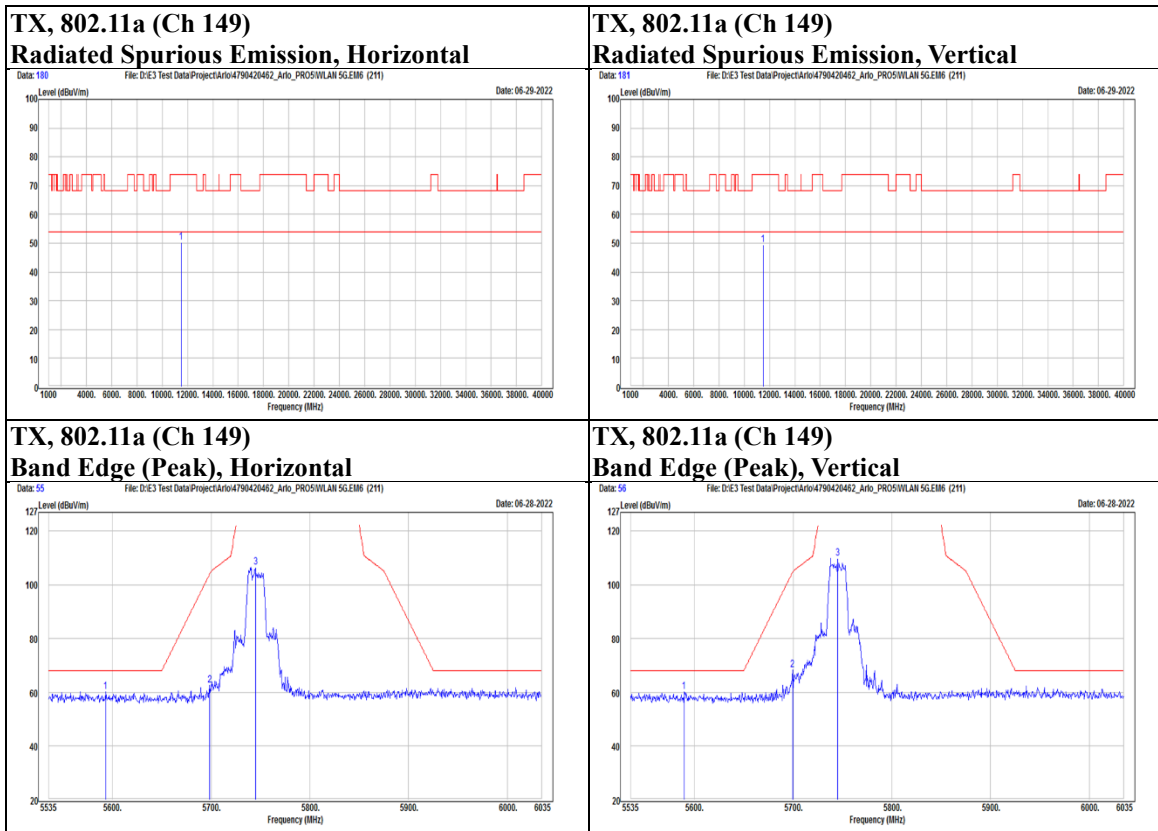

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan





Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948



Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5574.5	39.96	19.77	59.73	68.2	-8.47	PK
		5699.5	40.86	19.73	60.59	104.83	-44.24	PK
		5785	86.83	20.45	107.28	N/A	N/A	PK
		5898	40.38	20.96	61.34	88.14	-26.8	PK
		6018	41.38	20.98	62.36	68.2	-5.84	PK
		11570	29.42	19.07	48.49	74	-25.51	PK
Vertical	@	5579	41.48	19.75	61.23	68.2	-6.97	PK
		5698.5	40.8	19.73	60.53	104.09	-43.56	PK
		5785	88.99	20.45	109.44	N/A	N/A	PK
		5918	40.41	20.96	61.37	73.36	-11.99	PK
		5966	40.84	20.95	61.79	68.2	-6.41	PK
		11570	29.28	19.07	48.35	74	-25.65	PK

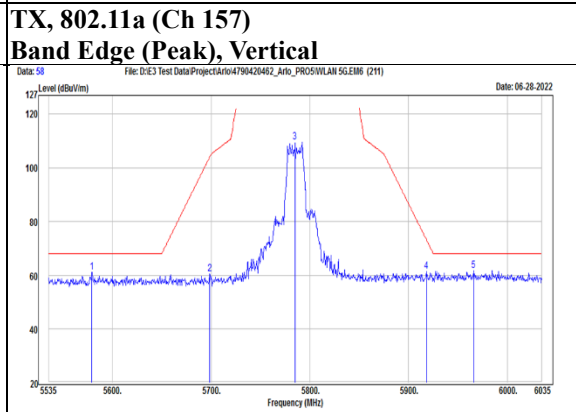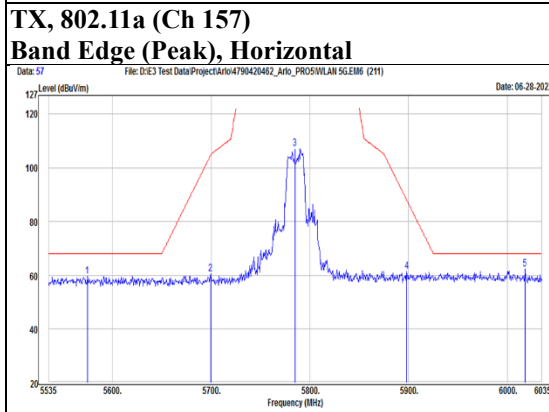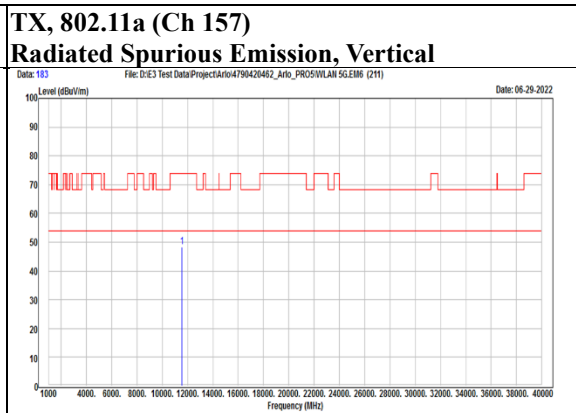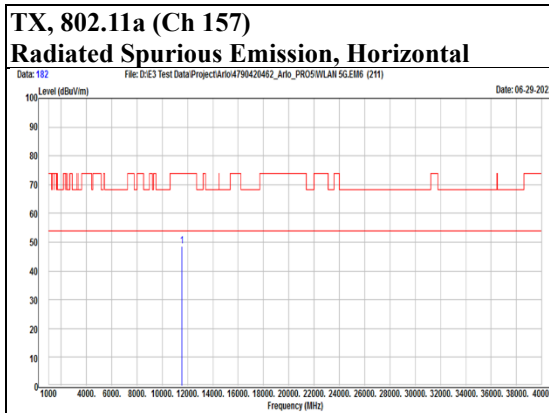

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	87.47	20.58	108.05	N/A	N/A	PK
		5918.5	40.06	20.96	61.02	72.99	-11.97	PK
		5970	40.43	20.96	61.39	68.2	-6.81	PK
	*	11650	30.04	18.83	48.87	74	-25.13	PK
Vertical	@	5825	89.68	20.58	110.26	N/A	N/A	PK
		5903.5	41.45	20.97	62.42	84.07	-21.65	PK
		5954.5	41.17	20.95	62.12	68.2	-6.08	PK
	*	11650	29.37	18.83	48.2	74	-25.8	PK

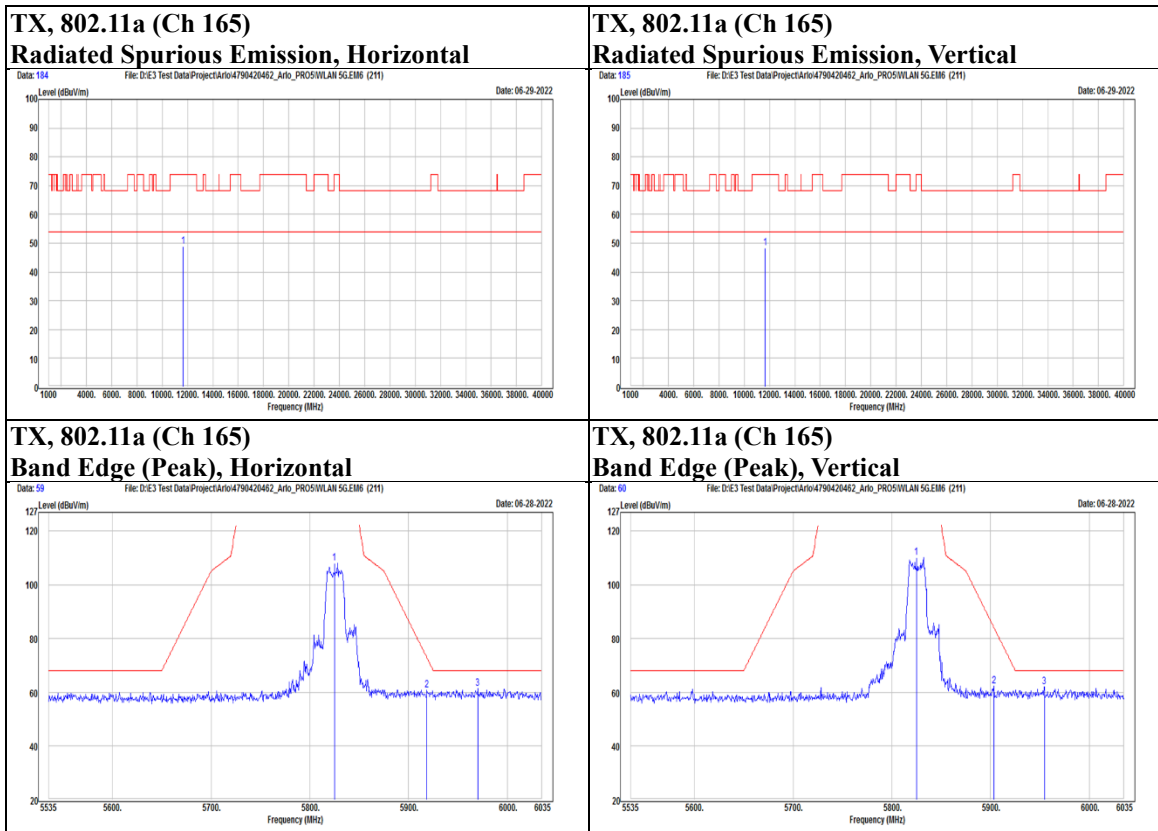

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948



Mode	802.11n(HT20)	Channel	36
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5147.35	46.01	19.41	65.42	74	-8.58	PK
		5148.05	32.53	19.4	51.93	54	-2.07	AVG
	@	5180	85.53	19.31	104.84	N/A	N/A	PK
	@	5180	76.32	19.31	95.63	N/A	N/A	AVG
	*	10360	30.64	17.51	48.15	68.2	-20.05	PK
Vertical		5144.2	41.22	19.4	60.62	74	-13.38	PK
		5148.4	34.02	19.4	53.42	54	-0.58	AVG
	@	5180	82.51	19.31	101.82	N/A	N/A	PK
	@	5180	79.86	19.31	99.17	N/A	N/A	AVG
	*	10360	30.66	17.51	48.17	68.2	-20.03	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

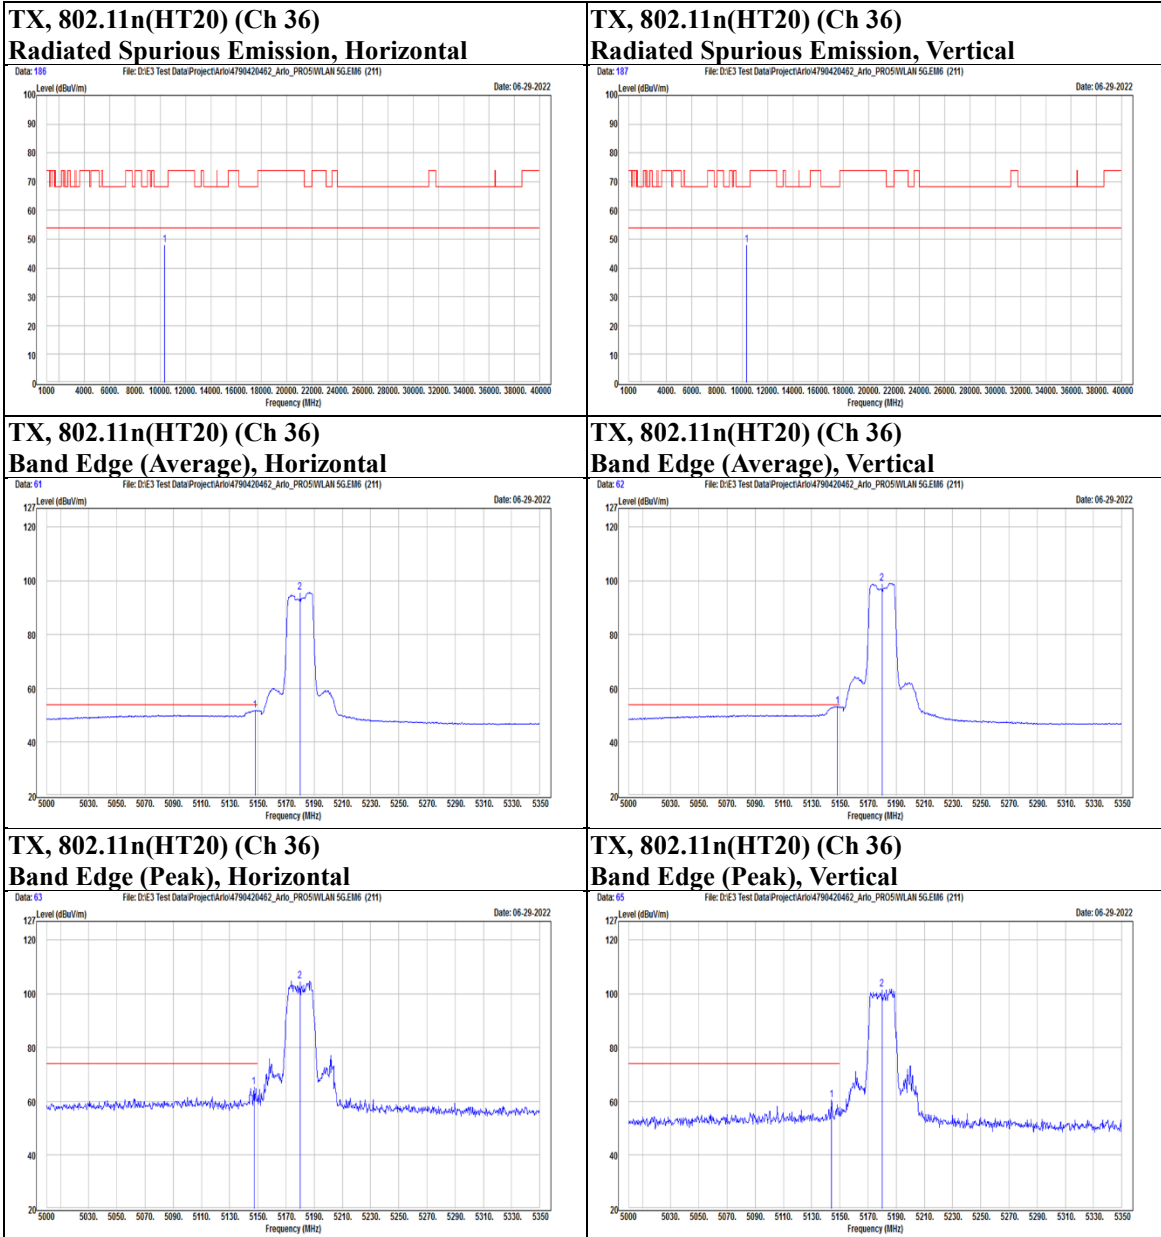



Mode	802.11n(HT20)	Channel	44
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5093.8	30.6	19.39	49.99	54	-4.01	AVG
		5105	41.64	19.44	61.08	74	-12.92	PK
	@	5220	90.05	19.12	109.17	N/A	N/A	PK
	@	5220	80.5	19.12	99.62	N/A	N/A	AVG
	*	10440	29.71	17.81	47.52	68.2	-20.68	PK
Vertical		5064.05	36.85	19.18	56.03	74	-17.97	PK
		5147.35	30.9	19.41	50.31	54	-3.69	AVG
	@	5220	86.28	19.12	105.4	N/A	N/A	PK
	@	5220	84.07	19.12	103.19	N/A	N/A	AVG
	*	10440	31.51	17.81	49.32	68.2	-18.88	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

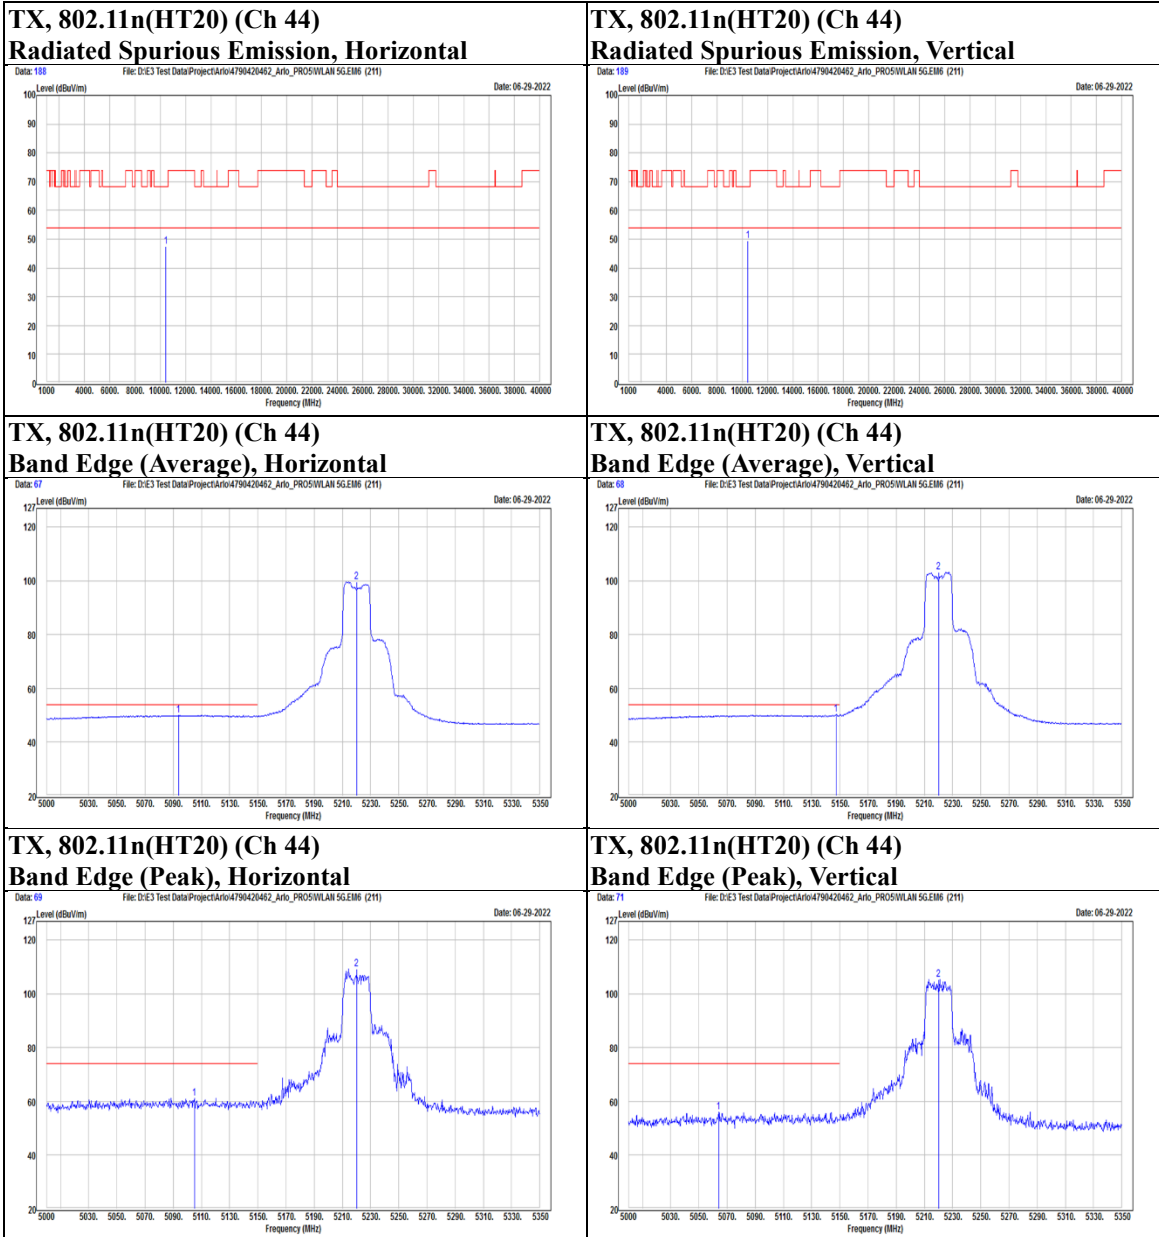



Mode	802.11n(HT20)	Channel	48
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5082.6	41.54	19.33	60.87	74	-13.13	PK
		5093.1	30.59	19.39	49.98	54	-4.02	AVG
	@	5240	90.41	18.97	109.38	N/A	N/A	PK
	@	5240	80.52	18.97	99.49	N/A	N/A	AVG
	*	10480	29.98	17.92	47.9	68.2	-20.3	PK
Vertical		5084.7	30.74	19.34	50.08	54	-3.92	AVG
		5104.65	36.89	19.44	56.33	74	-17.67	PK
	@	5240	87.33	18.97	106.3	N/A	N/A	PK
	@	5240	84.49	18.97	103.46	N/A	N/A	AVG
	*	10480	30.28	17.92	48.2	68.2	-20	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

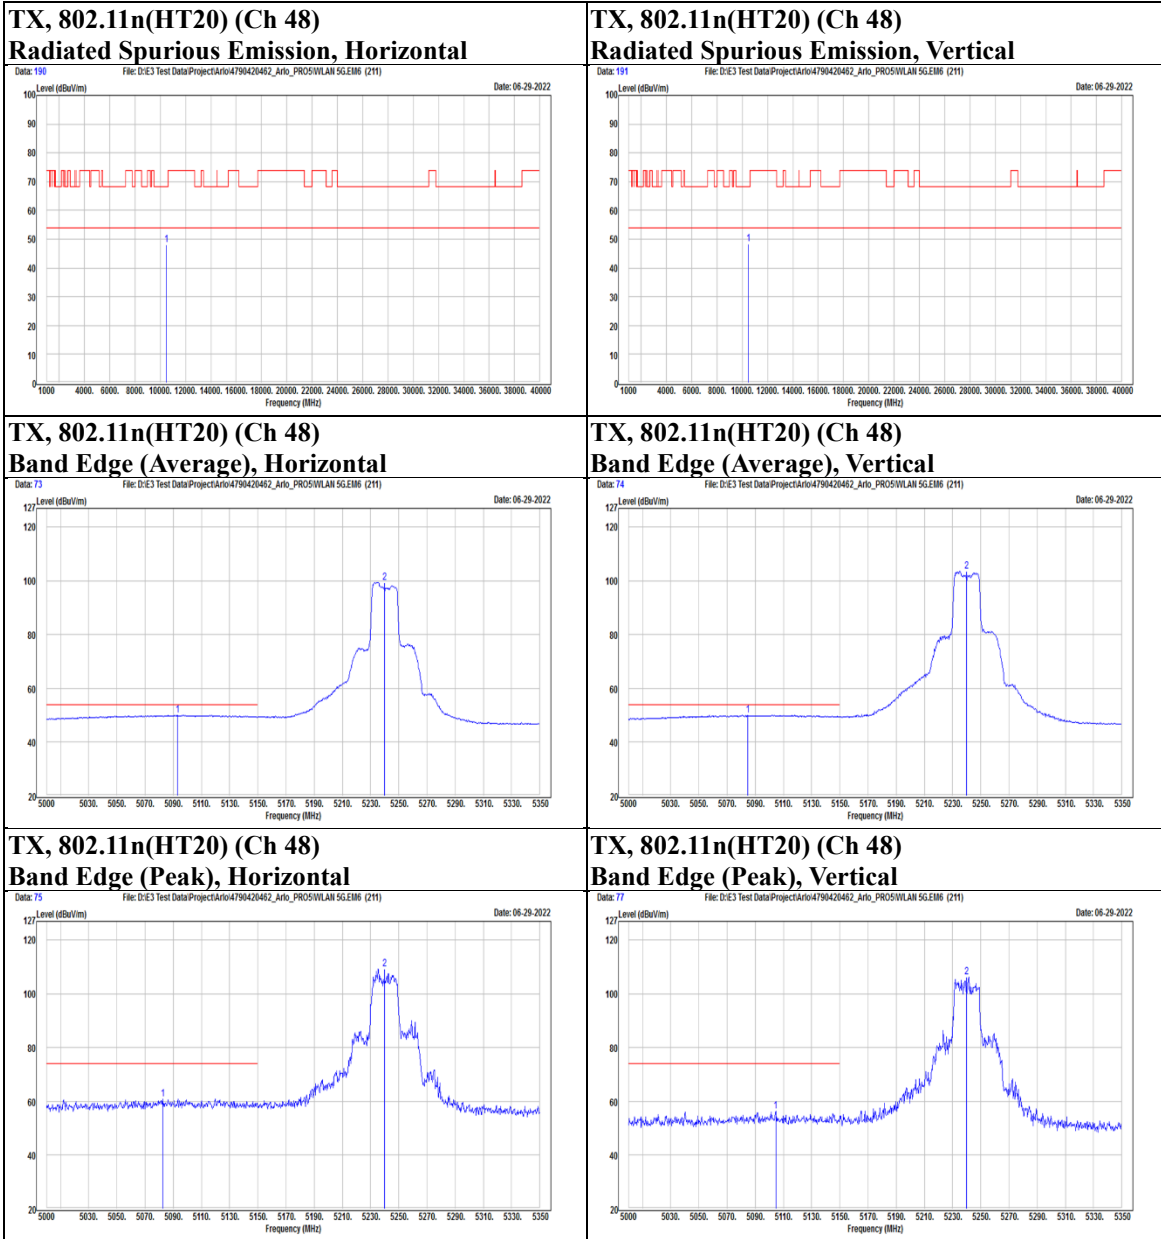



Mode	802.11n(HT20)	Channel	52
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	87.79	18.88	106.67	N/A	N/A	PK
	@	5260	79.85	18.88	98.73	N/A	N/A	AVG
		5455.8	40.38	19.54	59.92	74	-14.08	PK
		5459.1	28.5	19.57	48.07	54	-5.93	AVG
	*	10520	30	17.99	47.99	68.2	-20.21	PK
Vertical	@	5260	91.06	18.88	109.94	N/A	N/A	PK
	@	5260	84.14	18.88	103.02	N/A	N/A	AVG
		5451.6	39.86	19.53	59.39	74	-14.61	PK
		5451.9	28.53	19.53	48.06	54	-5.94	AVG
	*	10520	30.08	17.99	48.07	68.2	-20.13	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

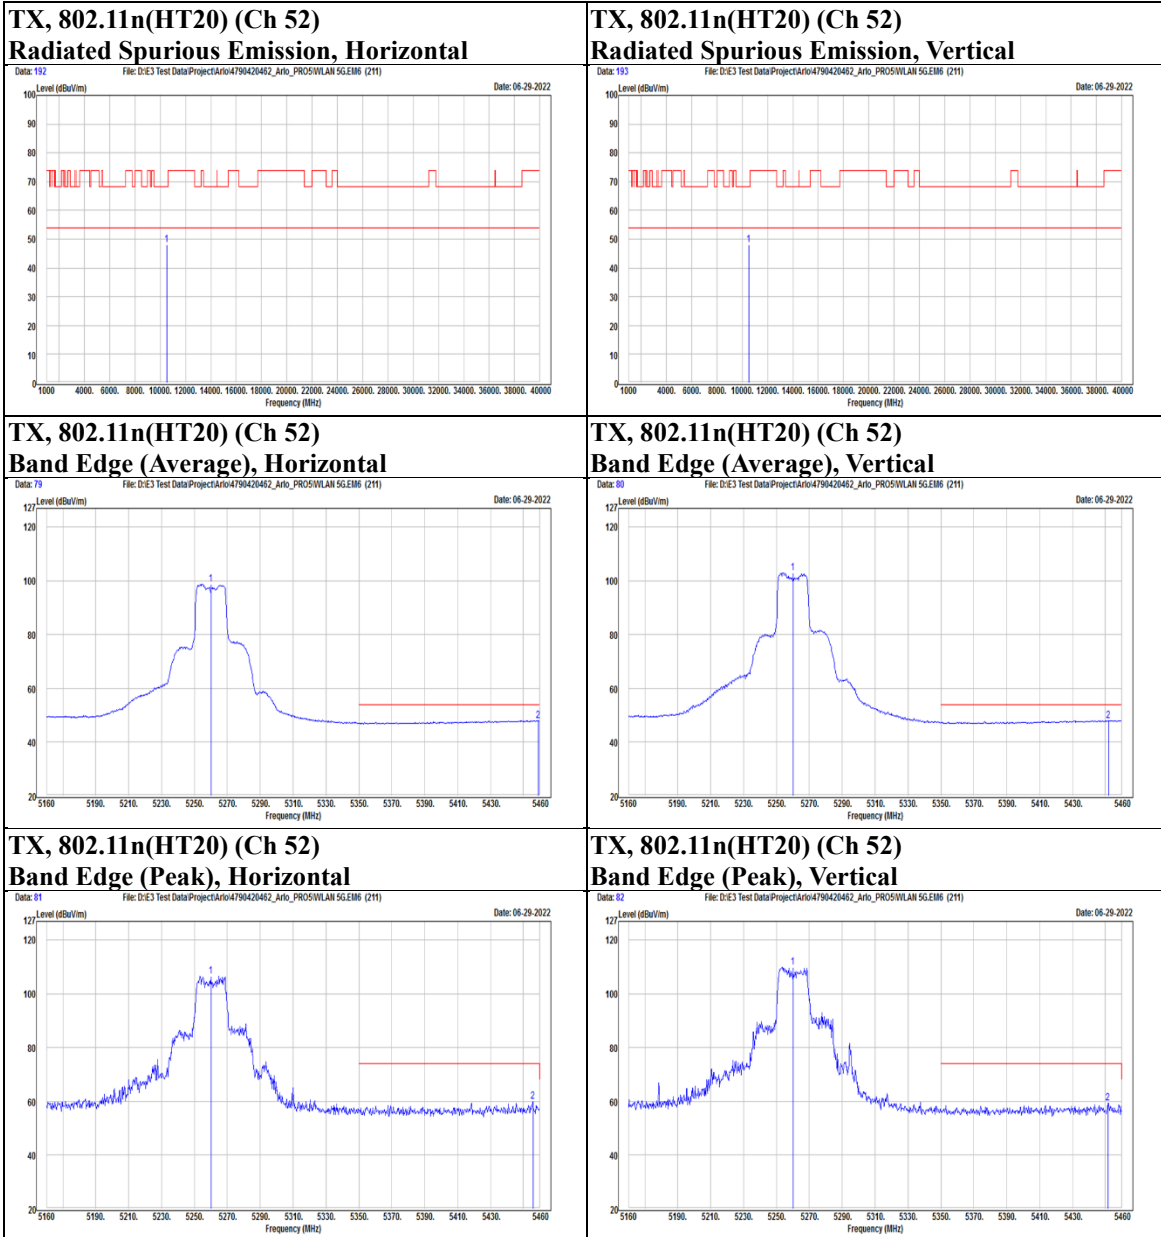



Mode	802.11n(HT20)	Channel	60
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	87.83	18.77	106.6	N/A	N/A	PK
	@	5300	79.37	18.77	98.14	N/A	N/A	AVG
		5350.2	31.23	19.01	50.24	54	-3.76	AVG
		5351.7	41.98	19.02	61	74	-13	PK
	*	10600	30.82	18.04	48.86	68.2	-19.34	PK
Vertical	@	5300	92.29	18.77	111.06	N/A	N/A	PK
	@	5300	83.91	18.77	102.68	N/A	N/A	AVG
		5350.2	33.26	19.01	52.27	54	-1.73	AVG
		5358.9	43.17	19.06	62.23	74	-11.77	PK
	*	10600	30.47	18.04	48.51	68.2	-19.69	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

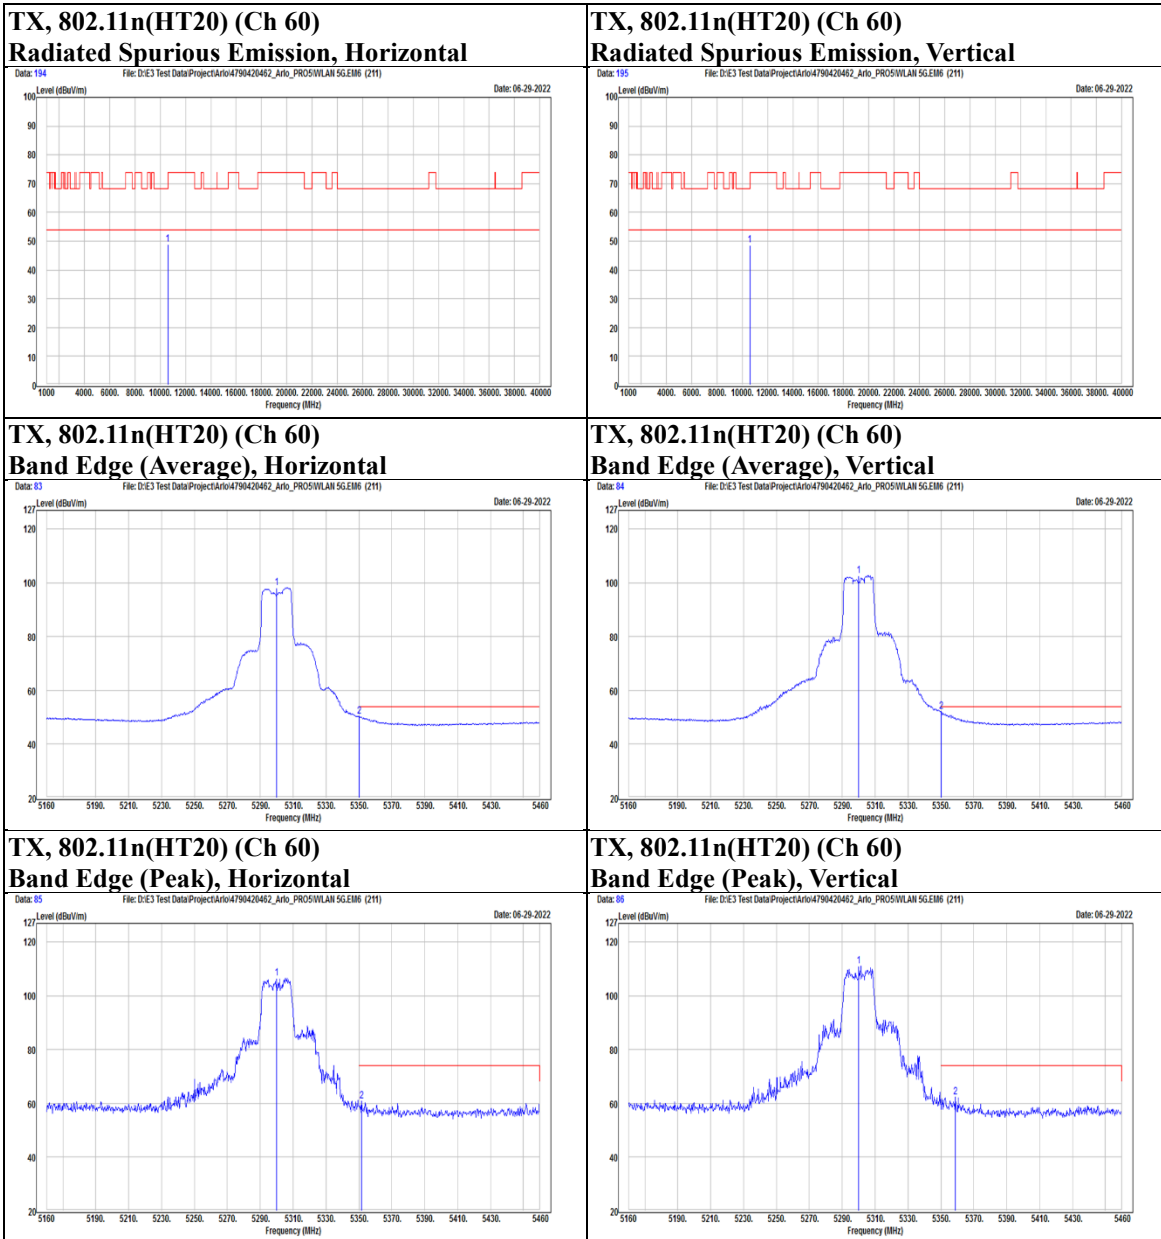



Test report No. : 4790420462-US-R1-V0
Page : 89 of 103
Issued date : 2022/8/2
FCC ID : 2APLE18300422

Mode	802.11n(HT20)	Channel	64
------	---------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	85.94	18.86	104.8	N/A	N/A	PK
	@	5320	77.64	18.86	96.5	N/A	N/A	AVG
		5351.1	32.03	19.01	51.04	54	-2.96	AVG
		5355.3	48.48	19.04	67.52	74	-6.48	PK
	*	10640	29.58	18.03	47.61	74	-26.39	PK
Vertical	@	5320	89.61	18.86	108.47	N/A	N/A	PK
	@	5320	80.45	18.86	99.31	N/A	N/A	AVG
		5350.5	34.91	19.01	53.92	54	-0.08	AVG
		5353.2	50.87	19.03	69.9	74	-4.1	PK
	*	10640	30.74	18.03	48.77	74	-25.23	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948





Doc No: 17-EM-F0878 / 6.0

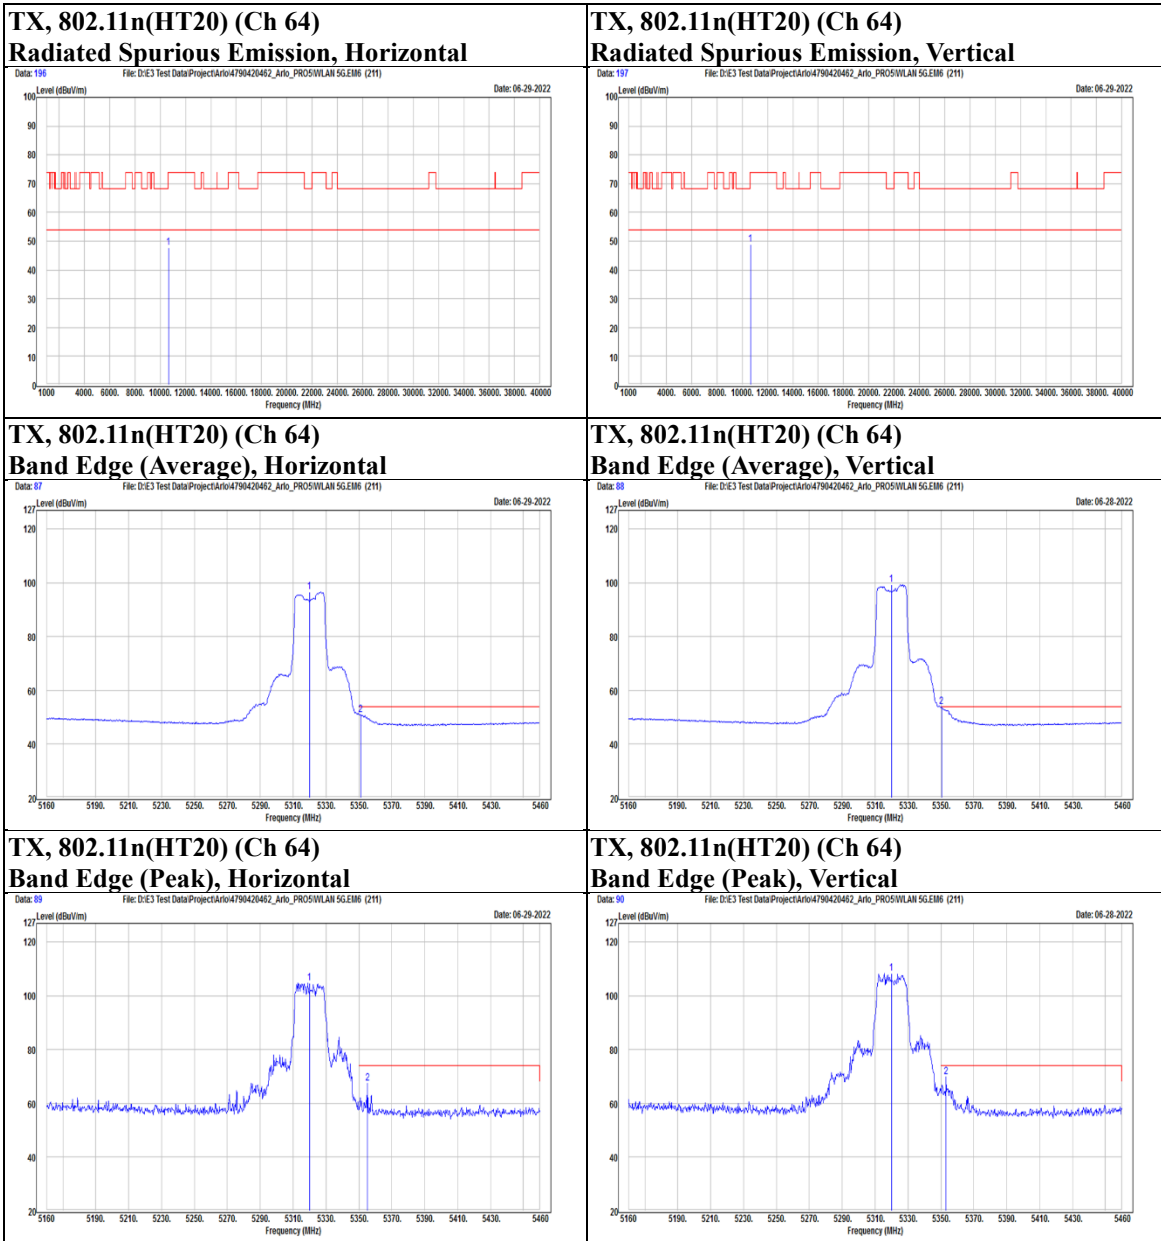



Mode	802.11n(HT20)	Channel	100
------	---------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5412.25	40.21	19.33	59.54	74	-14.46	PK
		5412.25	29.12	19.33	48.45	54	-5.55	AVG
		5463	42.84	19.58	62.42	68.2	-5.78	PK
	@	5500	83.21	19.77	102.98	N/A	N/A	PK
	@	5500	74.57	19.77	94.34	N/A	N/A	AVG
	*	11000	31.02	18.41	49.43	74	-24.57	PK
Vertical		5459.5	41.39	19.57	60.96	74	-13.04	PK
		5459.5	29.94	19.57	49.51	54	-4.49	AVG
		5466.85	48.57	19.61	68.18	68.2	-0.02	PK
	@	5500	87.28	19.77	107.05	N/A	N/A	PK
	@	5500	78.31	19.77	98.08	N/A	N/A	AVG
	*	11000	30.03	18.41	48.44	74	-25.56	PK

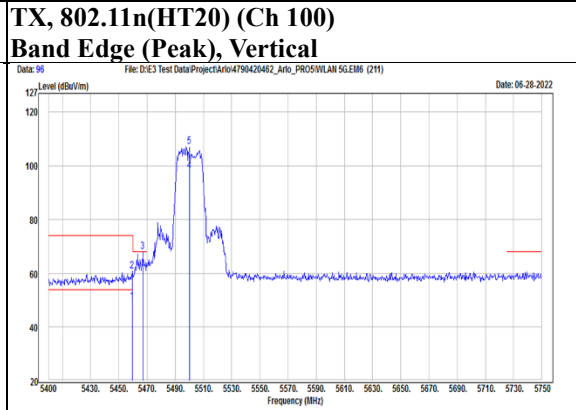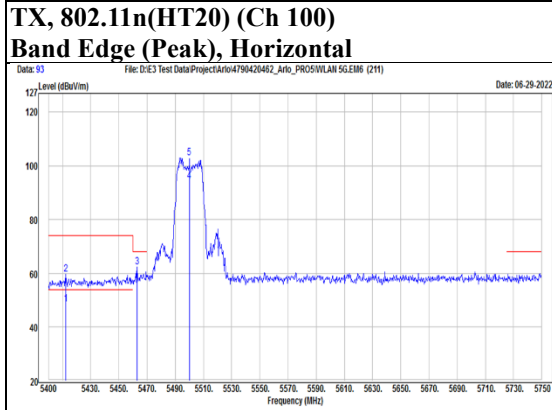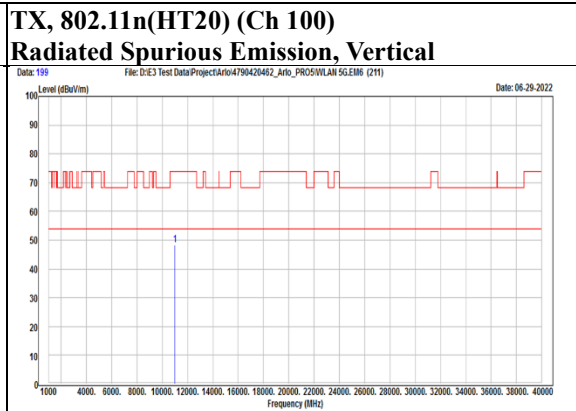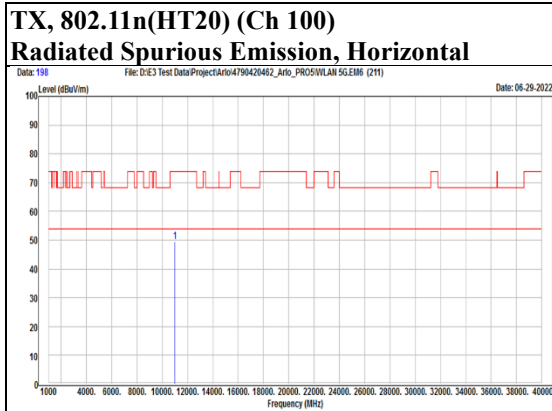

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Mode	802.11n(HT20)	Channel	116
------	---------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5440.6	39.27	19.47	58.74	74	-15.26	PK
		5440.6	28.59	19.47	48.06	54	-5.94	AVG
		5467.55	38.86	19.61	58.47	68.2	-9.73	PK
	@	5580	84.88	19.76	104.64	N/A	N/A	PK
	@	5580	77.93	19.76	97.69	N/A	N/A	AVG
		5748.25	40.23	20.19	60.42	68.2	-7.78	PK
Vertical	*	11160	30.23	18.47	48.7	74	-25.3	PK
		5405.25	40.25	19.3	59.55	74	-14.45	PK
		5405.25	28.87	19.3	48.17	54	-5.83	AVG
		5467.55	39.23	19.61	58.84	68.2	-9.36	PK
	@	5580	91.14	19.76	110.9	N/A	N/A	PK
	@	5580	82.74	19.76	102.5	N/A	N/A	AVG
	5736	40.35	20.07	60.42	68.2	-7.78	PK	
*	11160	30.11	18.47	48.58	74	-25.42	PK	

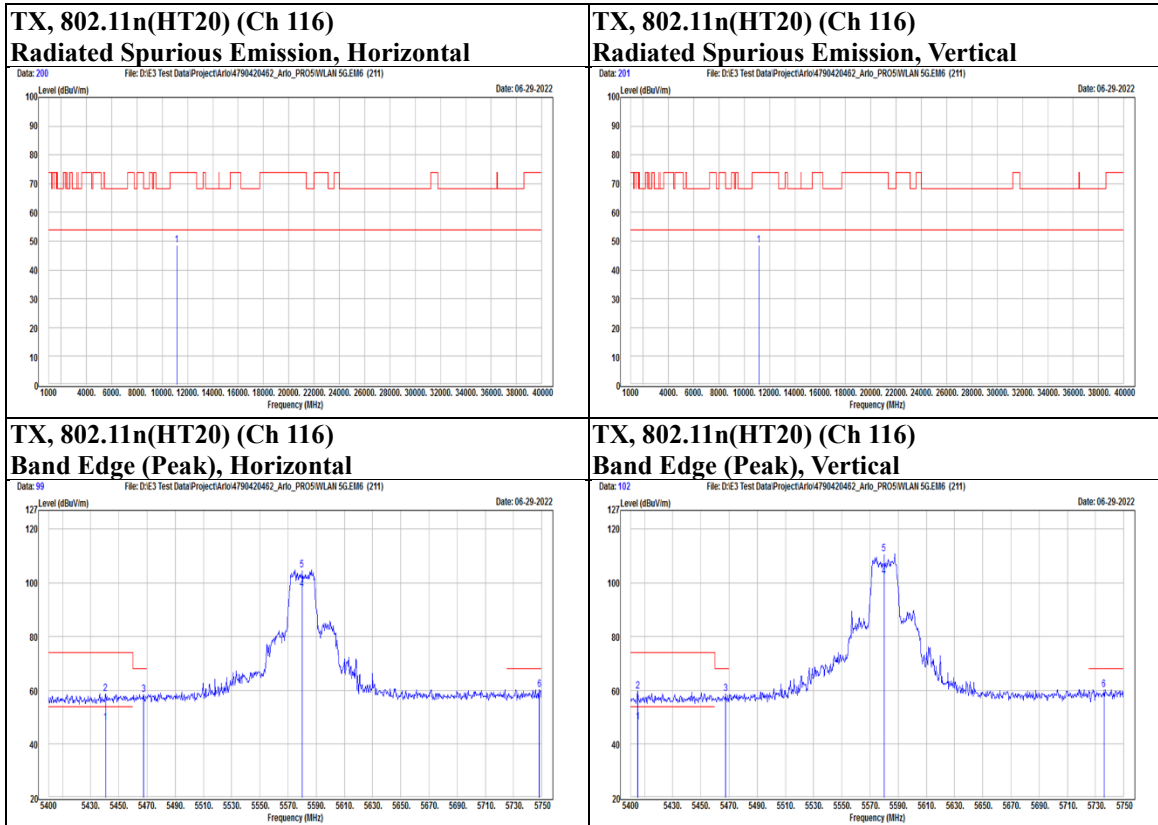

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948