


Report No.: GZEM181100248301


Page: 61 of 118



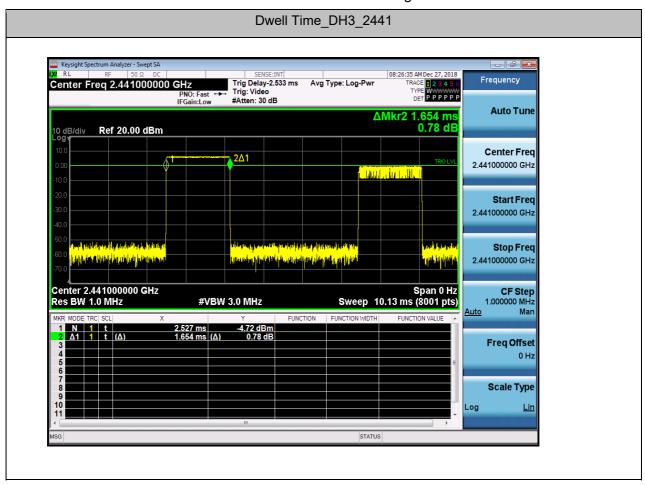

Report No.: GZEM181100248301


Page: 62 of 118

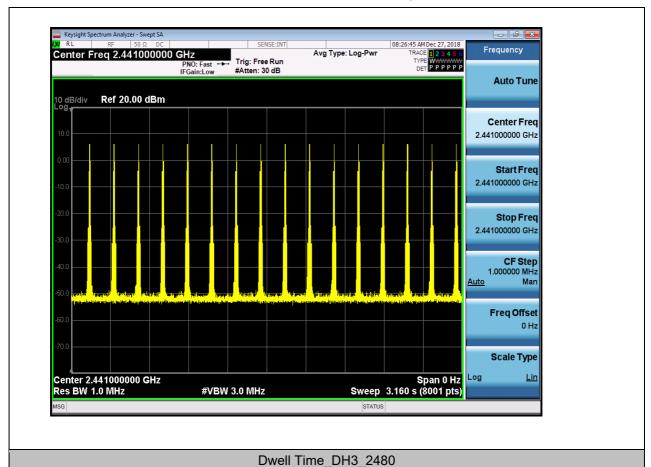




Report No.: GZEM181100248301

Page: 63 of 118

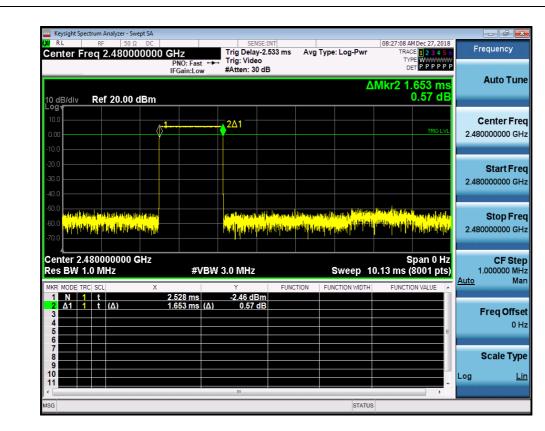


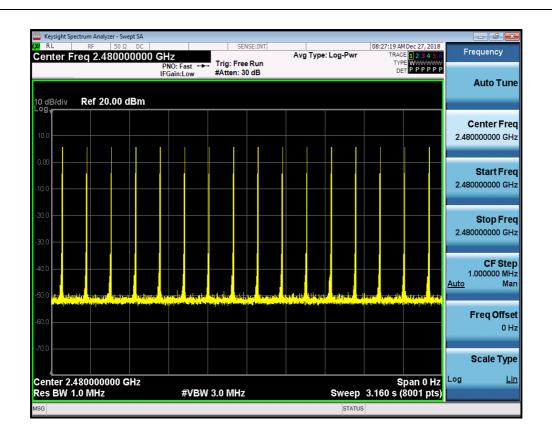



Report No.: GZEM181100248301


Page: 64 of 118

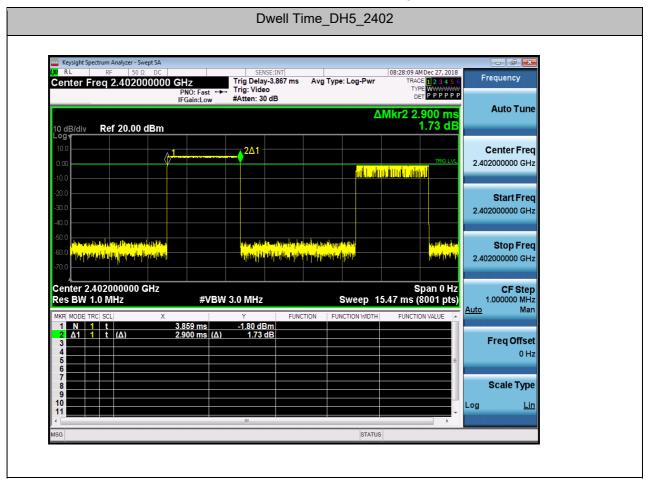



Report No.: GZEM181100248301


Page: 65 of 118

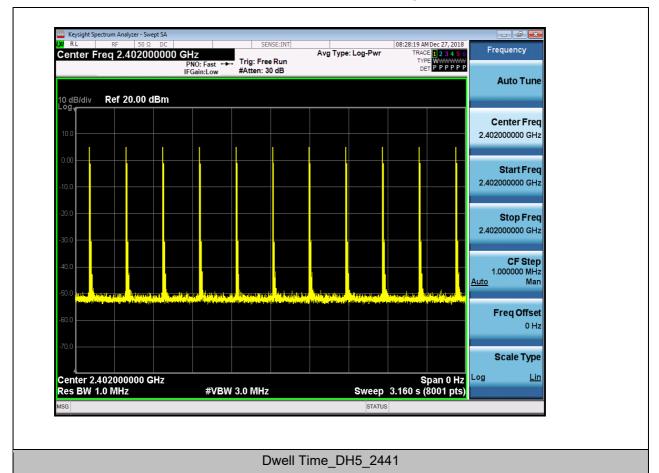




Report No.: GZEM181100248301

Page: 66 of 118

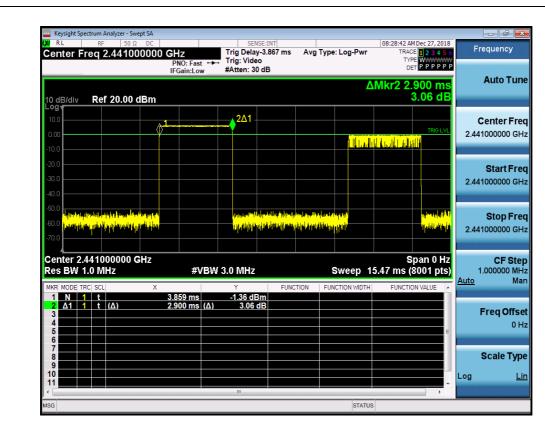


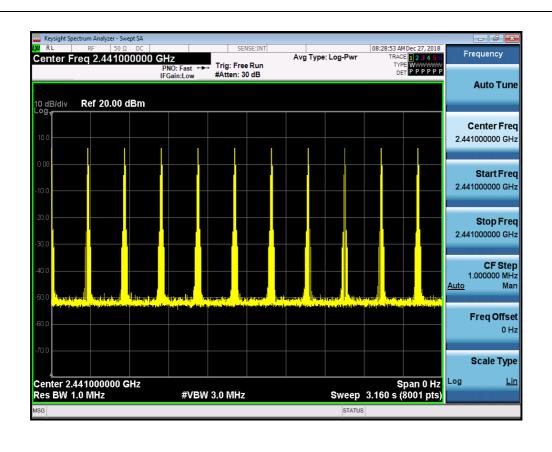



Report No.: GZEM181100248301


Page: 67 of 118

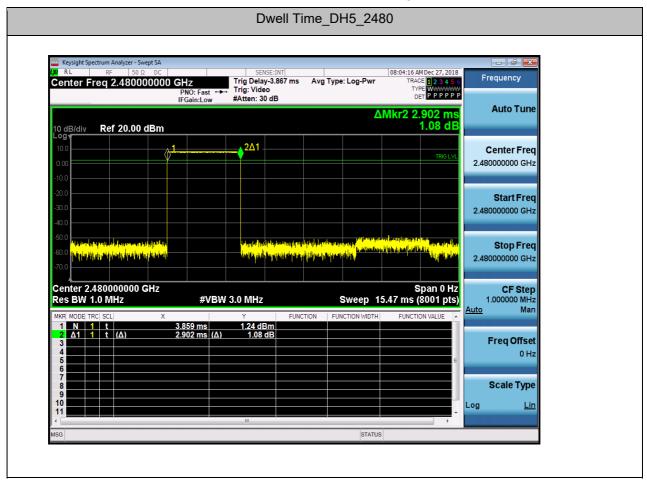



Report No.: GZEM181100248301

Page: 68 of 118

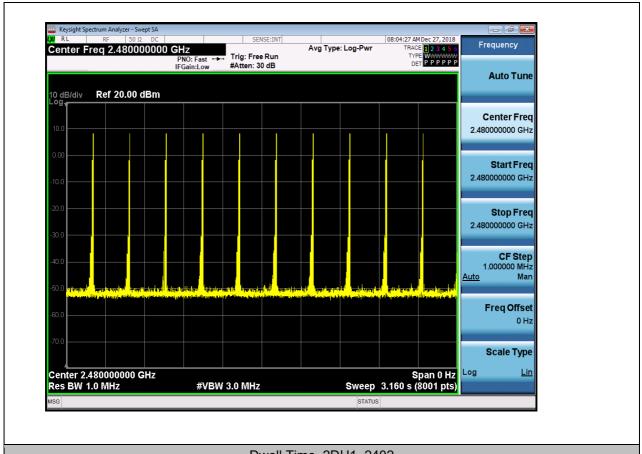



Dwell Time_2DH1_2402



Report No.: GZEM181100248301

Page: 69 of 118

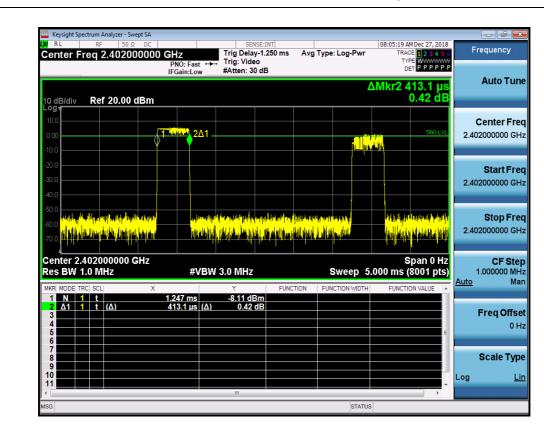


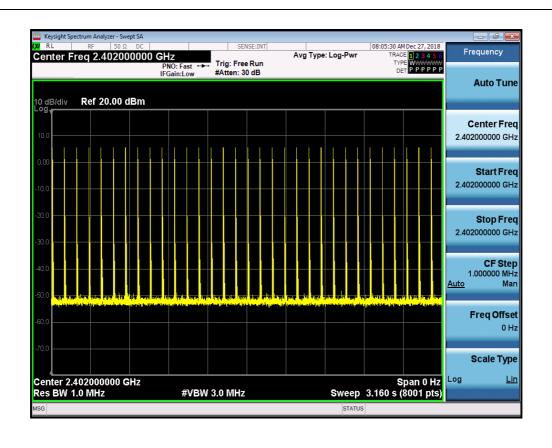



Report No.: GZEM181100248301


Page: 70 of 118

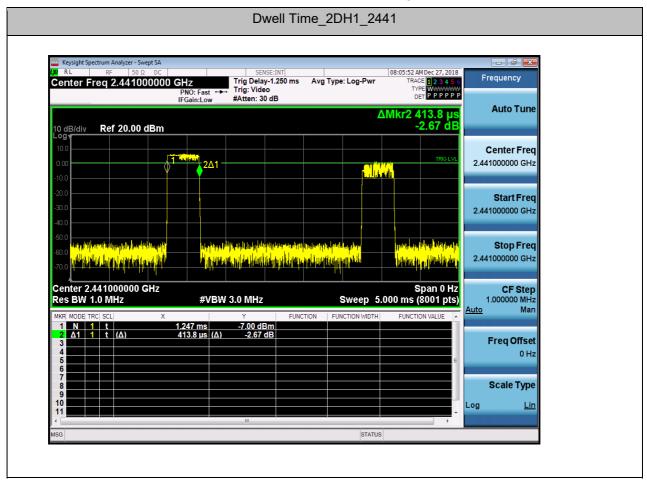



Report No.: GZEM181100248301


71 of 118 Page:

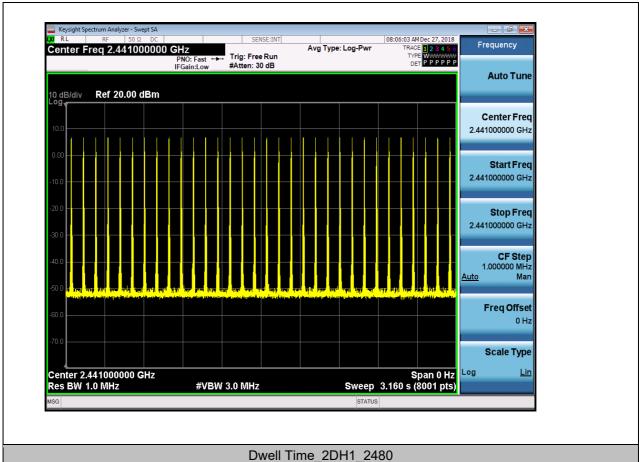




Report No.: GZEM181100248301

Page: 72 of 118

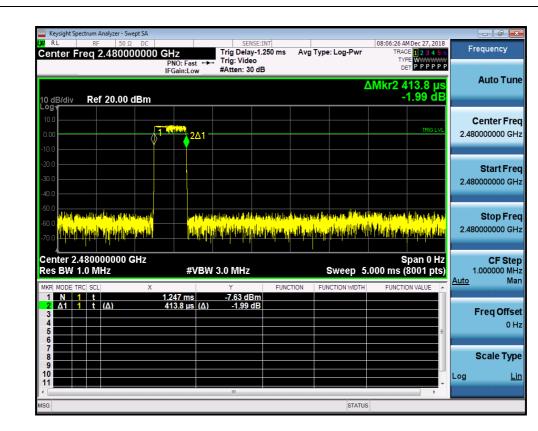


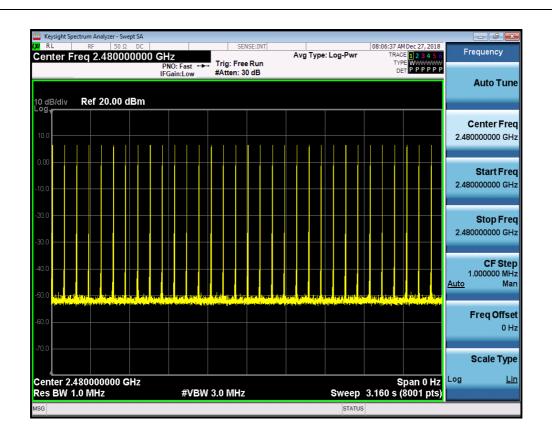



Report No.: GZEM181100248301


Page: 73 of 118

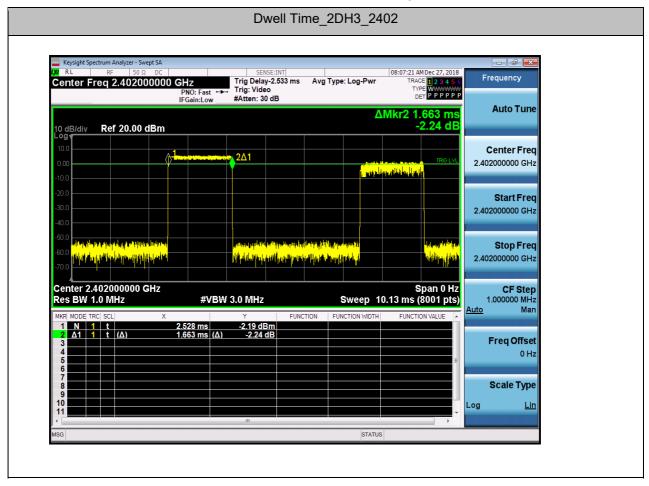



Report No.: GZEM181100248301


74 of 118 Page:

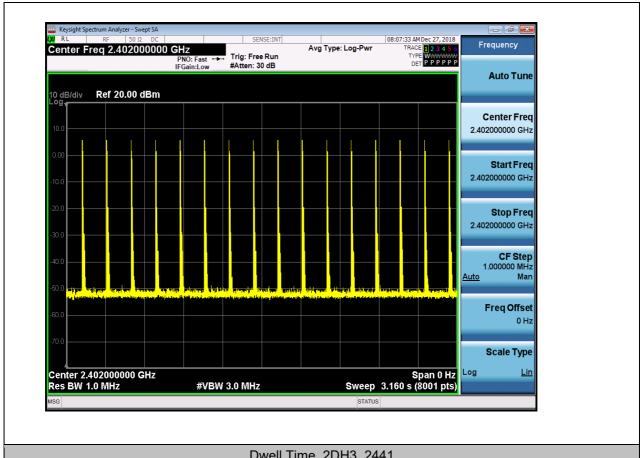




Report No.: GZEM181100248301

Page: 75 of 118

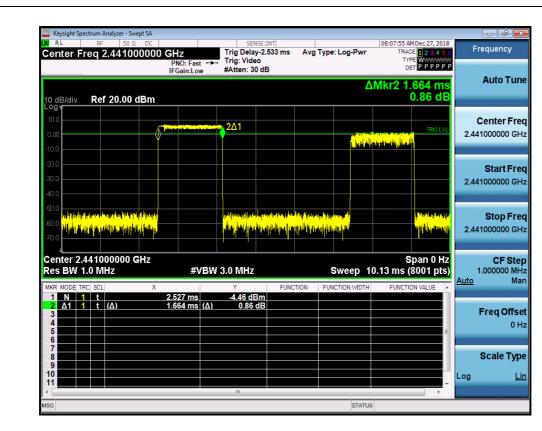


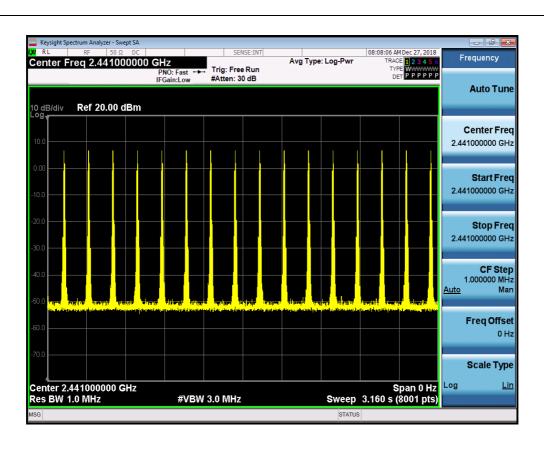



Report No.: GZEM181100248301


Page: 76 of 118

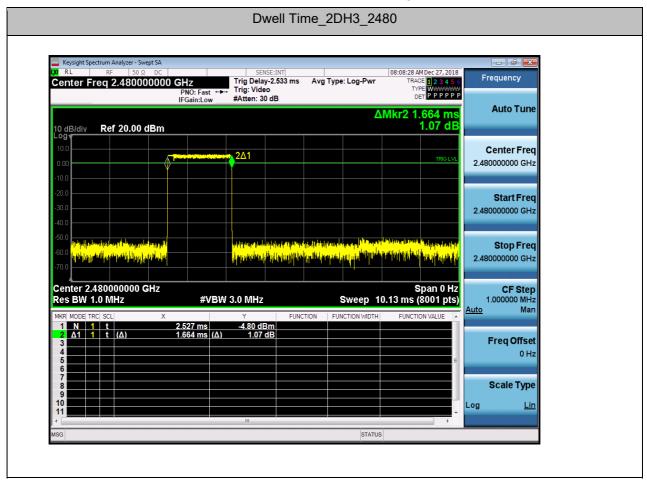



Report No.: GZEM181100248301


Page: 77 of 118

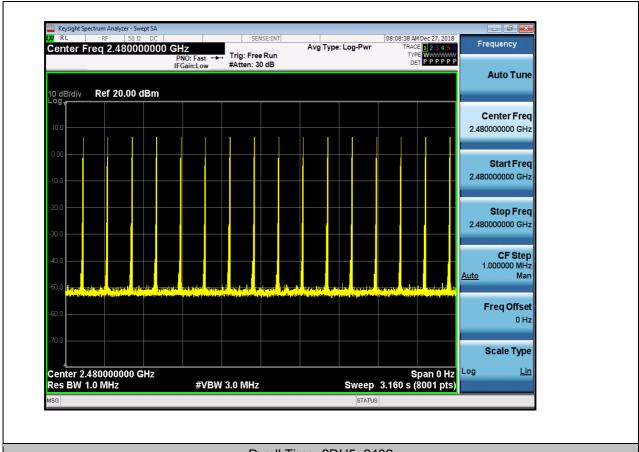




Report No.: GZEM181100248301

Page: 78 of 118

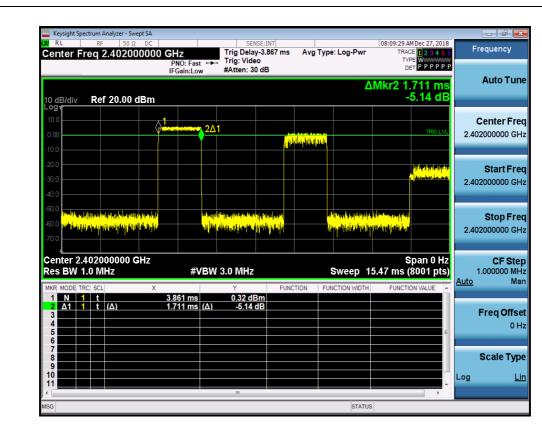


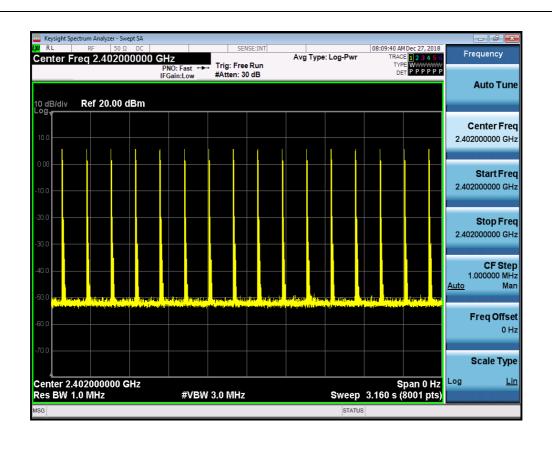



Report No.: GZEM181100248301


Page: 79 of 118

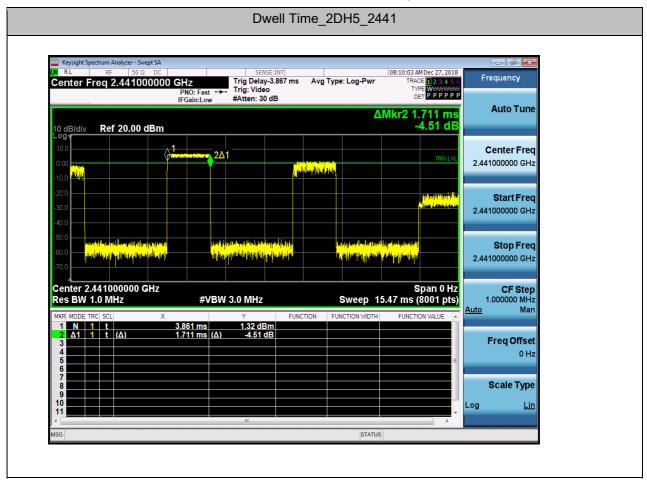



Report No.: GZEM181100248301

Page: 80 of 118

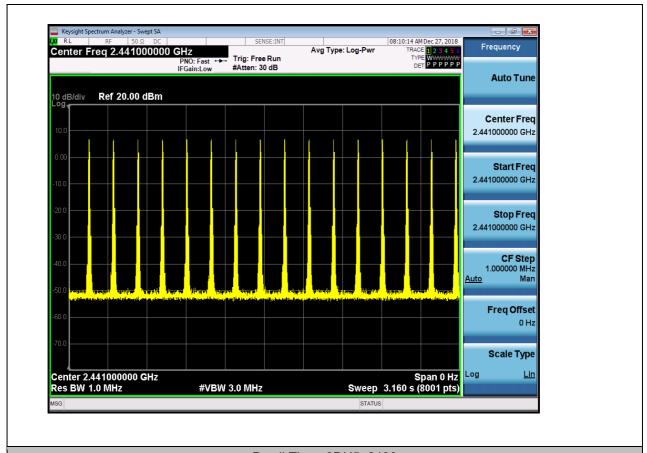



Dwell Time_2DH5_2480



Report No.: GZEM181100248301

Page: 81 of 118

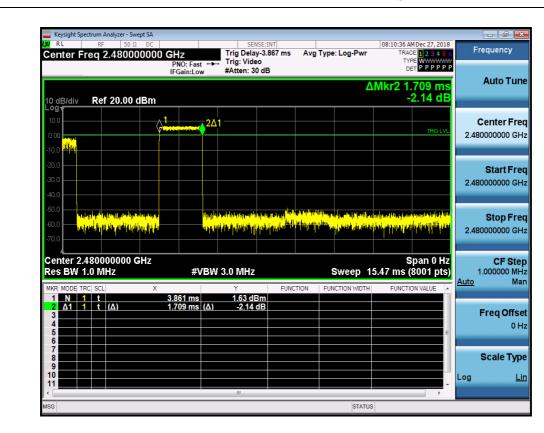


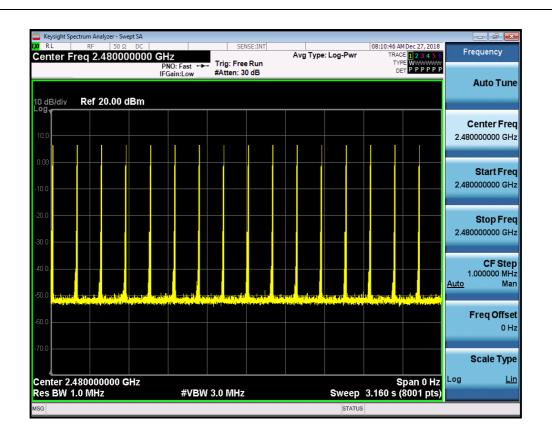



Report No.: GZEM181100248301


Page: 82 of 118

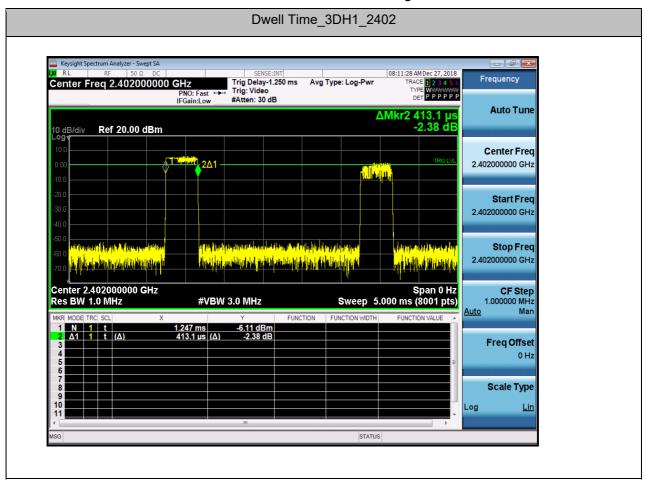



Report No.: GZEM181100248301


83 of 118 Page:

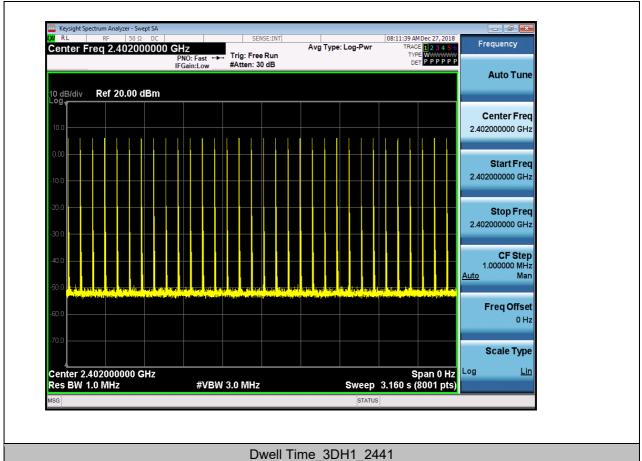




Report No.: GZEM181100248301

Page: 84 of 118

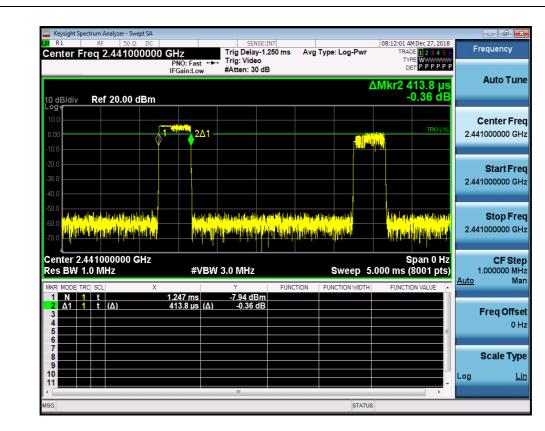


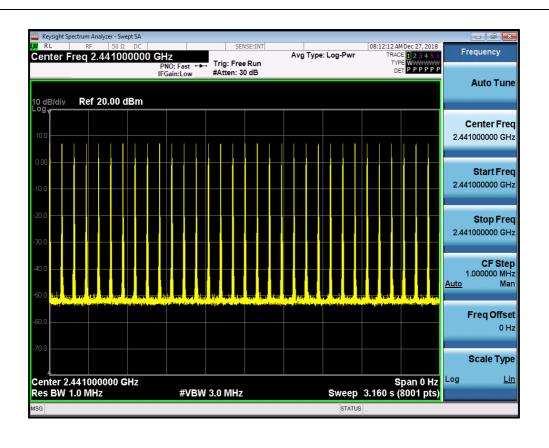



Report No.: GZEM181100248301


Page: 85 of 118

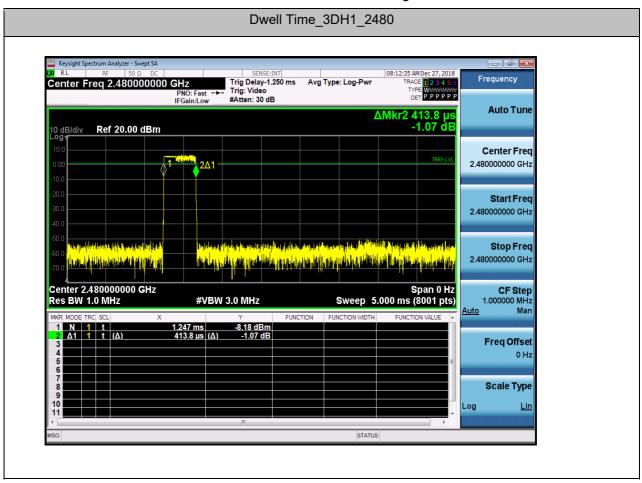



Report No.: GZEM181100248301


86 of 118 Page:

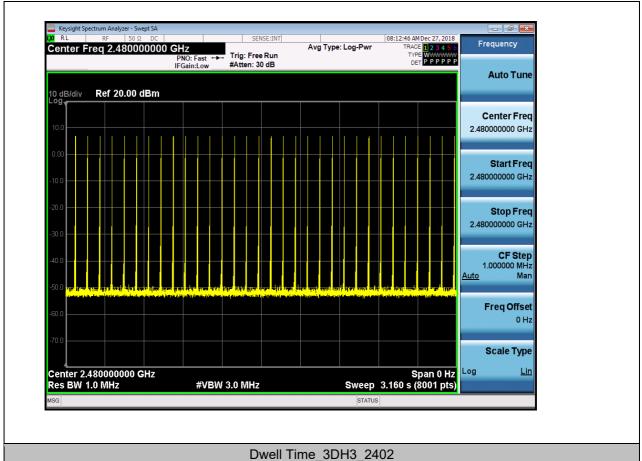




Report No.: GZEM181100248301

Page: 87 of 118

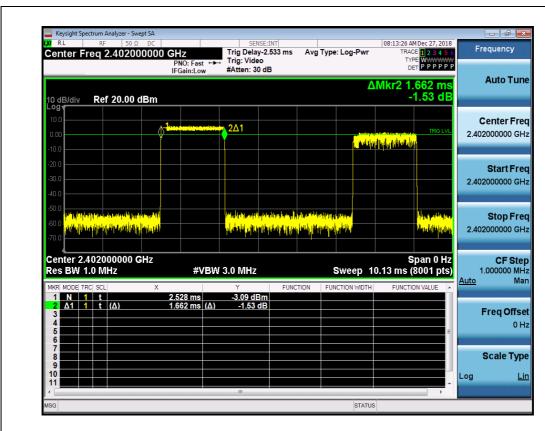


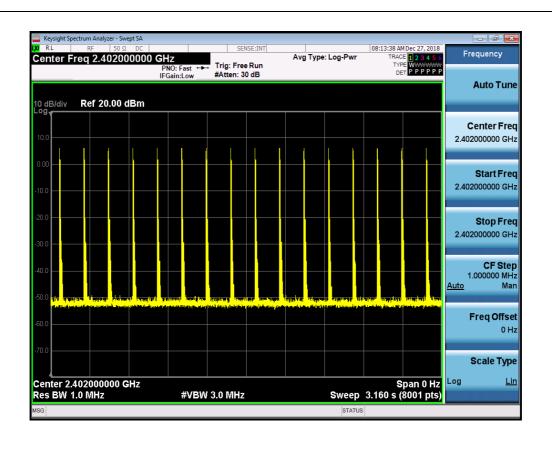



Report No.: GZEM181100248301


Page: 88 of 118

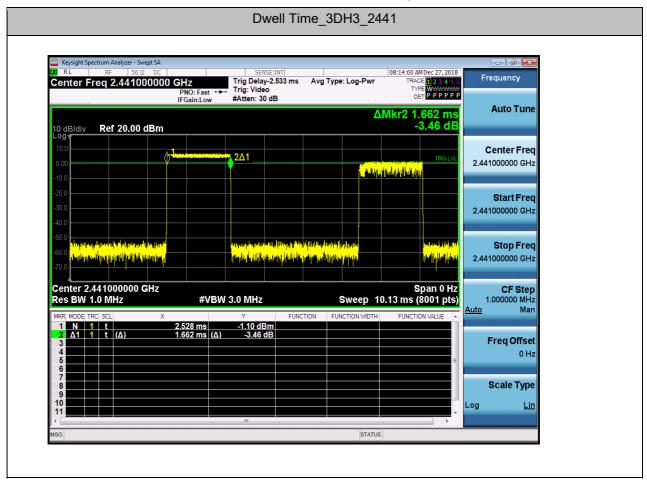



Report No.: GZEM181100248301


Page: 89 of 118

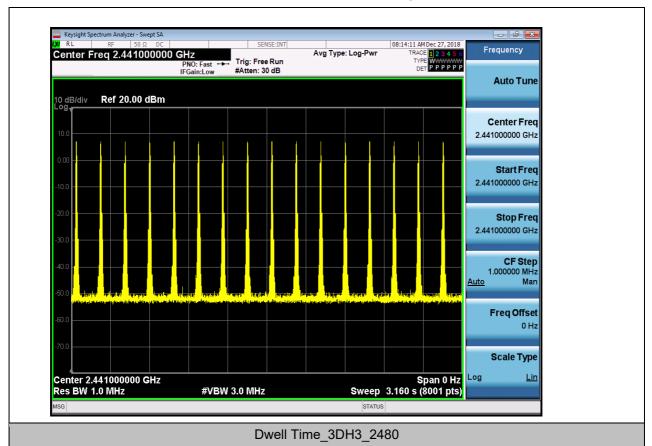




Report No.: GZEM181100248301

Page: 90 of 118

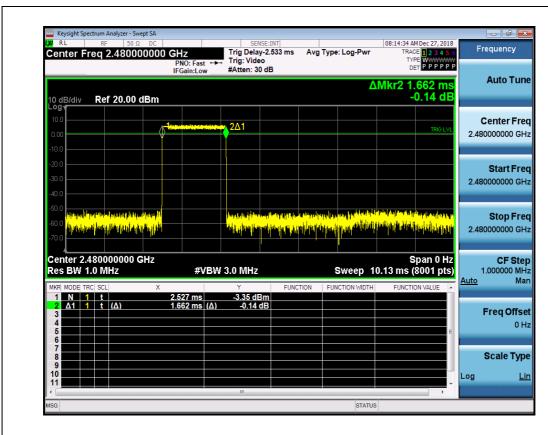


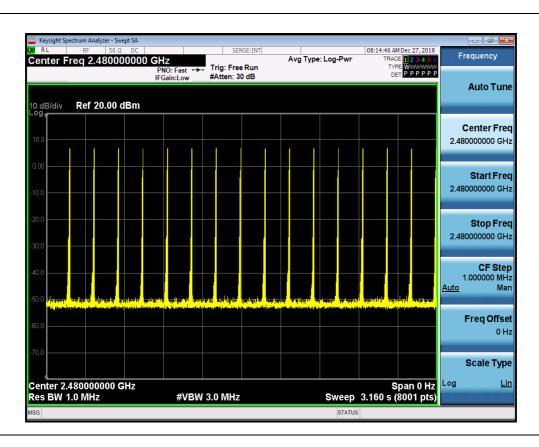



Report No.: GZEM181100248301


Page: 91 of 118

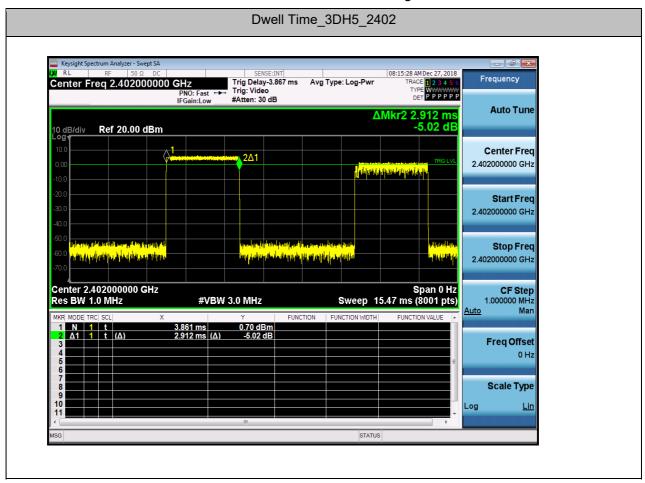



Report No.: GZEM181100248301

92 of 118 Page:

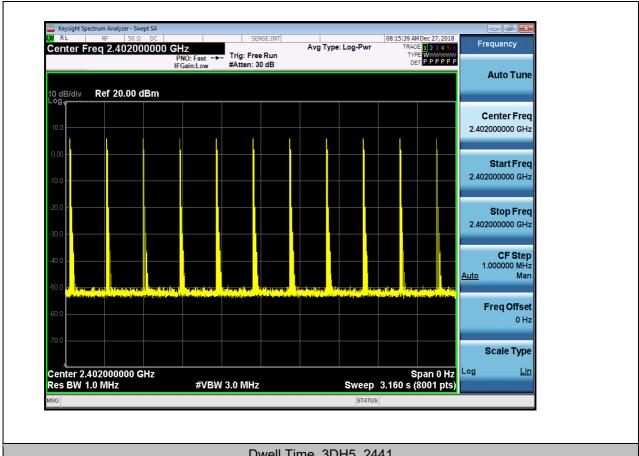



Dwell Time_3DH5_2441



Report No.: GZEM181100248301

Page: 93 of 118

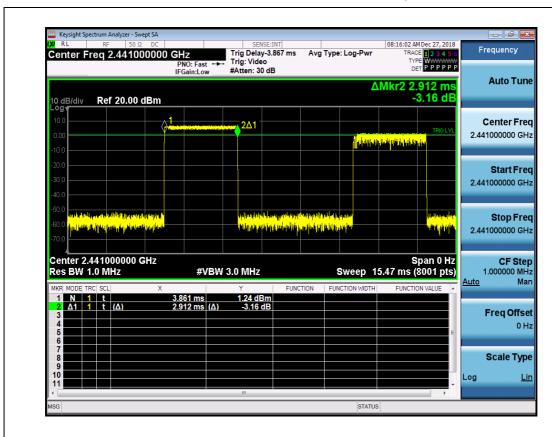


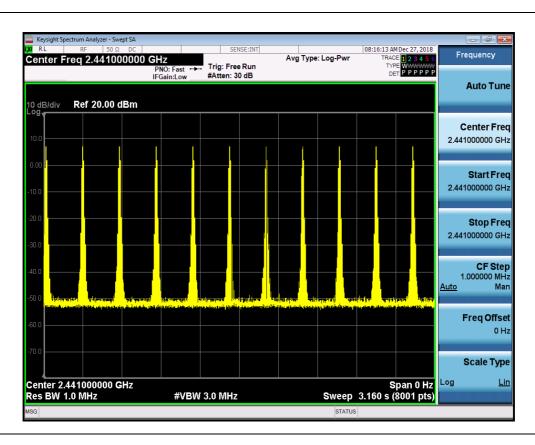



Report No.: GZEM181100248301


Page: 94 of 118

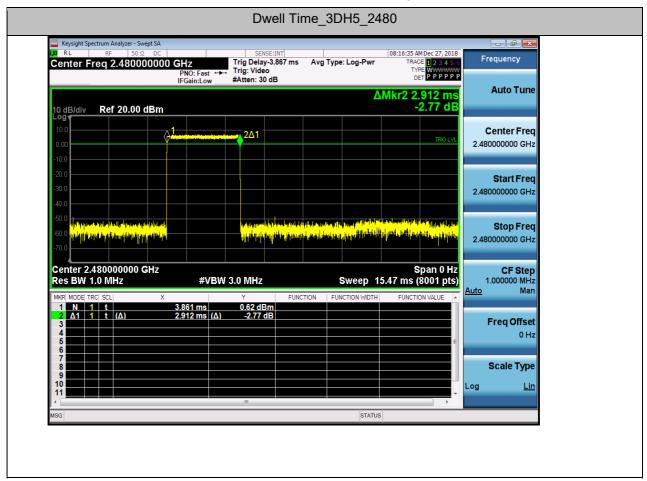



Report No.: GZEM181100248301

Page: 95 of 118

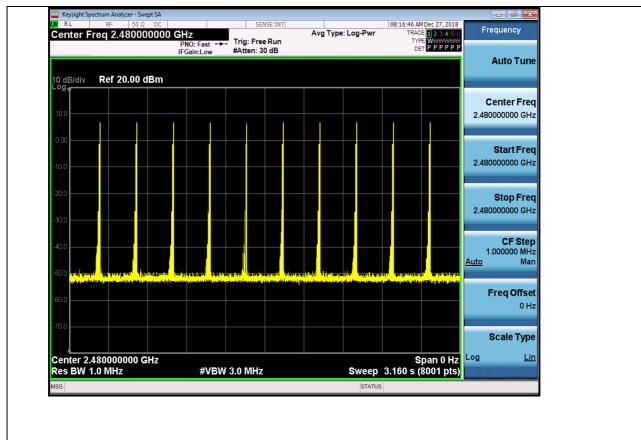


5. Hopping Channel Number

Test Mode	Test Channel	Number of Hopping Channel[N]	Limit[N]	Verdict
DH5	All channel hopping	79	>=15	PASS
2DH5	All channel hopping	79	>=15	PASS
3DH5	All channel hopping	79	>=15	PASS



Report No.: GZEM181100248301


Page: 96 of 118

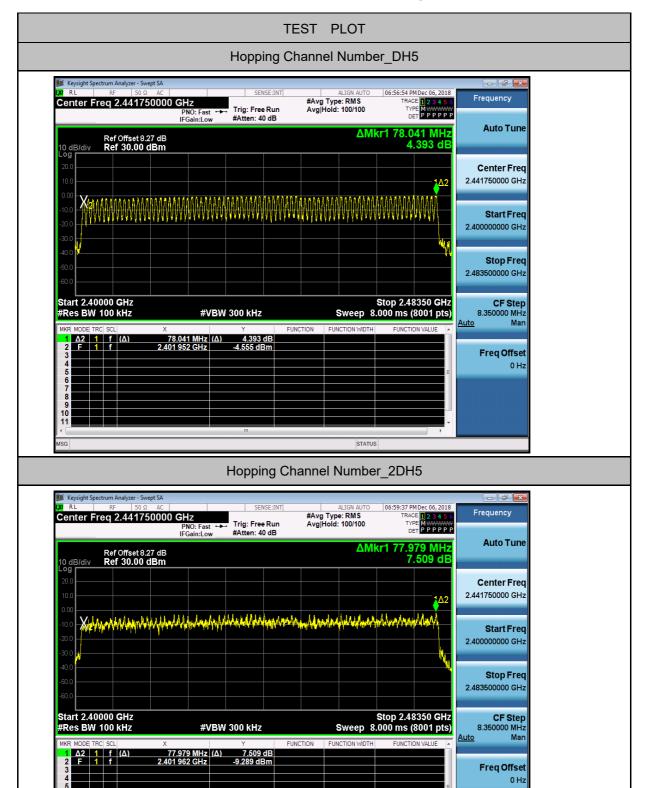



Report No.: GZEM181100248301

Page: 97 of 118

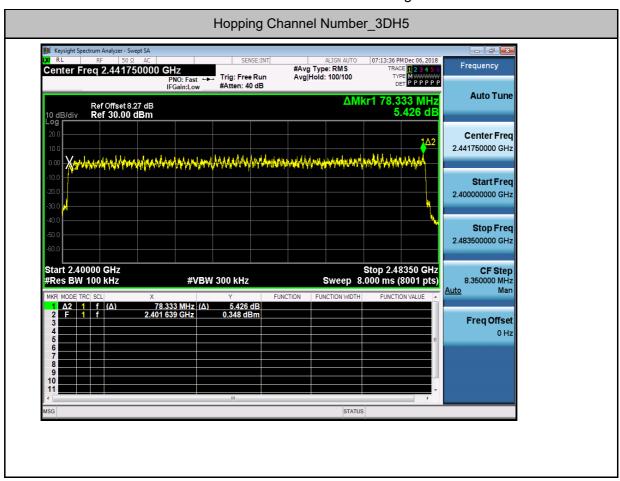


6.Band-edge for RF Conducted Emissions


Test Mode	Test Channel	Hopping	Carrier Power[dBm]	Max. Spurious Level [dBm]	Limit[dBm]	Verdict
DH5	2402	On	-0.829	-38.866	-20.83	PASS
DH5	2402	Off	-0.288	-39.367	-20.29	PASS
DH5	2480	On	0.343	-36.510	-19.66	PASS
DH5	2480	Off	0.326	-40.169	-19.67	PASS
2DH5	2402	On	-2.936	-39.478	-22.94	PASS
2DH5	2402	Off	-1.042	-40.100	-21.04	PASS
2DH5	2480	On	-1.588	-39.187	-21.59	PASS
2DH5	2480	Off	-2.599	-39.739	-22.6	PASS
3DH5	2402	On	5.406	-39.423	-14.59	PASS
3DH5	2402	Off	-1.084	-39.774	-21.08	PASS
3DH5	2480	On	6.718	-39.353	-13.28	PASS
3DH5	2480	Off	-1.473	-39.686	-21.47	PASS




Report No.: GZEM181100248301


98 of 118 Page:

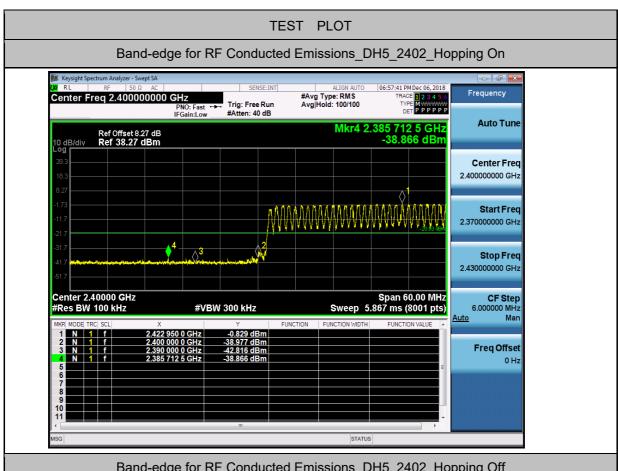

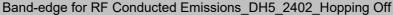


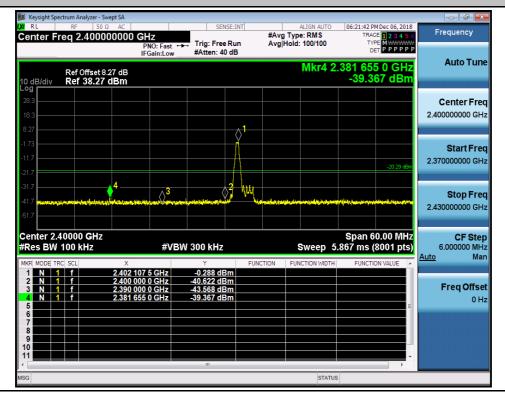




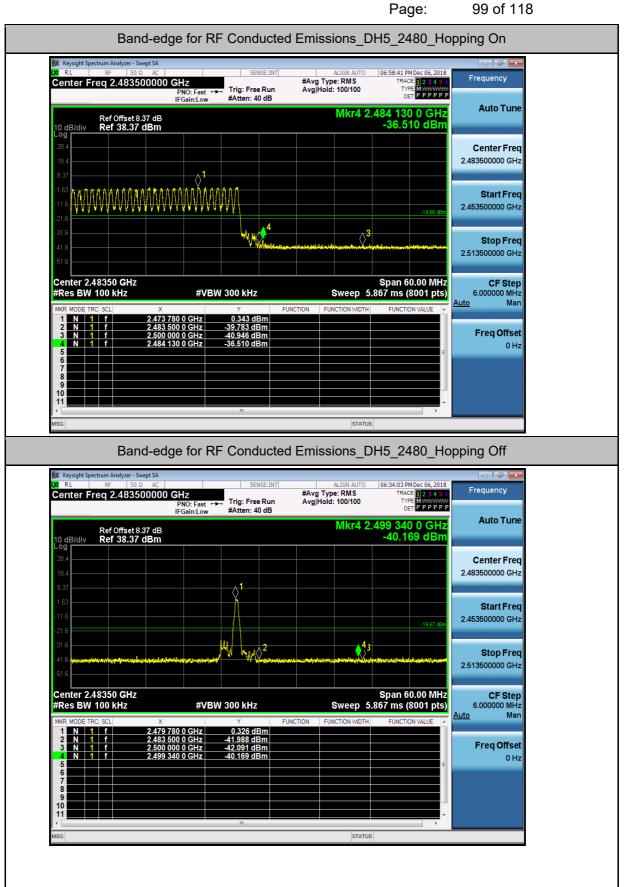



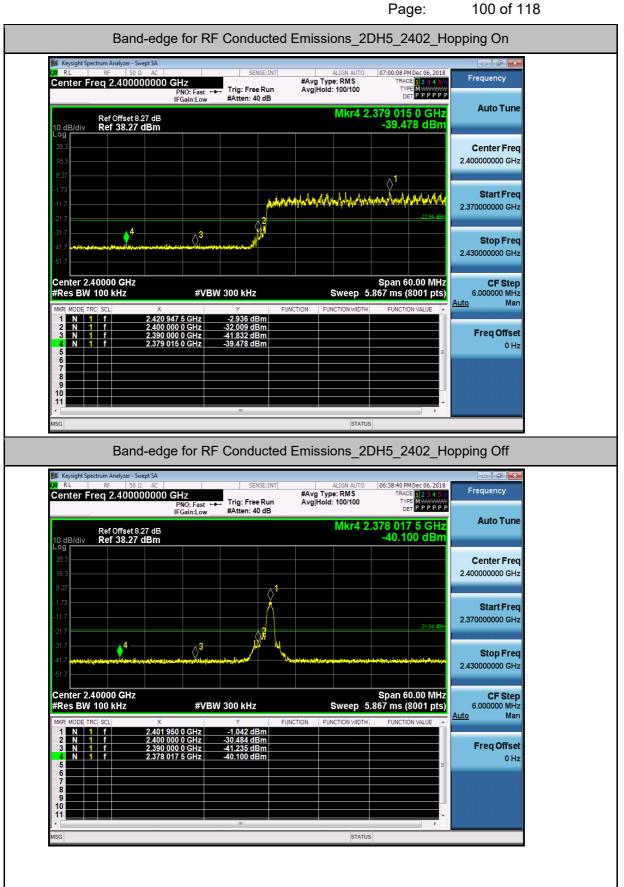




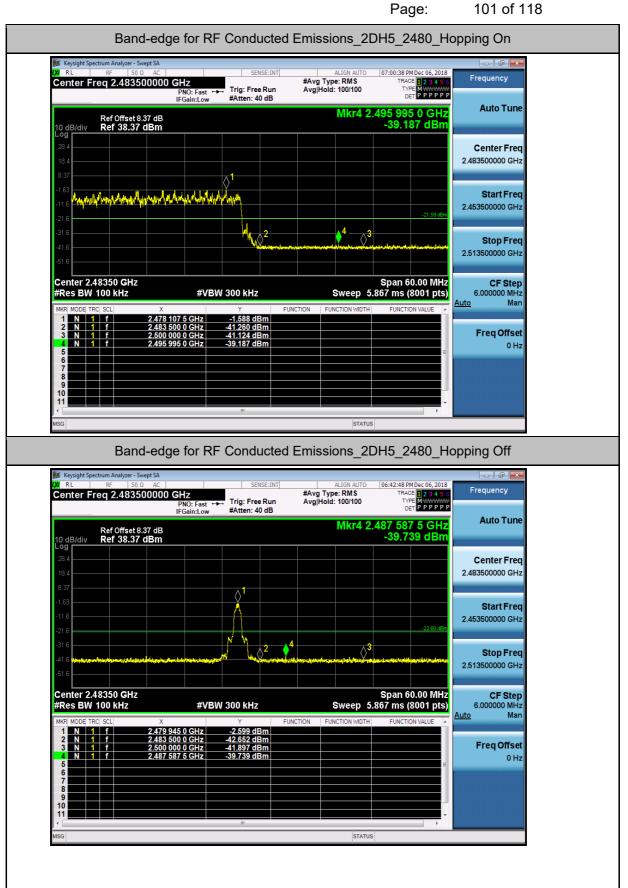





Report No.: GZEM181100248301

Page: 102 of 118

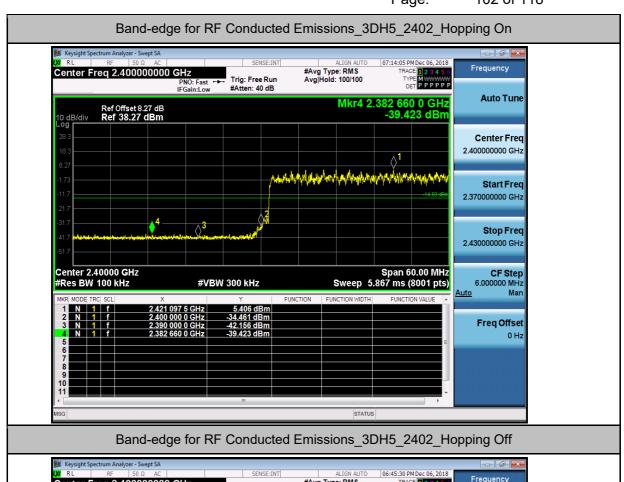

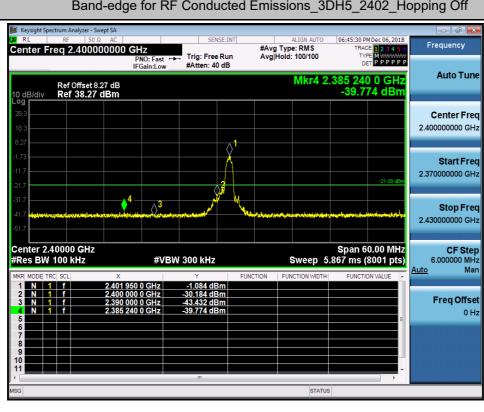



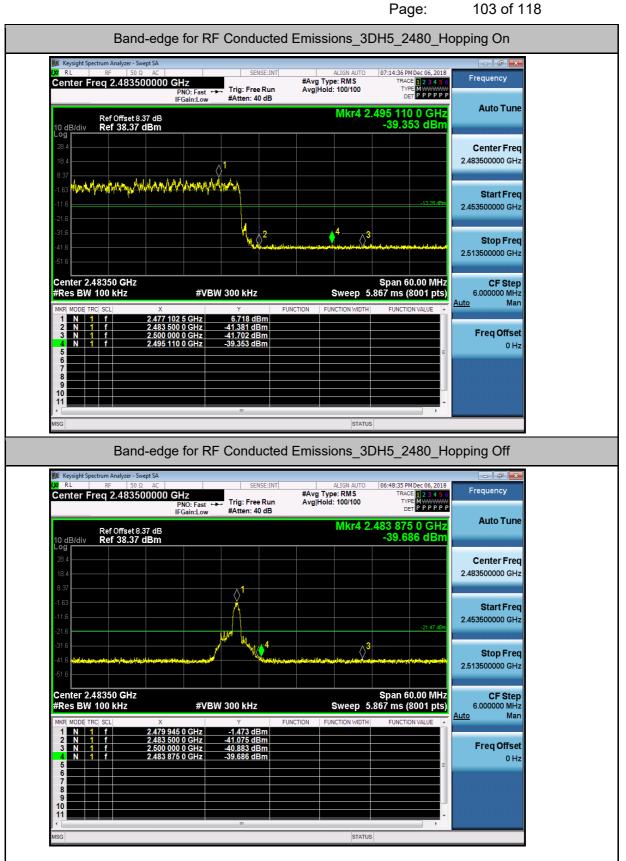



Report No.: GZEM181100248301

Page: 104 of 118


7.RF Conducted Spurious Emissions

Test Mode	Test Channel	StartFre [MHz]	StopFre [MHz]	RBW [kHz]	VBW [kHz]	Pref[dBm]	Max. Level [dBm]	Limit [dBm]	Verdict
DH5	2402	30	10000	100	300	0.413	-46.503	<- 19.587	PASS
DH5	2402	10000	26000	100	300	0.413	-45.022	<- 19.587	PASS
DH5	2441	30	10000	100	300	0.34	-47.144	<-19.66	PASS
DH5	2441	10000	26000	100	300	0.34	-44.349	<-19.66	PASS
DH5	2480	30	10000	100	300	0.102	-46.815	<- 19.898	PASS
DH5	2480	10000	26000	100	300	0.102	-44.036	<- 19.898	PASS
2DH5	2402	30	10000	100	300	0.17	-47.664	<-19.83	PASS
2DH5	2402	10000	26000	100	300	0.17	-44.788	<-19.83	PASS
2DH5	2441	30	10000	100	300	0.38	-46.799	<-19.62	PASS
2DH5	2441	10000	26000	100	300	0.38	-43.886	<-19.62	PASS
2DH5	2480	30	10000	100	300	0.332	-46.808	<- 19.668	PASS
2DH5	2480	10000	26000	100	300	0.332	-44.197	<- 19.668	PASS
3DH5	2402	30	10000	100	300	0.116	-46.914	<- 19.884	PASS
3DH5	2402	10000	26000	100	300	0.116	-44.021	<- 19.884	PASS
3DH5	2441	30	10000	100	300	0.616	-47.543	<- 19.384	PASS
3DH5	2441	10000	26000	100	300	0.616	-43.725	<- 19.384	PASS
3DH5	2480	30	10000	100	300	0.437	-47.134	<- 19.563	PASS
3DH5	2480	10000	26000	100	300	0.437	-44.499	<- 19.563	PASS



Report No.: GZEM181100248301

Page: 105 of 118

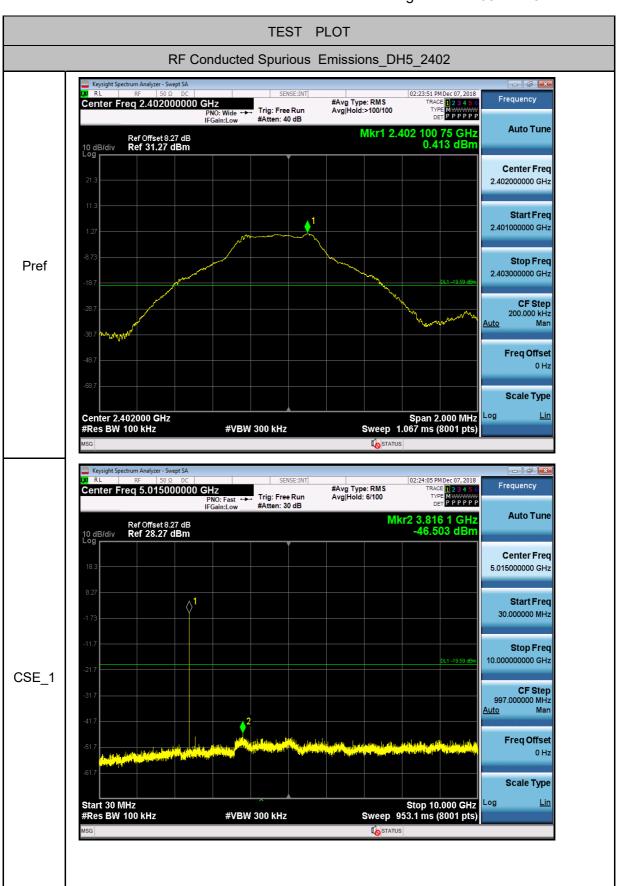




Pref

SGS-CSTC Standards Technical Services Co., Ltd. Guangzhou Branch

Report No.: GZEM181100248301

Page: 106 of 118

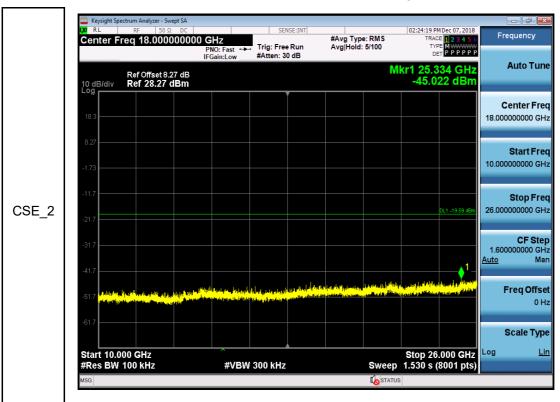


RF Conducted Spurious Emissions_DH5_2441






Report No.: GZEM181100248301

Page: 107 of 118

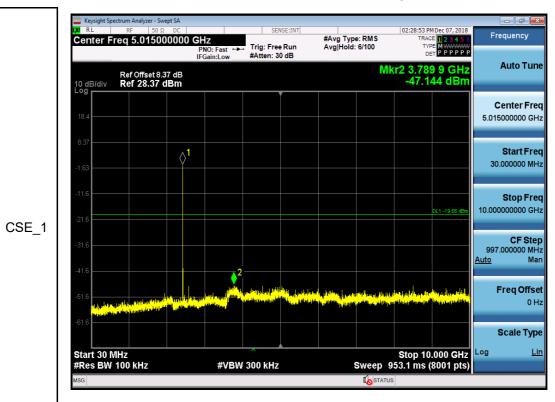


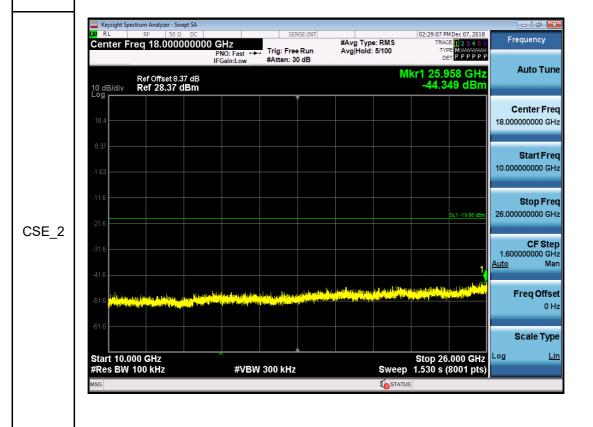



Report No.: GZEM181100248301


Page: 108 of 118

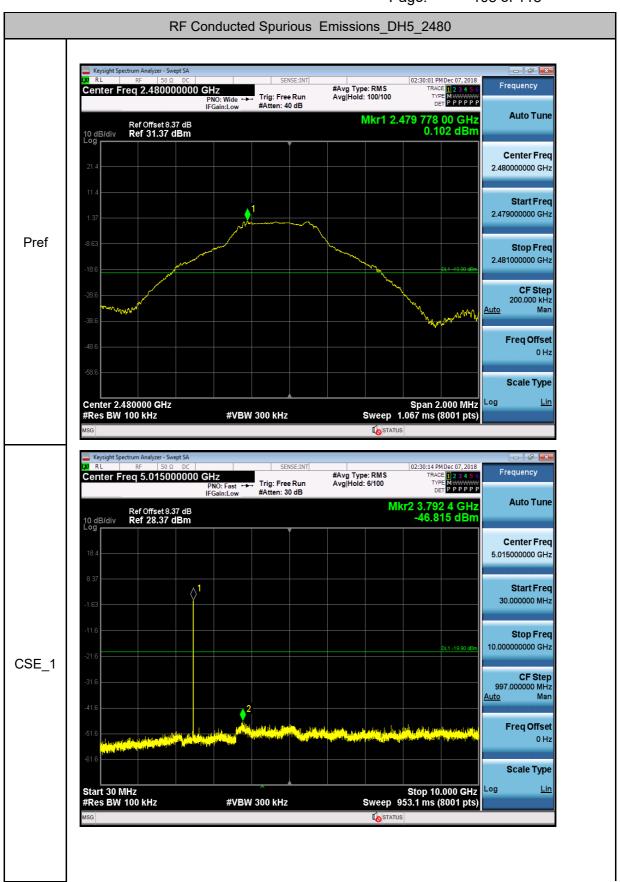




Report No.: GZEM181100248301

Page: 109 of 118

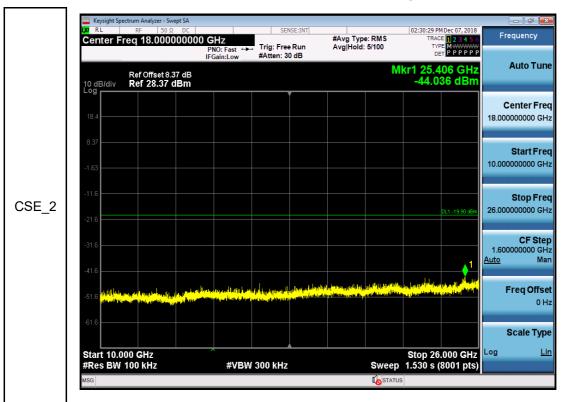


RF Conducted Spurious Emissions_2DH5_2402

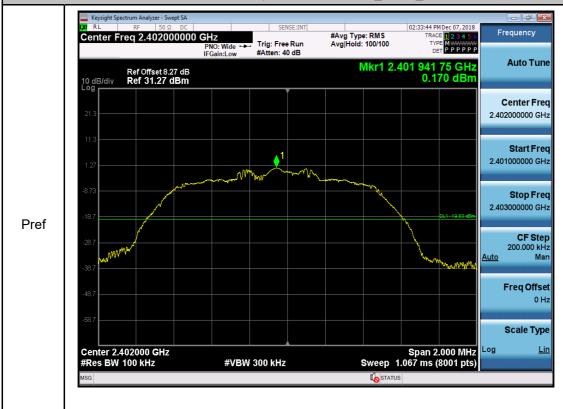




Report No.: GZEM181100248301

Page: 110 of 118

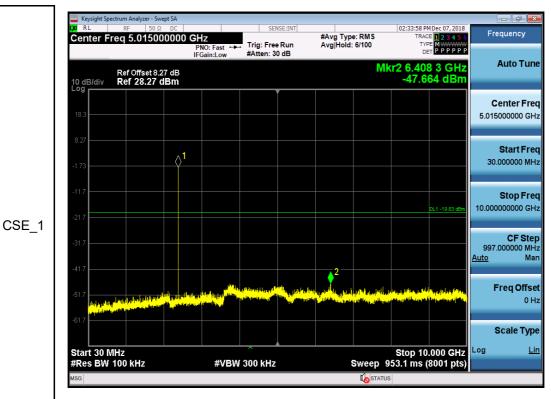


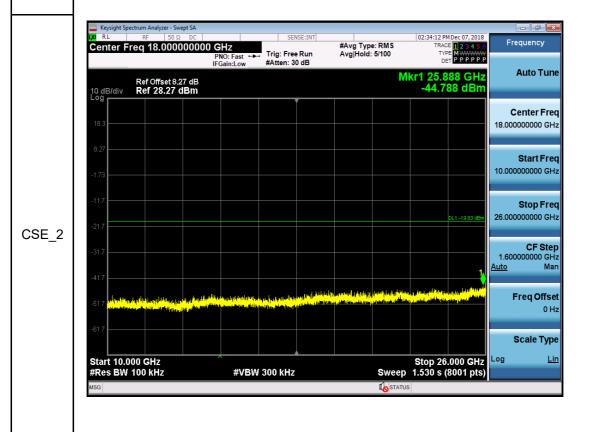



Report No.: GZEM181100248301


Page: 111 of 118

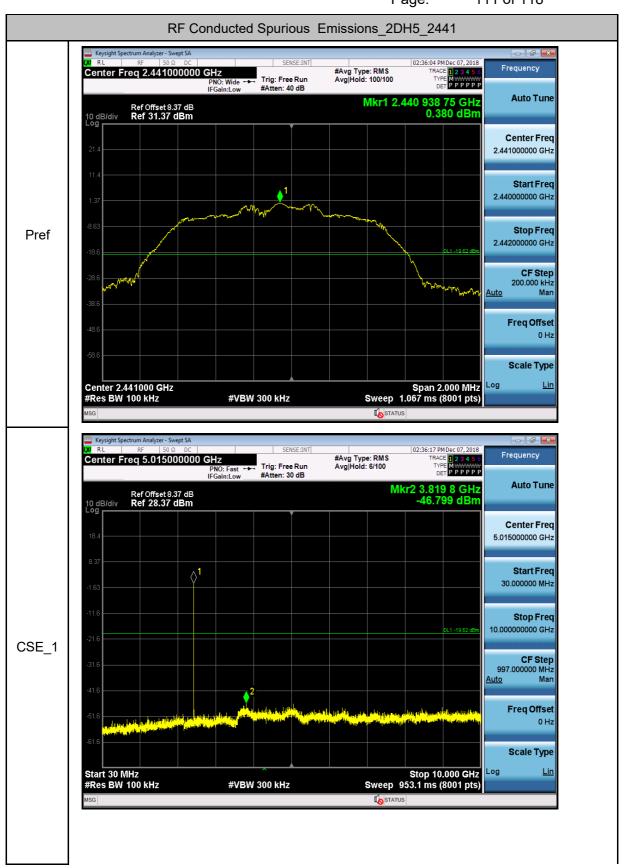



Report No.: GZEM181100248301

Page: 112 of 118

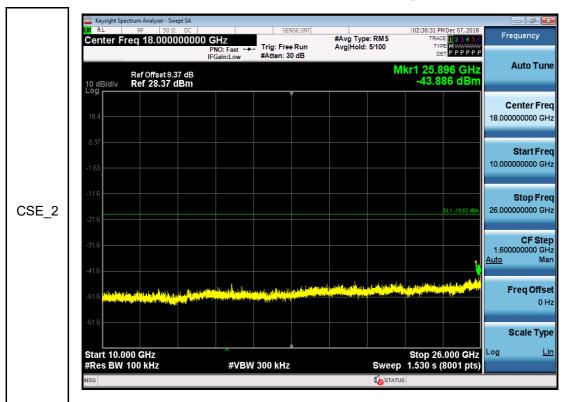


RF Conducted Spurious Emissions_2DH5_2480






Report No.: GZEM181100248301

Page: 113 of 118

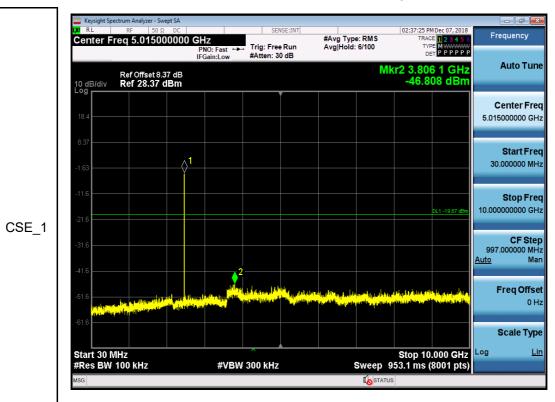


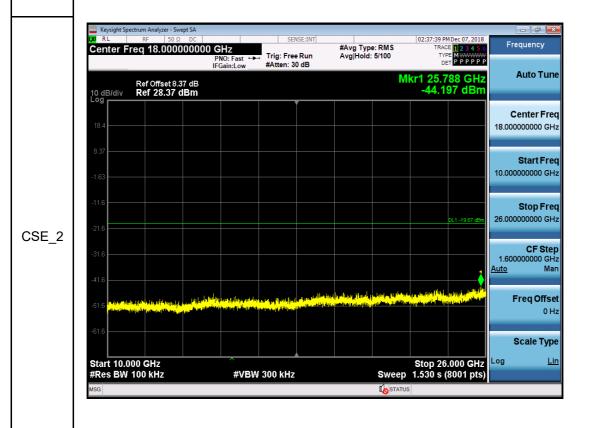



Report No.: GZEM181100248301


Page: 114 of 118

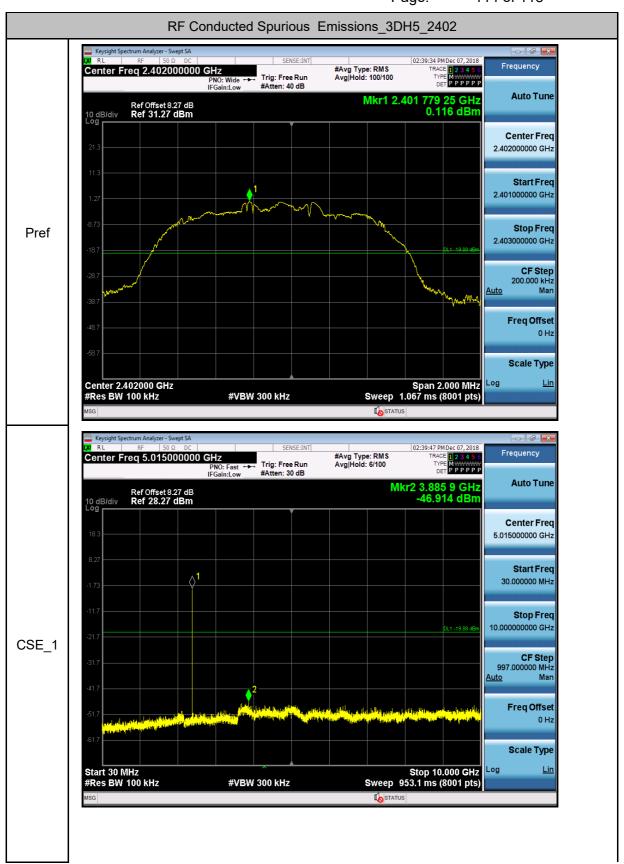



Report No.: GZEM181100248301

Page: 115 of 118

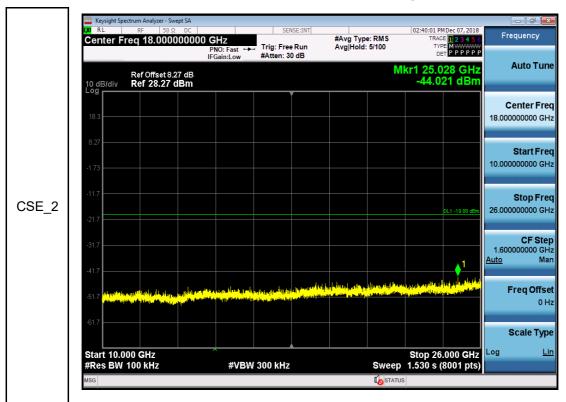


RF Conducted Spurious Emissions_3DH5_2441






Report No.: GZEM181100248301

Page: 116 of 118

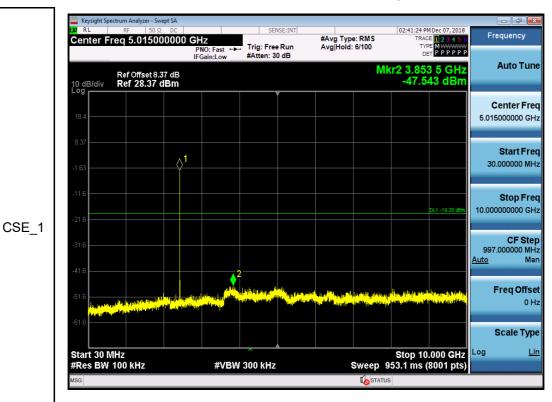


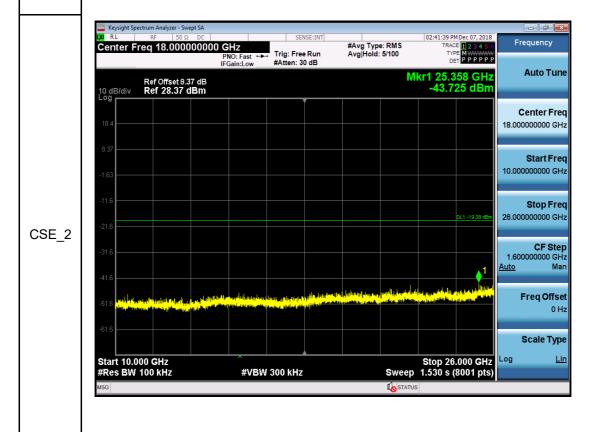



Report No.: GZEM181100248301


Page: 117 of 118

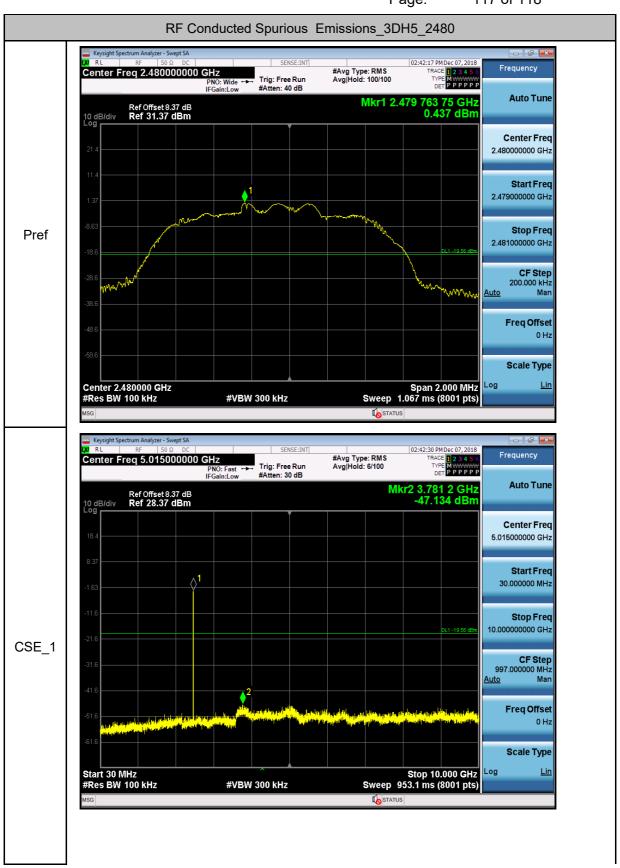



Report No.: GZEM181100248301

Page: 118 of 118

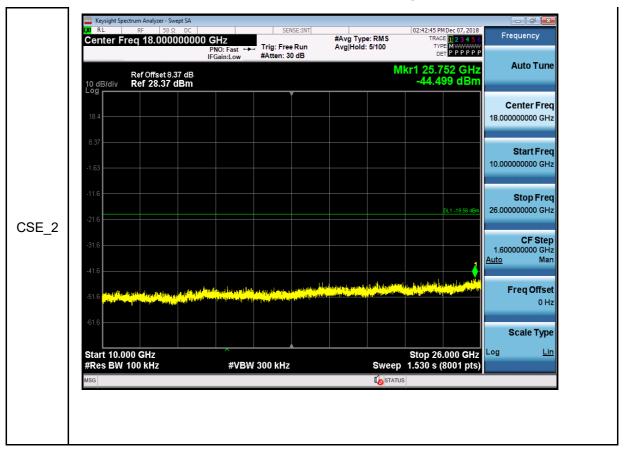

-- End of Report --