





Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

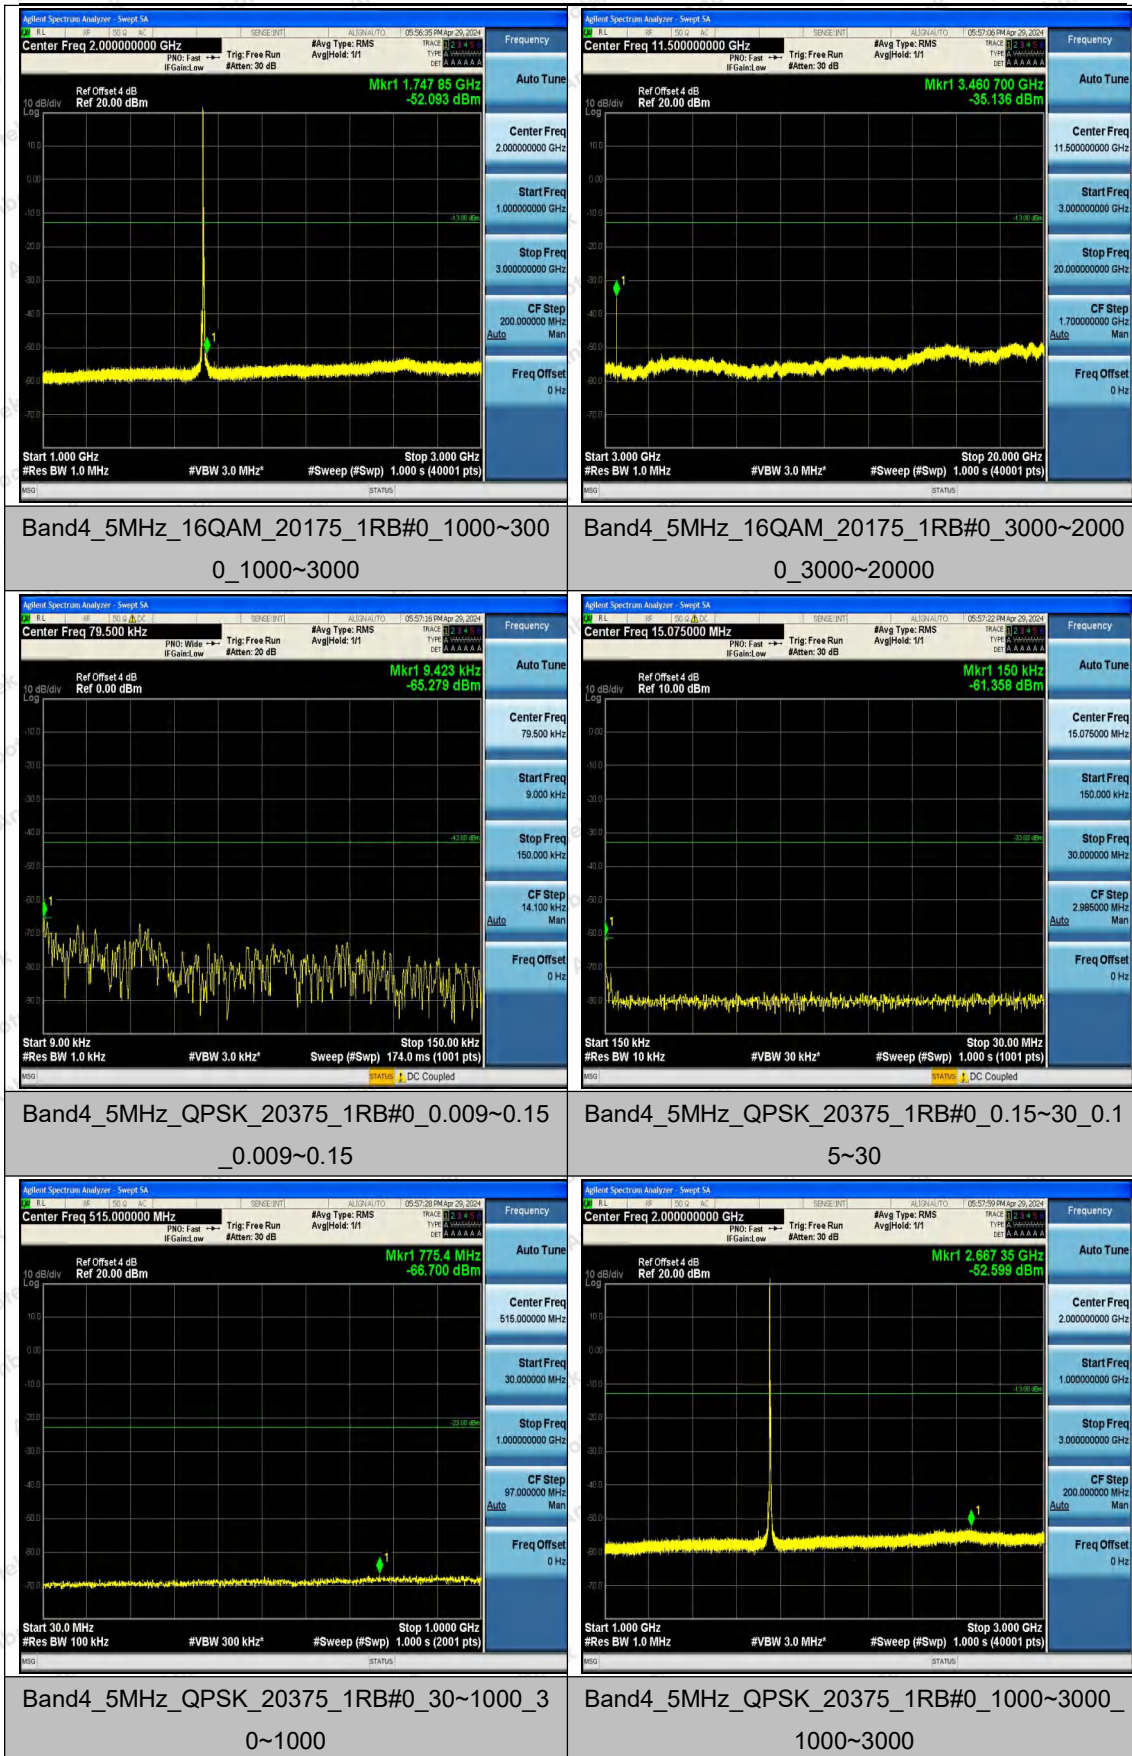

Hotline
 400-003-0500
 www.anbotek.com.cn



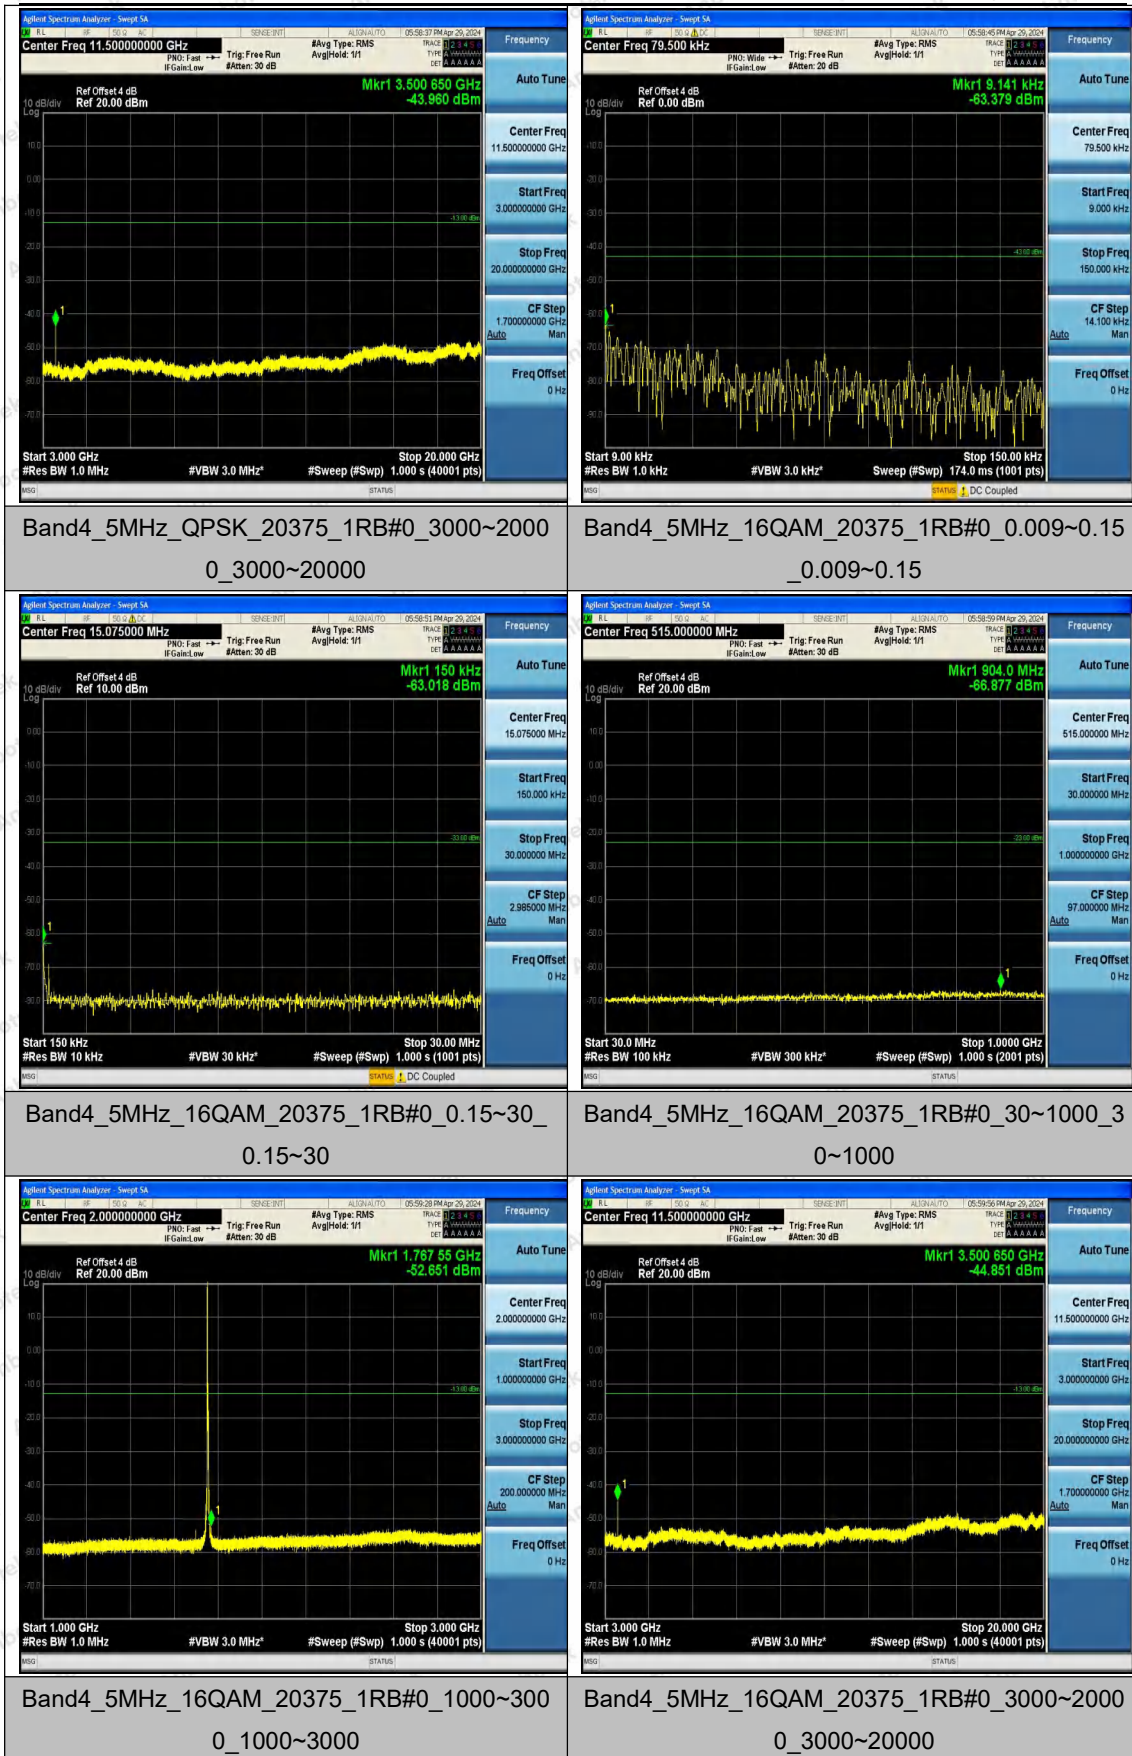


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



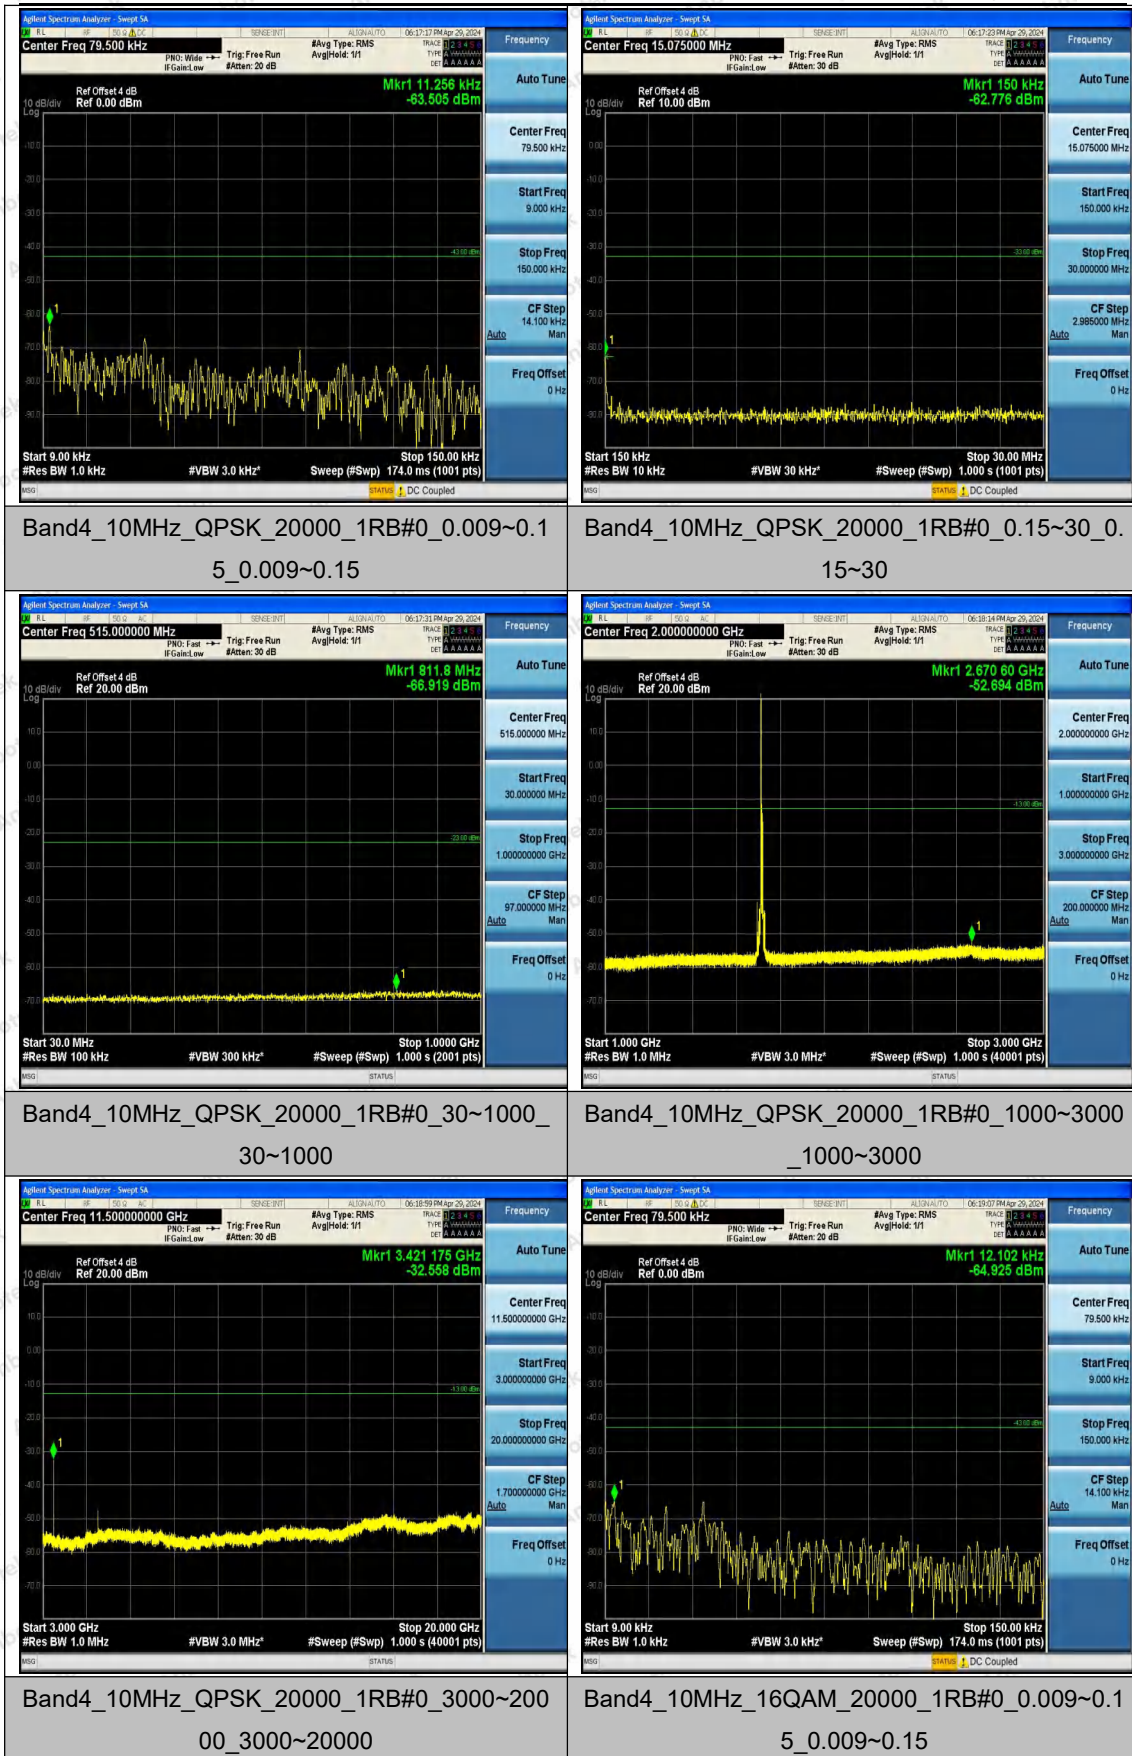


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



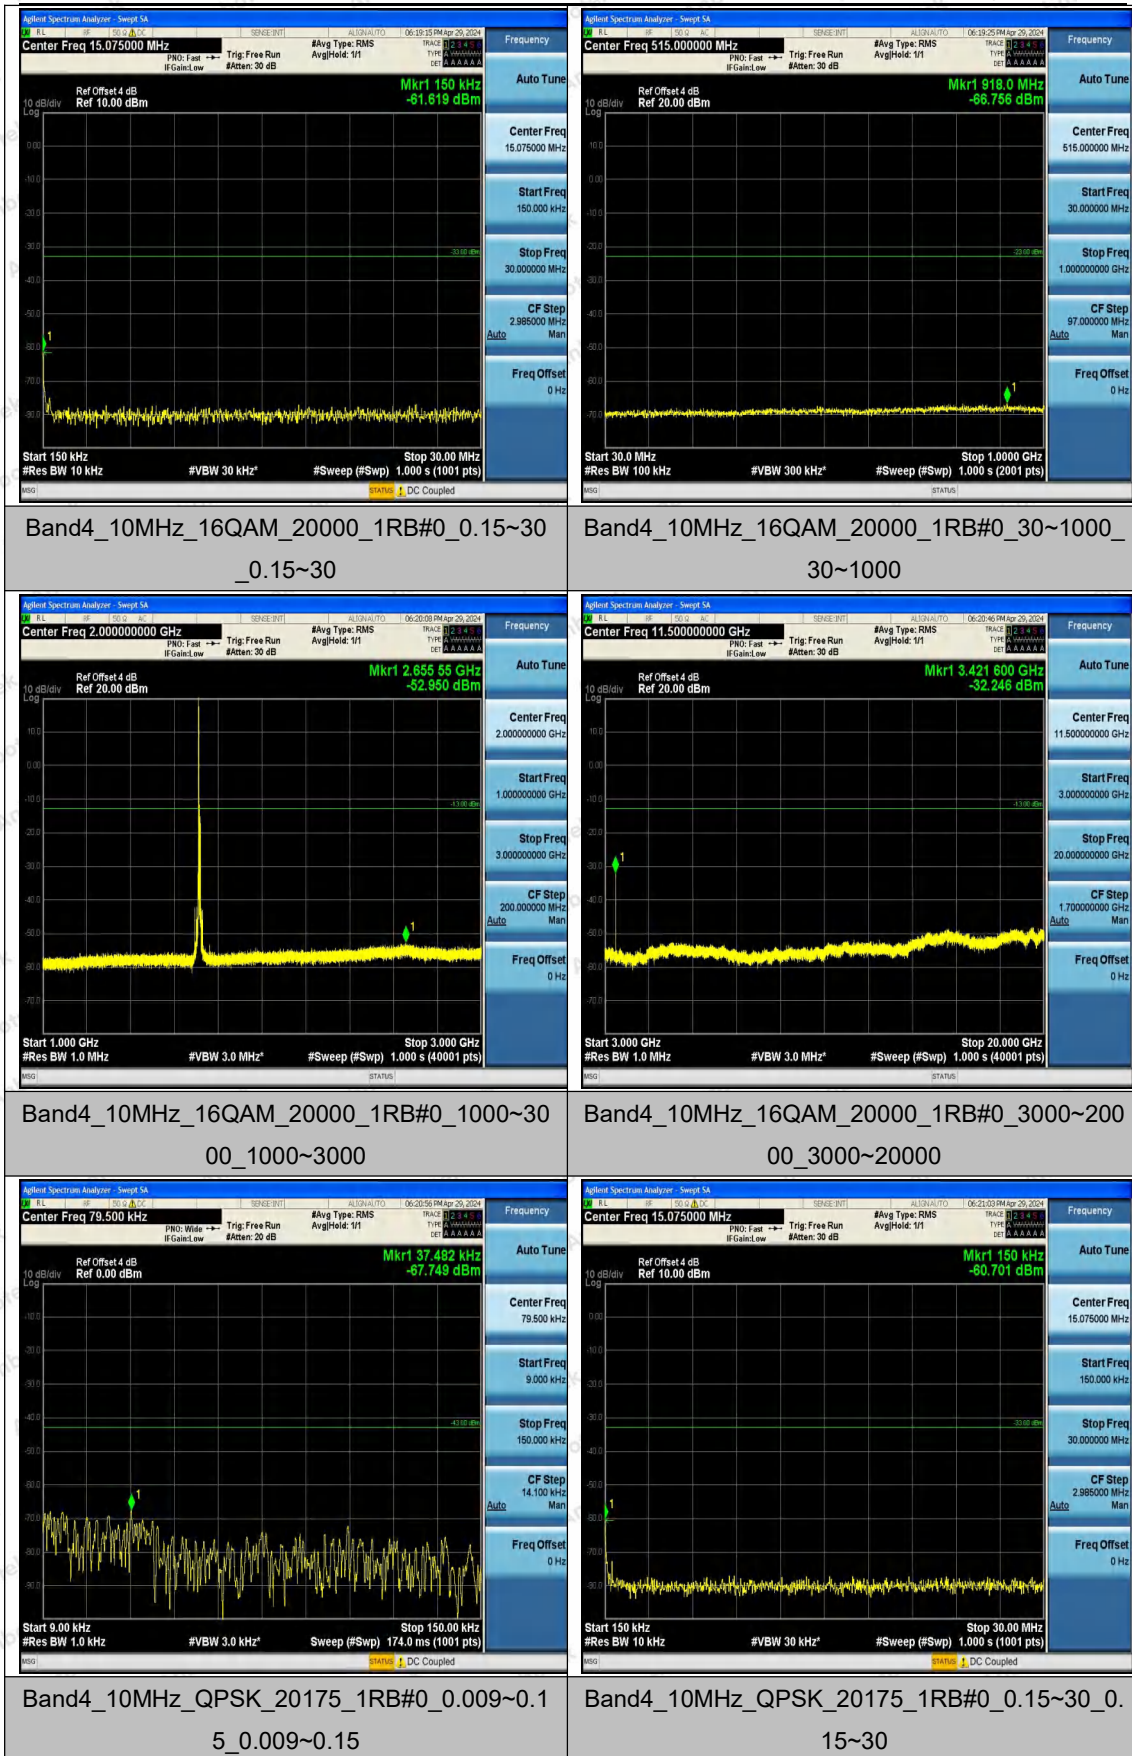


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



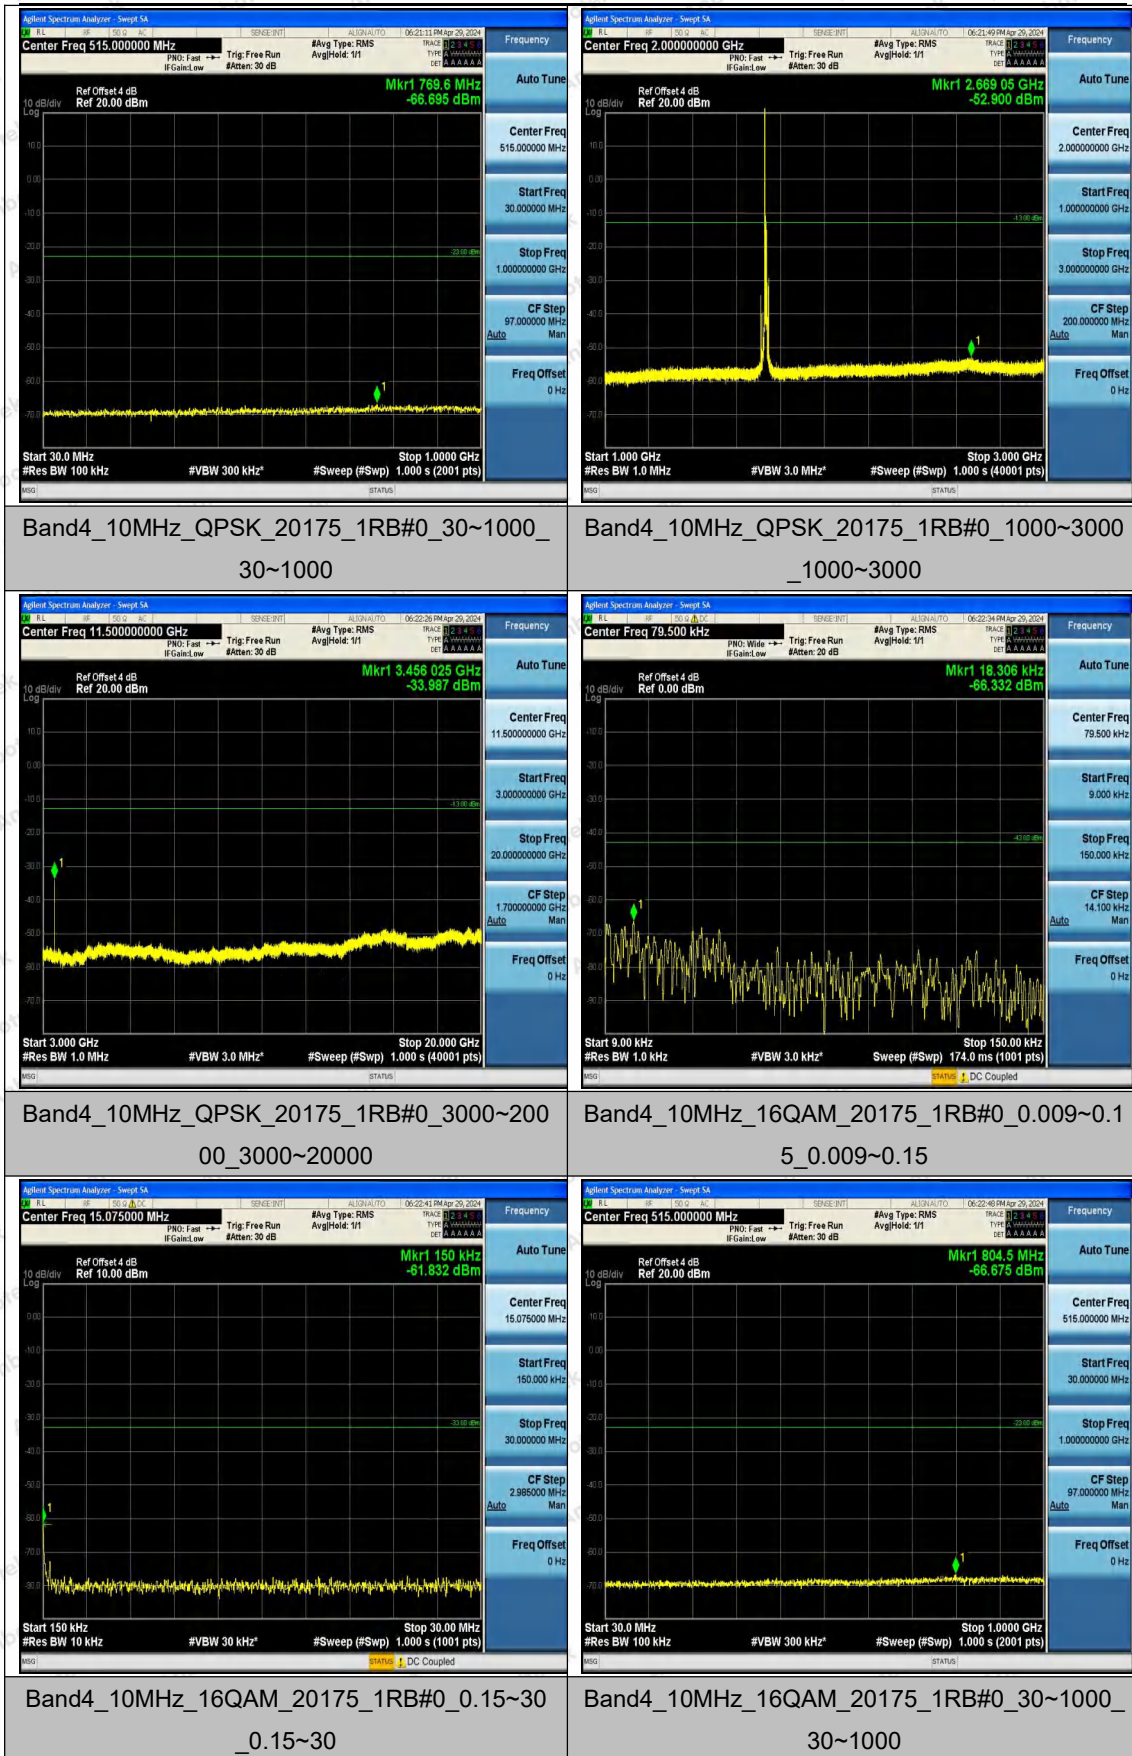


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



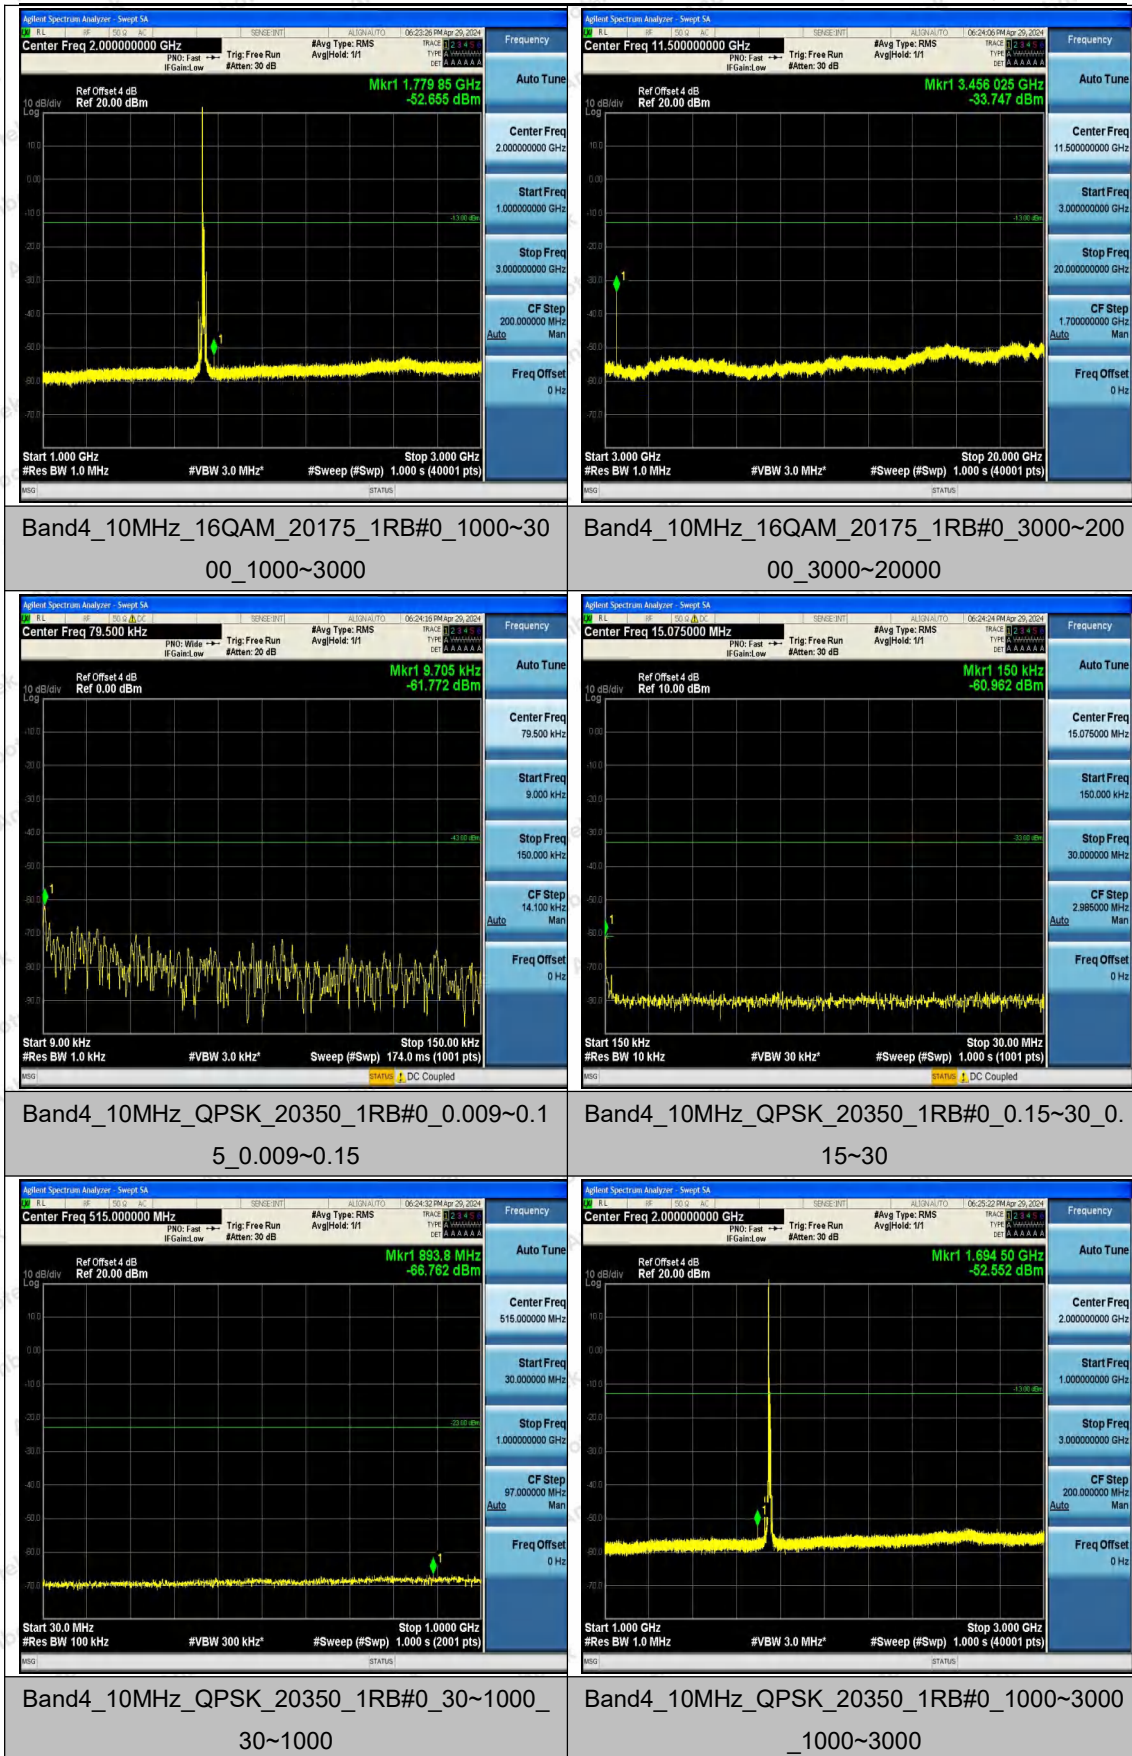


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



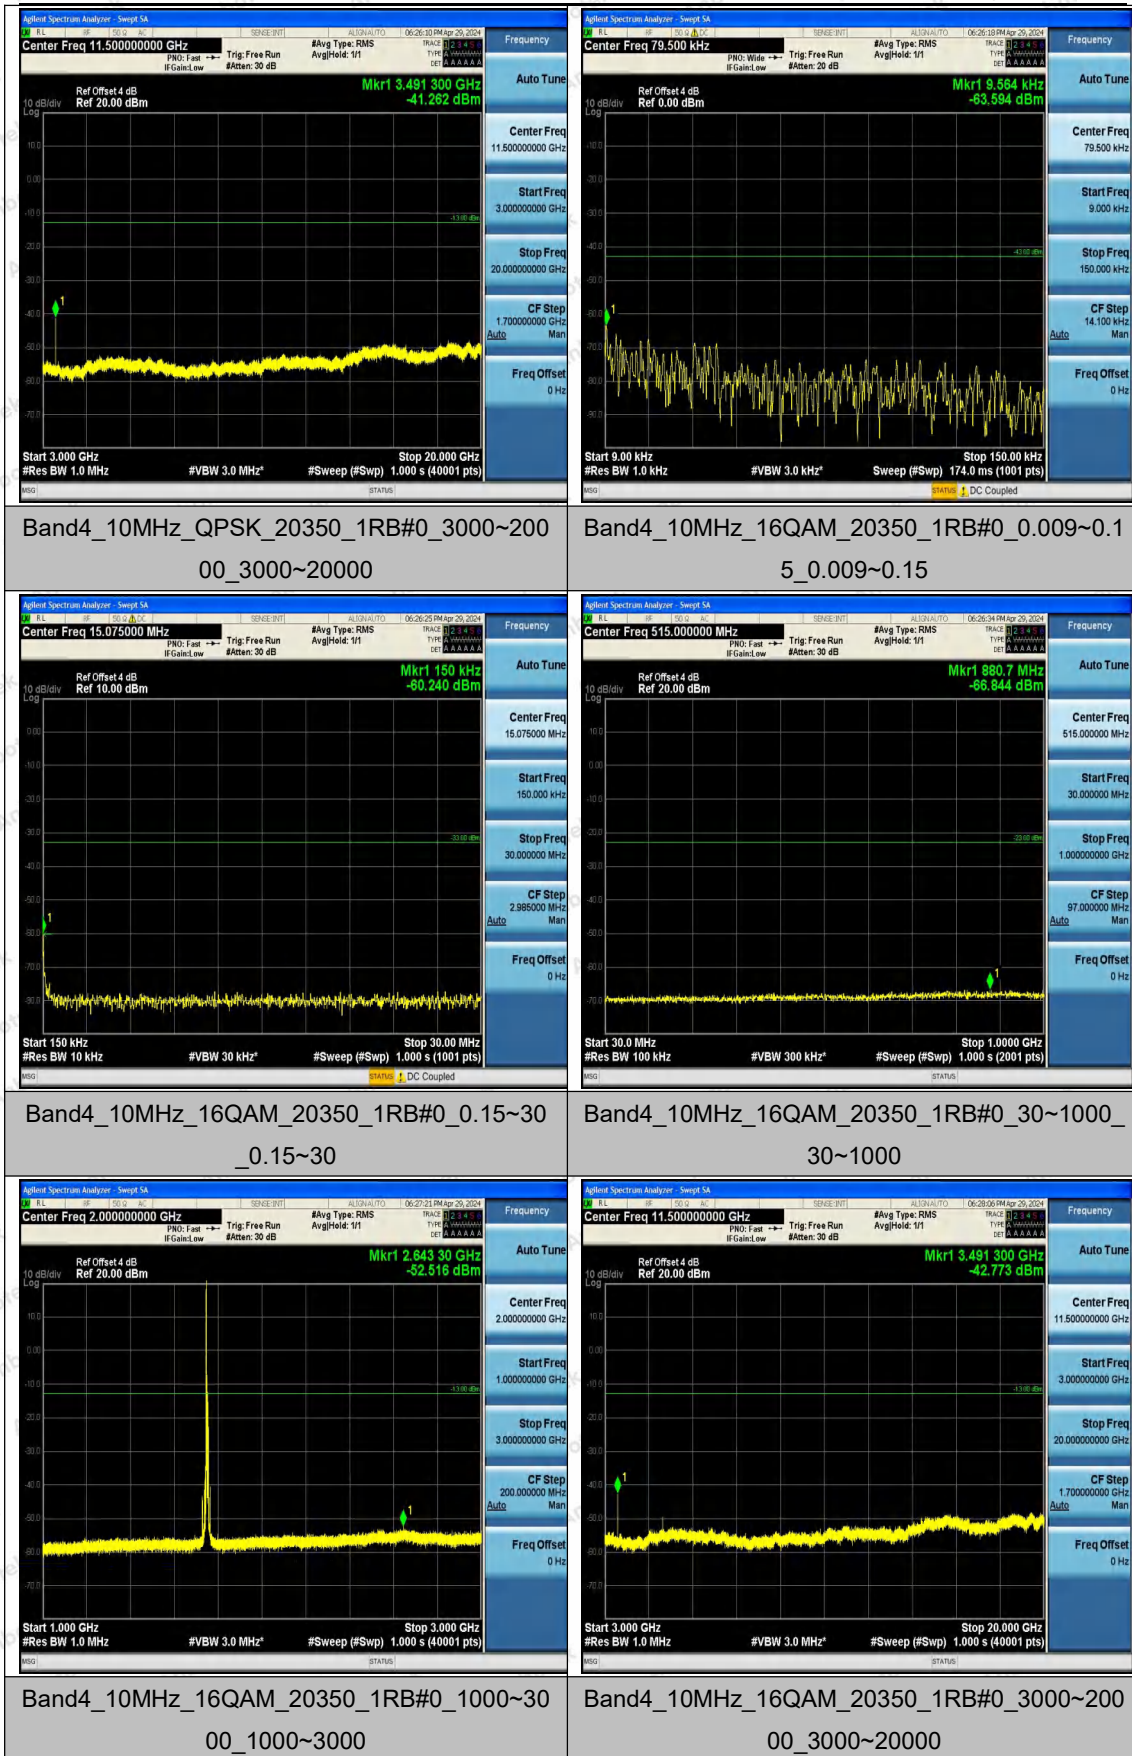


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



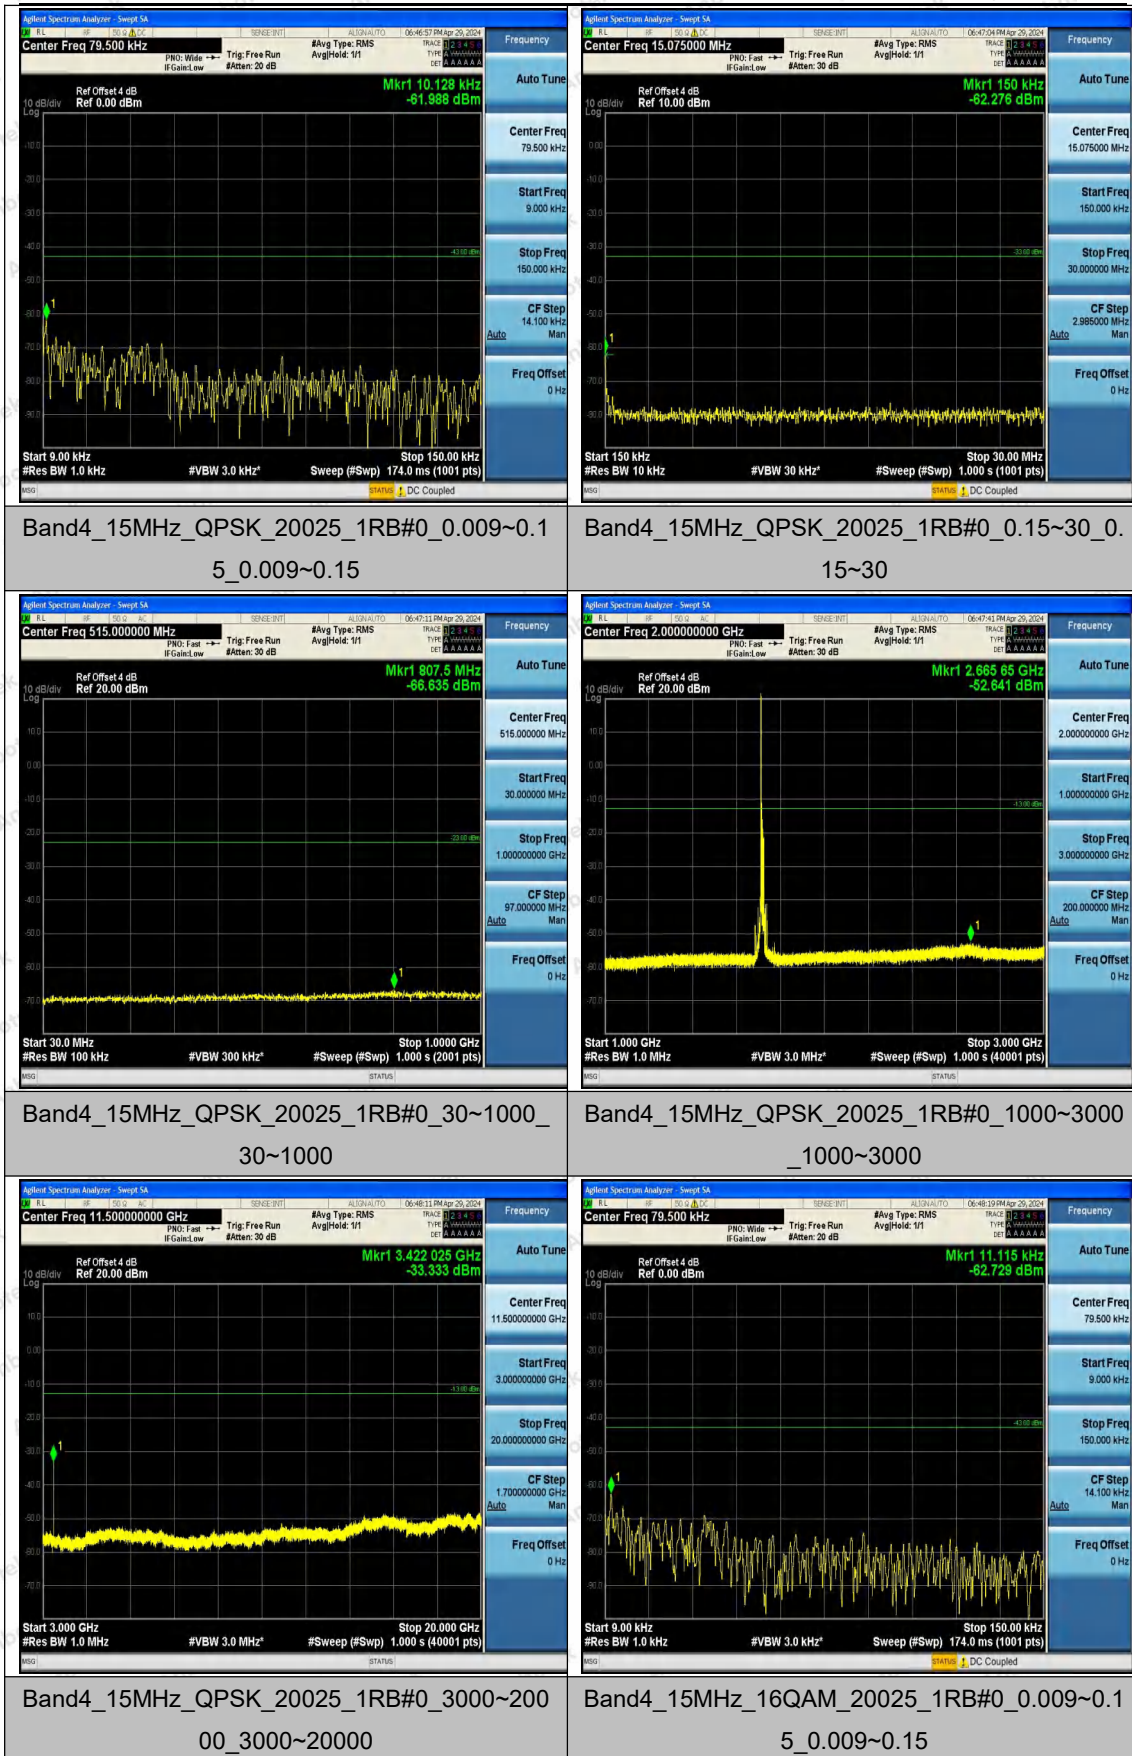


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



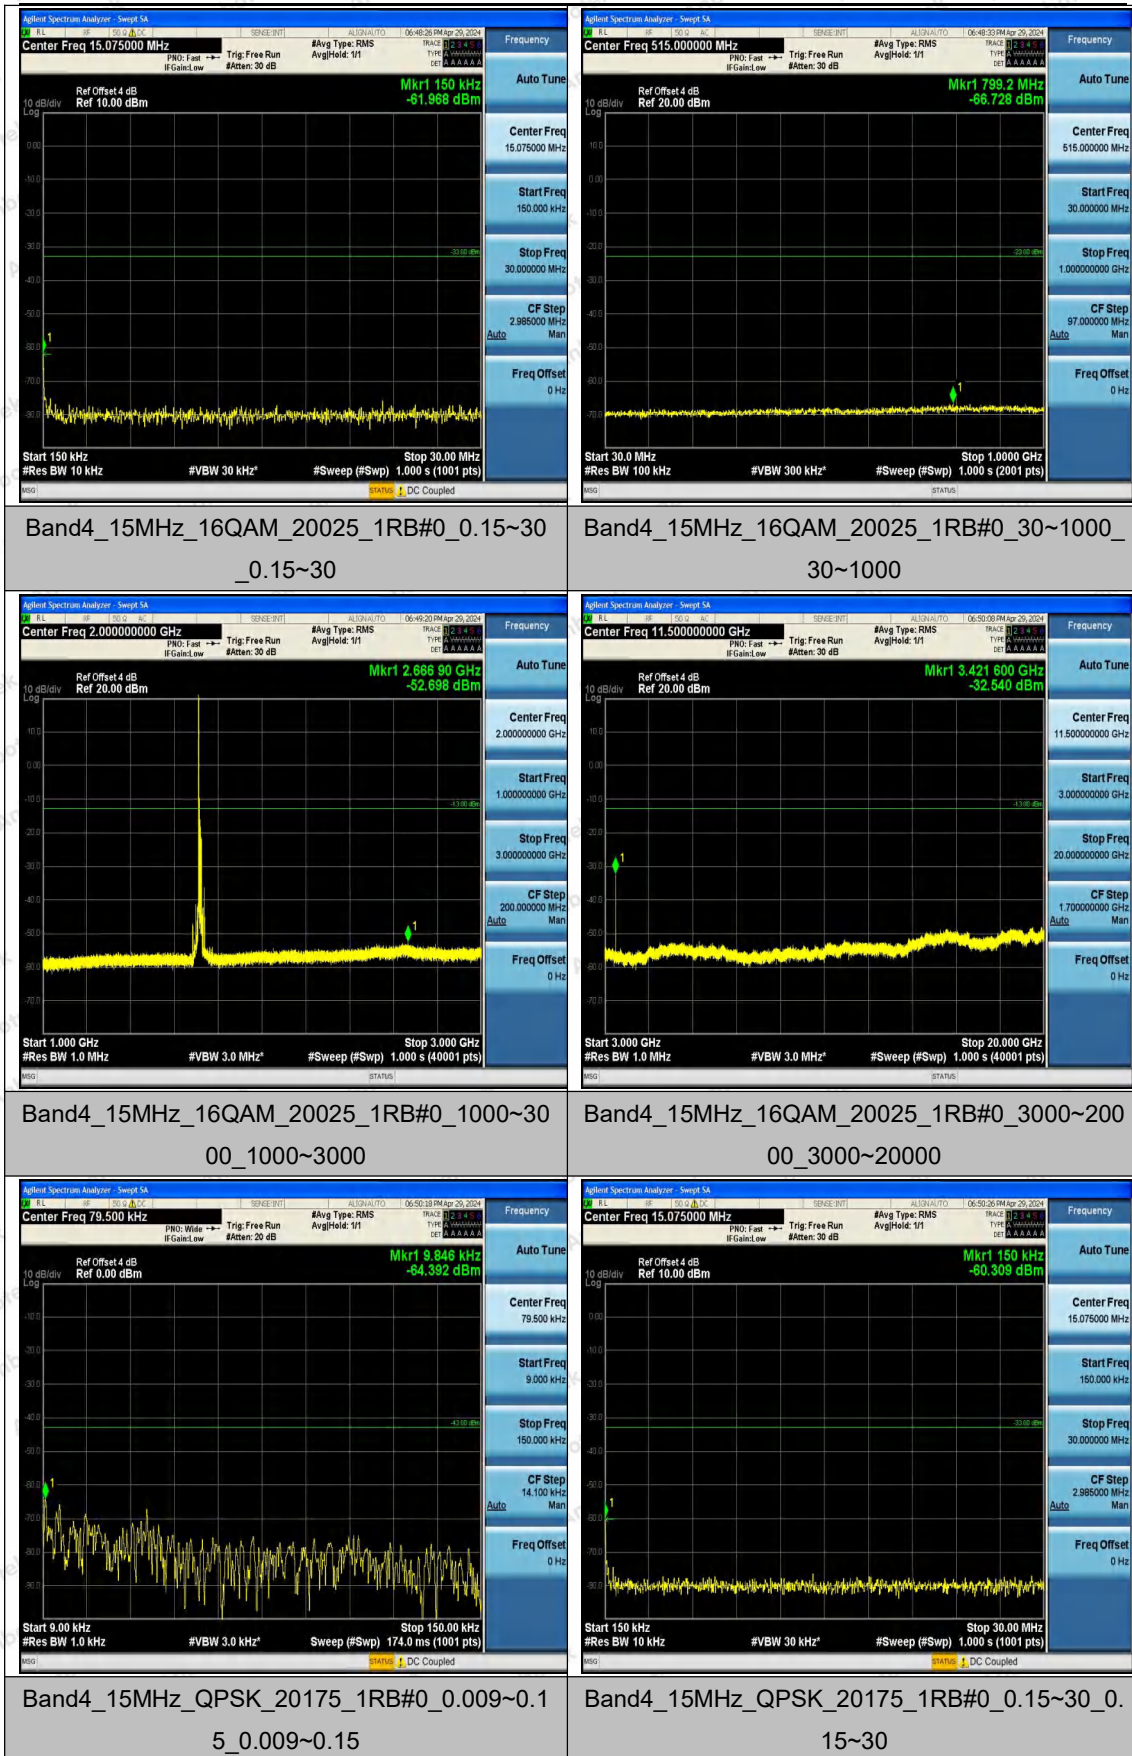


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



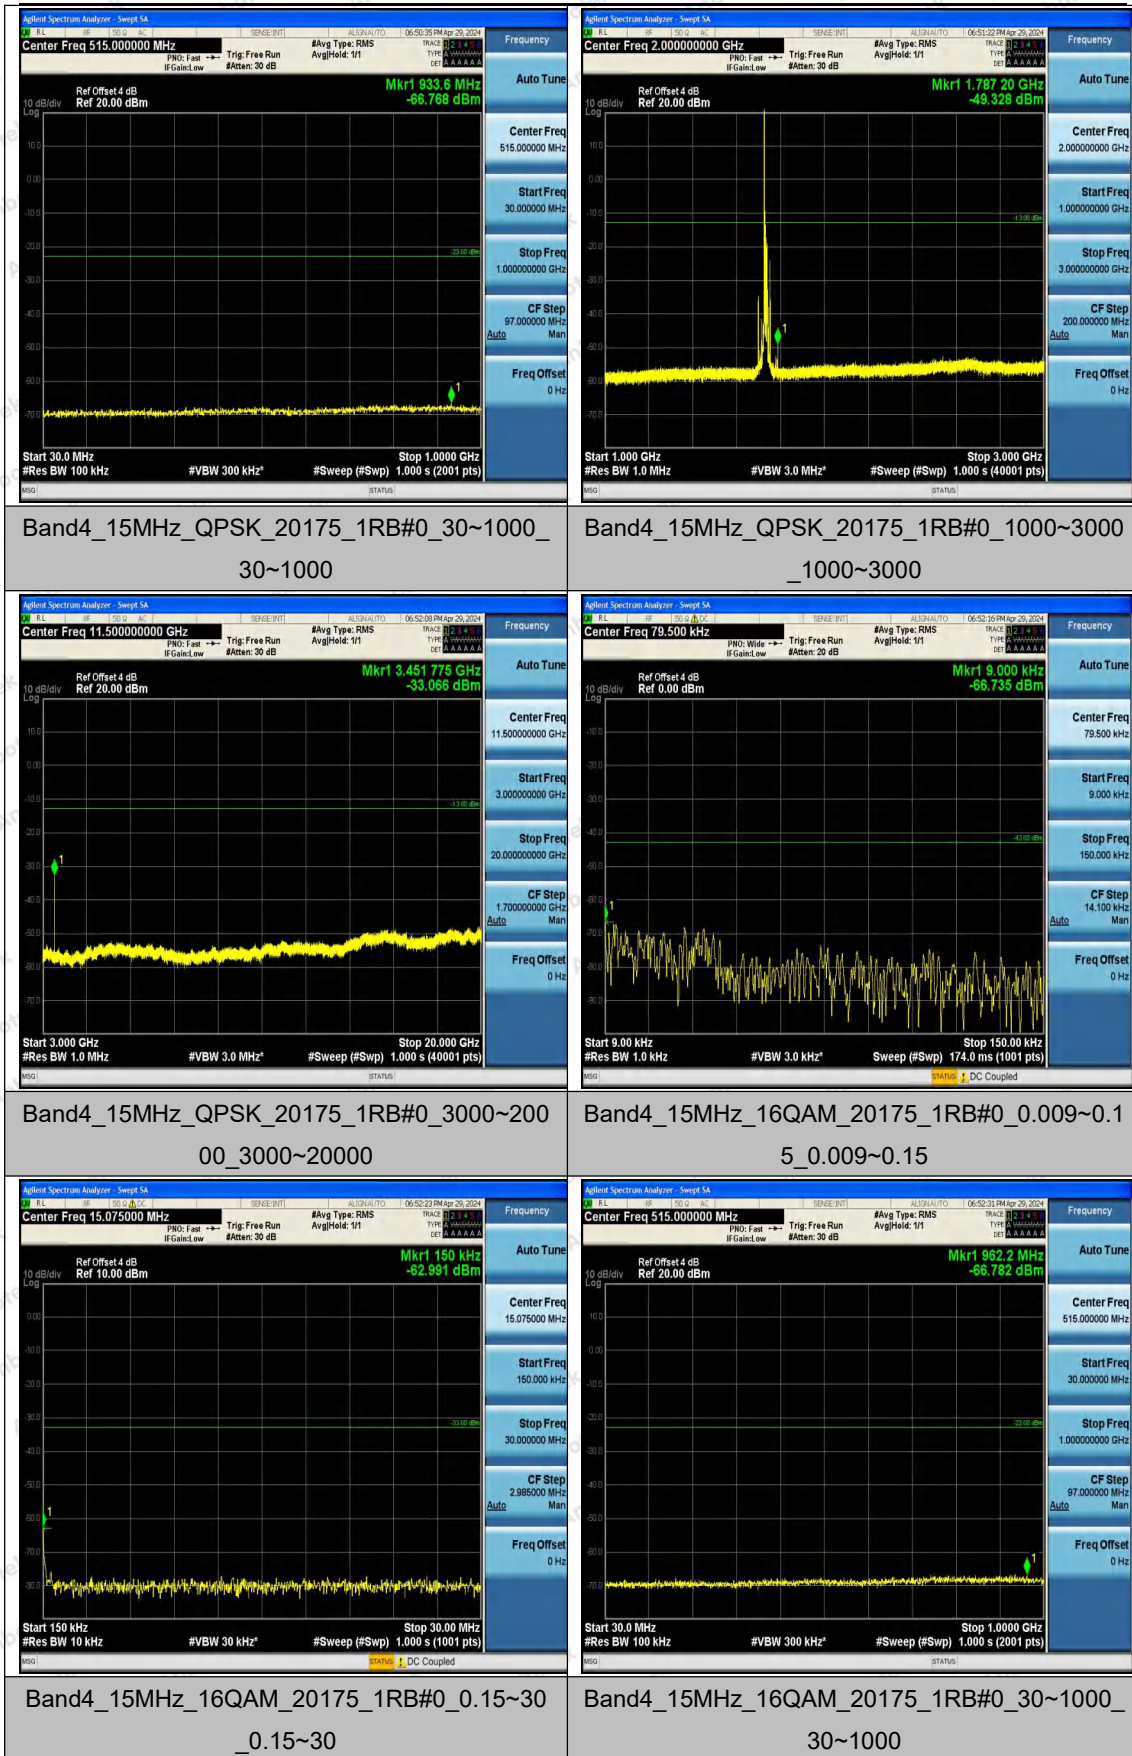


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



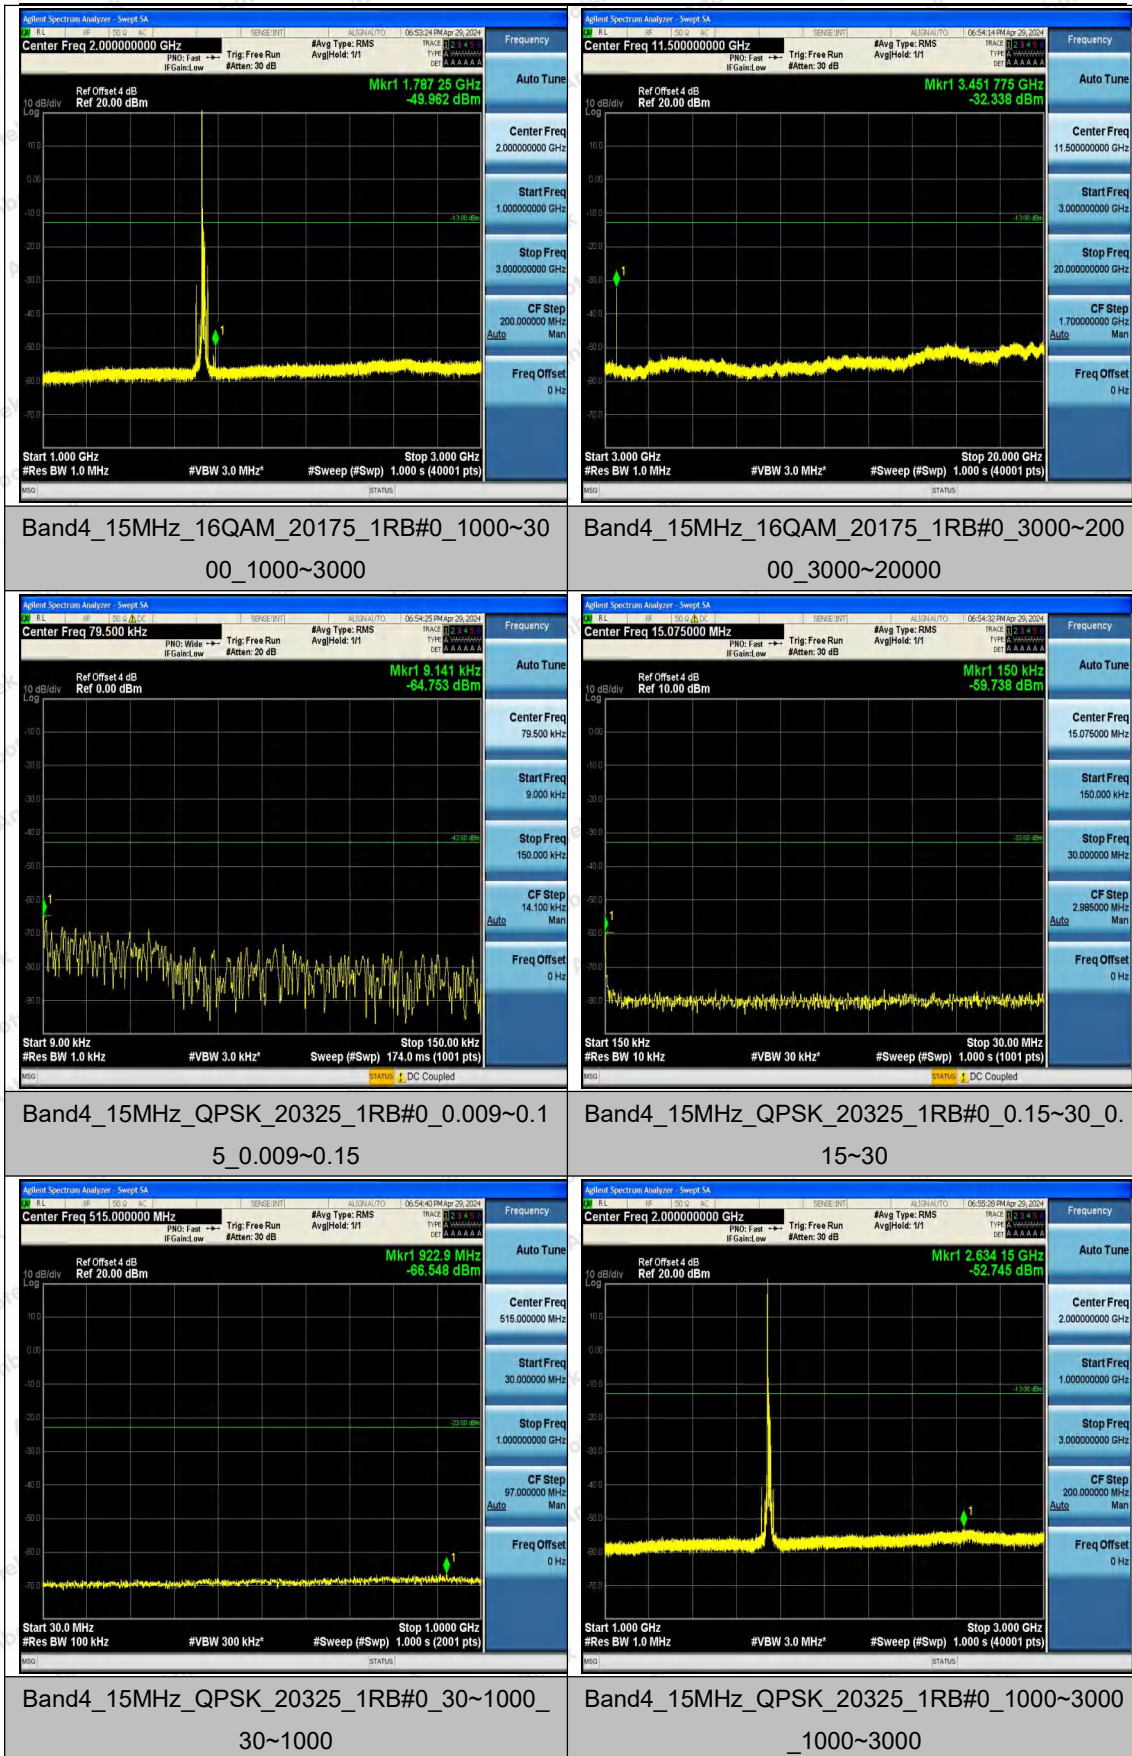


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com.cn



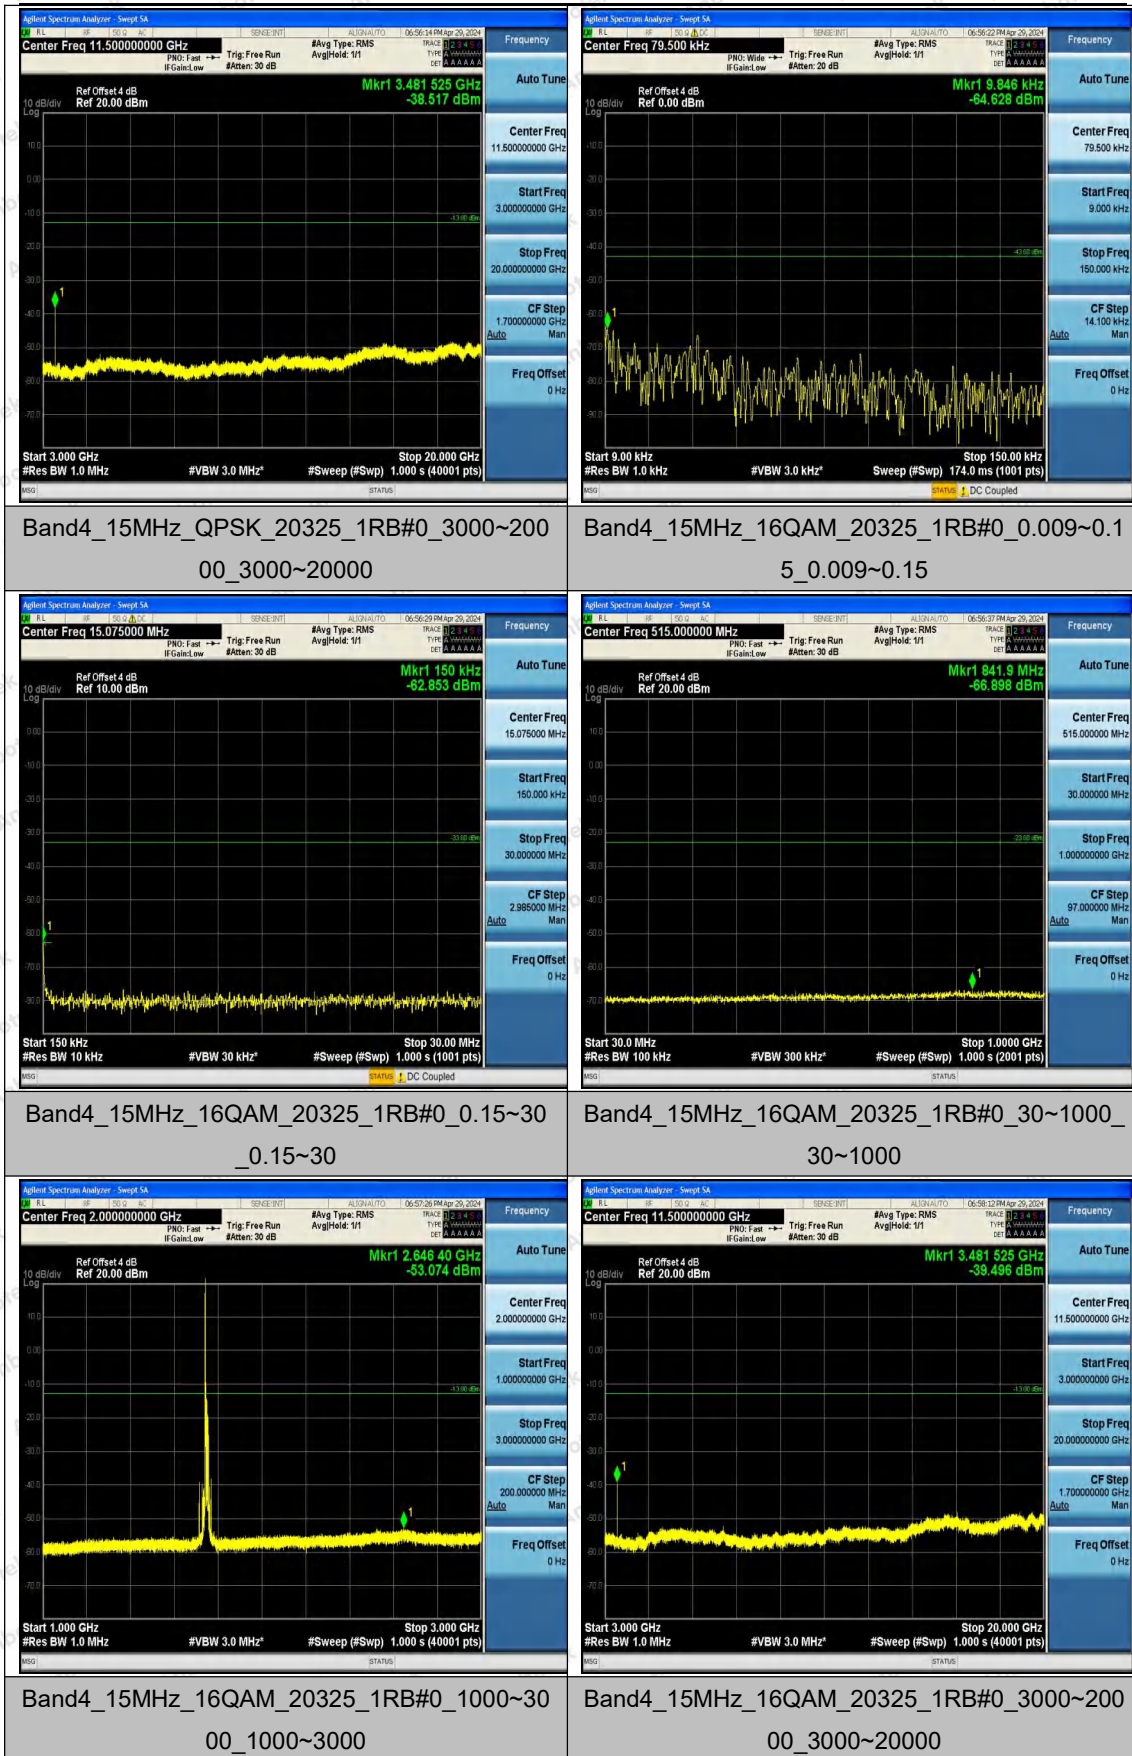


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



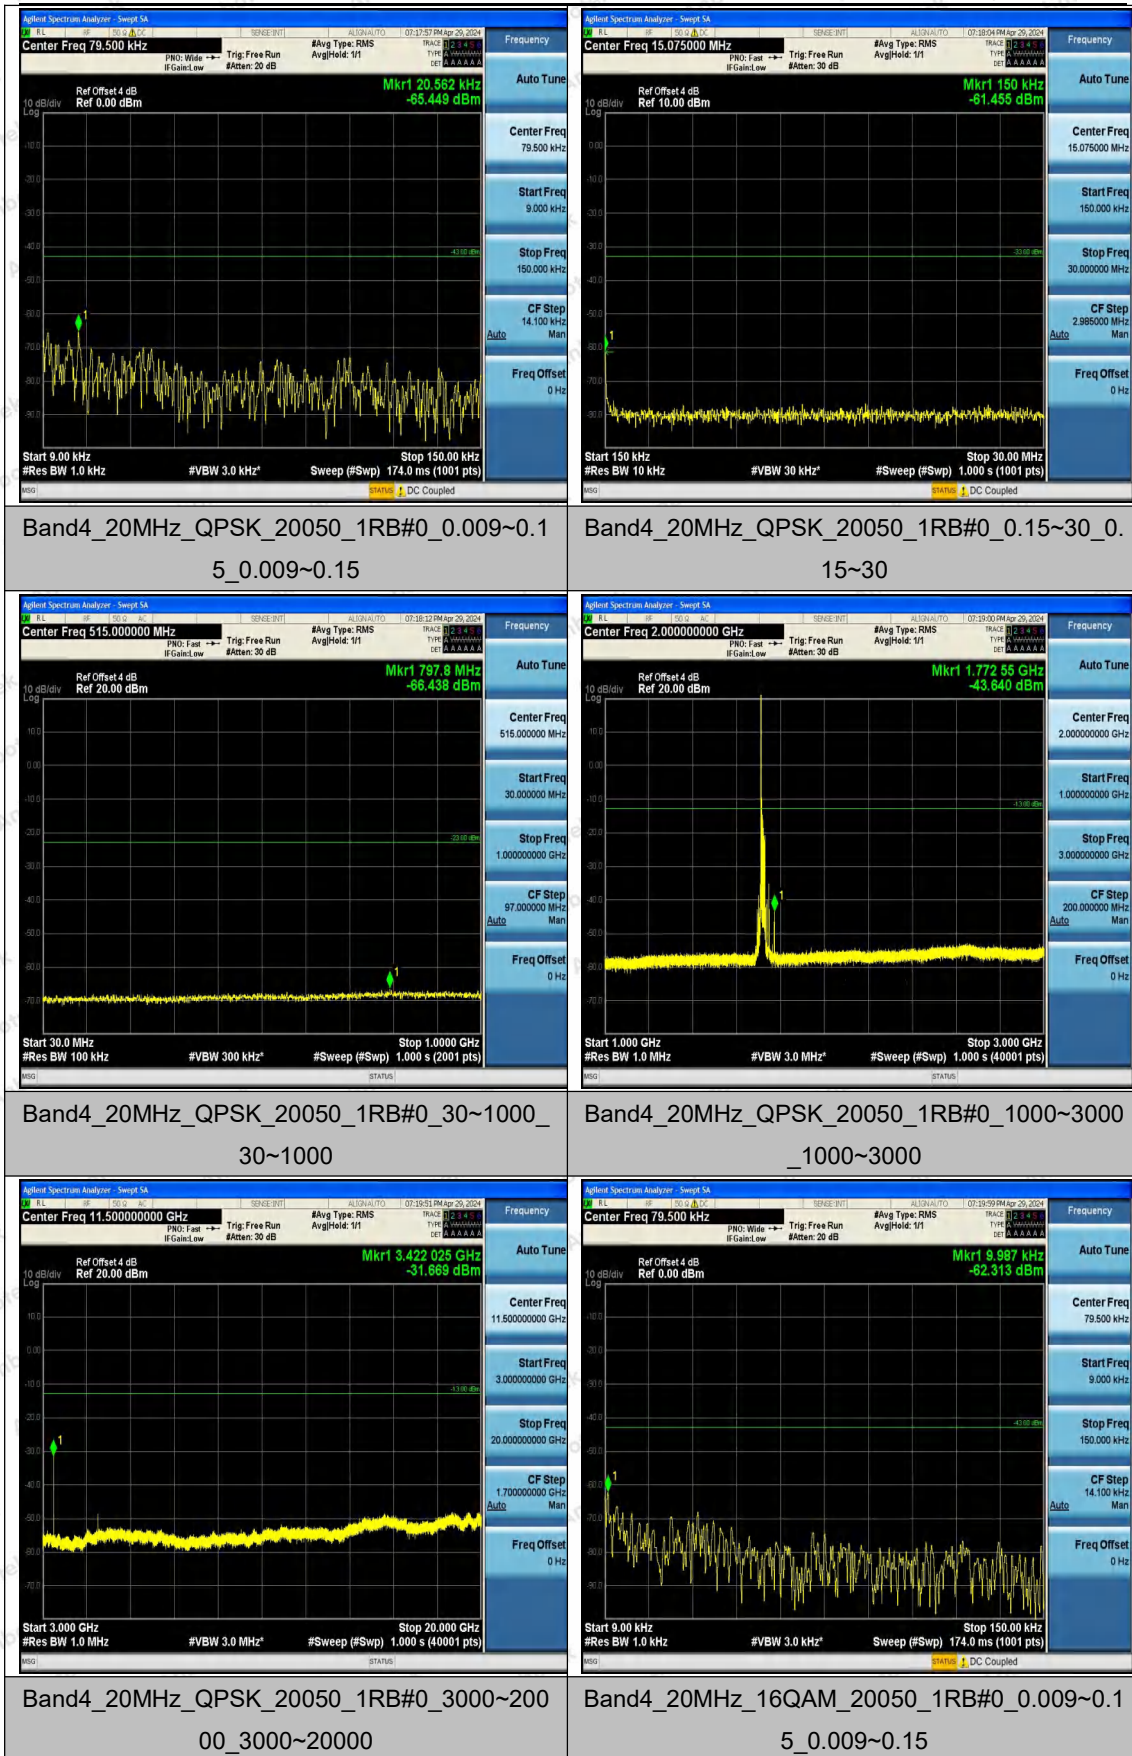


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



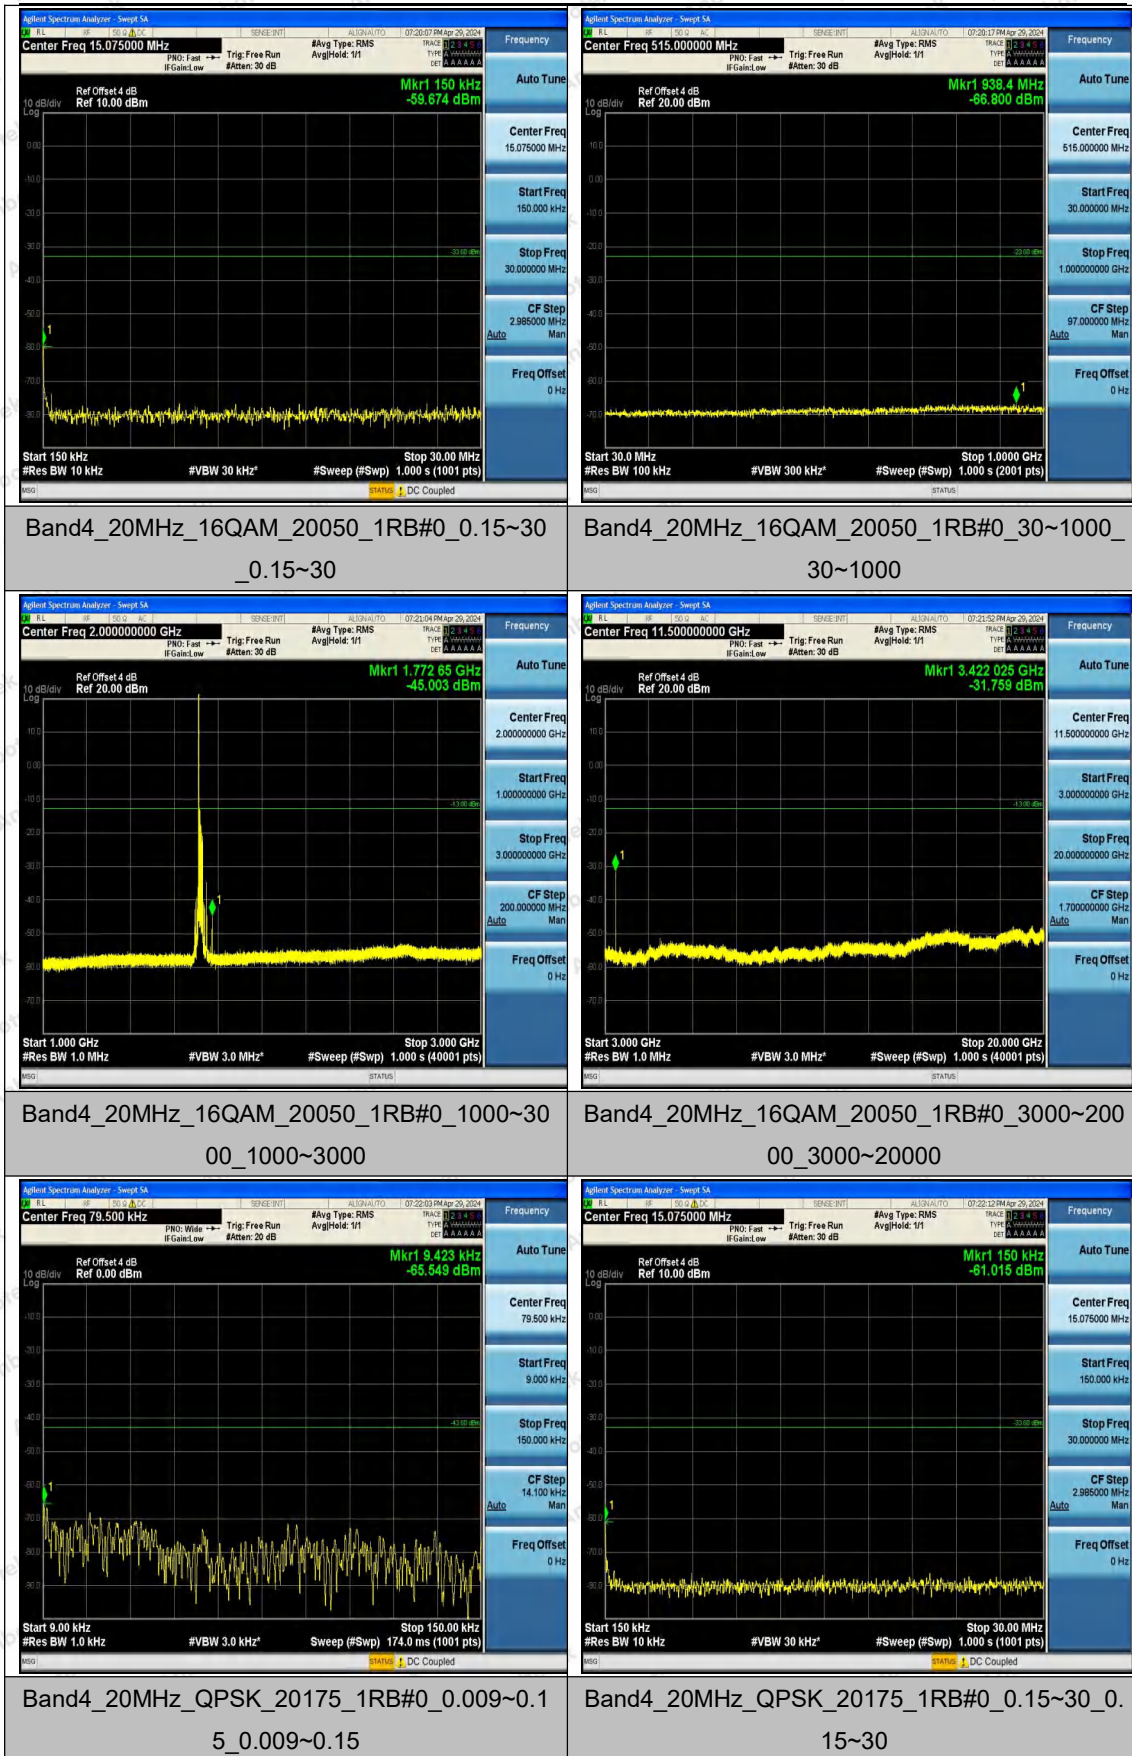


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



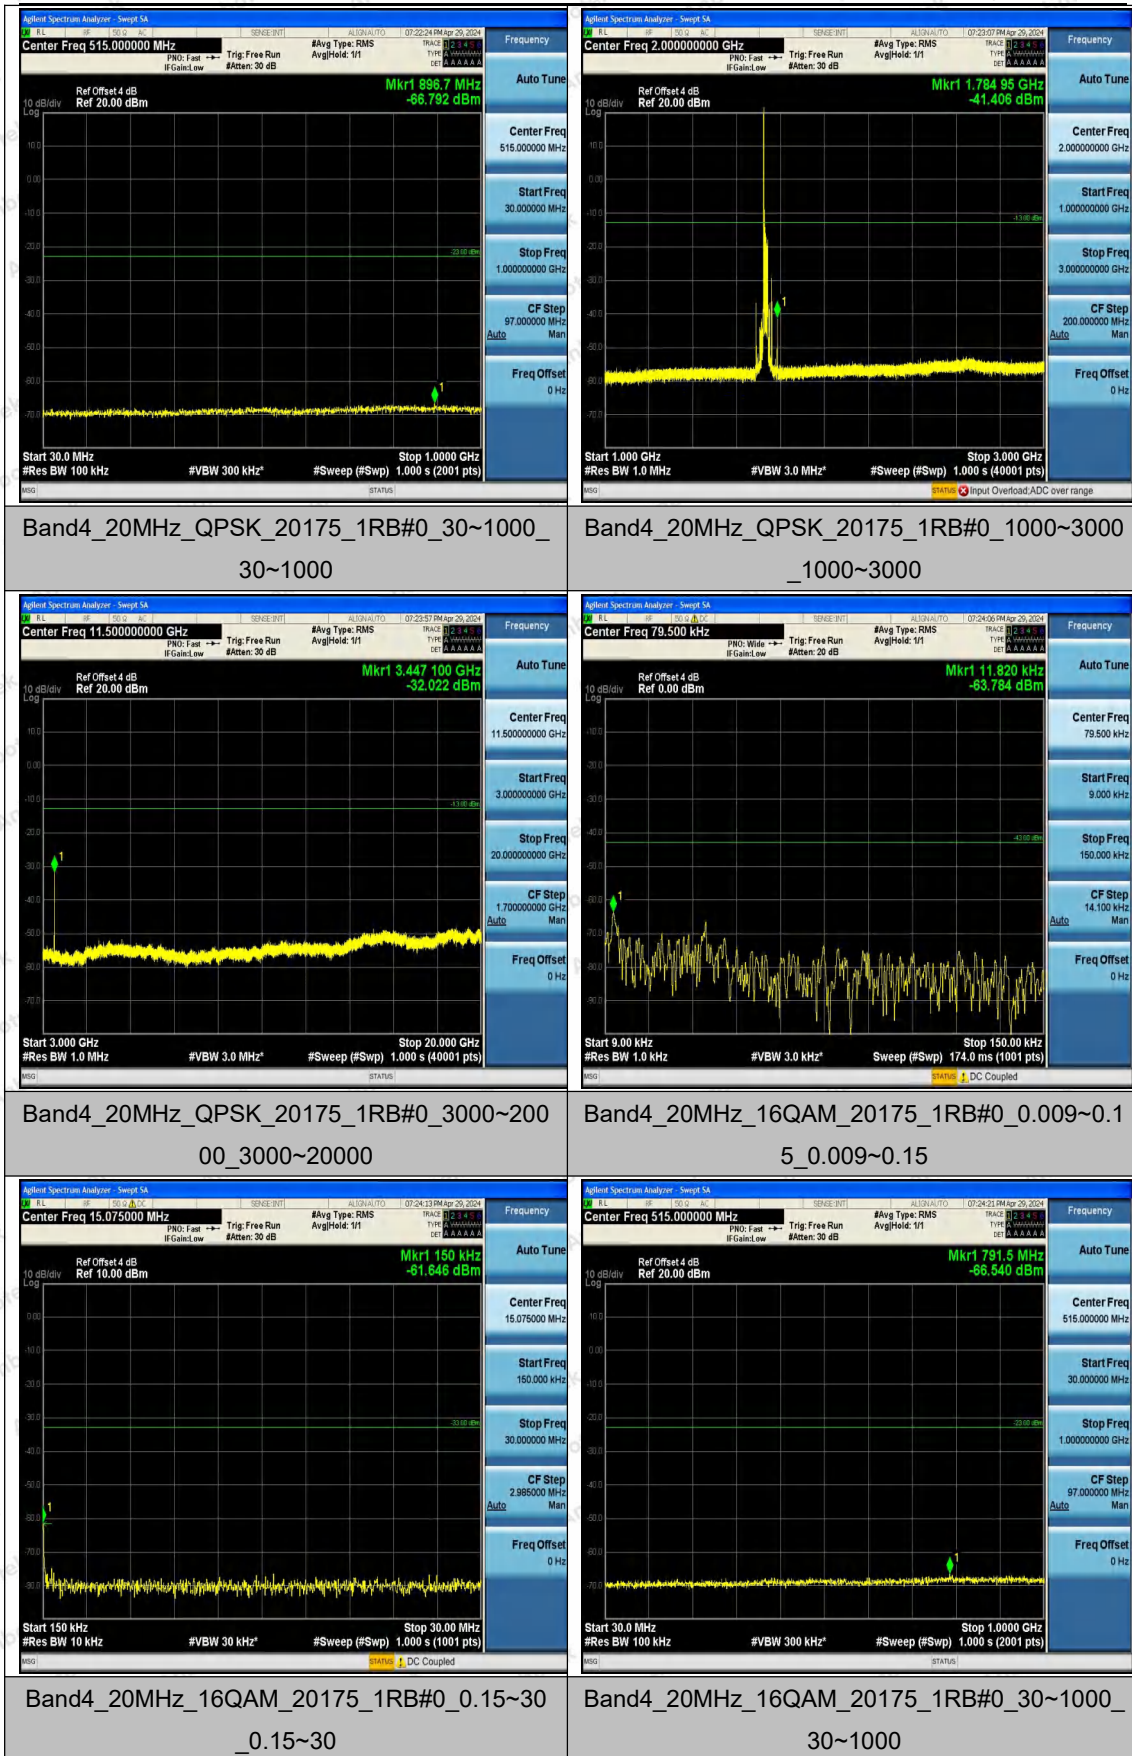


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



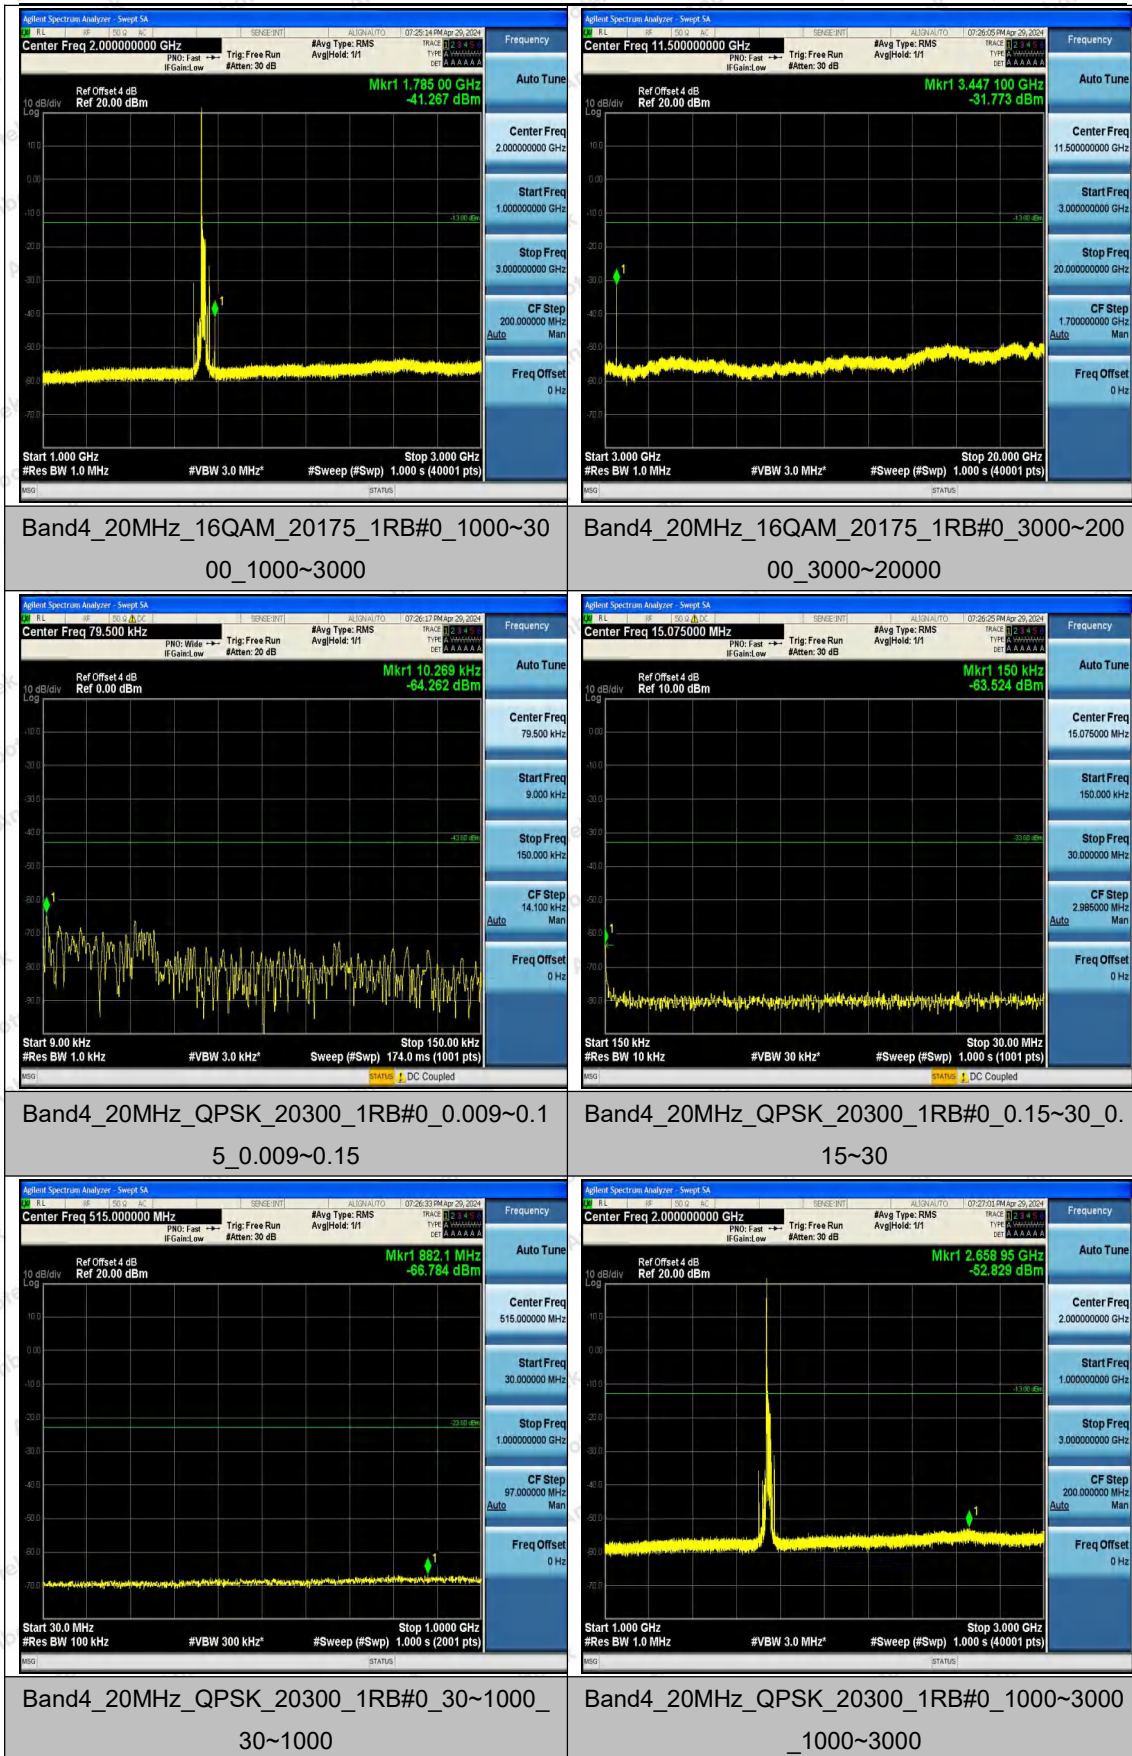


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



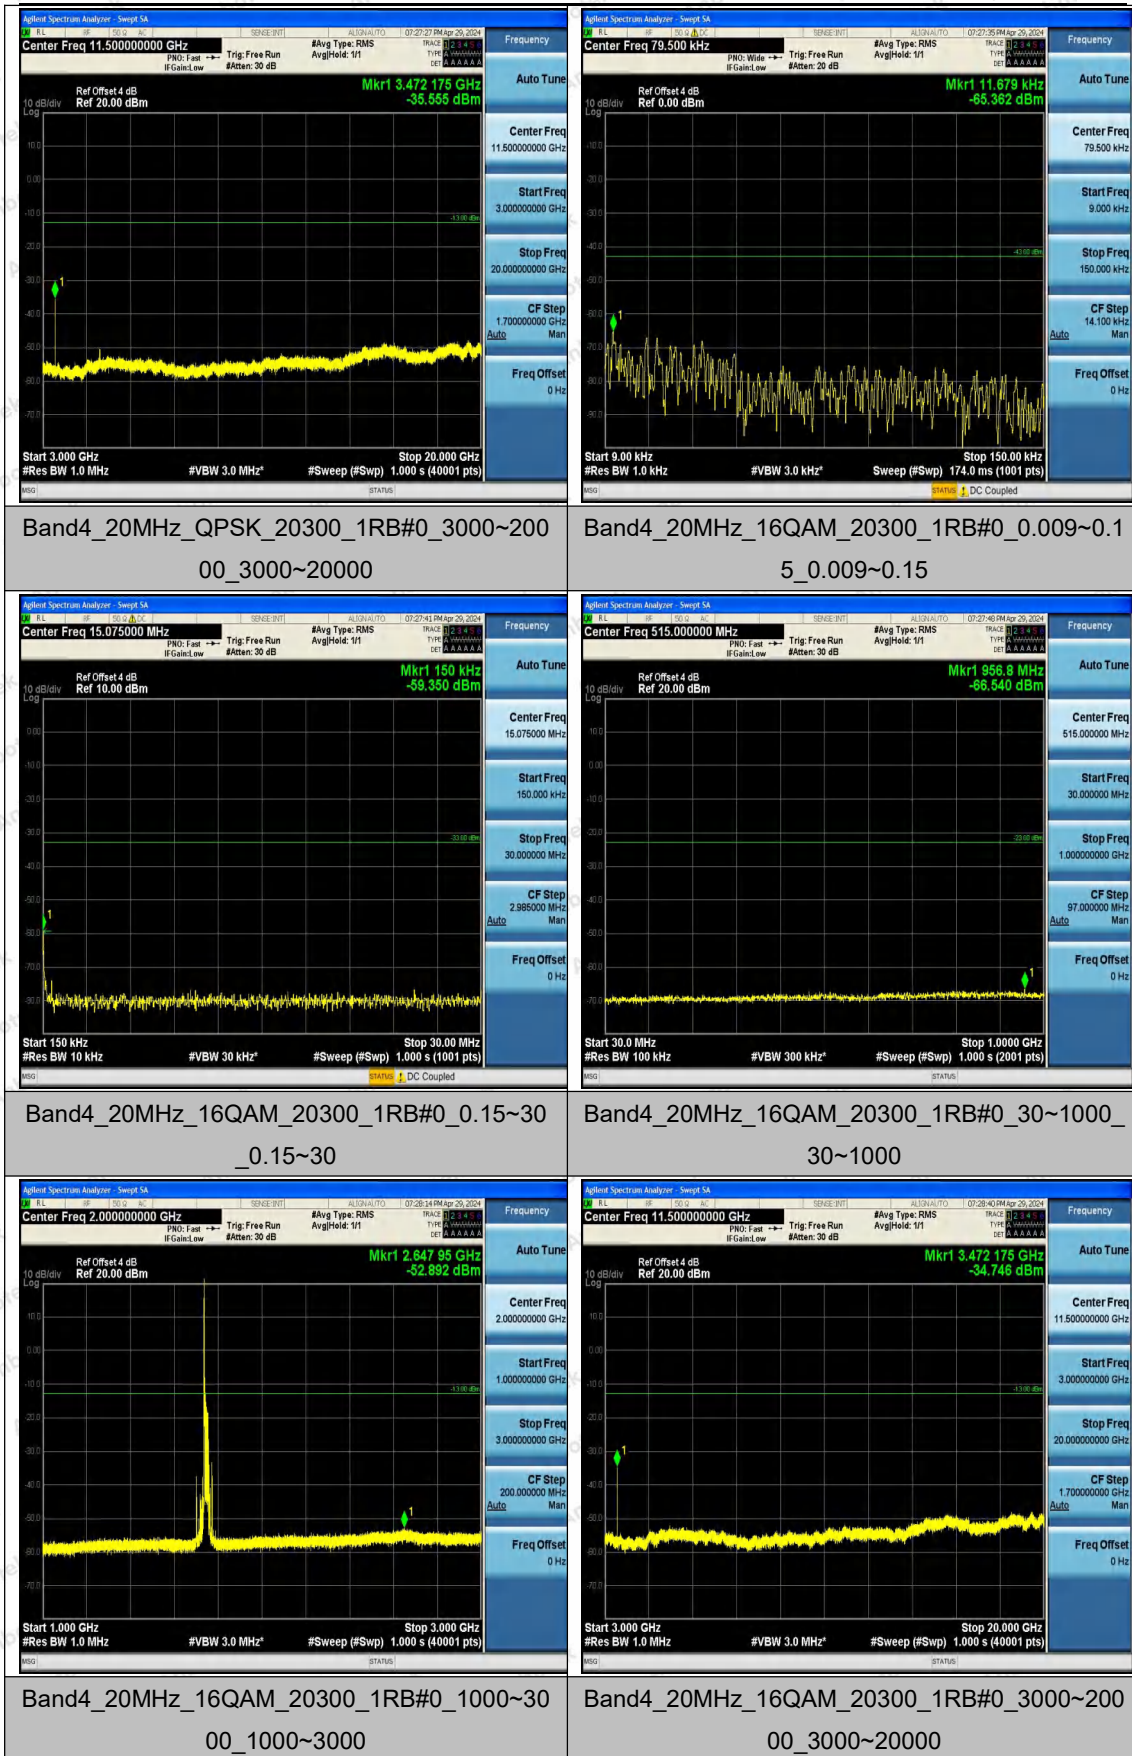

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	31.59	0.018466	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	-29.04	-0.016976	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	-39.32	-0.022985	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	-9.08	-0.005308	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	19.44	0.011364	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	34.65	0.020255	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	37.54	0.021668	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	-15.88	-0.009166	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	-45.96	-0.026528	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	43.39	0.025045	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	40.44	0.023342	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	43.99	0.025391	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	55.69	0.031745	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-16.29	-0.009286	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-14.43	-0.008226	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	3.95	0.002252	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	18.80	0.010717	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	35.92	0.020475	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	-24.26	-0.014175	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	-20.27	-0.011843	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	40.25	0.023517	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	-14.81	-0.008653	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	5.71	0.003336	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	4.18	0.002442	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	26.61	0.015359	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	-3.89	-0.002245	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	48.69	0.028104	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	13.35	0.007706	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	33.53	0.019354	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	-11.86	-0.006846	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	2.95	0.001682	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	-46.89	-0.026741	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	-41.28	-0.023541	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VN	NT	-25.88	-0.014759	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VL	NT	-24.35	-0.013887	±2.5	PASS



Band4	3MHz	16QAM	20385	15RB#0	VH	NT	-11.72	-0.006684	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	-5.25	-0.003066	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	15.82	0.009238	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	49.31	0.028794	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	4.55	0.002657	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	14.39	0.008403	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	3.48	0.002032	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	30.90	0.017835	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	-23.06	-0.013310	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	22.69	0.013097	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	20.31	0.011723	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	21.46	0.012387	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	18.87	0.010892	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	-24.72	-0.014106	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-19.96	-0.011389	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-51.20	-0.029215	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-21.79	-0.012434	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	-37.39	-0.021335	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-26.55	-0.015150	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-12.45	-0.007259	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	25.49	0.014863	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	35.96	0.020968	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	13.28	0.007743	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	37.82	0.022052	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-31.49	-0.018362	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	16.44	0.009489	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	-24.58	-0.014188	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	36.64	0.021149	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	40.23	0.023221	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	16.01	0.009241	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	-37.98	-0.021922	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	34.30	0.019600	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	-38.62	-0.022069	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	-44.67	-0.025526	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	-32.11	-0.018349	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	-43.77	-0.025011	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	-29.55	-0.016886	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	-44.99	-0.026195	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	50.40	0.029345	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VH	NT	47.76	0.027808	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	-14.19	-0.008262	±2.5	PASS



Band4	15MHz	16QAM	20025	75RB#0	VL	NT	22.93	0.013351	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	-23.92	-0.013927	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	-45.46	-0.026240	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VL	NT	-6.62	-0.003821	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	37.29	0.021524	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	25.91	0.014955	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	-15.79	-0.009114	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	-36.75	-0.021212	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	-21.56	-0.012338	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	-52.81	-0.030220	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	-38.68	-0.022134	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	-15.21	-0.008704	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	-35.63	-0.020389	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	-29.70	-0.016996	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	-55.33	-0.032169	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	-19.47	-0.011320	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	42.90	0.024942	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	-10.21	-0.005936	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	-48.27	-0.028064	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	-54.19	-0.031506	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	-36.84	-0.021264	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	-40.11	-0.023152	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	23.43	0.013524	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	12.52	0.007227	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	-31.17	-0.017991	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	-47.21	-0.027250	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	-39.45	-0.022607	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	-45.95	-0.026332	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-25.29	-0.014493	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-37.04	-0.021226	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-28.11	-0.016109	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	-53.79	-0.030825	±2.5	PASS



Appendix G: Frequency stability VS Temperature

measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	-35.59	-0.020804	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	-22.26	-0.013012	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-10	-10.50	-0.006138	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	15.65	0.009148	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	40.24	0.023523	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	28.97	0.016935	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	30	34.22	0.020004	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	40	31.01	0.018127	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	50	14.23	0.008318	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	50.31	0.029409	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	50.81	0.029701	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-10	-3.63	-0.002122	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	16.32	0.009540	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	36.51	0.021342	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	46.92	0.027427	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	30	28.87	0.016876	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	40	22.07	0.012901	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	50	37.62	0.021991	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	3.71	0.002141	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	-26.25	-0.015152	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-10	-21.66	-0.012502	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	15.36	0.008866	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	10.53	0.006078	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	33.06	0.019082	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	30	40.43	0.023336	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	40	48.77	0.028150	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	50	15.34	0.008854	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	15.02	0.008670	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	21.77	0.012566	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-10	35.69	0.020600	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	11.33	0.006540	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	27.21	0.015706	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	30.53	0.017622	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	30	20.08	0.011590	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	40	10.39	0.005997	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	50	24.38	0.014072	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-12.27	-0.006994	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-10.57	-0.006025	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-10	-40.17	-0.022898	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	10.49	0.005980	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-18.21	-0.010380	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	-36.76	-0.020954	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	30	-16.44	-0.009371	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	40	-15.16	-0.008642	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	50	-10.24	-0.005837	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	21.59	0.012307	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	37.32	0.021273	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-10	-3.75	-0.002138	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	20.71	0.011805	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	45.33	0.025839	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	36.54	0.020829	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	30	49.41	0.028165	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	40	40.48	0.023075	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	50	22.80	0.012997	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	-2.42	-0.001414	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	20.73	0.012112	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-10	42.53	0.024850	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	31.66	0.018498	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	10	32.30	0.018872	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	15.65	0.009144	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	30	29.47	0.017219	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	40	39.67	0.023178	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	50	-21.51	-0.012568	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	-22.59	-0.013199	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	3.40	0.001987	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-10	-11.57	-0.006760	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	-36.81	-0.021507	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	-14.92	-0.008717	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	-38.18	-0.022308	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	30	-43.76	-0.025568	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	40	-30.44	-0.017786	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	50	-9.54	-0.005574	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-30	19.66	0.011348	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	3MHz	QPSK	20175	15RB#0	NV	-20	20.47	0.011815	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-10	14.10	0.008139	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	38.57	0.022263	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	35.79	0.020658	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	10.80	0.006234	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	30	30.24	0.017455	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	40	49.31	0.028462	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	50	48.05	0.027734	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	-24.52	-0.014153	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	37.47	0.021628	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-10	24.68	0.014245	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	47.18	0.027232	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	6.18	0.003567	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	5.79	0.003342	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	30	-41.10	-0.023723	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	40	-9.46	-0.005460	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	50	10.76	0.006211	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	-14.76	-0.008417	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	-28.20	-0.016082	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-10	-21.07	-0.012016	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	-39.84	-0.022720	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	-30.63	-0.017468	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	-20.50	-0.011691	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	30	-24.88	-0.014189	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	40	-41.40	-0.023610	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	50	-42.84	-0.024431	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	-34.66	-0.019766	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	-32.17	-0.018346	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-10	-44.67	-0.025475	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	-29.93	-0.017069	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	-46.72	-0.026644	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	-20.11	-0.011468	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	30	-28.92	-0.016493	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	40	-30.71	-0.017514	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	50	-10.74	-0.006125	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	20.11	0.011743	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	31.54	0.018418	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-10	14.00	0.008175	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	15.75	0.009197	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	19.10	0.011153	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	21.94	0.012812	±2.5	PASS



Band4	5MHz	QPSK	19975	25RB#0	NV	30	47.05	0.027474	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	40	36.23	0.021156	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	50	10.37	0.006055	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	-8.47	-0.004946	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-20	-51.48	-0.030061	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-10	-24.93	-0.014558	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	11.66	0.006809	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	14.26	0.008327	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	-15.05	-0.008788	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	30	-38.74	-0.022622	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	40	-9.40	-0.005489	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	50	-21.47	-0.012537	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	37.48	0.021633	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	21.97	0.012681	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-10	47.55	0.027446	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	5.28	0.003048	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	41.18	0.023769	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	41.08	0.023711	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	30	40.67	0.023475	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	40	21.79	0.012577	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	50	54.29	0.031336	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	12.19	0.007036	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	-11.30	-0.006522	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-10	-13.25	-0.007648	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	-5.38	-0.003105	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	15.11	0.008722	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	40.43	0.023336	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	30	-7.37	-0.004254	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	40	11.07	0.006390	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	50	25.68	0.014823	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	-20.14	-0.011492	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	46.59	0.026585	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-10	-13.26	-0.007566	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-11.84	-0.006756	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	-42.61	-0.024314	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	20	-32.77	-0.018699	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	30	-39.02	-0.022265	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	40	-40.58	-0.023155	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	50	-23.19	-0.013233	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	-25.23	-0.014397	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-43.46	-0.024799	±2.5	PASS



Band4	5MHz	16QAM	20375	25RB#0	NV	-10	-16.78	-0.009575	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	-16.68	-0.009518	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	-30.54	-0.017427	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-30.54	-0.017427	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	30	-22.87	-0.013050	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	40	-38.07	-0.021723	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	50	-9.57	-0.005461	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	38.62	0.022519	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	27.85	0.016239	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-10	20.36	0.011872	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	25.48	0.014857	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	38.02	0.022169	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	30.94	0.018041	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	30	10.51	0.006128	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	40	40.57	0.023656	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	50	45.38	0.026461	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	-12.75	-0.007434	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-13.73	-0.008006	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-10	-35.85	-0.020904	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	30.43	0.017743	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	-6.22	-0.003627	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	27.14	0.015825	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	30	-24.63	-0.014362	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	40	-31.29	-0.018245	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	50	-16.65	-0.009708	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	49.12	0.028352	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	49.32	0.028468	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-10	33.59	0.019388	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	26.56	0.015330	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	40.57	0.023417	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	35.31	0.020381	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	30	46.72	0.026967	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	40	43.60	0.025166	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	50	28.32	0.016346	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	-31.87	-0.018395	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	-37.82	-0.021830	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-10	40.08	0.023134	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	-3.02	-0.001743	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	-8.98	-0.005183	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	-33.93	-0.019584	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	30	4.13	0.002384	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band4	10MHz	16QAM	20175	50RB#0	NV	40	-13.79	-0.007960	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	50	-36.44	-0.021033	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	-38.52	-0.022011	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	-37.92	-0.021669	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-10	-36.95	-0.021114	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	-19.70	-0.011257	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	-41.69	-0.023823	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	7.52	0.004297	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	30	40.80	0.023314	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	40	-39.53	-0.022589	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	50	-31.07	-0.017754	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-30	-36.88	-0.021074	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	-45.96	-0.026263	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-10	-7.15	-0.004086	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	0	-10.83	-0.006189	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	-50.94	-0.029109	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	-45.56	-0.026034	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	30	-43.96	-0.025120	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	40	-41.64	-0.023794	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	50	-12.15	-0.006943	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	50.71	0.029525	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	36.56	0.021287	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-10	42.41	0.024693	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	35.89	0.020897	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	12.04	0.007010	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	46.26	0.026934	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	30	27.64	0.016093	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	40	17.55	0.010218	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	50	15.88	0.009246	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	-36.44	-0.021217	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	-41.93	-0.024413	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-10	-34.92	-0.020332	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	-23.53	-0.013700	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	-27.17	-0.015820	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	-7.80	-0.004541	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	30	-46.52	-0.027086	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	40	6.75	0.003930	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	50	-32.66	-0.019016	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	40.48	0.023365	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	37.89	0.021870	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-10	43.22	0.024947	±2.5	PASS



Band4	15MHz	QPSK	20175	75RB#0	NV	0	51.68	0.029830	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	42.73	0.024664	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	39.38	0.022730	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	30	16.14	0.009316	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	40	19.15	0.011053	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	50	18.38	0.010609	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	-30.73	-0.017737	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	-21.23	-0.012254	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-10	-38.80	-0.022395	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	-26.95	-0.015556	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	-42.20	-0.024358	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	-8.41	-0.004854	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	30	29.24	0.016877	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	40	14.45	0.008341	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	50	-45.58	-0.026309	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	-16.09	-0.009207	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	-43.85	-0.025093	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-10	-33.46	-0.019147	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	-33.49	-0.019165	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	-24.95	-0.014278	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	-35.76	-0.020464	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	30	-38.02	-0.021757	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	40	-9.64	-0.005516	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	50	35.10	0.020086	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	-12.36	-0.007073	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	-44.52	-0.025476	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-10	-35.32	-0.020212	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	-23.79	-0.013614	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	-49.41	-0.028275	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	-9.90	-0.005665	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	30	-41.47	-0.023731	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	40	-40.81	-0.023353	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	50	-29.93	-0.017127	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	32.46	0.018872	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	29.40	0.017093	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-10	7.65	0.004448	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	43.85	0.025494	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	49.58	0.028826	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	-13.36	-0.007767	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	30	38.12	0.022163	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	40	19.61	0.011401	±2.5	PASS



Band4	20MHz	QPSK	20050	100RB#0	NV	50	-5.22	-0.003035	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	-39.37	-0.022890	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	-51.63	-0.030017	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-10	-37.77	-0.021959	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	11.66	0.006779	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	-13.90	-0.008081	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	-35.29	-0.020517	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	30	-35.15	-0.020436	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	40	-44.43	-0.025831	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	50	-24.55	-0.014273	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	41.51	0.023960	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-20	22.86	0.013195	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-10	-6.82	-0.003937	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	27.97	0.016144	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	10	39.83	0.022990	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	49.25	0.028427	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	30	40.25	0.023232	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	40	40.41	0.023325	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	50	39.24	0.022649	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	-34.90	-0.020144	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	-39.38	-0.022730	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-10	-36.15	-0.020866	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	11.39	0.006574	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	-6.88	-0.003971	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	-46.18	-0.026655	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	30	-33.30	-0.019221	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	40	-29.97	-0.017299	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	50	-38.77	-0.022378	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-19.45	-0.011146	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	14.56	0.008344	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-10	-36.98	-0.021192	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-30.16	-0.017284	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	-30.36	-0.017398	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	-24.81	-0.014218	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	30	32.77	0.018779	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	40	6.38	0.003656	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	50	33.27	0.019066	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	-42.60	-0.024413	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-31.60	-0.018109	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-10	-34.72	-0.019897	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-22.16	-0.012699	±2.5	PASS



Band4	20MHz	16QAM	20300	100RB#0	NV	10	-32.43	-0.018585	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-14.79	-0.008476	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	30	-39.38	-0.022567	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	40	-46.82	-0.026831	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	50	-39.02	-0.022361	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

