



Appendix A: Effective (Isotropic) Radiated Power Output Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	EIRP(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	22.96	23.46	PASS
Band66	1.4MHz	QPSK	131979	1RB#2	23.01	23.51	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	22.98	23.48	PASS
Band66	1.4MHz	QPSK	131979	3RB#0	23.13	23.63	PASS
Band66	1.4MHz	QPSK	131979	3RB#1	23.14	23.64	PASS
Band66	1.4MHz	QPSK	131979	3RB#3	23.15	23.65	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	22.08	22.58	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	23.14	23.64	PASS
Band66	1.4MHz	QPSK	132322	1RB#2	23.13	23.63	PASS
Band66	1.4MHz	QPSK	132322	1RB#5	23.12	23.62	PASS
Band66	1.4MHz	QPSK	132322	3RB#0	23.18	23.68	PASS
Band66	1.4MHz	QPSK	132322	3RB#1	23.13	23.63	PASS
Band66	1.4MHz	QPSK	132322	3RB#3	23.18	23.68	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	22.20	22.70	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	23.22	23.72	PASS
Band66	1.4MHz	QPSK	132665	1RB#2	23.33	23.83	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	23.20	23.70	PASS
Band66	1.4MHz	QPSK	132665	3RB#0	23.21	23.71	PASS
Band66	1.4MHz	QPSK	132665	3RB#1	23.19	23.69	PASS
Band66	1.4MHz	QPSK	132665	3RB#3	23.20	23.70	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	22.18	22.68	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	22.13	22.63	PASS
Band66	1.4MHz	16QAM	131979	1RB#2	22.18	22.68	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	22.11	22.61	PASS
Band66	1.4MHz	16QAM	131979	3RB#0	22.13	22.63	PASS
Band66	1.4MHz	16QAM	131979	3RB#1	22.13	22.63	PASS
Band66	1.4MHz	16QAM	131979	3RB#3	22.18	22.68	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	21.17	21.67	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	22.38	22.88	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 2 of 132

Band66	1.4MHz	16QAM	132322	1RB#2	22.24	22.74	PASS
Band66	1.4MHz	16QAM	132322	1RB#5	22.23	22.73	PASS
Band66	1.4MHz	16QAM	132322	3RB#0	22.26	22.76	PASS
Band66	1.4MHz	16QAM	132322	3RB#1	22.38	22.88	PASS
Band66	1.4MHz	16QAM	132322	3RB#3	22.24	22.74	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	21.14	21.64	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	22.16	22.66	PASS
Band66	1.4MHz	16QAM	132665	1RB#2	22.33	22.83	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	22.26	22.76	PASS
Band66	1.4MHz	16QAM	132665	3RB#0	22.32	22.82	PASS
Band66	1.4MHz	16QAM	132665	3RB#1	22.20	22.70	PASS
Band66	1.4MHz	16QAM	132665	3RB#3	22.28	22.78	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	21.20	21.70	PASS
Band66	1.4MHz	64QAM	131979	1RB#0	21.25	21.75	PASS
Band66	1.4MHz	64QAM	131979	1RB#2	20.99	21.49	PASS
Band66	1.4MHz	64QAM	131979	1RB#5	21.30	21.80	PASS
Band66	1.4MHz	64QAM	131979	3RB#0	21.09	21.59	PASS
Band66	1.4MHz	64QAM	131979	3RB#1	21.17	21.67	PASS
Band66	1.4MHz	64QAM	131979	3RB#3	21.17	21.67	PASS
Band66	1.4MHz	64QAM	131979	6RB#0	20.13	20.63	PASS
Band66	1.4MHz	64QAM	132322	1RB#0	21.11	21.61	PASS
Band66	1.4MHz	64QAM	132322	1RB#2	21.27	21.77	PASS
Band66	1.4MHz	64QAM	132322	1RB#5	21.45	21.95	PASS
Band66	1.4MHz	64QAM	132322	3RB#0	21.34	21.84	PASS
Band66	1.4MHz	64QAM	132322	3RB#1	21.28	21.78	PASS
Band66	1.4MHz	64QAM	132322	3RB#3	21.25	21.75	PASS
Band66	1.4MHz	64QAM	132322	6RB#0	20.26	20.76	PASS
Band66	1.4MHz	64QAM	132665	1RB#0	21.18	21.68	PASS
Band66	1.4MHz	64QAM	132665	1RB#2	21.28	21.78	PASS
Band66	1.4MHz	64QAM	132665	1RB#5	21.16	21.66	PASS
Band66	1.4MHz	64QAM	132665	3RB#0	21.28	21.78	PASS
Band66	1.4MHz	64QAM	132665	3RB#1	21.29	21.79	PASS
Band66	1.4MHz	64QAM	132665	3RB#3	21.22	21.72	PASS
Band66	1.4MHz	64QAM	132665	6RB#0	20.20	20.70	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 3 of 132

Band66	3MHz	QPSK	131987	1RB#0	22.99	23.49	PASS
Band66	3MHz	QPSK	131987	1RB#8	23.11	23.61	PASS
Band66	3MHz	QPSK	131987	1RB#14	22.97	23.47	PASS
Band66	3MHz	QPSK	131987	8RB#0	22.14	22.64	PASS
Band66	3MHz	QPSK	131987	8RB#4	22.16	22.66	PASS
Band66	3MHz	QPSK	131987	8RB#7	22.12	22.62	PASS
Band66	3MHz	QPSK	131987	15RB#0	22.11	22.61	PASS
Band66	3MHz	QPSK	132322	1RB#0	23.05	23.55	PASS
Band66	3MHz	QPSK	132322	1RB#8	23.12	23.62	PASS
Band66	3MHz	QPSK	132322	1RB#14	23.04	23.54	PASS
Band66	3MHz	QPSK	132322	8RB#0	22.17	22.67	PASS
Band66	3MHz	QPSK	132322	8RB#4	22.18	22.68	PASS
Band66	3MHz	QPSK	132322	8RB#7	22.20	22.70	PASS
Band66	3MHz	QPSK	132322	15RB#0	22.20	22.70	PASS
Band66	3MHz	QPSK	132657	1RB#0	23.09	23.59	PASS
Band66	3MHz	QPSK	132657	1RB#8	23.20	23.70	PASS
Band66	3MHz	QPSK	132657	1RB#14	23.13	23.63	PASS
Band66	3MHz	QPSK	132657	8RB#0	22.15	22.65	PASS
Band66	3MHz	QPSK	132657	8RB#4	22.17	22.67	PASS
Band66	3MHz	QPSK	132657	8RB#7	22.18	22.68	PASS
Band66	3MHz	QPSK	132657	15RB#0	22.08	22.58	PASS
Band66	3MHz	16QAM	131987	1RB#0	22.10	22.60	PASS
Band66	3MHz	16QAM	131987	1RB#8	22.27	22.77	PASS
Band66	3MHz	16QAM	131987	1RB#14	22.13	22.63	PASS
Band66	3MHz	16QAM	131987	8RB#0	21.13	21.63	PASS
Band66	3MHz	16QAM	131987	8RB#4	21.13	21.63	PASS
Band66	3MHz	16QAM	131987	8RB#7	21.19	21.69	PASS
Band66	3MHz	16QAM	131987	15RB#0	21.12	21.62	PASS
Band66	3MHz	16QAM	132322	1RB#0	22.37	22.87	PASS
Band66	3MHz	16QAM	132322	1RB#8	22.34	22.84	PASS
Band66	3MHz	16QAM	132322	1RB#14	22.25	22.75	PASS
Band66	3MHz	16QAM	132322	8RB#0	21.27	21.77	PASS
Band66	3MHz	16QAM	132322	8RB#4	21.20	21.70	PASS
Band66	3MHz	16QAM	132322	8RB#7	21.18	21.68	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 4 of 132

Band66	3MHz	16QAM	132322	15RB#0	21.23	21.73	PASS
Band66	3MHz	16QAM	132657	1RB#0	22.05	22.55	PASS
Band66	3MHz	16QAM	132657	1RB#8	22.25	22.75	PASS
Band66	3MHz	16QAM	132657	1RB#14	22.16	22.66	PASS
Band66	3MHz	16QAM	132657	8RB#0	21.10	21.60	PASS
Band66	3MHz	16QAM	132657	8RB#4	21.19	21.69	PASS
Band66	3MHz	16QAM	132657	8RB#7	21.27	21.77	PASS
Band66	3MHz	16QAM	132657	15RB#0	21.16	21.66	PASS
Band66	3MHz	64QAM	131987	1RB#0	21.24	21.74	PASS
Band66	3MHz	64QAM	131987	1RB#8	21.18	21.68	PASS
Band66	3MHz	64QAM	131987	1RB#14	21.21	21.71	PASS
Band66	3MHz	64QAM	131987	8RB#0	20.18	20.68	PASS
Band66	3MHz	64QAM	131987	8RB#4	19.99	20.49	PASS
Band66	3MHz	64QAM	131987	8RB#7	20.14	20.64	PASS
Band66	3MHz	64QAM	131987	15RB#0	20.12	20.62	PASS
Band66	3MHz	64QAM	132322	1RB#0	21.31	21.81	PASS
Band66	3MHz	64QAM	132322	1RB#8	21.41	21.91	PASS
Band66	3MHz	64QAM	132322	1RB#14	21.41	21.91	PASS
Band66	3MHz	64QAM	132322	8RB#0	20.24	20.74	PASS
Band66	3MHz	64QAM	132322	8RB#4	20.21	20.71	PASS
Band66	3MHz	64QAM	132322	8RB#7	20.33	20.83	PASS
Band66	3MHz	64QAM	132322	15RB#0	20.21	20.71	PASS
Band66	3MHz	64QAM	132657	1RB#0	21.08	21.58	PASS
Band66	3MHz	64QAM	132657	1RB#8	21.32	21.82	PASS
Band66	3MHz	64QAM	132657	1RB#14	21.29	21.79	PASS
Band66	3MHz	64QAM	132657	8RB#0	20.18	20.68	PASS
Band66	3MHz	64QAM	132657	8RB#4	20.10	20.60	PASS
Band66	3MHz	64QAM	132657	8RB#7	20.26	20.76	PASS
Band66	3MHz	64QAM	132657	15RB#0	20.12	20.62	PASS
Band66	5MHz	QPSK	131997	1RB#0	23.02	23.52	PASS
Band66	5MHz	QPSK	131997	1RB#12	23.16	23.66	PASS
Band66	5MHz	QPSK	131997	1RB#24	23.06	23.56	PASS
Band66	5MHz	QPSK	131997	12RB#0	22.19	22.69	PASS
Band66	5MHz	QPSK	131997	12RB#6	22.15	22.65	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 5 of 132

Band66	5MHz	QPSK	131997	12RB#13	22.13	22.63	PASS
Band66	5MHz	QPSK	131997	25RB#0	22.17	22.67	PASS
Band66	5MHz	QPSK	132322	1RB#0	23.10	23.60	PASS
Band66	5MHz	QPSK	132322	1RB#12	23.21	23.71	PASS
Band66	5MHz	QPSK	132322	1RB#24	23.16	23.66	PASS
Band66	5MHz	QPSK	132322	12RB#0	22.19	22.69	PASS
Band66	5MHz	QPSK	132322	12RB#6	22.18	22.68	PASS
Band66	5MHz	QPSK	132322	12RB#13	22.19	22.69	PASS
Band66	5MHz	QPSK	132322	25RB#0	22.23	22.73	PASS
Band66	5MHz	QPSK	132647	1RB#0	23.19	23.69	PASS
Band66	5MHz	QPSK	132647	1RB#12	23.32	23.82	PASS
Band66	5MHz	QPSK	132647	1RB#24	23.23	23.73	PASS
Band66	5MHz	QPSK	132647	12RB#0	22.23	22.73	PASS
Band66	5MHz	QPSK	132647	12RB#6	22.22	22.72	PASS
Band66	5MHz	QPSK	132647	12RB#13	22.25	22.75	PASS
Band66	5MHz	QPSK	132647	25RB#0	22.21	22.71	PASS
Band66	5MHz	16QAM	131997	1RB#0	22.29	22.79	PASS
Band66	5MHz	16QAM	131997	1RB#12	22.19	22.69	PASS
Band66	5MHz	16QAM	131997	1RB#24	22.17	22.67	PASS
Band66	5MHz	16QAM	131997	12RB#0	21.13	21.63	PASS
Band66	5MHz	16QAM	131997	12RB#6	21.21	21.71	PASS
Band66	5MHz	16QAM	131997	12RB#13	21.21	21.71	PASS
Band66	5MHz	16QAM	131997	25RB#0	21.21	21.71	PASS
Band66	5MHz	16QAM	132322	1RB#0	22.43	22.93	PASS
Band66	5MHz	16QAM	132322	1RB#12	22.51	23.01	PASS
Band66	5MHz	16QAM	132322	1RB#24	22.38	22.88	PASS
Band66	5MHz	16QAM	132322	12RB#0	21.15	21.65	PASS
Band66	5MHz	16QAM	132322	12RB#6	21.17	21.67	PASS
Band66	5MHz	16QAM	132322	12RB#13	21.28	21.78	PASS
Band66	5MHz	16QAM	132322	25RB#0	21.25	21.75	PASS
Band66	5MHz	16QAM	132647	1RB#0	22.37	22.87	PASS
Band66	5MHz	16QAM	132647	1RB#12	22.17	22.67	PASS
Band66	5MHz	16QAM	132647	1RB#24	22.22	22.72	PASS
Band66	5MHz	16QAM	132647	12RB#0	21.14	21.64	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 6 of 132

Band66	5MHz	16QAM	132647	12RB#6	21.26	21.76	PASS
Band66	5MHz	16QAM	132647	12RB#13	21.21	21.71	PASS
Band66	5MHz	16QAM	132647	25RB#0	21.19	21.69	PASS
Band66	5MHz	64QAM	131997	1RB#0	21.31	21.81	PASS
Band66	5MHz	64QAM	131997	1RB#12	21.27	21.77	PASS
Band66	5MHz	64QAM	131997	1RB#24	21.22	21.72	PASS
Band66	5MHz	64QAM	131997	12RB#0	20.14	20.64	PASS
Band66	5MHz	64QAM	131997	12RB#6	20.20	20.70	PASS
Band66	5MHz	64QAM	131997	12RB#13	20.18	20.68	PASS
Band66	5MHz	64QAM	131997	25RB#0	20.15	20.65	PASS
Band66	5MHz	64QAM	132322	1RB#0	21.18	21.68	PASS
Band66	5MHz	64QAM	132322	1RB#12	21.36	21.86	PASS
Band66	5MHz	64QAM	132322	1RB#24	21.22	21.72	PASS
Band66	5MHz	64QAM	132322	12RB#0	20.16	20.66	PASS
Band66	5MHz	64QAM	132322	12RB#6	20.22	20.72	PASS
Band66	5MHz	64QAM	132322	12RB#13	20.26	20.76	PASS
Band66	5MHz	64QAM	132322	25RB#0	20.23	20.73	PASS
Band66	5MHz	64QAM	132647	1RB#0	21.38	21.88	PASS
Band66	5MHz	64QAM	132647	1RB#12	21.54	22.04	PASS
Band66	5MHz	64QAM	132647	1RB#24	21.35	21.85	PASS
Band66	5MHz	64QAM	132647	12RB#0	20.22	20.72	PASS
Band66	5MHz	64QAM	132647	12RB#6	20.28	20.78	PASS
Band66	5MHz	64QAM	132647	12RB#13	20.22	20.72	PASS
Band66	5MHz	64QAM	132647	25RB#0	20.17	20.67	PASS
Band66	10MHz	QPSK	132022	1RB#0	23.07	23.57	PASS
Band66	10MHz	QPSK	132022	1RB#24	23.13	23.63	PASS
Band66	10MHz	QPSK	132022	1RB#49	23.12	23.62	PASS
Band66	10MHz	QPSK	132022	25RB#0	22.23	22.73	PASS
Band66	10MHz	QPSK	132022	25RB#12	22.19	22.69	PASS
Band66	10MHz	QPSK	132022	25RB#25	22.21	22.71	PASS
Band66	10MHz	QPSK	132022	50RB#0	22.26	22.76	PASS
Band66	10MHz	QPSK	132322	1RB#0	23.17	23.67	PASS
Band66	10MHz	QPSK	132322	1RB#24	23.24	23.74	PASS
Band66	10MHz	QPSK	132322	1RB#49	23.28	23.78	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 7 of 132

Band66	10MHz	QPSK	132322	25RB#0	22.22	22.72	PASS
Band66	10MHz	QPSK	132322	25RB#12	22.19	22.69	PASS
Band66	10MHz	QPSK	132322	25RB#25	22.25	22.75	PASS
Band66	10MHz	QPSK	132322	50RB#0	22.30	22.80	PASS
Band66	10MHz	QPSK	132622	1RB#0	23.27	23.77	PASS
Band66	10MHz	QPSK	132622	1RB#24	23.23	23.73	PASS
Band66	10MHz	QPSK	132622	1RB#49	23.30	23.80	PASS
Band66	10MHz	QPSK	132622	25RB#0	22.16	22.66	PASS
Band66	10MHz	QPSK	132622	25RB#12	22.12	22.62	PASS
Band66	10MHz	QPSK	132622	25RB#25	22.24	22.74	PASS
Band66	10MHz	QPSK	132622	50RB#0	22.24	22.74	PASS
Band66	10MHz	16QAM	132022	1RB#0	22.07	22.57	PASS
Band66	10MHz	16QAM	132022	1RB#24	22.28	22.78	PASS
Band66	10MHz	16QAM	132022	1RB#49	22.18	22.68	PASS
Band66	10MHz	16QAM	132022	25RB#0	21.22	21.72	PASS
Band66	10MHz	16QAM	132022	25RB#12	21.23	21.73	PASS
Band66	10MHz	16QAM	132022	25RB#25	21.23	21.73	PASS
Band66	10MHz	16QAM	132022	50RB#0	21.25	21.75	PASS
Band66	10MHz	16QAM	132322	1RB#0	22.28	22.78	PASS
Band66	10MHz	16QAM	132322	1RB#24	22.33	22.83	PASS
Band66	10MHz	16QAM	132322	1RB#49	22.33	22.83	PASS
Band66	10MHz	16QAM	132322	25RB#0	21.23	21.73	PASS
Band66	10MHz	16QAM	132322	25RB#12	21.19	21.69	PASS
Band66	10MHz	16QAM	132322	25RB#25	21.33	21.83	PASS
Band66	10MHz	16QAM	132322	50RB#0	21.29	21.79	PASS
Band66	10MHz	16QAM	132622	1RB#0	22.14	22.64	PASS
Band66	10MHz	16QAM	132622	1RB#24	22.22	22.72	PASS
Band66	10MHz	16QAM	132622	1RB#49	22.17	22.67	PASS
Band66	10MHz	16QAM	132622	25RB#0	21.18	21.68	PASS
Band66	10MHz	16QAM	132622	25RB#12	21.14	21.64	PASS
Band66	10MHz	16QAM	132622	25RB#25	21.26	21.76	PASS
Band66	10MHz	16QAM	132622	50RB#0	21.24	21.74	PASS
Band66	10MHz	64QAM	132022	1RB#0	21.28	21.78	PASS
Band66	10MHz	64QAM	132022	1RB#24	21.34	21.84	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 8 of 132

Band66	10MHz	64QAM	132022	1RB#49	21.37	21.87	PASS
Band66	10MHz	64QAM	132022	25RB#0	20.22	20.72	PASS
Band66	10MHz	64QAM	132022	25RB#12	20.23	20.73	PASS
Band66	10MHz	64QAM	132022	25RB#25	20.25	20.75	PASS
Band66	10MHz	64QAM	132022	50RB#0	20.24	20.74	PASS
Band66	10MHz	64QAM	132322	1RB#0	21.51	22.01	PASS
Band66	10MHz	64QAM	132322	1RB#24	21.54	22.04	PASS
Band66	10MHz	64QAM	132322	1RB#49	21.61	22.11	PASS
Band66	10MHz	64QAM	132322	25RB#0	20.17	20.67	PASS
Band66	10MHz	64QAM	132322	25RB#12	20.17	20.67	PASS
Band66	10MHz	64QAM	132322	25RB#25	20.29	20.79	PASS
Band66	10MHz	64QAM	132322	50RB#0	20.34	20.84	PASS
Band66	10MHz	64QAM	132622	1RB#0	21.41	21.91	PASS
Band66	10MHz	64QAM	132622	1RB#24	21.25	21.75	PASS
Band66	10MHz	64QAM	132622	1RB#49	21.29	21.79	PASS
Band66	10MHz	64QAM	132622	25RB#0	20.21	20.71	PASS
Band66	10MHz	64QAM	132622	25RB#12	20.15	20.65	PASS
Band66	10MHz	64QAM	132622	25RB#25	20.25	20.75	PASS
Band66	10MHz	64QAM	132622	50RB#0	20.27	20.77	PASS
Band66	15MHz	QPSK	132047	1RB#0	22.88	23.38	PASS
Band66	15MHz	QPSK	132047	1RB#38	22.97	23.47	PASS
Band66	15MHz	QPSK	132047	1RB#74	23.05	23.55	PASS
Band66	15MHz	QPSK	132047	38RB#0	22.15	22.65	PASS
Band66	15MHz	QPSK	132047	38RB#18	22.13	22.63	PASS
Band66	15MHz	QPSK	132047	38RB#37	22.10	22.60	PASS
Band66	15MHz	QPSK	132047	75RB#0	22.09	22.59	PASS
Band66	15MHz	QPSK	132322	1RB#0	22.94	23.44	PASS
Band66	15MHz	QPSK	132322	1RB#38	23.03	23.53	PASS
Band66	15MHz	QPSK	132322	1RB#74	23.04	23.54	PASS
Band66	15MHz	QPSK	132322	38RB#0	22.17	22.67	PASS
Band66	15MHz	QPSK	132322	38RB#18	22.18	22.68	PASS
Band66	15MHz	QPSK	132322	38RB#37	22.16	22.66	PASS
Band66	15MHz	QPSK	132322	75RB#0	22.16	22.66	PASS
Band66	15MHz	QPSK	132597	1RB#0	23.10	23.60	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 9 of 132

Band66	15MHz	QPSK	132597	1RB#38	23.01	23.51	PASS
Band66	15MHz	QPSK	132597	1RB#74	22.98	23.48	PASS
Band66	15MHz	QPSK	132597	38RB#0	22.09	22.59	PASS
Band66	15MHz	QPSK	132597	38RB#18	22.09	22.59	PASS
Band66	15MHz	QPSK	132597	38RB#37	22.07	22.57	PASS
Band66	15MHz	QPSK	132597	75RB#0	22.06	22.56	PASS
Band66	15MHz	16QAM	132047	1RB#0	22.14	22.64	PASS
Band66	15MHz	16QAM	132047	1RB#38	21.89	22.39	PASS
Band66	15MHz	16QAM	132047	1RB#74	22.02	22.52	PASS
Band66	15MHz	16QAM	132047	38RB#0	22.09	22.59	PASS
Band66	15MHz	16QAM	132047	38RB#18	22.13	22.63	PASS
Band66	15MHz	16QAM	132047	38RB#37	22.13	22.63	PASS
Band66	15MHz	16QAM	132047	75RB#0	21.12	21.62	PASS
Band66	15MHz	16QAM	132322	1RB#0	22.14	22.64	PASS
Band66	15MHz	16QAM	132322	1RB#38	22.30	22.80	PASS
Band66	15MHz	16QAM	132322	1RB#74	22.33	22.83	PASS
Band66	15MHz	16QAM	132322	38RB#0	22.17	22.67	PASS
Band66	15MHz	16QAM	132322	38RB#18	22.18	22.68	PASS
Band66	15MHz	16QAM	132322	38RB#37	22.20	22.70	PASS
Band66	15MHz	16QAM	132322	75RB#0	21.20	21.70	PASS
Band66	15MHz	16QAM	132597	1RB#0	22.16	22.66	PASS
Band66	15MHz	16QAM	132597	1RB#38	22.20	22.70	PASS
Band66	15MHz	16QAM	132597	1RB#74	22.08	22.58	PASS
Band66	15MHz	16QAM	132597	38RB#0	22.08	22.58	PASS
Band66	15MHz	16QAM	132597	38RB#18	22.02	22.52	PASS
Band66	15MHz	16QAM	132597	38RB#37	22.07	22.57	PASS
Band66	15MHz	16QAM	132597	75RB#0	21.08	21.58	PASS
Band66	15MHz	64QAM	132047	1RB#0	21.01	21.51	PASS
Band66	15MHz	64QAM	132047	1RB#38	21.38	21.88	PASS
Band66	15MHz	64QAM	132047	1RB#74	21.34	21.84	PASS
Band66	15MHz	64QAM	132047	38RB#0	22.08	22.58	PASS
Band66	15MHz	64QAM	132047	38RB#18	22.11	22.61	PASS
Band66	15MHz	64QAM	132047	38RB#37	22.11	22.61	PASS
Band66	15MHz	64QAM	132047	75RB#0	20.12	20.62	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 10 of 132

Band66	15MHz	64QAM	132322	1RB#0	21.04	21.54	PASS
Band66	15MHz	64QAM	132322	1RB#38	21.24	21.74	PASS
Band66	15MHz	64QAM	132322	1RB#74	21.25	21.75	PASS
Band66	15MHz	64QAM	132322	38RB#0	22.16	22.66	PASS
Band66	15MHz	64QAM	132322	38RB#18	22.17	22.67	PASS
Band66	15MHz	64QAM	132322	38RB#37	22.16	22.66	PASS
Band66	15MHz	64QAM	132322	75RB#0	20.13	20.63	PASS
Band66	15MHz	64QAM	132597	1RB#0	21.22	21.72	PASS
Band66	15MHz	64QAM	132597	1RB#38	21.02	21.52	PASS
Band66	15MHz	64QAM	132597	1RB#74	21.05	21.55	PASS
Band66	15MHz	64QAM	132597	38RB#0	22.04	22.54	PASS
Band66	15MHz	64QAM	132597	38RB#18	22.07	22.57	PASS
Band66	15MHz	64QAM	132597	38RB#37	22.07	22.57	PASS
Band66	15MHz	64QAM	132597	75RB#0	20.06	20.56	PASS
Band66	20MHz	QPSK	132072	1RB#0	23.12	23.62	PASS
Band66	20MHz	QPSK	132072	1RB#49	22.95	23.45	PASS
Band66	20MHz	QPSK	132072	1RB#99	23.26	23.76	PASS
Band66	20MHz	QPSK	132072	50RB#0	22.13	22.63	PASS
Band66	20MHz	QPSK	132072	50RB#25	22.11	22.61	PASS
Band66	20MHz	QPSK	132072	50RB#50	22.18	22.68	PASS
Band66	20MHz	QPSK	132072	100RB#0	22.12	22.62	PASS
Band66	20MHz	QPSK	132322	1RB#0	23.04	23.54	PASS
Band66	20MHz	QPSK	132322	1RB#49	23.06	23.56	PASS
Band66	20MHz	QPSK	132322	1RB#99	23.21	23.71	PASS
Band66	20MHz	QPSK	132322	50RB#0	22.07	22.57	PASS
Band66	20MHz	QPSK	132322	50RB#25	22.13	22.63	PASS
Band66	20MHz	QPSK	132322	50RB#50	22.20	22.70	PASS
Band66	20MHz	QPSK	132322	100RB#0	22.21	22.71	PASS
Band66	20MHz	QPSK	132572	1RB#0	23.01	23.51	PASS
Band66	20MHz	QPSK	132572	1RB#49	23.10	23.60	PASS
Band66	20MHz	QPSK	132572	1RB#99	23.07	23.57	PASS
Band66	20MHz	QPSK	132572	50RB#0	22.06	22.56	PASS
Band66	20MHz	QPSK	132572	50RB#25	22.07	22.57	PASS
Band66	20MHz	QPSK	132572	50RB#50	22.19	22.69	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 11 of 132

Band66	20MHz	QPSK	132572	100RB#0	22.12	22.62	PASS
Band66	20MHz	16QAM	132072	1RB#0	22.08	22.58	PASS
Band66	20MHz	16QAM	132072	1RB#49	22.22	22.72	PASS
Band66	20MHz	16QAM	132072	1RB#99	22.18	22.68	PASS
Band66	20MHz	16QAM	132072	50RB#0	21.11	21.61	PASS
Band66	20MHz	16QAM	132072	50RB#25	21.12	21.62	PASS
Band66	20MHz	16QAM	132072	50RB#50	21.17	21.67	PASS
Band66	20MHz	16QAM	132072	100RB#0	21.16	21.66	PASS
Band66	20MHz	16QAM	132322	1RB#0	22.19	22.69	PASS
Band66	20MHz	16QAM	132322	1RB#49	22.10	22.60	PASS
Band66	20MHz	16QAM	132322	1RB#99	22.21	22.71	PASS
Band66	20MHz	16QAM	132322	50RB#0	21.10	21.60	PASS
Band66	20MHz	16QAM	132322	50RB#25	21.15	21.65	PASS
Band66	20MHz	16QAM	132322	50RB#50	21.28	21.78	PASS
Band66	20MHz	16QAM	132322	100RB#0	21.20	21.70	PASS
Band66	20MHz	16QAM	132572	1RB#0	22.14	22.64	PASS
Band66	20MHz	16QAM	132572	1RB#49	22.06	22.56	PASS
Band66	20MHz	16QAM	132572	1RB#99	21.98	22.48	PASS
Band66	20MHz	16QAM	132572	50RB#0	21.12	21.62	PASS
Band66	20MHz	16QAM	132572	50RB#25	21.09	21.59	PASS
Band66	20MHz	16QAM	132572	50RB#50	21.17	21.67	PASS
Band66	20MHz	16QAM	132572	100RB#0	21.09	21.59	PASS
Band66	20MHz	64QAM	132072	1RB#0	21.16	21.66	PASS
Band66	20MHz	64QAM	132072	1RB#49	21.21	21.71	PASS
Band66	20MHz	64QAM	132072	1RB#99	21.30	21.80	PASS
Band66	20MHz	64QAM	132072	50RB#0	20.13	20.63	PASS
Band66	20MHz	64QAM	132072	50RB#25	20.11	20.61	PASS
Band66	20MHz	64QAM	132072	50RB#50	20.18	20.68	PASS
Band66	20MHz	64QAM	132072	100RB#0	20.13	20.63	PASS
Band66	20MHz	64QAM	132322	1RB#0	21.18	21.68	PASS
Band66	20MHz	64QAM	132322	1RB#49	21.38	21.88	PASS
Band66	20MHz	64QAM	132322	1RB#99	21.45	21.95	PASS
Band66	20MHz	64QAM	132322	50RB#0	20.10	20.60	PASS
Band66	20MHz	64QAM	132322	50RB#25	20.12	20.62	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 12 of 132

Band66	20MHz	64QAM	132322	50RB#50	20.26	20.76	PASS
Band66	20MHz	64QAM	132322	100RB#0	20.22	20.72	PASS
Band66	20MHz	64QAM	132572	1RB#0	21.11	21.61	PASS
Band66	20MHz	64QAM	132572	1RB#49	21.12	21.62	PASS
Band66	20MHz	64QAM	132572	1RB#99	21.03	21.53	PASS
Band66	20MHz	64QAM	132572	50RB#0	20.10	20.60	PASS
Band66	20MHz	64QAM	132572	50RB#25	20.11	20.61	PASS
Band66	20MHz	64QAM	132572	50RB#50	20.14	20.64	PASS
Band66	20MHz	64QAM	132572	100RB#0	20.11	20.61	PASS



Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	3.60	13	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	4.44	13	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	3.68	13	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	4.52	13	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	3.76	13	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	4.56	13	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	4.48	13	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	5.48	13	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	4.68	13	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	5.40	13	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	4.52	13	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	5.48	13	PASS
Band66	1.4MHz	64QAM	131979	1RB#0	5.36	13	PASS
Band66	1.4MHz	64QAM	131979	6RB#0	6.44	13	PASS
Band66	1.4MHz	64QAM	132322	1RB#0	5.32	13	PASS
Band66	1.4MHz	64QAM	132322	6RB#0	6.48	13	PASS
Band66	1.4MHz	64QAM	132665	1RB#0	5.44	13	PASS
Band66	1.4MHz	64QAM	132665	6RB#0	6.36	13	PASS
Band66	3MHz	QPSK	131987	1RB#0	3.68	13	PASS
Band66	3MHz	QPSK	131987	15RB#0	4.48	13	PASS
Band66	3MHz	QPSK	132322	1RB#0	3.76	13	PASS
Band66	3MHz	QPSK	132322	15RB#0	4.56	13	PASS
Band66	3MHz	QPSK	132657	1RB#0	3.76	13	PASS
Band66	3MHz	QPSK	132657	15RB#0	4.56	13	PASS
Band66	3MHz	16QAM	131987	1RB#0	4.52	13	PASS
Band66	3MHz	16QAM	131987	15RB#0	5.48	13	PASS
Band66	3MHz	16QAM	132322	1RB#0	4.56	13	PASS
Band66	3MHz	16QAM	132322	15RB#0	5.44	13	PASS
Band66	3MHz	16QAM	132657	1RB#0	4.72	13	PASS
Band66	3MHz	16QAM	132657	15RB#0	5.52	13	PASS
Band66	3MHz	64QAM	131987	1RB#0	5.36	13	PASS
Band66	3MHz	64QAM	131987	15RB#0	6.40	13	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 14 of 132

Band66	3MHz	64QAM	132322	1RB#0	5.44	13	PASS
Band66	3MHz	64QAM	132322	15RB#0	6.36	13	PASS
Band66	3MHz	64QAM	132657	1RB#0	5.52	13	PASS
Band66	3MHz	64QAM	132657	15RB#0	6.48	13	PASS
Band66	5MHz	QPSK	131997	1RB#0	3.68	13	PASS
Band66	5MHz	QPSK	131997	25RB#0	4.52	13	PASS
Band66	5MHz	QPSK	132322	1RB#0	3.68	13	PASS
Band66	5MHz	QPSK	132322	25RB#0	4.52	13	PASS
Band66	5MHz	QPSK	132647	1RB#0	3.68	13	PASS
Band66	5MHz	QPSK	132647	25RB#0	4.60	13	PASS
Band66	5MHz	16QAM	131997	1RB#0	4.52	13	PASS
Band66	5MHz	16QAM	131997	25RB#0	5.48	13	PASS
Band66	5MHz	16QAM	132322	1RB#0	4.52	13	PASS
Band66	5MHz	16QAM	132322	25RB#0	5.52	13	PASS
Band66	5MHz	16QAM	132647	1RB#0	4.48	13	PASS
Band66	5MHz	16QAM	132647	25RB#0	5.56	13	PASS
Band66	5MHz	64QAM	131997	1RB#0	5.36	13	PASS
Band66	5MHz	64QAM	131997	25RB#0	6.40	13	PASS
Band66	5MHz	64QAM	132322	1RB#0	5.44	13	PASS
Band66	5MHz	64QAM	132322	25RB#0	6.36	13	PASS
Band66	5MHz	64QAM	132647	1RB#0	5.56	13	PASS
Band66	5MHz	64QAM	132647	25RB#0	6.36	13	PASS
Band66	10MHz	QPSK	132022	1RB#0	3.52	13	PASS
Band66	10MHz	QPSK	132022	50RB#0	4.64	13	PASS
Band66	10MHz	QPSK	132322	1RB#0	3.68	13	PASS
Band66	10MHz	QPSK	132322	50RB#0	4.60	13	PASS
Band66	10MHz	QPSK	132622	1RB#0	3.56	13	PASS
Band66	10MHz	QPSK	132622	50RB#0	4.76	13	PASS
Band66	10MHz	16QAM	132022	1RB#0	4.68	13	PASS
Band66	10MHz	16QAM	132022	50RB#0	5.52	13	PASS
Band66	10MHz	16QAM	132322	1RB#0	4.72	13	PASS
Band66	10MHz	16QAM	132322	50RB#0	5.52	13	PASS
Band66	10MHz	16QAM	132622	1RB#0	4.48	13	PASS
Band66	10MHz	16QAM	132622	50RB#0	5.68	13	PASS
Band66	10MHz	64QAM	132022	1RB#0	5.44	13	PASS
Band66	10MHz	64QAM	132022	50RB#0	6.40	13	PASS
Band66	10MHz	64QAM	132322	1RB#0	5.44	13	PASS
Band66	10MHz	64QAM	132322	50RB#0	6.44	13	PASS
Band66	10MHz	64QAM	132622	1RB#0	5.28	13	PASS
Band66	10MHz	64QAM	132622	50RB#0	6.44	13	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 15 of 132

Band66	15MHz	QPSK	132047	1RB#0	3.68	13	PASS
Band66	15MHz	QPSK	132047	75RB#0	4.72	13	PASS
Band66	15MHz	QPSK	132322	1RB#0	3.60	13	PASS
Band66	15MHz	QPSK	132322	75RB#0	4.72	13	PASS
Band66	15MHz	QPSK	132597	1RB#0	3.60	13	PASS
Band66	15MHz	QPSK	132597	75RB#0	5.04	13	PASS
Band66	15MHz	16QAM	132047	1RB#0	4.72	13	PASS
Band66	15MHz	16QAM	132047	75RB#0	5.56	13	PASS
Band66	15MHz	16QAM	132322	1RB#0	5.00	13	PASS
Band66	15MHz	16QAM	132322	75RB#0	5.72	13	PASS
Band66	15MHz	16QAM	132597	1RB#0	4.44	13	PASS
Band66	15MHz	16QAM	132597	75RB#0	5.92	13	PASS
Band66	15MHz	64QAM	132047	1RB#0	5.40	13	PASS
Band66	15MHz	64QAM	132047	75RB#0	6.48	13	PASS
Band66	15MHz	64QAM	132322	1RB#0	5.44	13	PASS
Band66	15MHz	64QAM	132322	75RB#0	6.36	13	PASS
Band66	15MHz	64QAM	132597	1RB#0	5.36	13	PASS
Band66	15MHz	64QAM	132597	75RB#0	6.52	13	PASS
Band66	20MHz	QPSK	132072	1RB#0	3.60	13	PASS
Band66	20MHz	QPSK	132072	100RB#0	4.64	13	PASS
Band66	20MHz	QPSK	132322	1RB#0	3.88	13	PASS
Band66	20MHz	QPSK	132322	100RB#0	4.84	13	PASS
Band66	20MHz	QPSK	132572	1RB#0	3.88	13	PASS
Band66	20MHz	QPSK	132572	100RB#0	5.04	13	PASS
Band66	20MHz	16QAM	132072	1RB#0	4.52	13	PASS
Band66	20MHz	16QAM	132072	100RB#0	5.68	13	PASS
Band66	20MHz	16QAM	132322	1RB#0	4.80	13	PASS
Band66	20MHz	16QAM	132322	100RB#0	5.68	13	PASS
Band66	20MHz	16QAM	132572	1RB#0	4.68	13	PASS
Band66	20MHz	16QAM	132572	100RB#0	5.92	13	PASS
Band66	20MHz	64QAM	132072	1RB#0	5.52	13	PASS
Band66	20MHz	64QAM	132072	100RB#0	6.44	13	PASS
Band66	20MHz	64QAM	132322	1RB#0	5.48	13	PASS
Band66	20MHz	64QAM	132322	100RB#0	6.52	13	PASS
Band66	20MHz	64QAM	132572	1RB#0	5.60	13	PASS
Band66	20MHz	64QAM	132572	100RB#0	6.56	13	PASS



Test Graphs


Band66-1.4MHz-QPSK-131979-1RB#0




Band66-1.4MHz-QPSK-131979-6RB#0




Band66-1.4MHz-QPSK-132322-1RB#0

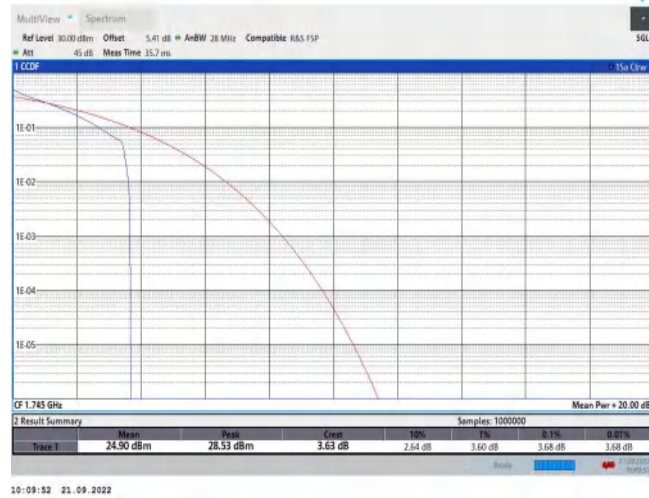

Band66-1.4MHz-QPSK-132322-6RB#0

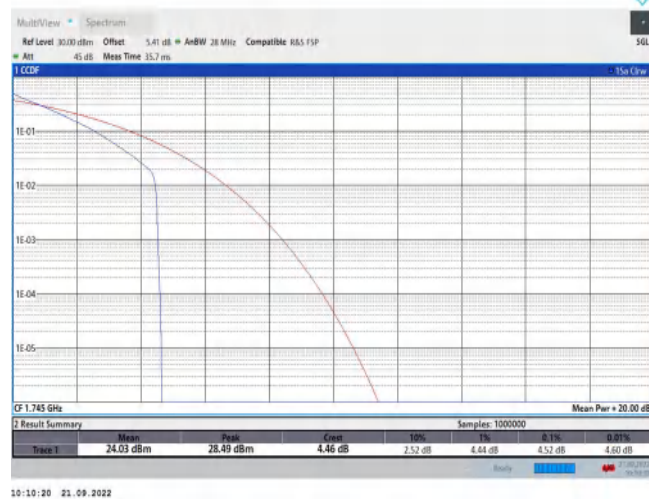


Band66-1.4MHz-QPSK-132665-1RB#0

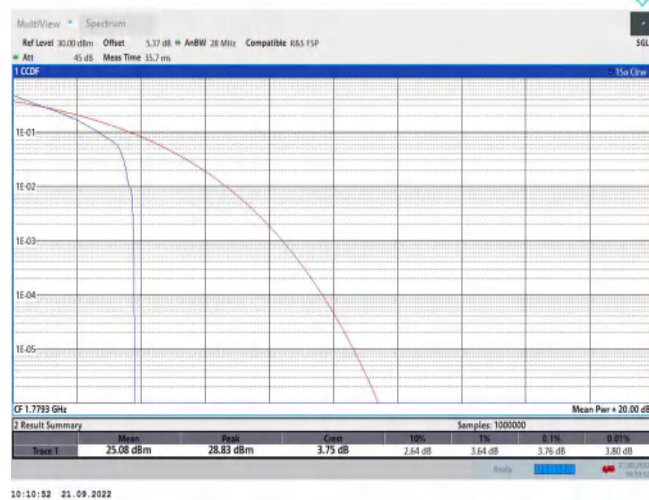





Band66-1.4MHz-QPSK-132665-6RB#0

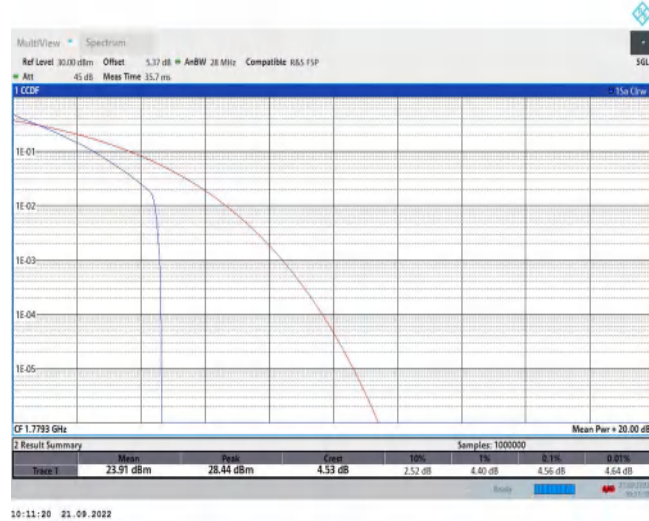


Band66-1.4MHz-16QAM-131979-1RB#0

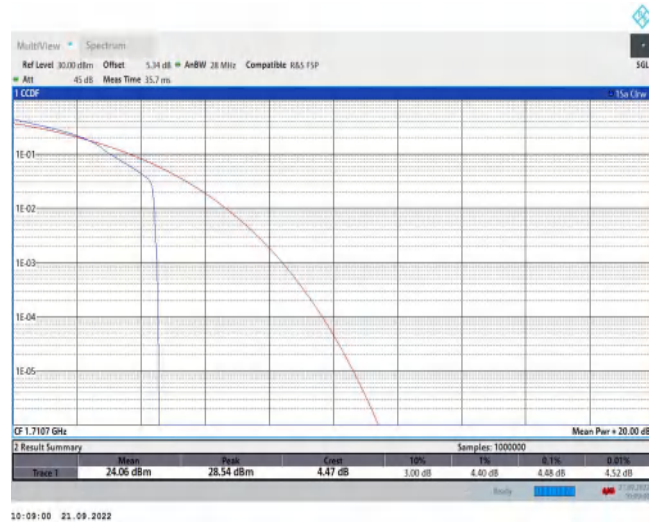


Band66-1.4MHz-16QAM-131979-6RB#0

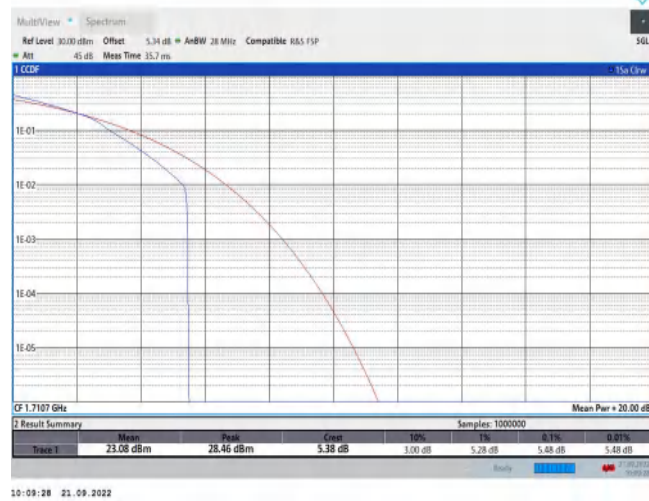

Band66-1.4MHz-16QAM-132322-1RB#0

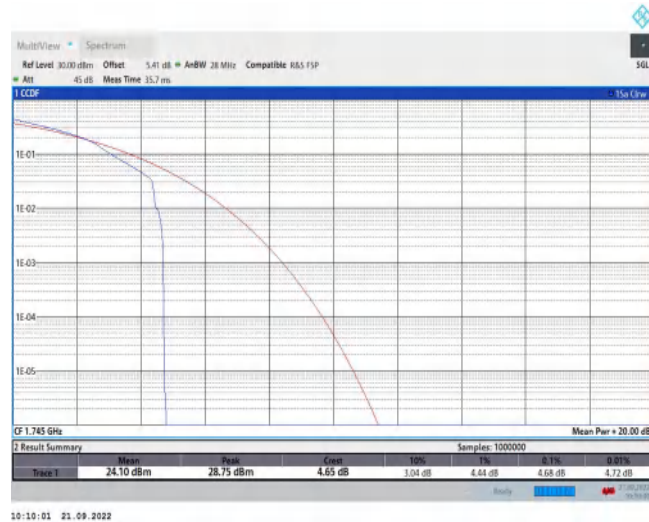


Band66-1.4MHz-16QAM-132322-6RB#0

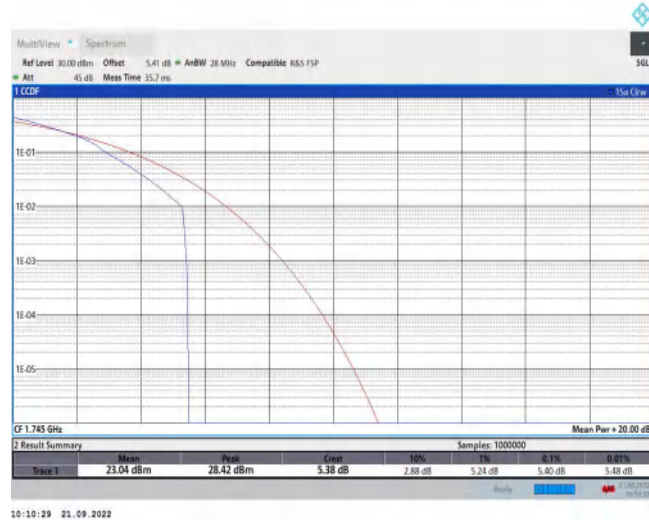





Band66-1.4MHz-16QAM-132665-1RB#0

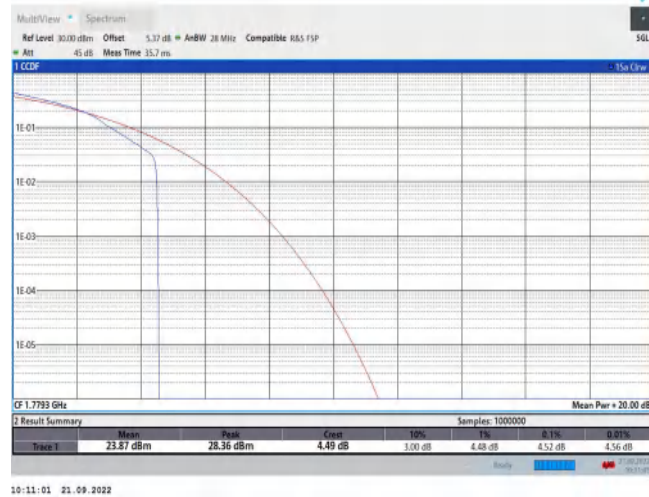


Band66-1.4MHz-16QAM-132665-6RB#0

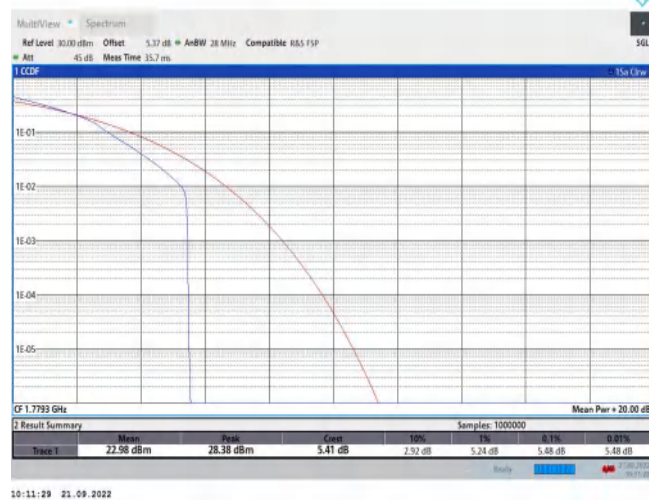


Band66-1.4MHz-64QAM-131979-1RB#0

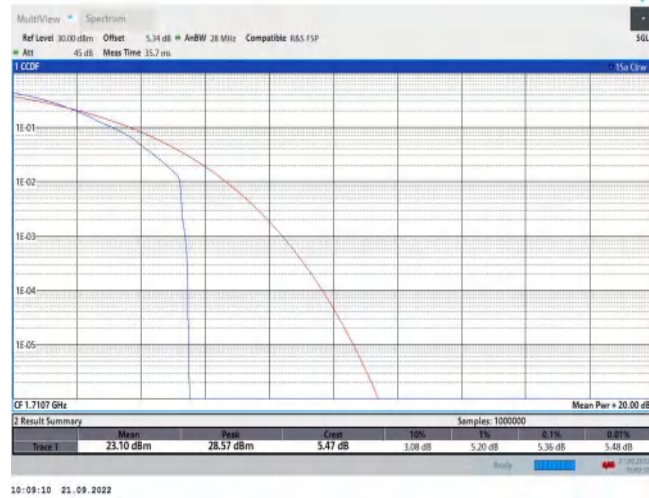

Band66-1.4MHz-64QAM-131979-6RB#0

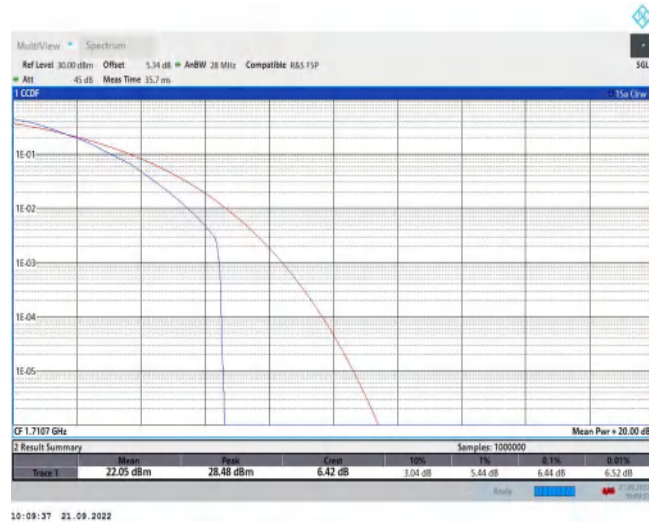


Band66-1.4MHz-64QAM-132322-1RB#0

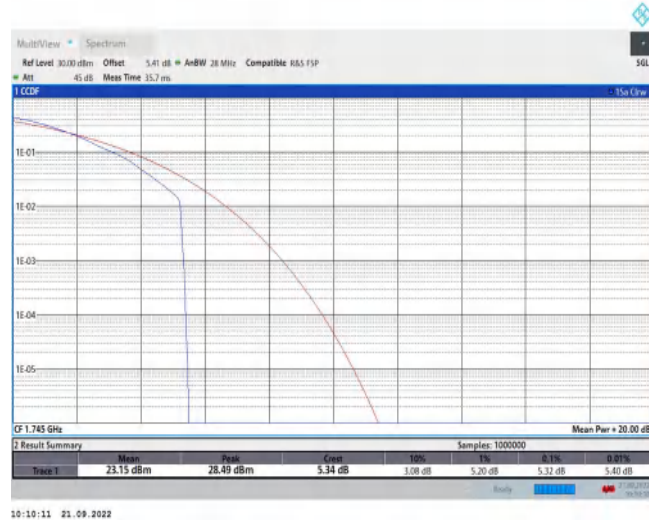





Band66-1.4MHz-64QAM-132322-6RB#0

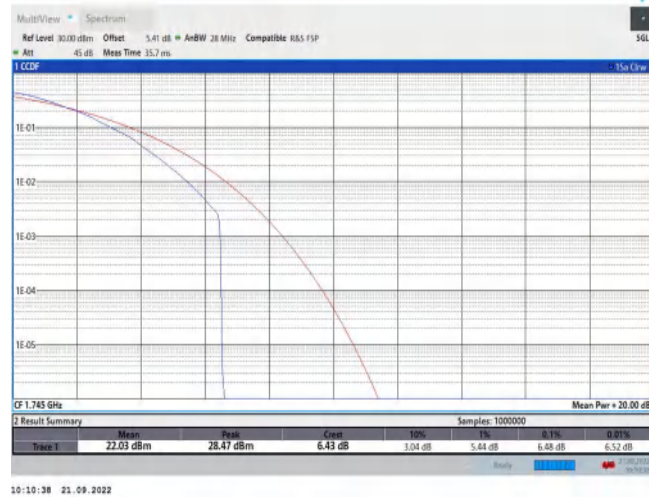


Band66-1.4MHz-64QAM-132665-1RB#0

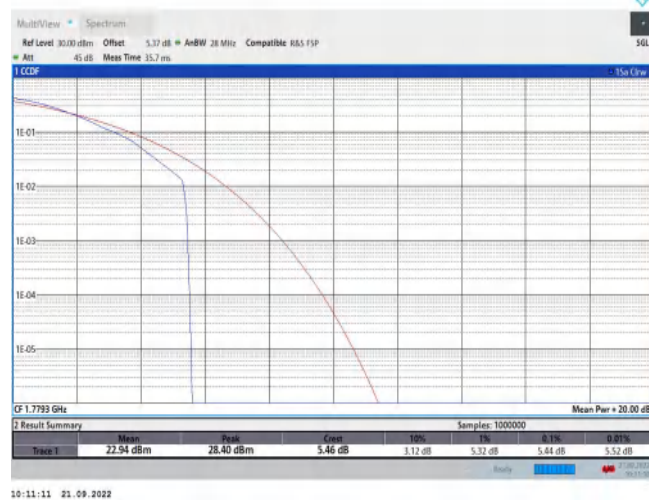


Band66-1.4MHz-64QAM-132665-6RB#0

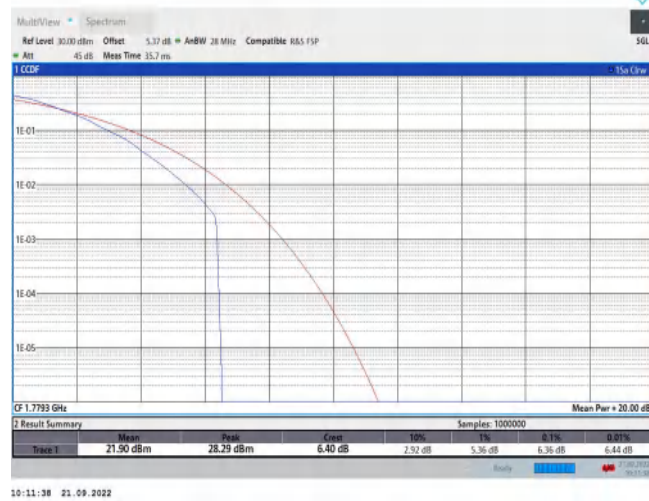

Band66-3MHz-QPSK-131987-1RB#0

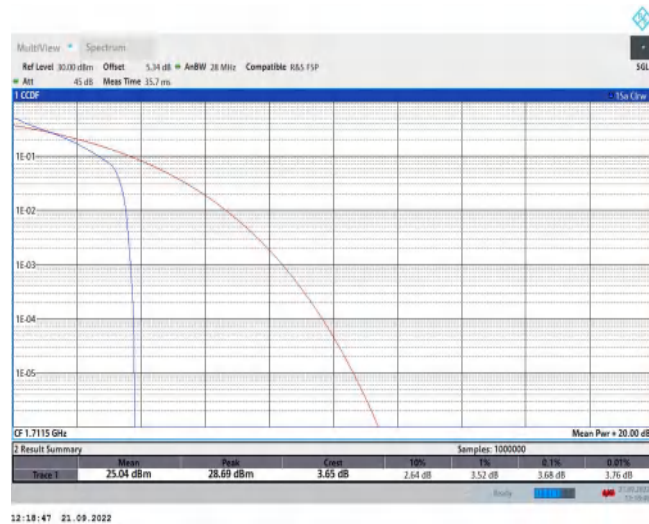


Band66-3MHz-QPSK-131987-15RB#0

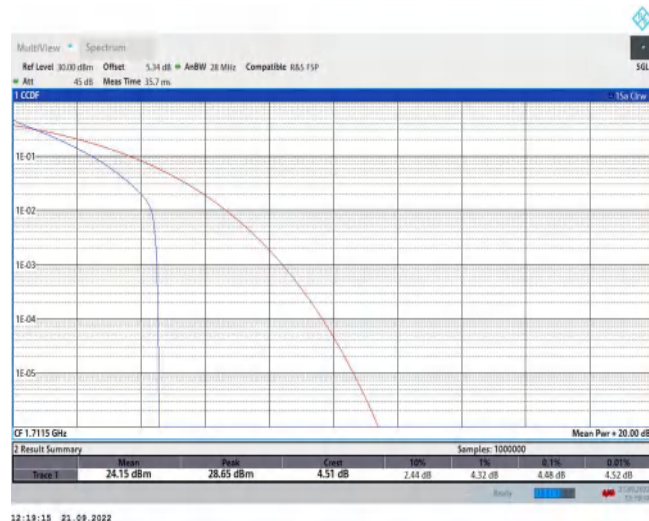





Band66-3MHz-QPSK-132322-1RB#0

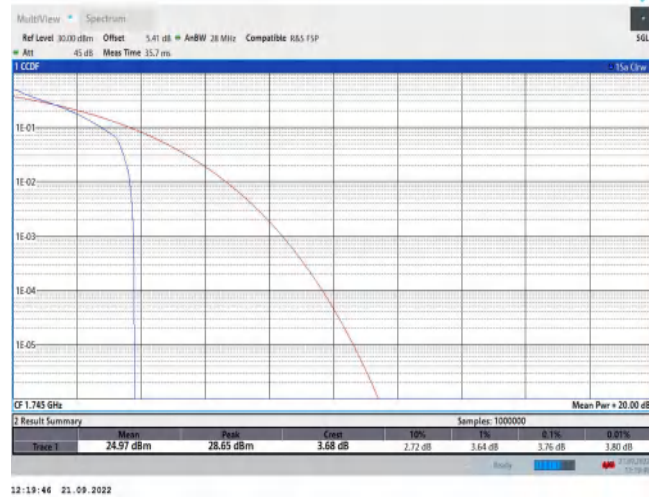


Band66-3MHz-QPSK-132322-15RB#0

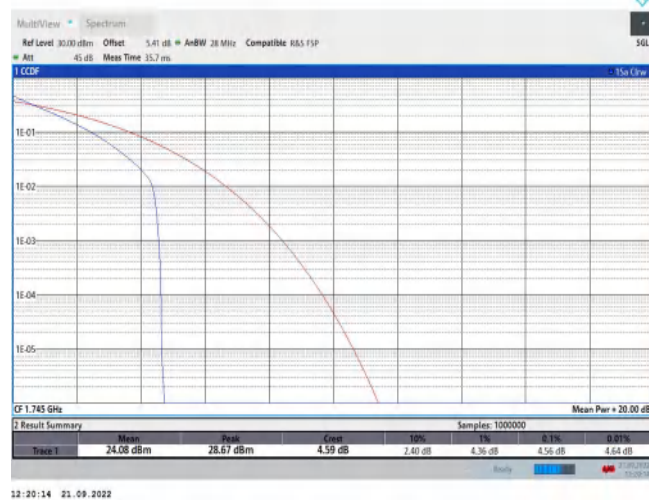


Band66-3MHz-QPSK-132657-1RB#0

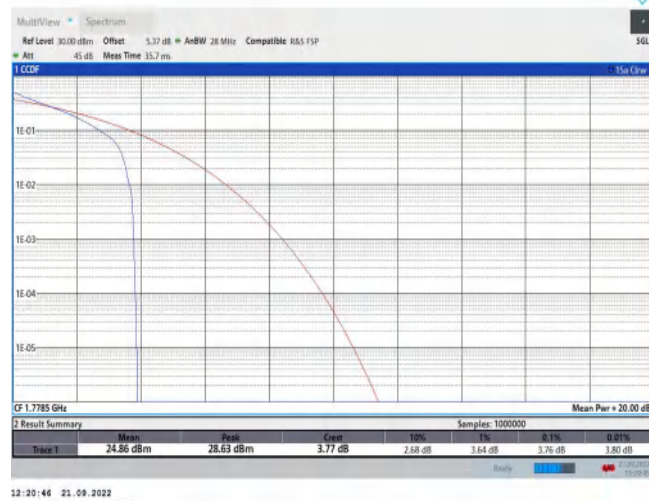

Band66-3MHz-QPSK-132657-15RB#0

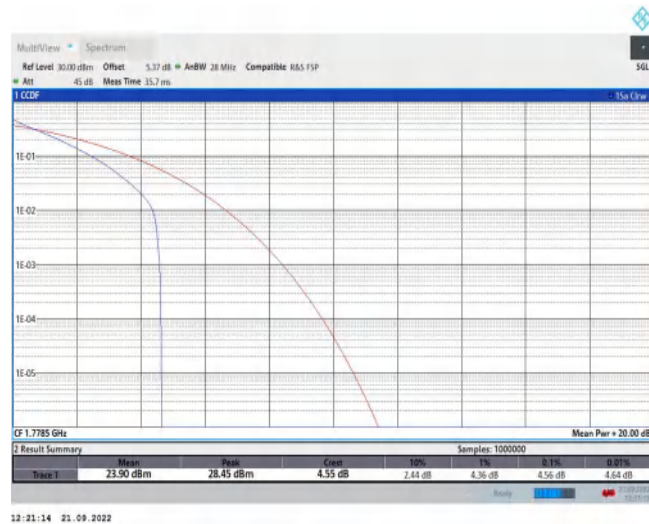


Band66-3MHz-16QAM-131987-1RB#0

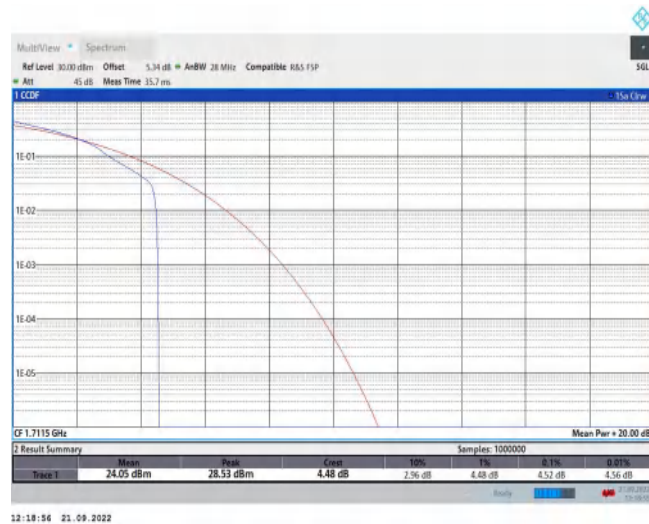





Band66-3MHz-16QAM-131987-15RB#0

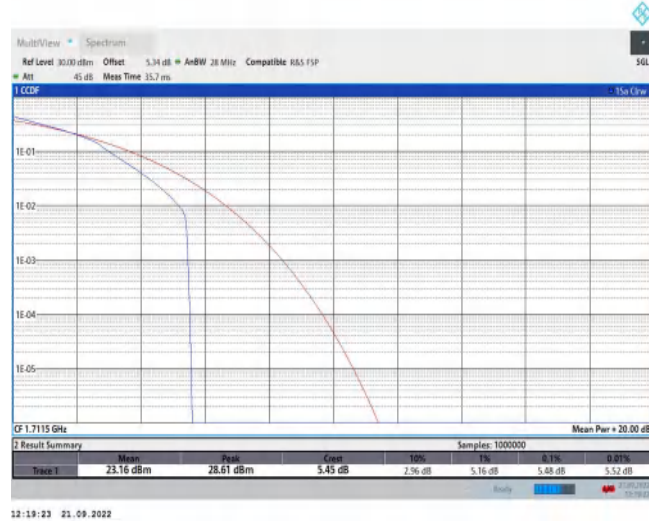


Band66-3MHz-16QAM-132322-1RB#0

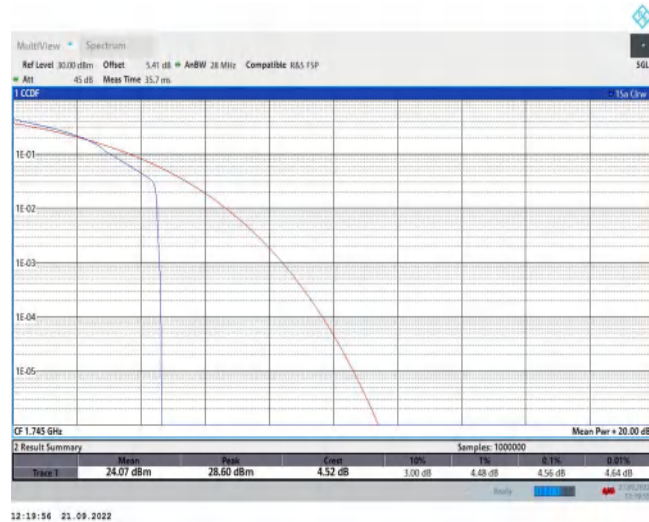


Band66-3MHz-16QAM-132322-15RB#0

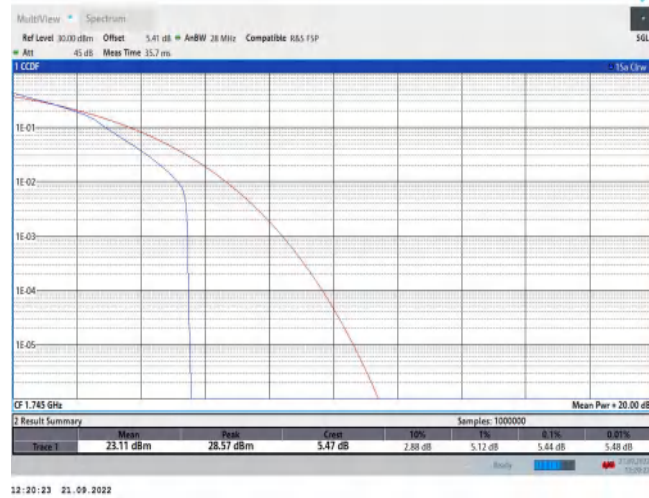

Band66-3MHz-16QAM-132657-1RB#0

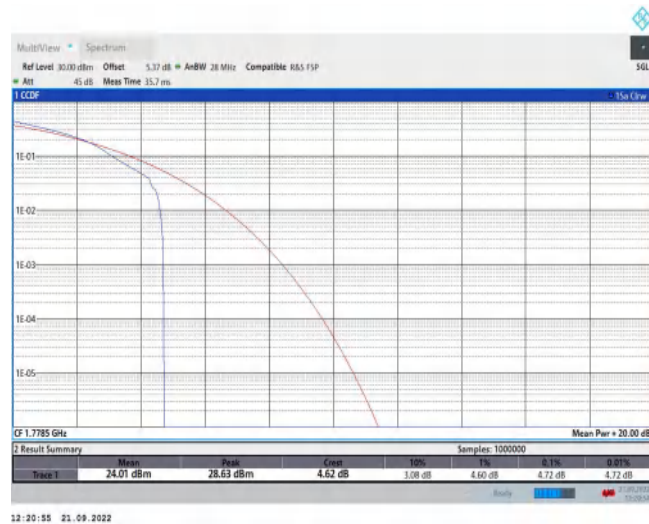


Band66-3MHz-16QAM-132657-15RB#0

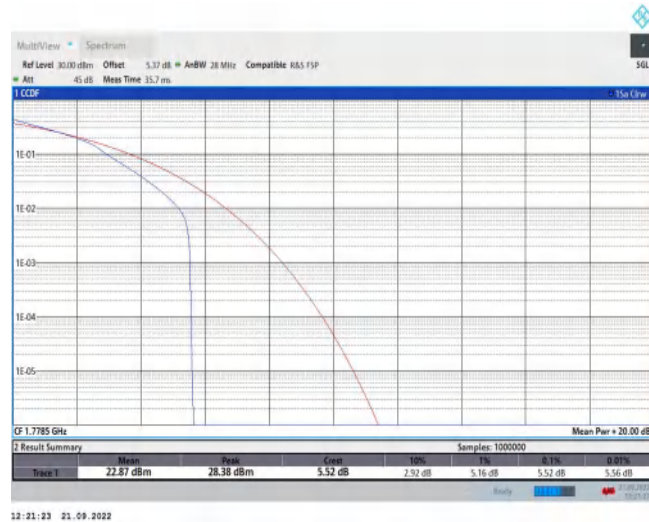





Band66-3MHz-64QAM-131987-1RB#0

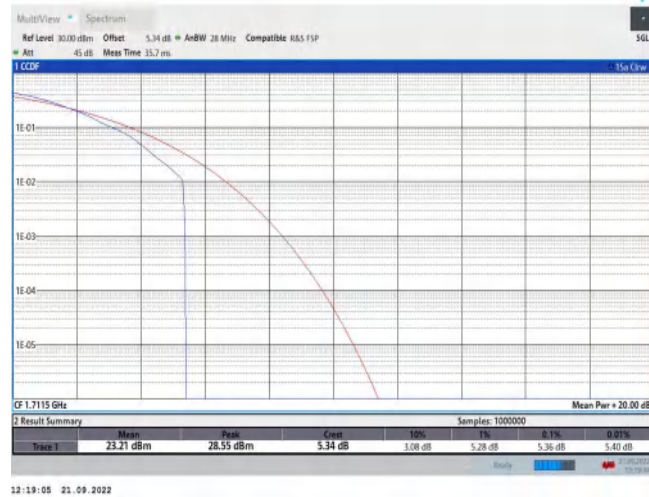


Band66-3MHz-64QAM-131987-15RB#0

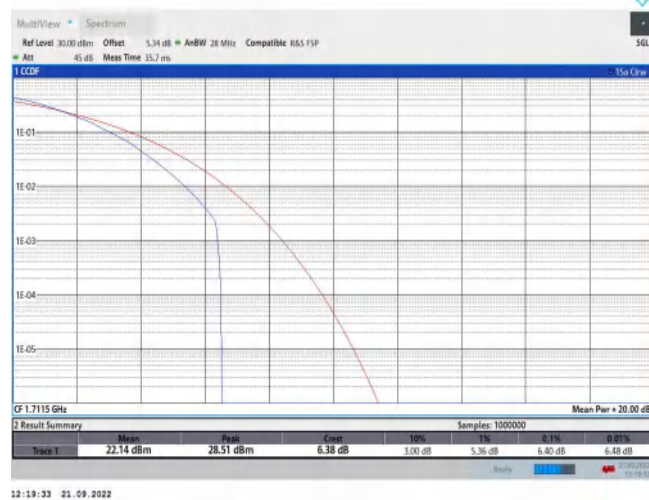


Band66-3MHz-64QAM-132322-1RB#0


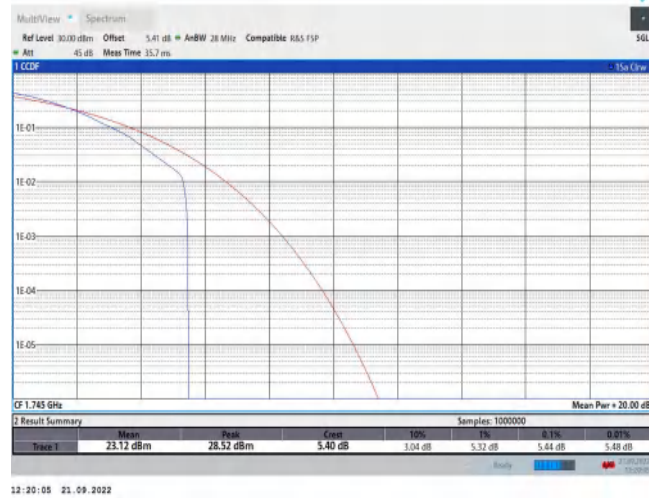


Band66-3MHz-64QAM-132322-15RB#0

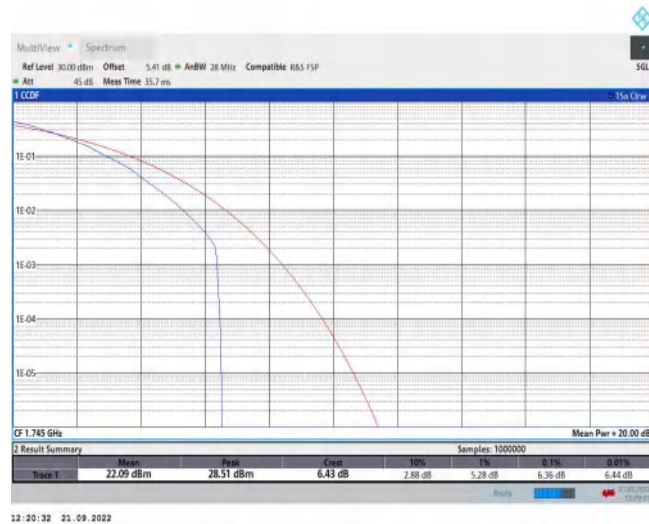


Band66-3MHz-64QAM-132657-1RB#0

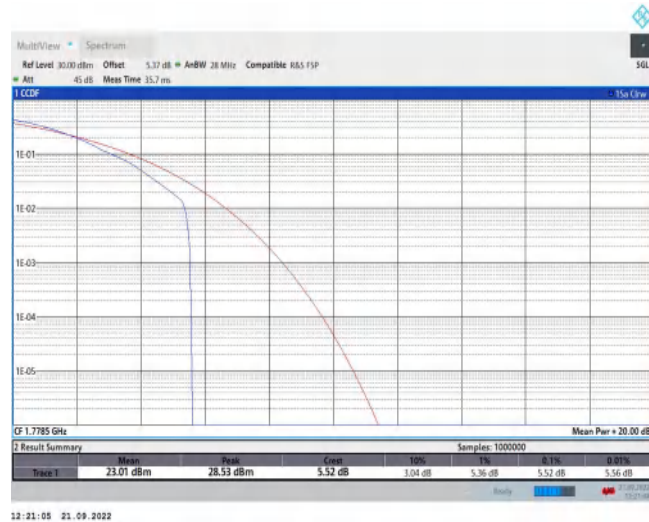


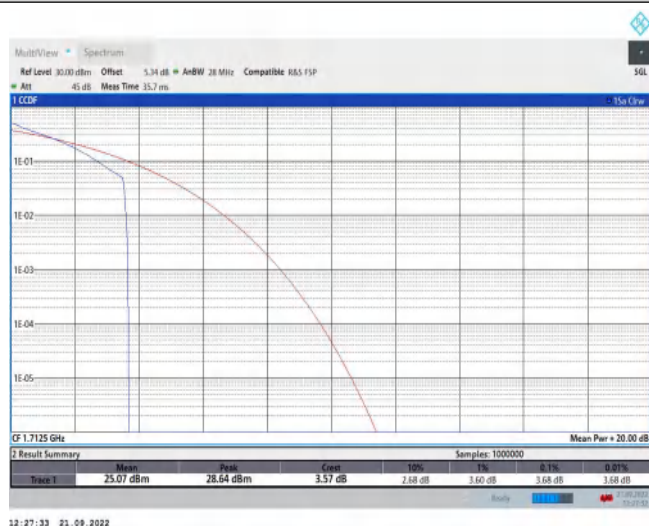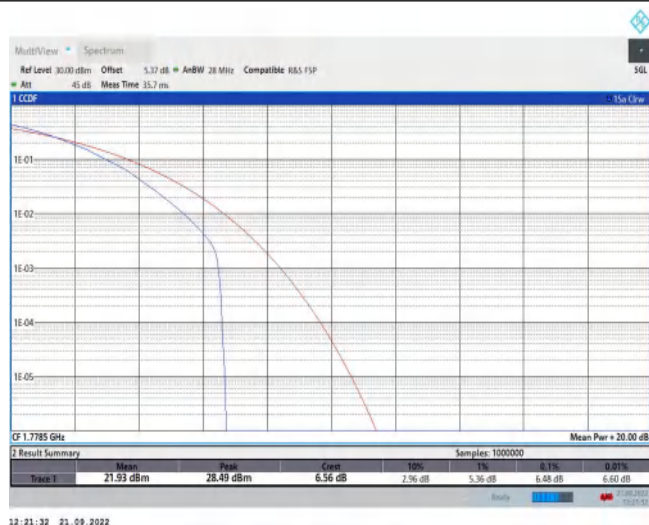


Band66-5MHz-QPSK-131997-25RB#0

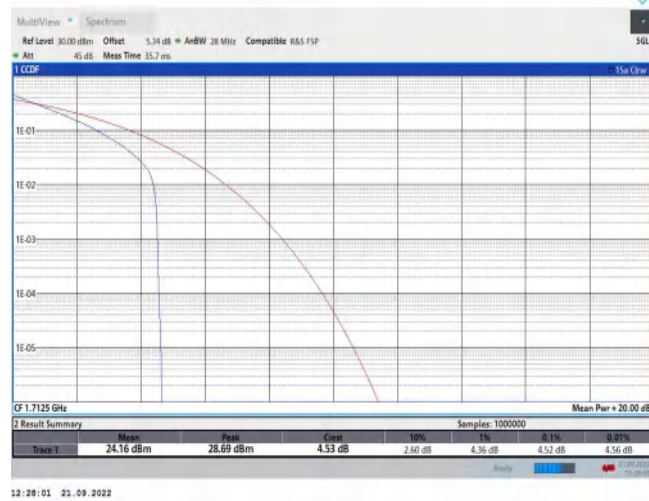

Band66-5MHz-QPSK-132322-1RB#0

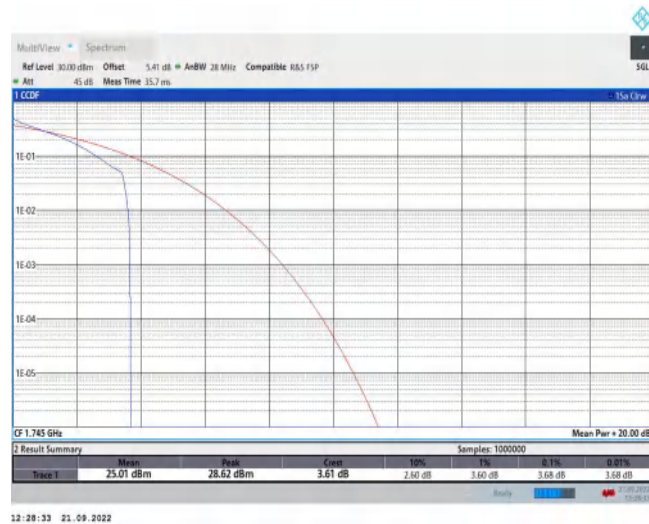


Band66-5MHz-QPSK-132322-25RB#0

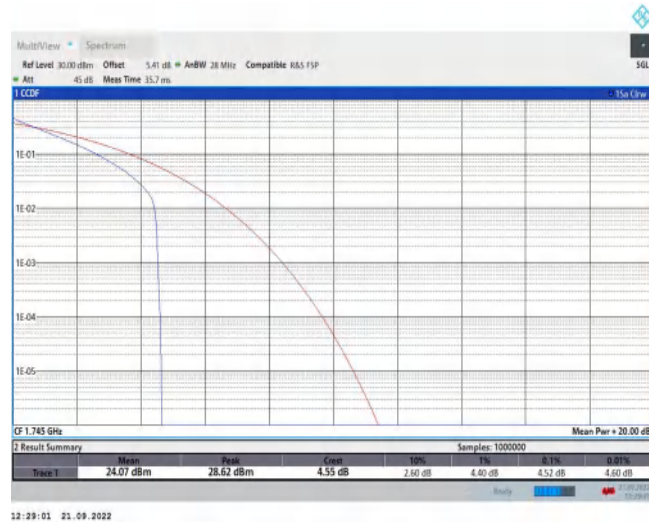





Band66-5MHz-QPSK-132647-1RB#0

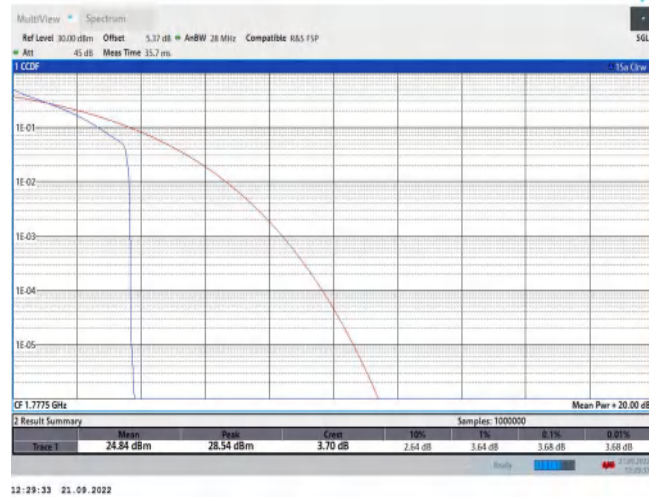


Band66-5MHz-QPSK-132647-25RB#0

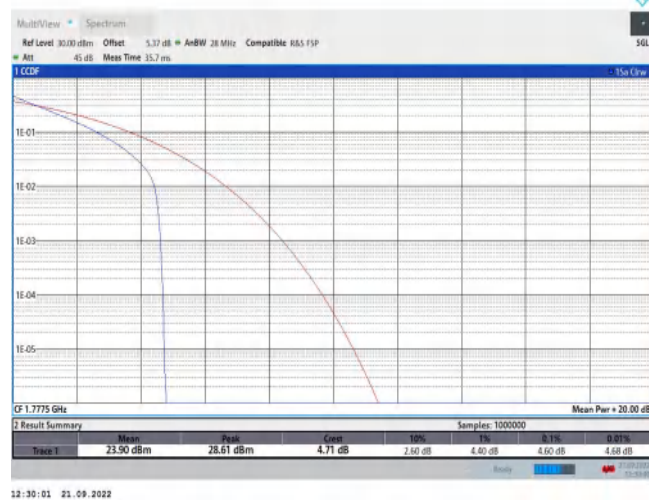


Band66-5MHz-16QAM-131997-1RB#0

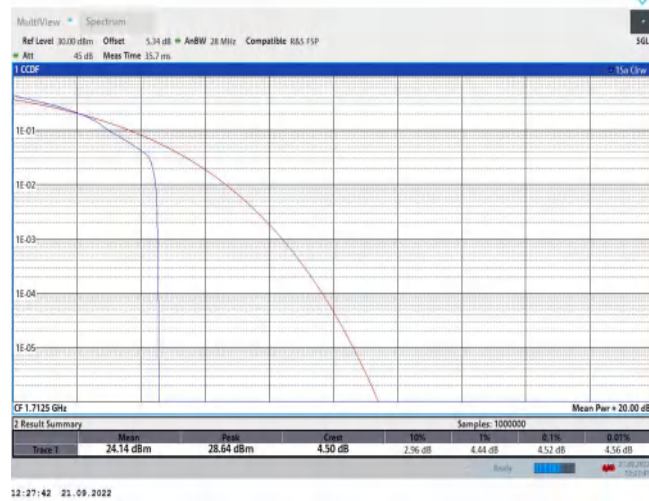

Band66-5MHz-16QAM-131997-25RB#0

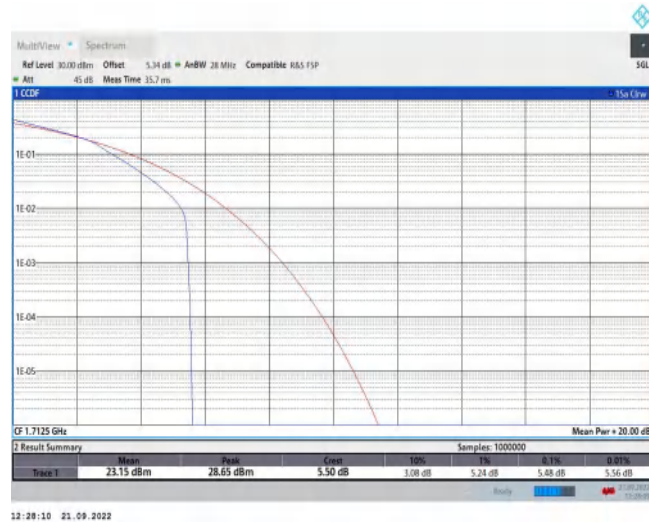


Band66-5MHz-16QAM-132322-1RB#0

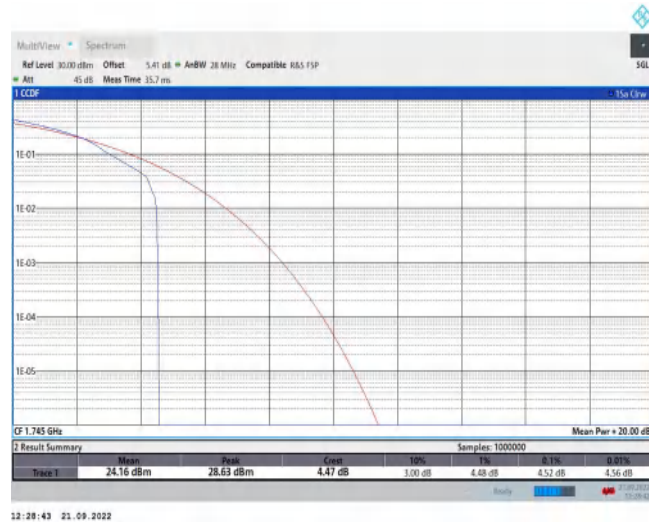





Band66-5MHz-16QAM-132322-25RB#0

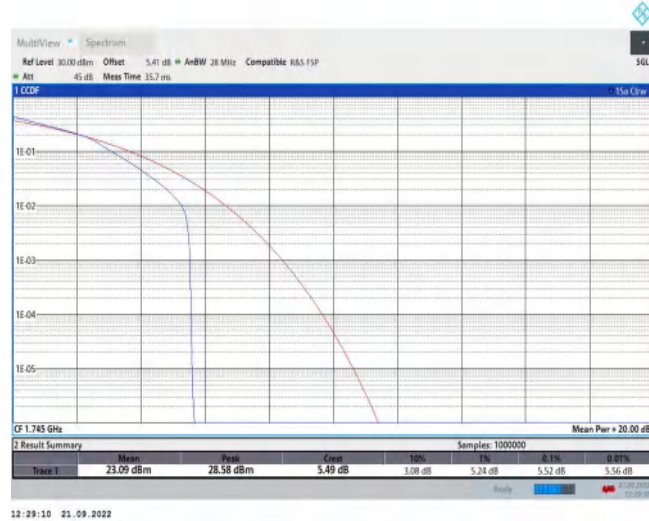


Band66-5MHz-16QAM-132647-1RB#0

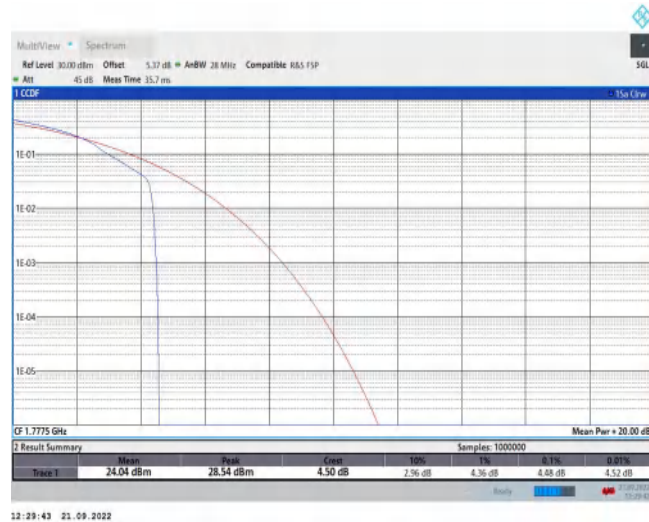


Band66-5MHz-16QAM-132647-25RB#0

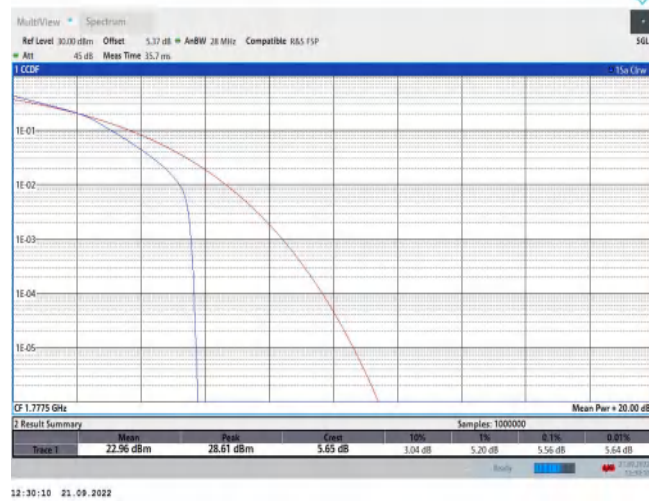

Band66-5MHz-64QAM-131997-1RB#0

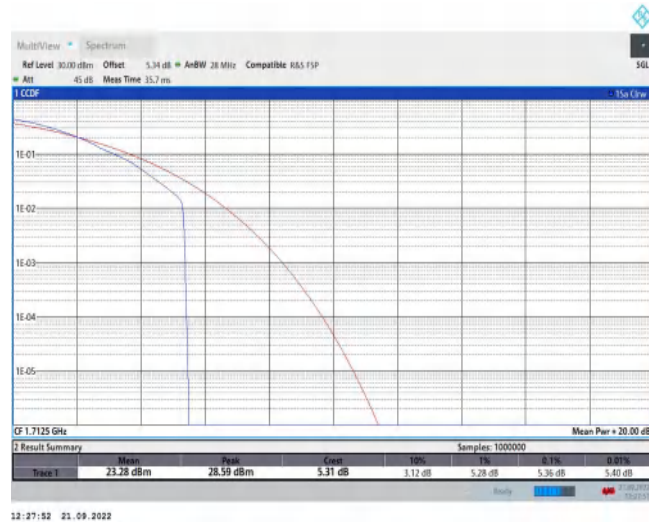


Band66-5MHz-64QAM-131997-25RB#0

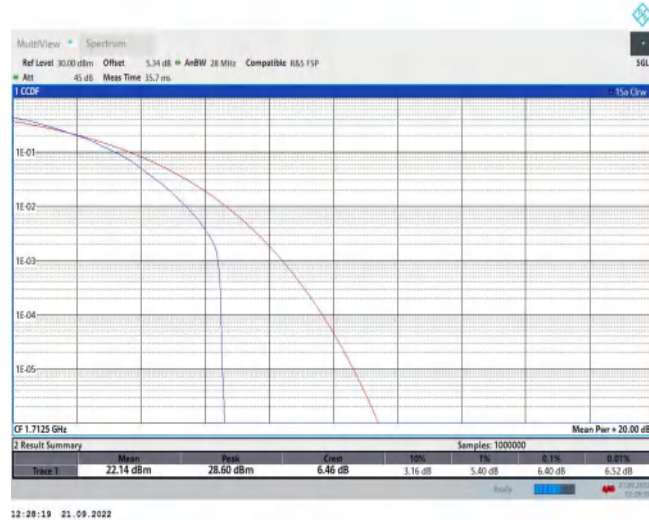





Band66-5MHz-64QAM-132322-1RB#0

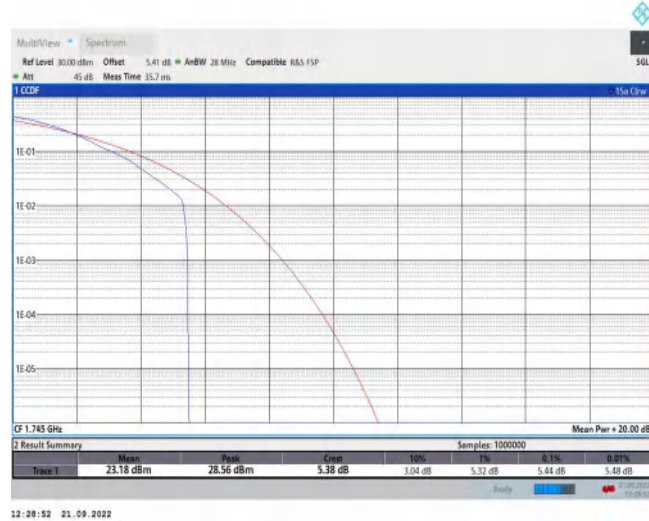


Band66-5MHz-64QAM-132322-25RB#0

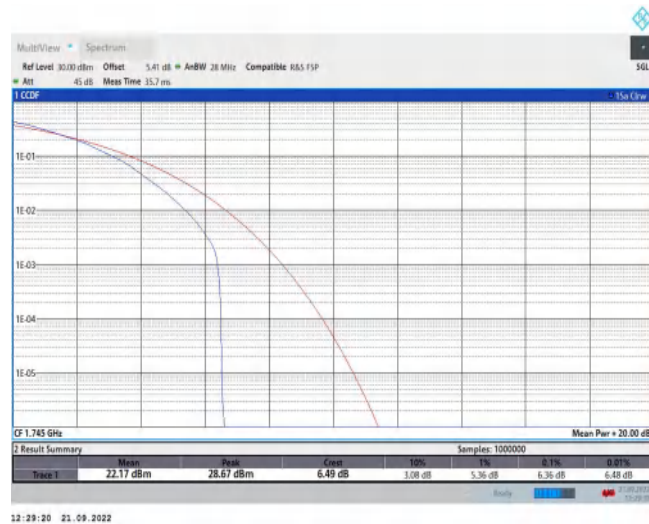


Band66-5MHz-64QAM-132647-1RB#0

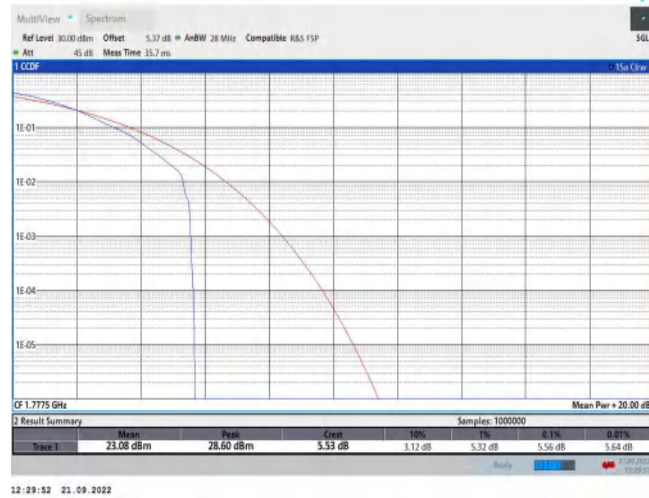

Band66-5MHz-64QAM-132647-25RB#0

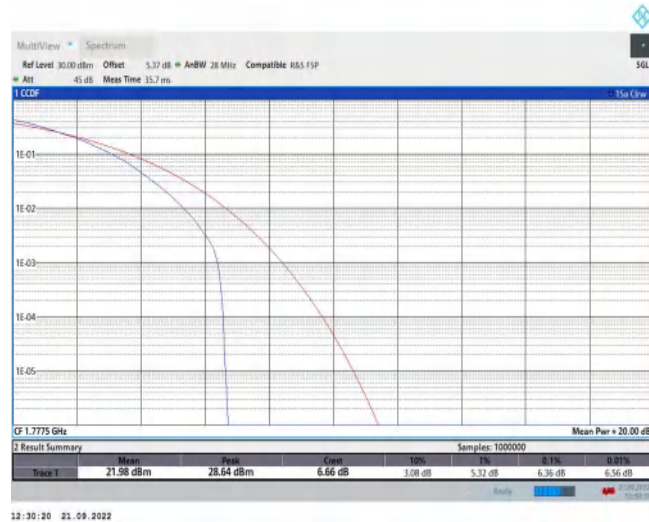


Band66-10MHz-QPSK-132022-1RB#0

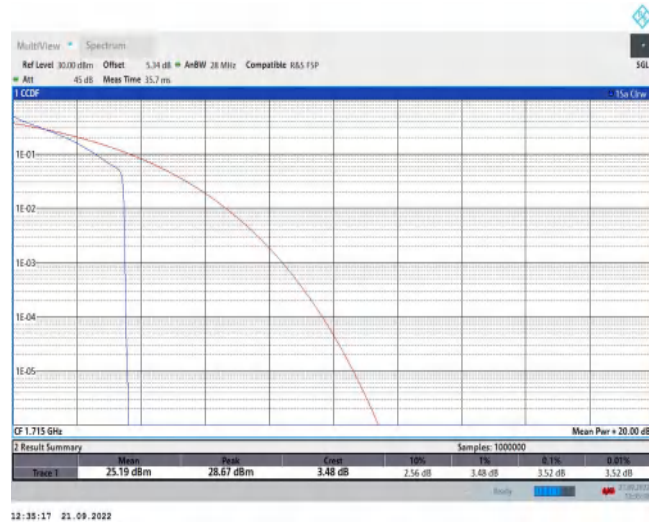





Band66-10MHz-QPSK-132022-50RB#0

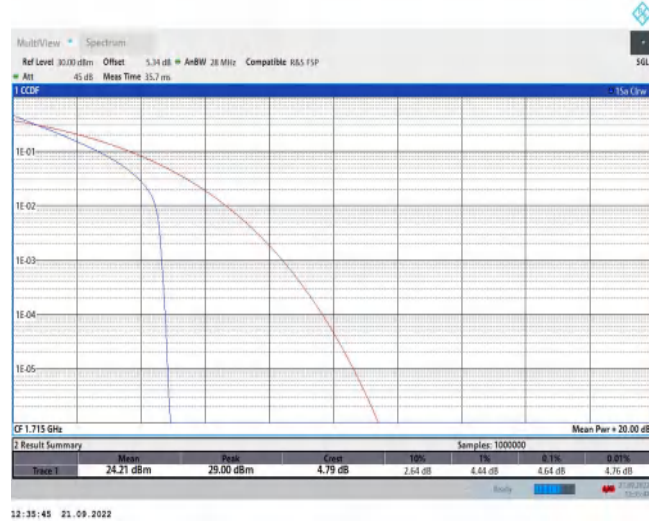


Band66-10MHz-QPSK-132322-1RB#0

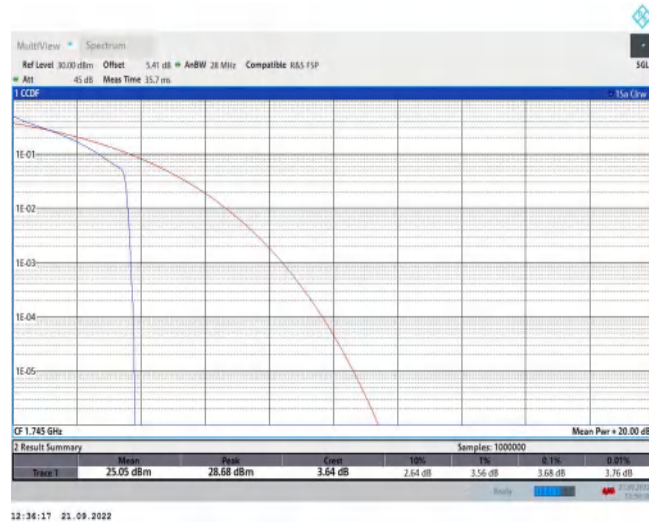


Band66-10MHz-QPSK-132322-50RB#0

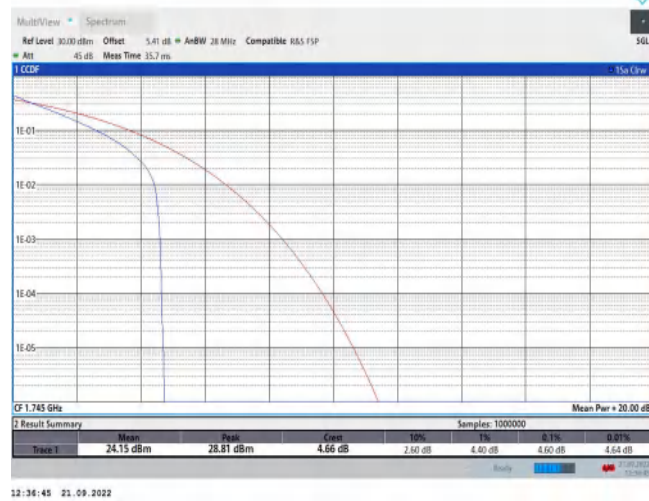

Band66-10MHz-QPSK-132622-1RB#0

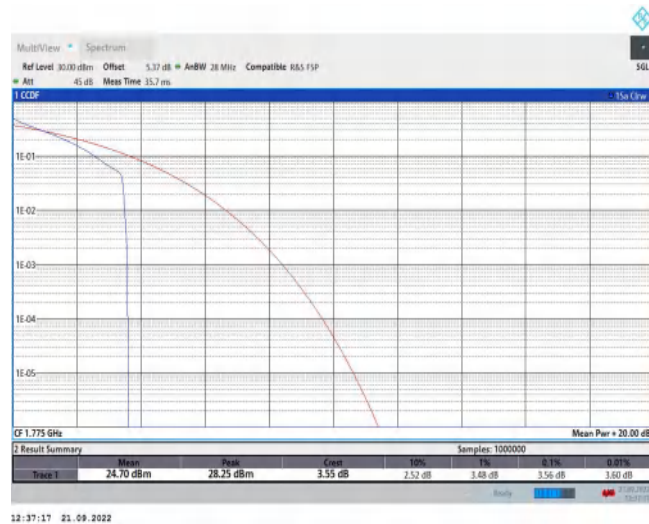


Band66-10MHz-QPSK-132622-50RB#0

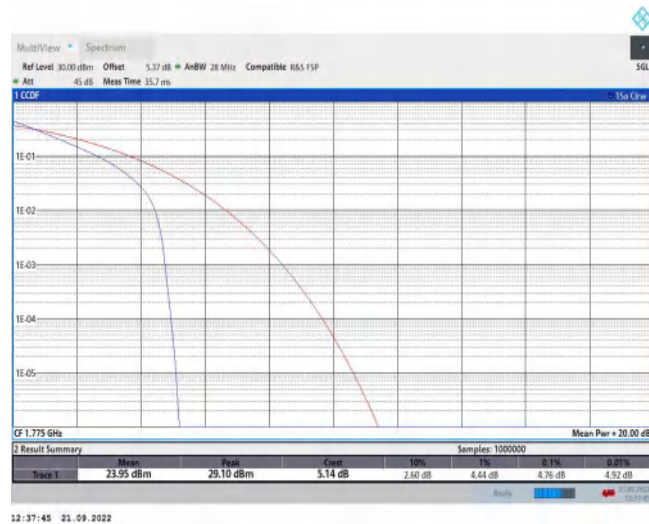





Band66-10MHz-16QAM-132022-1RB#0

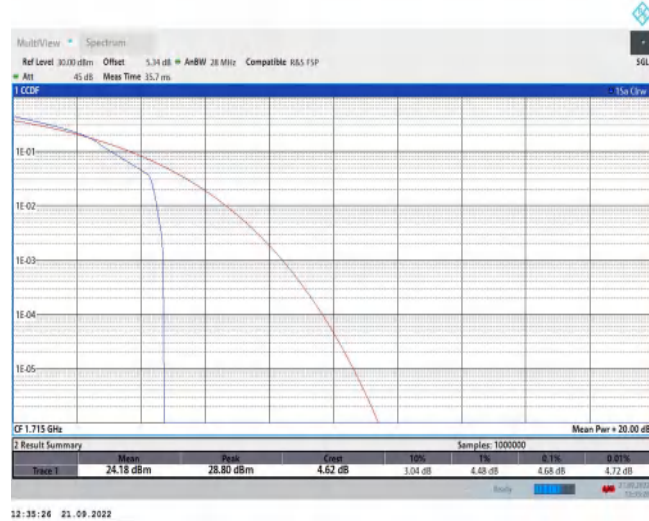


Band66-10MHz-16QAM-132022-50RB#0

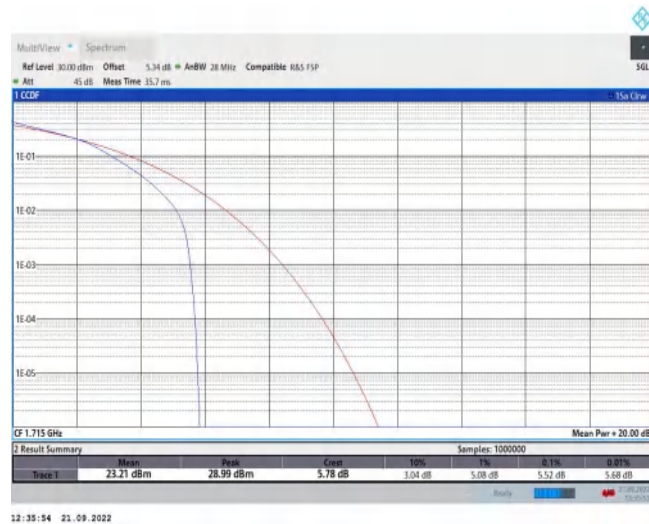


Band66-10MHz-16QAM-132322-1RB#0

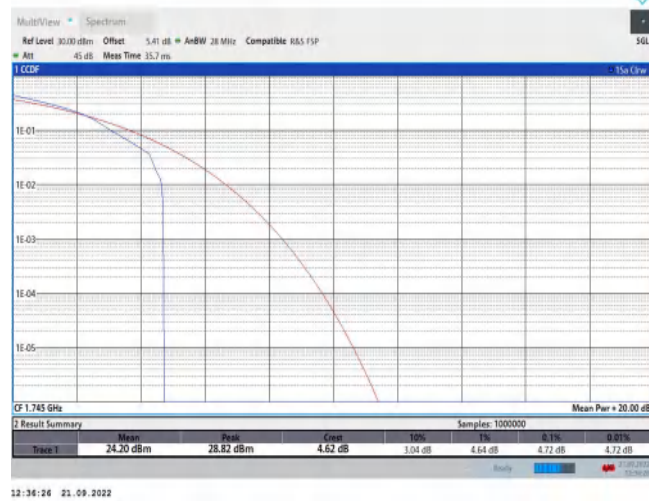

Band66-10MHz-16QAM-132322-50RB#0

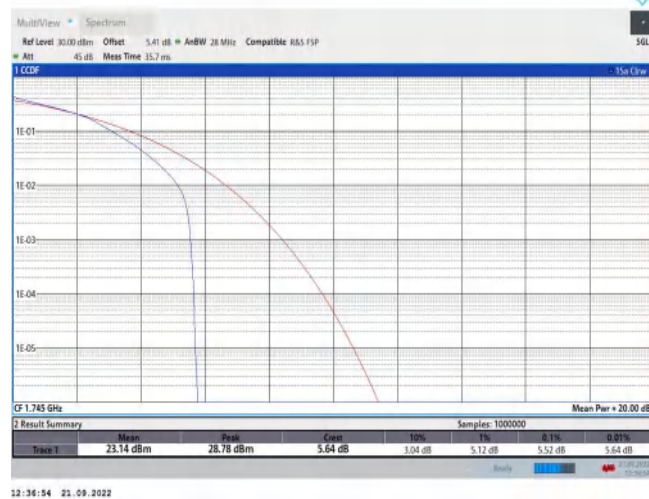


Band66-10MHz-16QAM-132622-1RB#0

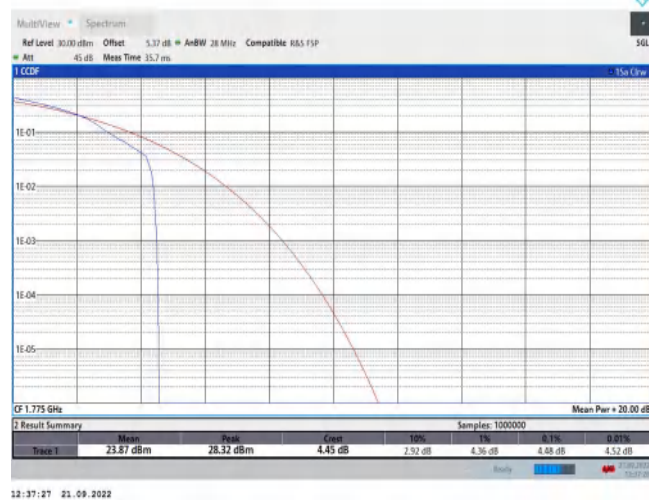





Band66-10MHz-16QAM-132622-50RB#0

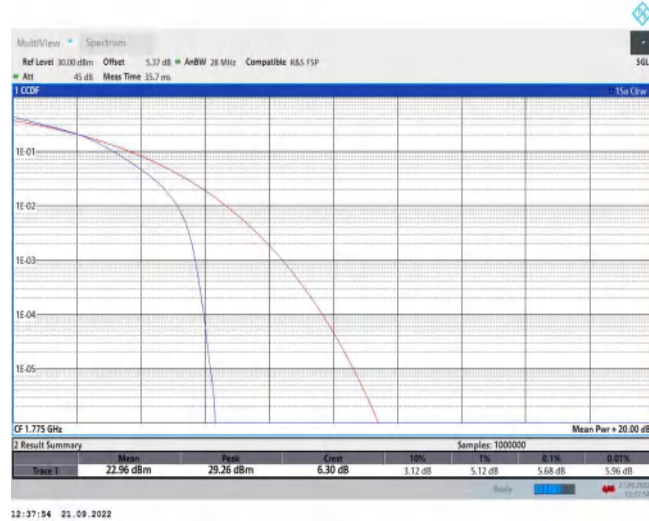


Band66-10MHz-64QAM-132022-1RB#0

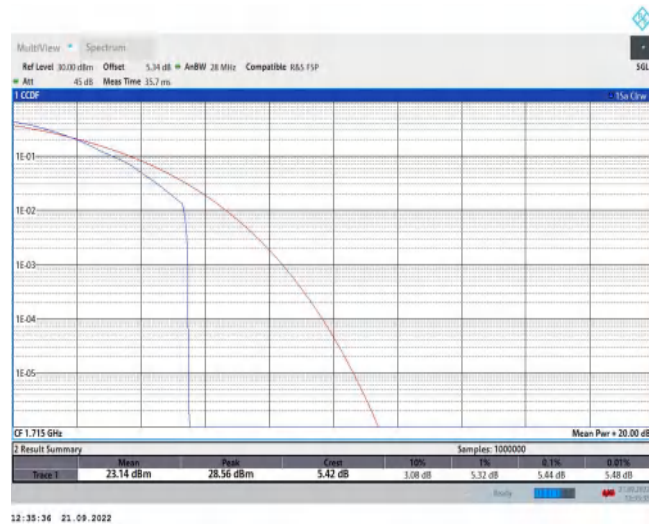


Band66-10MHz-64QAM-132022-50RB#0

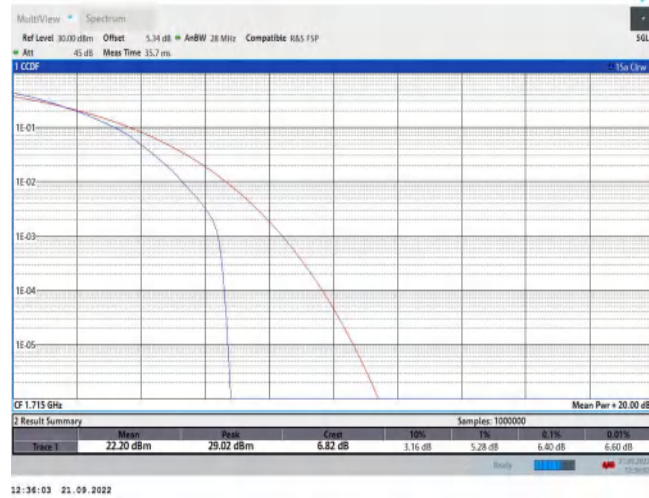

Band66-10MHz-64QAM-132322-1RB#0

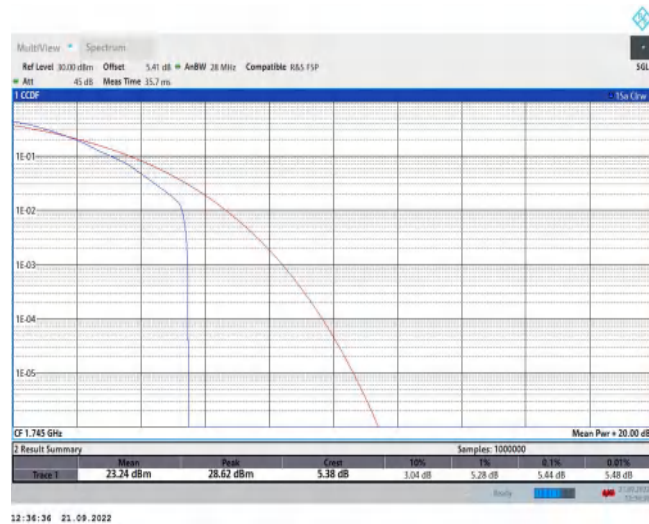


Band66-10MHz-64QAM-132322-50RB#0

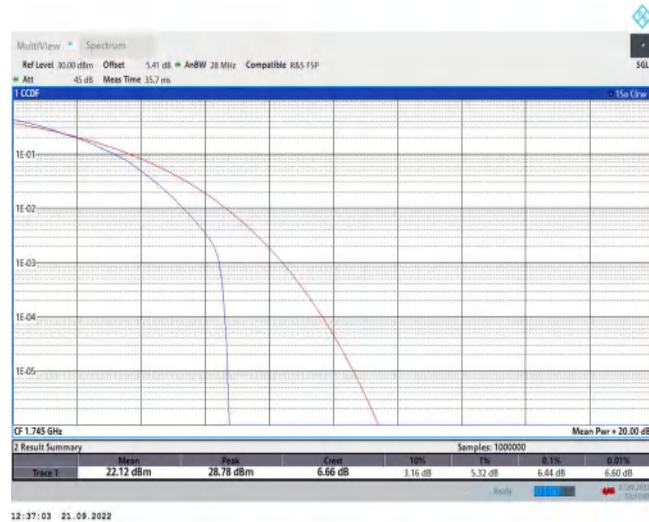





Band66-10MHz-64QAM-132622-1RB#0

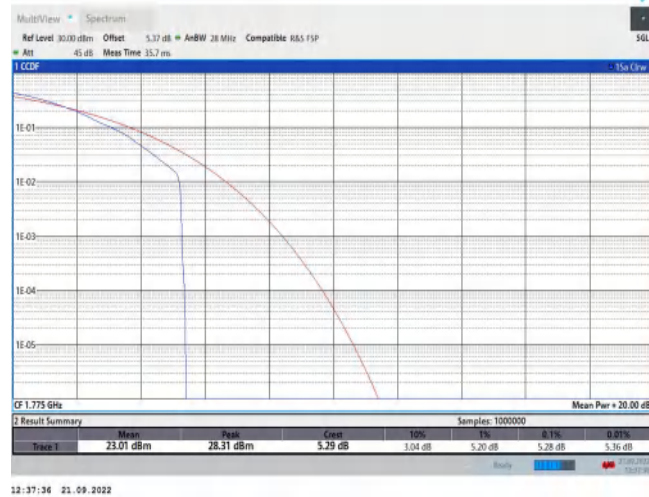


Band66-10MHz-64QAM-132622-50RB#0

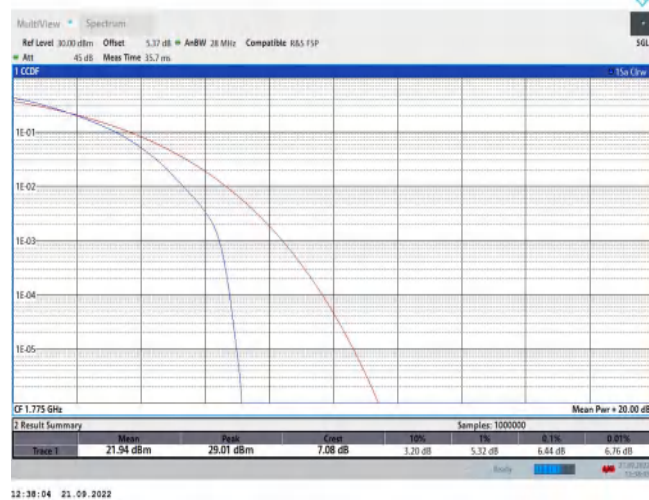


Band66-15MHz-QPSK-132047-1RB#0

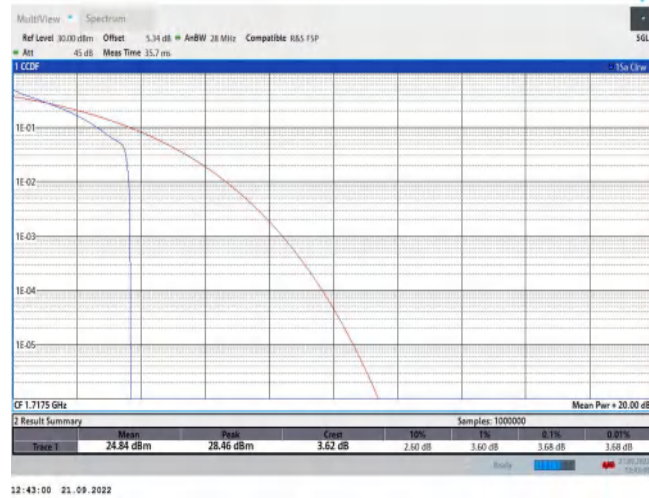

Band66-15MHz-QPSK-132047-75RB#0

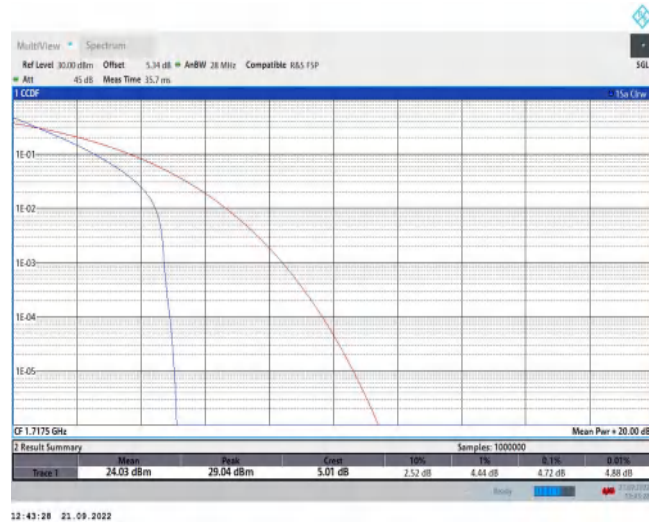


Band66-15MHz-QPSK-132322-1RB#0

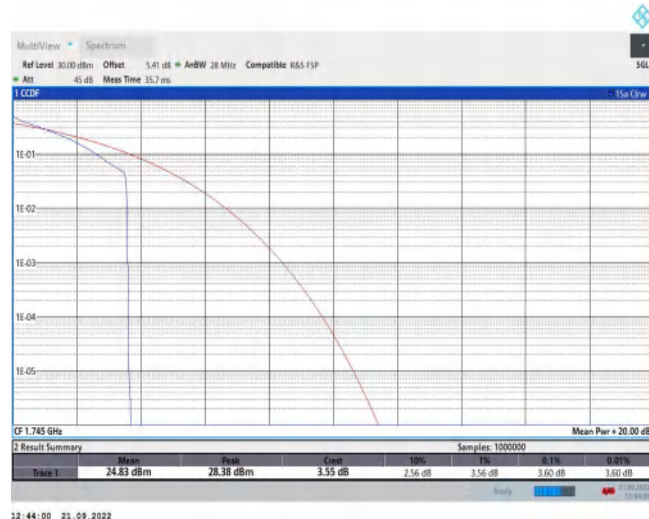





Band66-15MHz-QPSK-132322-75RB#0

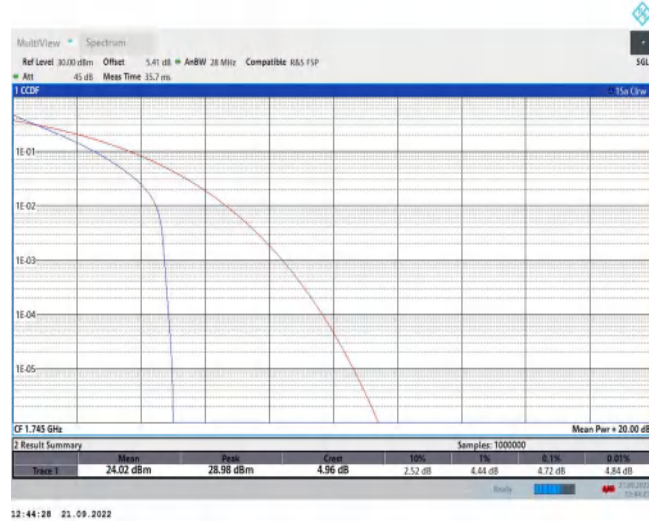


Band66-15MHz-QPSK-132597-1RB#0

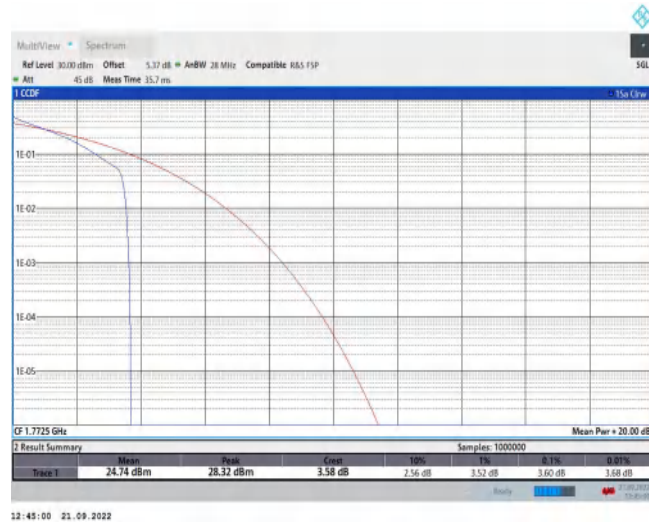


Band66-15MHz-QPSK-132597-75RB#0

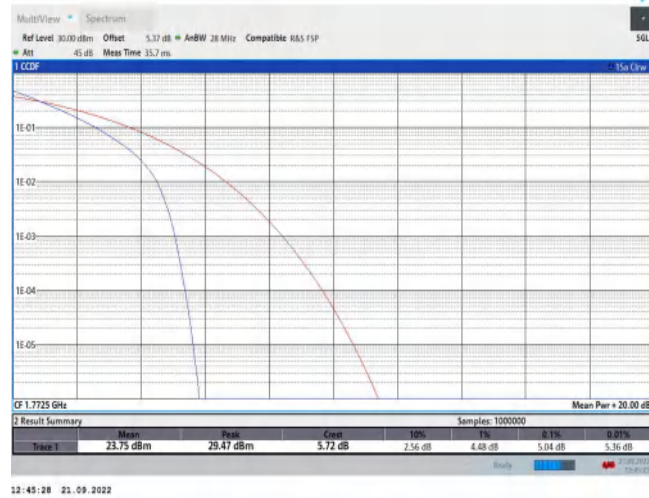

Band66-15MHz-16QAM-132047-1RB#0

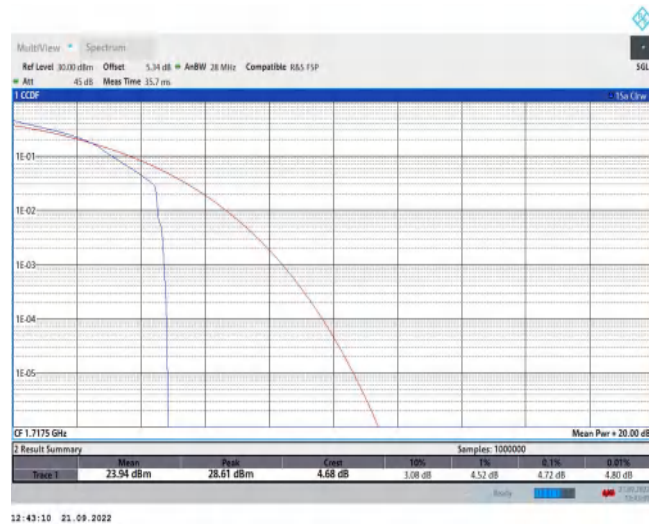


Band66-15MHz-16QAM-132047-75RB#0

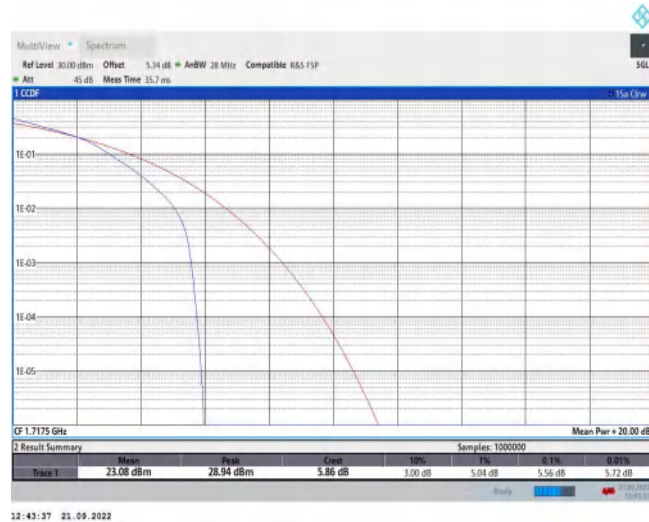





Band66-15MHz-16QAM-132322-1RB#0

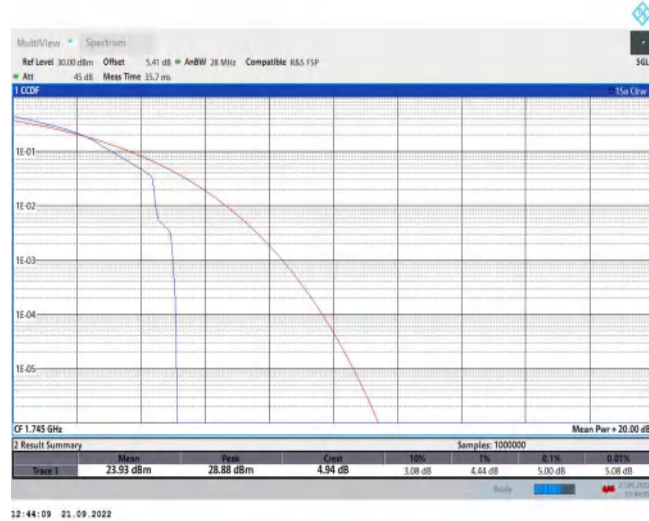


Band66-15MHz-16QAM-132322-75RB#0

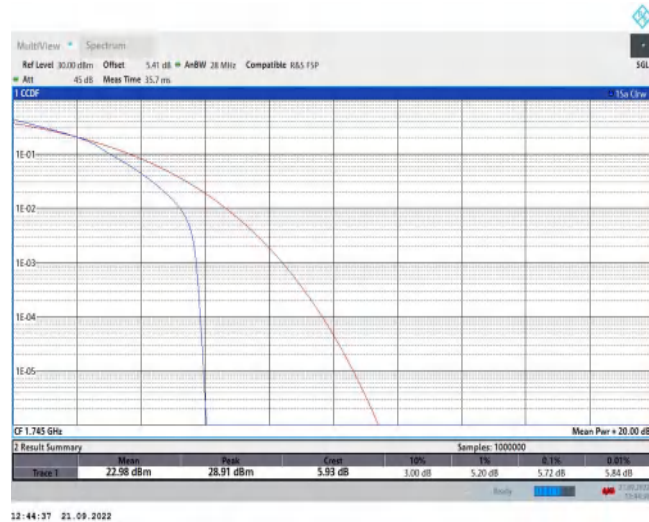


Band66-15MHz-16QAM-132597-1RB#0

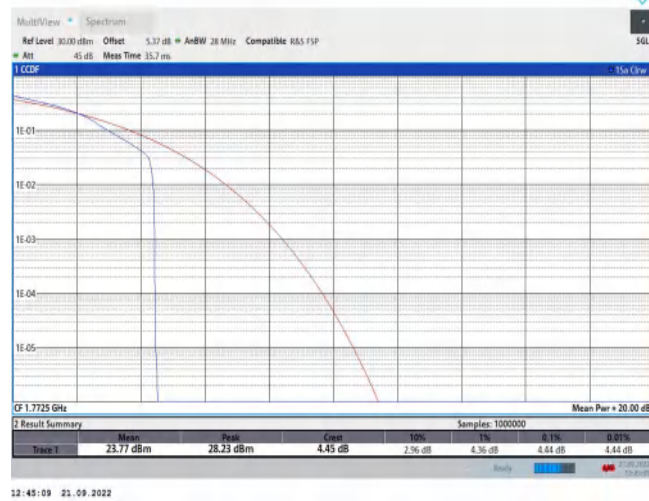

Band66-15MHz-16QAM-132597-75RB#0

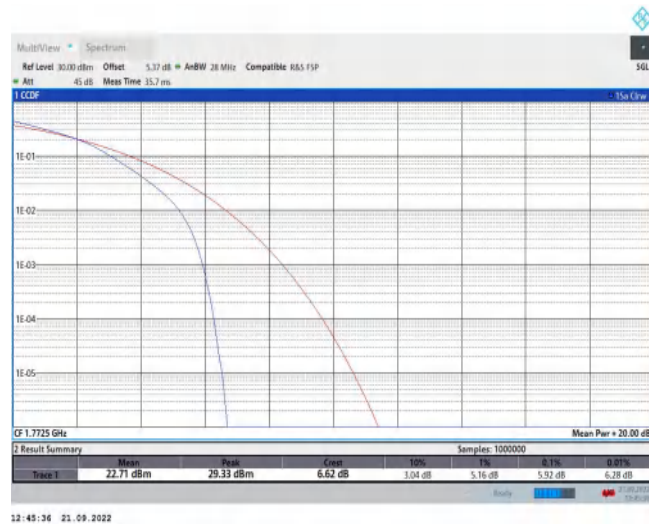


Band66-15MHz-64QAM-132047-1RB#0

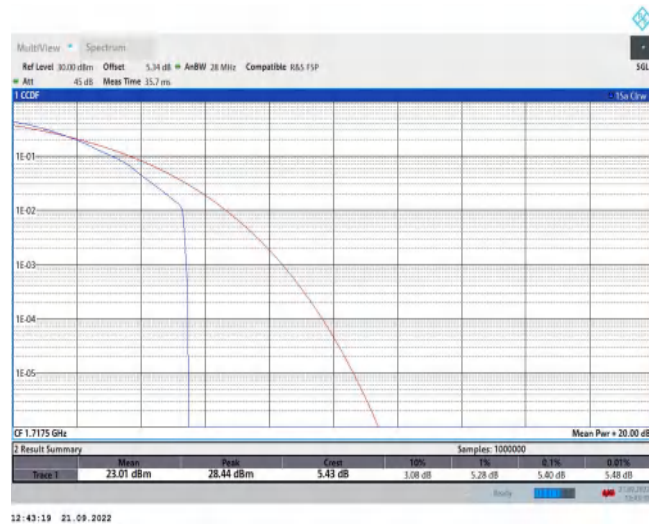





Band66-15MHz-64QAM-132047-75RB#0

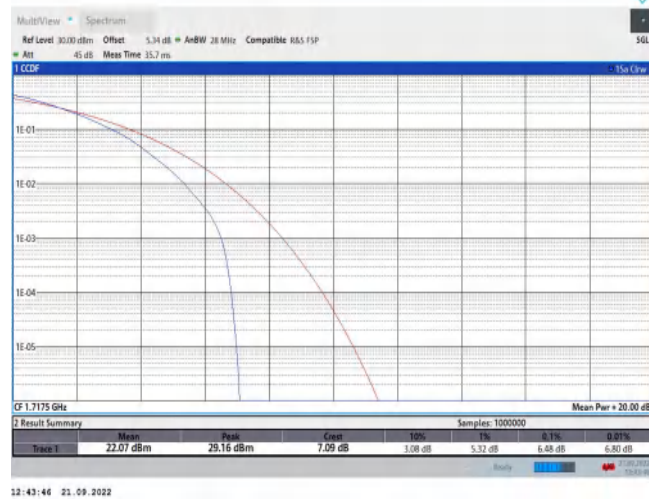


Band66-15MHz-64QAM-132322-1RB#0

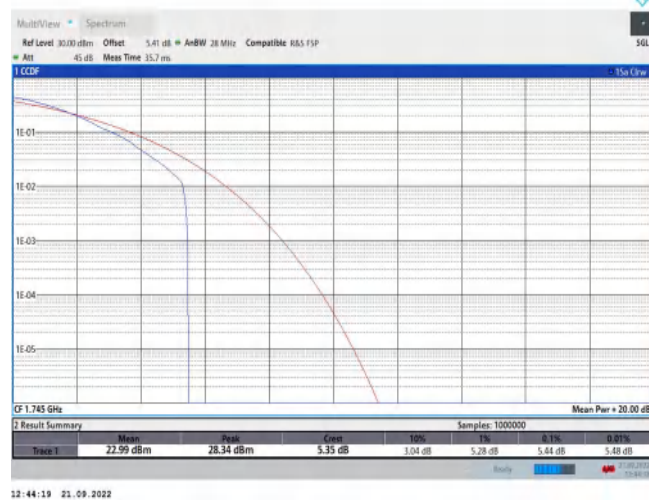


Band66-15MHz-64QAM-132322-75RB#0

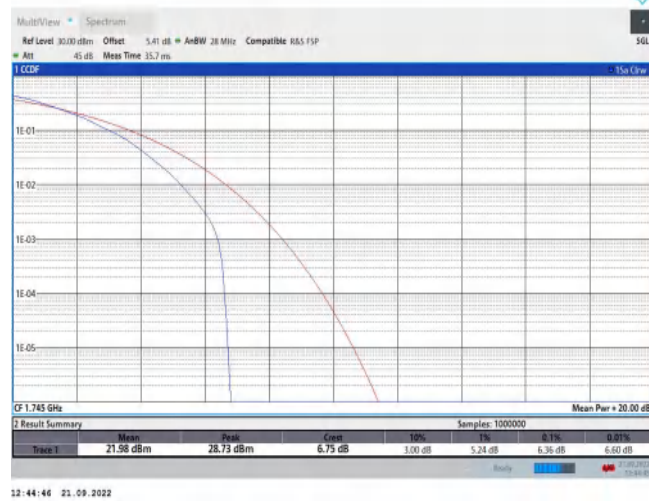

Band66-15MHz-64QAM-132597-1RB#0

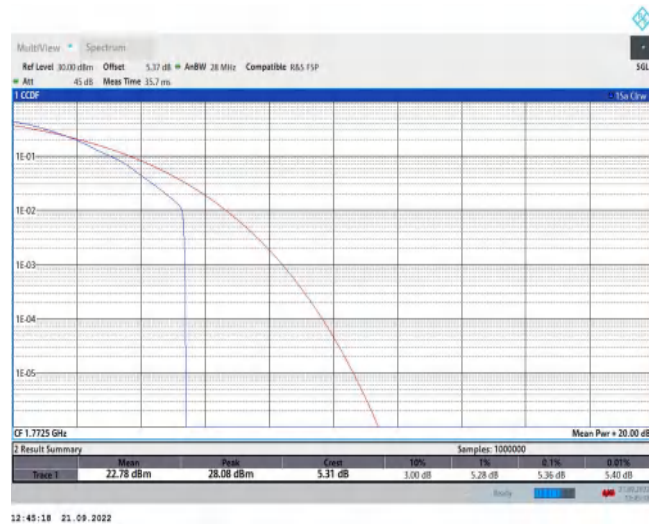


Band66-15MHz-64QAM-132597-75RB#0

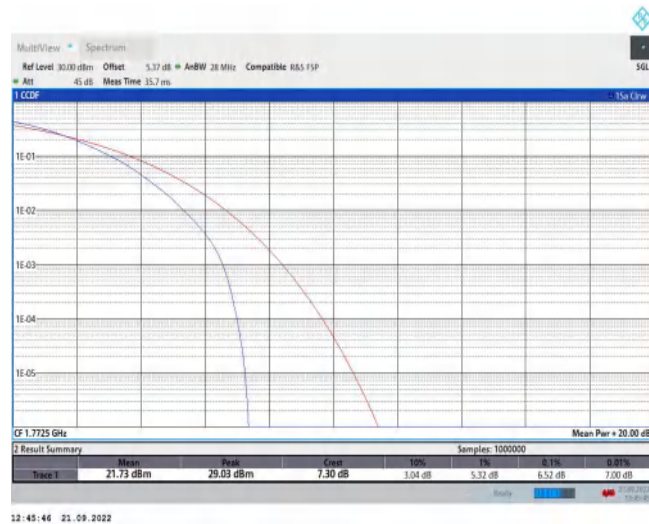





Band66-20MHz-QPSK-132072-1RB#0

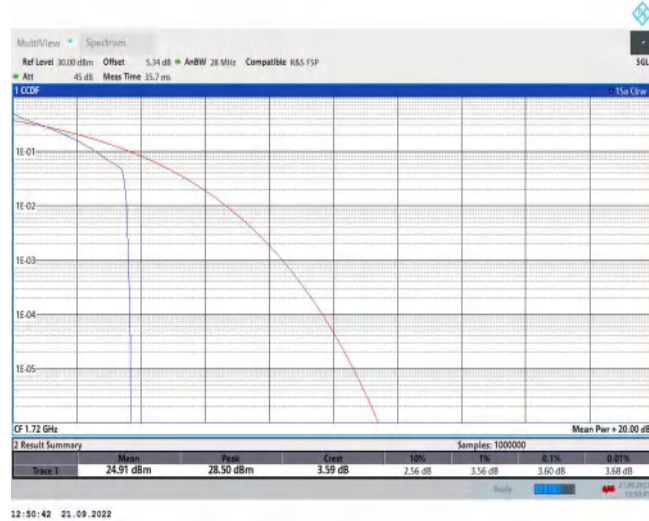


Band66-20MHz-QPSK-132072-100RB#0

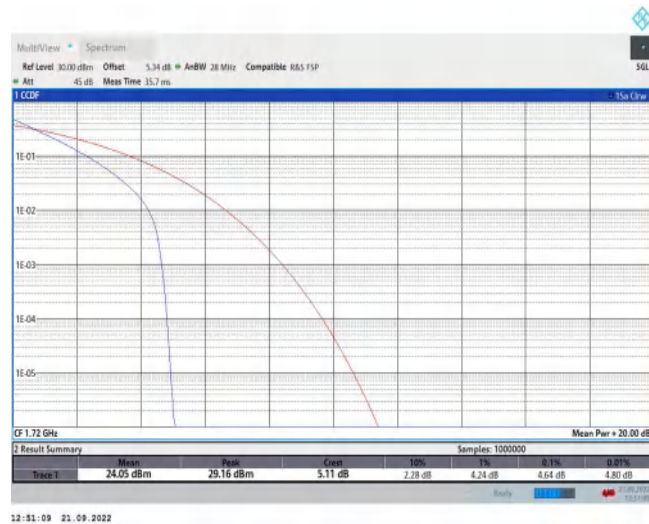


Band66-20MHz-QPSK-132322-1RB#0

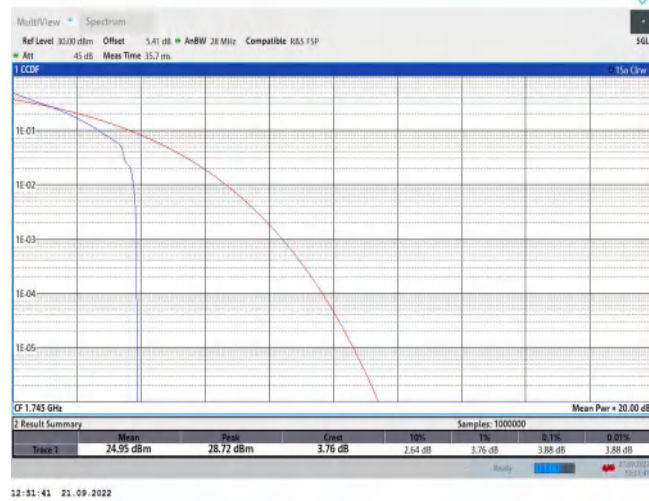

Band66-20MHz-QPSK-132322-100RB#0

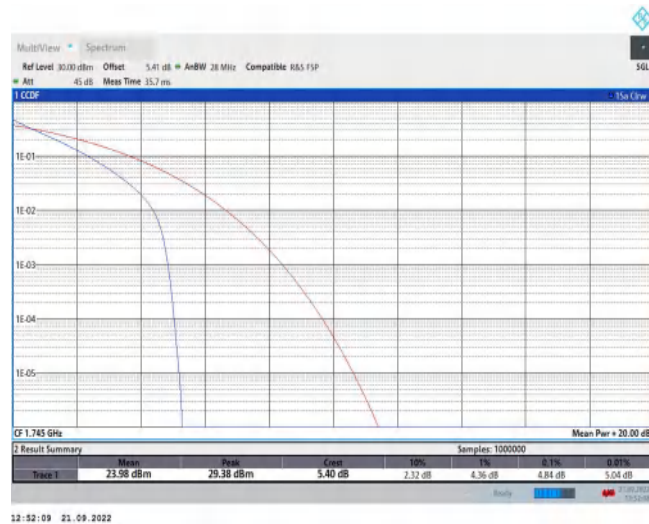


Band66-20MHz-QPSK-132572-1RB#0

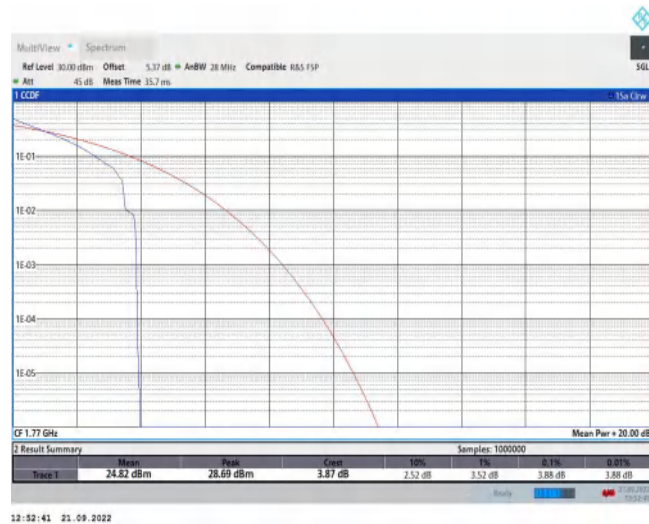





Band66-20MHz-QPSK-132572-100RB#0

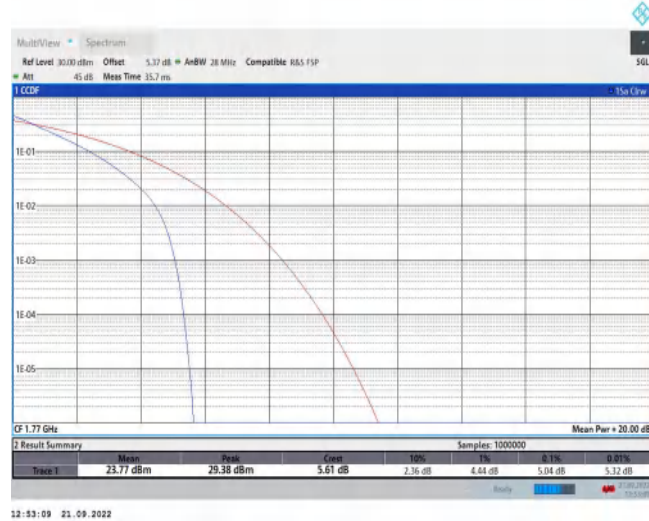


Band66-20MHz-16QAM-132072-1RB#0

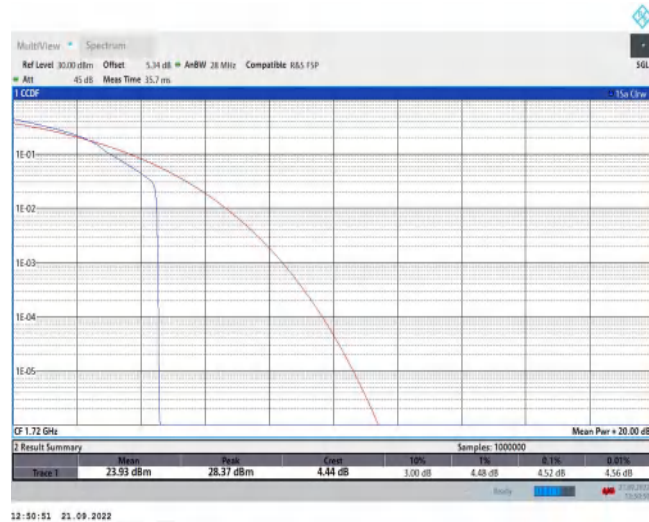


Band66-20MHz-16QAM-132072-100RB#0

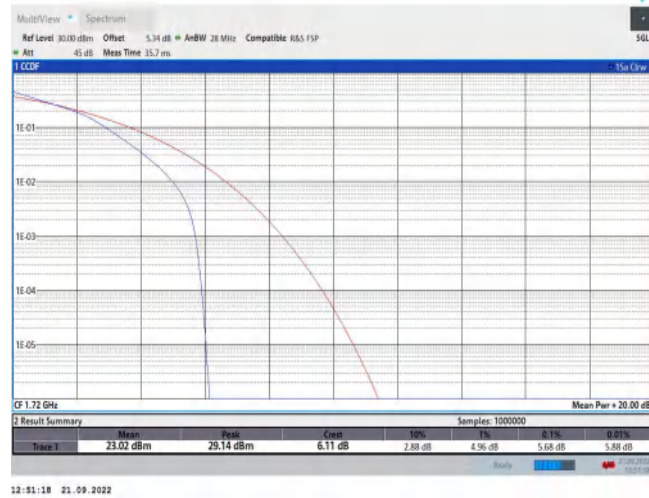

Band66-20MHz-16QAM-132322-1RB#0

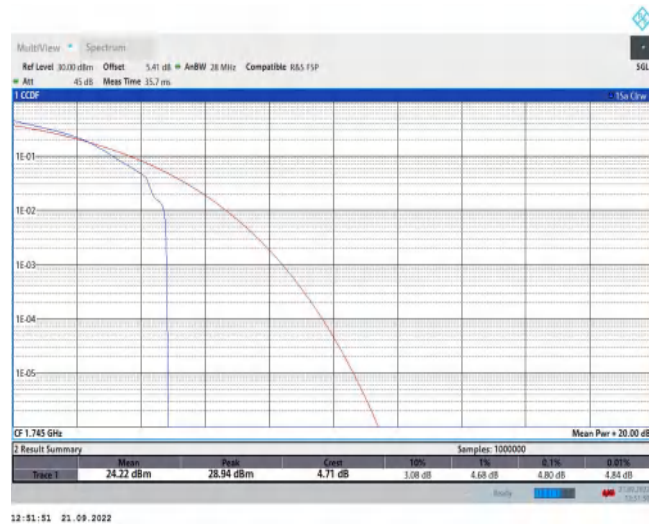


Band66-20MHz-16QAM-132322-100RB#0

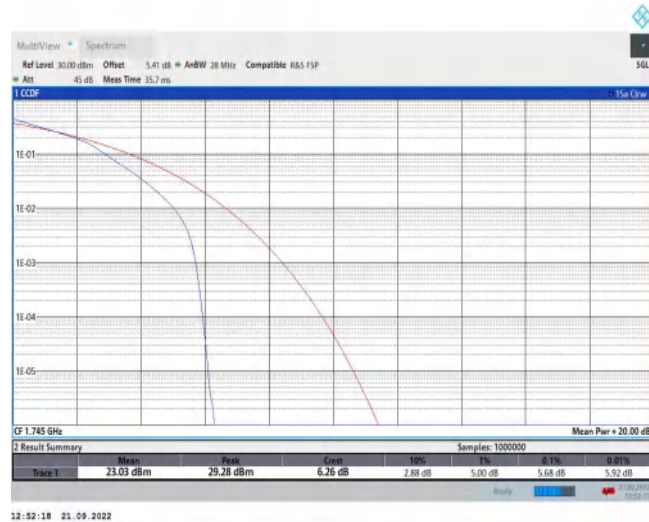





Band66-20MHz-16QAM-132572-1RB#0

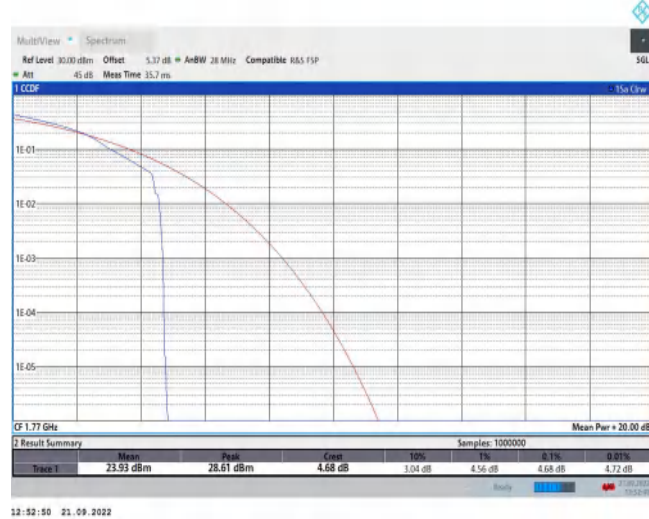


Band66-20MHz-16QAM-132572-100RB#0

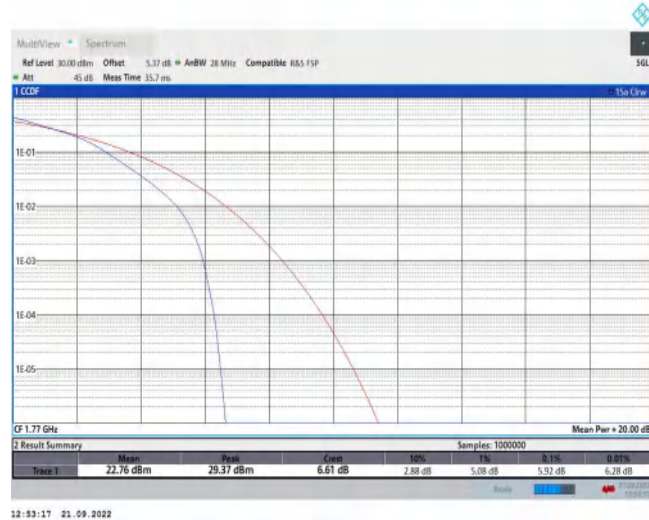


Band66-20MHz-64QAM-132072-1RB#0

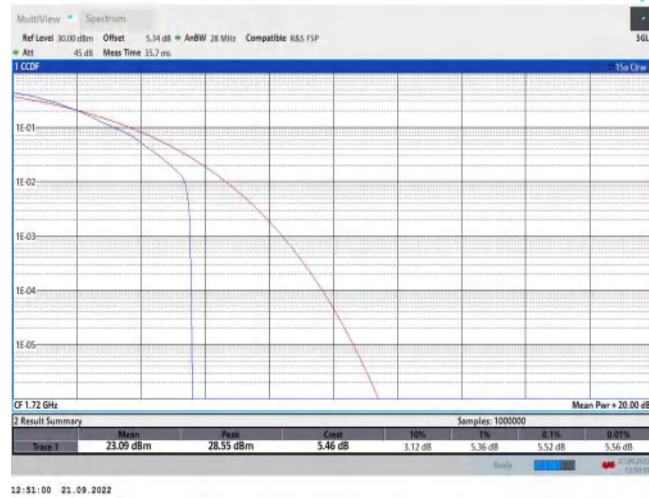

Band66-20MHz-64QAM-132072-100RB#0

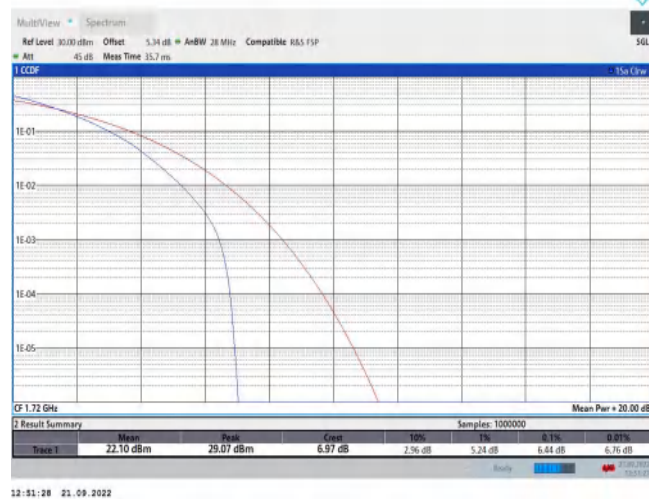


Band66-20MHz-64QAM-132322-1RB#0

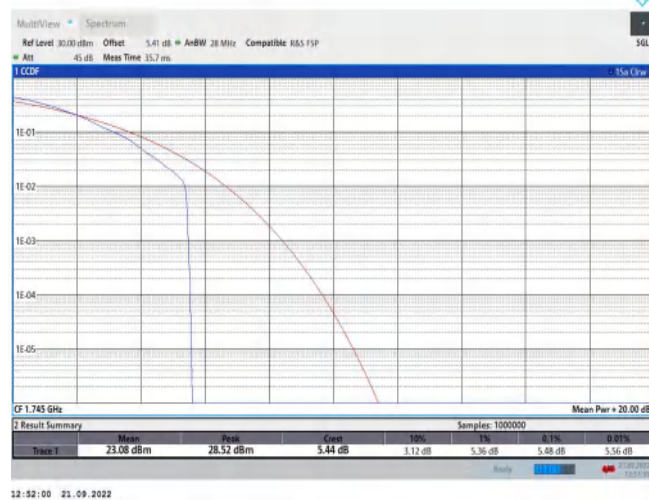





Band66-20MHz-64QAM-132322-100RB#0

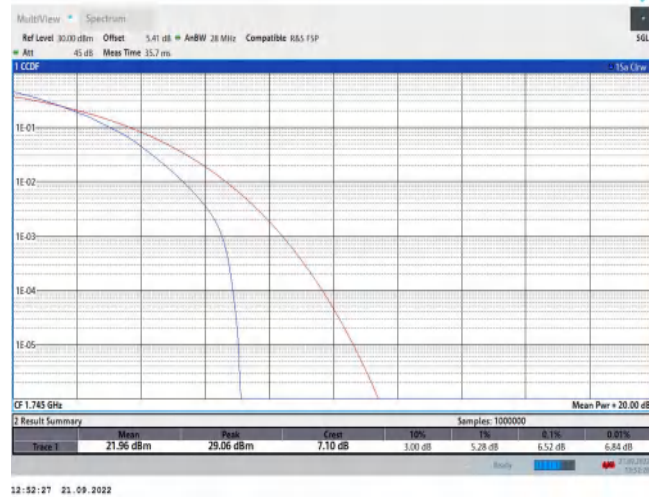

Band66-20MHz-64QAM-132572-1RB#0

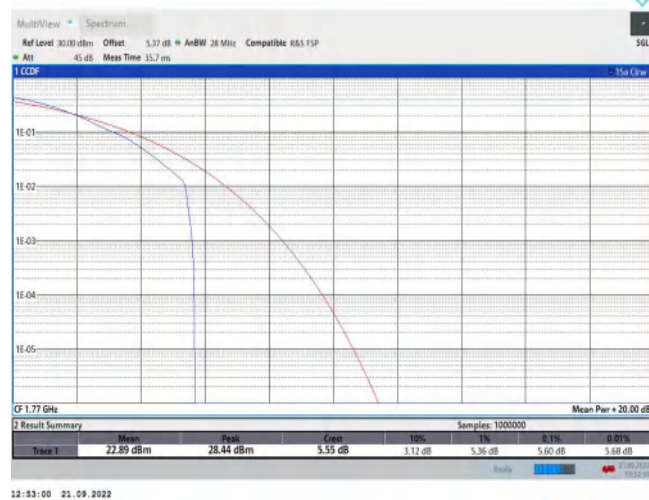

Band66-20MHz-64QAM-132572-100RB#0

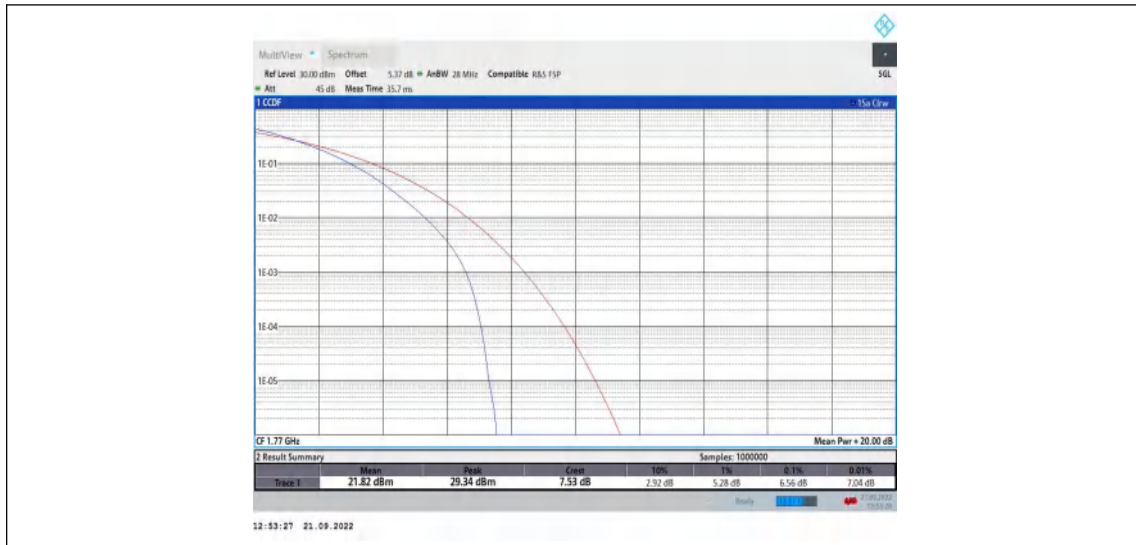



Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band66	1.4MHz	QPSK	131979	6RB#0	1.099	1.35	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	1.083	1.24	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	1.084	1.24	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	1.083	1.23	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	1.084	1.24	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	1.084	1.23	PASS
Band66	1.4MHz	64QAM	131979	6RB#0	1.084	1.24	PASS
Band66	1.4MHz	64QAM	132322	6RB#0	1.083	1.24	PASS
Band66	1.4MHz	64QAM	132665	6RB#0	1.084	1.24	PASS
Band66	3MHz	QPSK	131987	15RB#0	2.678	2.88	PASS
Band66	3MHz	QPSK	132322	15RB#0	2.679	2.88	PASS
Band66	3MHz	QPSK	132657	15RB#0	2.678	2.88	PASS
Band66	3MHz	16QAM	131987	15RB#0	2.679	2.88	PASS
Band66	3MHz	16QAM	132322	15RB#0	2.677	2.88	PASS
Band66	3MHz	16QAM	132657	15RB#0	2.678	2.88	PASS
Band66	3MHz	64QAM	131987	15RB#0	2.679	2.88	PASS
Band66	3MHz	64QAM	132322	15RB#0	2.679	2.87	PASS
Band66	3MHz	64QAM	132657	15RB#0	2.678	2.87	PASS
Band66	5MHz	QPSK	131997	25RB#0	4.507	4.78	PASS
Band66	5MHz	QPSK	132322	25RB#0	4.506	4.78	PASS
Band66	5MHz	QPSK	132647	25RB#0	4.503	4.80	PASS
Band66	5MHz	16QAM	131997	25RB#0	4.511	4.81	PASS
Band66	5MHz	16QAM	132322	25RB#0	4.508	4.80	PASS
Band66	5MHz	16QAM	132647	25RB#0	4.502	4.80	PASS
Band66	5MHz	64QAM	131997	25RB#0	4.504	4.78	PASS
Band66	5MHz	64QAM	132322	25RB#0	4.501	4.78	PASS
Band66	5MHz	64QAM	132647	25RB#0	4.502	4.78	PASS
Band66	10MHz	QPSK	132022	50RB#0	9.06	9.80	PASS
Band66	10MHz	QPSK	132322	50RB#0	9.046	9.80	PASS
Band66	10MHz	QPSK	132622	50RB#0	9.062	9.80	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 61 of 132

Band66	10MHz	16QAM	132022	50RB#0	9.059	9.80	PASS
Band66	10MHz	16QAM	132322	50RB#0	9.051	9.80	PASS
Band66	10MHz	16QAM	132622	50RB#0	9.072	9.80	PASS
Band66	10MHz	64QAM	132022	50RB#0	9.061	9.80	PASS
Band66	10MHz	64QAM	132322	50RB#0	9.058	9.80	PASS
Band66	10MHz	64QAM	132622	50RB#0	9.082	9.80	PASS
Band66	15MHz	QPSK	132047	75RB#0	13.494	14.30	PASS
Band66	15MHz	QPSK	132322	75RB#0	13.482	14.30	PASS
Band66	15MHz	QPSK	132597	75RB#0	13.504	14.35	PASS
Band66	15MHz	16QAM	132047	75RB#0	13.488	14.30	PASS
Band66	15MHz	16QAM	132322	75RB#0	13.474	14.30	PASS
Band66	15MHz	16QAM	132597	75RB#0	13.513	14.30	PASS
Band66	15MHz	64QAM	132047	75RB#0	13.478	14.30	PASS
Band66	15MHz	64QAM	132322	75RB#0	13.476	14.30	PASS
Band66	15MHz	64QAM	132597	75RB#0	13.516	14.30	PASS
Band66	20MHz	QPSK	132072	100RB#0	17.914	18.80	PASS
Band66	20MHz	QPSK	132322	100RB#0	17.9	18.87	PASS
Band66	20MHz	QPSK	132572	100RB#0	17.937	18.87	PASS
Band66	20MHz	16QAM	132072	100RB#0	17.909	18.87	PASS
Band66	20MHz	16QAM	132322	100RB#0	17.927	18.87	PASS
Band66	20MHz	16QAM	132572	100RB#0	17.942	18.93	PASS
Band66	20MHz	64QAM	132072	100RB#0	17.909	18.80	PASS
Band66	20MHz	64QAM	132322	100RB#0	17.901	18.80	PASS
Band66	20MHz	64QAM	132572	100RB#0	17.926	18.80	PASS




Test Graphs


Band66-1.4MHz-QPSK-131979-6RB#0




Band66-1.4MHz-QPSK-132322-6RB#0

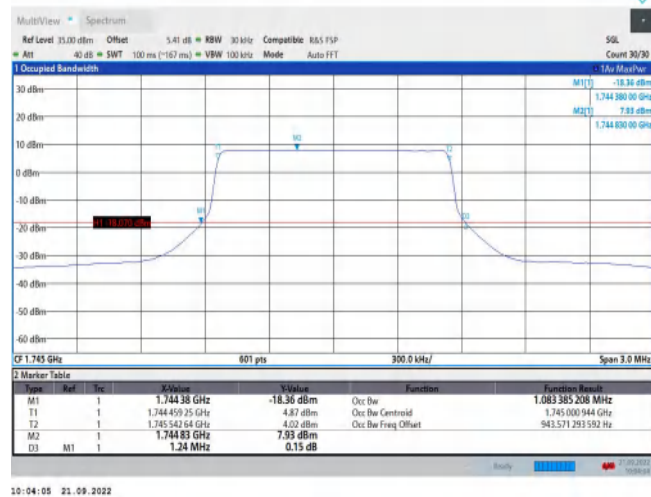


Band66-1.4MHz-QPSK-132665-6RB#0

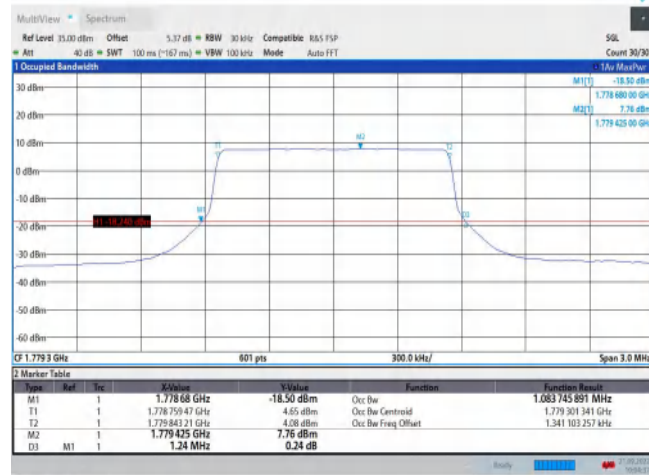

Band66-1.4MHz-16QAM-131979-6RB#0

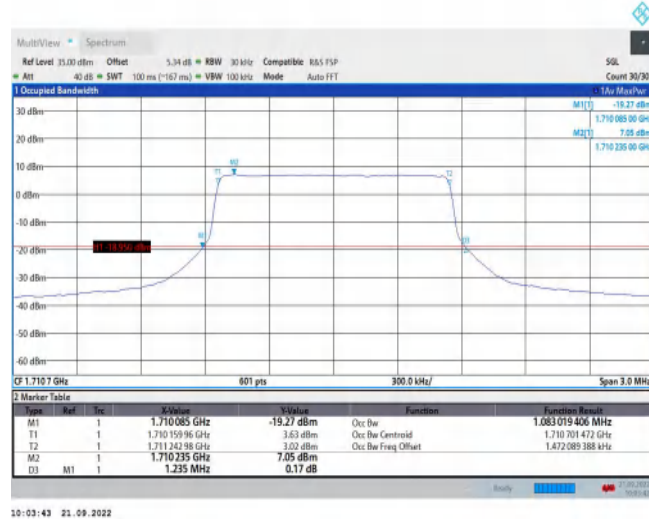

Band66-1.4MHz-16QAM-132322-6RB#0

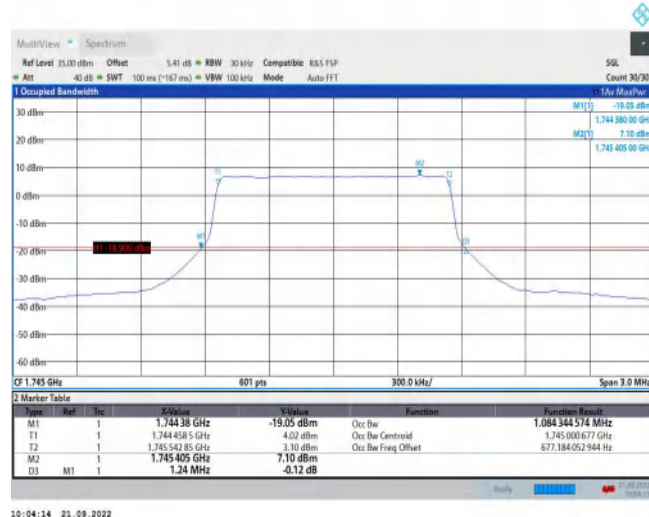




CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 64 of 132


Band66-1.4MHz-16QAM-132665-6RB#0

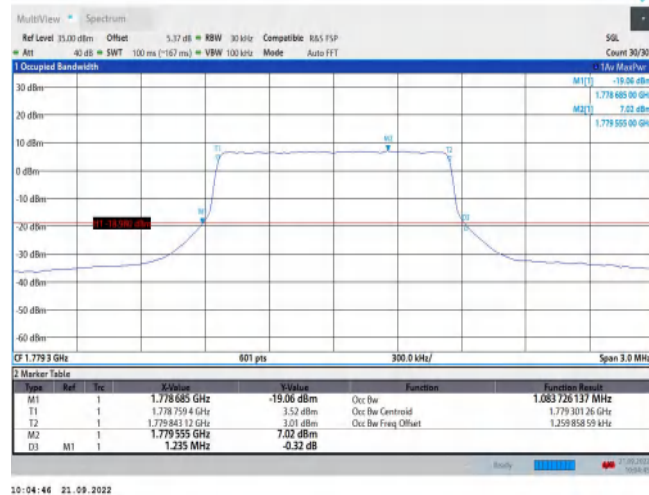


Band66-1.4MHz-64QAM-131979-6RB#0

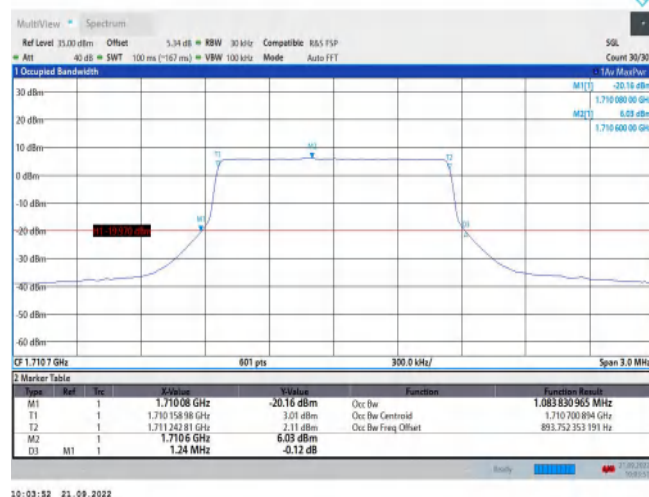


Band66-1.4MHz-64QAM-132322-6RB#0

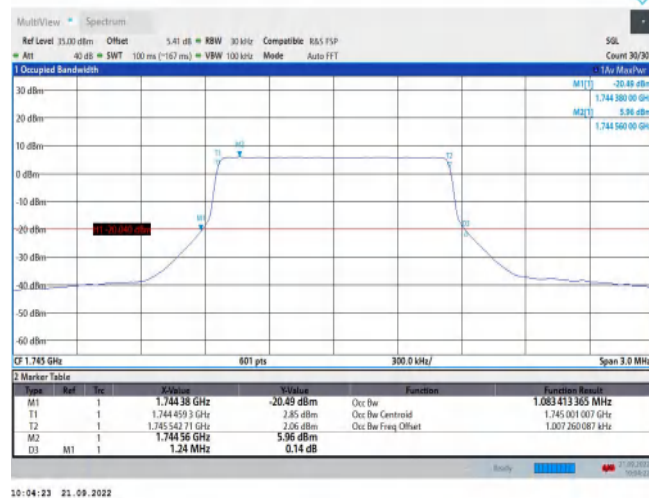

Band66-1.4MHz-64QAM-132665-6RB#0

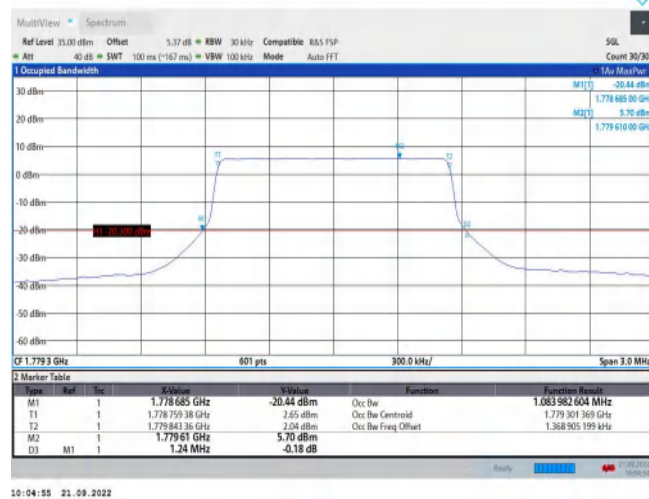

Band66-3MHz-QPSK-131987-15RB#0

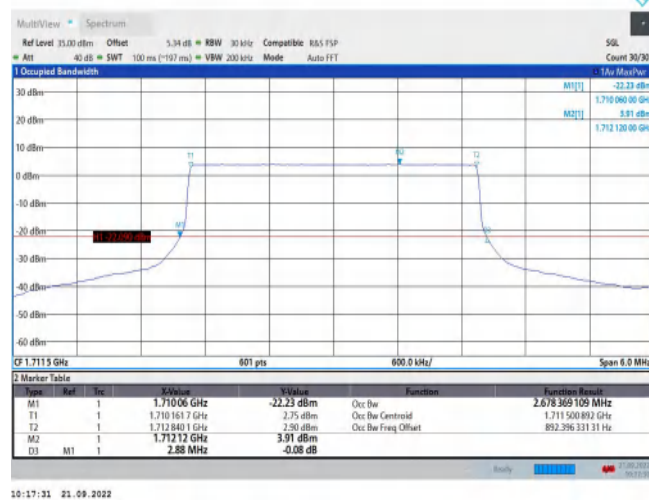




CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 66 of 132


Band66-3MHz-QPSK-132322-15RB#0

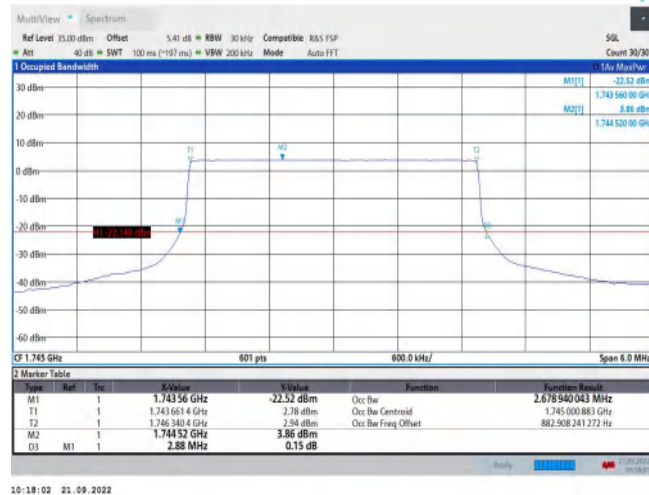


Band66-3MHz-QPSK-132657-15RB#0

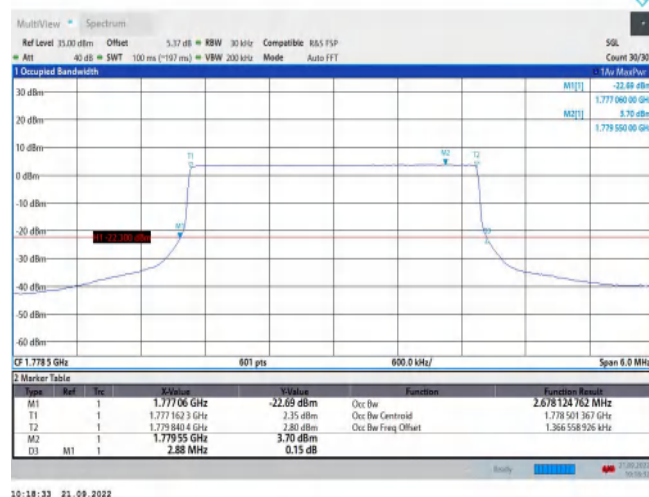


Band66-3MHz-16QAM-131987-15RB#0

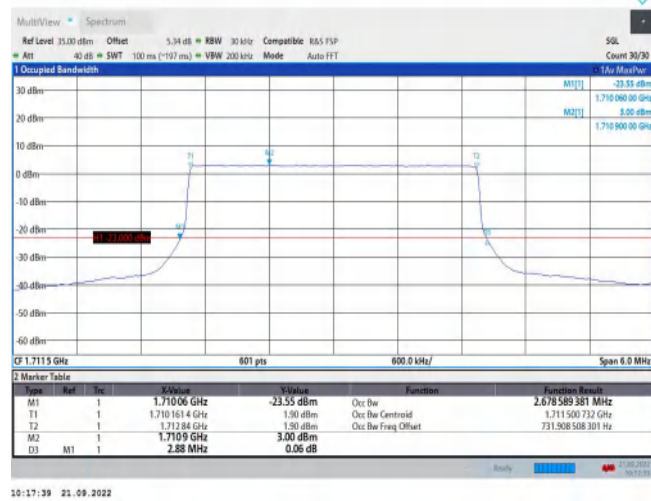

Band66-3MHz-16QAM-132322-15RB#0

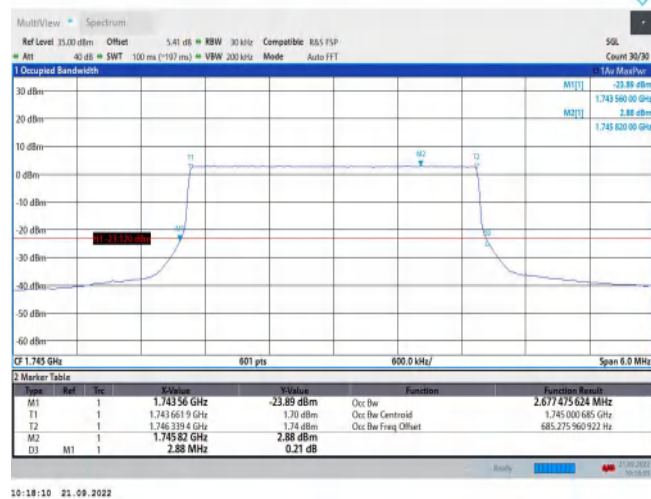


Band66-3MHz-16QAM-132657-15RB#0

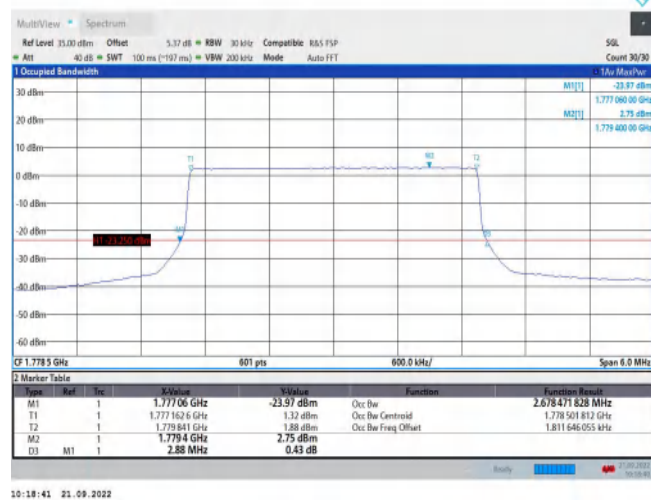




Band66-3MHz-64QAM-131987-15RB#0

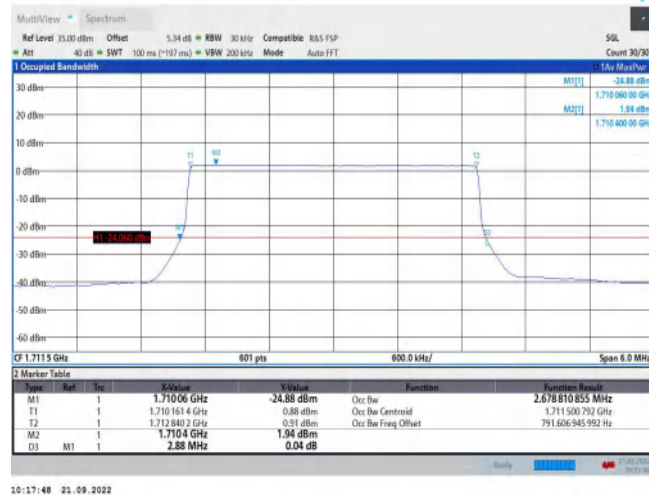

Band66-3MHz-64QAM-132322-15RB#0

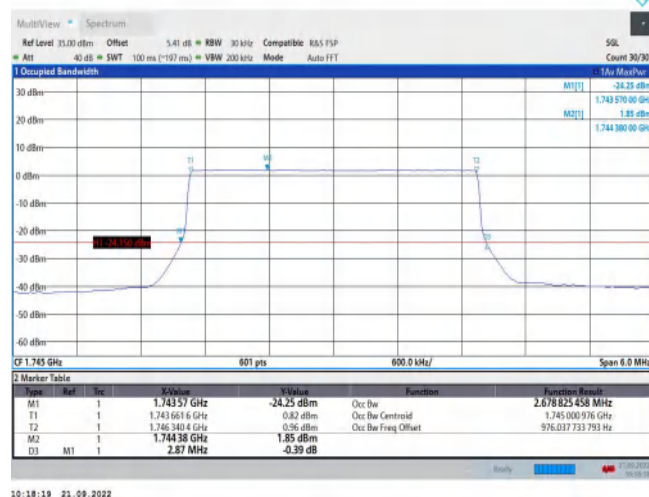


Band66-3MHz-64QAM-132657-15RB#0



CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 69 of 132

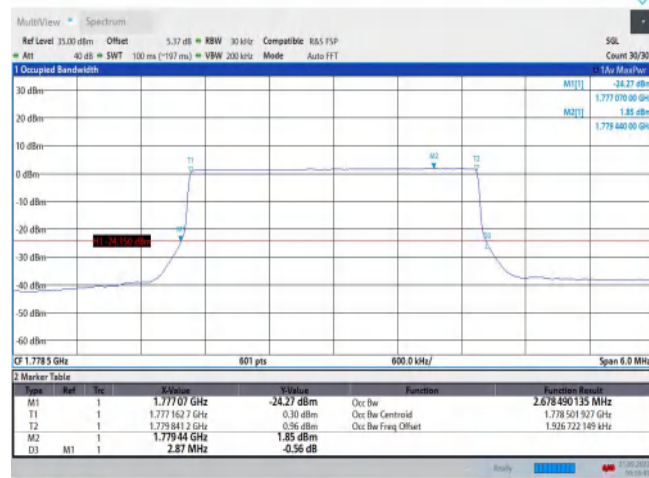

10:18:50 21.09.2022

Band66-5MHz-QPSK-131997-25RB#0

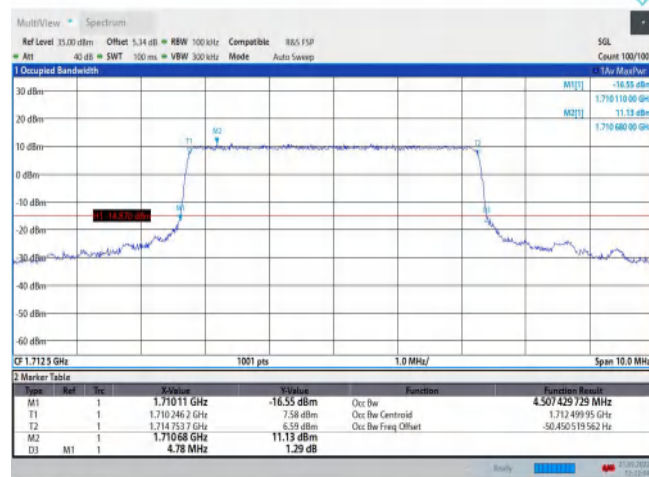

12:22:05 21.09.2022

Band66-5MHz-QPSK-132322-25RB#0



12:22:54 21.09.2022



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17


Page 70 of 132

Band66-5MHz-QPSK-132647-25RB#0




12:23:44 21.09.2022

Band66-5MHz-16QAM-131997-25RB#0

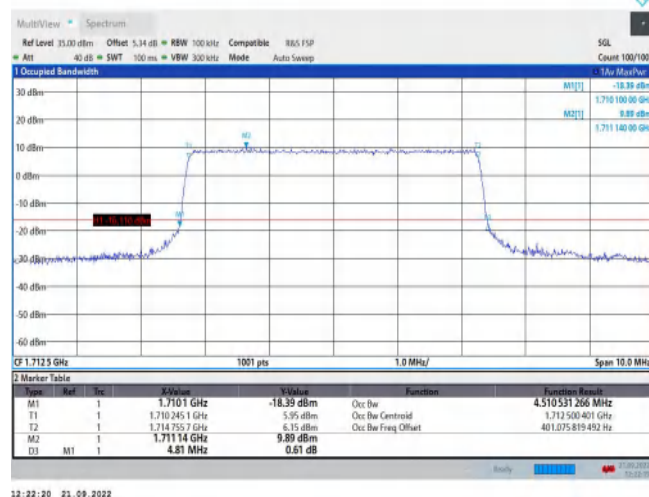


12:22:20 21.09.2022

Band66-5MHz-16QAM-132322-25RB#0

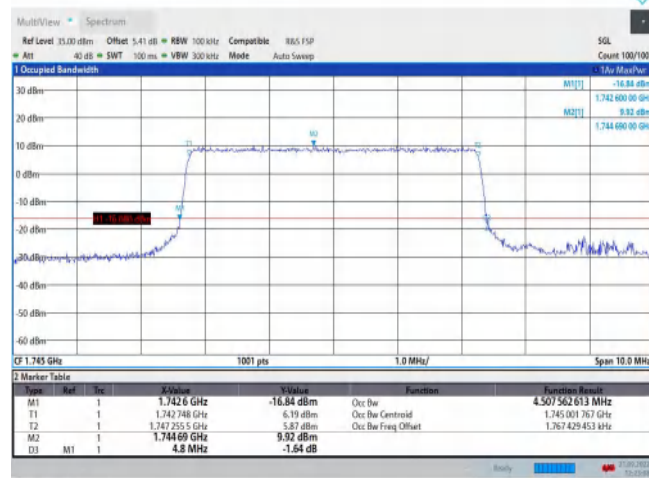

Band66-5MHz-16QAM-132647-25RB#0

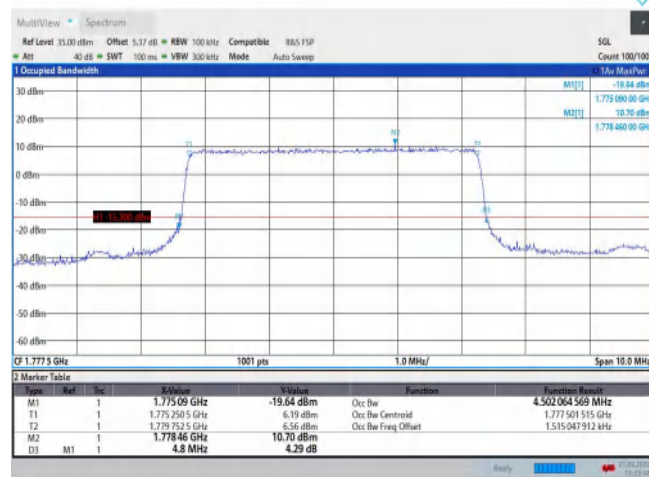

Band66-5MHz-64QAM-131997-25RB#0






CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17


Page 72 of 132

Band66-5MHz-64QAM-132322-25RB#0

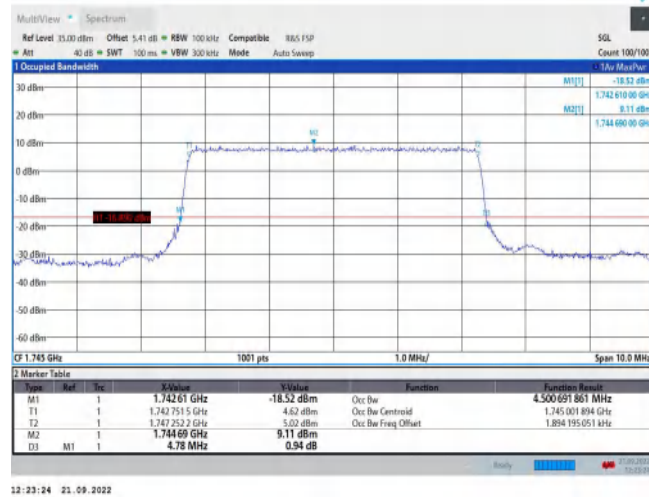


12:23:24 21.09.2022

Band66-5MHz-64QAM-132647-25RB#0

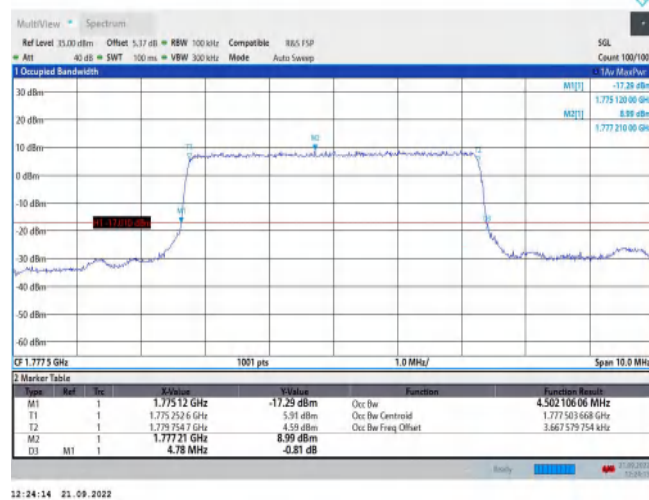


12:24:14 21.09.2022

Band66-10MHz-QPSK-132022-50RB#0

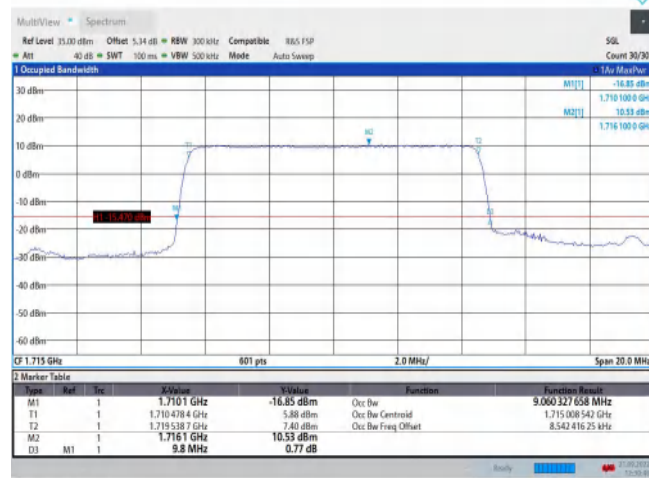

Band66-10MHz-QPSK-132322-50RB#0

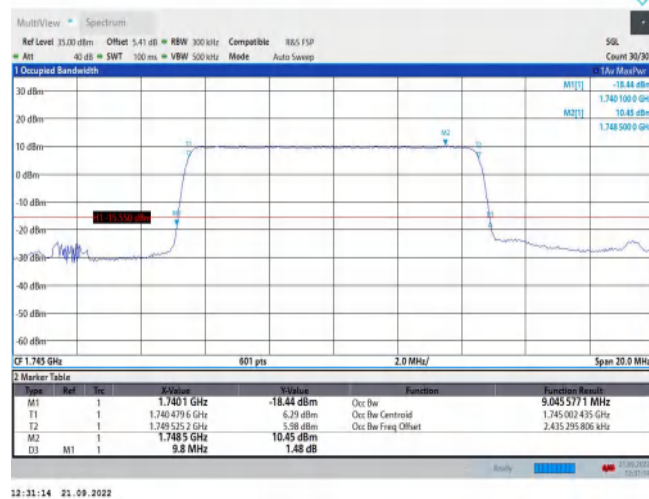

Band66-10MHz-QPSK-132622-50RB#0





CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 74 of 132

Band66-10MHz-16QAM-132022-50RB#0



Band66-10MHz-16QAM-132322-50RB#0

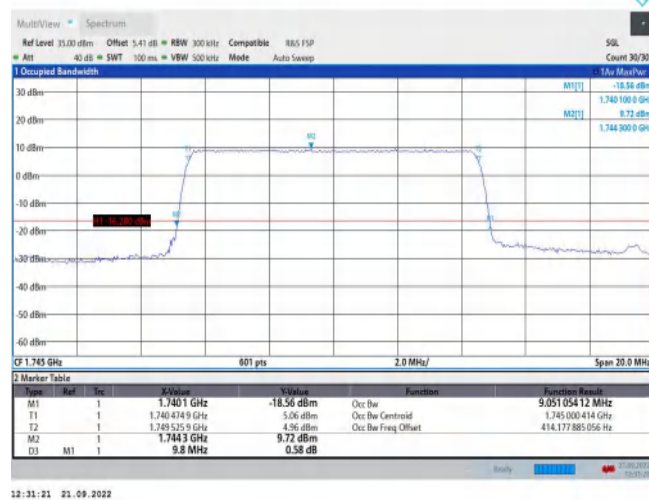

Band66-10MHz-16QAM-132622-50RB#0



12:31:48 21.09.2022

Band66-10MHz-64QAM-132022-50RB#0



12:31:02 21.09.2022


Band66-10MHz-64QAM-132322-50RB#0



12:31:29 21.09.2022



Band66-10MHz-64QAM-132622-50RB#0

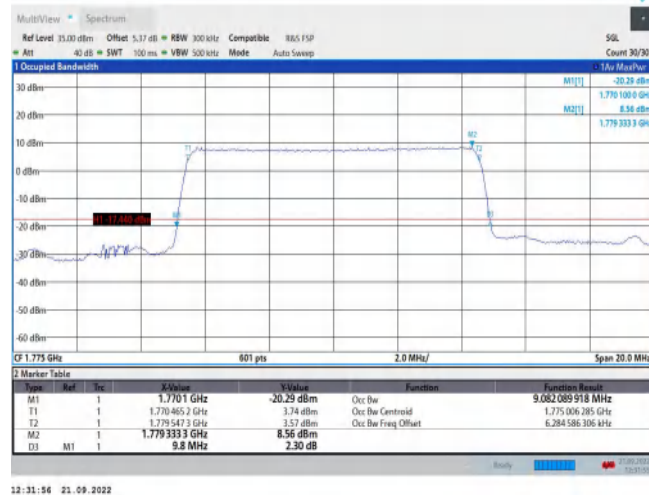

Band66-15MHz-QPSK-132047-75RB#0



Band66-15MHz-QPSK-132322-75RB#0



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17


Page 77 of 132



Band66-15MHz-QPSK-132597-75RB#0



Band66-15MHz-16QAM-132047-75RB#0

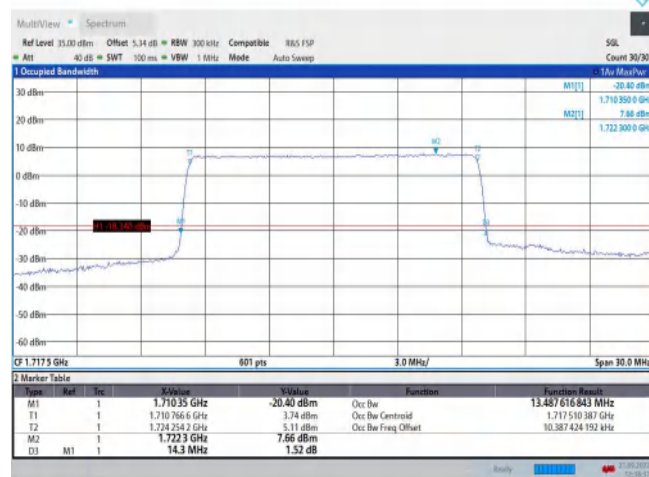




CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 78 of 132

Band66-15MHz-16QAM-132322-75RB#0

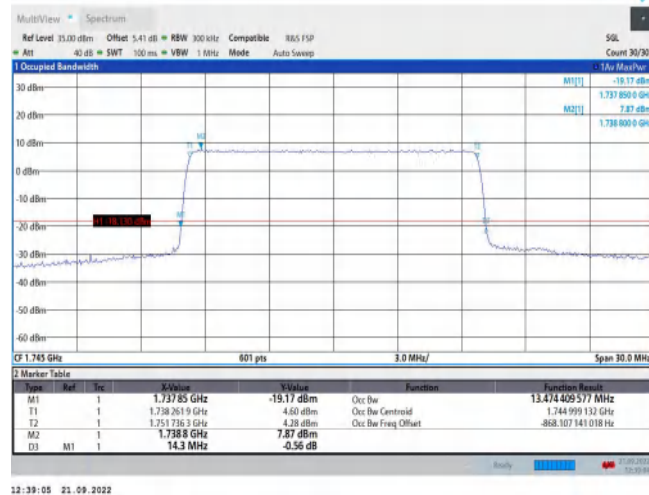

12:39:05 21.09.2022

Band66-15MHz-16QAM-132597-75RB#0



12:39:32 21.09.2022

Band66-15MHz-64QAM-132047-75RB#0



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 79 of 132



Band66-15MHz-64QAM-132322-75RB#0



Band66-15MHz-64QAM-132597-75RB#0






CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17


Page 80 of 132

Band66-20MHz-QPSK-132072-100RB#0

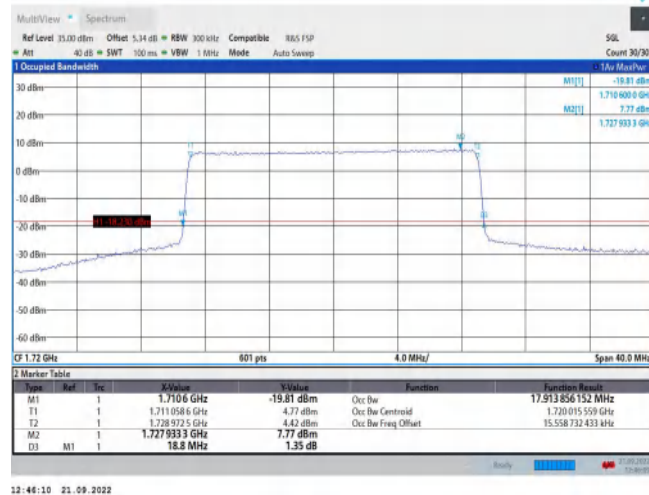

12:46:10 21.09.2022

Band66-20MHz-QPSK-132322-100RB#0

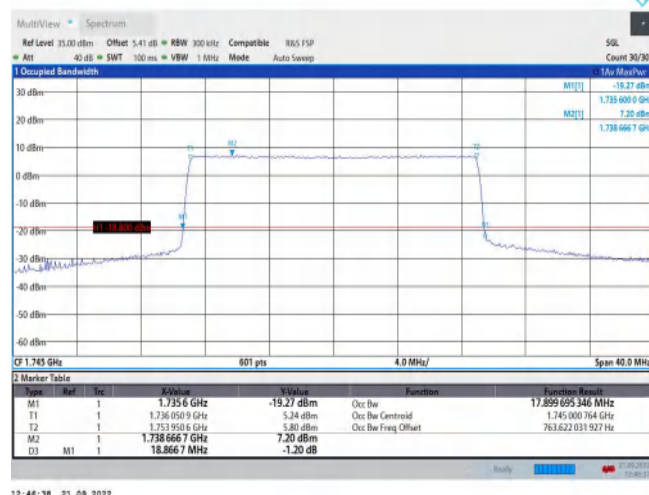

12:46:38 21.09.2022

Band66-20MHz-QPSK-132572-100RB#0



CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 81 of 132



12:47:04 21.09.2022

Band66-20MHz-16QAM-132072-100RB#0

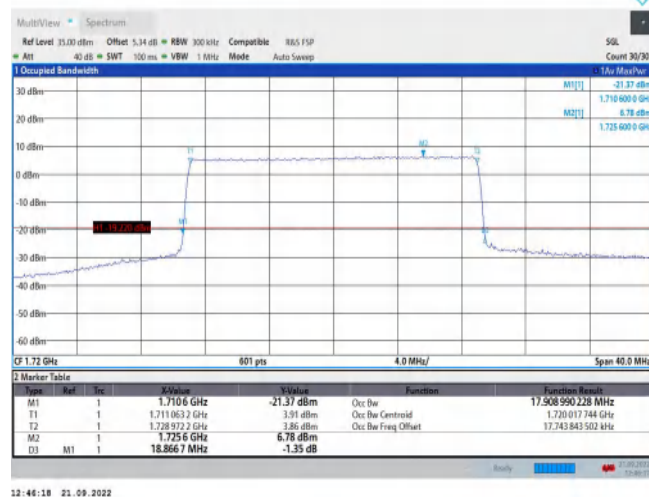

12:46:18 21.09.2022

Band66-20MHz-16QAM-132322-100RB#0



12:46:46 21.09.2022



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 82 of 132

Band66-20MHz-16QAM-132572-100RB#0



Band66-20MHz-64QAM-132072-100RB#0



Band66-20MHz-64QAM-132322-100RB#0



Band66-20MHz-64QAM-132572-100RB#0





Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	see graph	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	see graph	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	see graph	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	see graph	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	see graph	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	see graph	PASS
Band66	3MHz	QPSK	131987	1RB#0	see graph	PASS
Band66	3MHz	QPSK	131987	1RB#14	see graph	PASS
Band66	3MHz	QPSK	131987	15RB#0	see graph	PASS
Band66	3MHz	QPSK	132657	1RB#0	see graph	PASS
Band66	3MHz	QPSK	132657	1RB#14	see graph	PASS
Band66	3MHz	QPSK	132657	15RB#0	see graph	PASS
Band66	5MHz	QPSK	131997	1RB#0	see graph	PASS
Band66	5MHz	QPSK	131997	1RB#24	see graph	PASS
Band66	5MHz	QPSK	131997	25RB#0	see graph	PASS
Band66	5MHz	QPSK	132647	1RB#0	see graph	PASS
Band66	5MHz	QPSK	132647	1RB#24	see graph	PASS
Band66	5MHz	QPSK	132647	25RB#0	see graph	PASS
Band66	10MHz	QPSK	132022	1RB#0	see graph	PASS
Band66	10MHz	QPSK	132022	1RB#49	see graph	PASS
Band66	10MHz	QPSK	132022	50RB#0	see graph	PASS
Band66	10MHz	QPSK	132622	1RB#0	see graph	PASS
Band66	10MHz	QPSK	132622	1RB#49	see graph	PASS
Band66	10MHz	QPSK	132622	50RB#0	see graph	PASS
Band66	15MHz	QPSK	132047	1RB#0	see graph	PASS
Band66	15MHz	QPSK	132047	1RB#74	see graph	PASS
Band66	15MHz	QPSK	132047	75RB#0	see graph	PASS
Band66	15MHz	QPSK	132597	1RB#0	see graph	PASS
Band66	15MHz	QPSK	132597	1RB#74	see graph	PASS
Band66	15MHz	QPSK	132597	75RB#0	see graph	PASS
Band66	20MHz	QPSK	132072	1RB#0	see graph	PASS
Band66	20MHz	QPSK	132072	1RB#99	see graph	PASS
Band66	20MHz	QPSK	132072	100RB#0	see graph	PASS



CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 85 of 132


Band66	20MHz	QPSK	132572	1RB#0	see graph	PASS
Band66	20MHz	QPSK	132572	1RB#99	see graph	PASS
Band66	20MHz	QPSK	132572	100RB#0	see graph	PASS

Test Graphs


Band66-1.4MHz-QPSK-131979-1RB#0

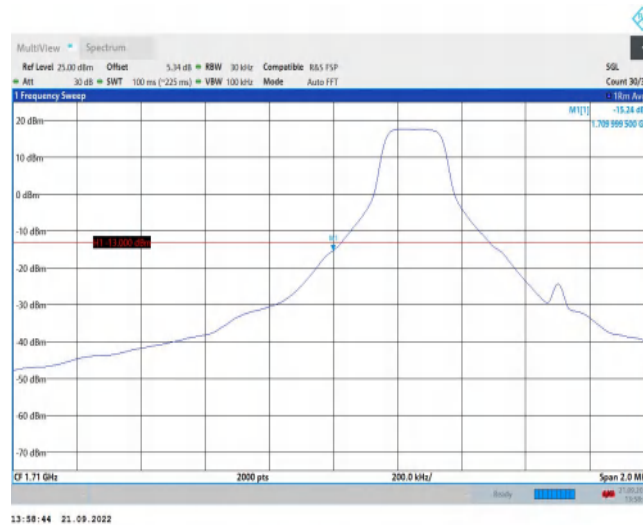


Band66-1.4MHz-QPSK-131979-1RB#5

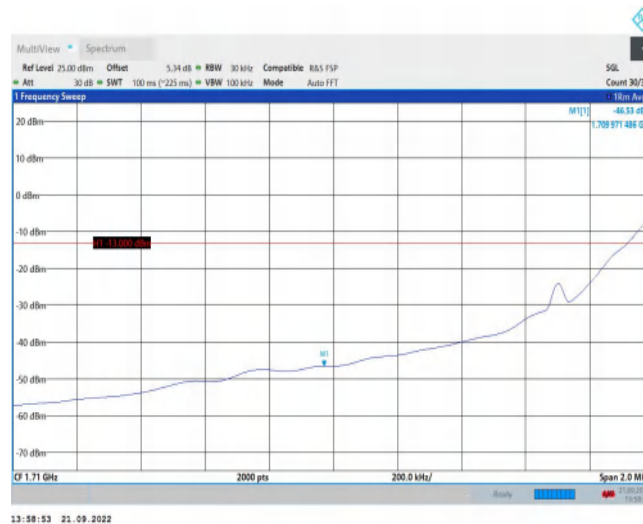


Band66-1.4MHz-QPSK-131979-6RB#0

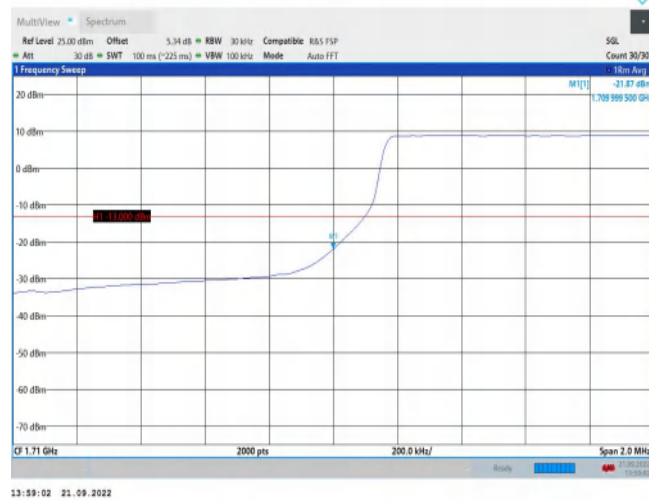

Band66-1.4MHz-QPSK-132665-1RB#0

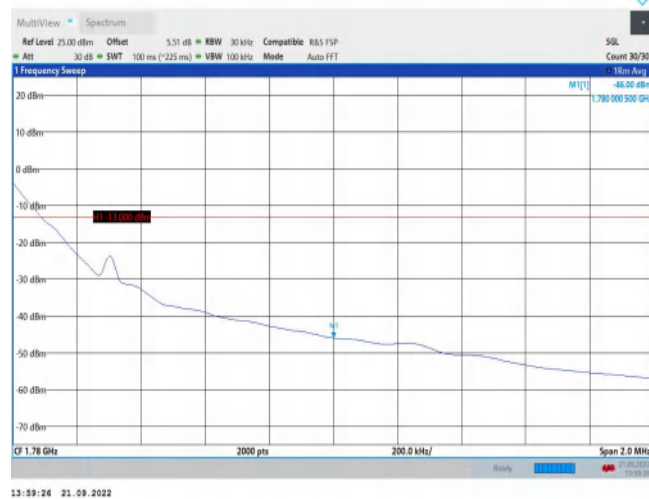


Band66-1.4MHz-QPSK-132665-1RB#5

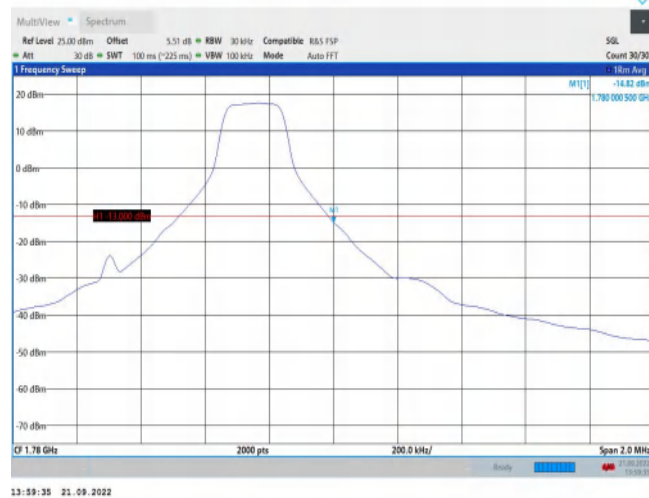





Band66-1.4MHz-QPSK-132665-6RB#0

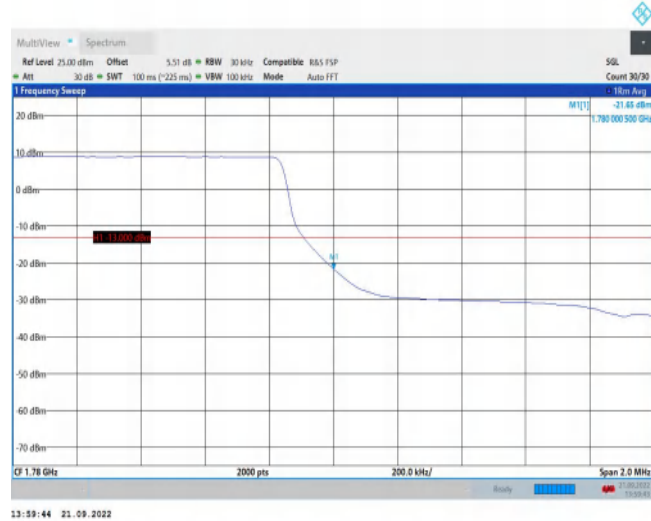


Band66-3MHz-QPSK-131987-1RB#0

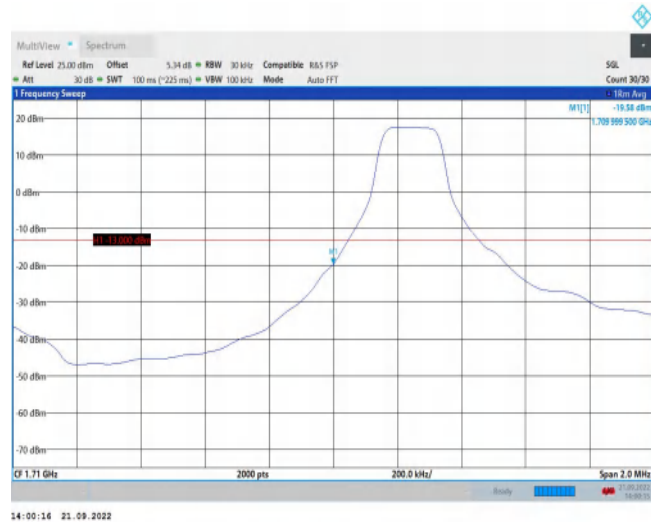


Band66-3MHz-QPSK-131987-1RB#14

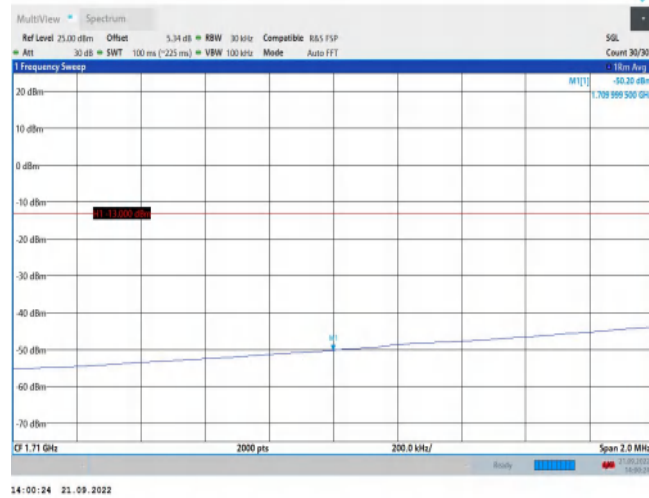

Band66-3MHz-QPSK-131987-15RB#0

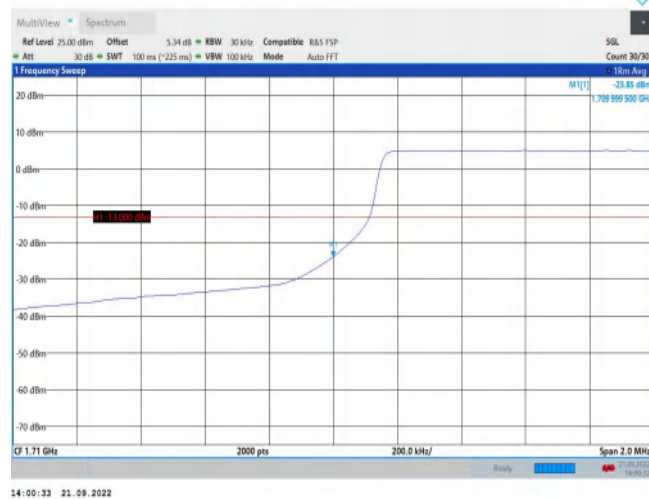


Band66-3MHz-QPSK-132657-1RB#0

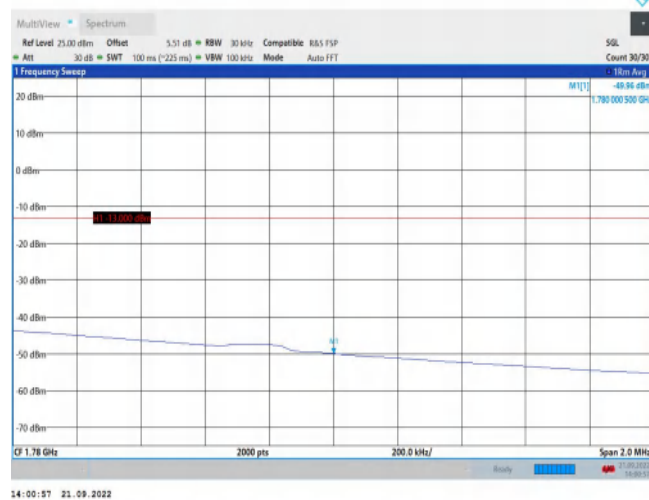





Band66-3MHz-QPSK-132657-1RB#14

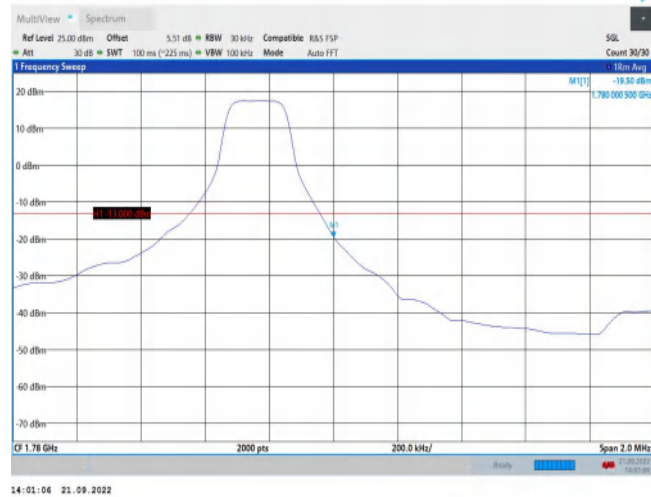


Band66-3MHz-QPSK-132657-15RB#0

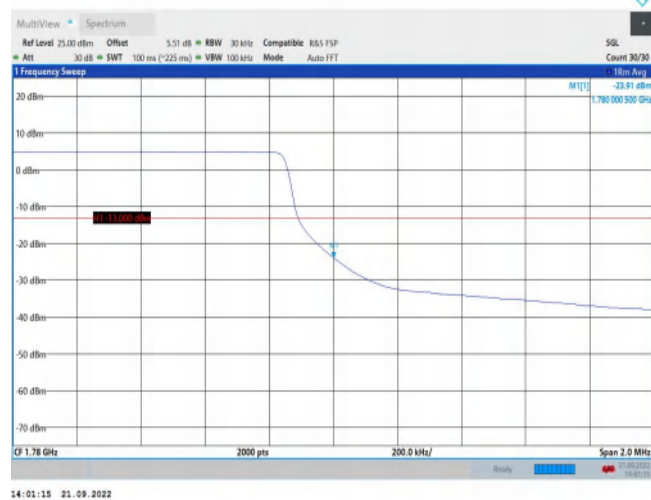


Band66-5MHz-QPSK-131997-1RB#0

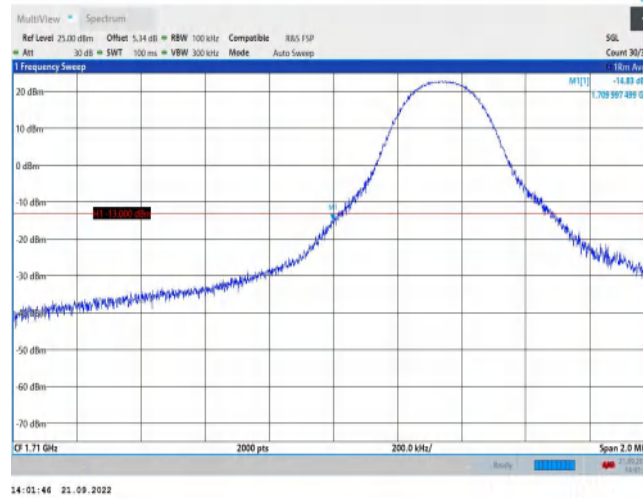

Band66-5MHz-QPSK-131997-1RB#24

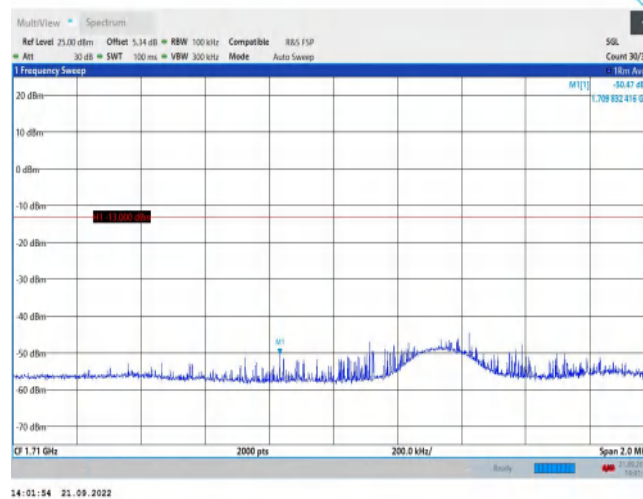


Band66-5MHz-QPSK-131997-25RB#0

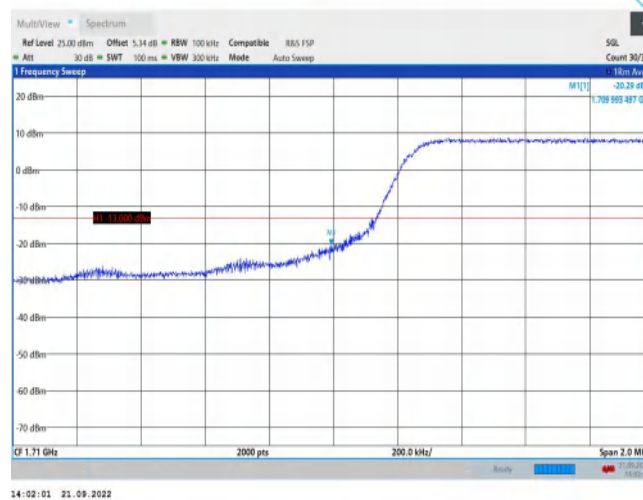





Band66-5MHz-QPSK-132647-1RB#0

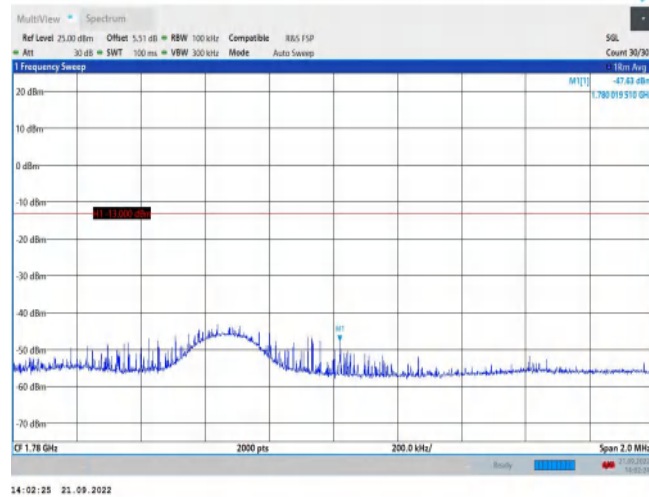


Band66-5MHz-QPSK-132647-1RB#24

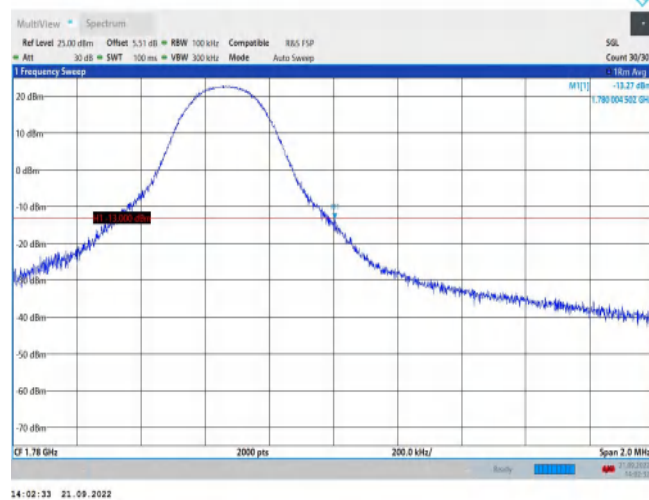


Band66-5MHz-QPSK-132647-25RB#0

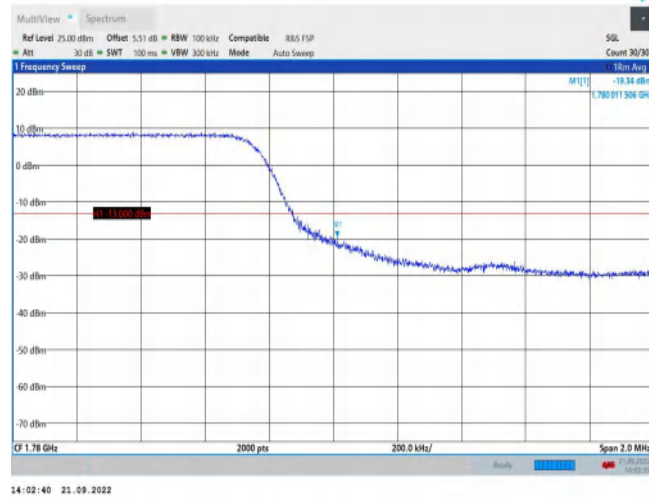

Band66-10MHz-QPSK-132022-1RB#0

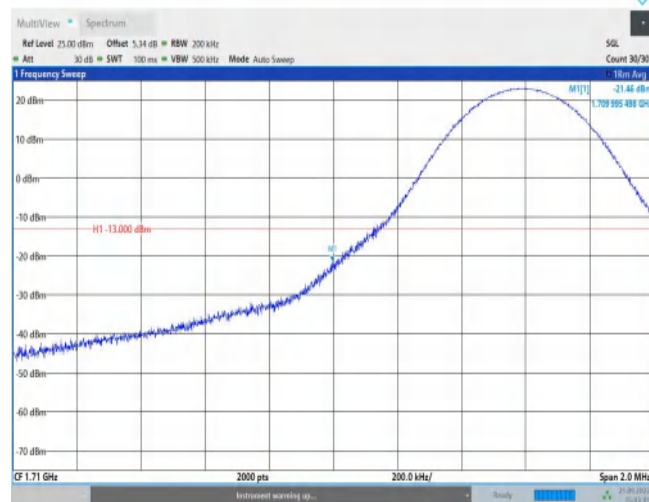

Band66-10MHz-QPSK-132022-1RB#49

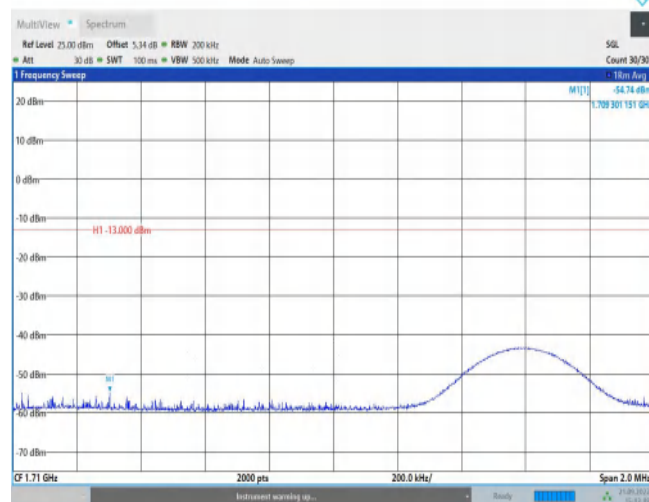




CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 93 of 132


Band66-10MHz-QPSK-132022-50RB#0

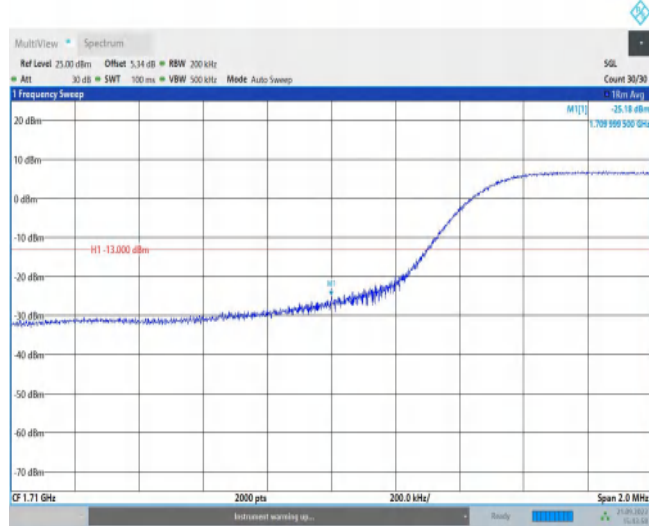


Band66-10MHz-QPSK-132622-1RB#0

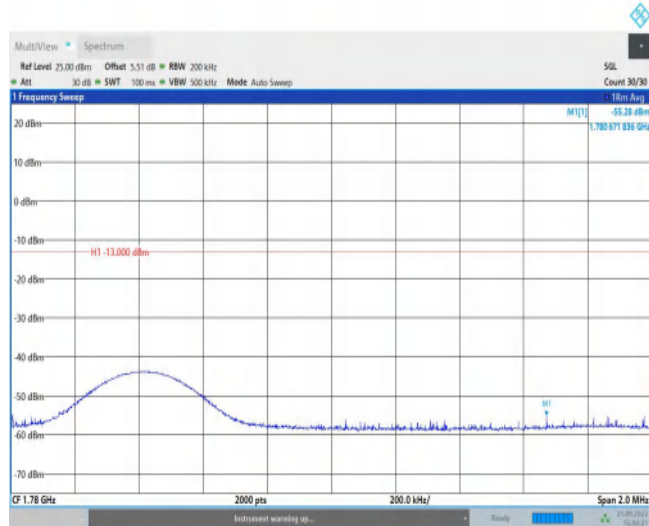


Band66-10MHz-QPSK-132622-1RB#49

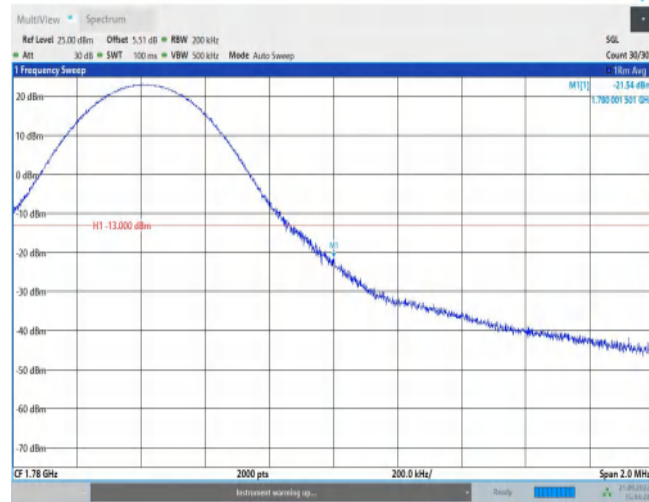

Band66-10MHz-QPSK-132622-50RB#0

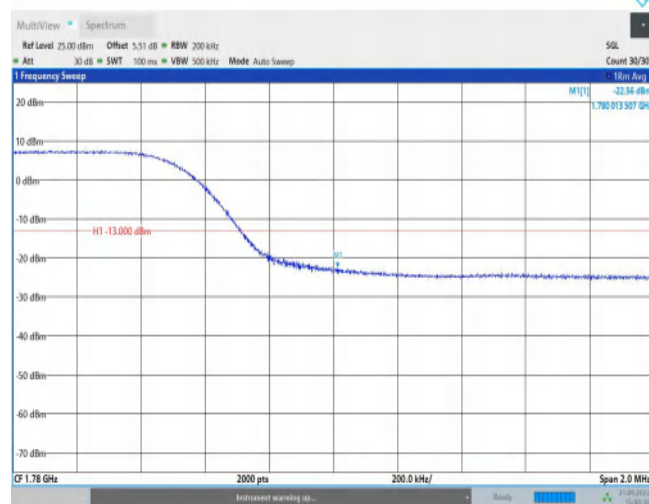


Band66-15MHz-QPSK-132047-1RB#0

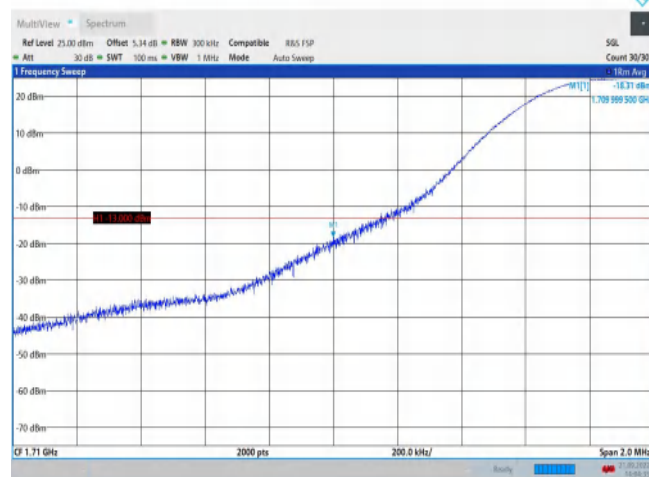





Band66-15MHz-QPSK-132047-1RB#74

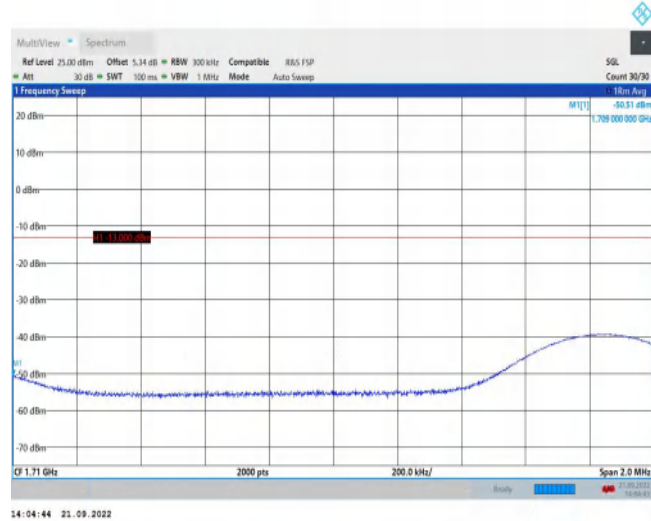


Band66-15MHz-QPSK-132047-75RB#0

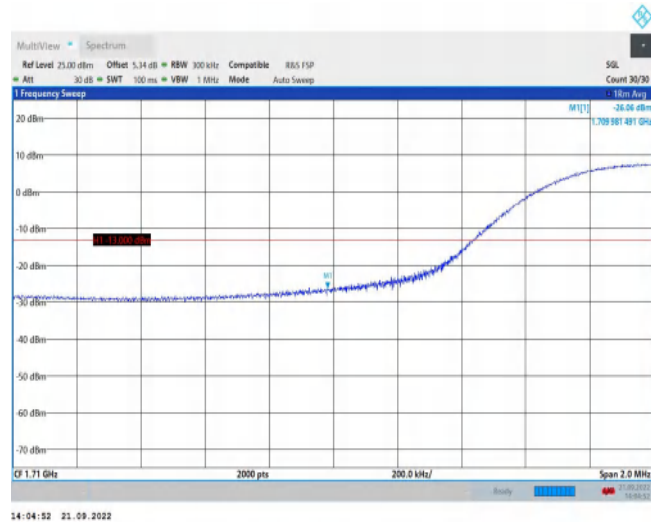


Band66-15MHz-QPSK-132597-1RB#0

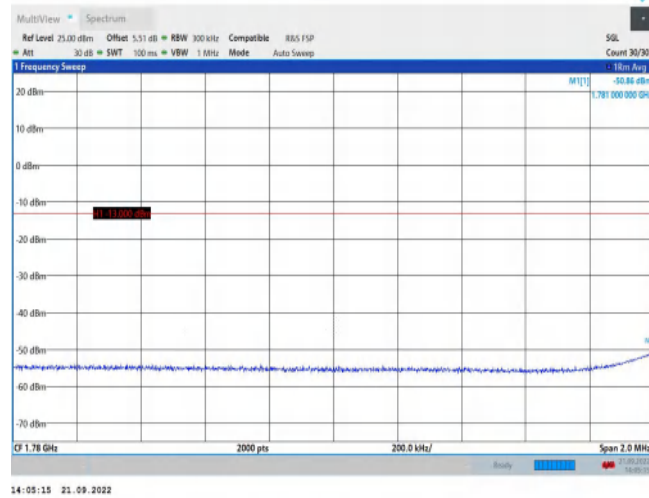

Band66-15MHz-QPSK-132597-1RB#74

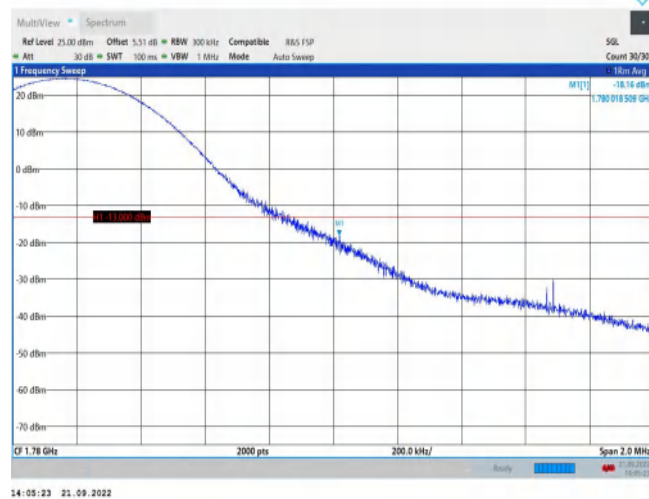


Band66-15MHz-QPSK-132597-75RB#0

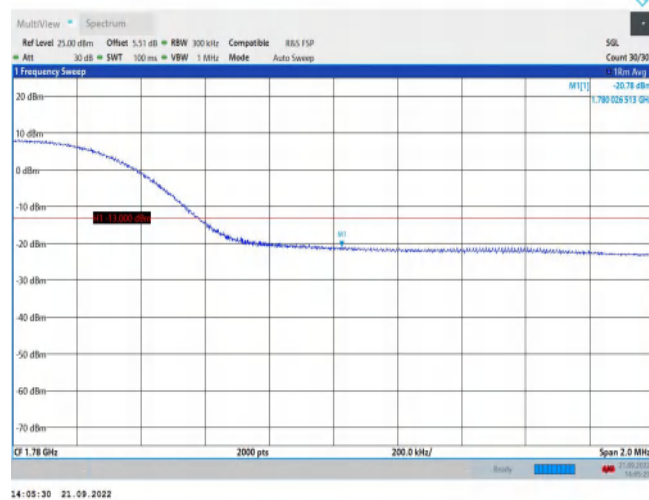





Band66-20MHz-QPSK-132072-1RB#0

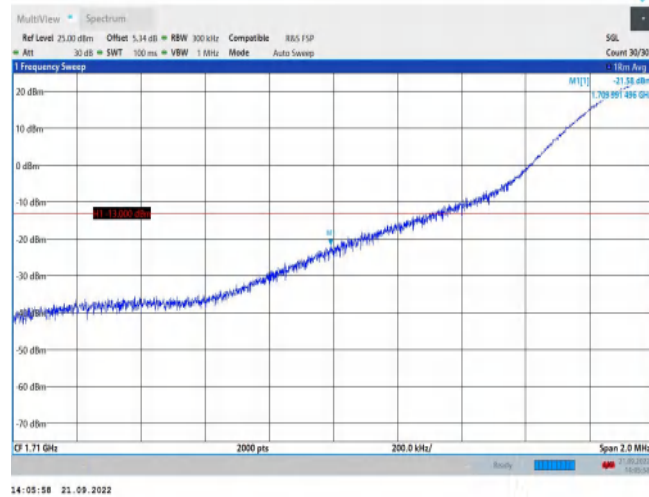


Band66-20MHz-QPSK-132072-1RB#99

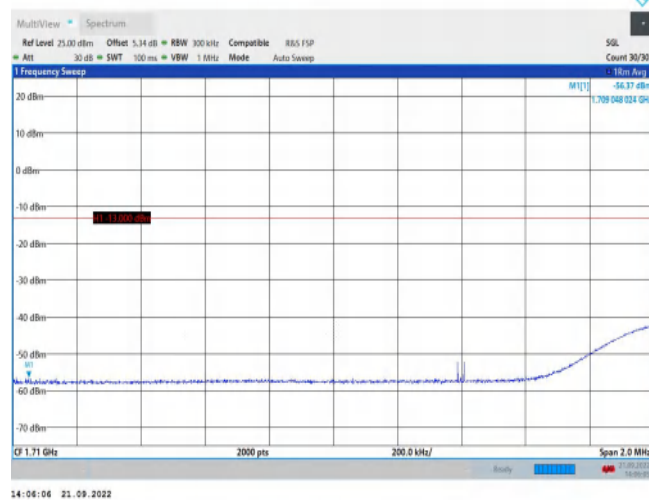


Band66-20MHz-QPSK-132072-100RB#0

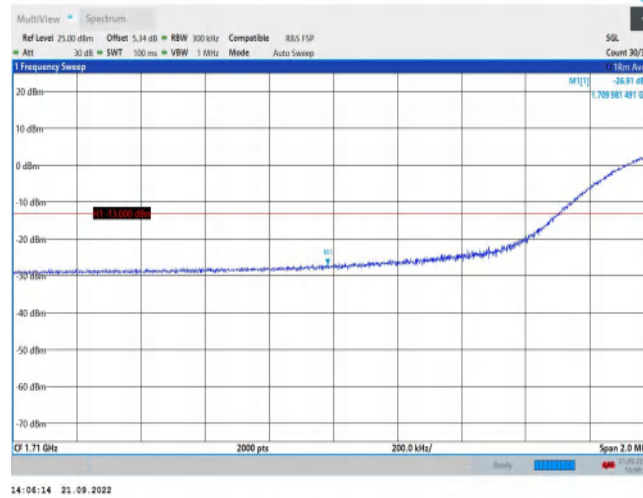

Band66-20MHz-QPSK-132572-1RB#0

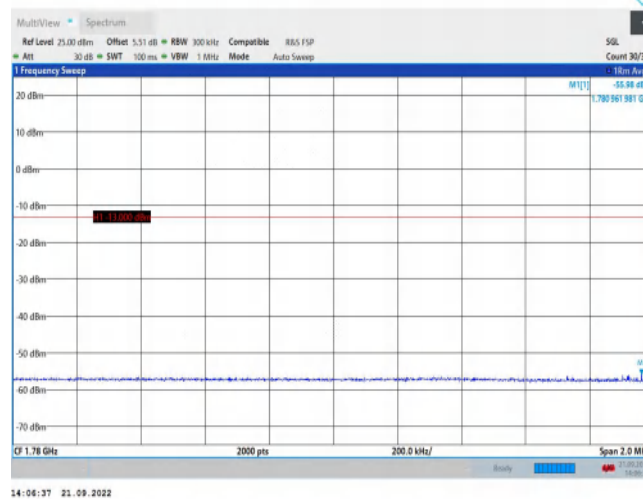


Band66-20MHz-QPSK-132572-1RB#99

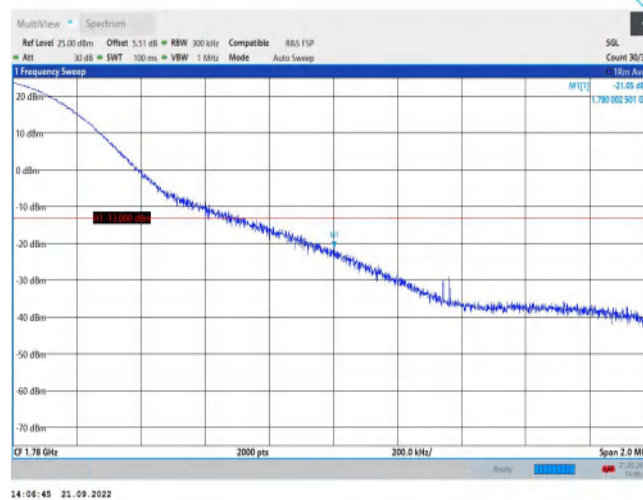



Band66-20MHz-QPSK-132572-100RB#0

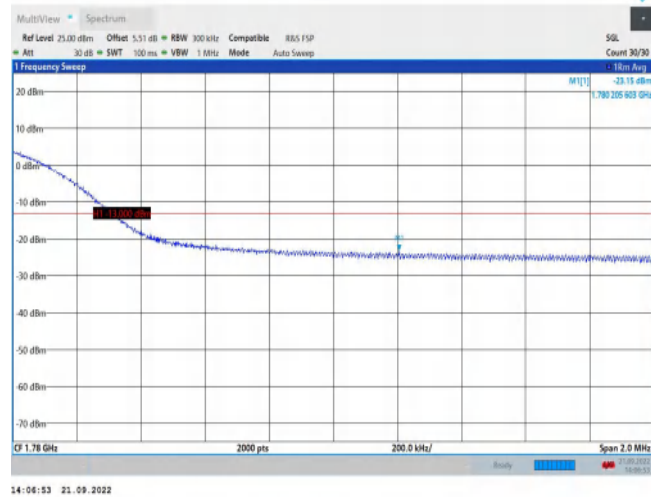



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band6 6	1.4MHz	QPSK	13197 9	1RB#0	Range1:30~1000MHz	-40.4 2	PAS S
Band6 6	1.4MHz	QPSK	13197 9	1RB#0	Range2:1000~2000M Hz	-38.0 1	PAS S
Band6 6	1.4MHz	QPSK	13197 9	1RB#0	Range3:2000~20000M Hz	-50.6 3	PAS S
Band6 6	1.4MHz	QPSK	13232 2	1RB#0	Range1:30~1000MHz	-41.5 7	PAS S
Band6 6	1.4MHz	QPSK	13232 2	1RB#0	Range2:1000~2000M Hz	-37.5 8	PAS S
Band6 6	1.4MHz	QPSK	13232 2	1RB#0	Range3:2000~20000M Hz	-51.3 5	PAS S
Band6 6	1.4MHz	QPSK	13266 5	1RB#0	Range1:30~1000MHz	-41.2 9	PAS S
Band6 6	1.4MHz	QPSK	13266 5	1RB#0	Range2:1000~2000M Hz	-38.0 8	PAS S
Band6 6	1.4MHz	QPSK	13266 5	1RB#0	Range3:2000~20000M Hz	-51.2 6	PAS S
Band6 6	3MHz	QPSK	13198 7	1RB#0	Range1:30~1000MHz	-41.1 7	PAS S
Band6 6	3MHz	QPSK	13198 7	1RB#0	Range2:1000~2000M Hz	-38	PAS S
Band6 6	3MHz	QPSK	13198 7	1RB#0	Range3:2000~20000M Hz	-51.0 9	PAS S
Band6 6	3MHz	QPSK	13232 2	1RB#0	Range1:30~1000MHz	-41.1 6	PAS S
Band6 6	3MHz	QPSK	13232 2	1RB#0	Range2:1000~2000M Hz	-38	PAS S
Band6 6	3MHz	QPSK	13232 2	1RB#0	Range3:2000~20000M Hz	-51.2 5	PAS S
Band6 6	3MHz	QPSK	13265 7	1RB#0	Range1:30~1000MHz	-40.7 1	PAS S



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 101 of 132

Band6 6	3MHz	QPSK	13265 7	1RB#0	Range2:1000~2000M Hz	-39.3 1	PAS S
Band6 6	3MHz	QPSK	13265 7	1RB#0	Range3:2000~20000M Hz	-50.2 6	PAS S
Band6 6	5MHz	QPSK	13199 7	1RB#0	Range1:30~1000MHz	-40.7 9	PAS S
Band6 6	5MHz	QPSK	13199 7	1RB#0	Range2:1000~2000M Hz	-38.0 8	PAS S
Band6 6	5MHz	QPSK	13199 7	1RB#0	Range3:2000~20000M Hz	-50.6 7	PAS S
Band6 6	5MHz	QPSK	13232 2	1RB#0	Range1:30~1000MHz	-41.5	PAS S
Band6 6	5MHz	QPSK	13232 2	1RB#0	Range2:1000~2000M Hz	-37.7 6	PAS S
Band6 6	5MHz	QPSK	13232 2	1RB#0	Range3:2000~20000M Hz	-50.9 3	PAS S
Band6 6	5MHz	QPSK	13264 7	1RB#0	Range1:30~1000MHz	-41.2 4	PAS S
Band6 6	5MHz	QPSK	13264 7	1RB#0	Range2:1000~2000M Hz	-37.5 6	PAS S
Band6 6	5MHz	QPSK	13264 7	1RB#0	Range3:2000~20000M Hz	-50.7 4	PAS S
Band6 6	10MHz	QPSK	13202 2	1RB#0	Range1:30~1000MHz	-40.8 2	PAS S
Band6 6	10MHz	QPSK	13202 2	1RB#0	Range2:1000~2000M Hz	-38.5 5	PAS S
Band6 6	10MHz	QPSK	13202 2	1RB#0	Range3:2000~20000M Hz	-50.6 1	PAS S
Band6 6	10MHz	QPSK	13232 2	1RB#0	Range1:30~1000MHz	-40.7 2	PAS S
Band6 6	10MHz	QPSK	13232 2	1RB#0	Range2:1000~2000M Hz	-38.5 4	PAS S
Band6 6	10MHz	QPSK	13232 2	1RB#0	Range3:2000~20000M Hz	-49.6 9	PAS S
Band6 6	10MHz	QPSK	13262 2	1RB#0	Range1:30~1000MHz	-41.2 2	PAS S
Band6 6	10MHz	QPSK	13262 2	1RB#0	Range2:1000~2000M Hz	-38.6 6	PAS S
Band6 6	10MHz	QPSK	13262 2	1RB#0	Range3:2000~20000M Hz	-50.0 7	PAS S



CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 102 of 132


Band6 6	15MHz	QPSK	13204 7	1RB#0	Range1:30~1000MHz	-40.9 1	PAS S
Band6 6	15MHz	QPSK	13204 7	1RB#0	Range2:1000~2000M Hz	-38.1 2	PAS S
Band6 6	15MHz	QPSK	13204 7	1RB#0	Range3:2000~20000M Hz	-50.7 7	PAS S
Band6 6	15MHz	QPSK	13232 2	1RB#0	Range1:30~1000MHz	-40.8 9	PAS S
Band6 6	15MHz	QPSK	13232 2	1RB#0	Range2:1000~2000M Hz	-38.5 3	PAS S
Band6 6	15MHz	QPSK	13232 2	1RB#0	Range3:2000~20000M Hz	-49.4 6	PAS S
Band6 6	15MHz	QPSK	13259 7	1RB#0	Range1:30~1000MHz	-41.5 5	PAS S
Band6 6	15MHz	QPSK	13259 7	1RB#0	Range2:1000~2000M Hz	-38.1 7	PAS S
Band6 6	15MHz	QPSK	13259 7	1RB#0	Range3:2000~20000M Hz	-50.4 8	PAS S
Band6 6	20MHz	QPSK	13207 2	1RB#0	Range1:30~1000MHz	-40.9 7	PAS S
Band6 6	20MHz	QPSK	13207 2	1RB#0	Range2:1000~2000M Hz	-38.5 8	PAS S
Band6 6	20MHz	QPSK	13207 2	1RB#0	Range3:2000~20000M Hz	-49.4 8	PAS S
Band6 6	20MHz	QPSK	13232 2	1RB#0	Range1:30~1000MHz	-41.5 8	PAS S
Band6 6	20MHz	QPSK	13232 2	1RB#0	Range2:1000~2000M Hz	-38.0 6	PAS S
Band6 6	20MHz	QPSK	13232 2	1RB#0	Range3:2000~20000M Hz	-50.8 8	PAS S
Band6 6	20MHz	QPSK	13257 2	1RB#0	Range1:30~1000MHz	-41.4 9	PAS S
Band6 6	20MHz	QPSK	13257 2	1RB#0	Range2:1000~2000M Hz	-38.6 3	PAS S
Band6 6	20MHz	QPSK	13257 2	1RB#0	Range3:2000~20000M Hz	-51.0 8	PAS S

Test Graphs


Band66-1.4MHz-QPSK-131979-1RB#0-Range1:30~1000MHz

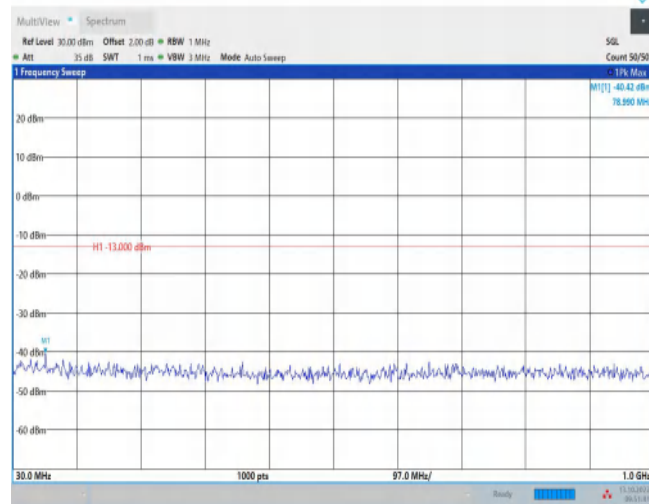

Band66-1.4MHz-QPSK-131979-1RB#0-Range2:1000~2000MHz

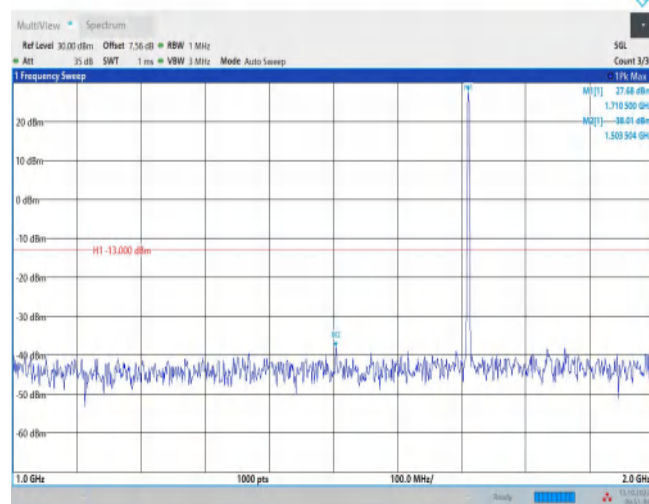


Band66-1.4MHz-QPSK-131979-1RB#0-Range3:2000~20000MHz

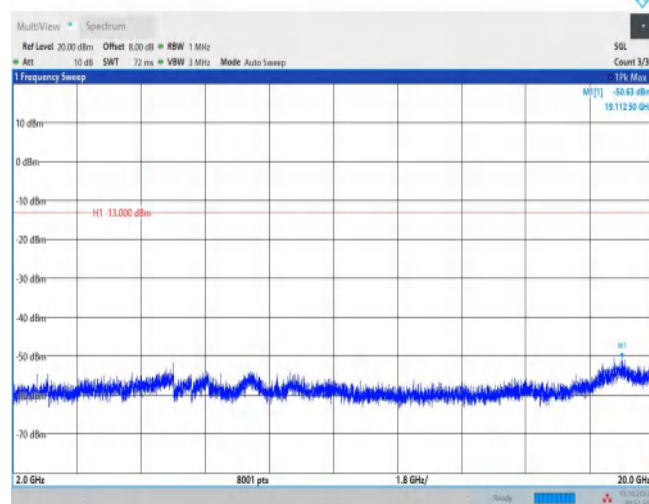





Band66-1.4MHz-QPSK-132322-1RB#0-Range1:30~1000MHz

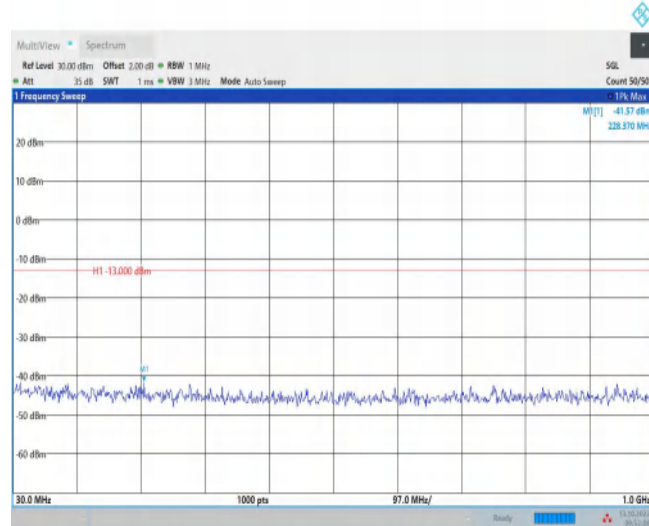


Band66-1.4MHz-QPSK-132322-1RB#0-Range2:1000~2000MHz

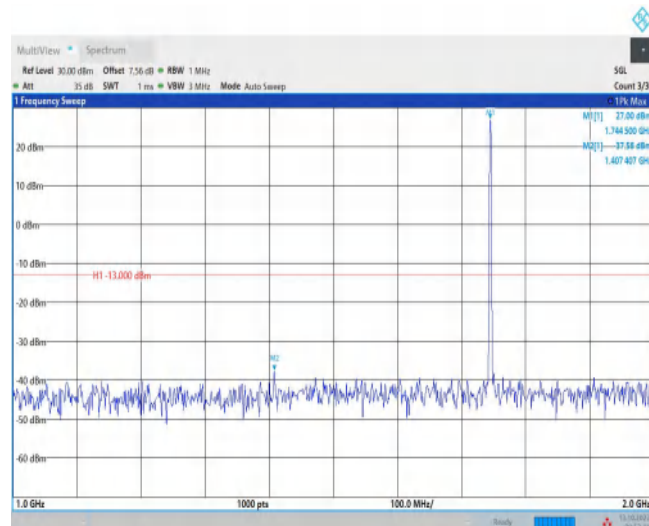


Band66-1.4MHz-QPSK-132322-1RB#0-Range3:2000~20000MHz

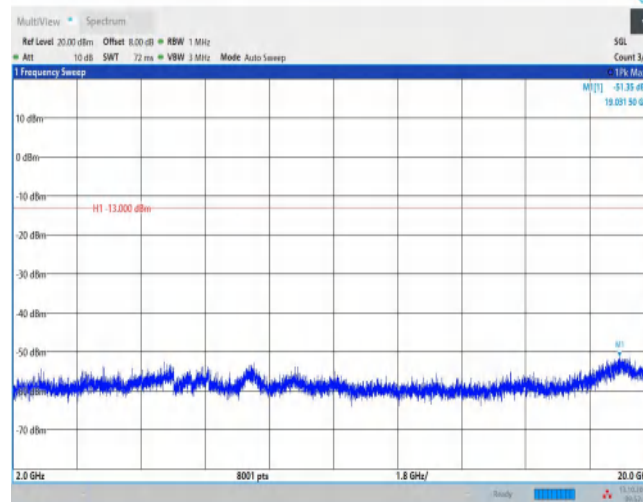

Band66-1.4MHz-QPSK-132665-1RB#0-Range1:30~1000MHz

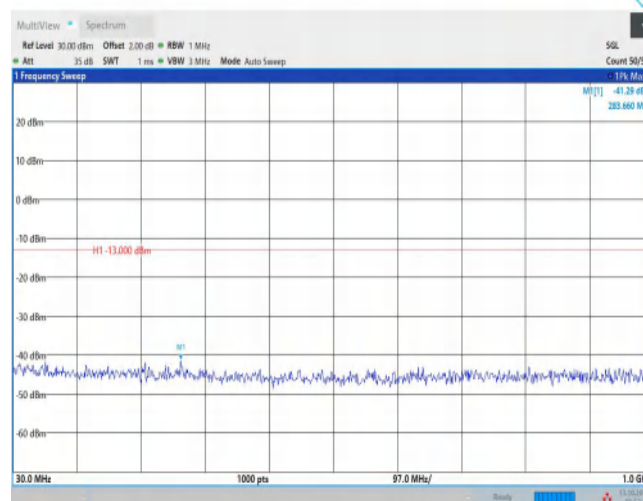


Band66-1.4MHz-QPSK-132665-1RB#0-Range2:1000~2000MHz

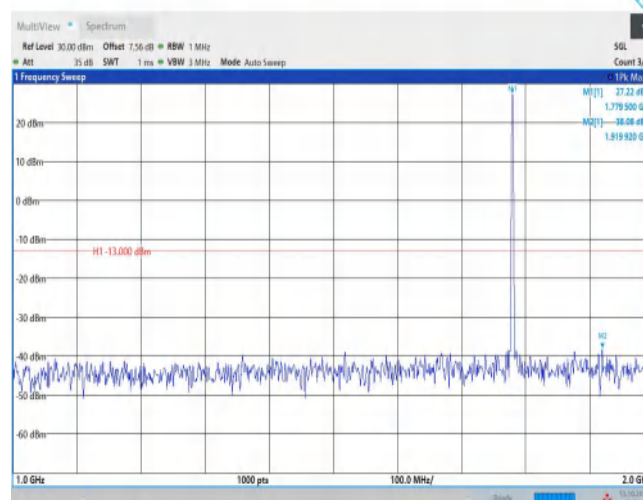





Band66-3MHz-QPSK-131987-1RB#0-Range2:1000~2000MHz

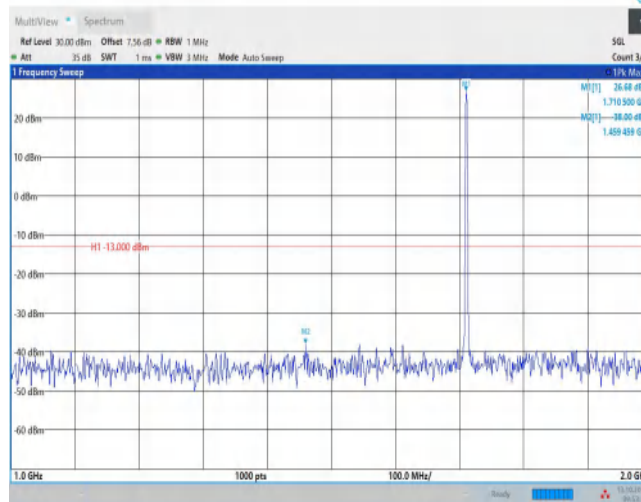

Band66-3MHz-QPSK-131987-1RB#0-Range3:2000~20000MHz

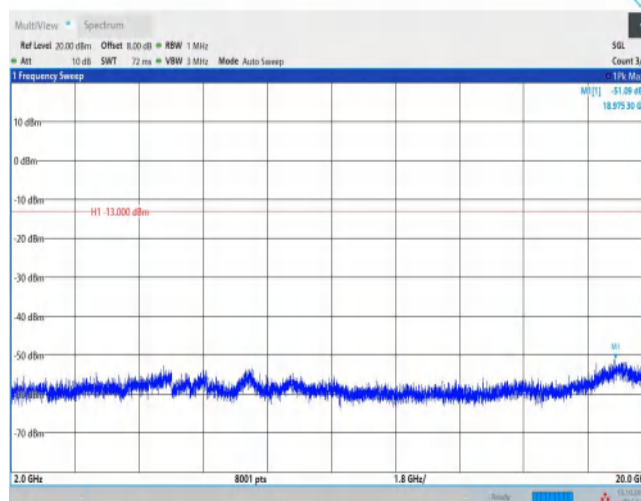


Band66-3MHz-QPSK-132322-1RB#0-Range1:30~1000MHz

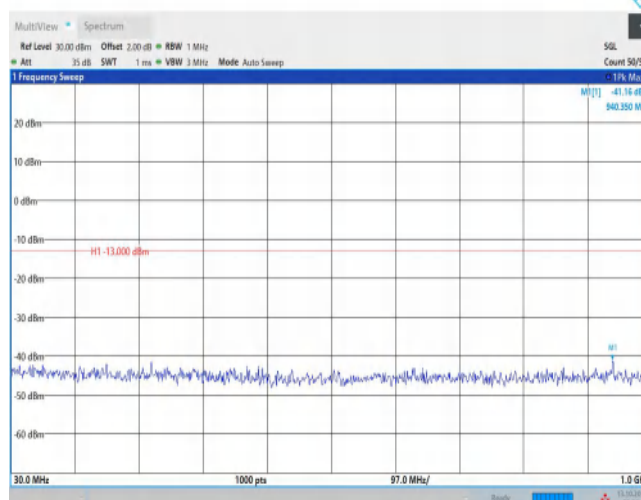





Band66-3MHz-QPSK-132322-1RB#0-Range2:1000~2000MHz

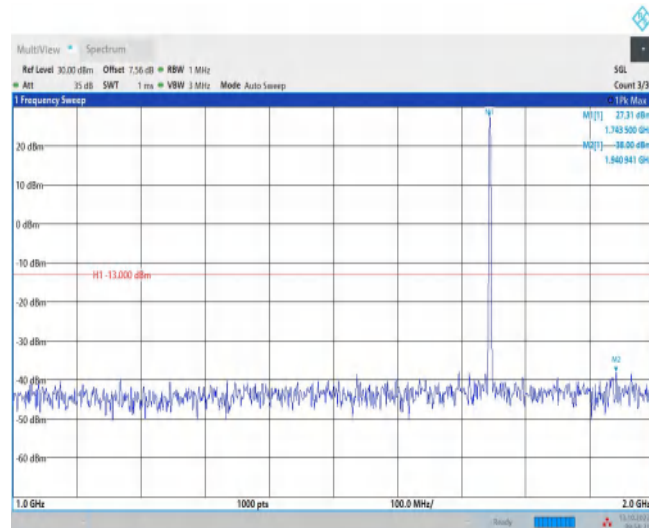


Band66-3MHz-QPSK-132322-1RB#0-Range3:2000~20000MHz

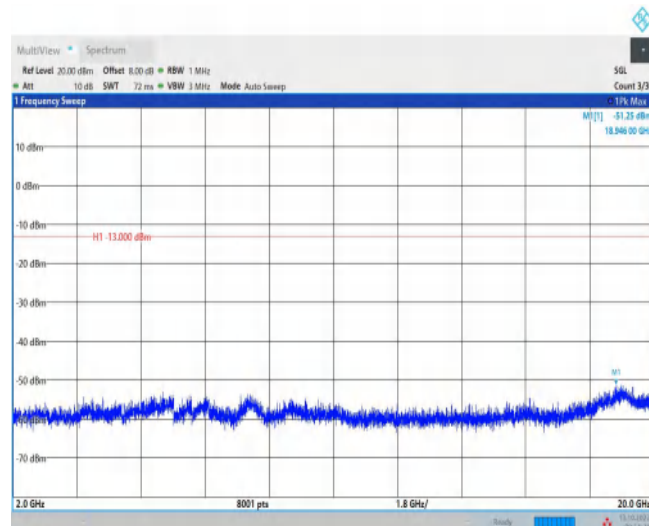


Band66-3MHz-QPSK-132657-1RB#0-Range1:30~1000MHz

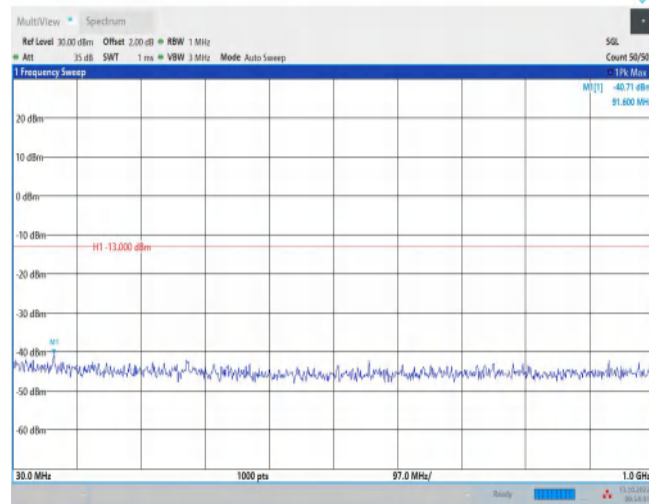

Band66-3MHz-QPSK-132657-1RB#0-Range2:1000~2000MHz

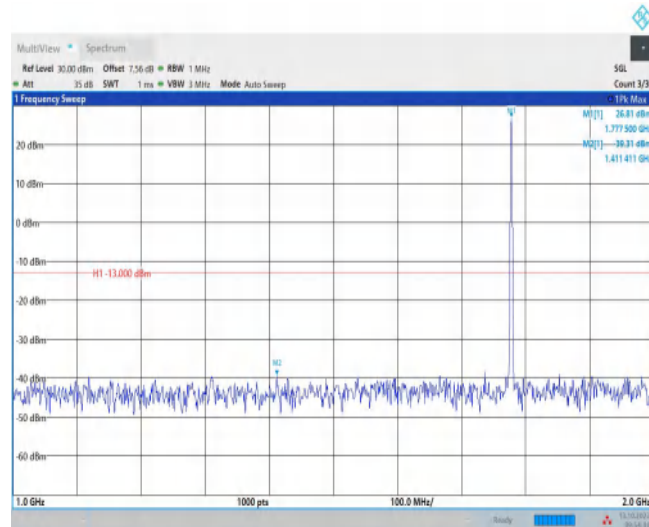


Band66-3MHz-QPSK-132657-1RB#0-Range3:2000~20000MHz

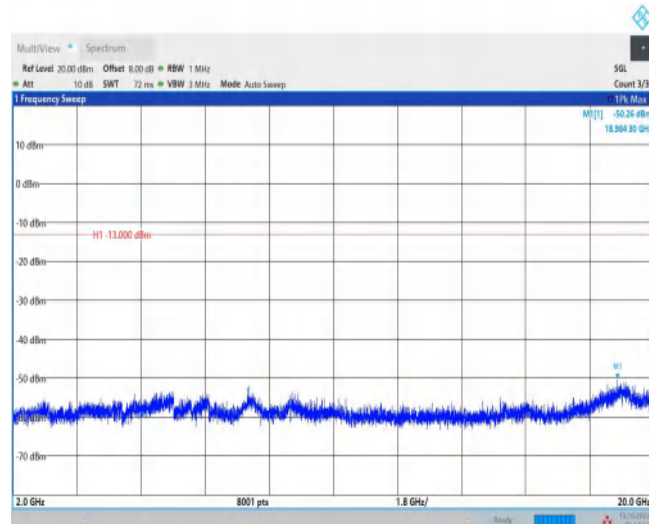





Band66-5MHz-QPSK-131997-1RB#0-Range1:30~1000MHz

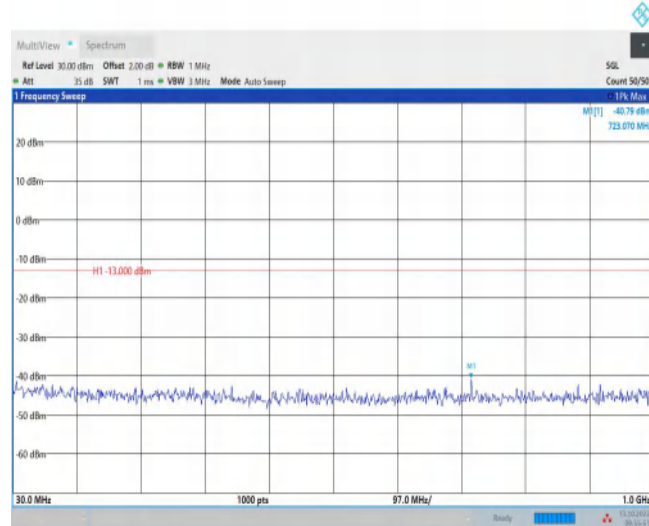


Band66-5MHz-QPSK-131997-1RB#0-Range2:1000~2000MHz

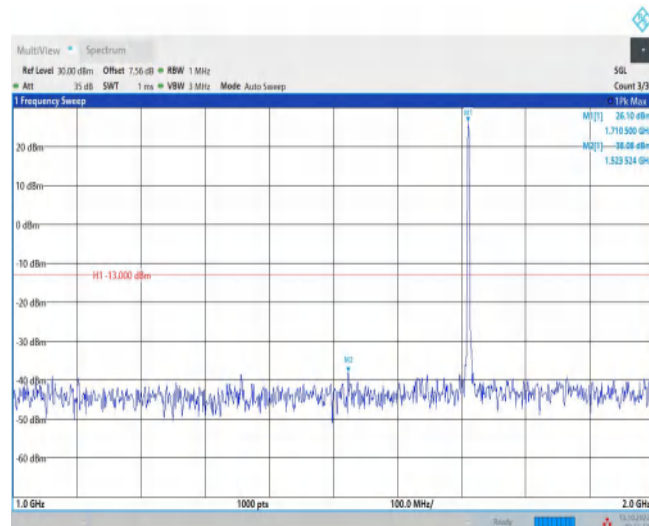


Band66-5MHz-QPSK-131997-1RB#0-Range3:2000~20000MHz

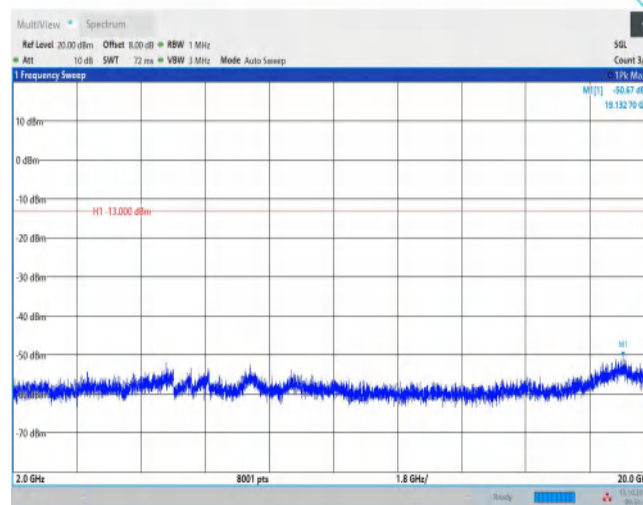

Band66-5MHz-QPSK-132322-1RB#0-Range1:30~1000MHz

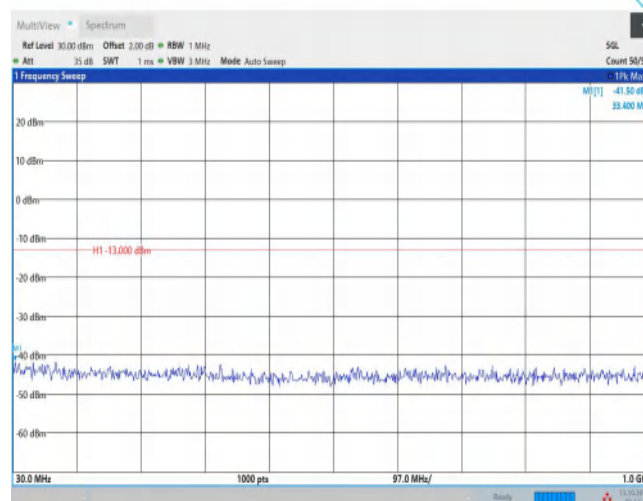

Band66-5MHz-QPSK-132322-1RB#0-Range2:1000~2000MHz

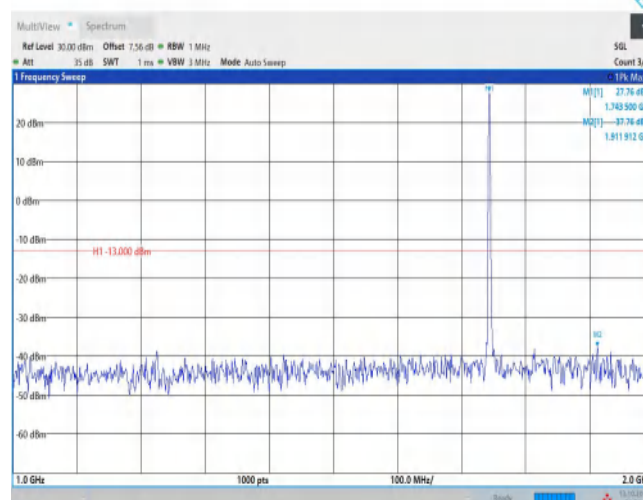




CVC Testing Technology Co., Ltd.


Test Report No.: FCC2022-0064-RF8-A17

Page 112 of 132


Band66-5MHz-QPSK-132322-1RB#0-Range3:2000~20000MHz

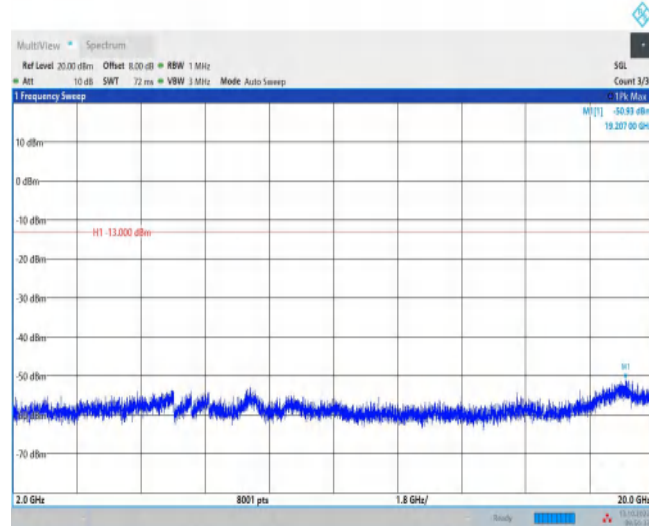


Band66-5MHz-QPSK-132647-1RB#0-Range1:30~1000MHz

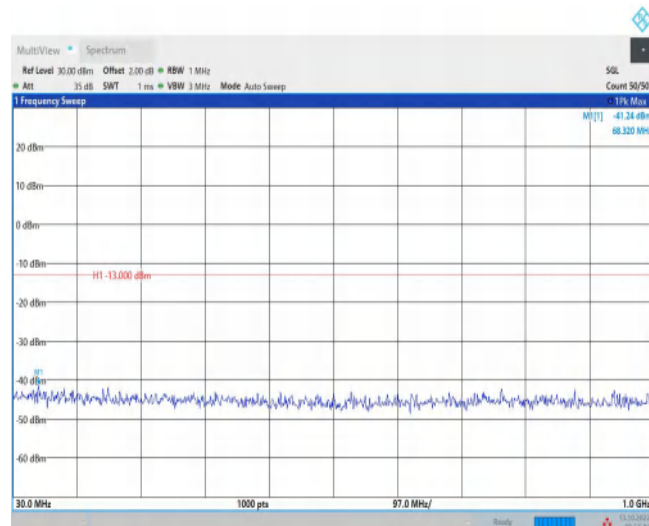


Band66-5MHz-QPSK-132647-1RB#0-Range2:1000~2000MHz

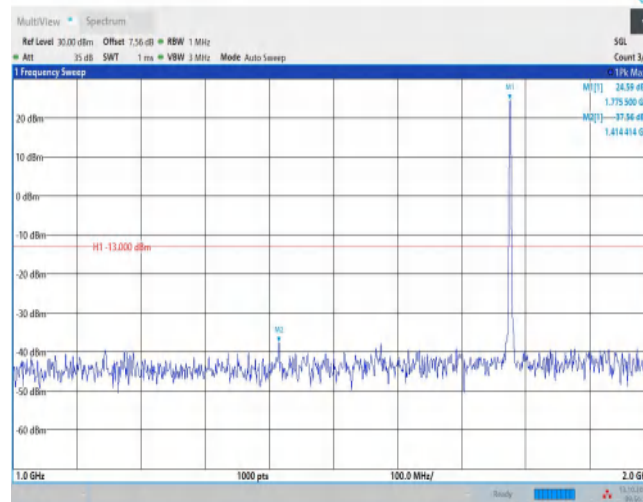


Band66-5MHz-QPSK-132647-1RB#0-Range3:2000~20000MHz

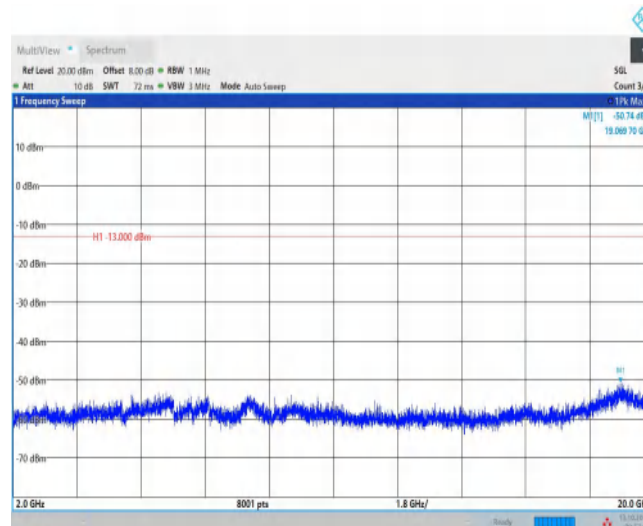


Band66-10MHz-QPSK-132022-1RB#0-Range1:30~1000MHz

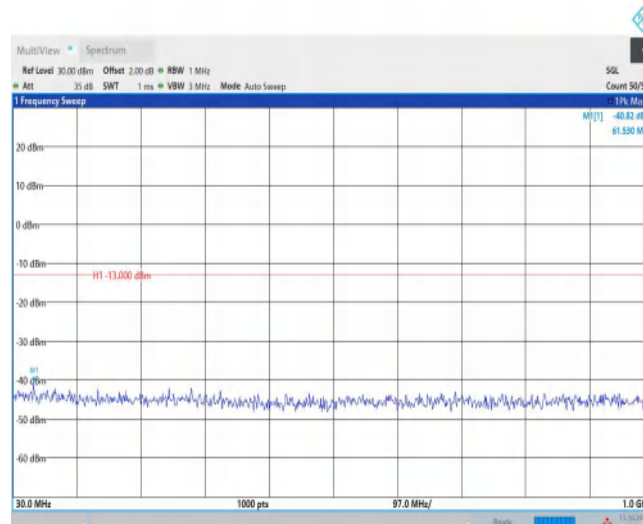


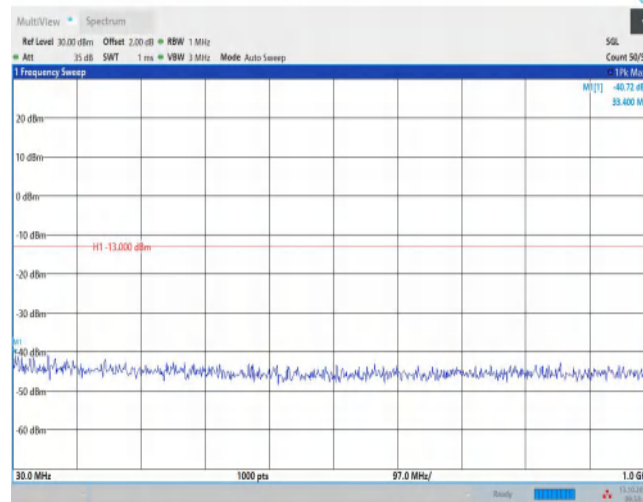

Band66-10MHz-QPSK-132322-1RB#0-Range2:1000~2000MHz

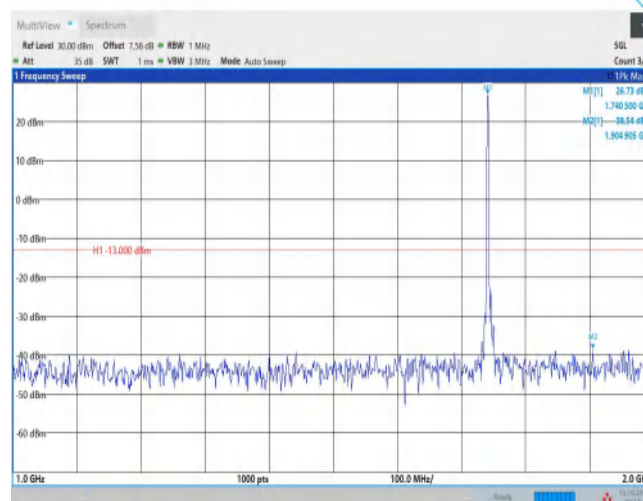


Band66-10MHz-QPSK-132322-1RB#0-Range3:2000~20000MHz

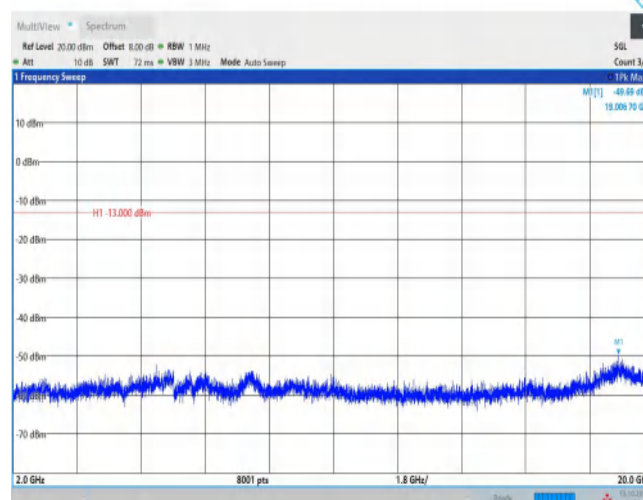





Band66-10MHz-QPSK-132622-1RB#0-Range1:30~1000MHz

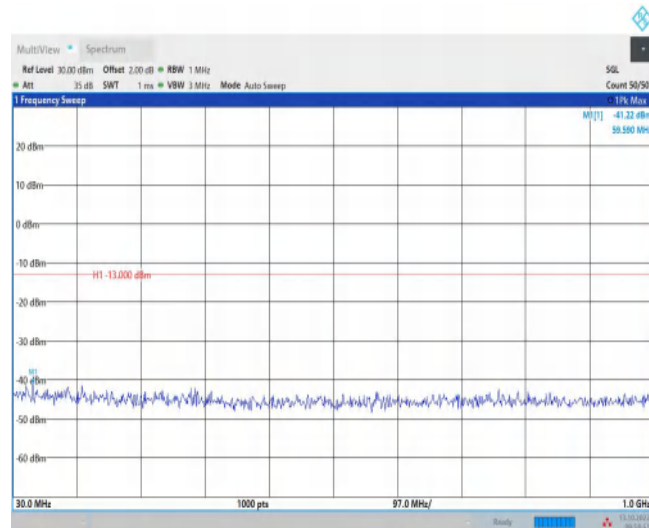


Band66-10MHz-QPSK-132622-1RB#0-Range2:1000~2000MHz

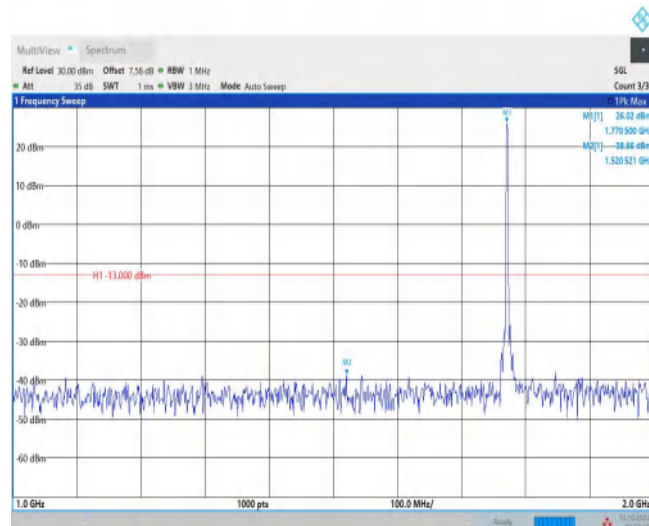


Band66-10MHz-QPSK-132622-1RB#0-Range3:2000~20000MHz

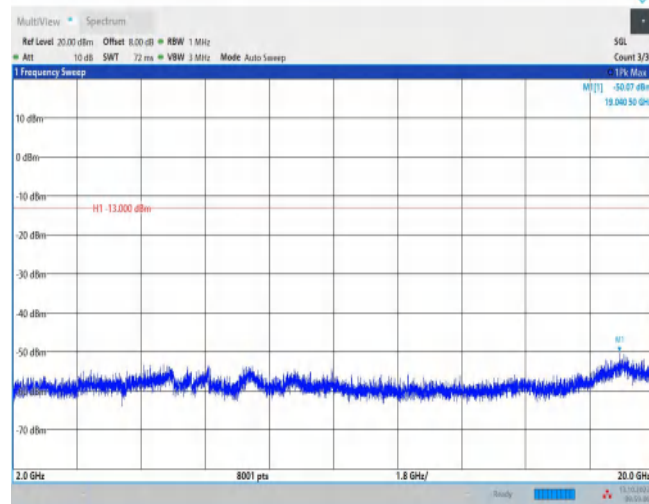

Band66-15MHz-QPSK-132047-1RB#0-Range1:30~1000MHz

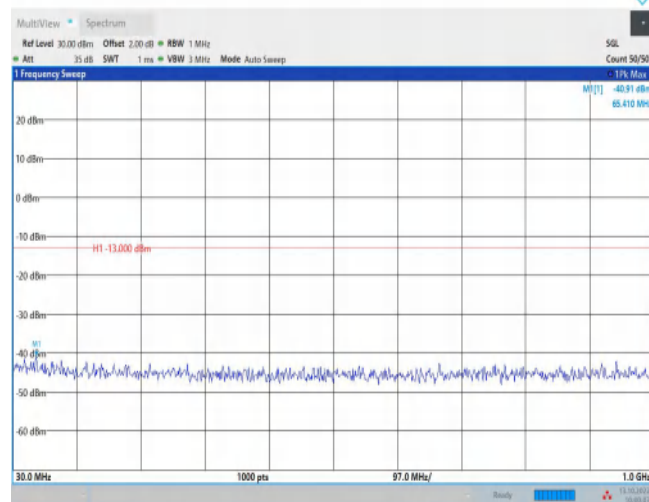


Band66-15MHz-QPSK-132047-1RB#0-Range2:1000~2000MHz

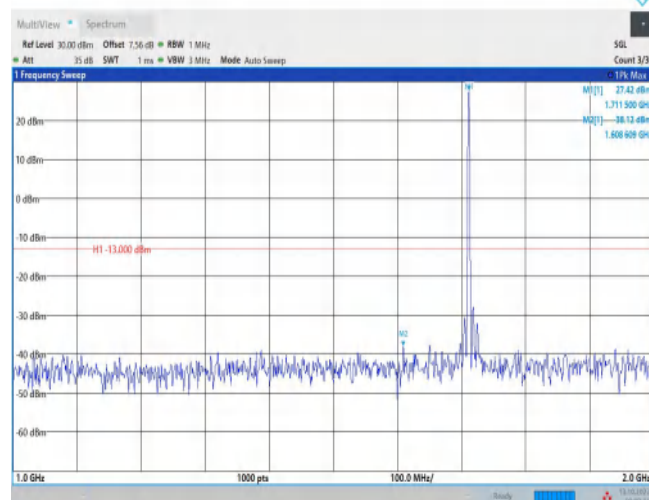





Band66-15MHz-QPSK-132047-1RB#0-Range3:2000~20000MHz

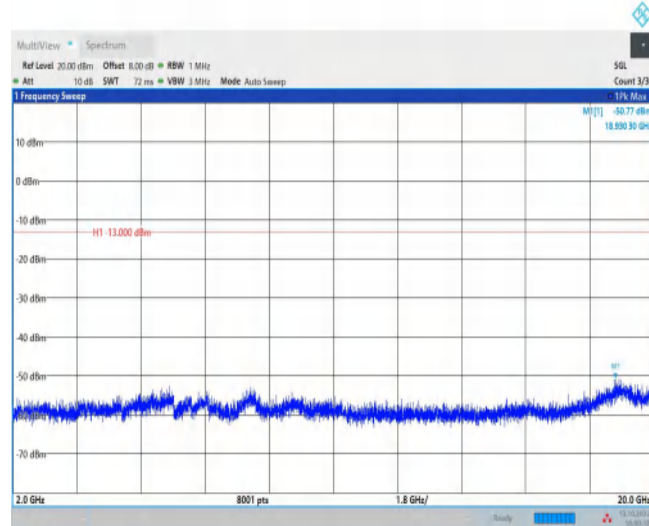


Band66-15MHz-QPSK-132322-1RB#0-Range1:30~1000MHz

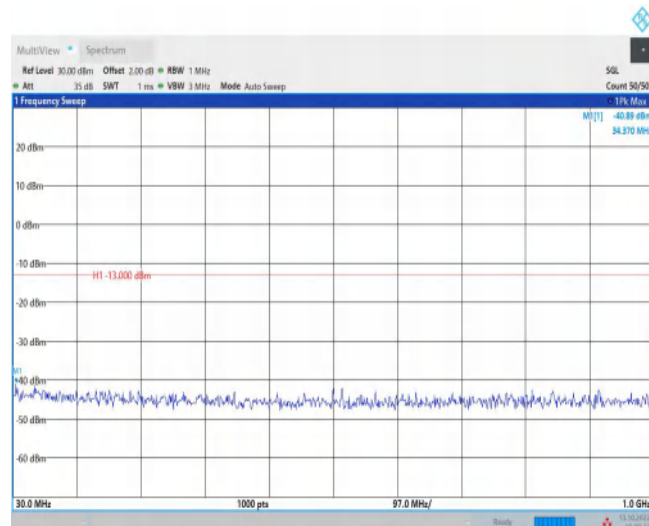


Band66-15MHz-QPSK-132322-1RB#0-Range2:1000~2000MHz

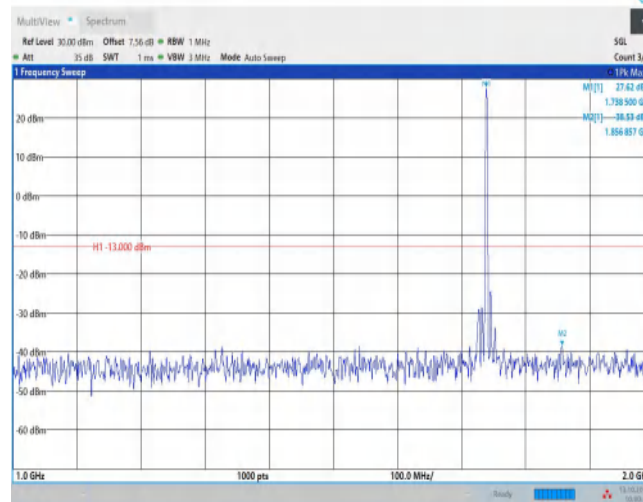


Band66-15MHz-QPSK-132322-1RB#0-Range3:2000~20000MHz

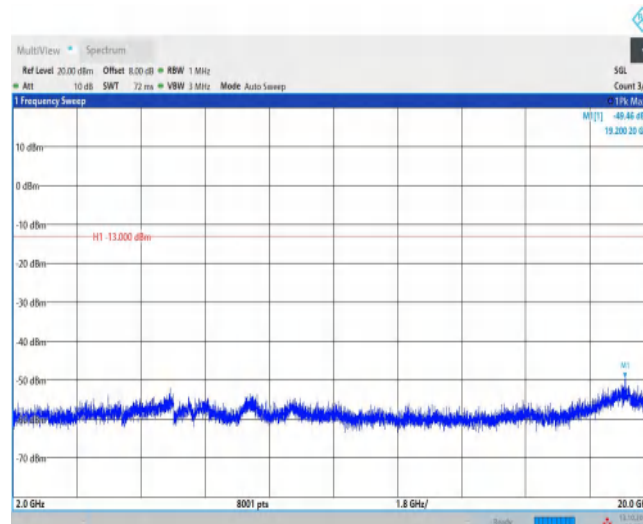


Band66-15MHz-QPSK-132597-1RB#0-Range1:30~1000MHz

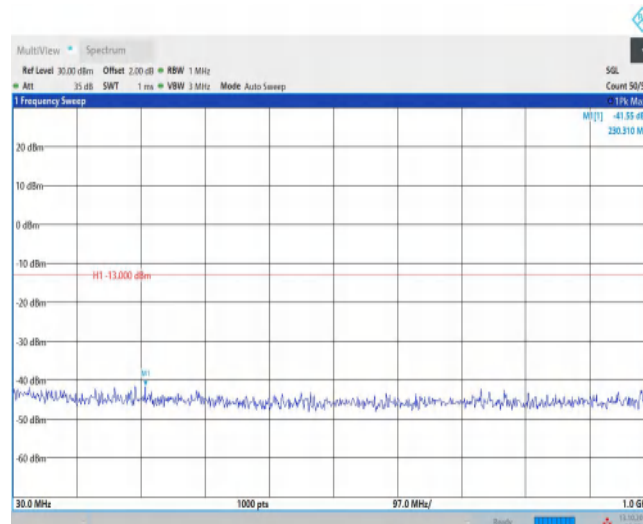


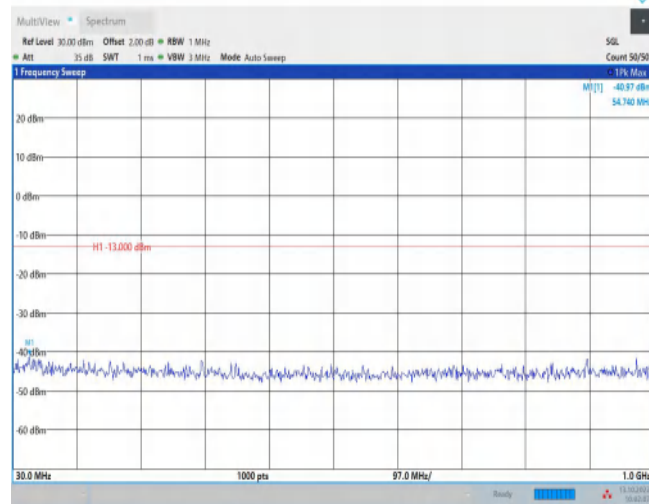

Band66-20MHz-QPSK-132072-1RB#0-Range2:1000~2000MHz

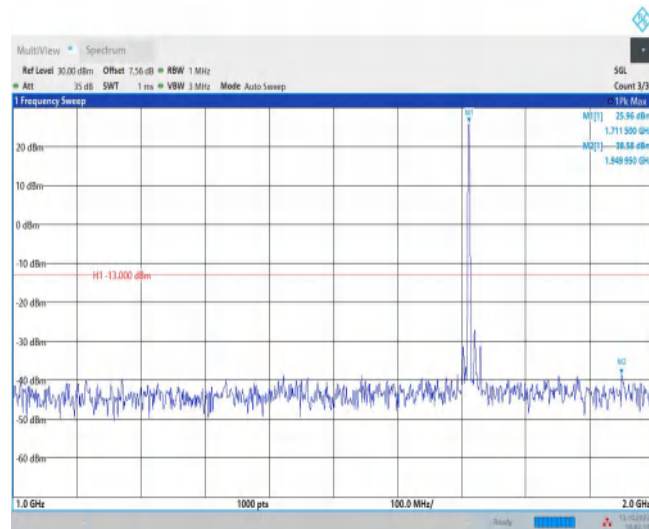


Band66-20MHz-QPSK-132072-1RB#0-Range3:2000~20000MHz

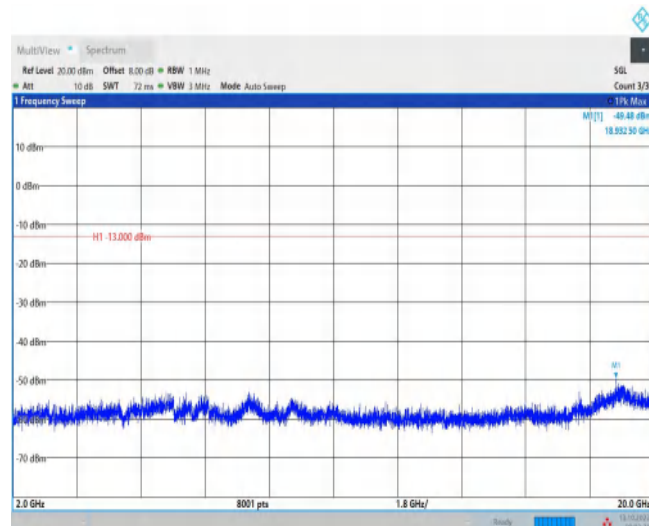





Band66-20MHz-QPSK-132322-1RB#0-Range1:30~1000MHz

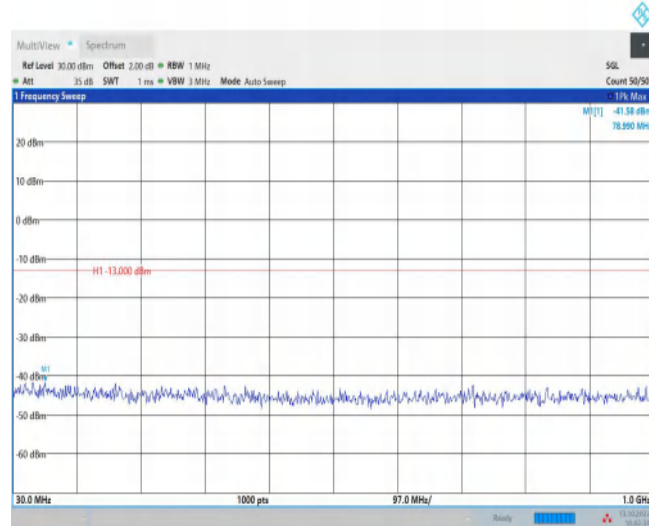


Band66-20MHz-QPSK-132322-1RB#0-Range2:1000~2000MHz

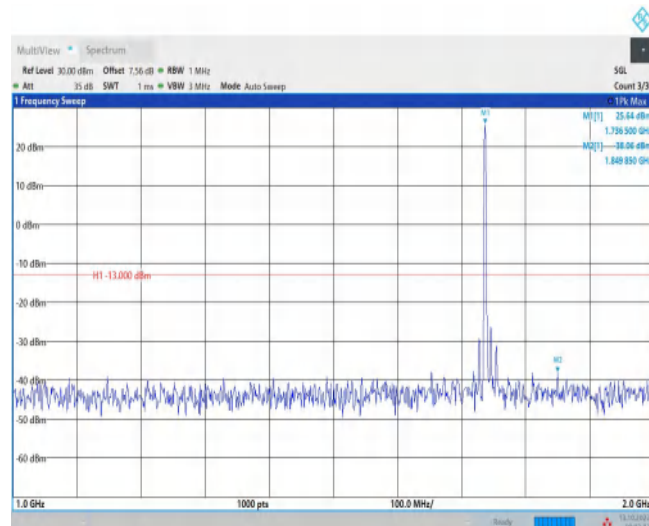


Band66-20MHz-QPSK-132322-1RB#0-Range3:2000~20000MHz

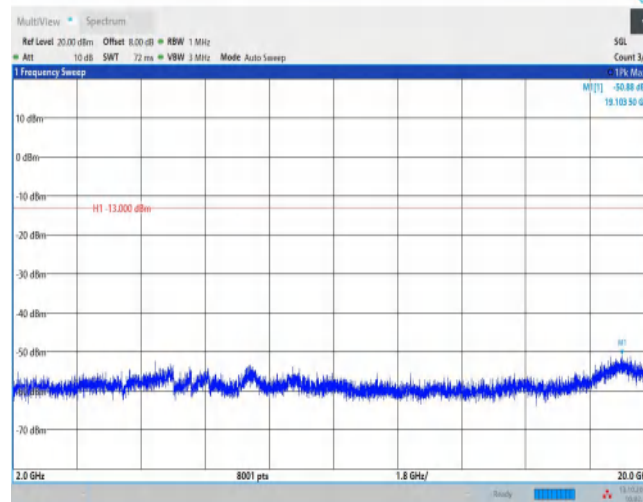

Band66-20MHz-QPSK-132572-1RB#0-Range1:30~1000MHz

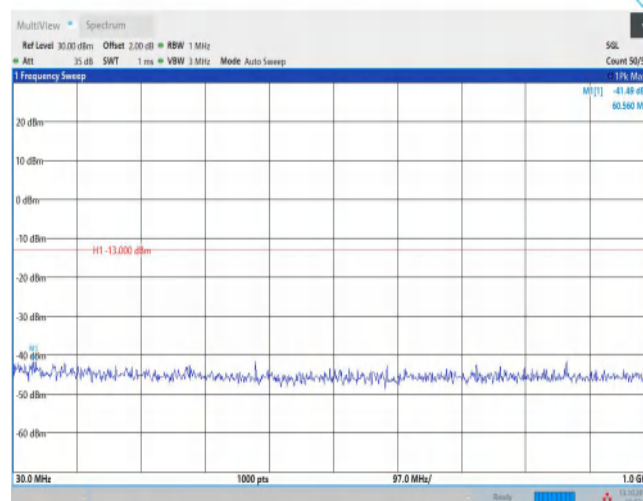


Band66-20MHz-QPSK-132572-1RB#0-Range2:1000~2000MHz

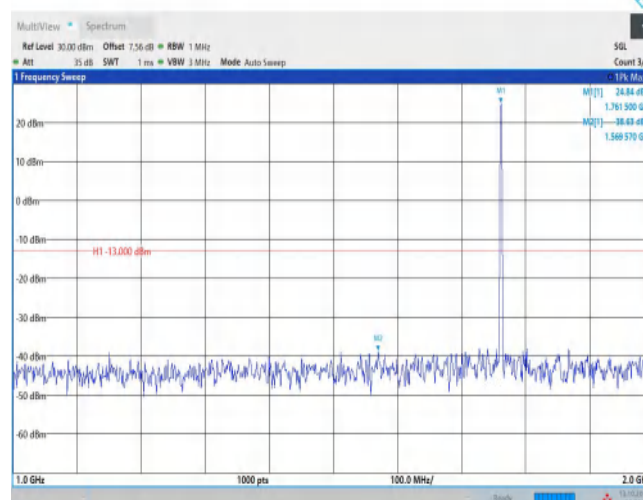



Band66-20MHz-QPSK-132572-1RB#0-Range3:2000~20000MHz

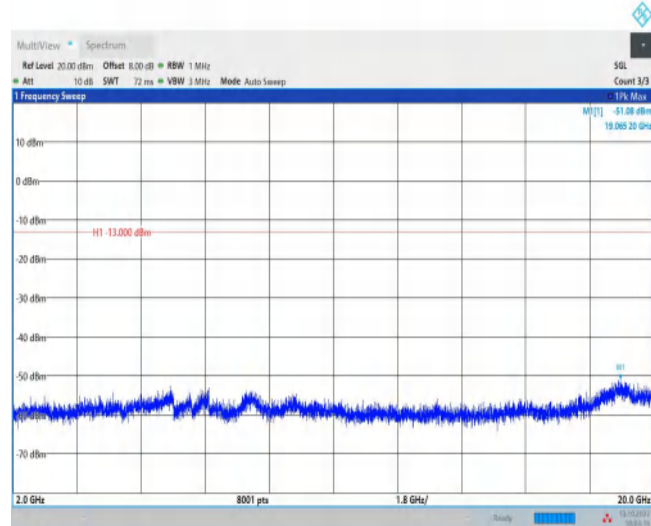



Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	VL	NT	14.04	0.008207	±2.5	PASS
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	VN	NT	18.52	0.010826	±2.5	PASS
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	VH	NT	26.03	0.015216	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	VL	NT	16.20	0.009284	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	VN	NT	20.16	0.011553	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	VH	NT	13.03	0.007467	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	VL	NT	-26.63	-0.014967	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	VN	NT	-29.05	-0.016327	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	VH	NT	-27.11	-0.015236	±2.5	PASS
Band6 6	3MHz	QPSK	13198 7	15RB#0	VL	NT	-2.91	-0.001700	±2.5	PASS
Band6 6	3MHz	QPSK	13198 7	15RB#0	VN	NT	-20.76	-0.012130	±2.5	PASS
Band6 6	3MHz	QPSK	13198 7	15RB#0	VH	NT	-2.09	-0.001221	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	VL	NT	2.26	0.001295	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	VN	NT	-4.58	-0.002625	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	VH	NT	-3.21	-0.001840	±2.5	PASS
Band6 6	3MHz	QPSK	13265 7	15RB#0	VL	NT	-3.35	-0.001884	±2.5	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 126 of 132

Band6 6	3MHz	QPSK	13265 7	15RB#0	VN	NT	-1.73	-0.000973	±2.5	PASS
Band6 6	3MHz	QPSK	13265 7	15RB#0	VH	NT	-2.13	-0.001198	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	VL	NT	-2.26	-0.001320	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	VN	NT	-3.37	-0.001968	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	VH	NT	-3.71	-0.002166	±2.5	PASS
Band6 6	5MHz	QPSK	13232 2	25RB#0	VL	NT	51.45	0.029484	±2.5	PASS
Band6 6	5MHz	QPSK	13232 2	25RB#0	VN	NT	-2.51	-0.001438	±2.5	PASS
Band6 6	5MHz	QPSK	13232 2	25RB#0	VH	NT	2.42	0.001387	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	VL	NT	2.15	0.001210	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	VN	NT	-2.65	-0.001491	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	VH	NT	-4.34	-0.002442	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	VL	NT	-2.79	-0.001627	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	VN	NT	-4.02	-0.002344	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	VH	NT	-3.93	-0.002292	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	VL	NT	2.26	0.001295	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	VN	NT	-2.80	-0.001605	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	VH	NT	1.90	0.001089	±2.5	PASS
Band6 6	10MHz	QPSK	13262 2	50RB#0	VL	NT	4.26	0.002400	±2.5	PASS
Band6 6	10MHz	QPSK	13262 2	50RB#0	VN	NT	-2.88	-0.001623	±2.5	PASS
Band6 6	10MHz	QPSK	13262 2	50RB#0	VH	NT	18.71	0.010541	±2.5	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 127 of 132

Band6 6	15MHz	QPSK	13204 7	75RB#0	VL	NT	1.74	0.001013	±2.5	PASS
Band6 6	15MHz	QPSK	13204 7	75RB#0	VN	NT	-17.14	-0.009980	±2.5	PASS
Band6 6	15MHz	QPSK	13204 7	75RB#0	VH	NT	2.21	0.001287	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	VL	NT	3.77	0.002160	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	VN	NT	-2.30	-0.001318	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	VH	NT	4.03	0.002309	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	VL	NT	-3.83	-0.002161	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	VN	NT	-3.00	-0.001693	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	VH	NT	-17.60	-0.009929	±2.5	PASS
Band6 6	20MHz	QPSK	13207 2	100RB#0	VL	NT	-3.26	-0.001895	±2.5	PASS
Band6 6	20MHz	QPSK	13207 2	100RB#0	VN	NT	-2.39	-0.001390	±2.5	PASS
Band6 6	20MHz	QPSK	13207 2	100RB#0	VH	NT	-3.45	-0.002006	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	VL	NT	-4.25	-0.002436	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	VN	NT	-3.44	-0.001971	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	VH	NT	-3.49	-0.002000	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	VL	NT	20.94	0.011831	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	VN	NT	-2.33	-0.001316	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	VH	NT	-3.39	-0.001915	±2.5	PASS

Temperature



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 128 of 132

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	NV	-30	20.73	0.012118	±2.5	PASS
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	NV	-20	22.13	0.012936	±2.5	PASS
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	NV	0	16.99	0.009932	±2.5	PASS
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	NV	10	19.11	0.011171	±2.5	PASS
Band6 6	1.4MHz	QPSK	13197 9	6RB#0	NV	20	25.13	0.014690	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	NV	-30	9.13	0.005232	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	NV	-20	7.87	0.004510	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	NV	0	9.93	0.005691	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	NV	10	9.93	0.005691	±2.5	PASS
Band6 6	1.4MHz	QPSK	13232 2	6RB#0	NV	20	10.76	0.006166	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	NV	-30	-20.89	-0.011741	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	NV	-20	-22.20	-0.012477	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	NV	0	-17.38	-0.009768	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	NV	10	-19.34	-0.010869	±2.5	PASS
Band6 6	1.4MHz	QPSK	13266 5	6RB#0	NV	20	-14.94	-0.008397	±2.5	PASS
Band6 6	3MHz	QPSK	13198 7	15RB#0	NV	-30	-4.71	-0.002752	±2.5	PASS
Band6 6	3MHz	QPSK	13198 7	15RB#0	NV	-20	-3.60	-0.002103	±2.5	PASS
Band6 6	3MHz	QPSK	13198 7	15RB#0	NV	0	-3.37	-0.001969	±2.5	PASS
Band6 6	3MHz	QPSK	13198 7	15RB#0	NV	10	-4.24	-0.002477	±2.5	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 129 of 132

Band6 6	3MHz	QPSK	13198 7	15RB#0	NV	20	-21.83	-0.012755	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	NV	-30	-3.88	-0.002223	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	NV	-20	1.79	0.001026	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	NV	0	-4.71	-0.002699	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	NV	10	-2.97	-0.001702	±2.5	PASS
Band6 6	3MHz	QPSK	13232 2	15RB#0	NV	20	2.79	0.001599	±2.5	PASS
Band6 6	3MHz	QPSK	13265 7	15RB#0	NV	-30	-2.83	-0.001591	±2.5	PASS
Band6 6	3MHz	QPSK	13265 7	15RB#0	NV	-20	-2.22	-0.001248	±2.5	PASS
Band6 6	3MHz	QPSK	13265 7	15RB#0	NV	0	15.63	0.008788	±2.5	PASS
Band6 6	3MHz	QPSK	13265 7	15RB#0	NV	10	-5.16	-0.002901	±2.5	PASS
Band6 6	3MHz	QPSK	13265 7	15RB#0	NV	20	-2.94	-0.001653	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	NV	-30	-2.65	-0.001547	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	NV	-20	-3.73	-0.002178	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	NV	0	-3.22	-0.001880	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	NV	10	-5.00	-0.002920	±2.5	PASS
Band6 6	5MHz	QPSK	13199 7	25RB#0	NV	20	-13.29	-0.007761	±2.5	PASS
Band6 6	5MHz	QPSK	13232 2	25RB#0	NV	-30	-3.09	-0.001771	±2.5	PASS
Band6 6	5MHz	QPSK	13232 2	25RB#0	NV	-20	-3.43	-0.001966	±2.5	PASS
Band6 6	5MHz	QPSK	13232 2	25RB#0	NV	0	5.19	0.002974	±2.5	PASS
Band6 6	5MHz	QPSK	13232 2	25RB#0	NV	10	-3.34	-0.001914	±2.5	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 130 of 132

Band6 6	5MHz	QPSK	13232 2	25RB#0	NV	20	-4.84	-0.002774	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	NV	-30	3.39	0.001907	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	NV	-20	-2.79	-0.001570	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	NV	0	-11.30	-0.006357	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	NV	10	3.98	0.002239	±2.5	PASS
Band6 6	5MHz	QPSK	13264 7	25RB#0	NV	20	-3.68	-0.002070	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	NV	-30	-3.57	-0.002082	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	NV	-20	-3.03	-0.001767	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	NV	0	-4.13	-0.002408	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	NV	10	3.51	0.002047	±2.5	PASS
Band6 6	10MHz	QPSK	13202 2	50RB#0	NV	20	-2.59	-0.001510	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	NV	-30	2.76	0.001582	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	NV	-20	-3.29	-0.001885	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	NV	0	1.76	0.001009	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	NV	10	2.65	0.001519	±2.5	PASS
Band6 6	10MHz	QPSK	13232 2	50RB#0	NV	20	1.69	0.000968	±2.5	PASS
Band6 6	10MHz	QPSK	13262 2	50RB#0	NV	-30	1.59	0.000896	±2.5	PASS
Band6 6	10MHz	QPSK	13262 2	50RB#0	NV	-20	-3.18	-0.001792	±2.5	PASS
Band6 6	10MHz	QPSK	13262 2	50RB#0	NV	0	-2.43	-0.001369	±2.5	PASS
Band6 6	10MHz	QPSK	13262 2	50RB#0	NV	10	-3.37	-0.001899	±2.5	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 131 of 132

Band6 6	10MHz	QPSK	13262 2	50RB#0	NV	20	-2.26	-0.001273	±2.5	PASS
Band6 6	15MHz	QPSK	13204 7	75RB#0	NV	-30	-2.53	-0.001473	±2.5	PASS
Band6 6	15MHz	QPSK	13204 7	75RB#0	NV	-20	-2.24	-0.001304	±2.5	PASS
Band6 6	15MHz	QPSK	13204 7	75RB#0	NV	0	-3.62	-0.002108	±2.5	PASS
Band6 6	15MHz	QPSK	13204 7	75RB#0	NV	10	-3.13	-0.001822	±2.5	PASS
Band6 6	15MHz	QPSK	13204 7	75RB#0	NV	20	-4.05	-0.002358	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	NV	-30	-2.40	-0.001375	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	NV	-20	-2.43	-0.001393	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	NV	0	2.36	0.001352	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	NV	10	-2.34	-0.001341	±2.5	PASS
Band6 6	15MHz	QPSK	13232 2	75RB#0	NV	20	1.58	0.000905	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	NV	-30	-3.35	-0.001890	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	NV	-20	-2.16	-0.001219	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	NV	0	-2.67	-0.001506	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	NV	10	2.25	0.001269	±2.5	PASS
Band6 6	15MHz	QPSK	13259 7	75RB#0	NV	20	-2.16	-0.001219	±2.5	PASS
Band6 6	20MHz	QPSK	13207 2	100RB#0	NV	-30	-2.14	-0.001244	±2.5	PASS
Band6 6	20MHz	QPSK	13207 2	100RB#0	NV	-20	-2.40	-0.001395	±2.5	PASS
Band6 6	20MHz	QPSK	13207 2	100RB#0	NV	0	-3.28	-0.001907	±2.5	PASS
Band6 6	20MHz	QPSK	13207 2	100RB#0	NV	10	-4.40	-0.002558	±2.5	PASS



CVC Testing Technology Co., Ltd.

Test Report No.: FCC2022-0064-RF8-A17

Page 132 of 132

Band6 6	20MHz	QPSK	13207 2	100RB#0	NV	20	-5.06	-0.002942	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	NV	-30	-2.12	-0.001215	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	NV	-20	2.26	0.001295	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	NV	0	-2.01	-0.001152	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	NV	10	2.10	0.001203	±2.5	PASS
Band6 6	20MHz	QPSK	13232 2	100RB#0	NV	20	-2.00	-0.001146	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	NV	-30	-2.32	-0.001311	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	NV	-20	-4.20	-0.002373	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	NV	0	-7.12	-0.004023	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	NV	10	-2.99	-0.001689	±2.5	PASS
Band6 6	20MHz	QPSK	13257 2	100RB#0	NV	20	-3.01	-0.001701	±2.5	PASS