




11N20SISO_AntB_5745_1000~40000

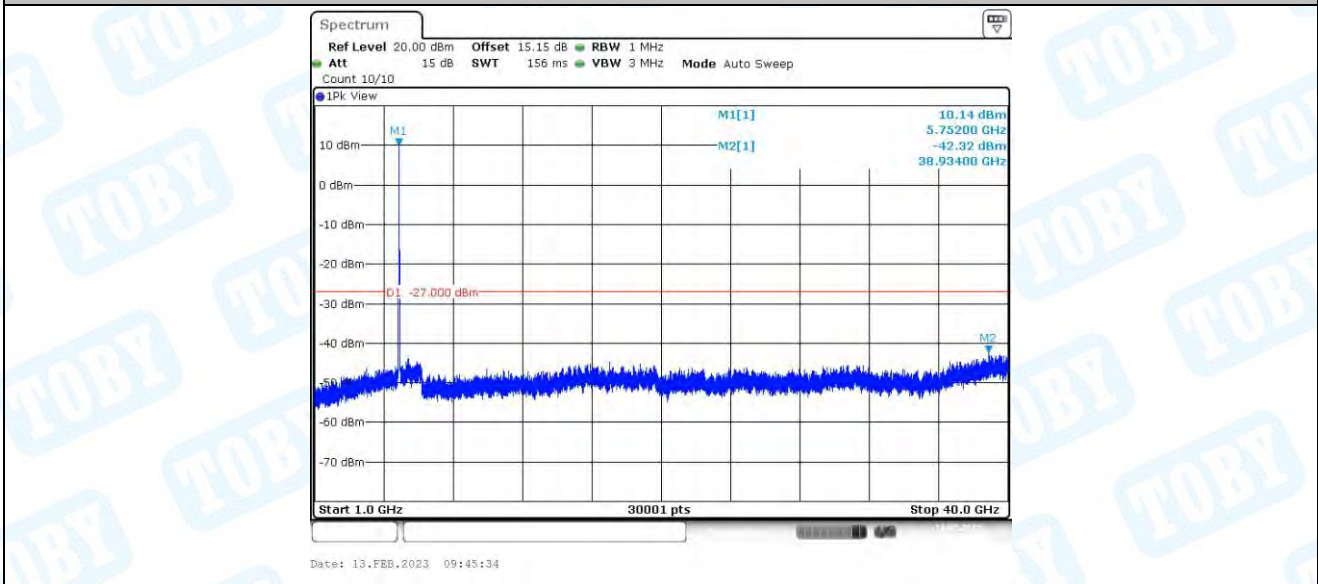


11N20SISO_AntB_5785_30~1000

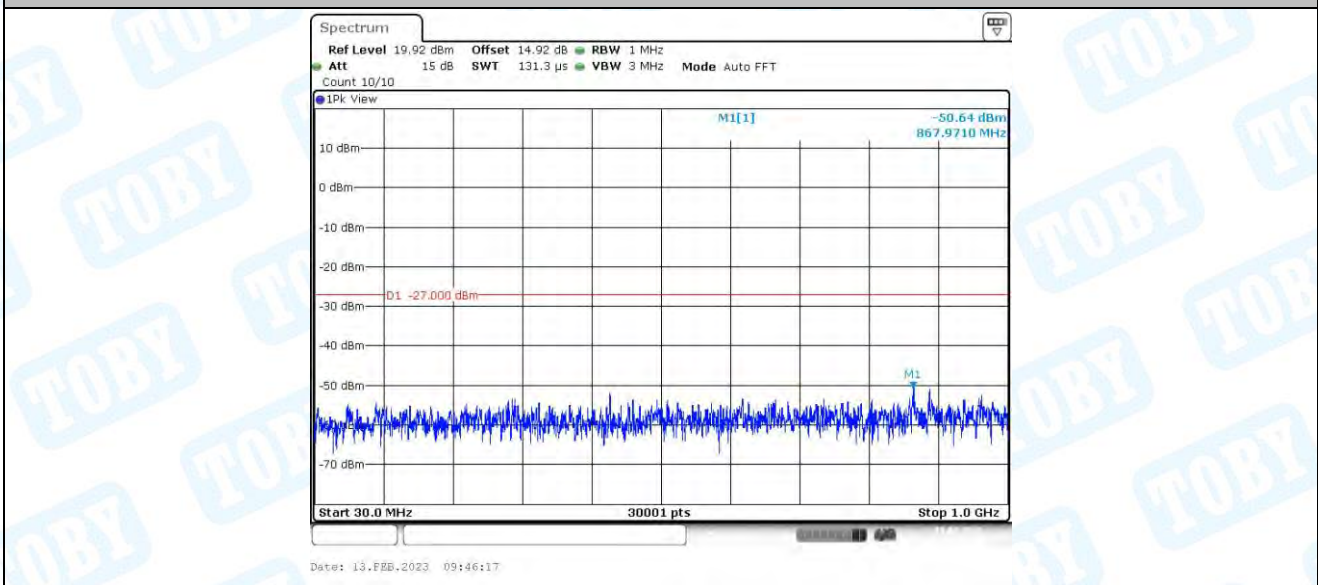


11N20SISO_AntB_5785_1000~40000

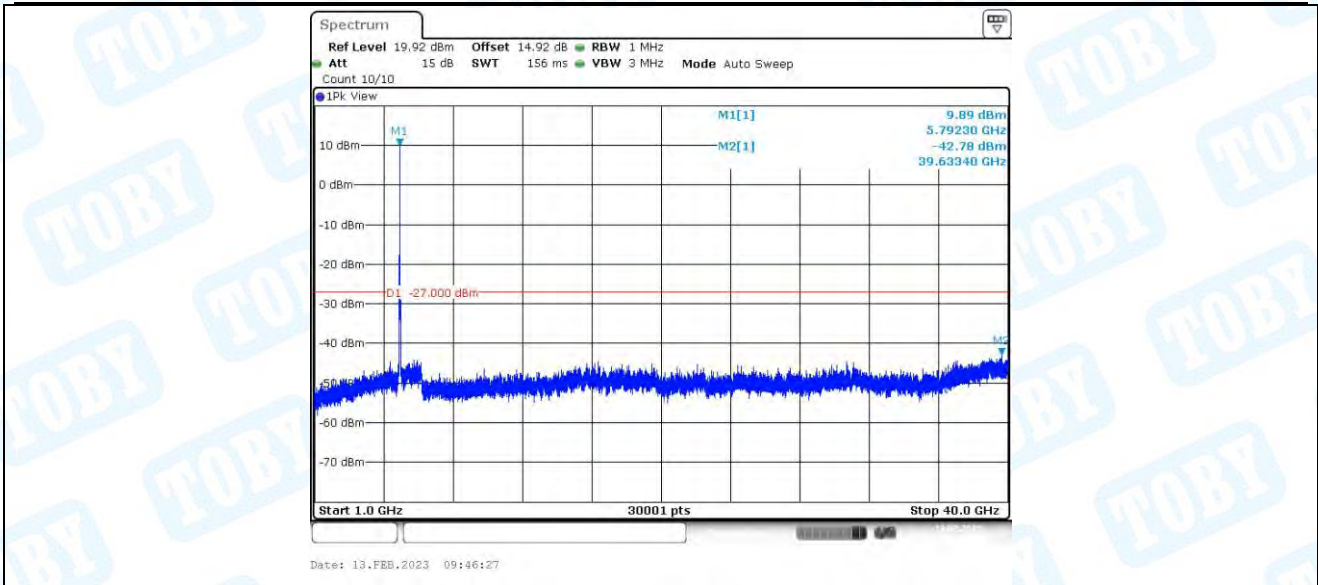


11N20SISO_AntB_5825_30~1000

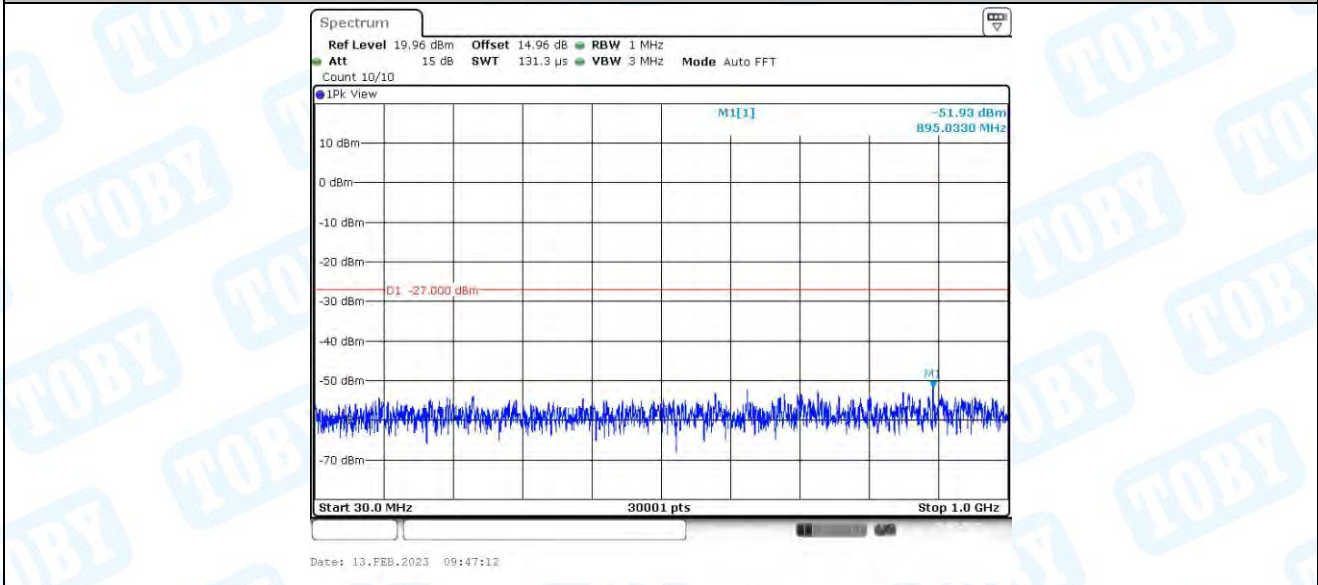


11N20SISO_AntB_5825_1000~40000

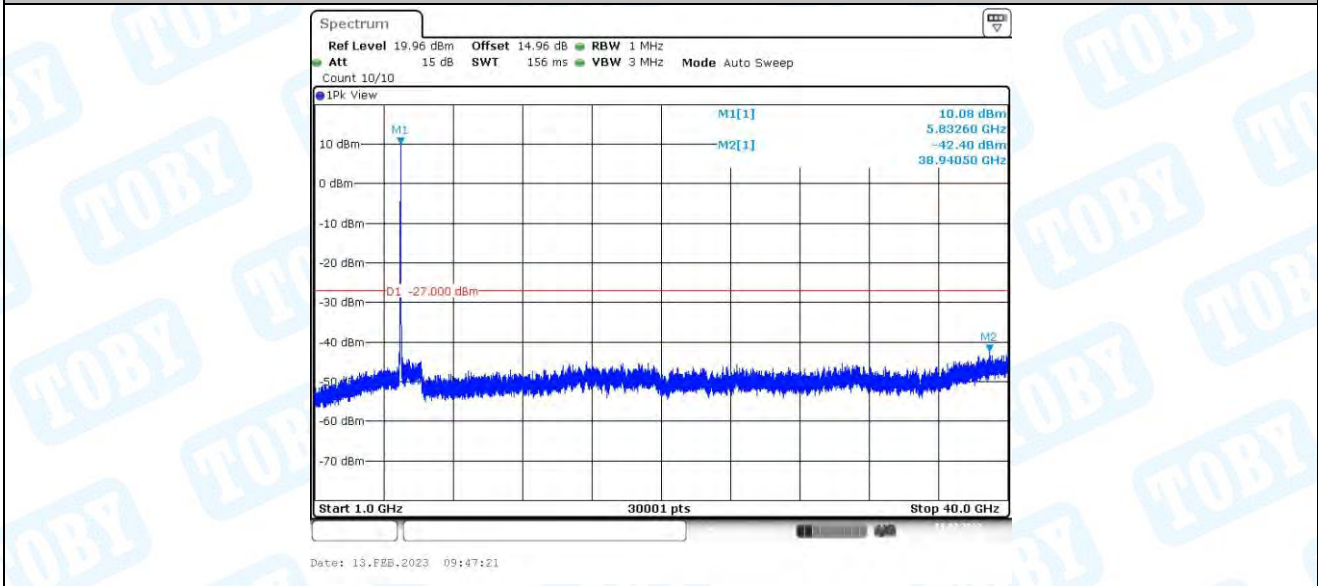


11N40SISO_AntB_5190_30~1000

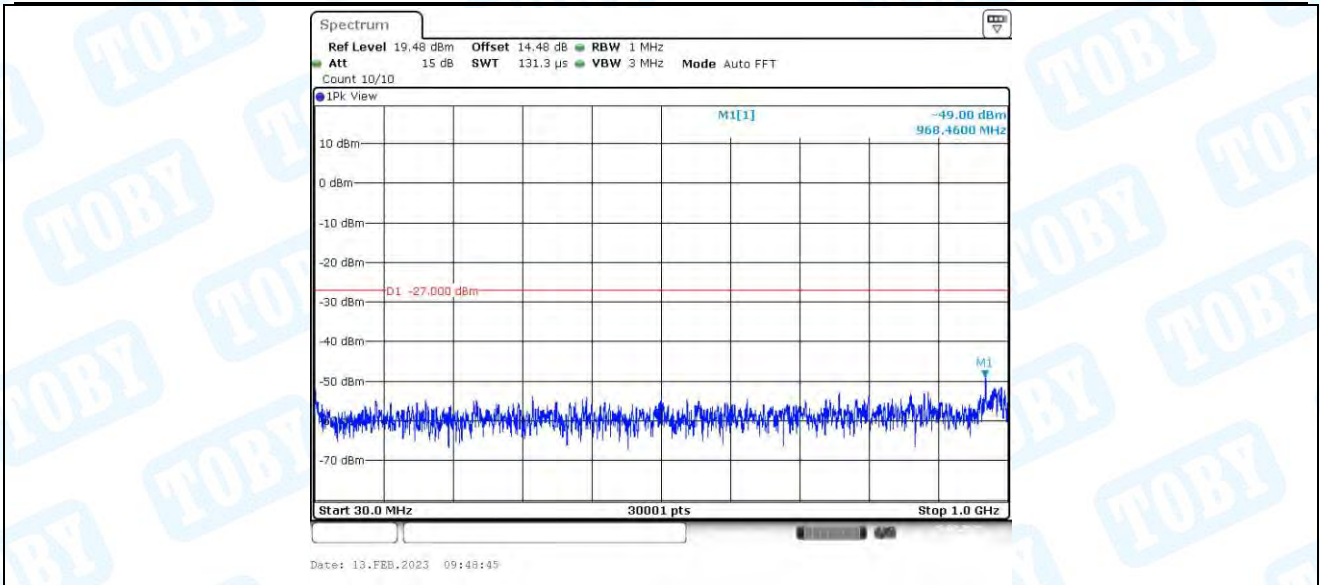




11N40SISO_AntB_5190_1000~40000

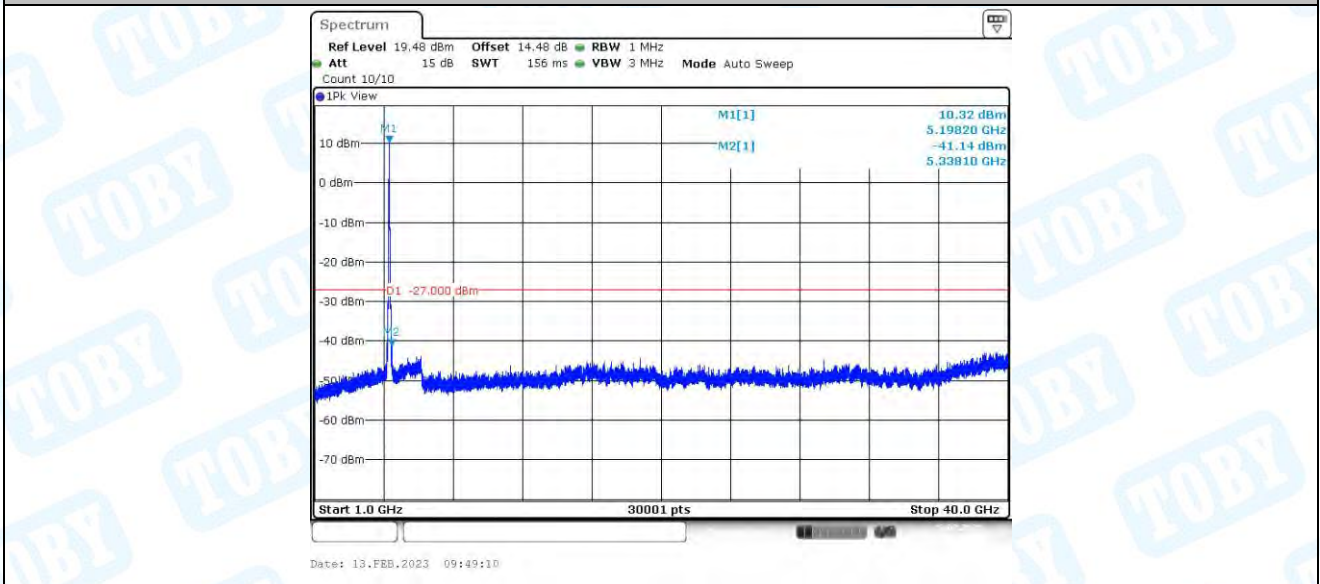


11N40SISO_AntB_5230_30~1000

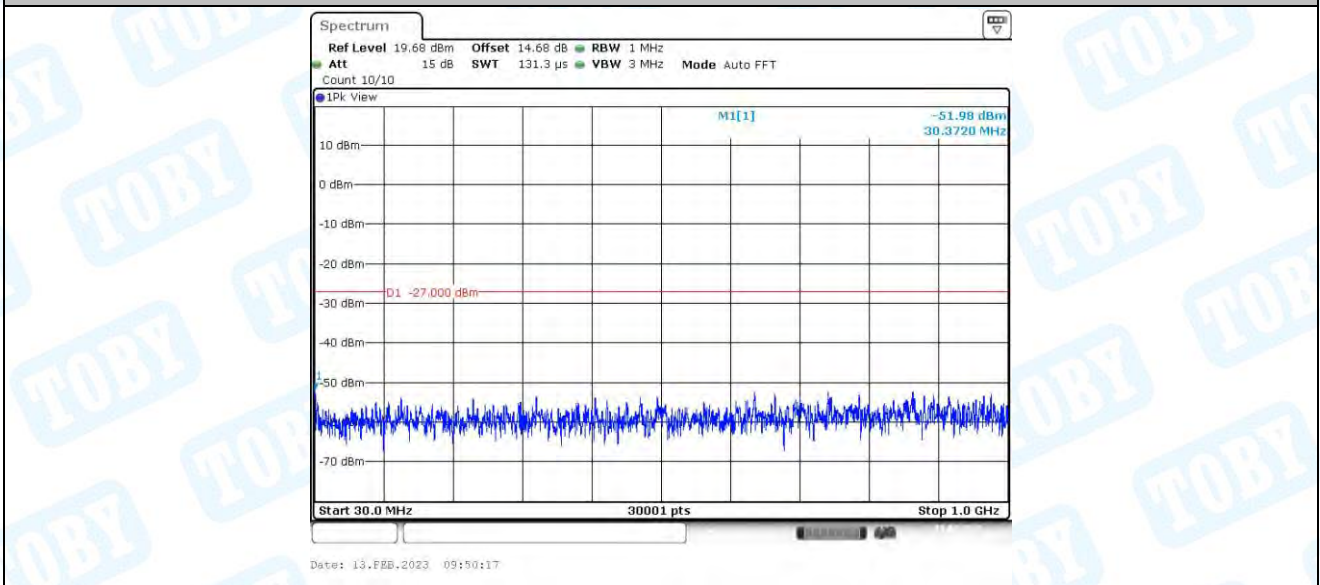


11N40SISO_AntB_5230_1000~40000

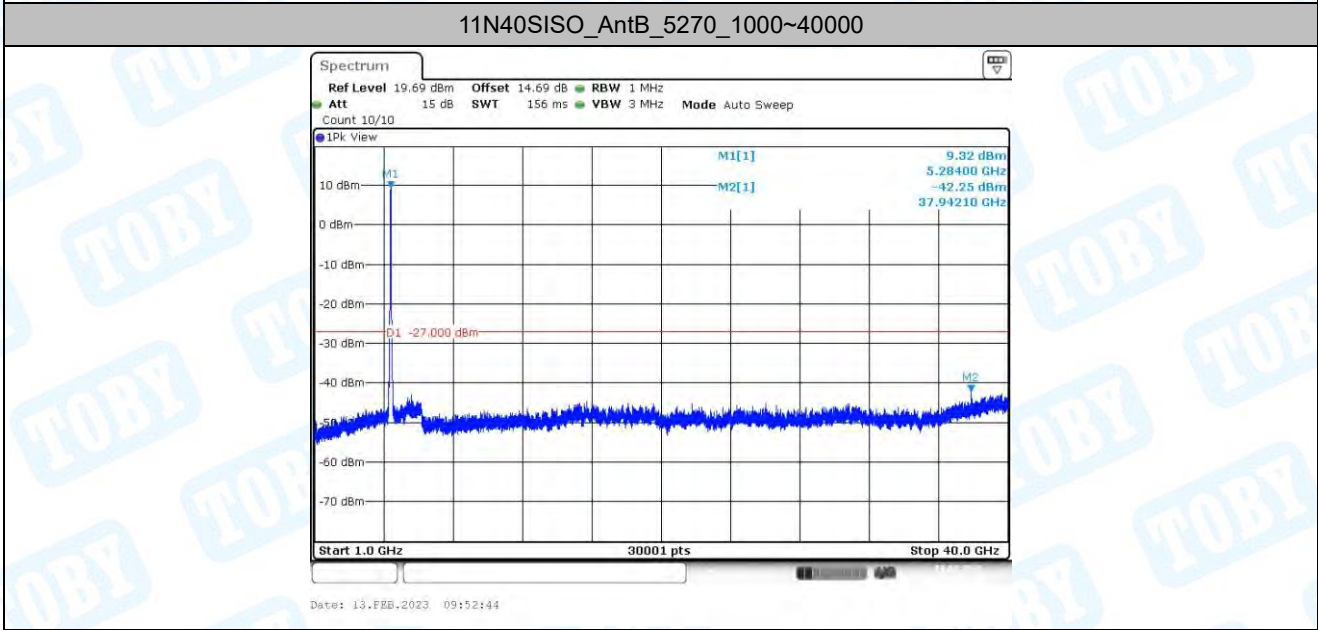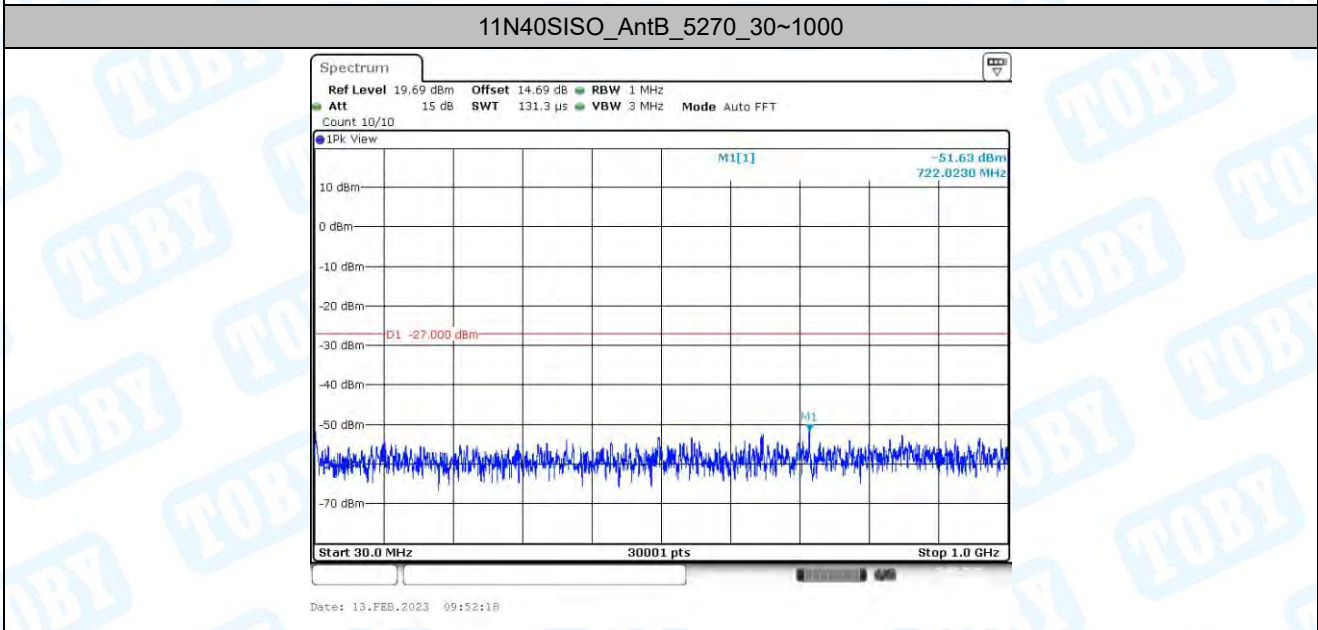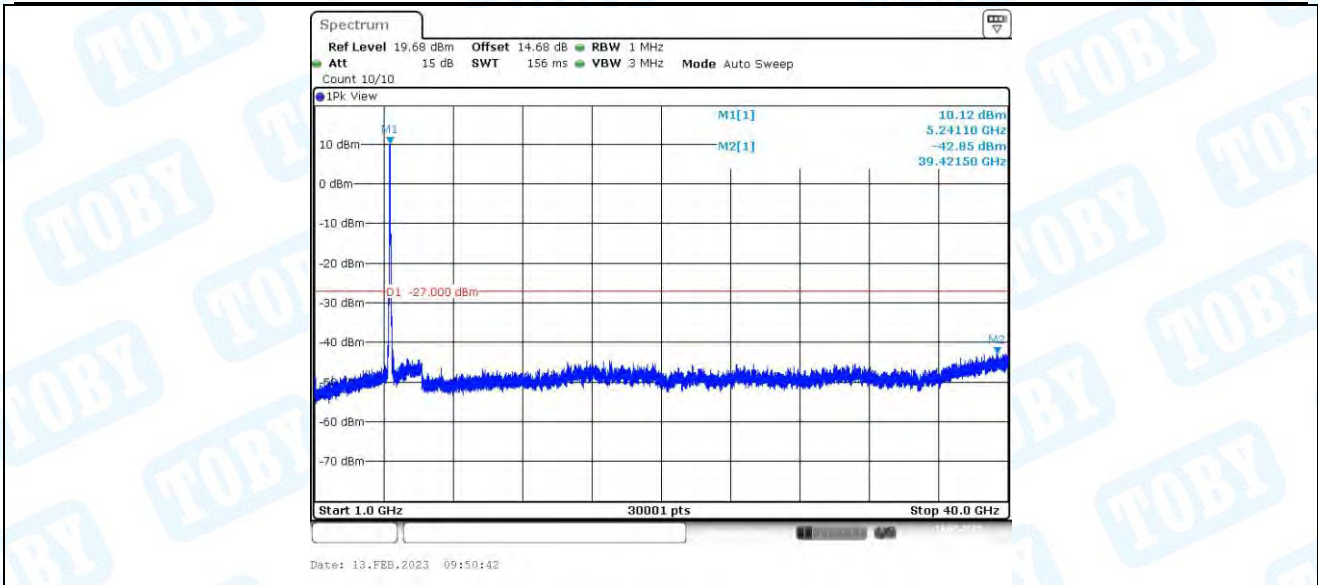


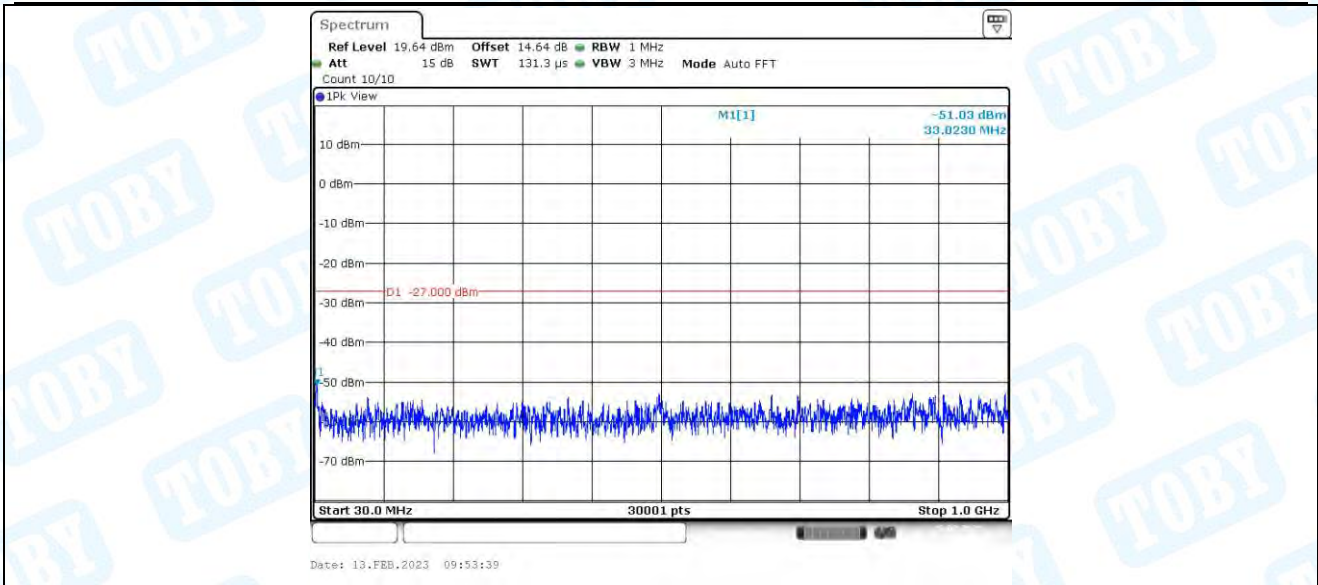


11N40SISO_AntB_5310_1000~40000

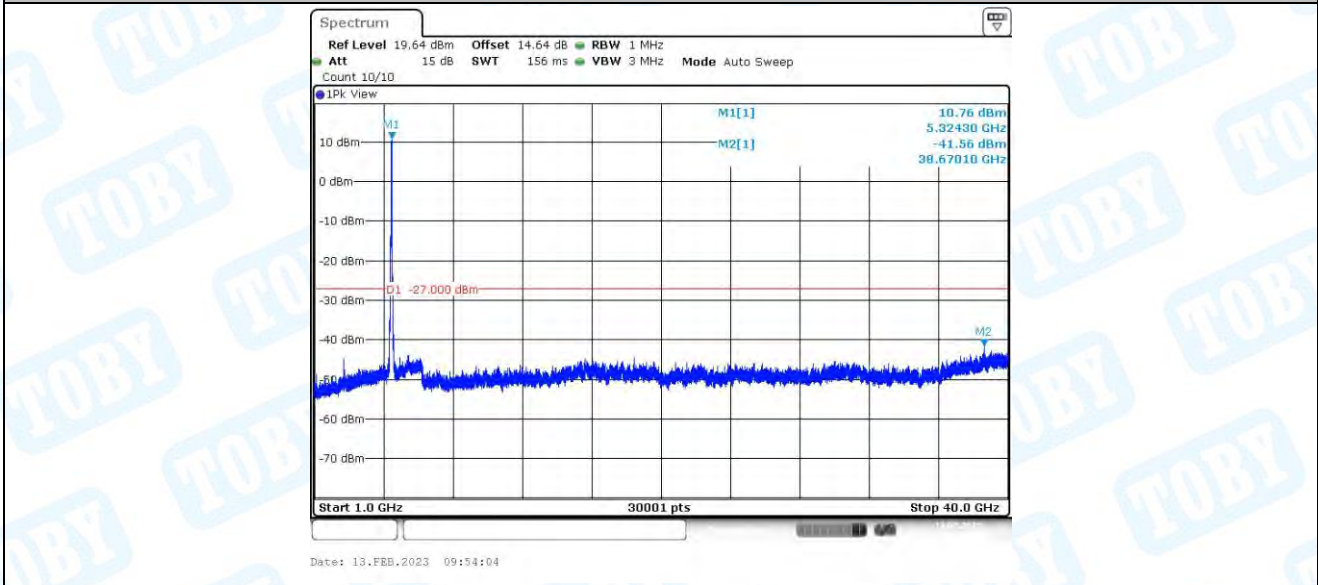


11N40SISO_AntB_5510_30~1000

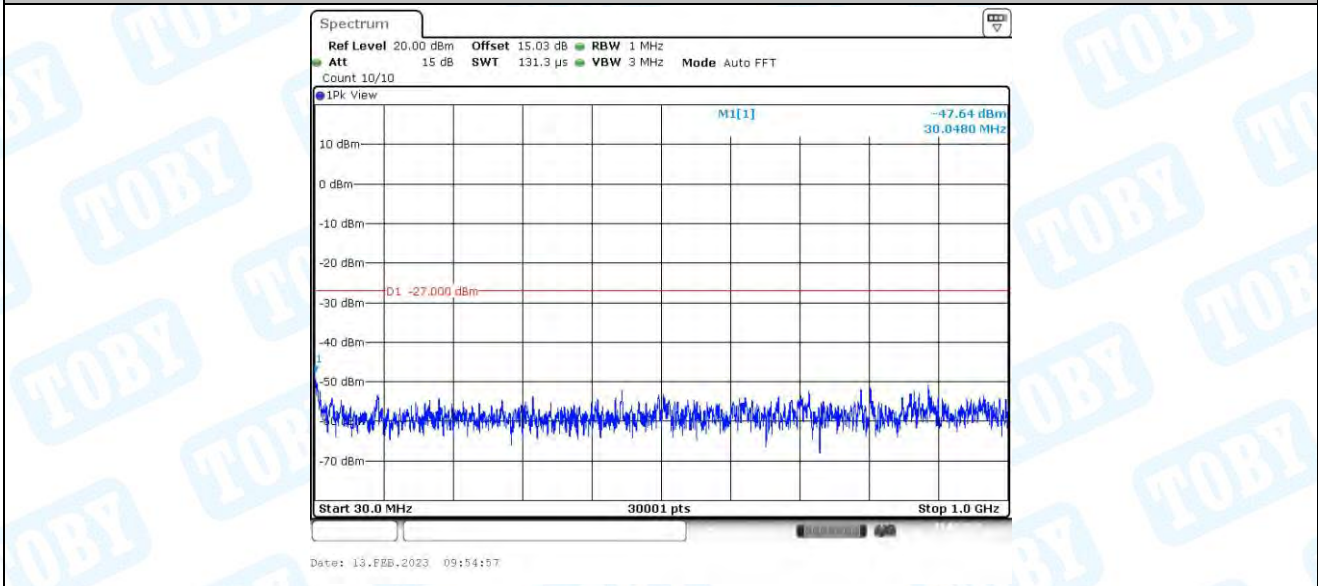


11N40SISO_AntB_5510_1000~40000

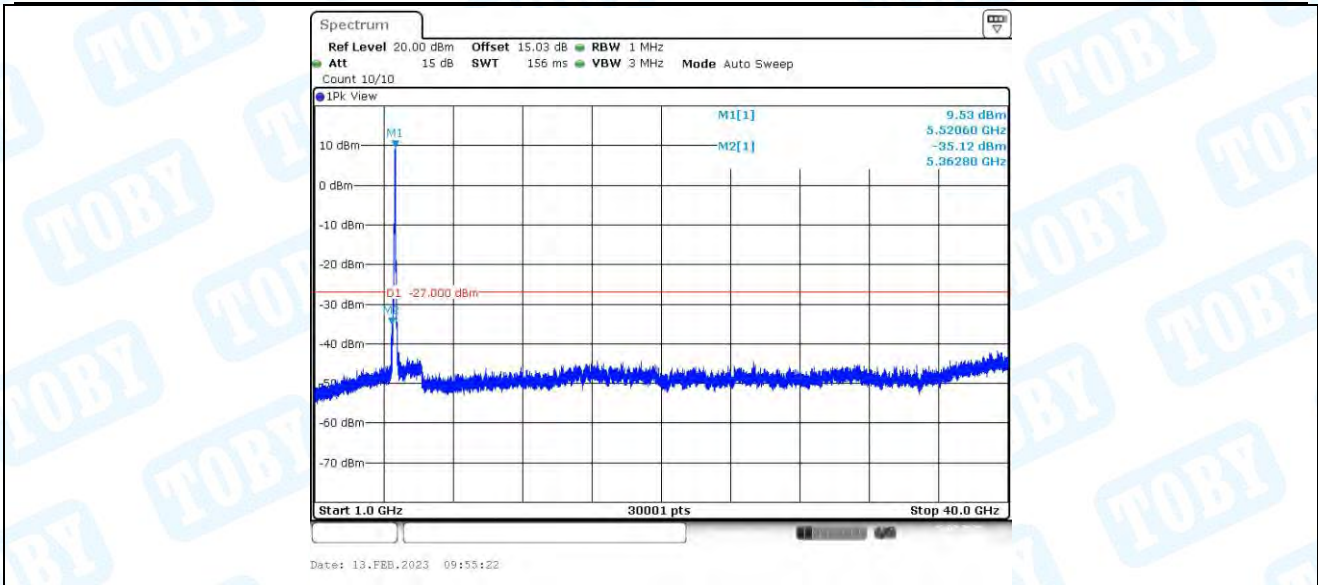


11N40SISO_AntB_5550_30~1000

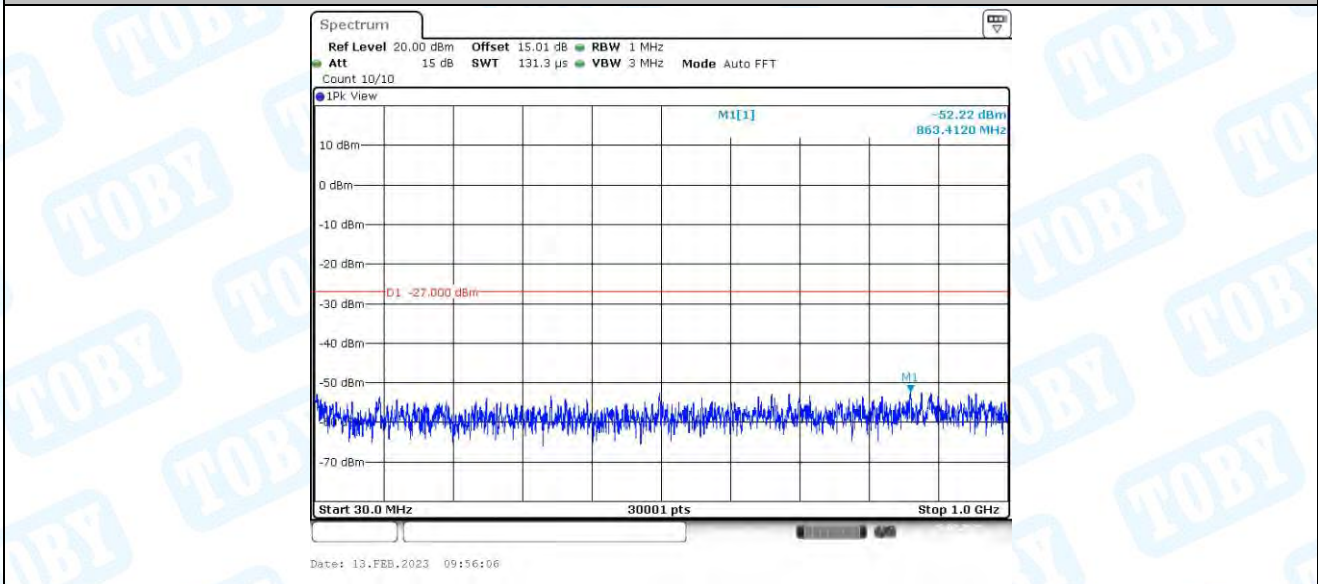


11N40SISO_AntB_5550_1000~40000

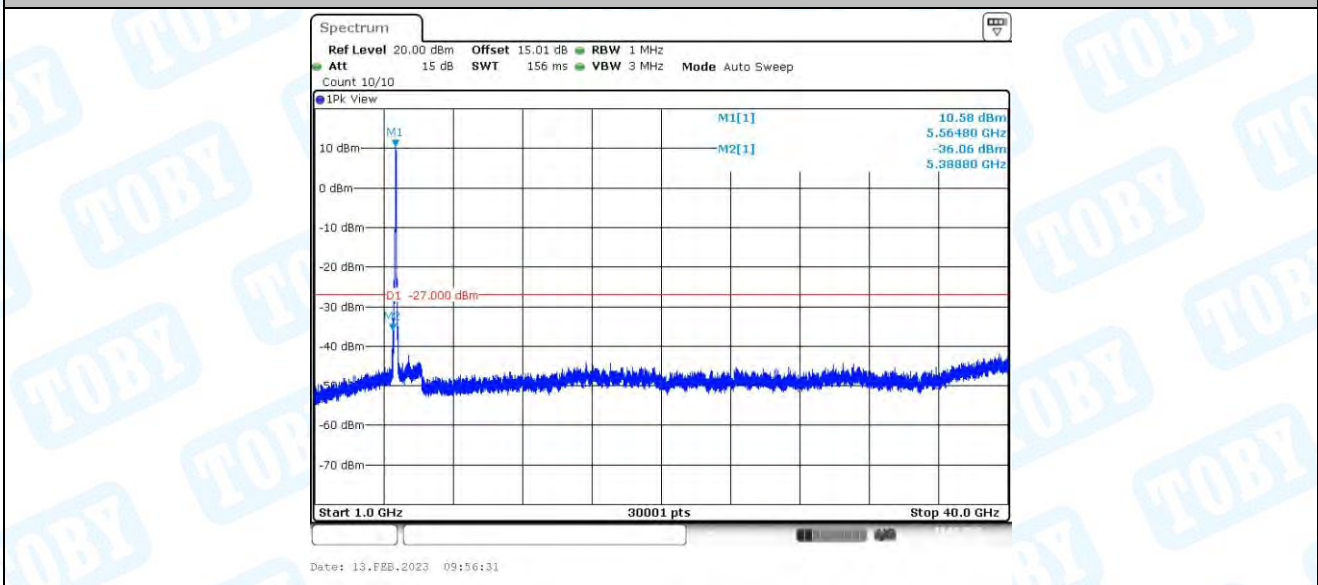


11N40SISO_AntB_5670_30~1000

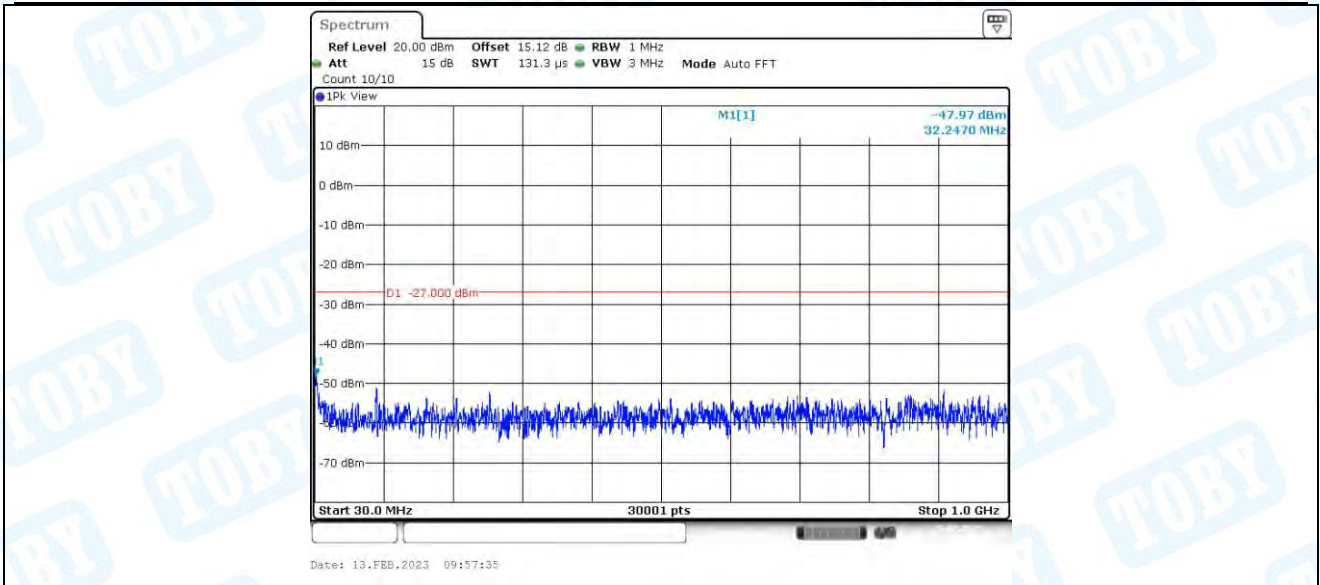


11N40SISO_AntB_5670_1000~40000

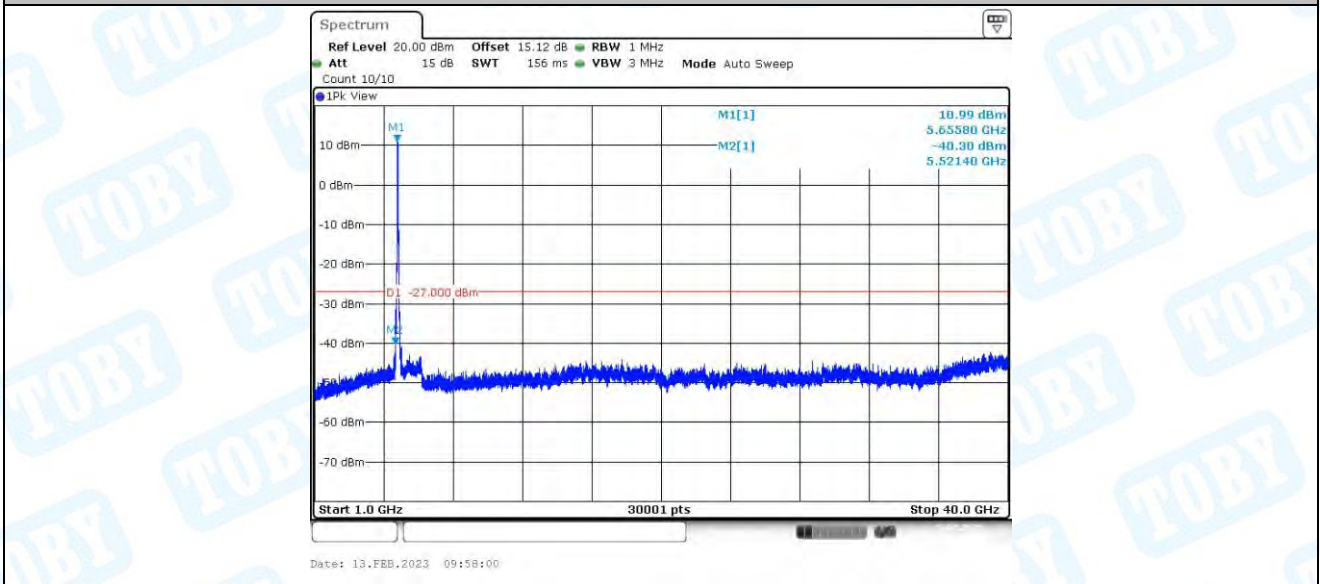


11N40SISO_AntB_5755_30~1000

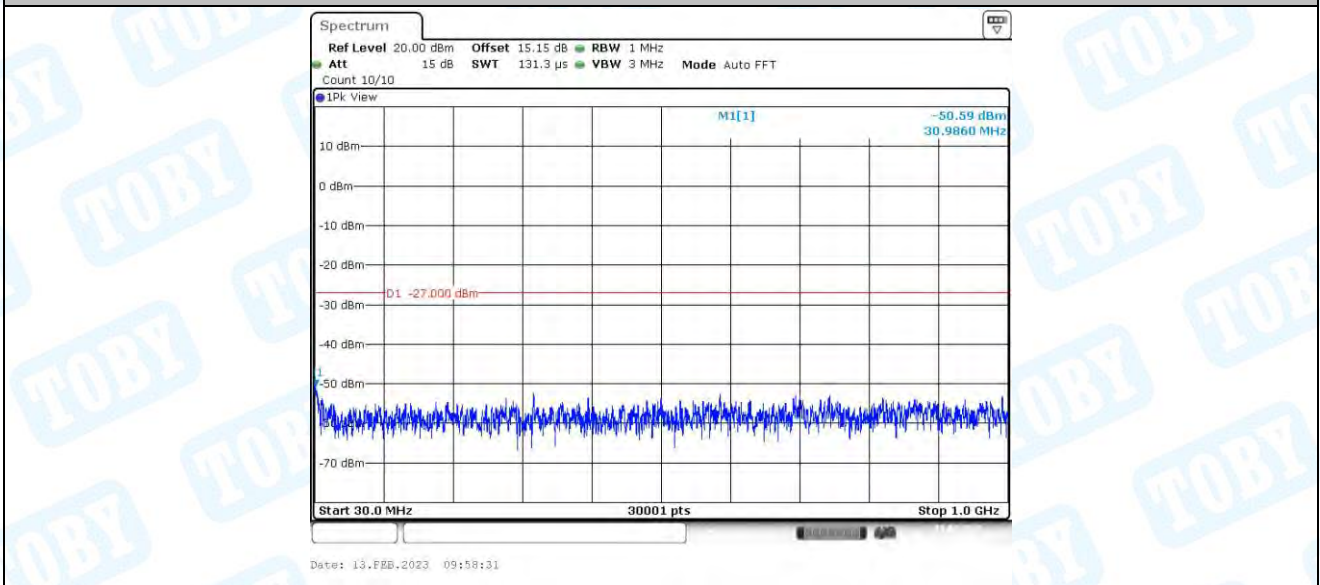


11N40SISO_AntB_5755_1000~40000

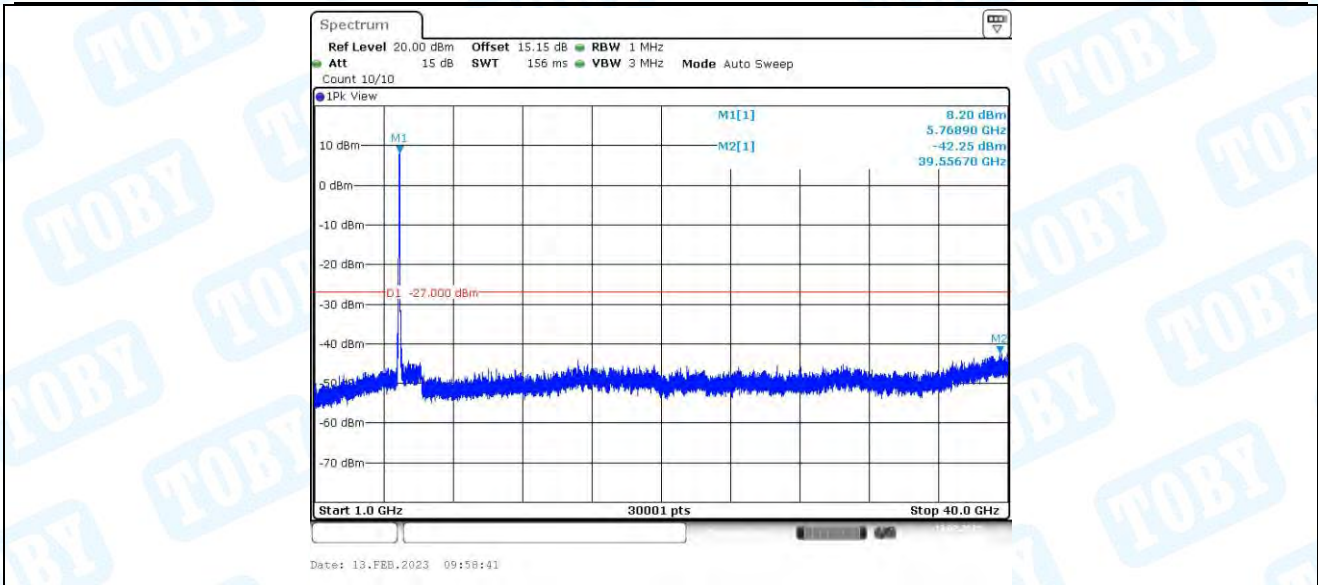


11N40SISO_AntB_5795_30~1000

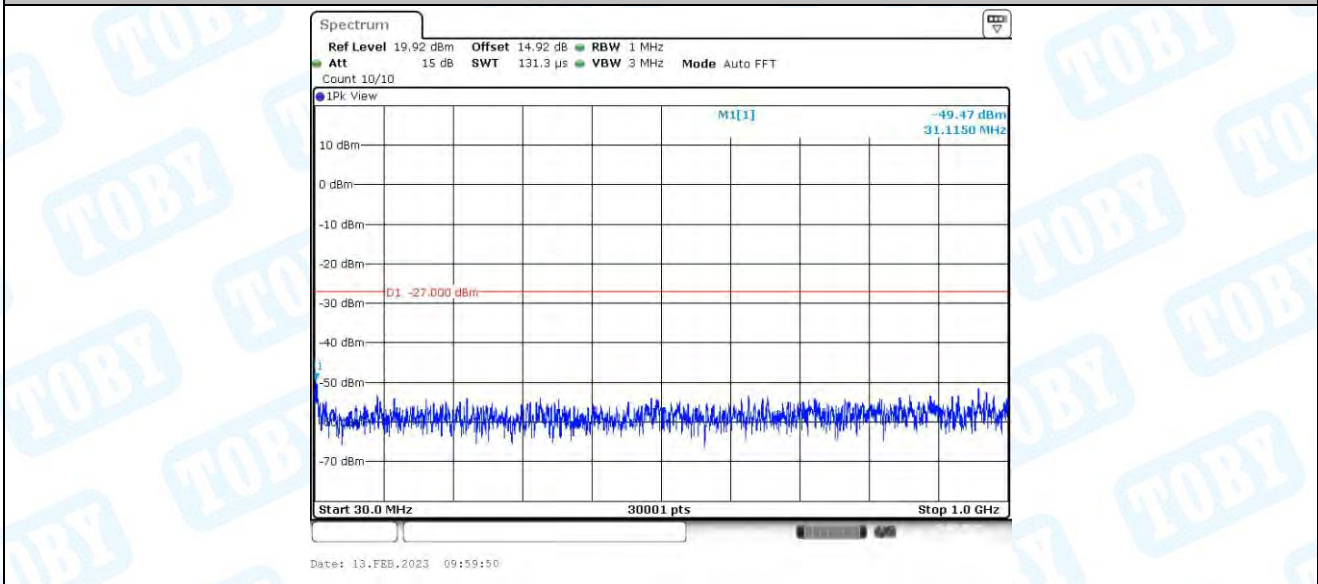


11N40SISO_AntB_5795_1000~40000

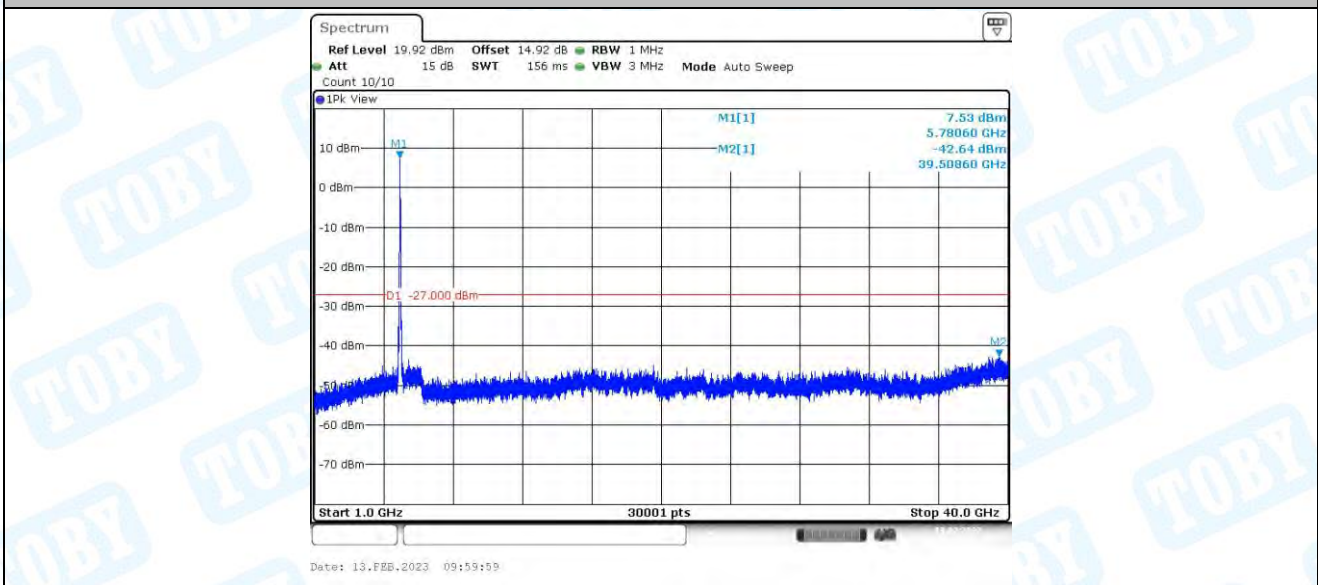


11AC20SISO_AntB_5180_30~1000

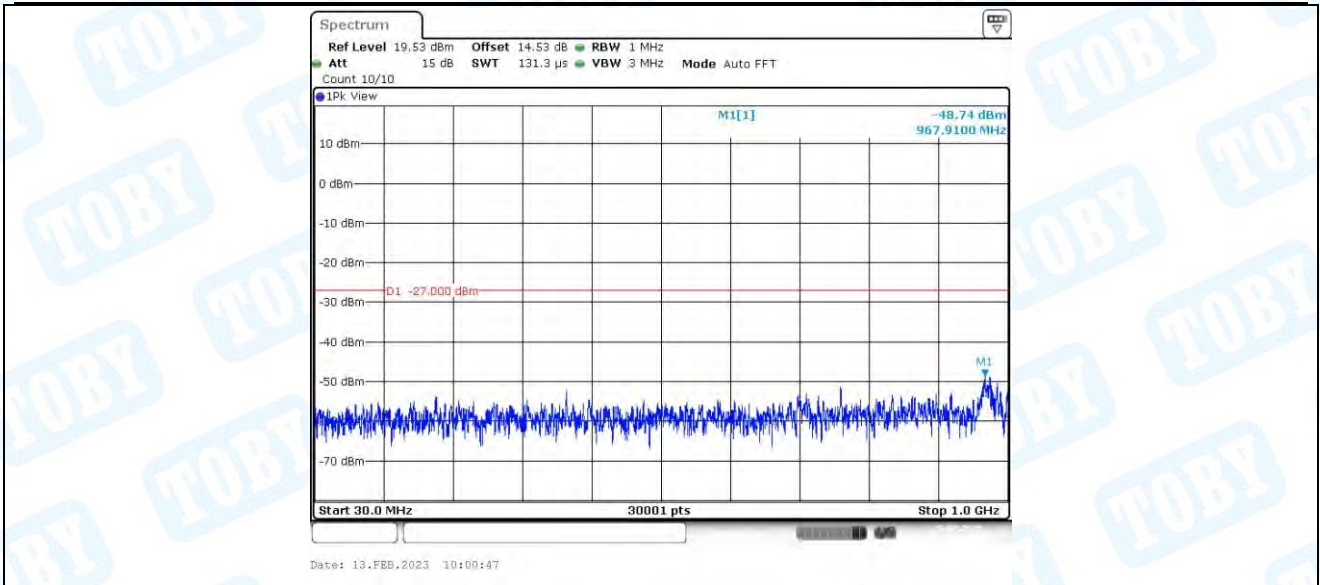


11AC20SISO_AntB_5180_1000~40000

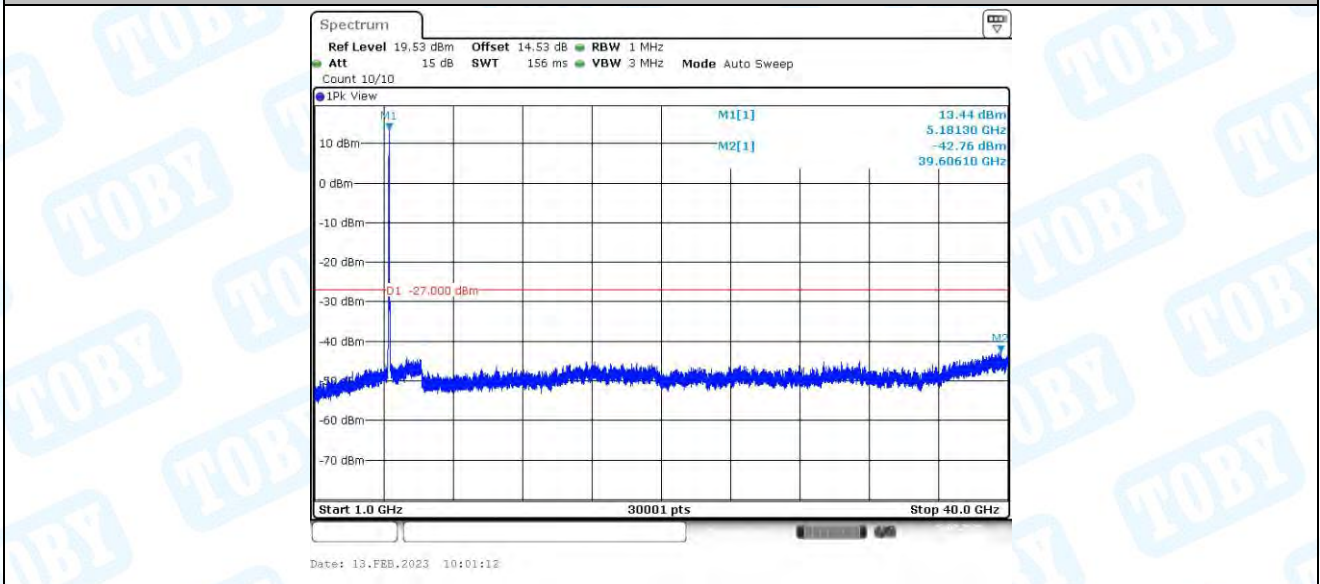


11AC20SISO_AntB_5200_30~1000

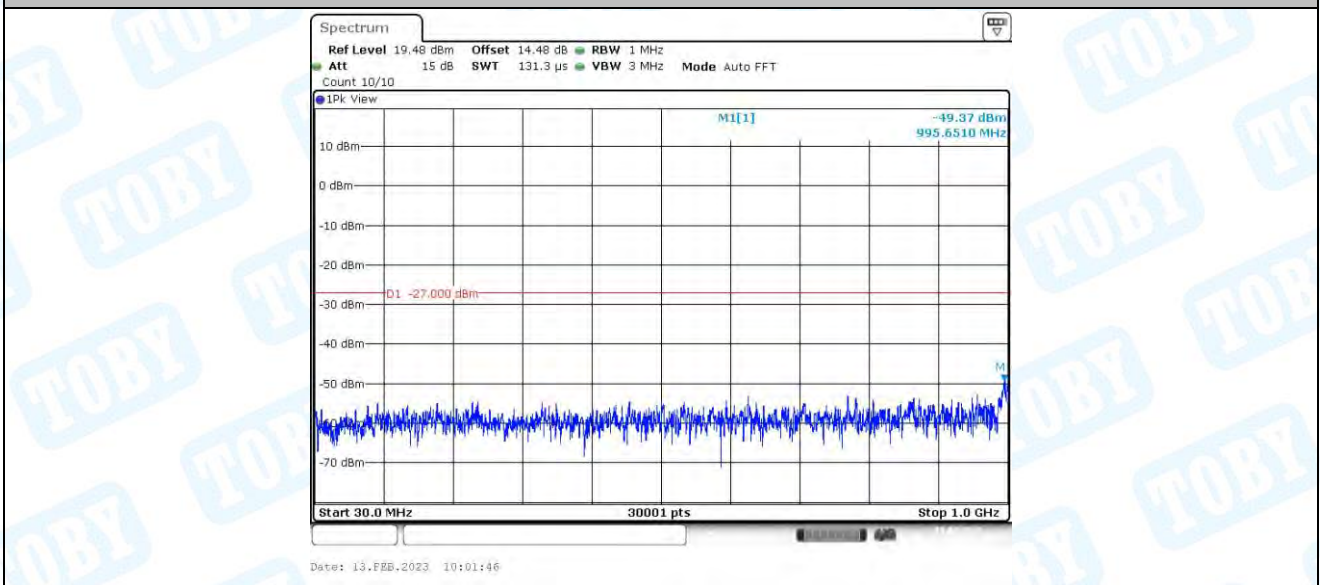


11AC20SISO_AntB_5200_1000~40000

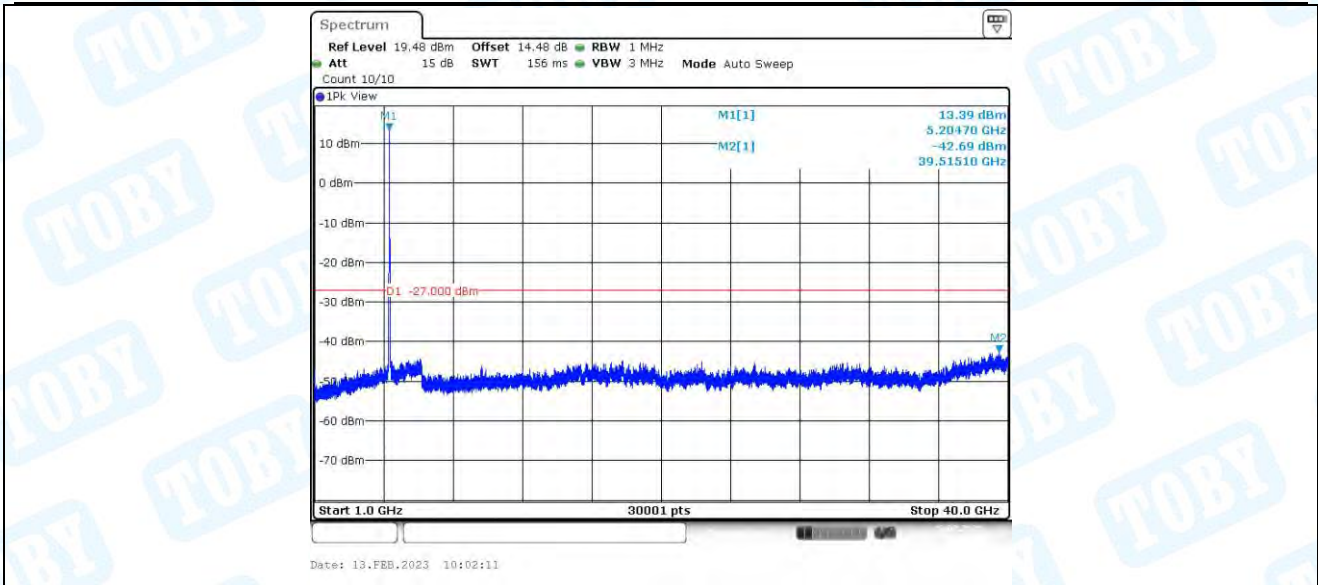


11AC20SISO_AntB_5240_30~1000

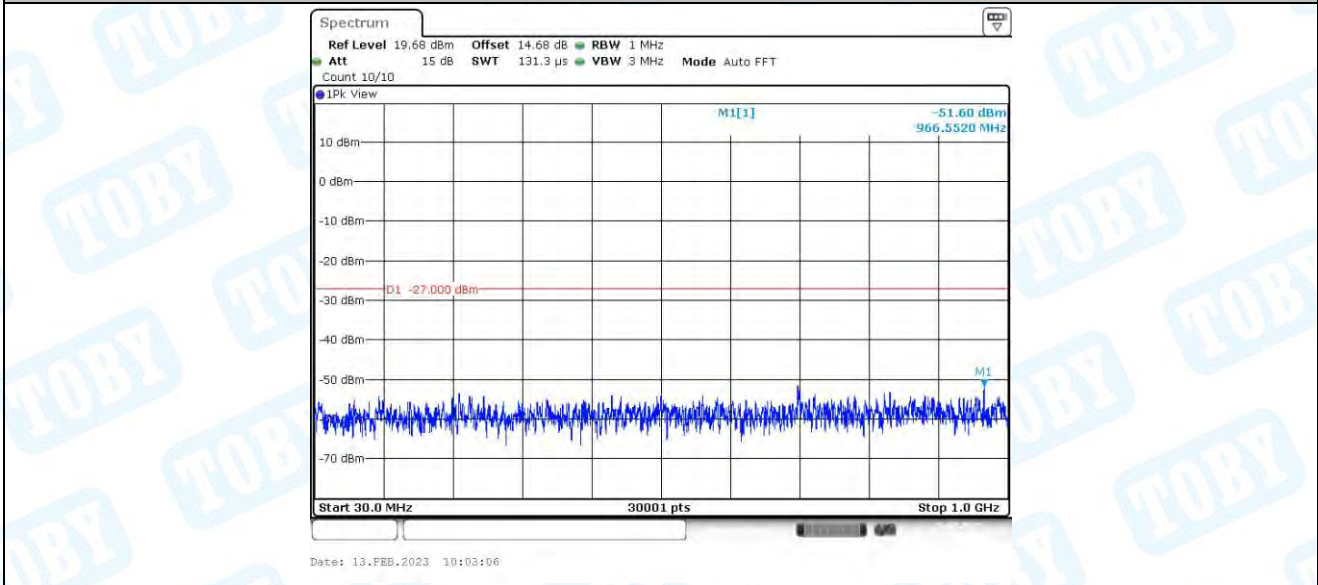


11AC20SISO_AntB_5240_1000~40000

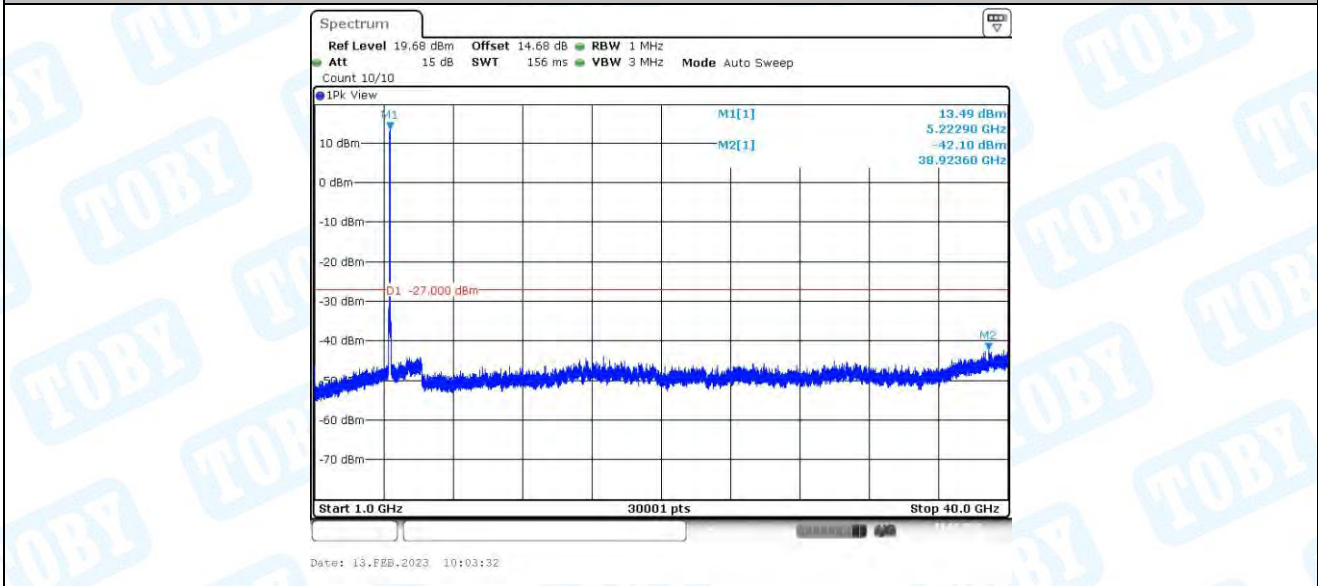


11AC20SISO_AntB_5260_30~1000

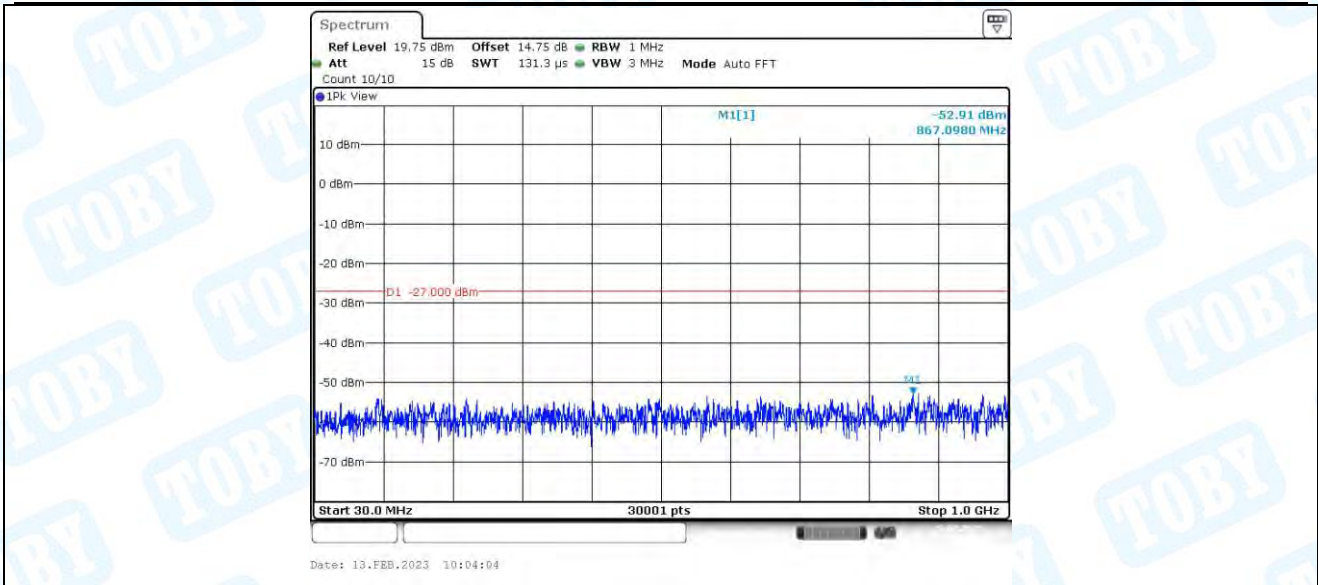


11AC20SISO_AntB_5260_1000~40000

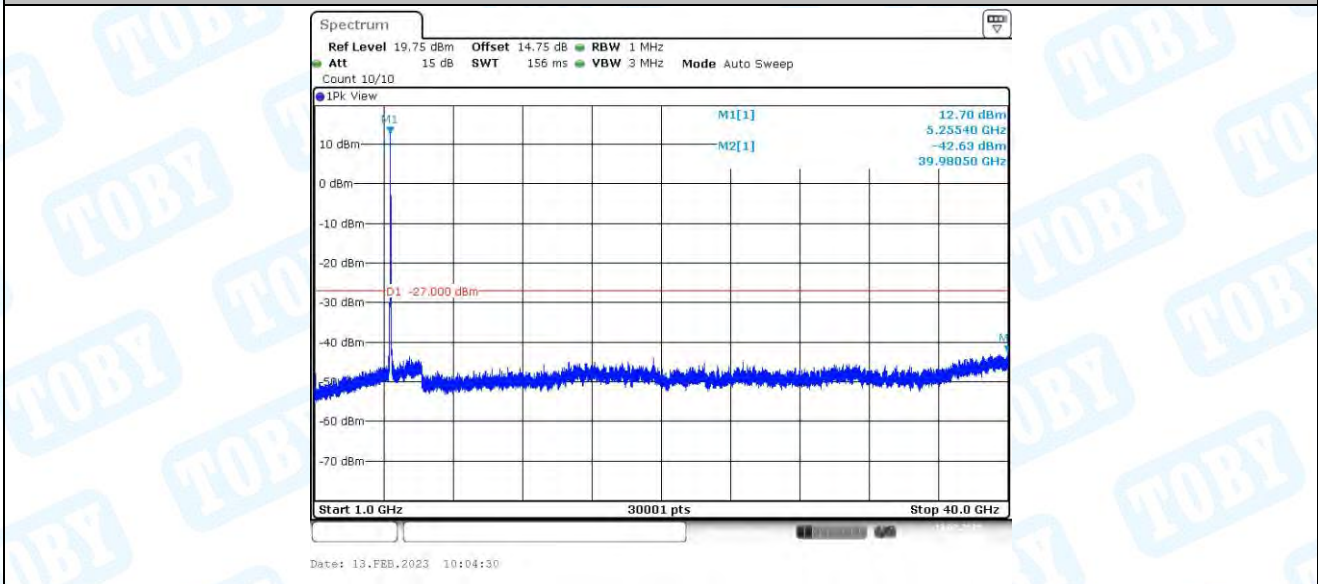


11AC20SISO_AntB_5280_30~1000

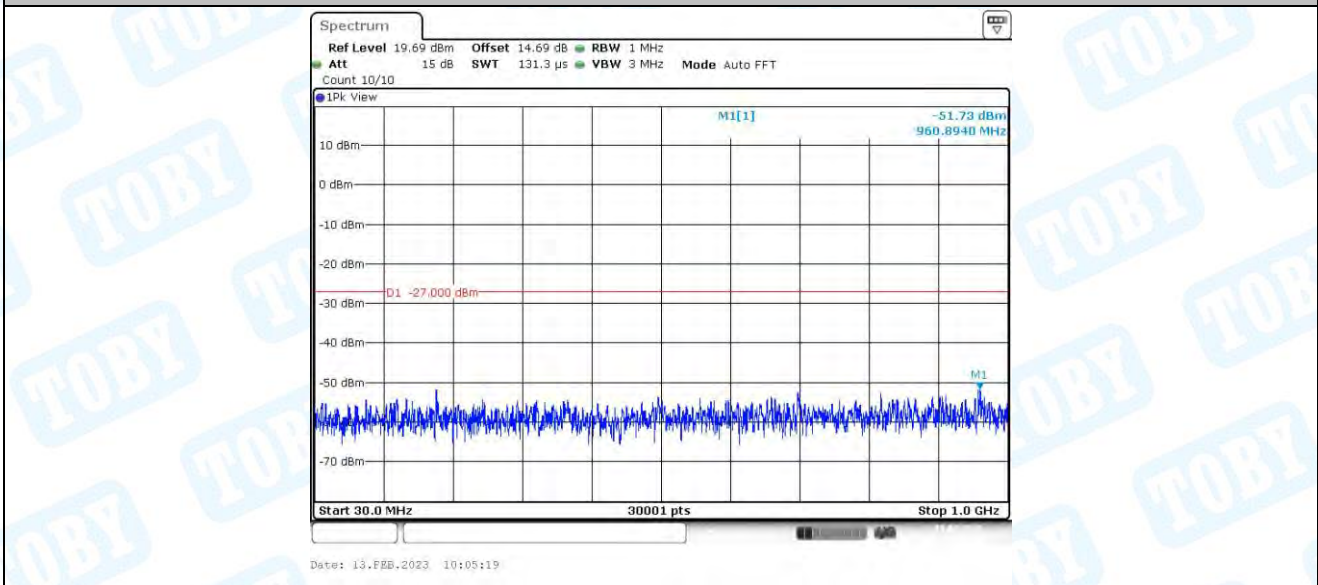


11AC20SISO_AntB_5280_1000~40000

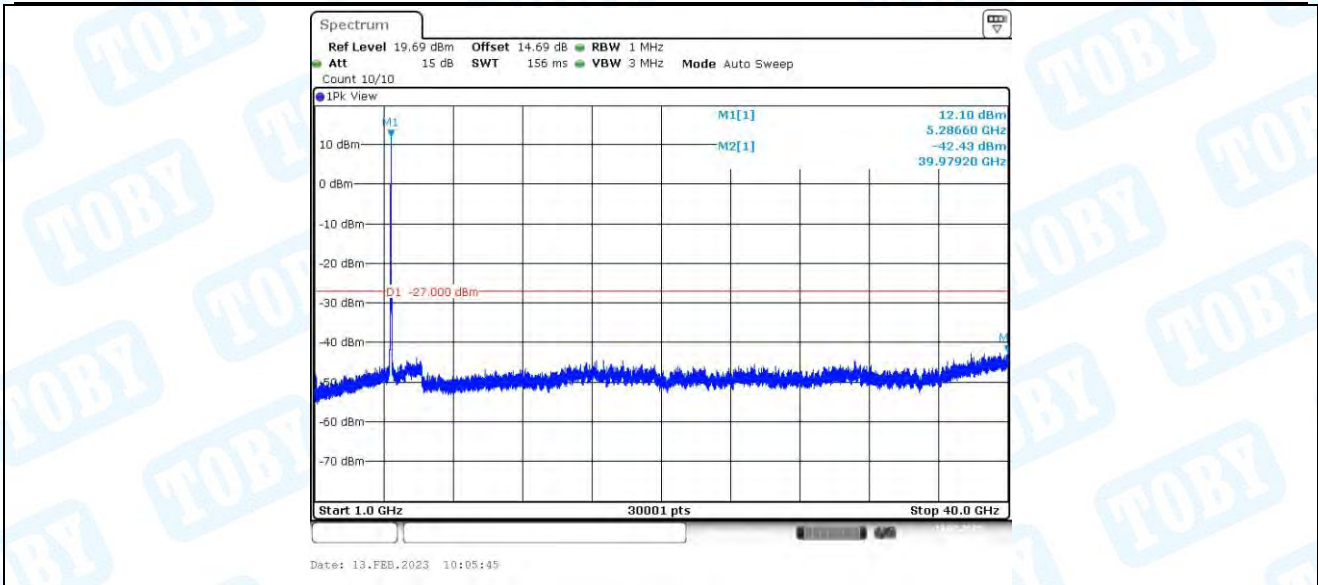


11AC20SISO_AntB_5320_30~1000

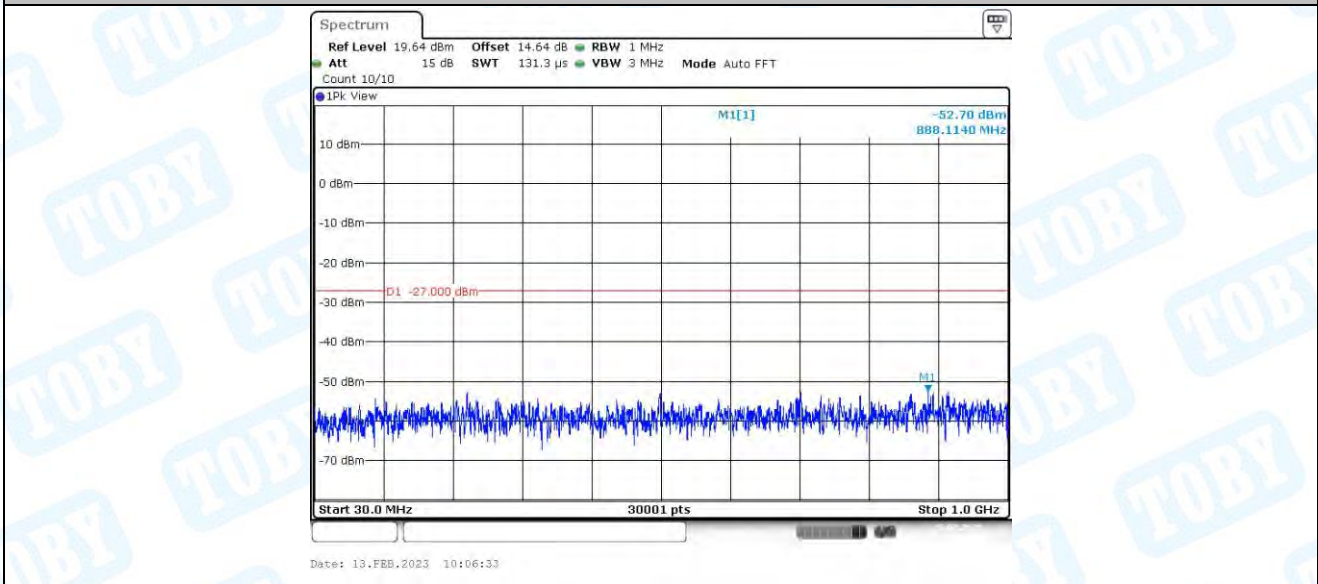

11AC20SISO_AntB_5320_1000~40000

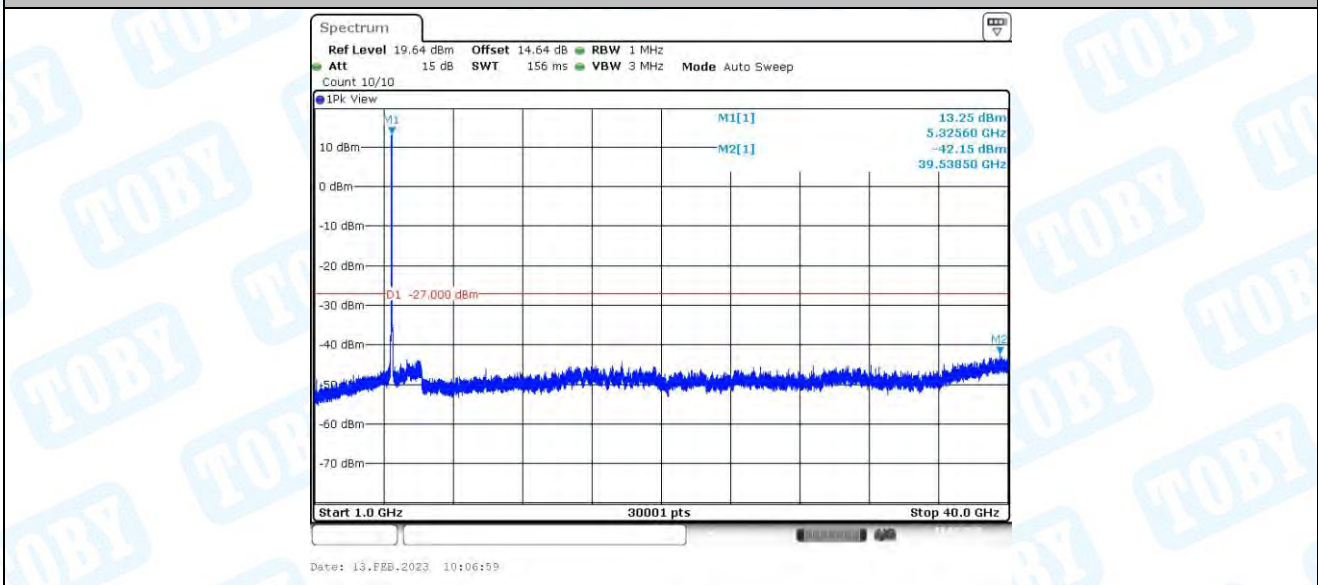


11AC20SISO_AntB_5500_30~1000

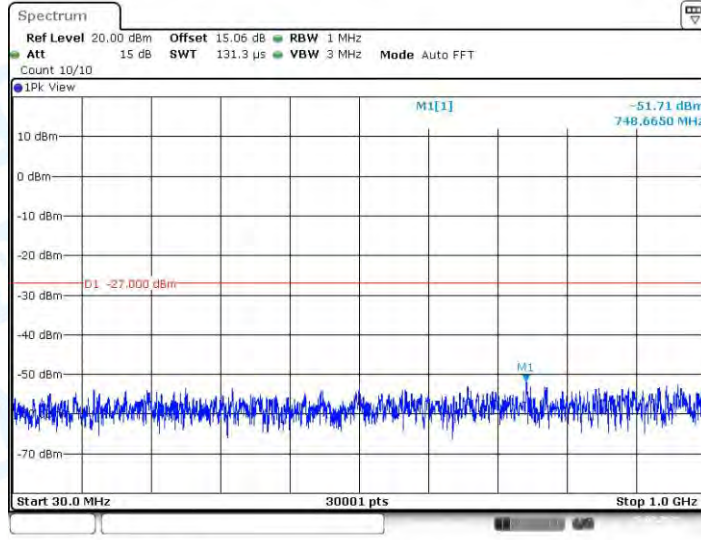


Date: 13.FEB.2023 10:07:24

11AC20SISO_AntB_5500_1000~40000

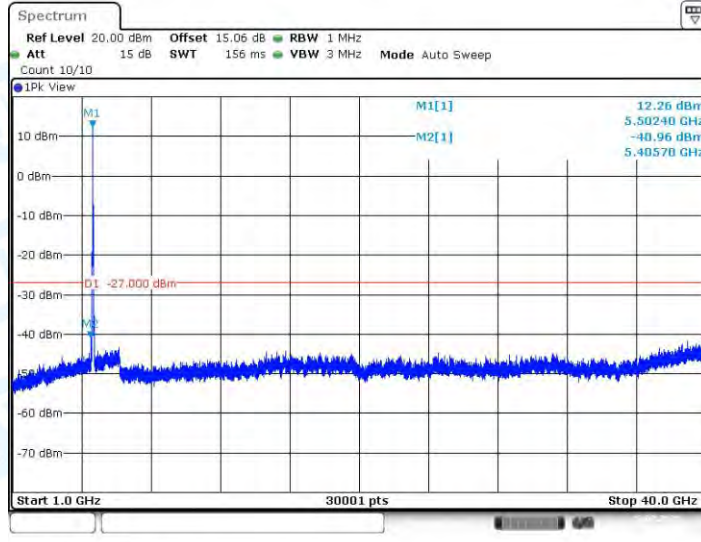


Date: 13.FEB.2023 10:07:50

11AC20SISO_AntB_5600_30~1000

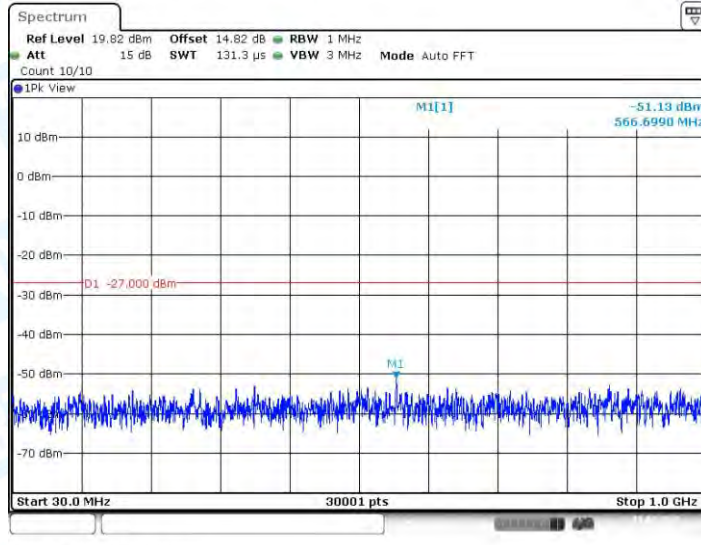


Date: 13.FEB.2023 10:08:35


11AC20SISO_AntB_5600_1000~40000

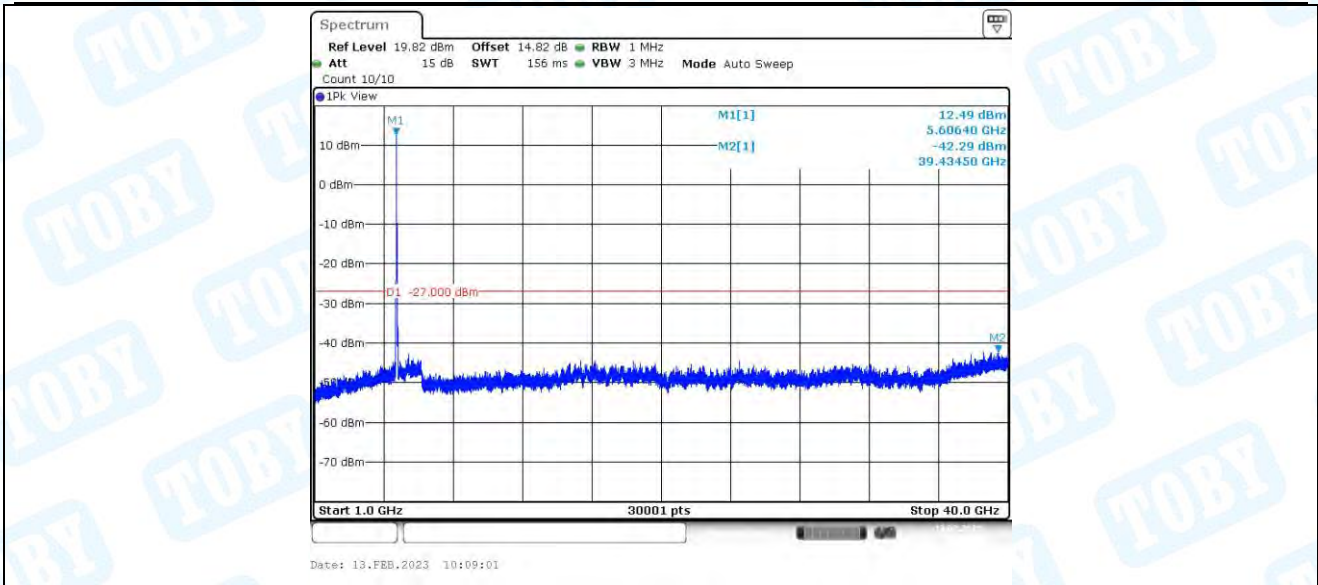


11AC20SISO_AntB_5700_30~1000

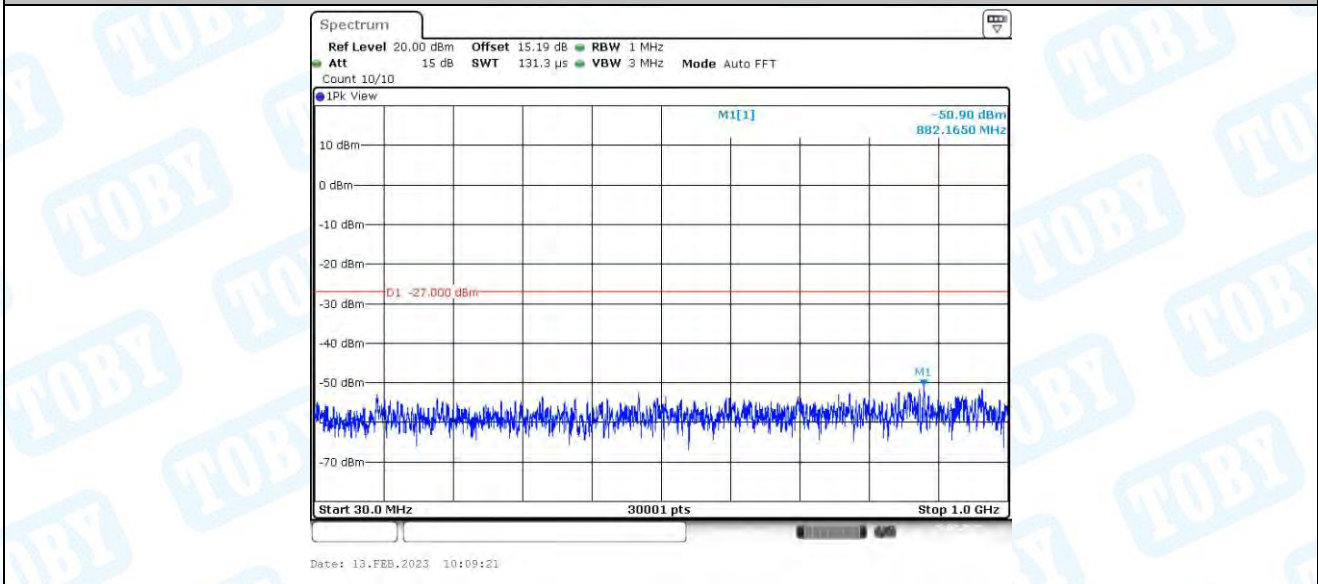


11AC20SISO_AntB_5700_1000~40000

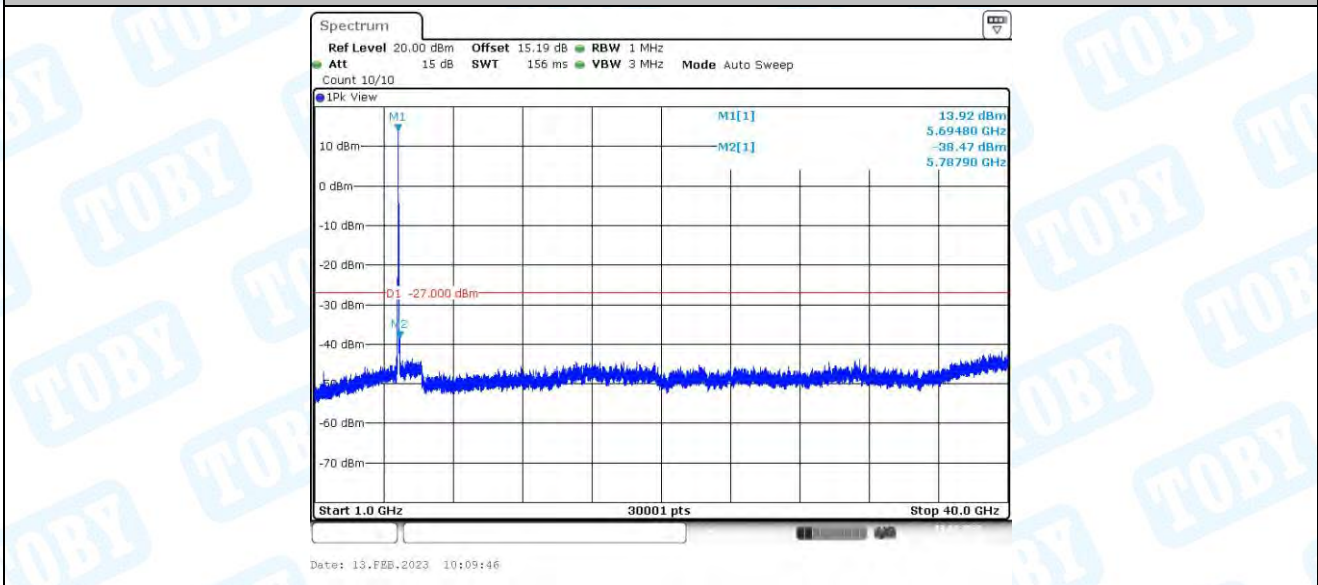


11AC20SISO_AntB_5745_30~1000

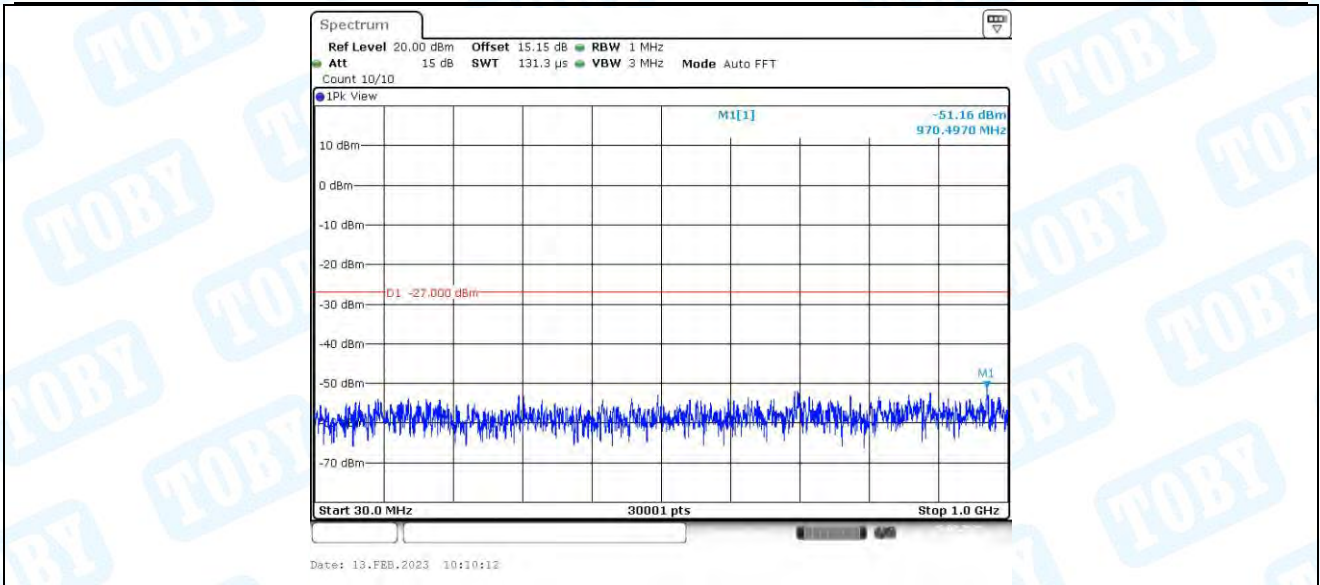


11AC20SISO_AntB_5745_1000~40000

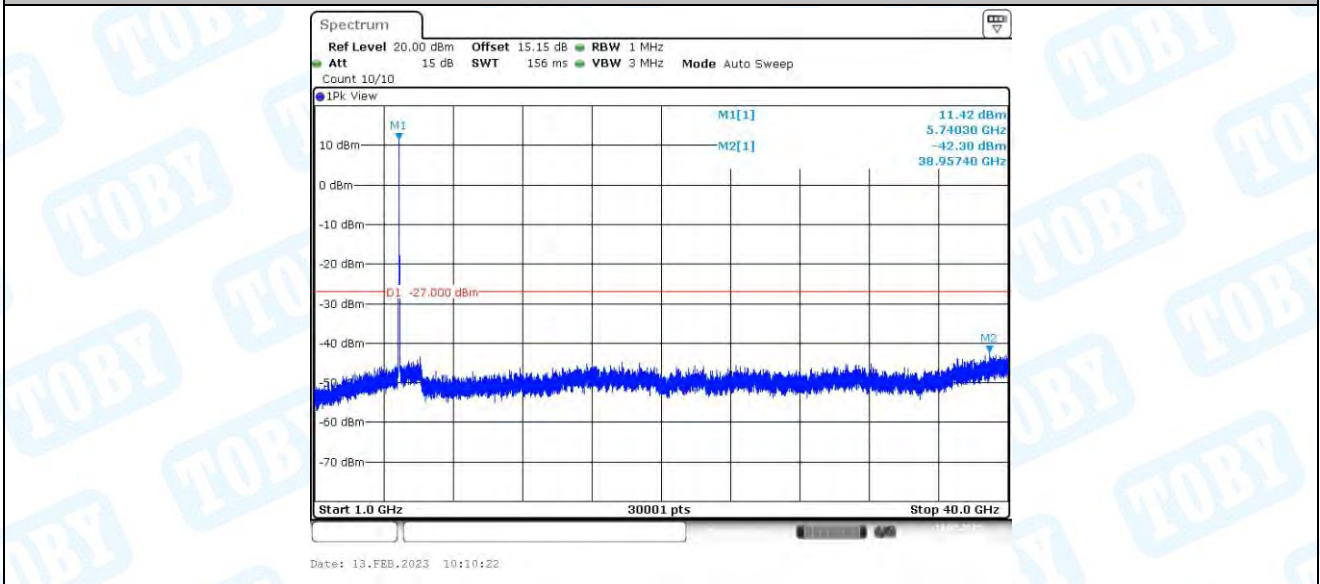


11AC20SISO_AntB_5785_30~1000

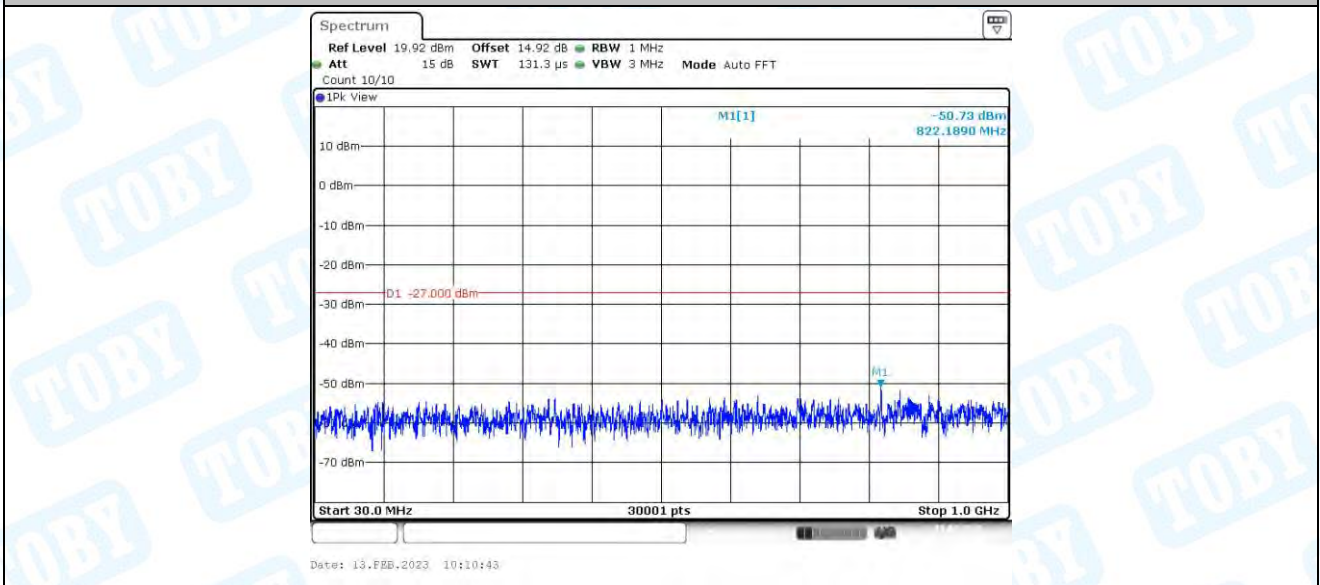


11AC20SISO_AntB_5785_1000~40000

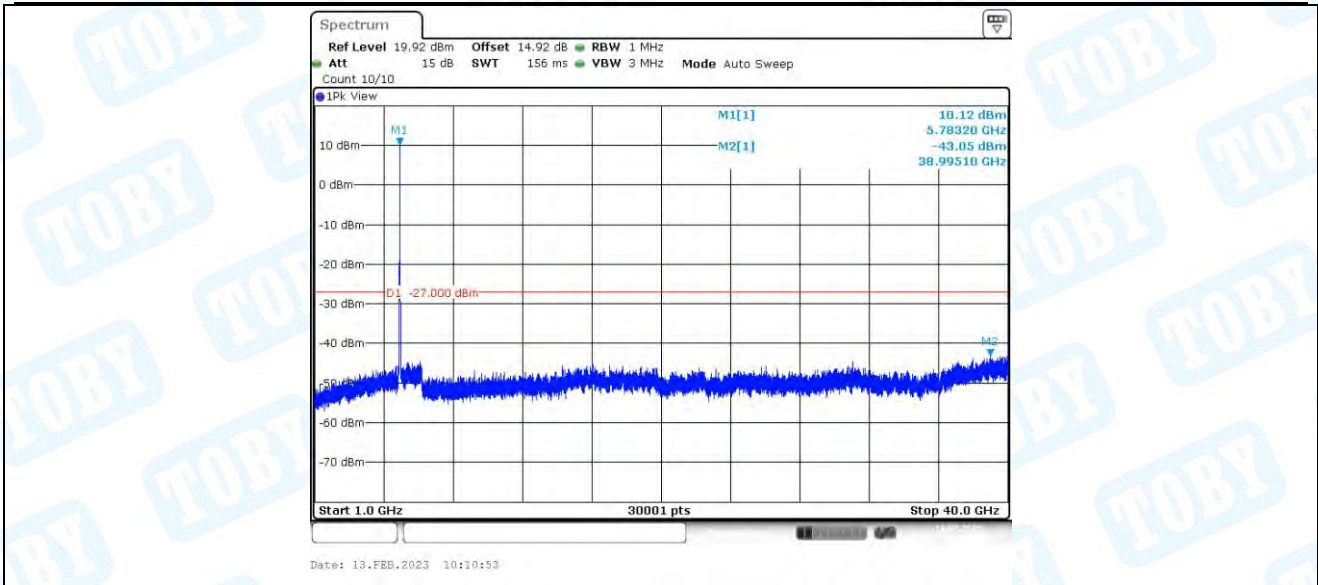


11AC20SISO_AntB_5825_30~1000

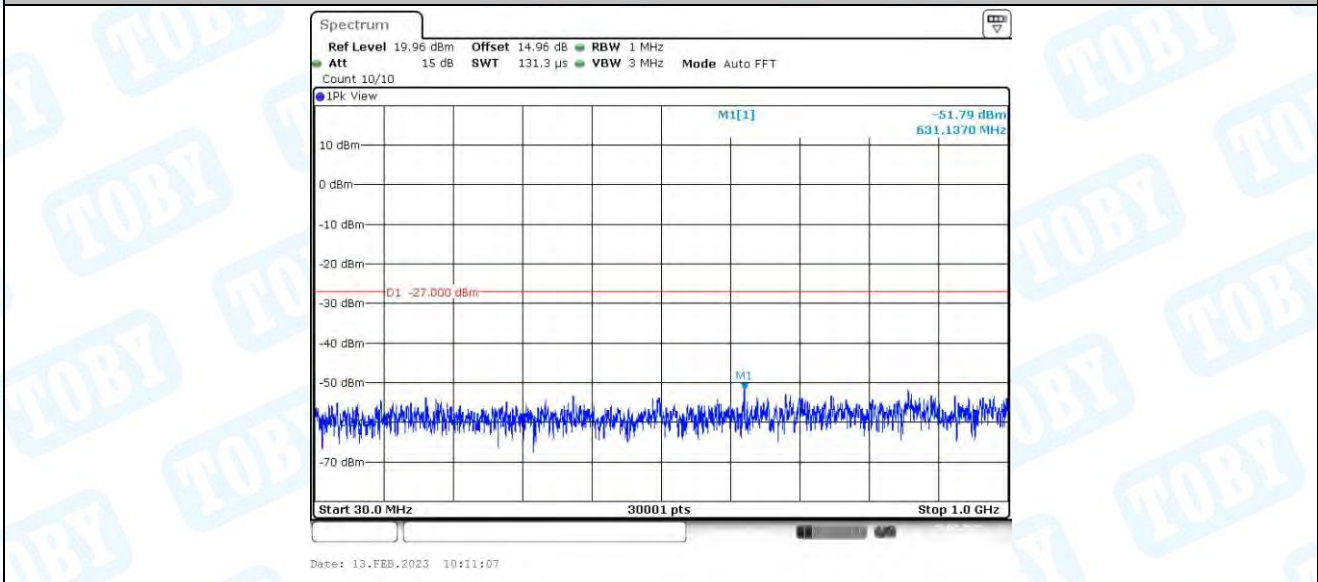


11AC20SISO_AntB_5825_1000~40000

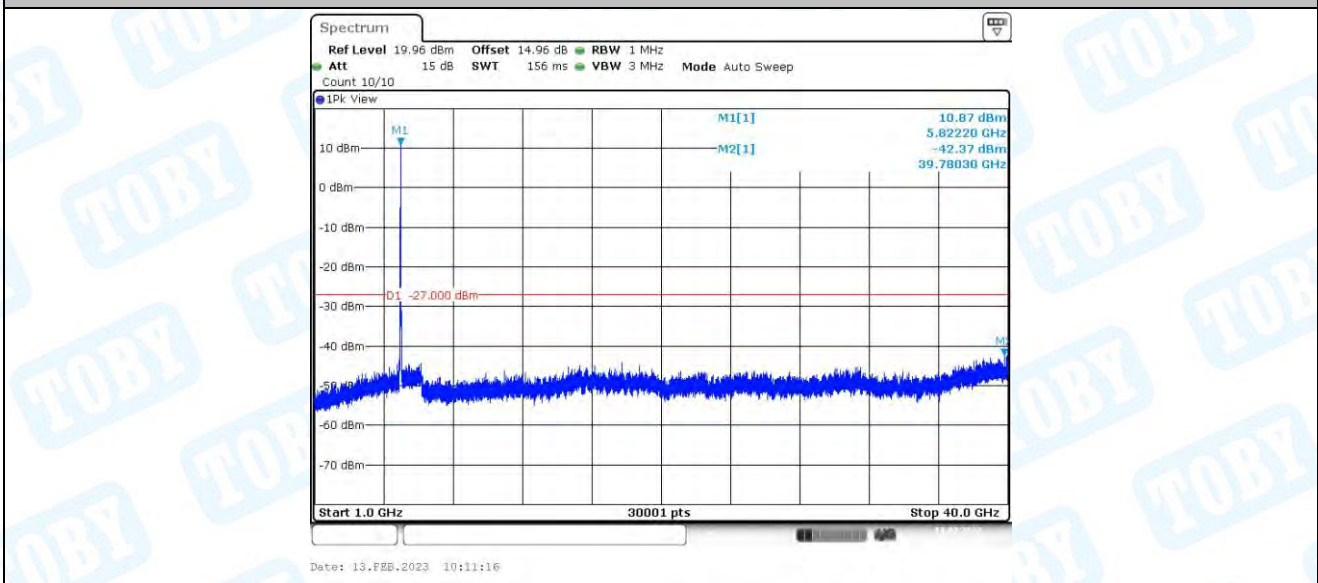


11AC40SISO_AntB_5190_30~1000

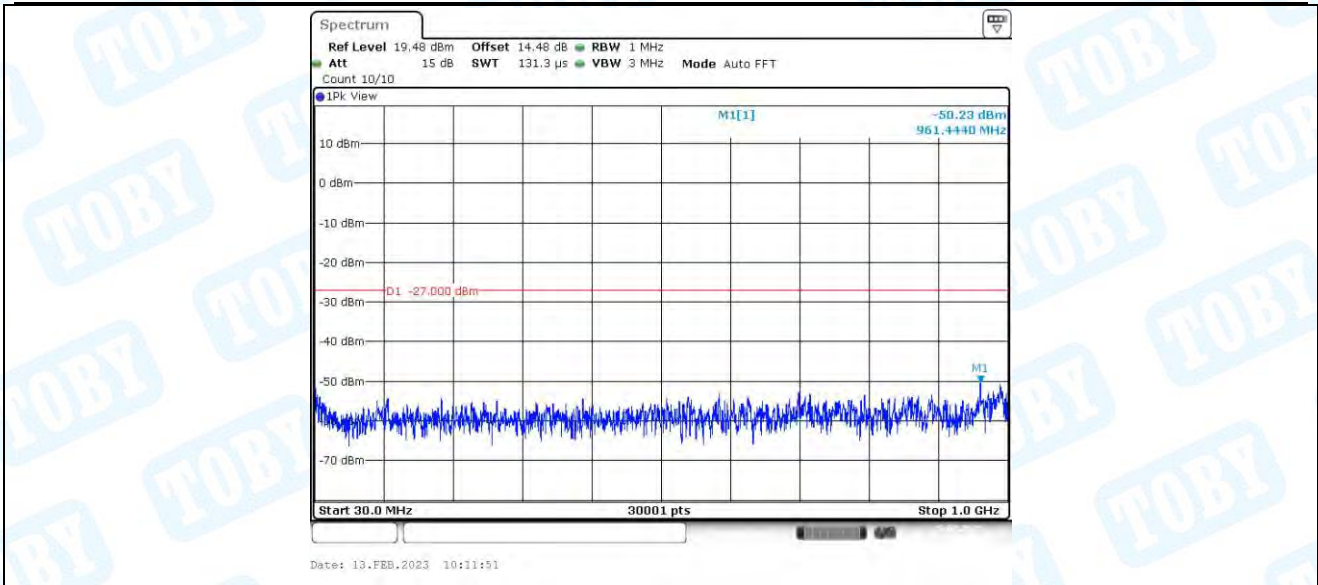


11AC40SISO_AntB_5190_1000~40000

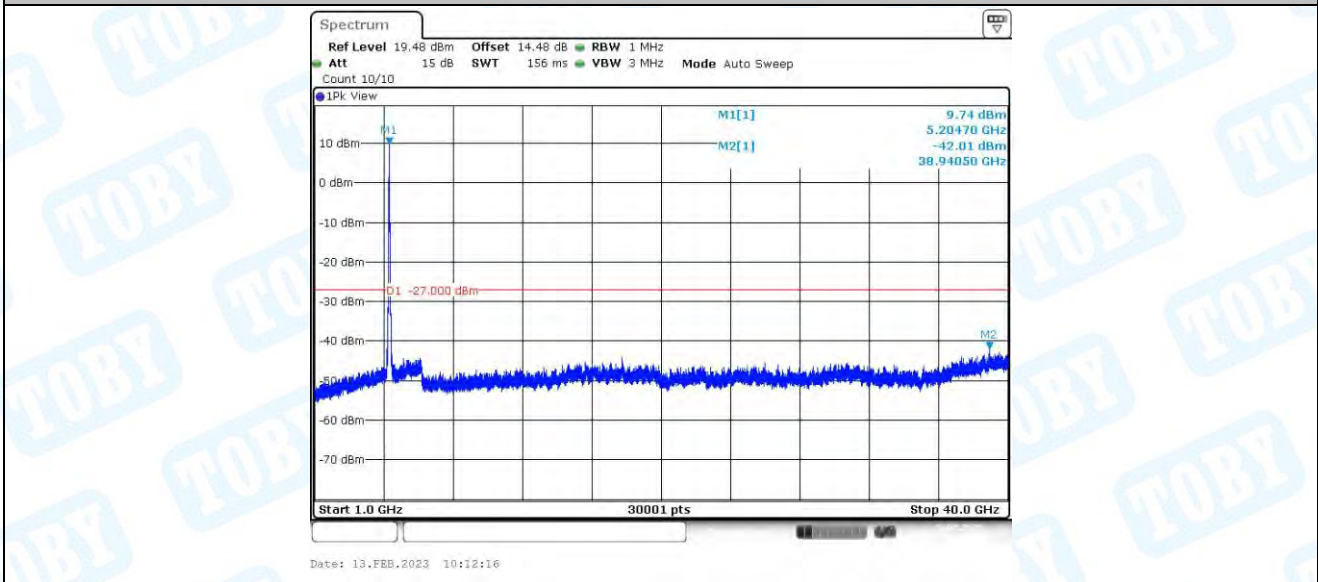


11AC40SISO_AntB_5230_30~1000

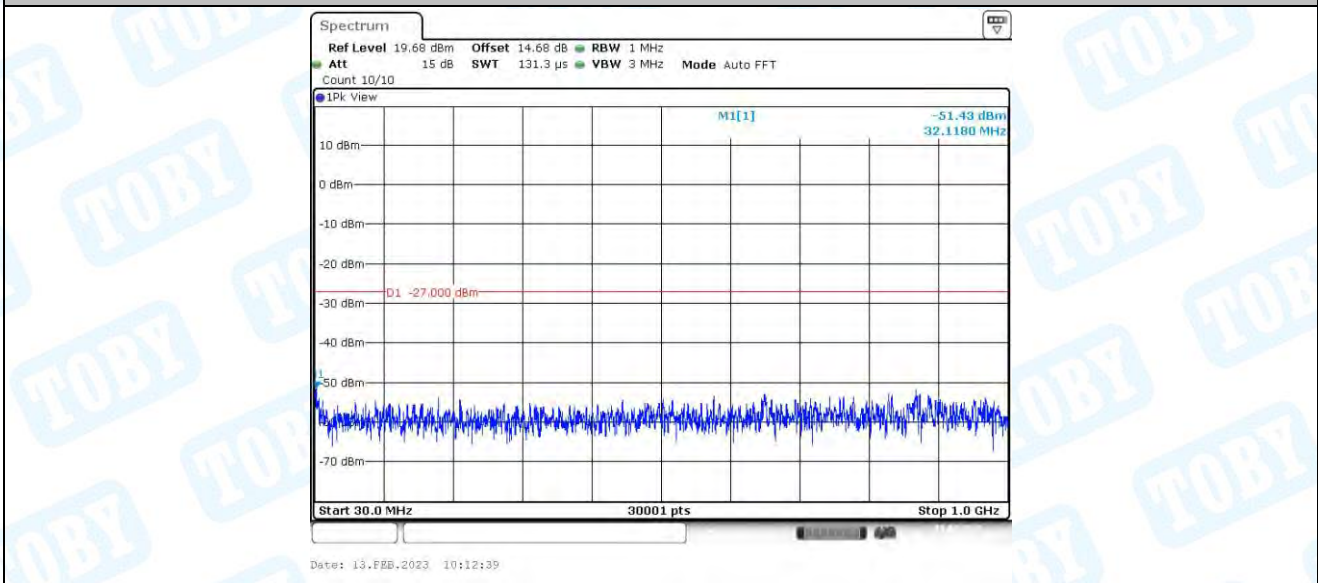


11AC40SISO_AntB_5230_1000~40000

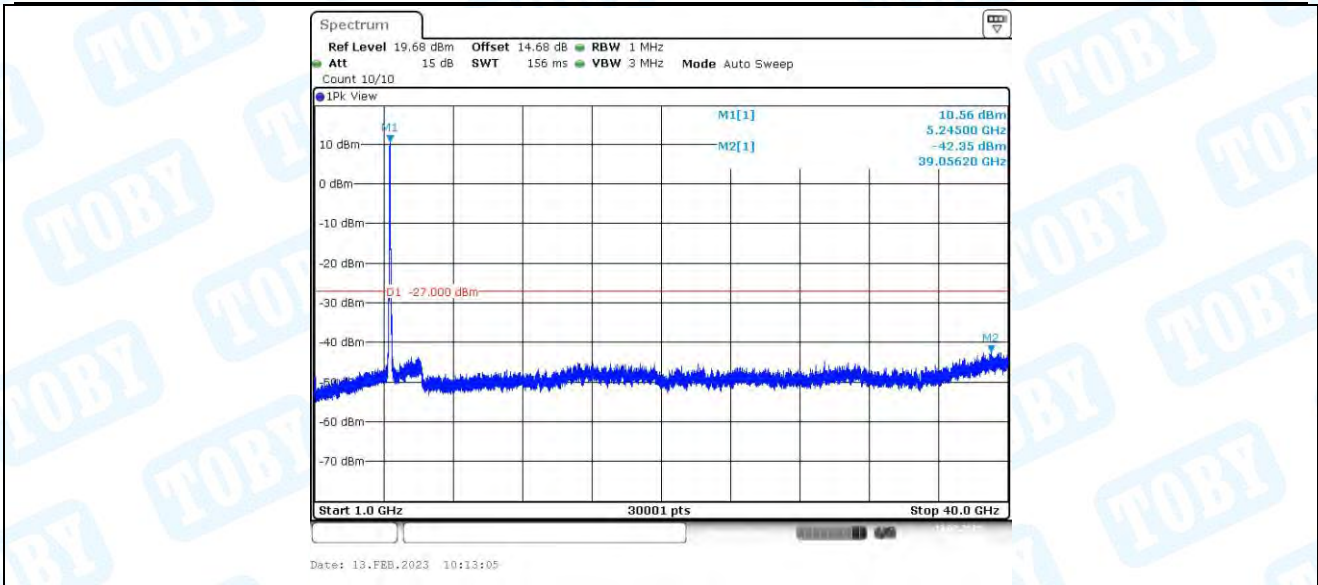


11AC40SISO_AntB_5270_30~1000

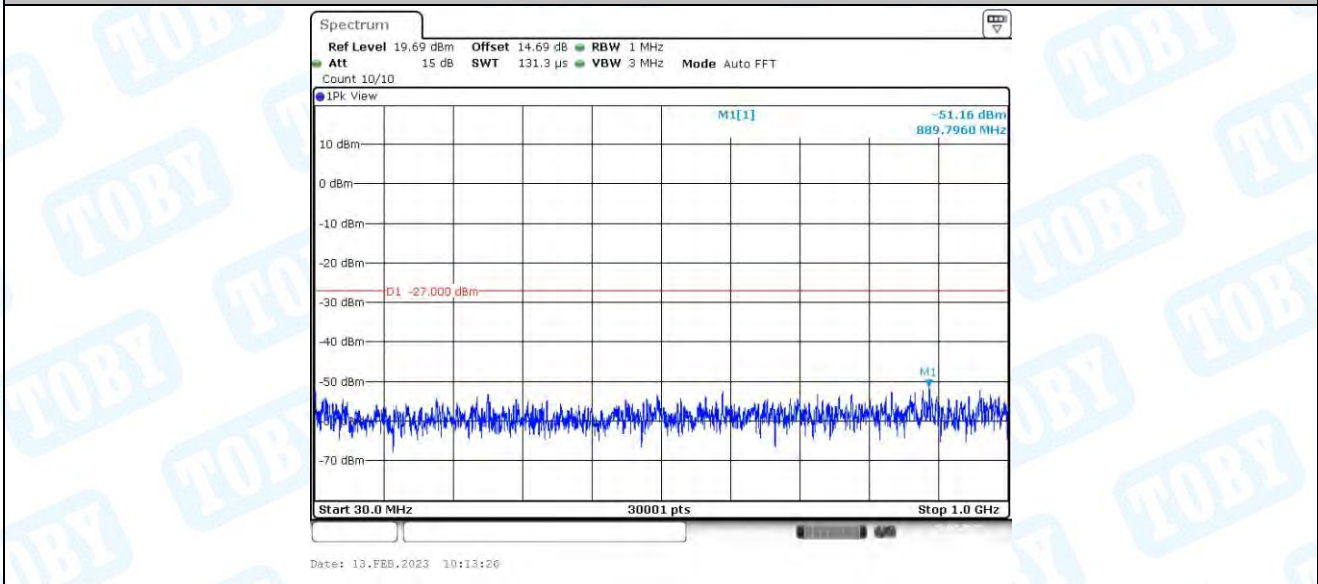


11AC40SISO_AntB_5270_1000~40000

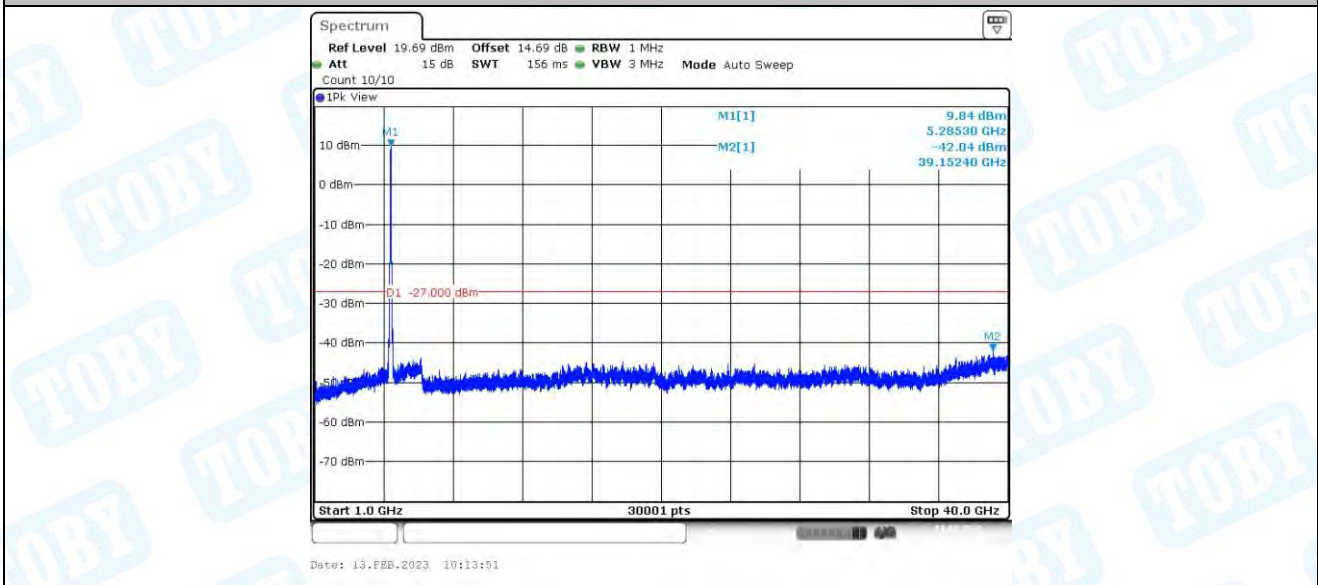


11AC40SISO_AntB_5310_30~1000

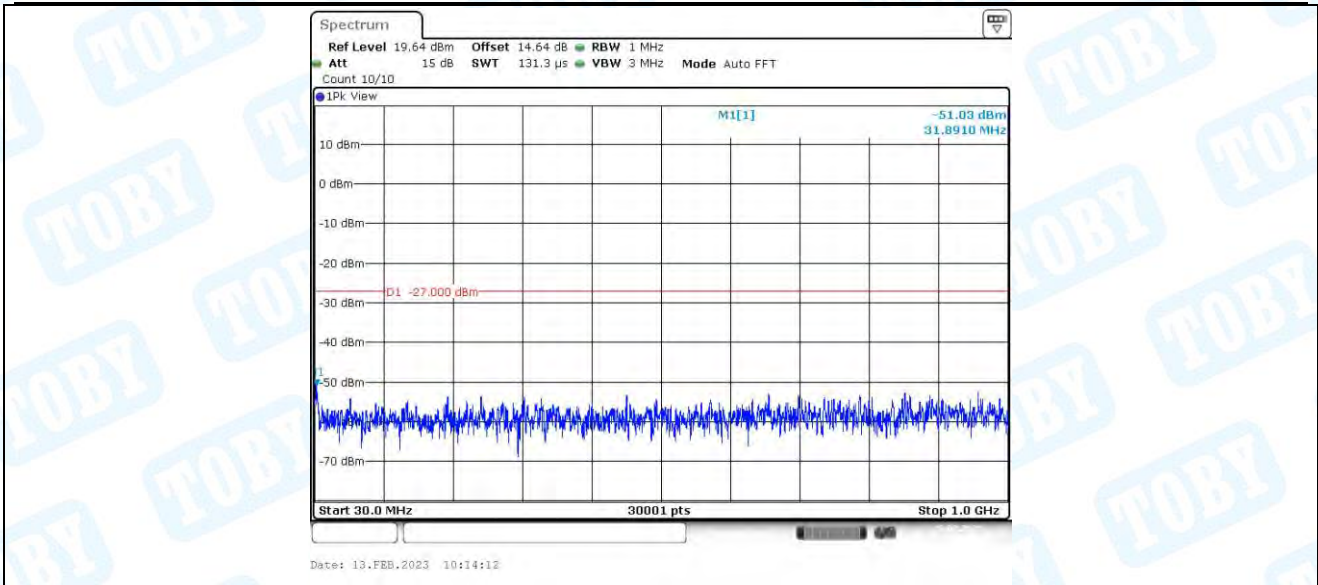


11AC40SISO_AntB_5310_1000~40000

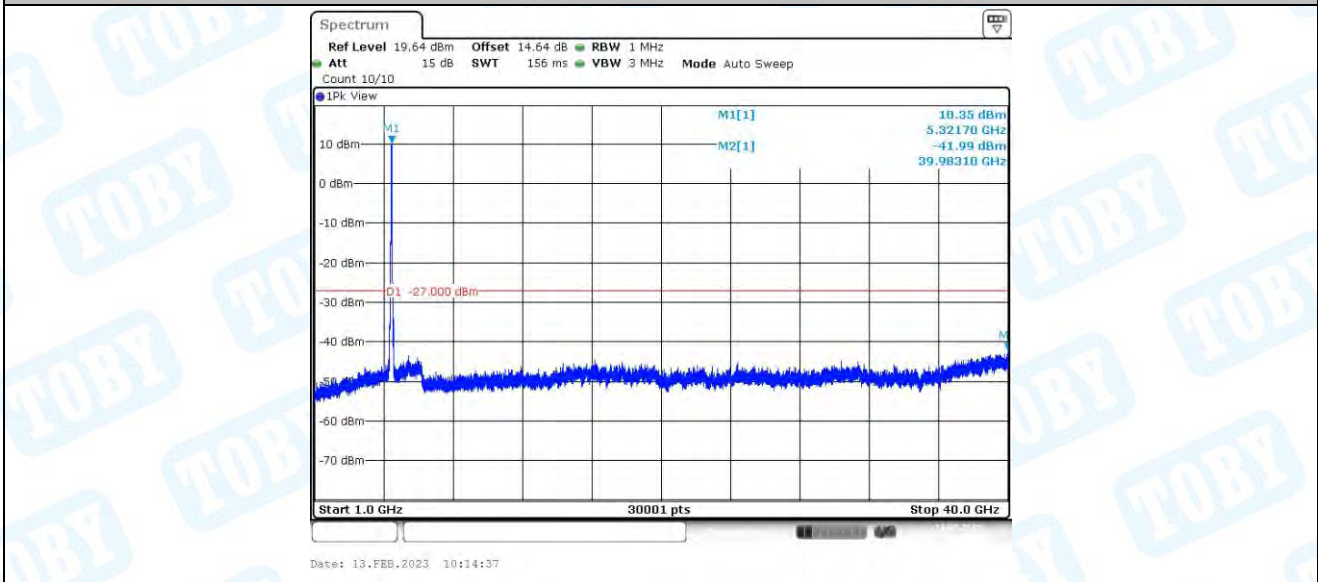


11AC40SISO_AntB_5510_30~1000

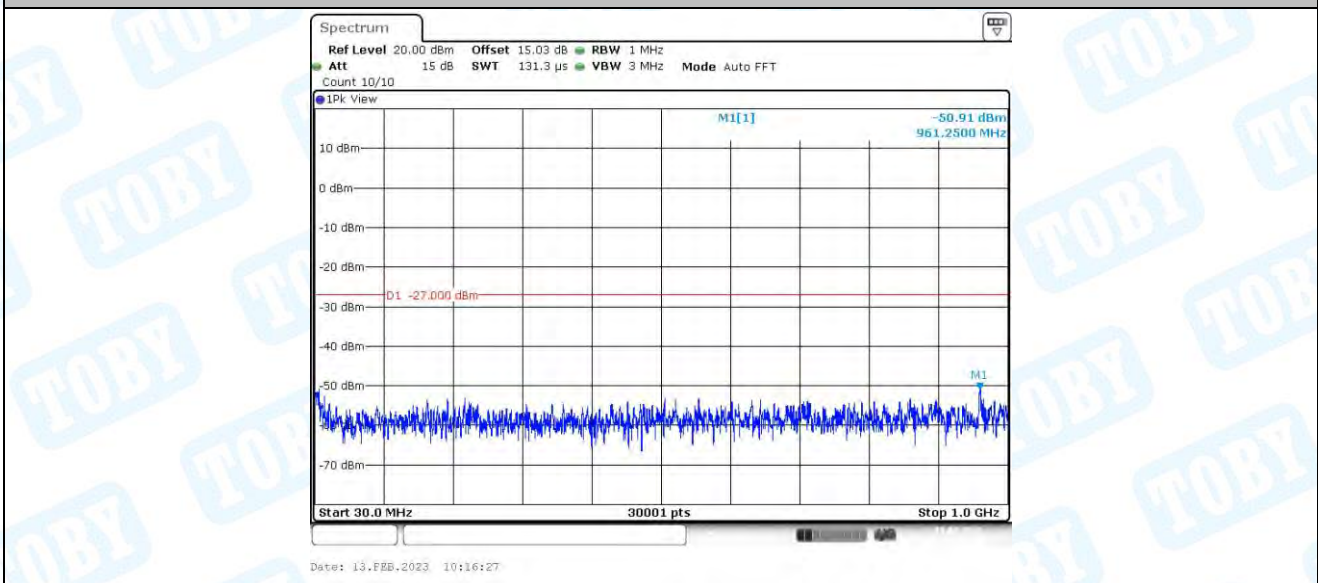


11AC40SISO_AntB_5510_1000~40000

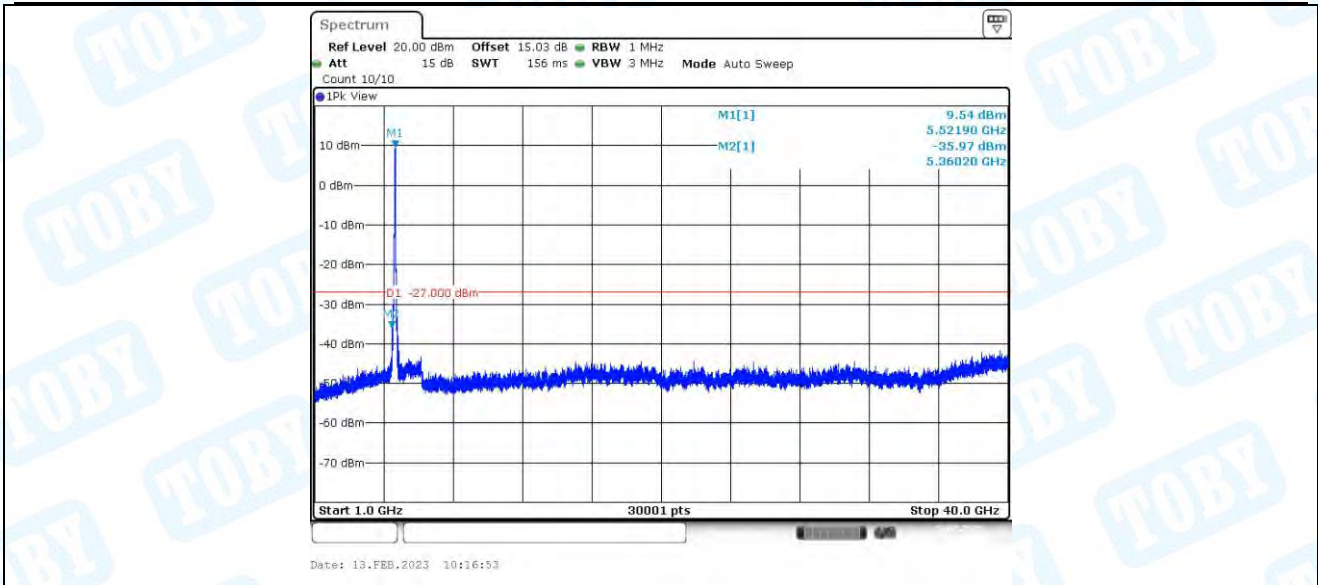


11AC40SISO_AntB_5550_30~1000

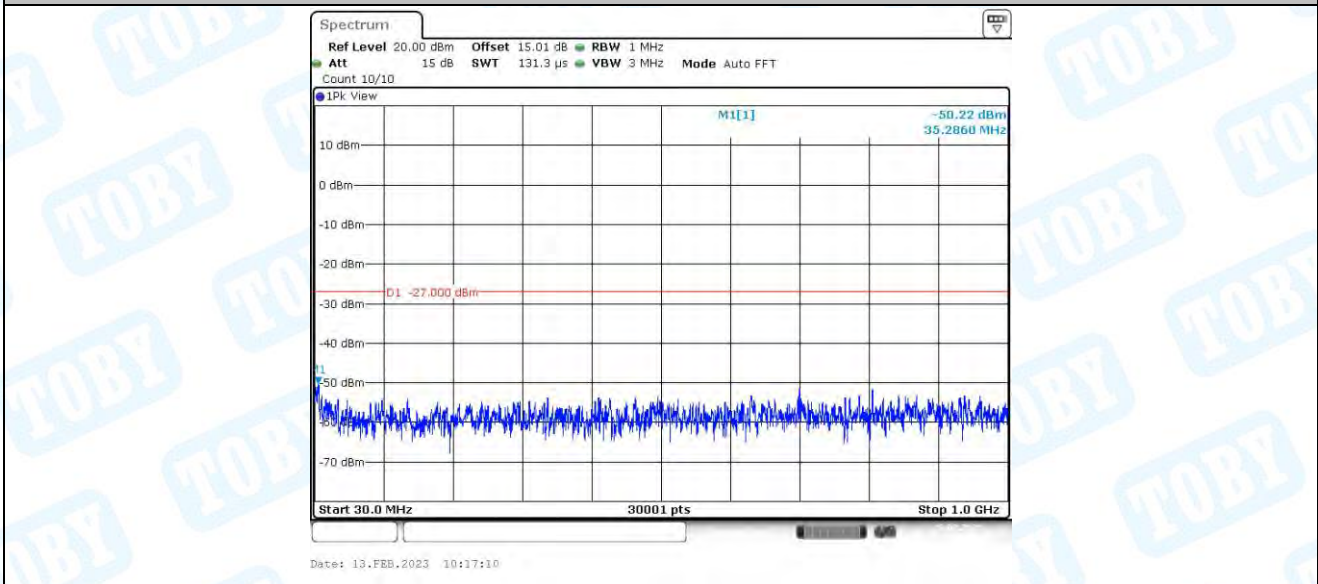


11AC40SISO_AntB_5550_1000~40000

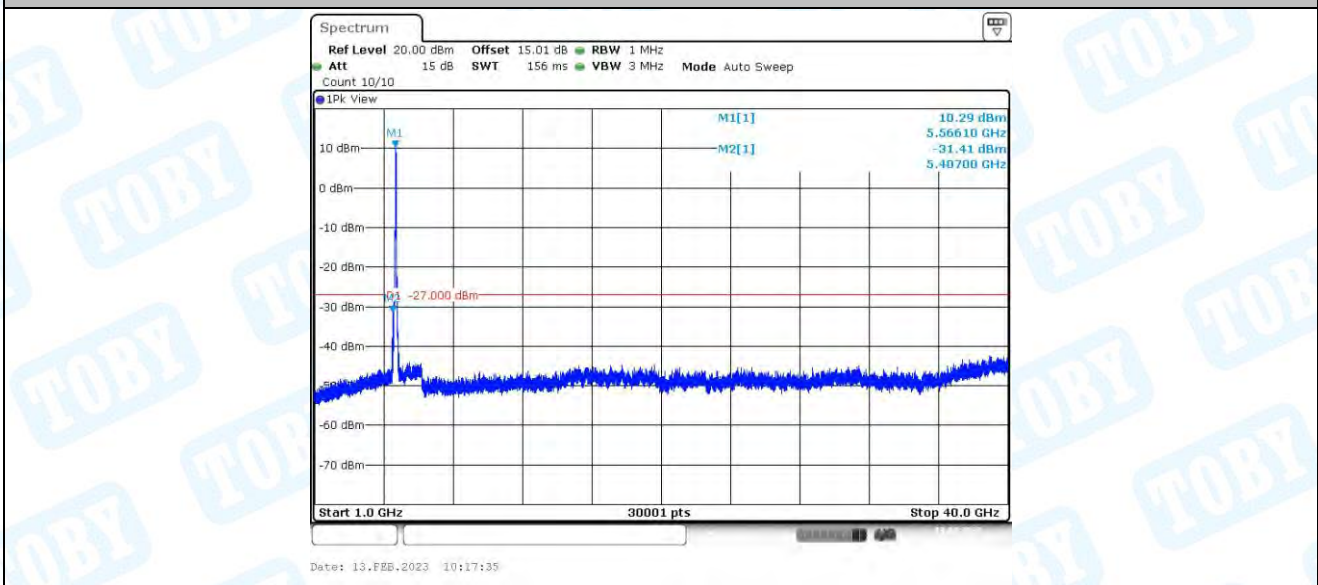


11AC40SISO_AntB_5670_30~1000

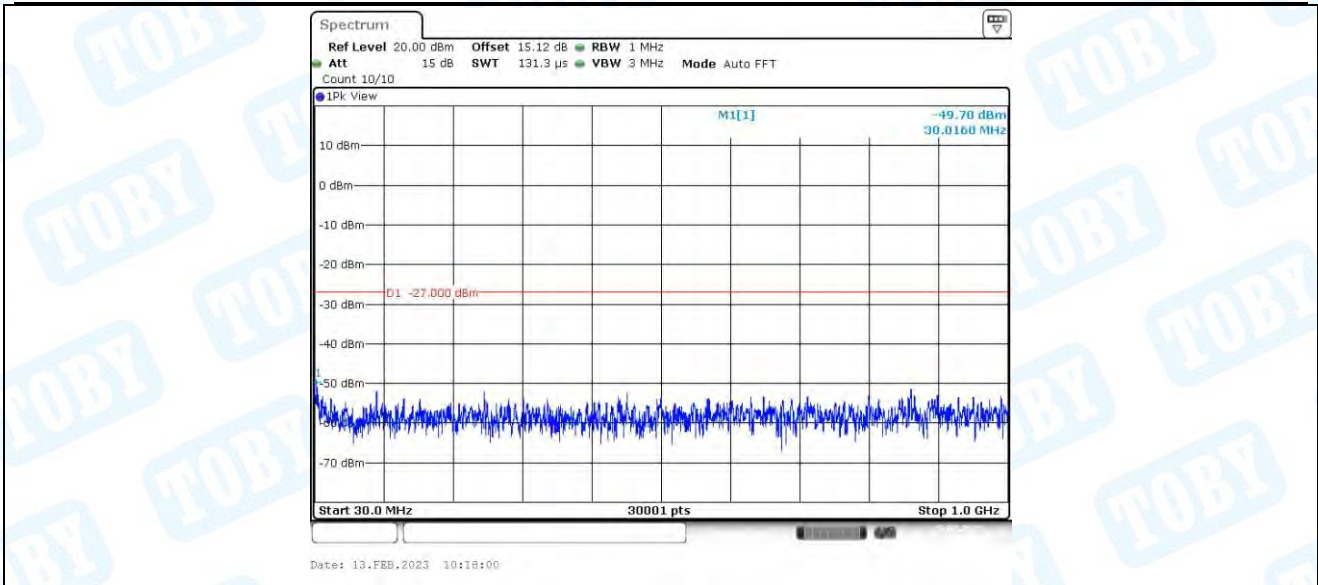


11AC40SISO_AntB_5670_1000~40000

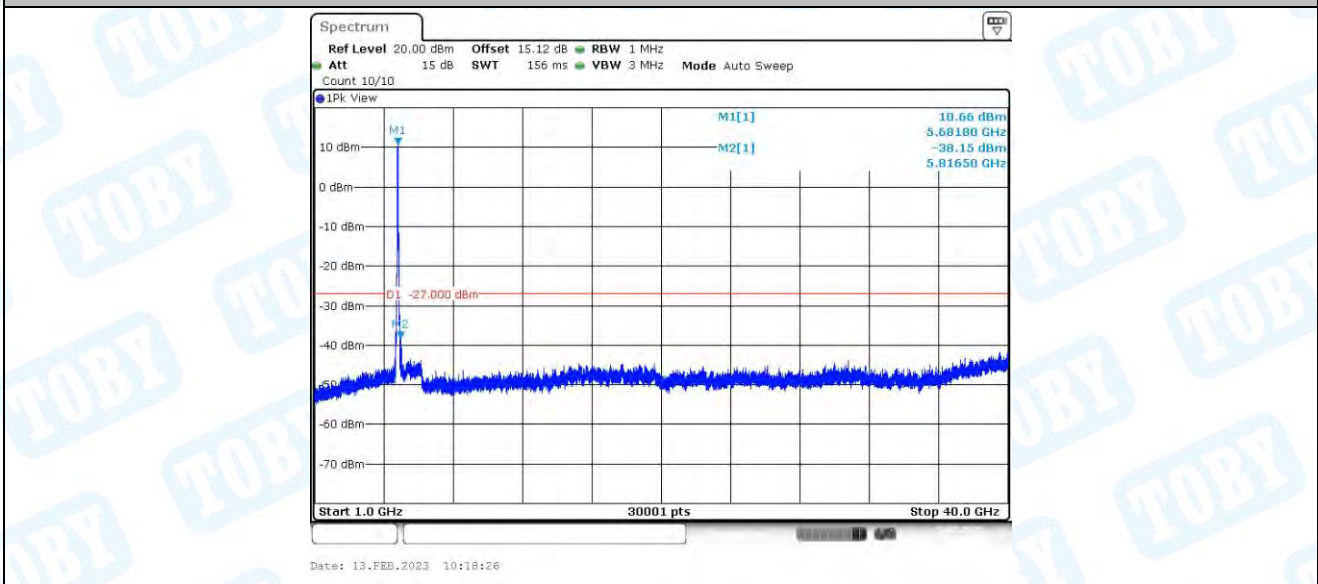


11AC40SISO_AntB_5755_30~1000

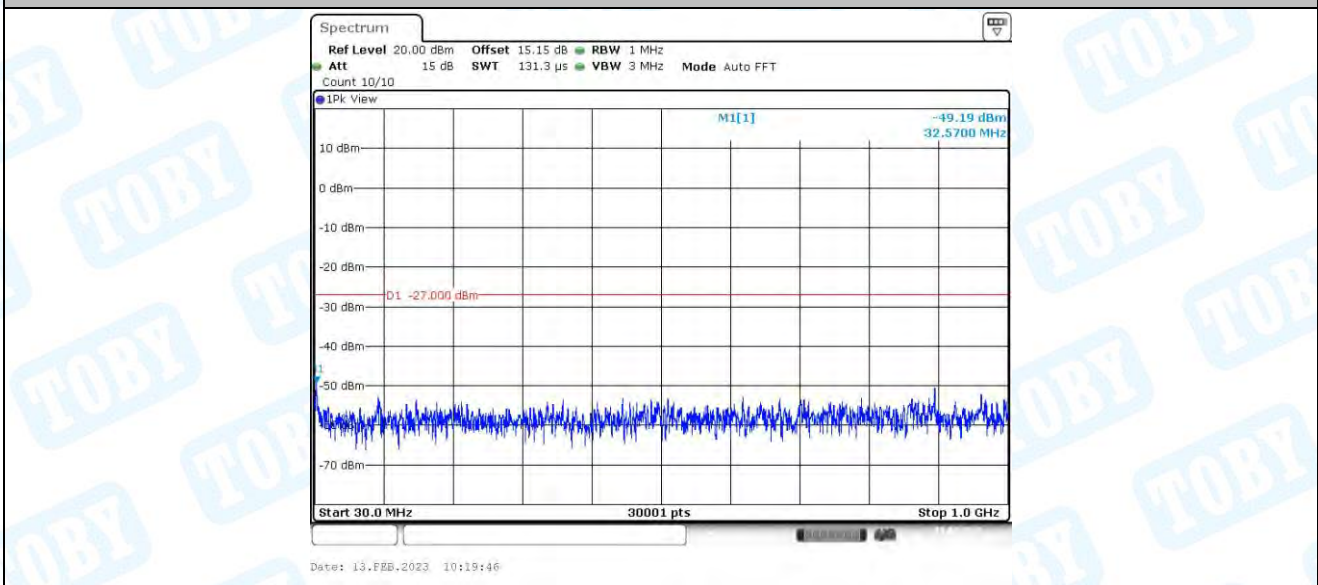


11AC40SISO_AntB_5755_1000~40000

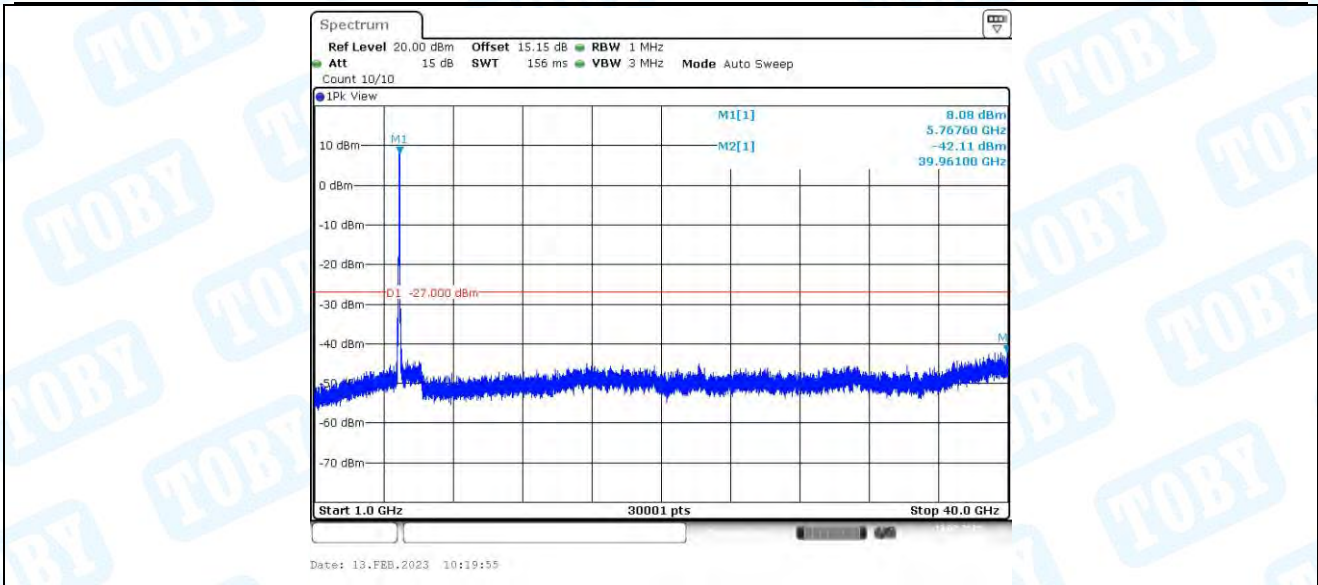


11AC40SISO_AntB_5795_30~1000

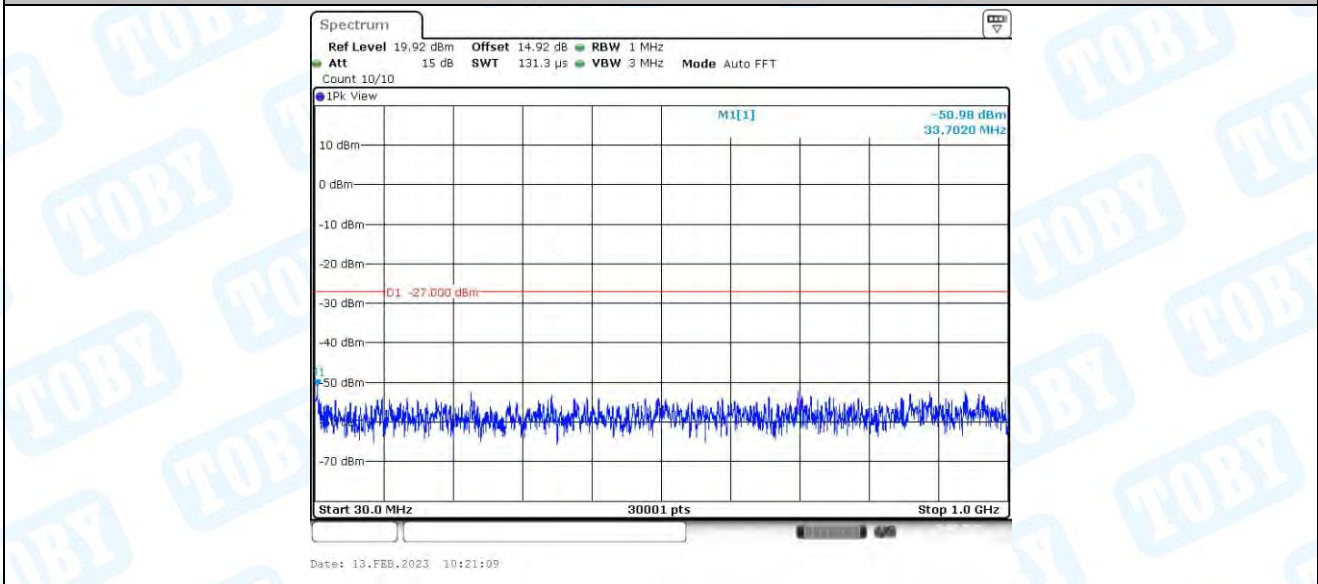


11AC40SISO_AntB_5795_1000~40000

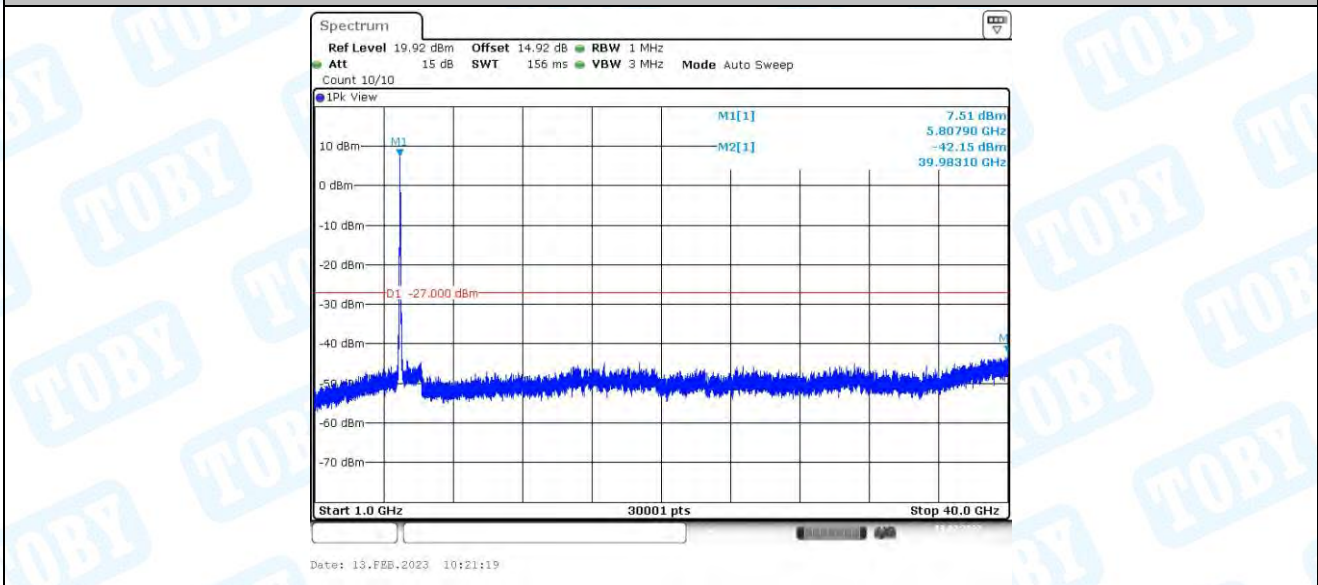


11AC80SISO_AntB_5210_30~1000

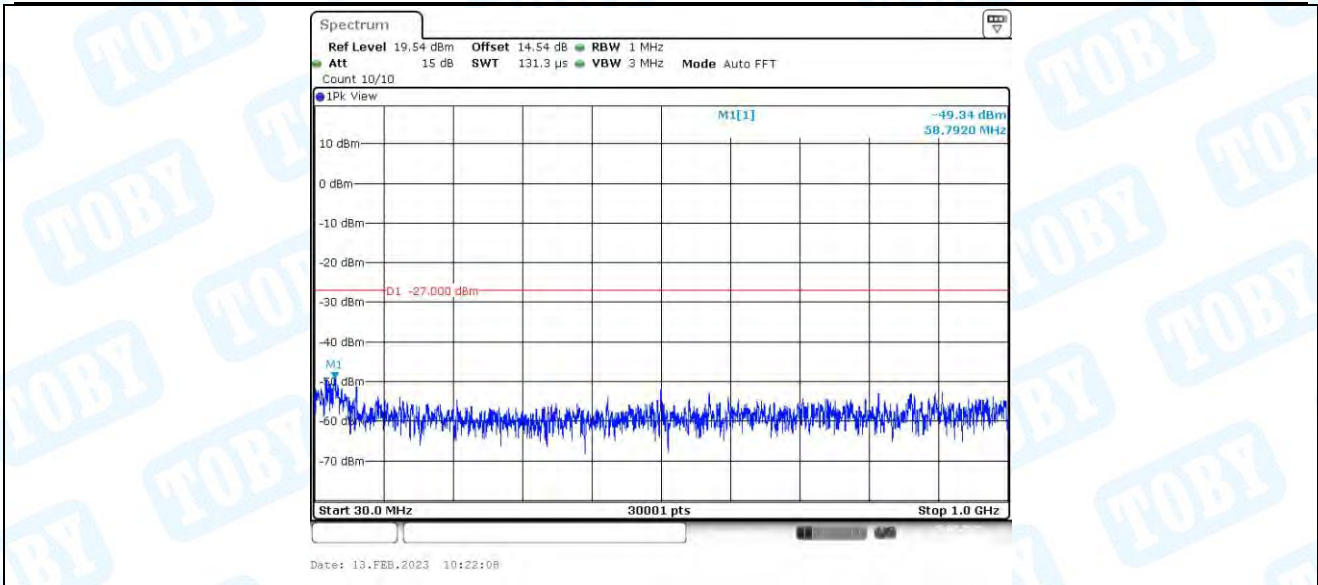


11AC80SISO_AntB_5210_1000~40000

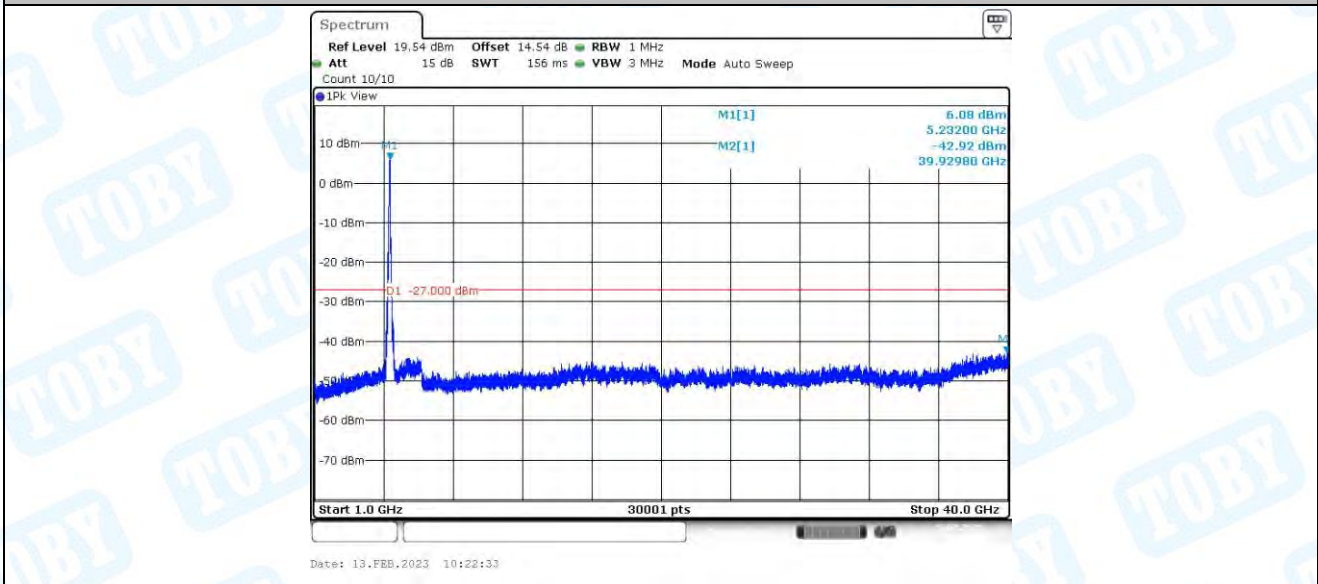


11AC80SISO_AntB_5290_30~1000

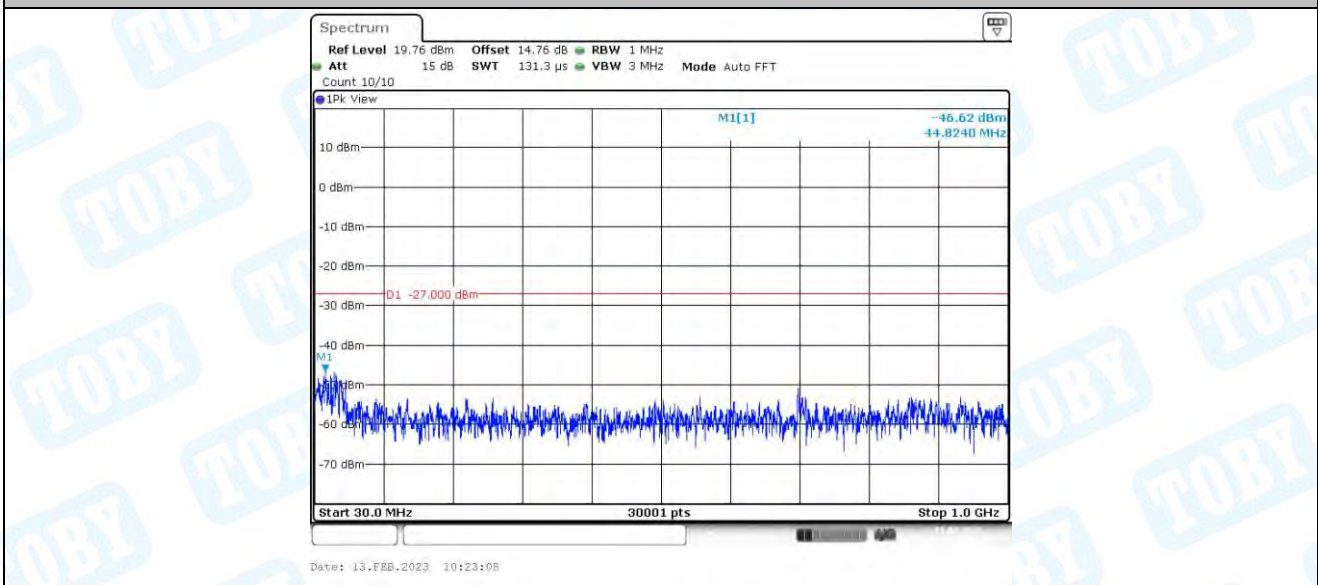


11AC80SISO_AntB_5290_1000~40000

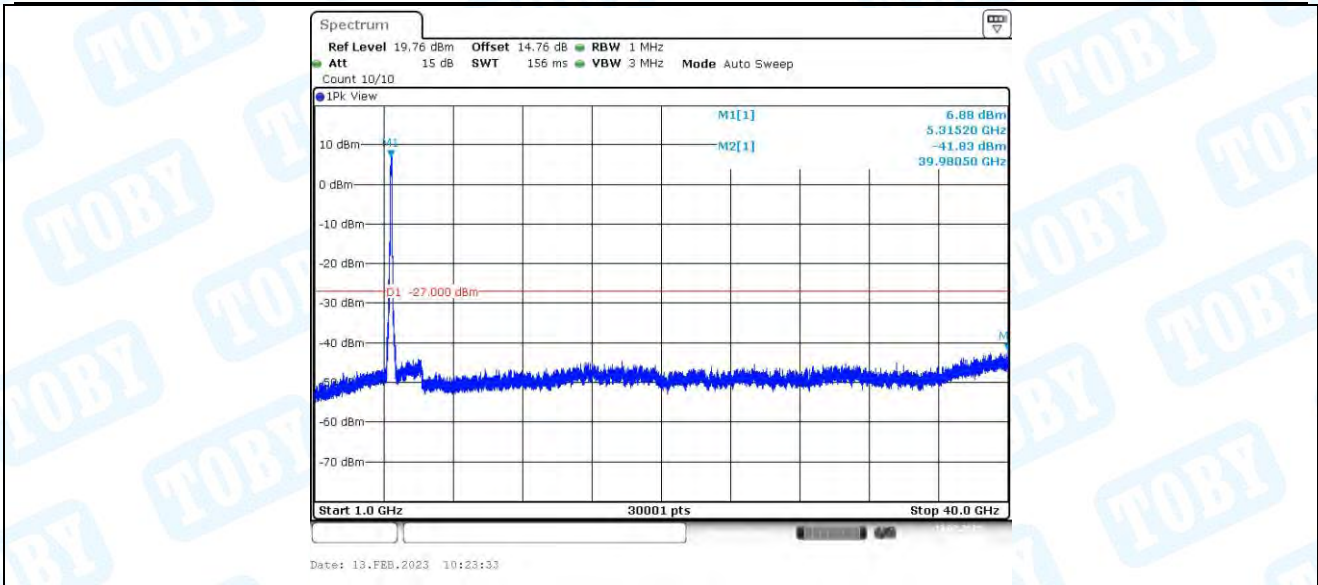


11AC80SISO_AntB_5530_30~1000

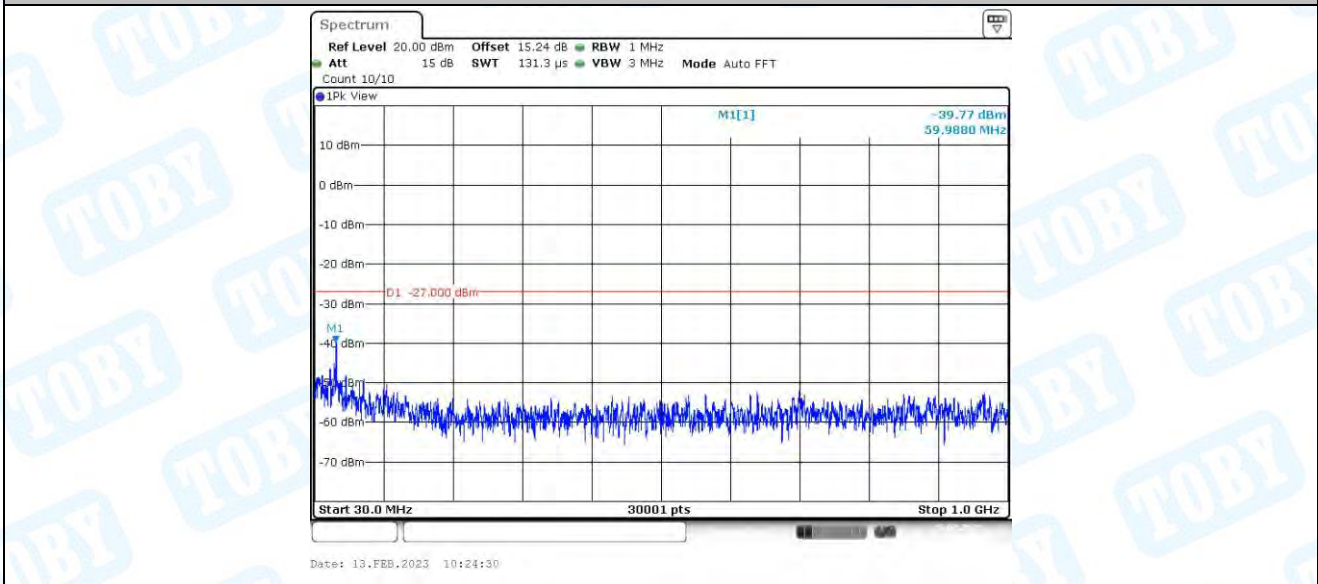


11AC80SISO_AntB_5530_1000~40000

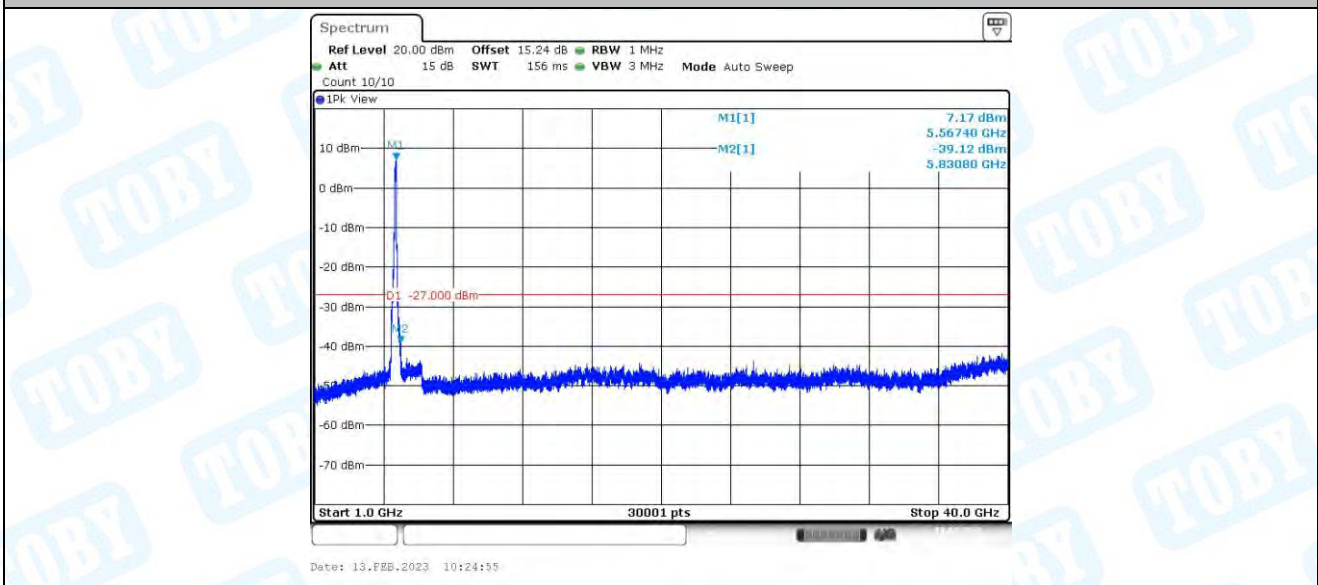


11AC80SISO_AntB_5610_30~1000

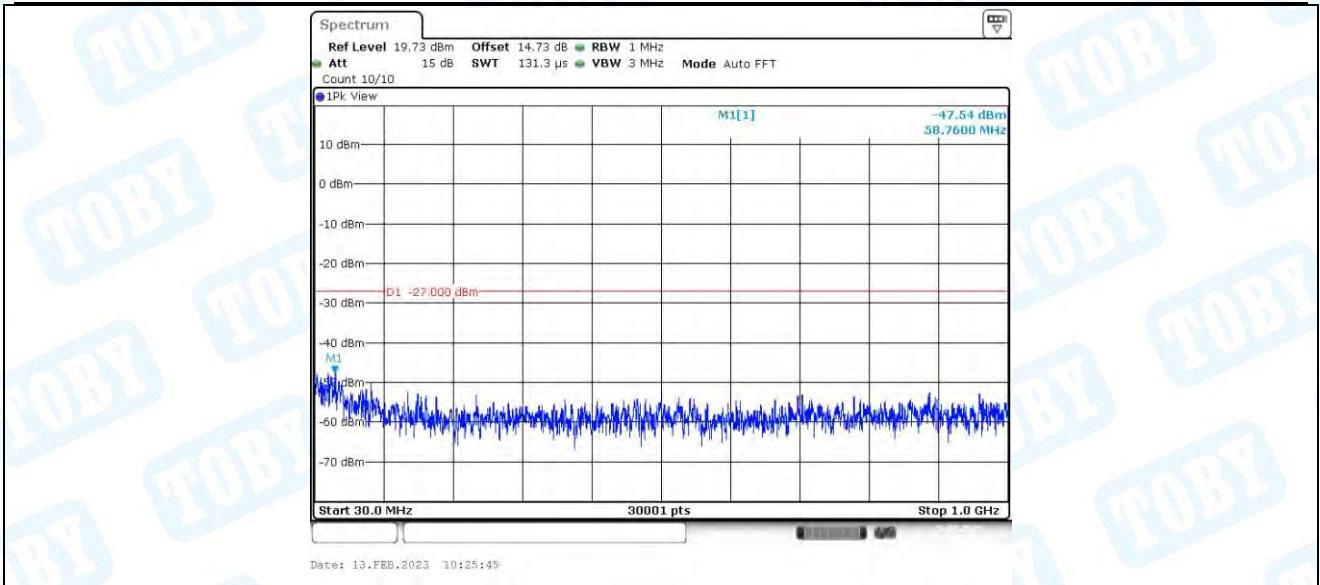


11AC80SISO_AntB_5610_1000~40000

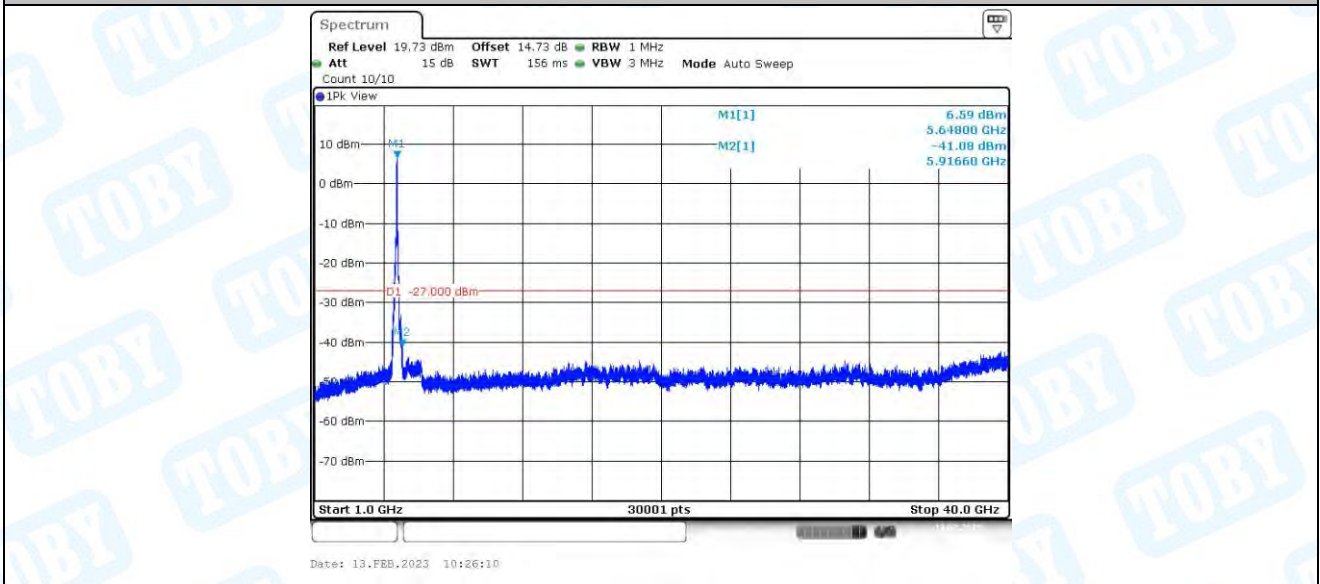

11AC80SISO_AntB_5775_30~1000

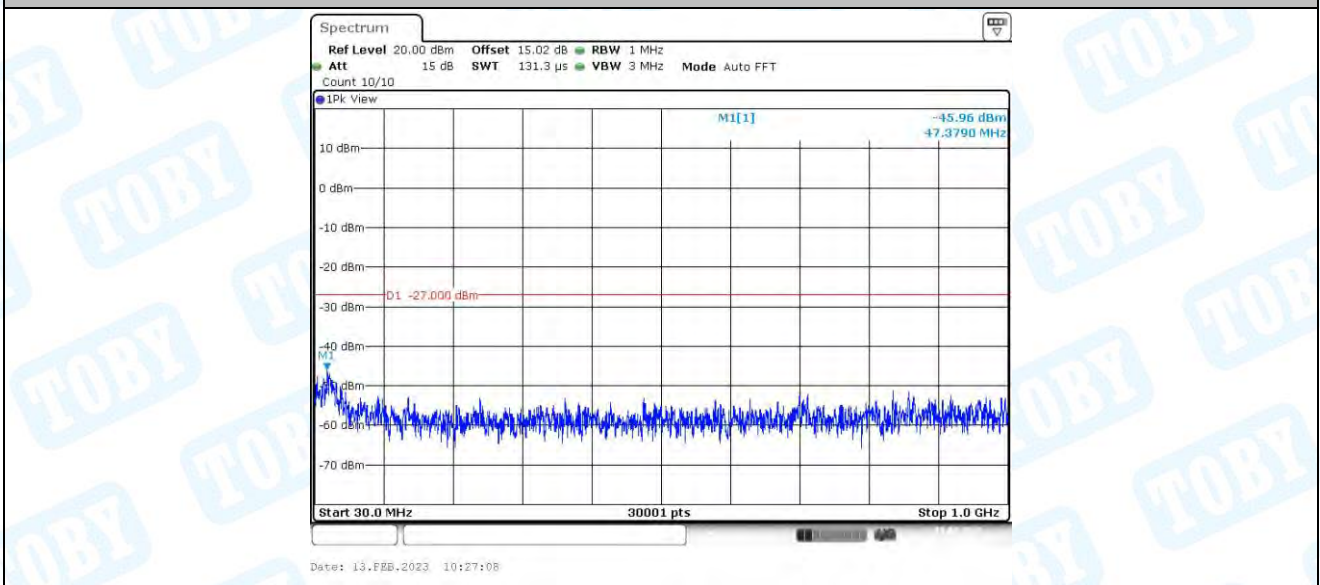

11AC80SISO_AntB_5775_1000~40000

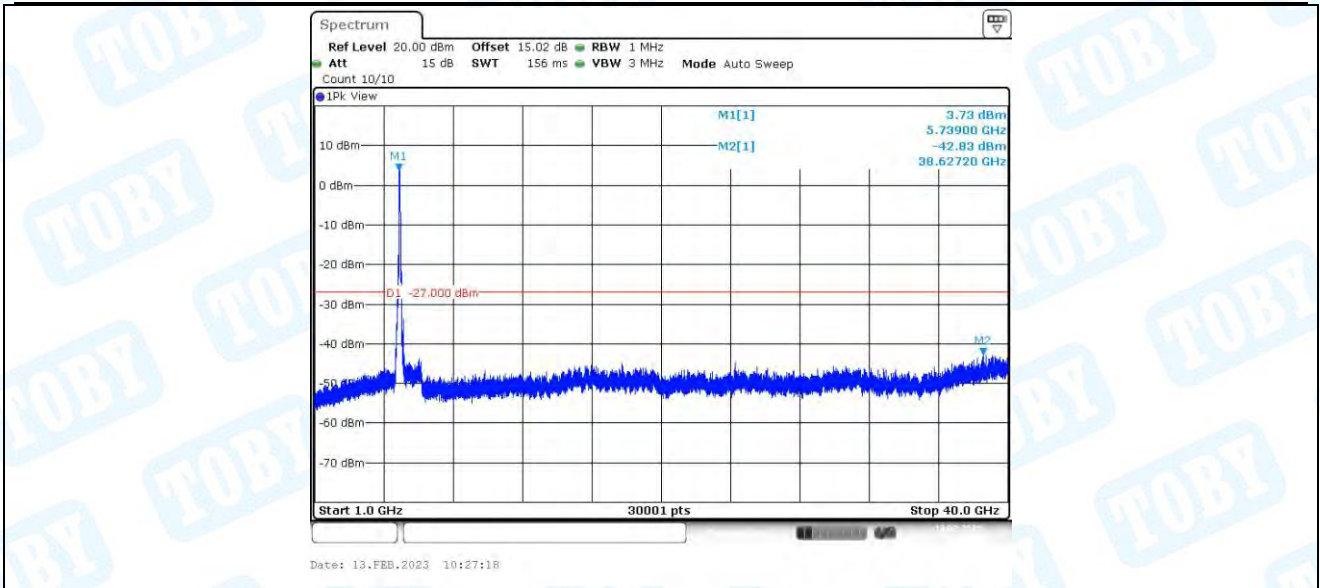

6. Duty Cycle

Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
ac(VHT80)	5210	AntB	86.57	0.63	0.86
a	5180	AntB	90.26	0.45	0.72
a	5200	AntB	90.91	0.41	0.71
a	5240	AntB	90.32	0.44	0.71
ac(VHT20)	5180	AntB	96.4	0.16	0.2
ac(VHT20)	5200	AntB	96.59	0.15	0.2
ac(VHT20)	5240	AntB	96.22	0.17	0.2
ac(VHT40)	5190	AntB	93.12	0.31	0.39
ac(VHT40)	5230	AntB	93.12	0.31	0.39
n(HT20)	5180	AntB	96.22	0.17	0.2
n(HT20)	5200	AntB	96.22	0.17	0.2
n(HT20)	5240	AntB	96.22	0.17	0.2
n(HT40)	5190	AntB	93.56	0.29	0.4
n(HT40)	5230	AntB	92.86	0.32	0.4


Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
a	5260	AntB	90.32	0.44	0.71
a	5280	AntB	91.45	0.39	0.72
a	5320	AntB	90.85	0.42	0.72
ac(VHT20)	5260	AntB	96.22	0.17	0.2
ac(VHT20)	5280	AntB	96.41	0.16	0.2
ac(VHT20)	5320	AntB	96.96	0.13	0.2
ac(VHT40)	5270	AntB	93.12	0.31	0.39
ac(VHT40)	5310	AntB	93.12	0.31	0.39
ac(VHT80)	5290	AntB	86.67	0.62	0.85
n(HT20)	5260	AntB	96.22	0.17	0.2
n(HT20)	5280	AntB	96.4	0.16	0.2
n(HT20)	5320	AntB	96.77	0.14	0.2
n(HT40)	5270	AntB	93.21	0.31	0.4
n(HT40)	5310	AntB	92.51	0.34	0.4

Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
a	5500	AntB	92.11	0.36	0.71
a	5600	AntB	90.32	0.44	0.71
a	5700	AntB	90.85	0.42	0.72
ac(VHT20)	5500	AntB	96.22	0.17	0.2
ac(VHT20)	5600	AntB	96.22	0.17	0.2
ac(VHT20)	5700	AntB	96.22	0.17	0.2
ac(VHT40)	5510	AntB	93.12	0.31	0.39
ac(VHT40)	5550	AntB	93.12	0.31	0.39
ac(VHT40)	5670	AntB	93.8	0.28	0.39
ac(VHT80)	5530	AntB	86.67	0.62	0.85
ac(VHT80)	5610	AntB	86.67	0.62	0.85
n(HT20)	5500	AntB	96.04	0.18	0.2
n(HT20)	5600	AntB	95.86	0.18	0.2
n(HT20)	5700	AntB	96.04	0.18	0.2
n(HT40)	5510	AntB	92.16	0.35	0.4
n(HT40)	5550	AntB	92.16	0.35	0.4
n(HT40)	5670	AntB	92.51	0.34	0.4


Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
a	5745	AntB	91.5	0.39	0.71
a	5785	AntB	92.11	0.36	0.71
a	5825	AntB	90.91	0.41	0.71
ac(VHT20)	5745	AntB	95.15	0.22	0.2
ac(VHT20)	5785	AntB	96.77	0.14	0.2
ac(VHT20)	5825	AntB	96.22	0.17	0.2
ac(VHT40)	5755	AntB	93.8	0.28	0.39
ac(VHT40)	5795	AntB	93.45	0.29	0.39
ac(VHT80)	5775	AntB	85.93	0.66	0.86
n(HT20)	5745	AntB	96.22	0.17	0.2
n(HT20)	5785	AntB	96.03	0.18	0.2
n(HT20)	5825	AntB	96.22	0.17	0.2
n(HT40)	5755	AntB	93.8	0.28	0.39
n(HT40)	5795	AntB	93.12	0.31	0.39

Test Graphs


Duty Cycle NVNT ac(VHT80) 5210MHz AntB

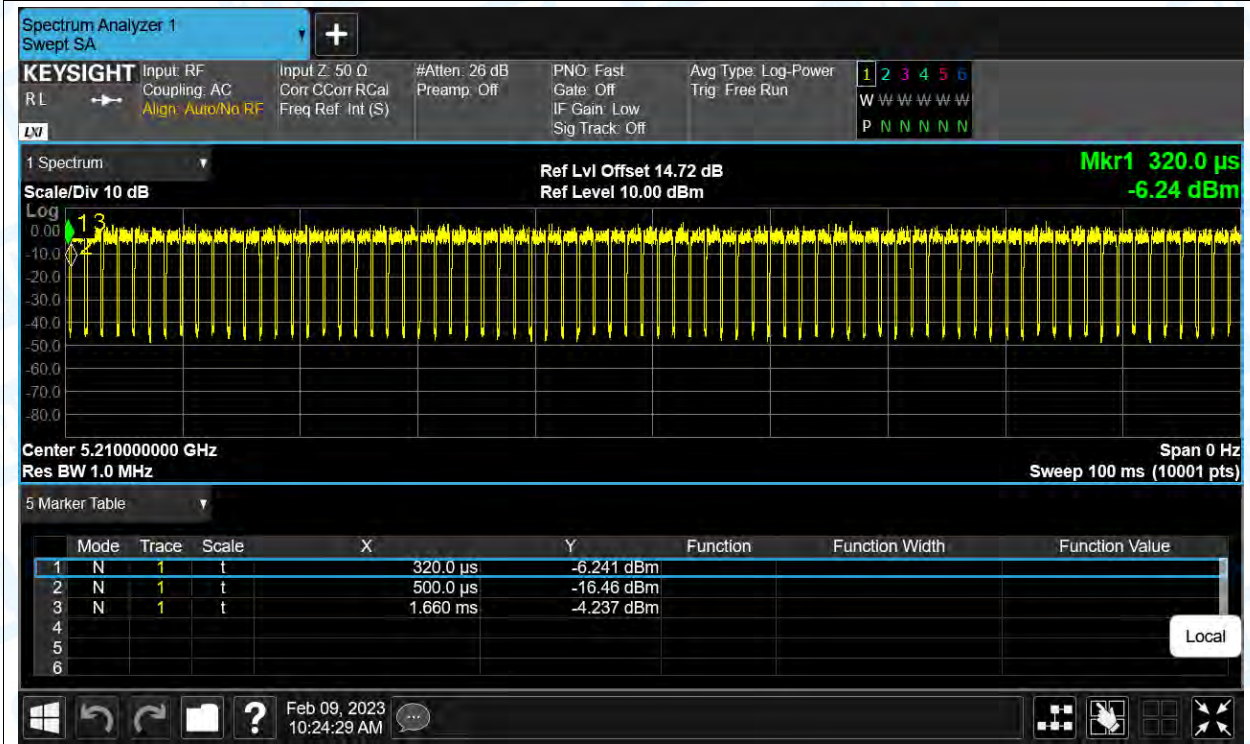


Duty Cycle NVNT a 5180MHz AntB

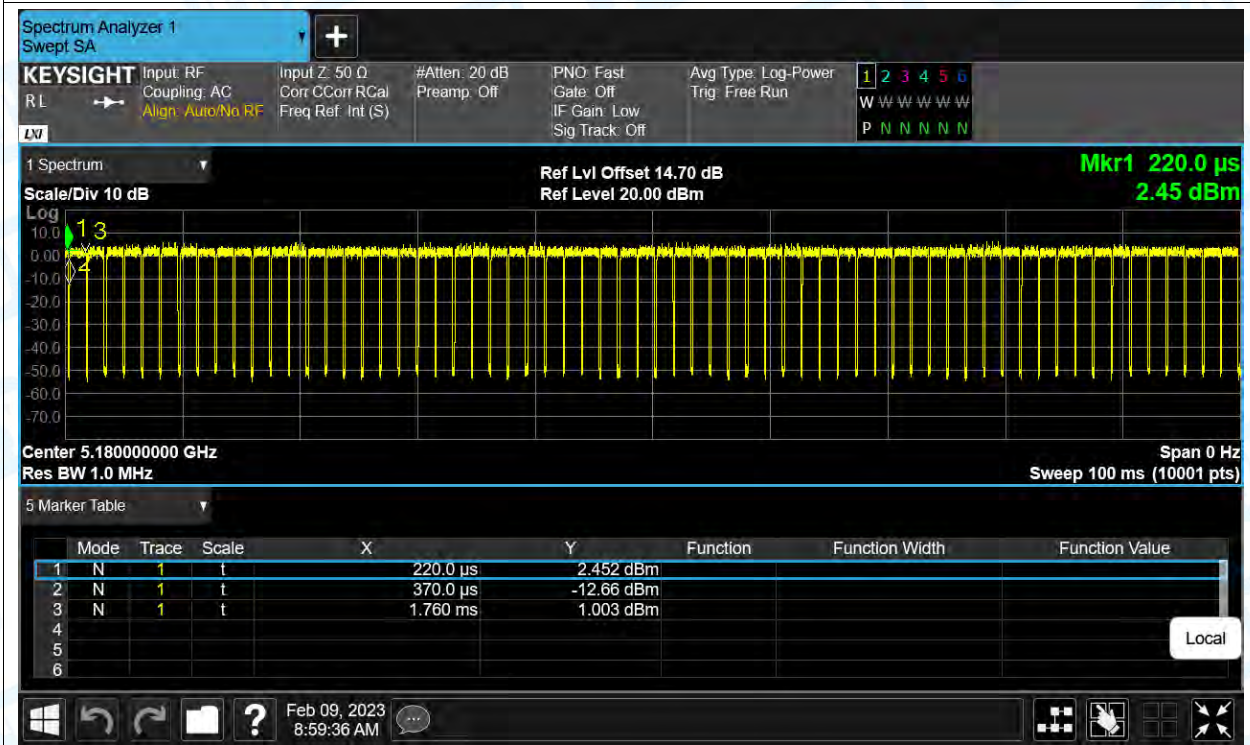


Duty Cycle NVNT a 5200MHz AntB

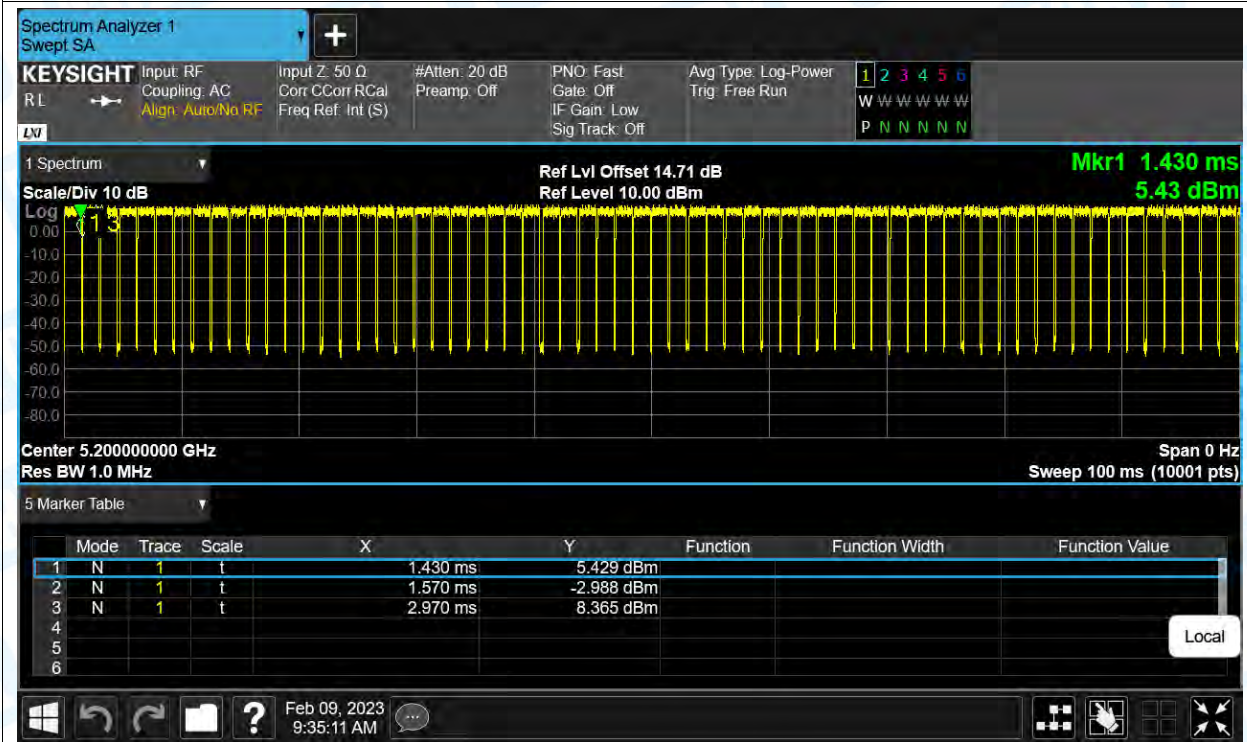


Duty Cycle NVNT a 5240MHz AntB

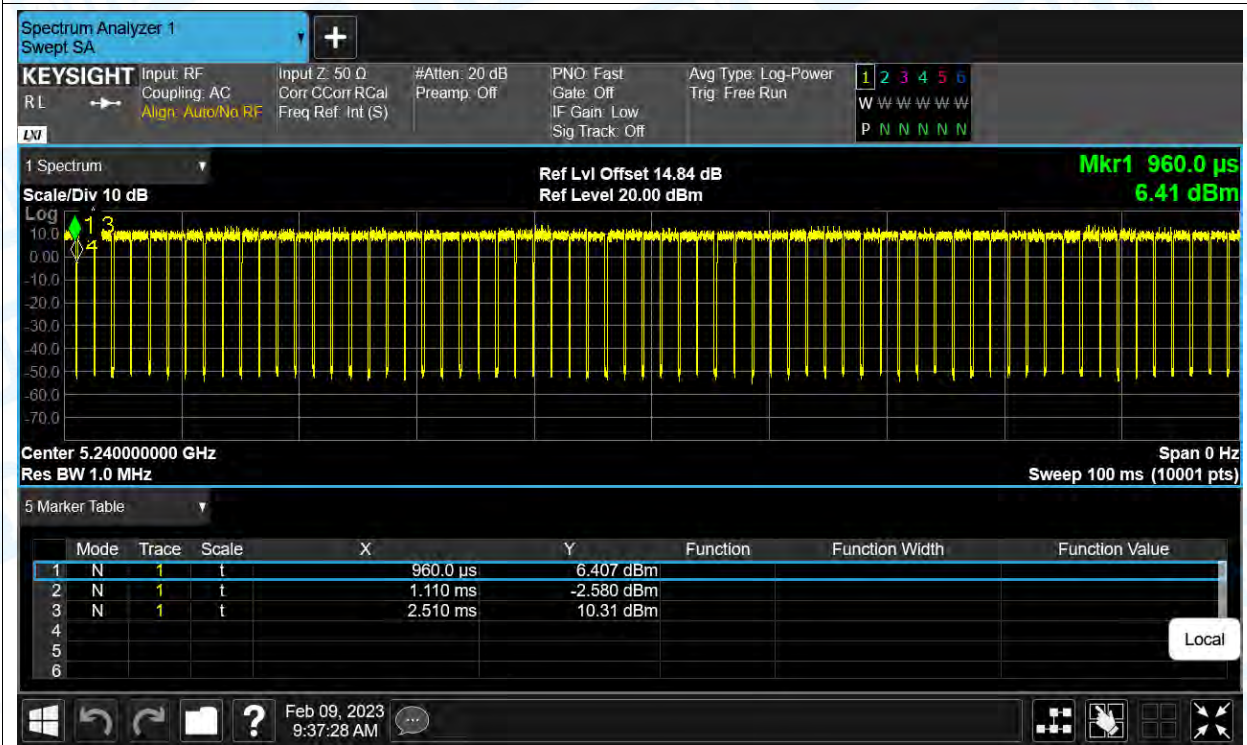


Duty Cycle NVNT ac(VHT20) 5180MHz AntB

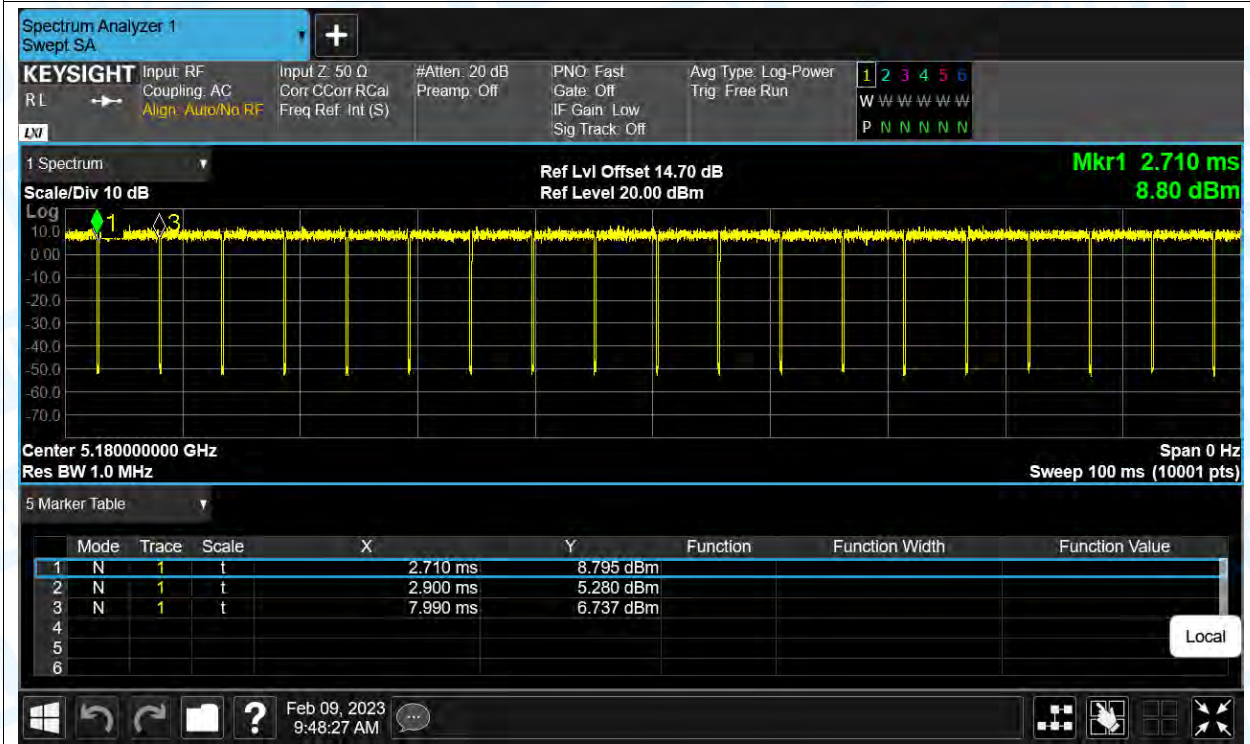


Duty Cycle NVNT ac(VHT20) 5200MHz AntB

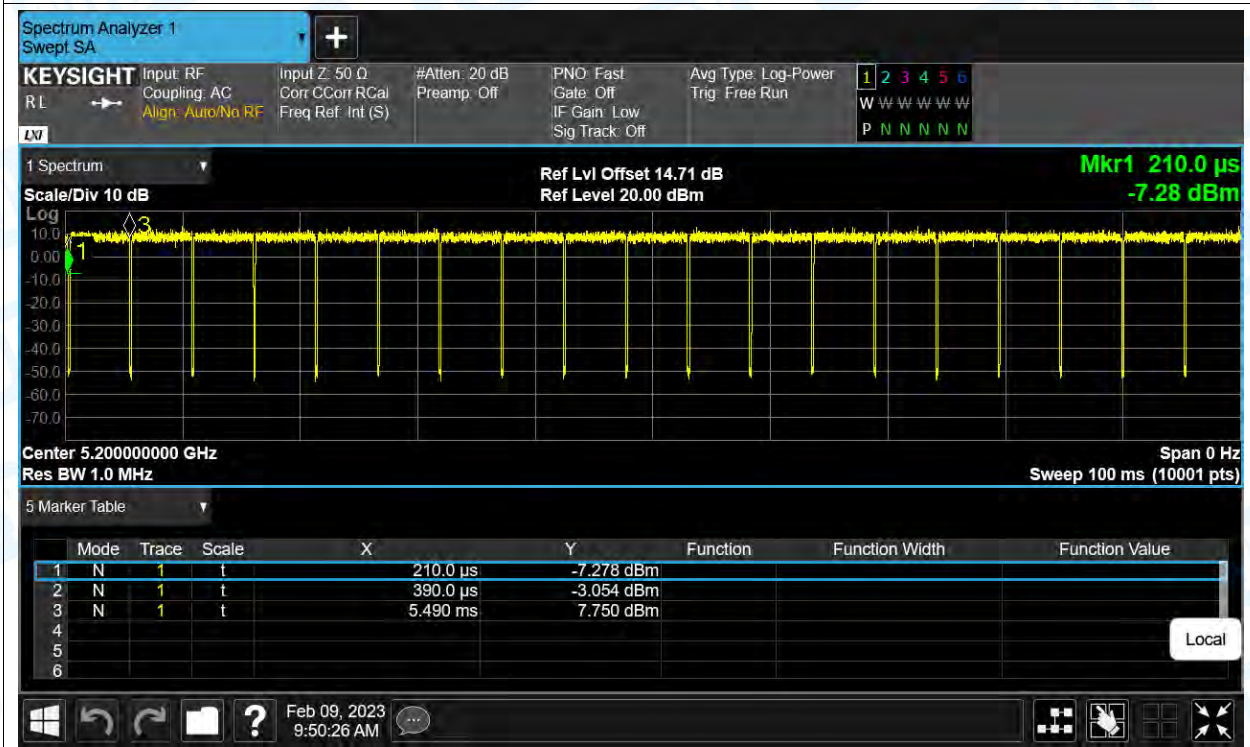


Duty Cycle NVNT ac(VHT20) 5240MHz AntB

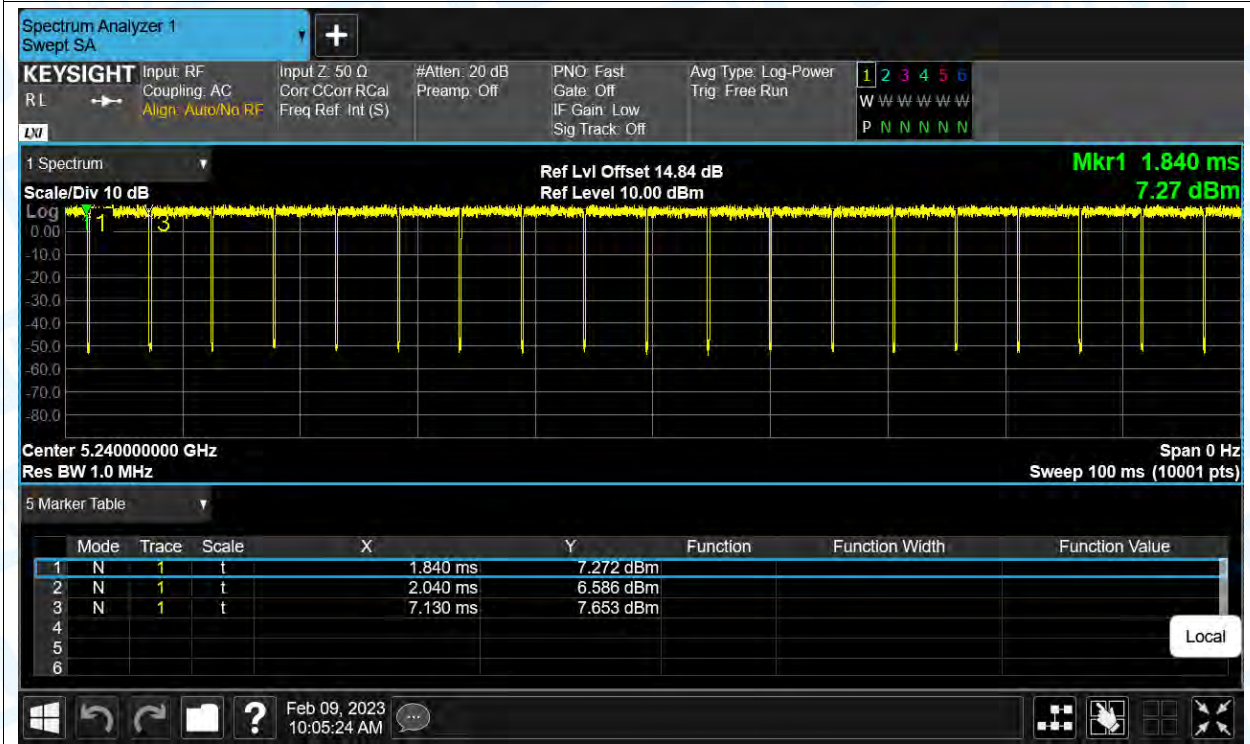


Duty Cycle NVNT ac(VHT40) 5190MHz AntB

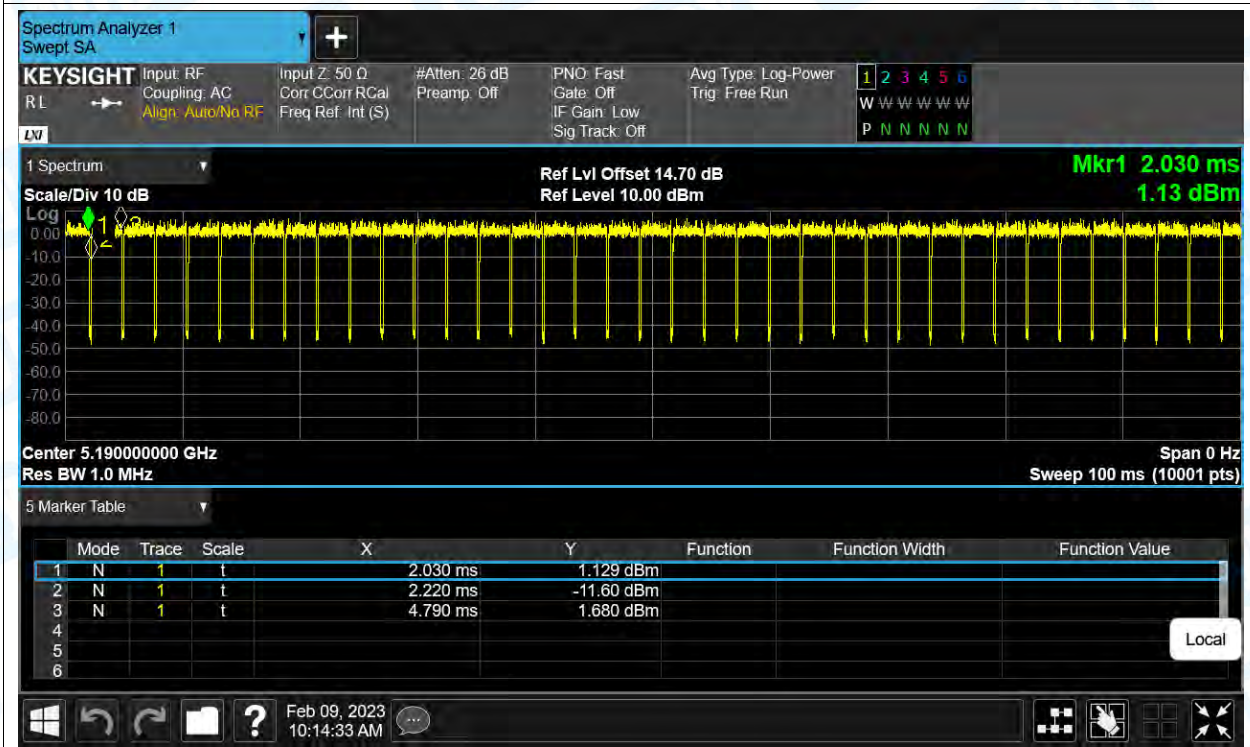


Duty Cycle NVNT ac(VHT40) 5230MHz AntB

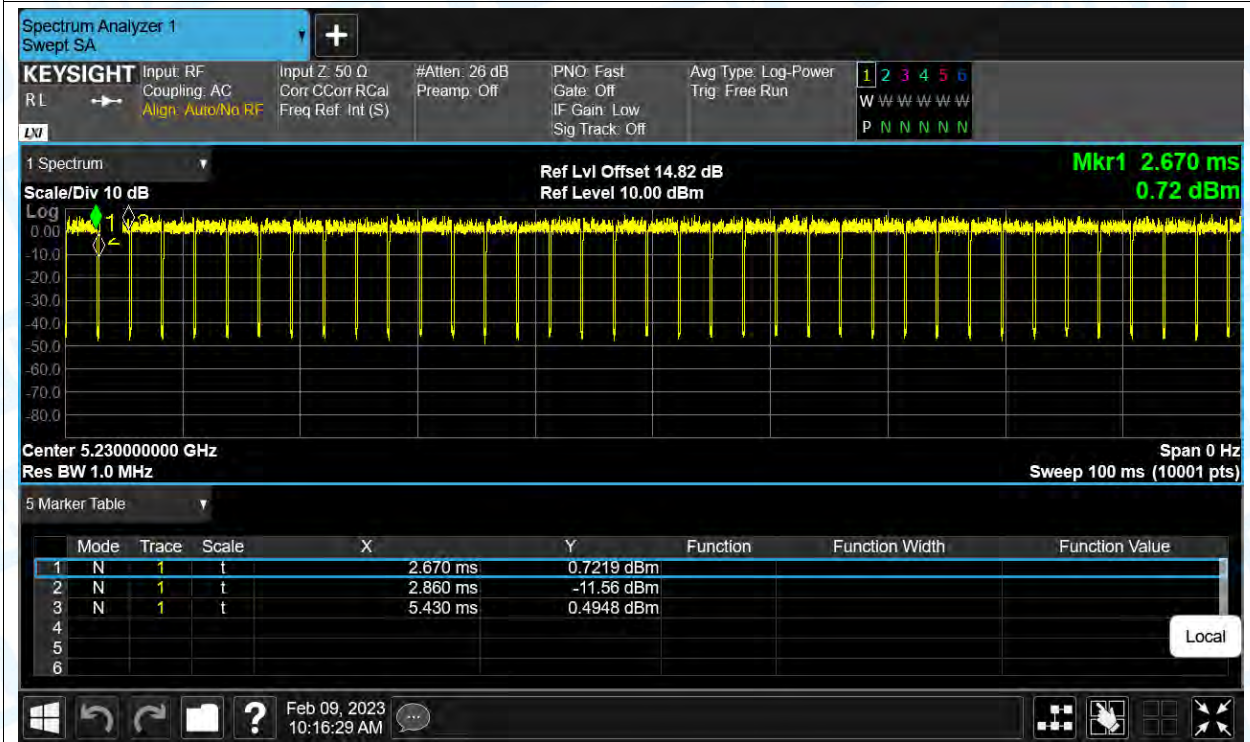


Duty Cycle NVNT n(HT20) 5180MHz AntB

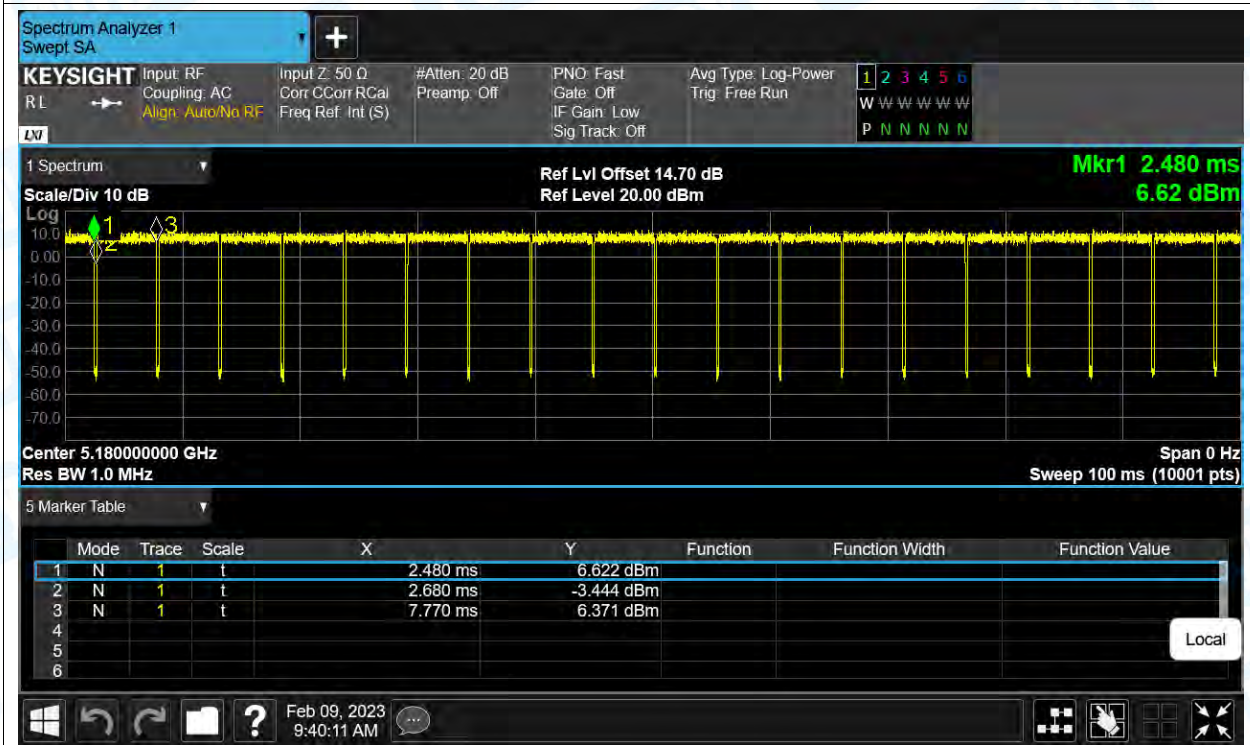


Duty Cycle NVNT n(HT20) 5200MHz AntB

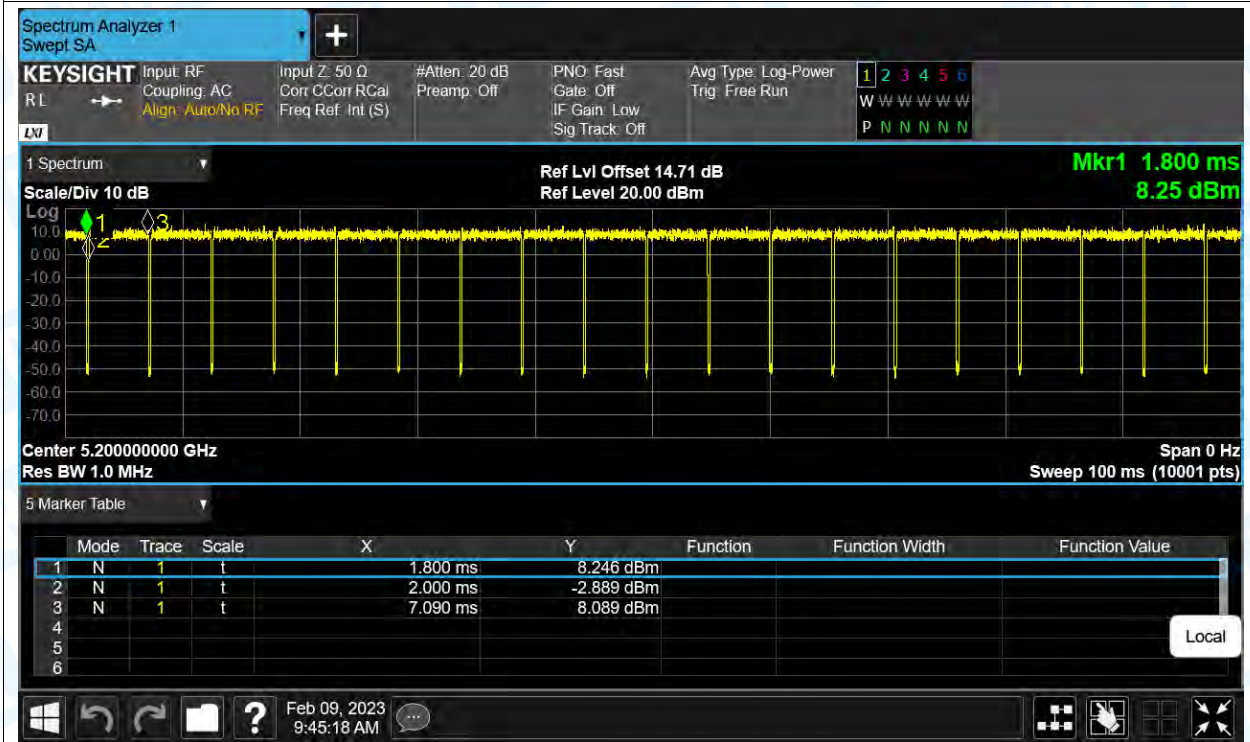


Duty Cycle NVNT n(HT20) 5240MHz AntB

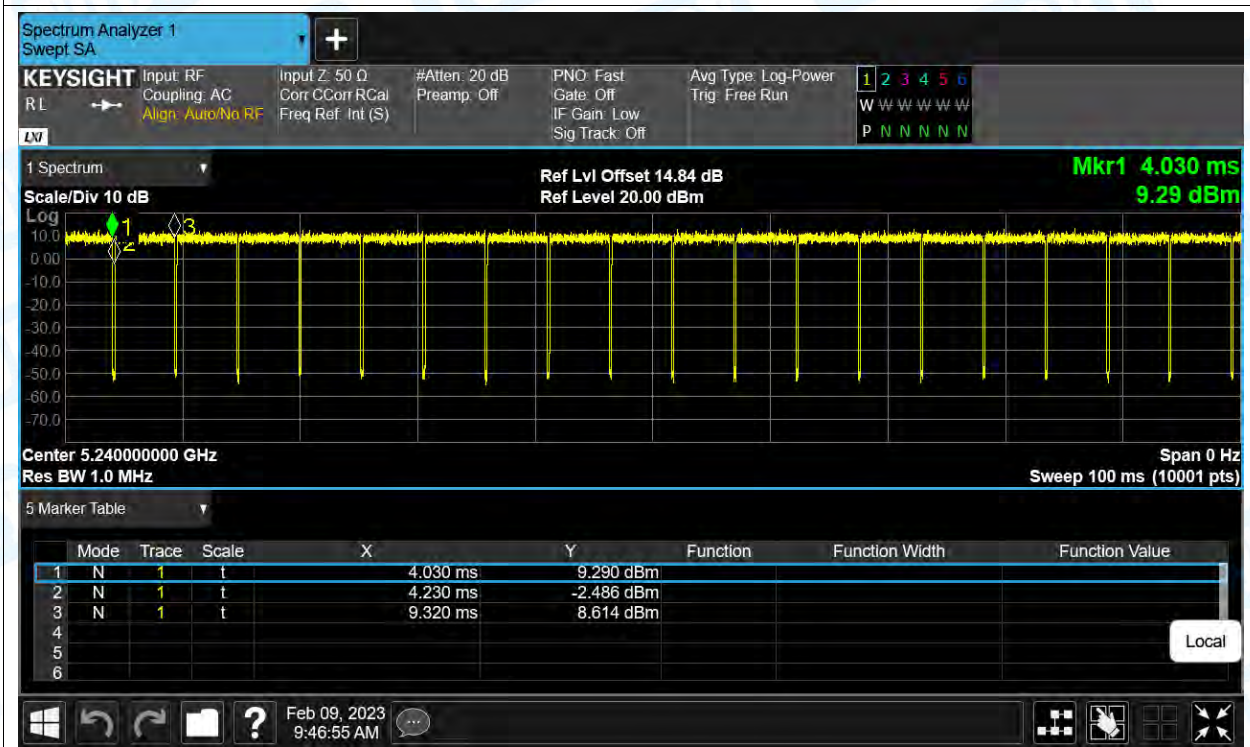

Duty Cycle NVNT n(HT40) 5190MHz AntB

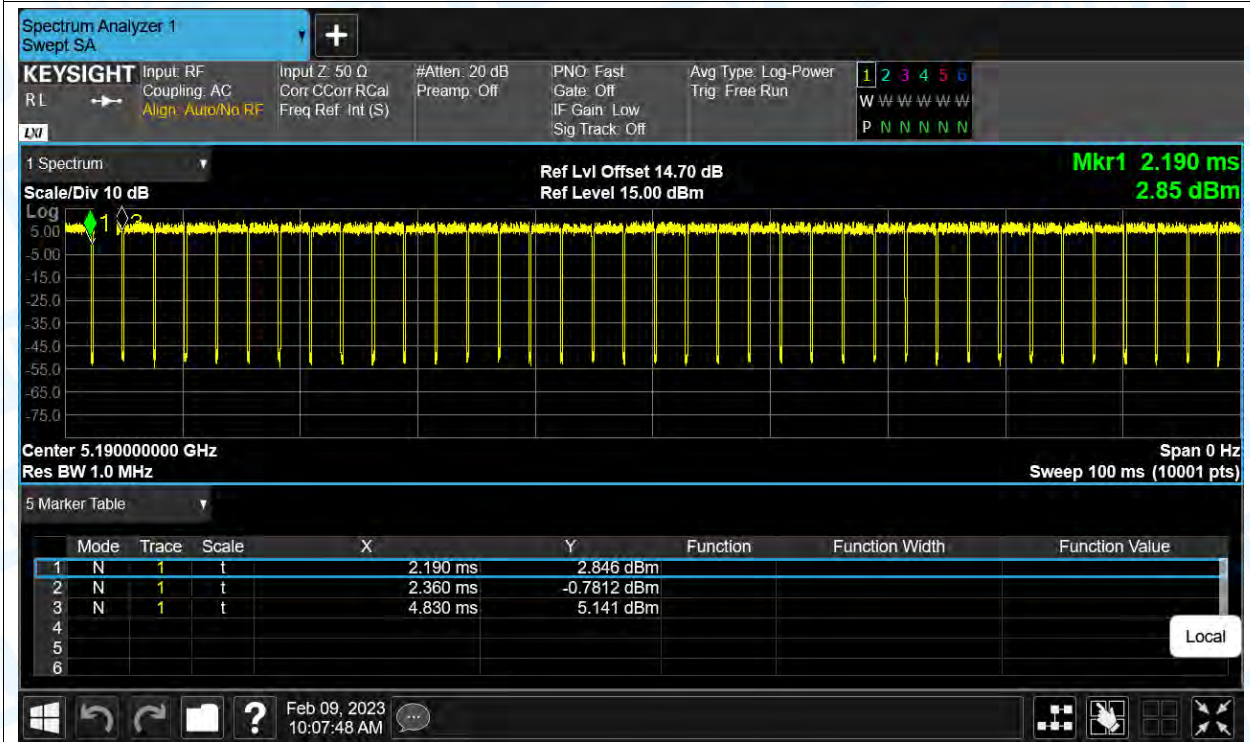


Duty Cycle NVNT n(HT40) 5230MHz AntB

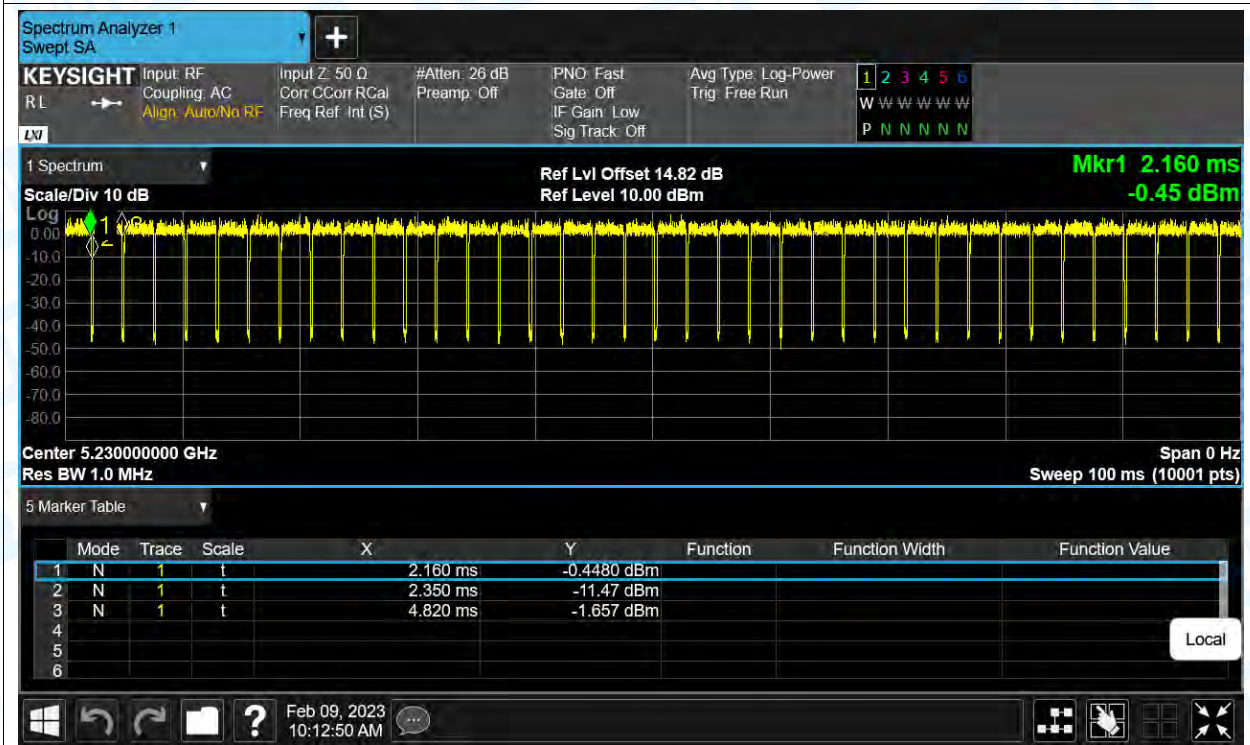


Test Graphs


Duty Cycle NVNT a 5260MHz AntB

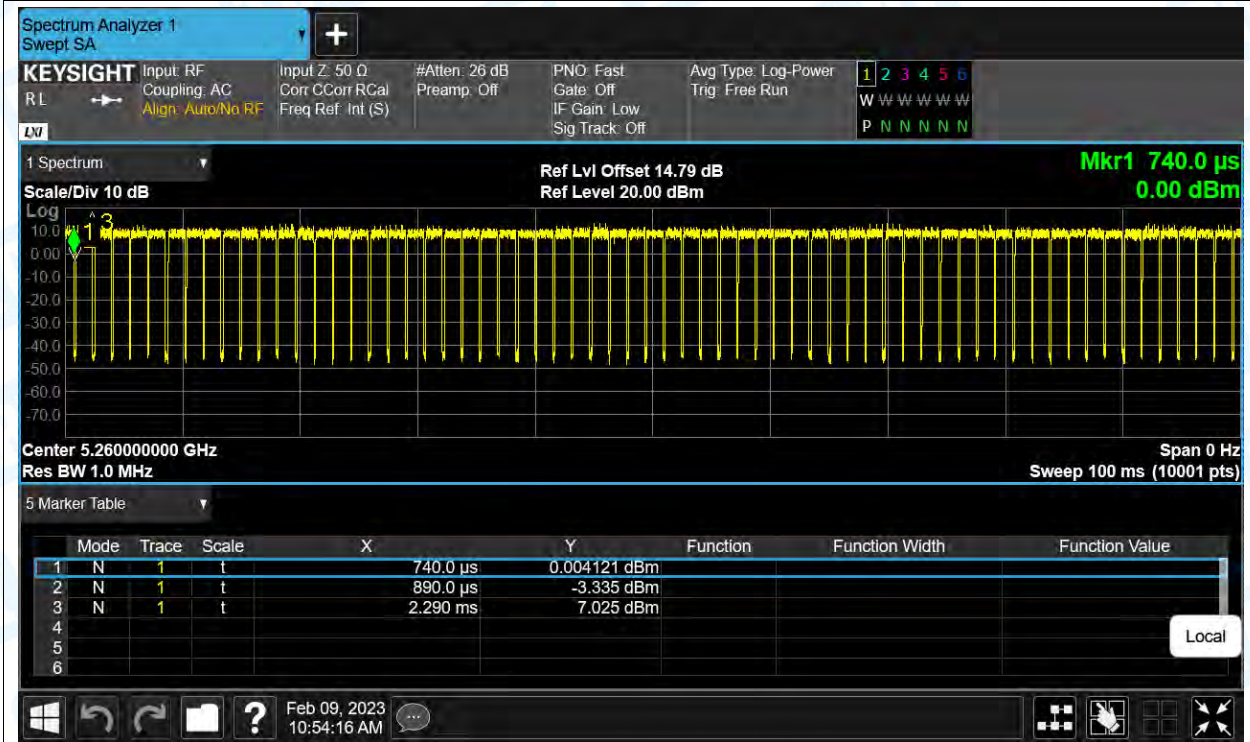


Duty Cycle NVNT a 5280MHz AntB

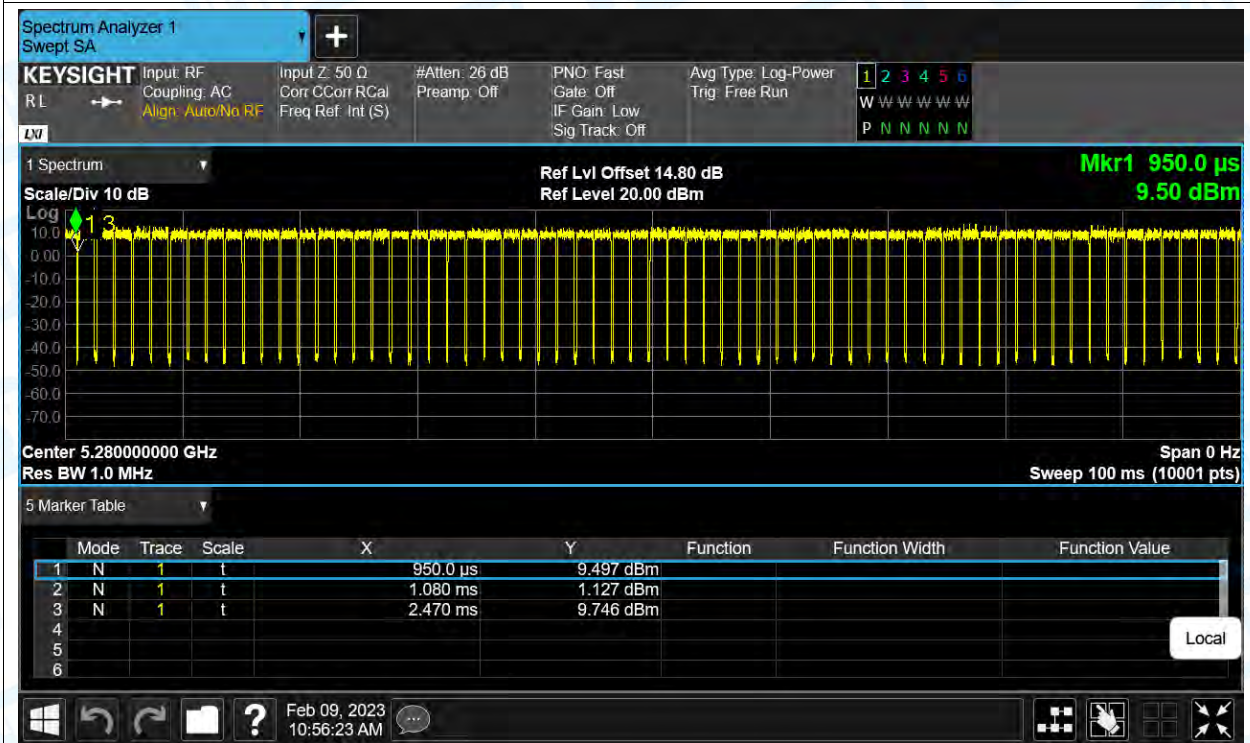


Duty Cycle NVNT a 5320MHz AntB

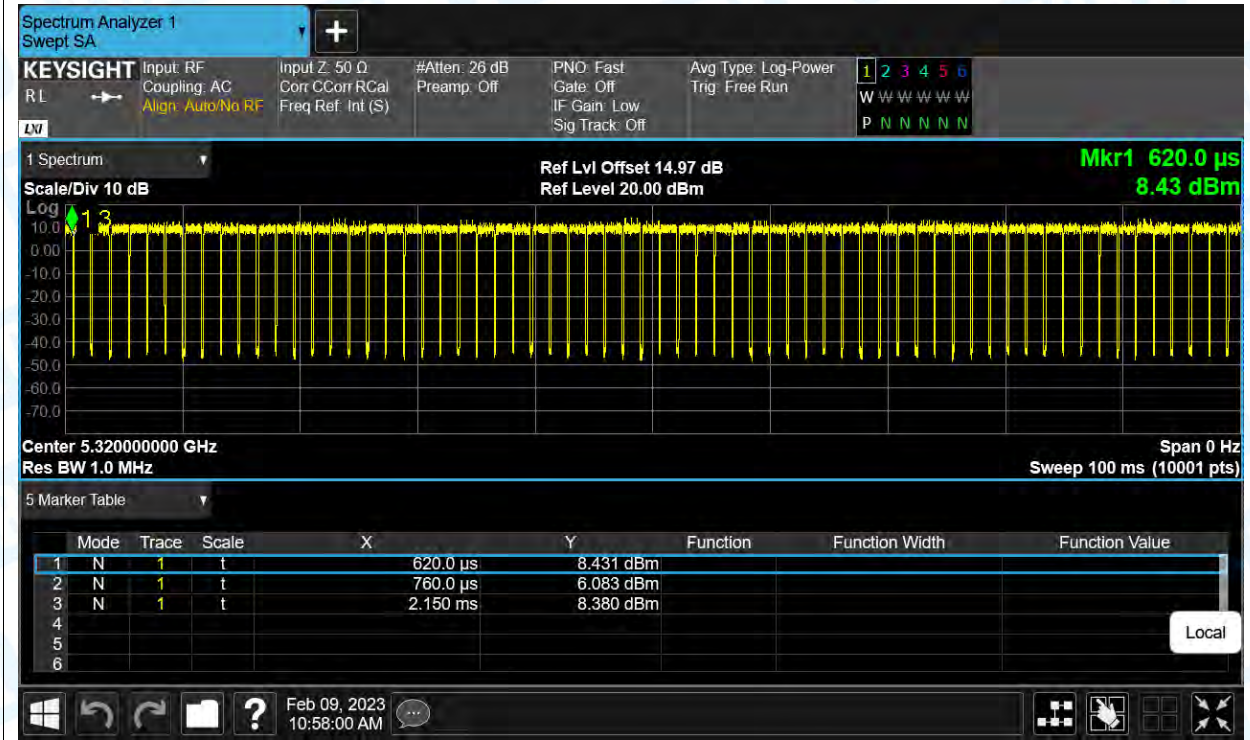


Duty Cycle NVNT ac(VHT20) 5260MHz AntB

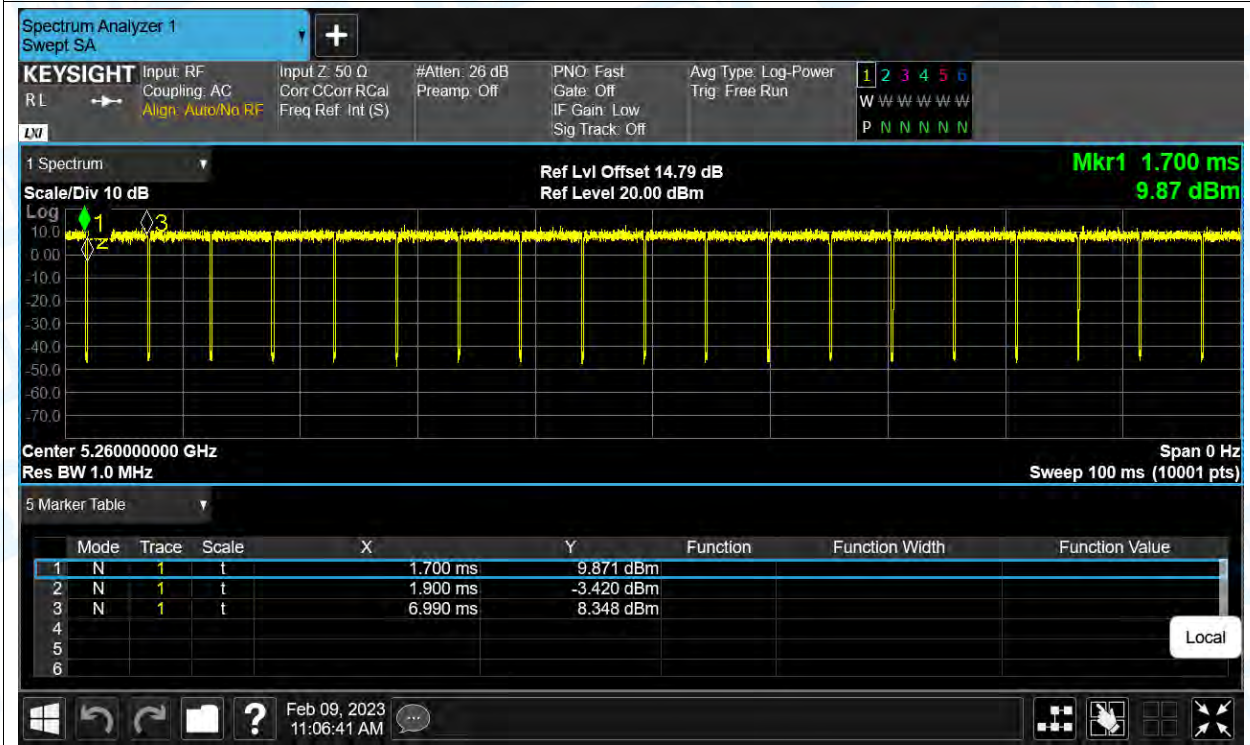


Duty Cycle NVNT ac(VHT20) 5280MHz AntB

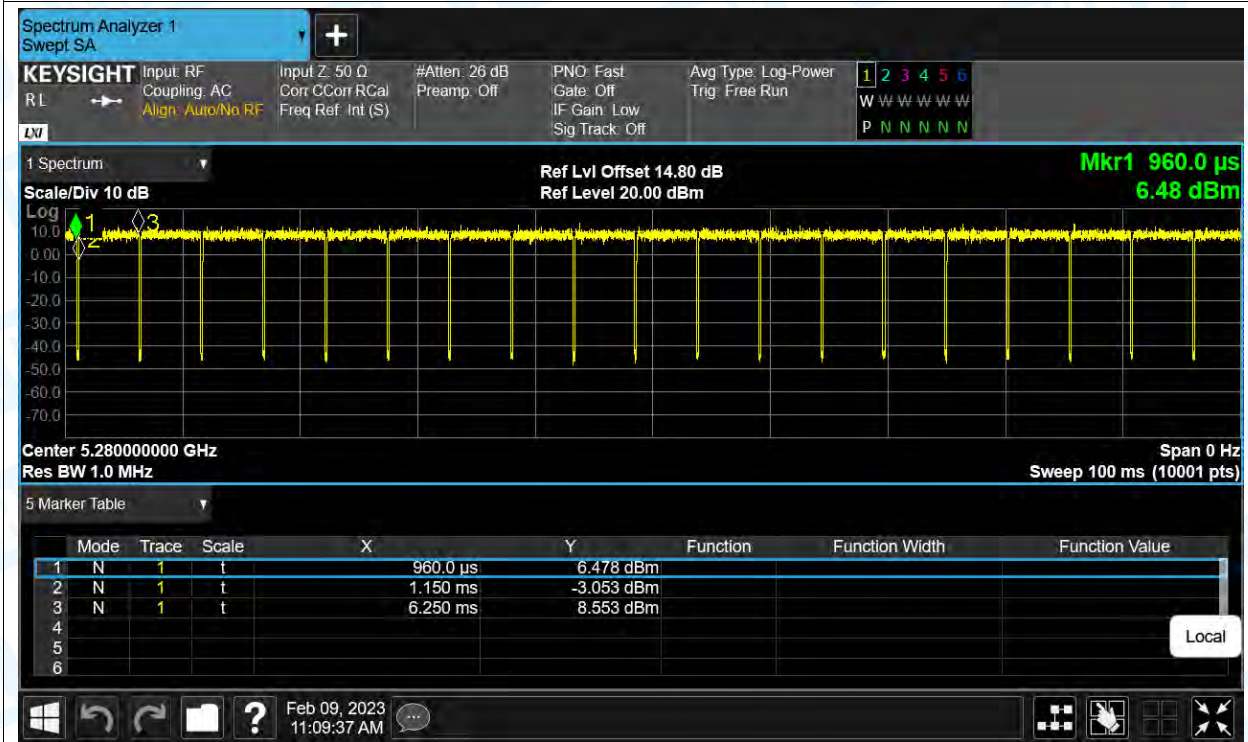


Duty Cycle NVNT ac(VHT20) 5320MHz AntB

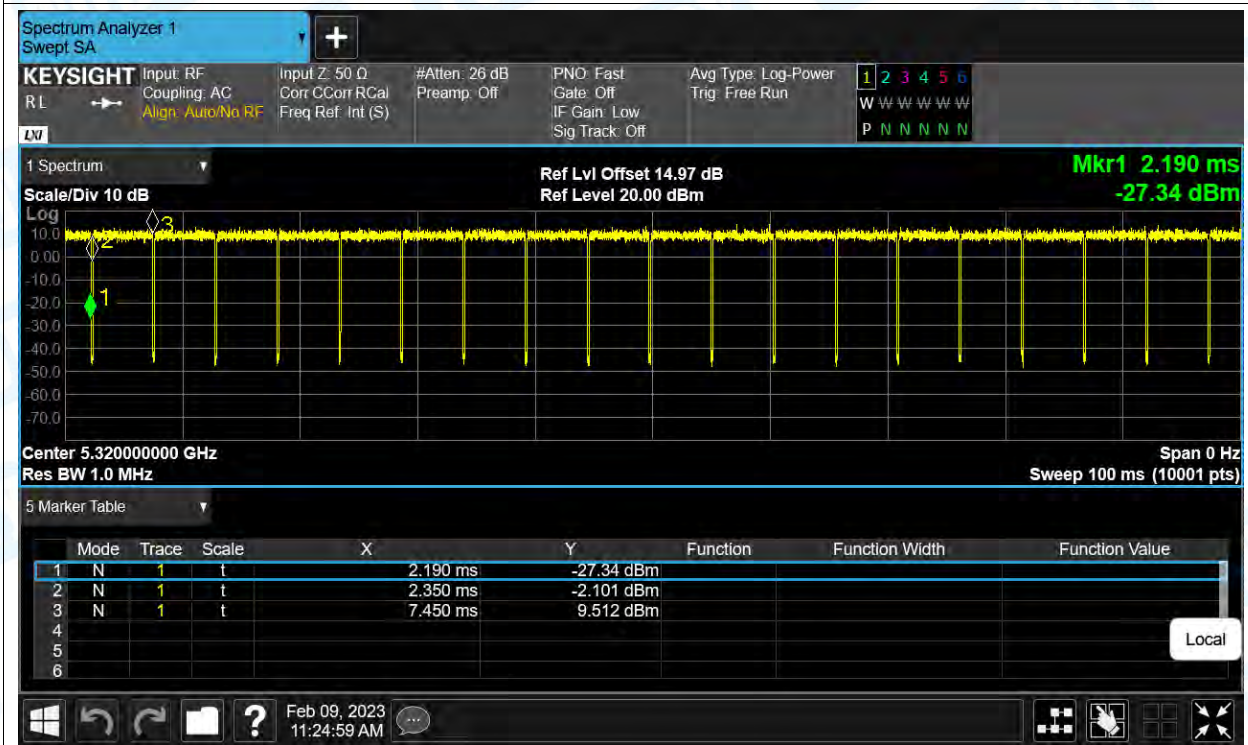


Duty Cycle NVNT ac(VHT40) 5270MHz AntB

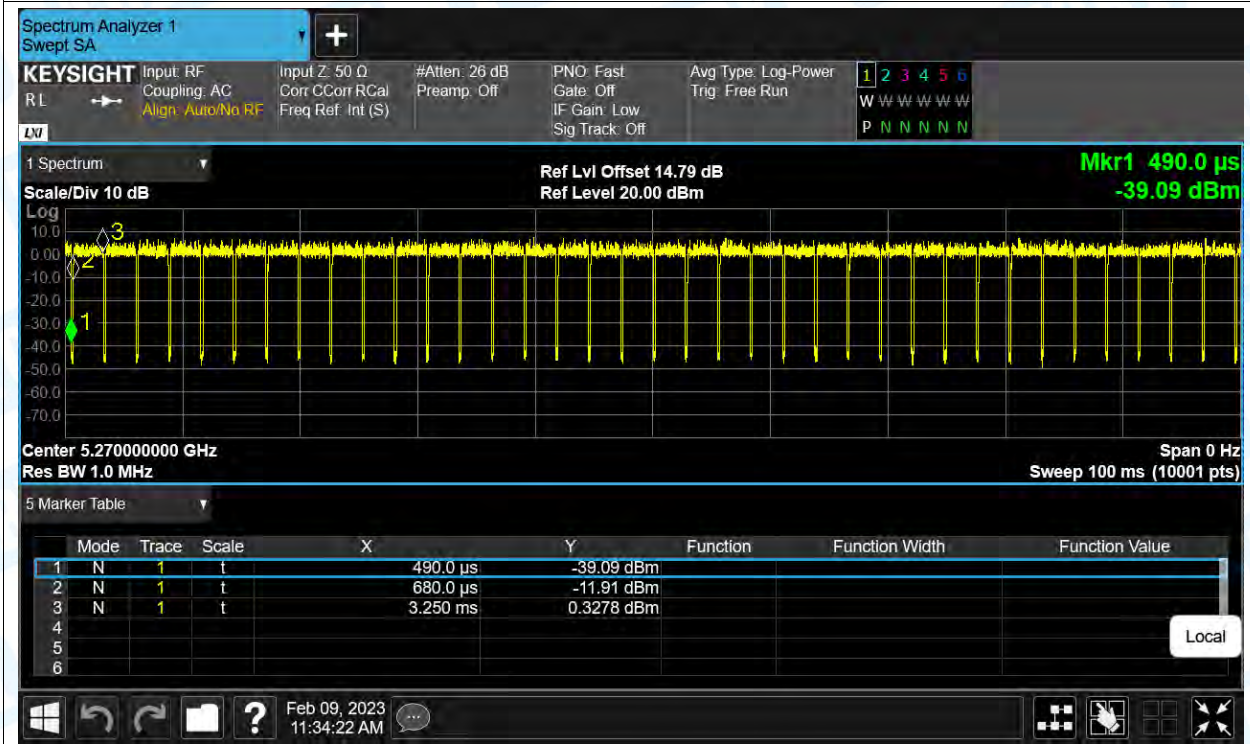


Duty Cycle NVNT ac(VHT40) 5310MHz AntB

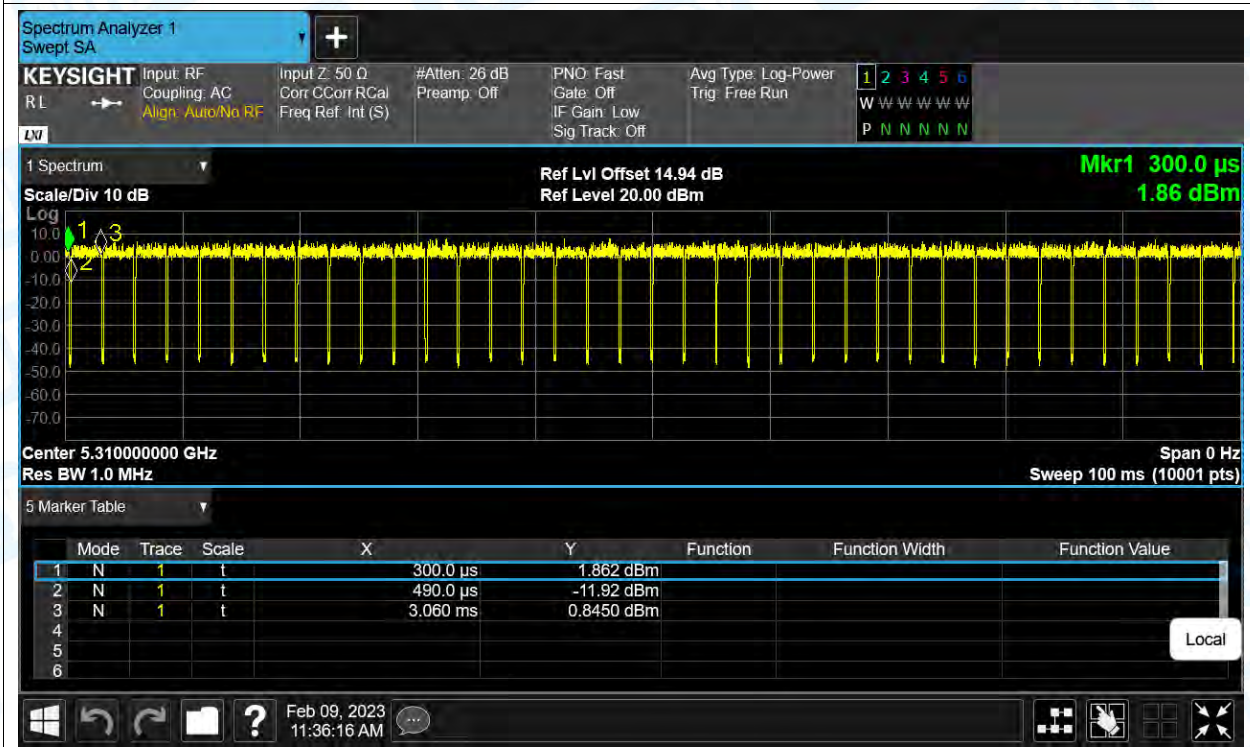


Duty Cycle NVNT ac(VHT80) 5290MHz AntB

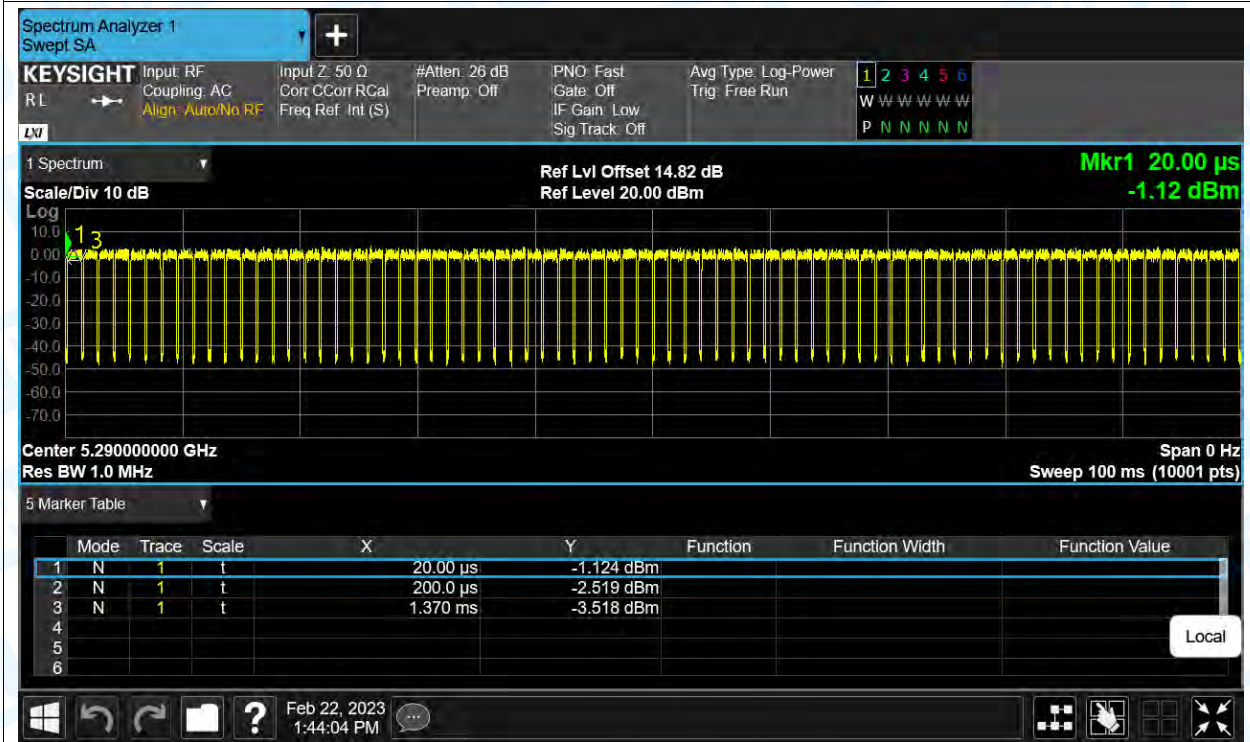

Duty Cycle NVNT n(HT20) 5260MHz AntB

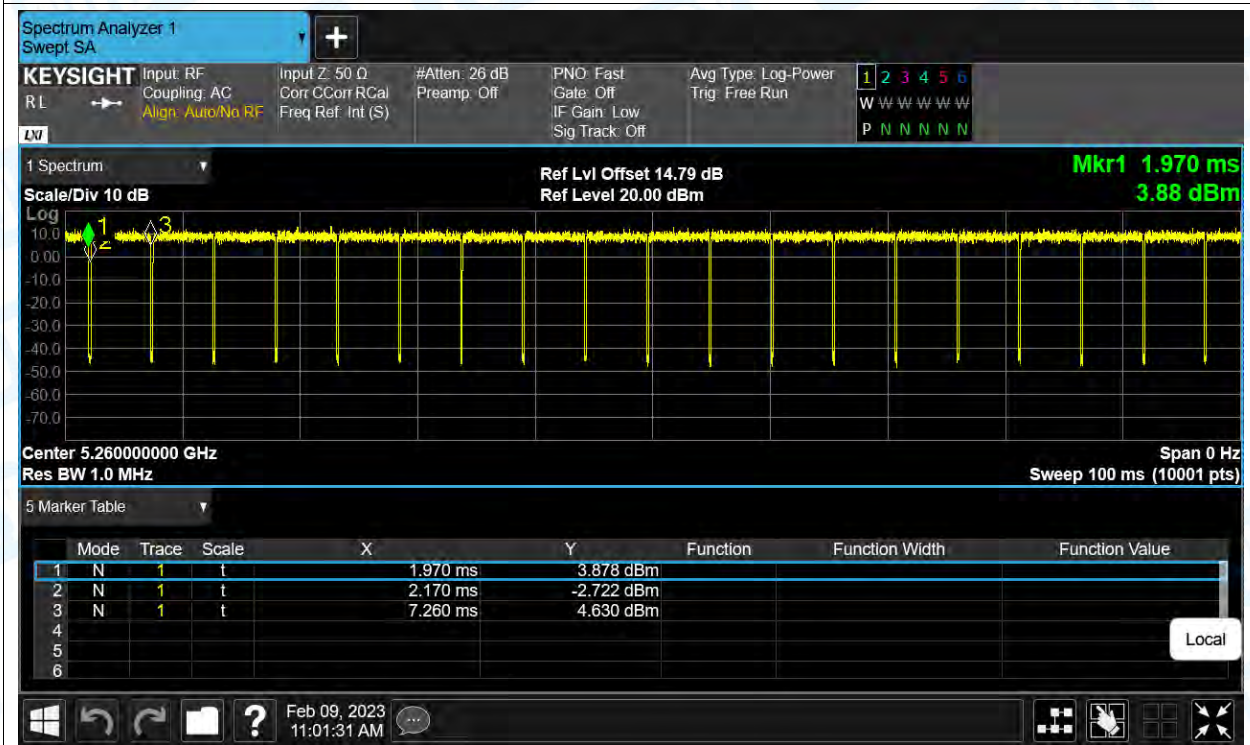

Duty Cycle NVNT n(HT20) 5280MHz AntB

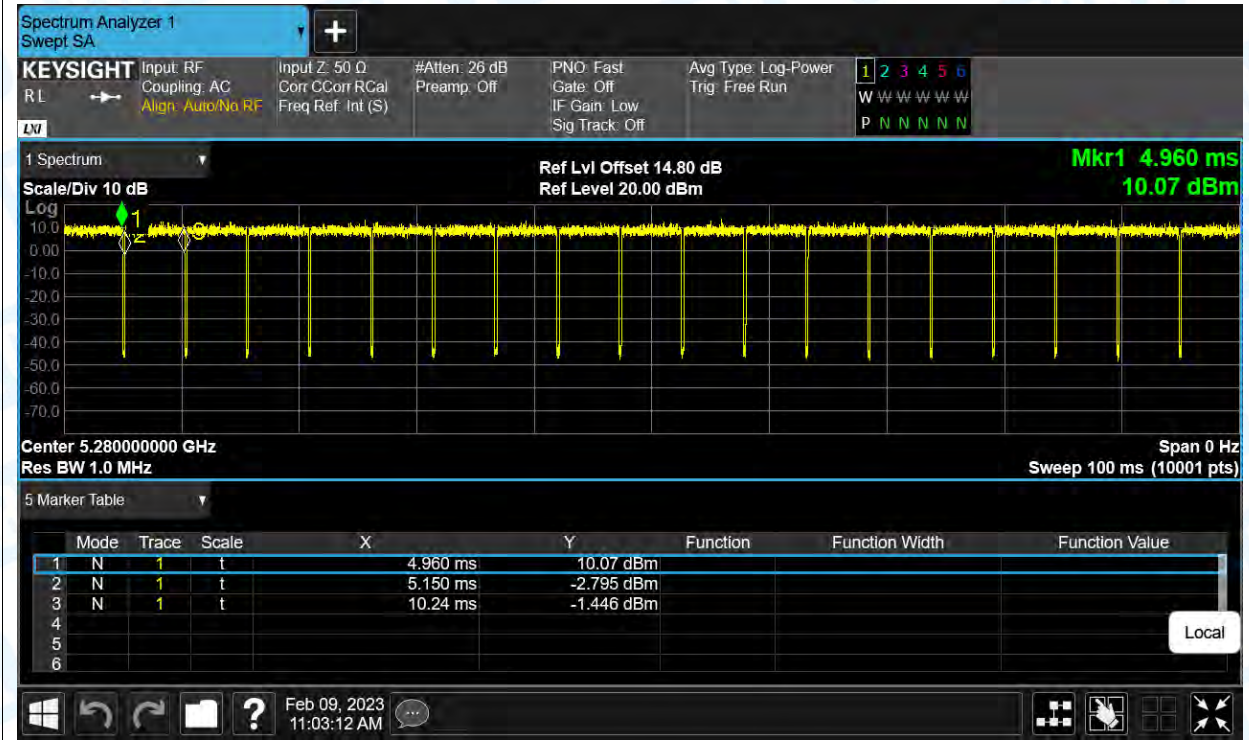

Duty Cycle NVNT n(HT20) 5320MHz AntB

