



Date: 20.JUN.2024 07:41:27

Band41_10MHz_QPSK_40590_50RB#0_30~100
 0_30~1000

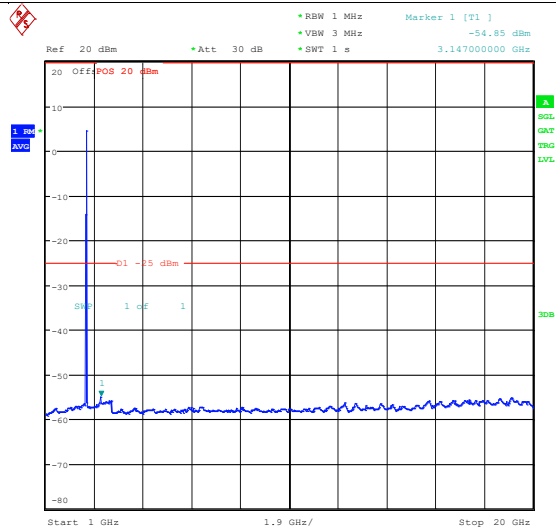


Date: 20.JUN.2024 07:41:43

Band41_10MHz_QPSK_40590_50RB#0_1000~20
 000_1000~20000

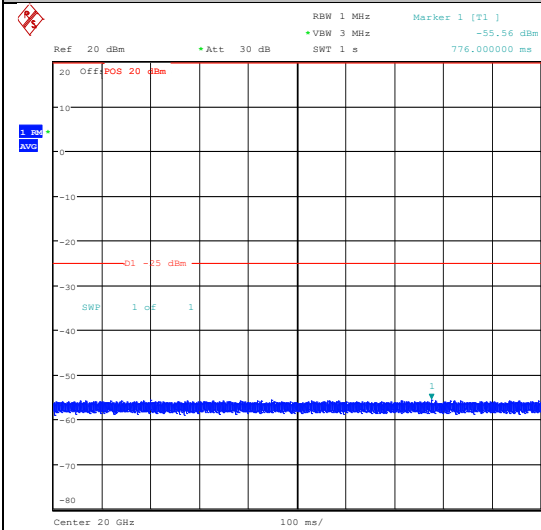


Date: 20.JUN.2024 07:41:59

Band41_10MHz_QPSK_40590_50RB#0_20000~
 27000_20000~27000

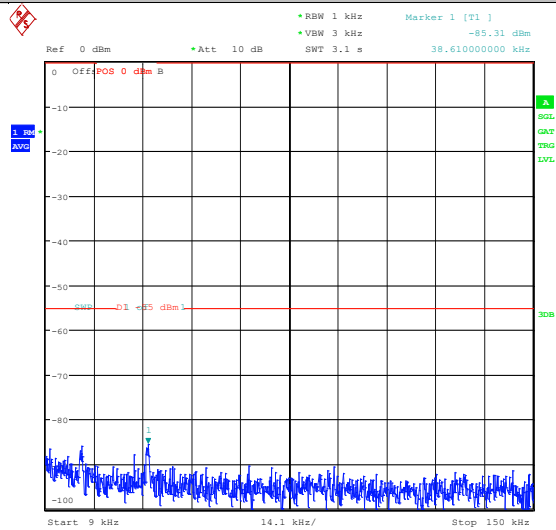


Date: 20.JUN.2024 07:42:44

Band41_10MHz_16QAM_40590_50RB#0_0.009~
 0.15_0.009~0.15

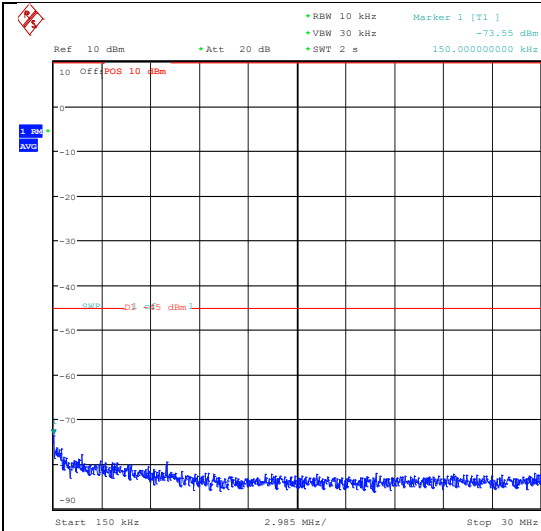


Date: 20.JUN.2024 07:43:50

Band41_10MHz_16QAM_40590_50RB#0_0.15~30_0.15~30

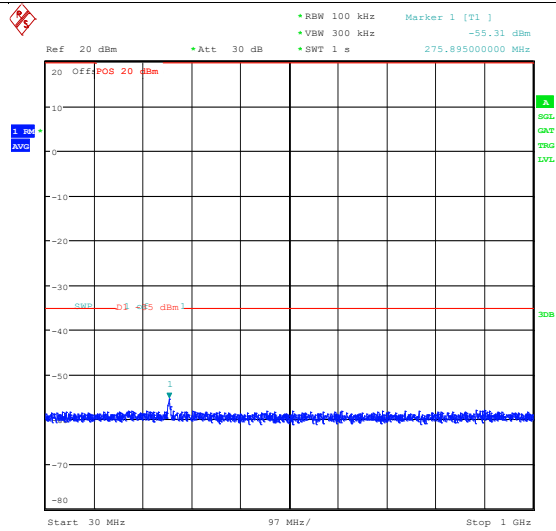


Date: 20.JUN.2024 07:44:06

Band41_10MHz_16QAM_40590_50RB#0_30~100_0_30~1000

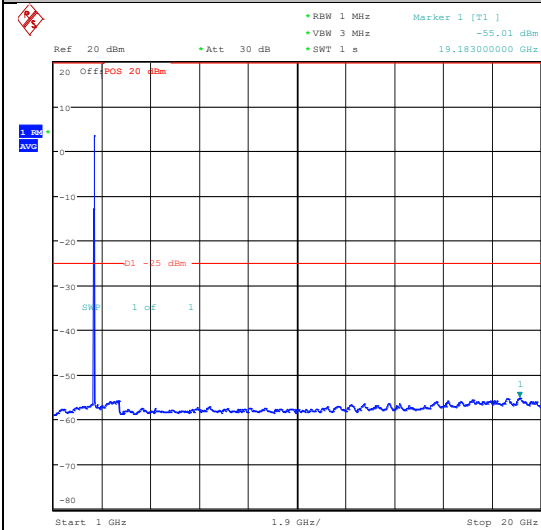


Date: 20.JUN.2024 07:44:22

Band41_10MHz_16QAM_40590_50RB#0_1000~20000_1000~20000

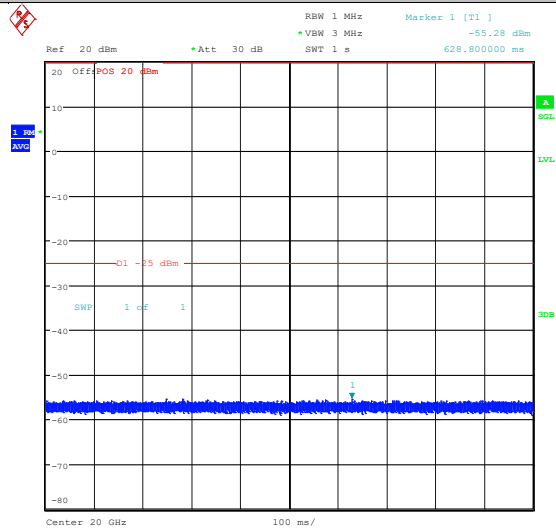


Date: 20.JUN.2024 07:44:38

Band41_10MHz_16QAM_40590_50RB#0_20000~27000_20000~27000

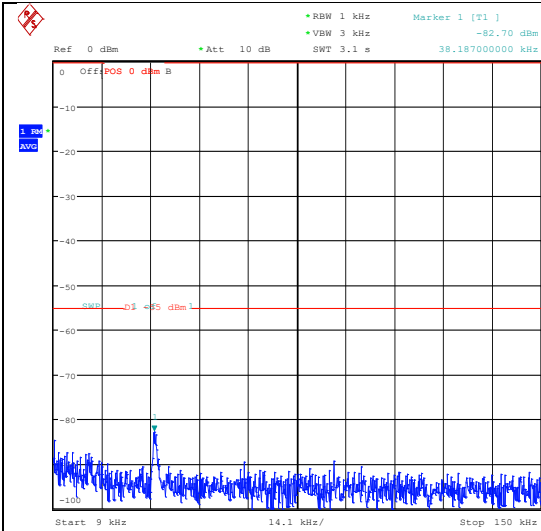


Date: 20.JUN.2024 07:45:26

Band41_10MHz_QPSK_41190_1RB#0_0.009~0.15_0.009~0.15

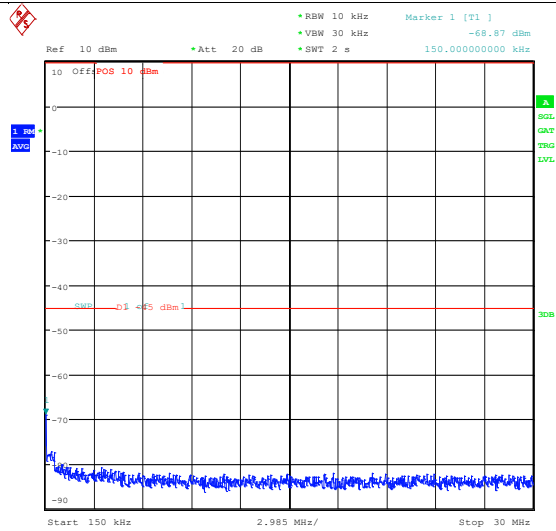


Date: 20.JUN.2024 07:46:32

Band41_10MHz_QPSK_41190_1RB#0_0.15~30_0.15~30

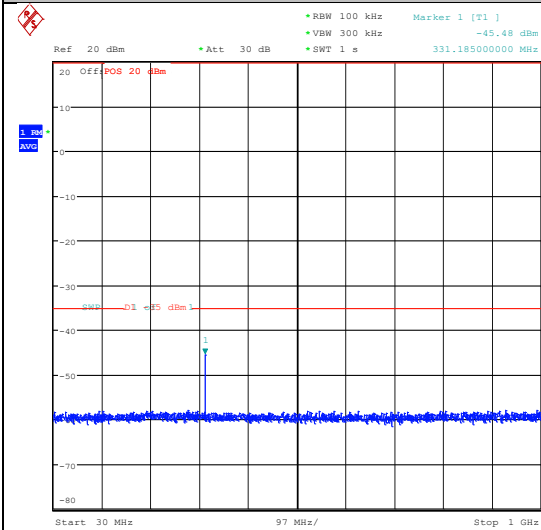


Date: 20.JUN.2024 07:46:48

Band41_10MHz_QPSK_41190_1RB#0_30~1000_30~1000

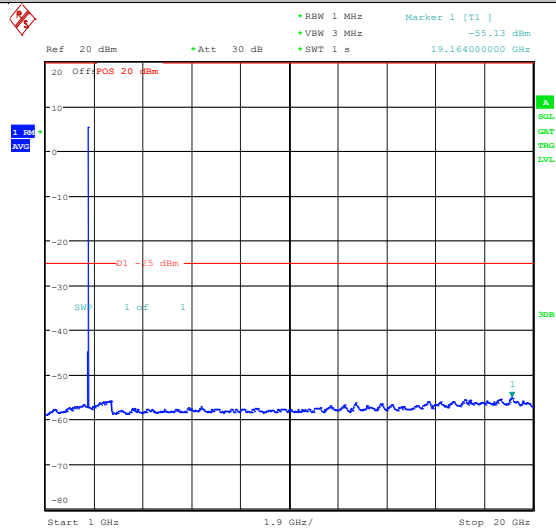


Date: 20.JUN.2024 07:47:04

Band41_10MHz_QPSK_41190_1RB#0_1000~2000_00_1000~20000

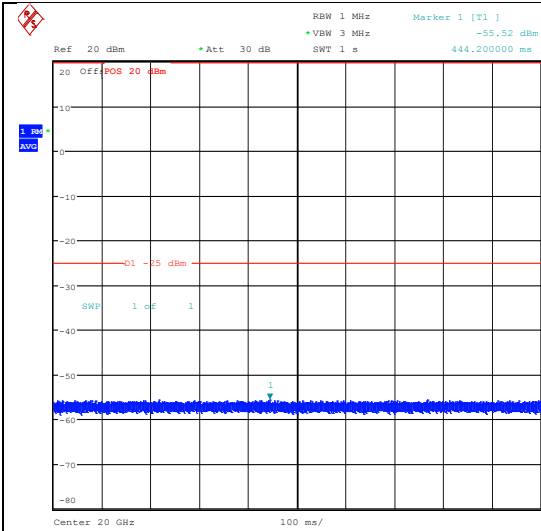


Date: 20.JUN.2024 07:47:20

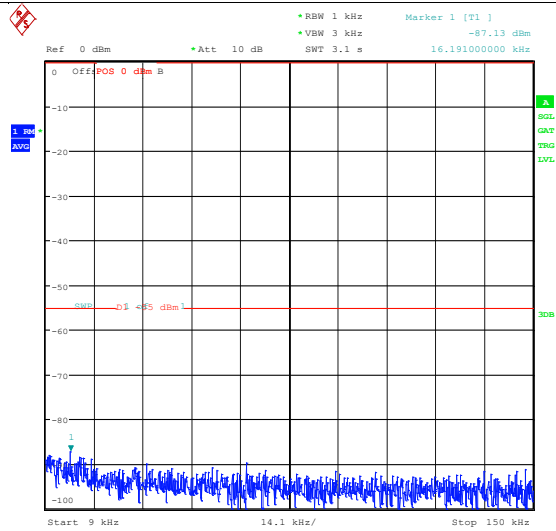


Date: 20.JUN.2024 07:48:05

Band41_10MHz_QPSK_41190_1RB#0_20000~27000

Band41_10MHz_16QAM_41190_1RB#0_0.009~0.15

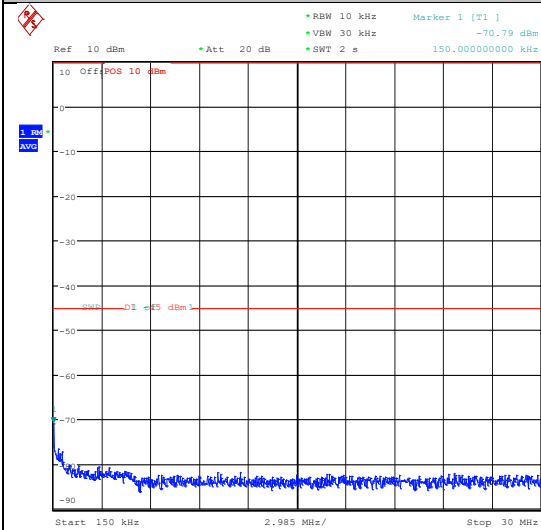


Date: 20.JUN.2024 07:49:11

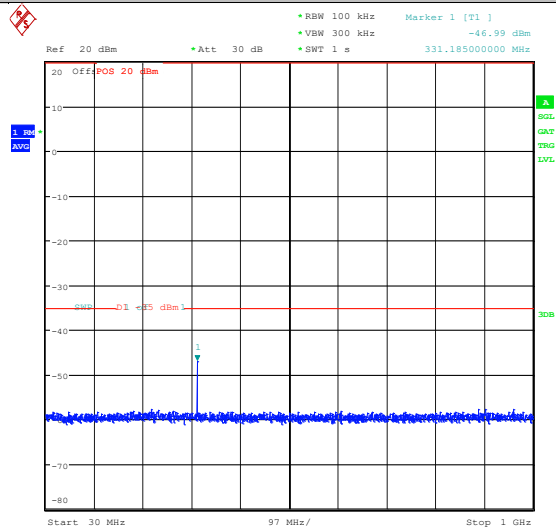


Date: 20.JUN.2024 07:49:27

Band41_10MHz_16QAM_41190_1RB#0_0.15~30

Band41_10MHz_16QAM_41190_1RB#0_30~1000

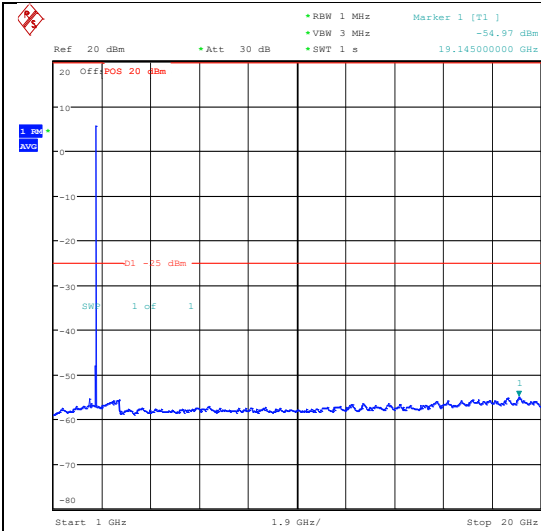


Date: 20.JUN.2024 07:49:43

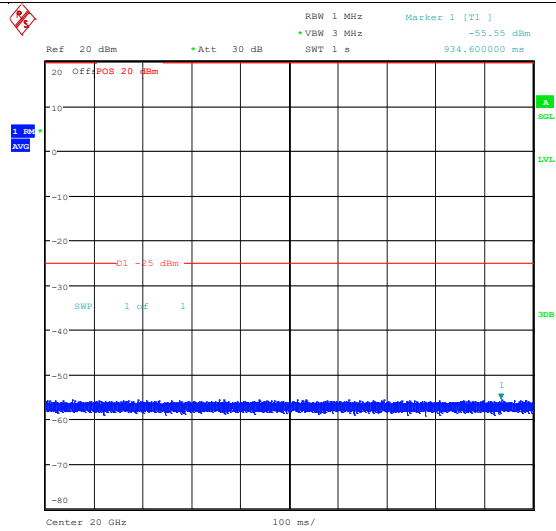


Date: 20.JUN.2024 07:49:59

Band41_10MHz_16QAM_41190_1RB#0_1000~20000_1000~20000

Band41_10MHz_16QAM_41190_1RB#0_20000~7000_20000~27000

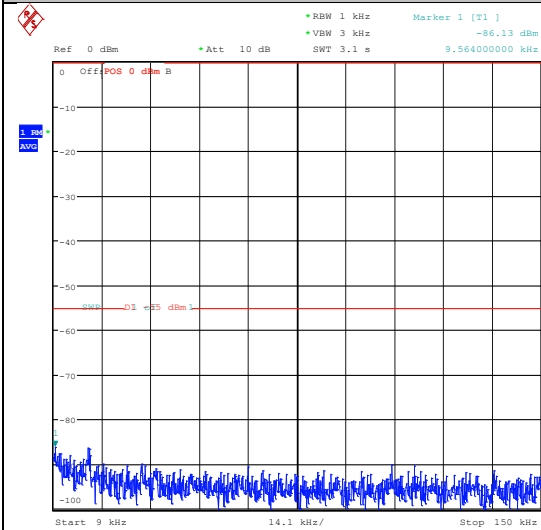


Date: 20.JUN.2024 07:50:45

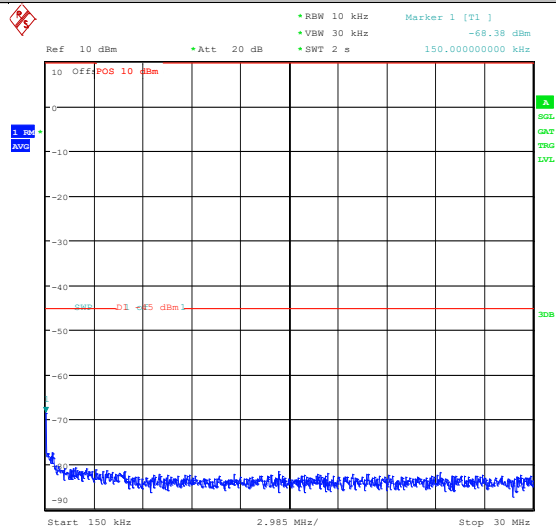

Date: 20.JUN.2024 07:51:51


Band41_10MHz_QPSK_41190_1RB#49_0.009~0.15_0.009~0.15

Band41_10MHz_QPSK_41190_1RB#49_0.15~30_0.15~30

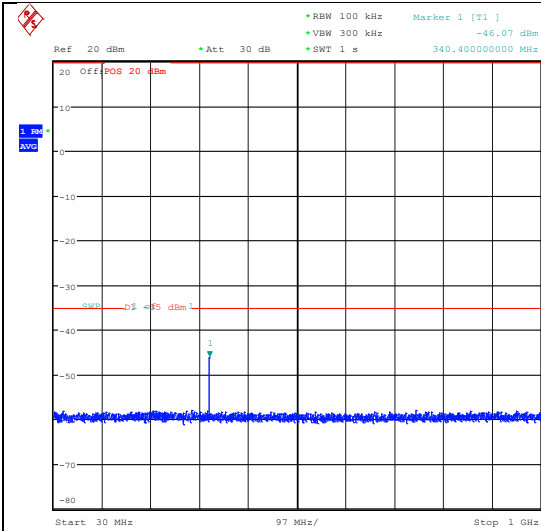


Date: 20.JUN.2024 07:52:07

Band41_10MHz_QPSK_41190_1RB#49_30~100
0_30~1000

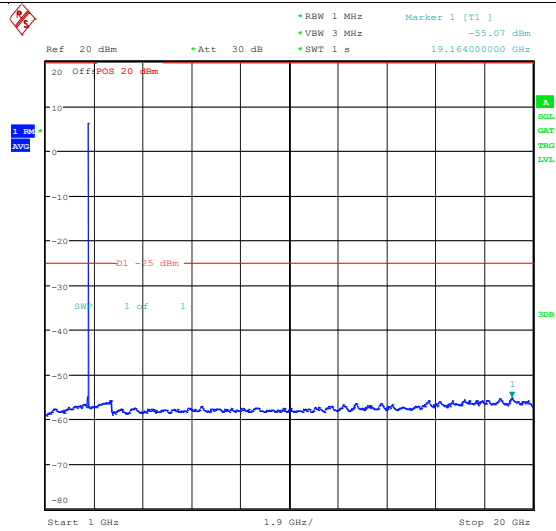


Date: 20.JUN.2024 07:52:23

Band41_10MHz_QPSK_41190_1RB#49_1000~20
000_1000~20000

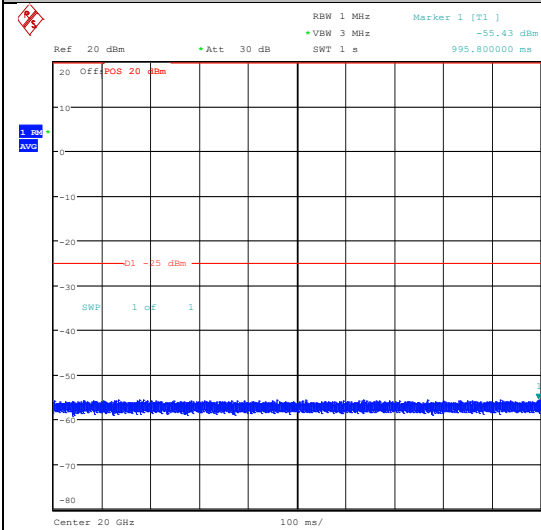


Date: 20.JUN.2024 07:52:39

Band41_10MHz_QPSK_41190_1RB#49_20000~27000
27000_20000~27000

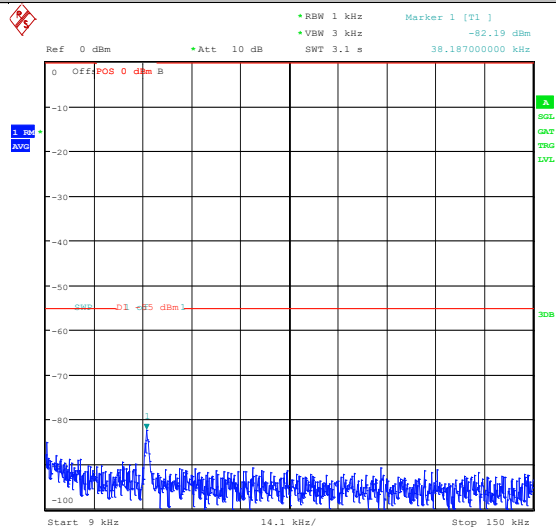


Date: 20.JUN.2024 07:53:24

Band41_10MHz_16QAM_41190_1RB#49_0.009~0.15
0.15_0.009~0.15

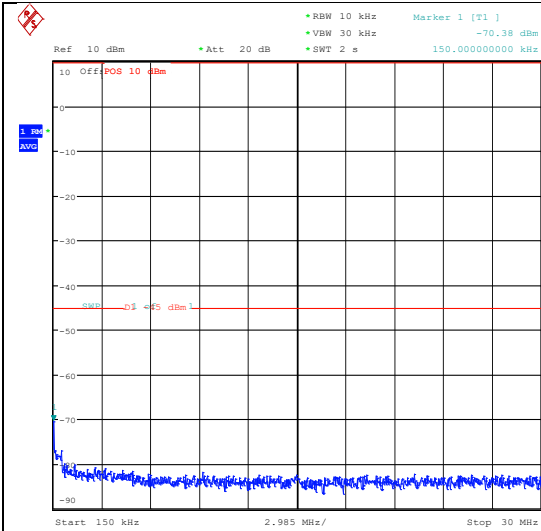


Date: 20.JUN.2024 07:54:30

Band41_10MHz_16QAM_41190_1RB#49_0.15~30
 0_0.15~30

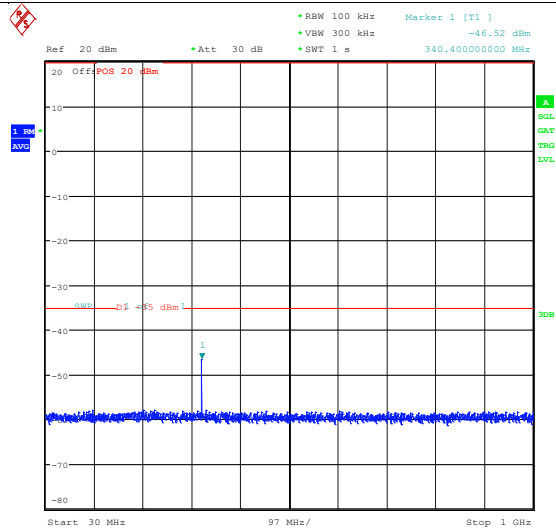


Date: 20.JUN.2024 07:54:46

Band41_10MHz_16QAM_41190_1RB#49_30~100
 0_30~1000

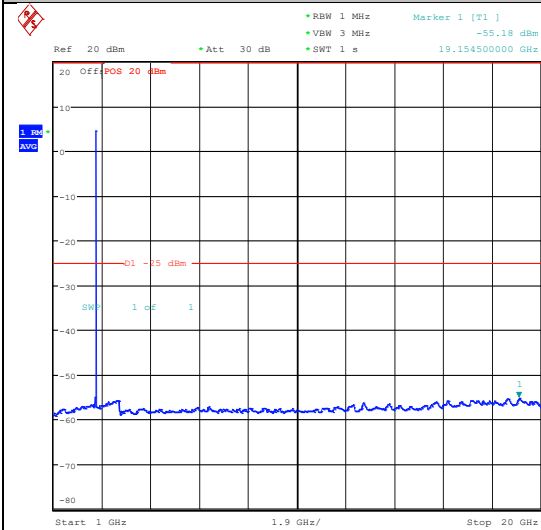


Date: 20.JUN.2024 07:55:02

Band41_10MHz_16QAM_41190_1RB#49_1000~
 20000_1000~20000

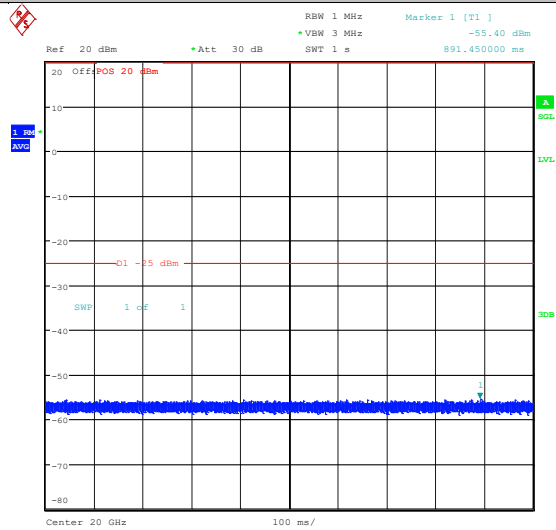


Date: 20.JUN.2024 07:55:17

Band41_10MHz_16QAM_41190_1RB#49_20000~
 27000_20000~27000

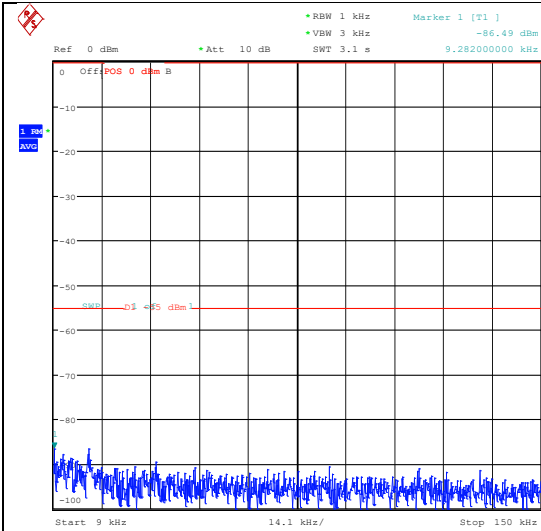


Date: 20 JUN 2024 07:56:03

Band41_10MHz_QPSK_41190_50RB#0_0.009~0.15_0.009~0.15

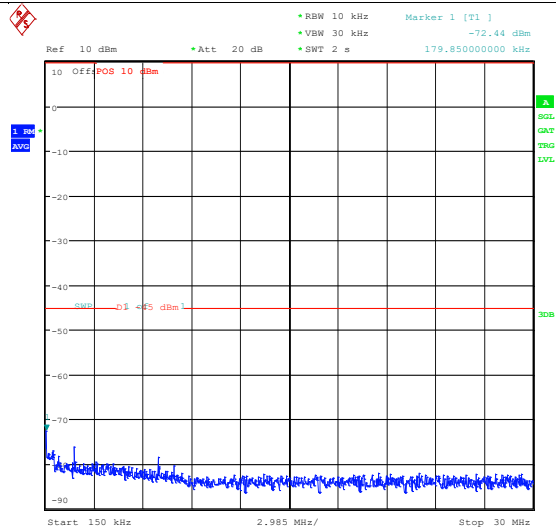


Date: 20 JUN 2024 07:57:09

Band41_10MHz_QPSK_41190_50RB#0_0.15~30_0.15~30

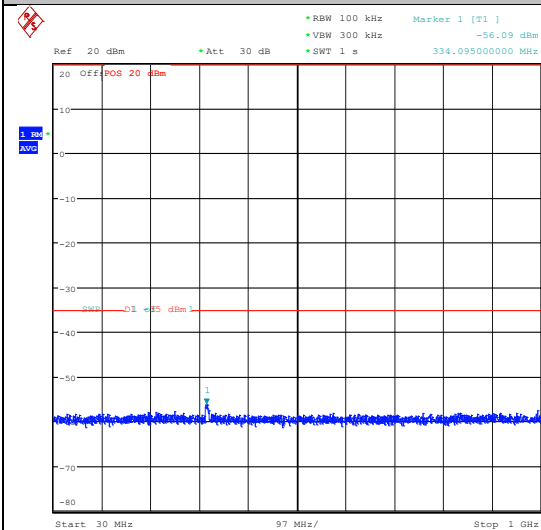


Date: 20 JUN 2024 07:57:25

Band41_10MHz_QPSK_41190_50RB#0_30~100_0_30~1000

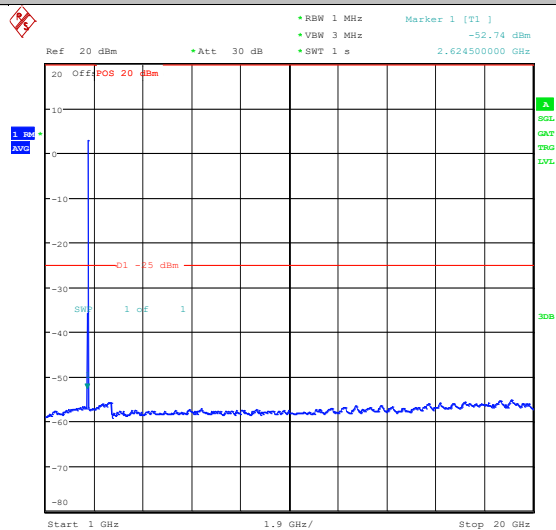


Date: 20 JUN 2024 07:57:40

Band41_10MHz_QPSK_41190_50RB#0_1000~20000_000_1000~20000

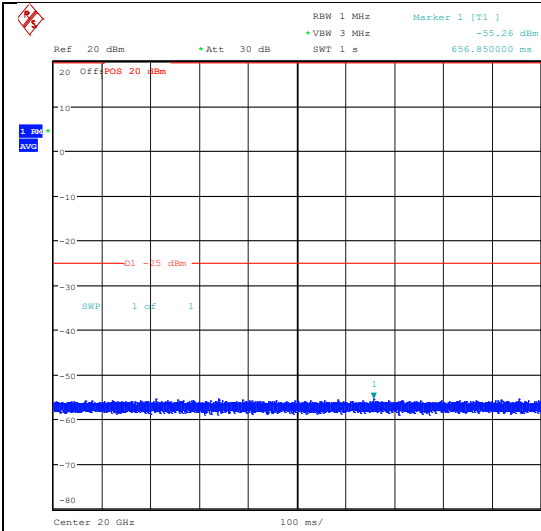


Date: 20.JUN.2024 07:57:56

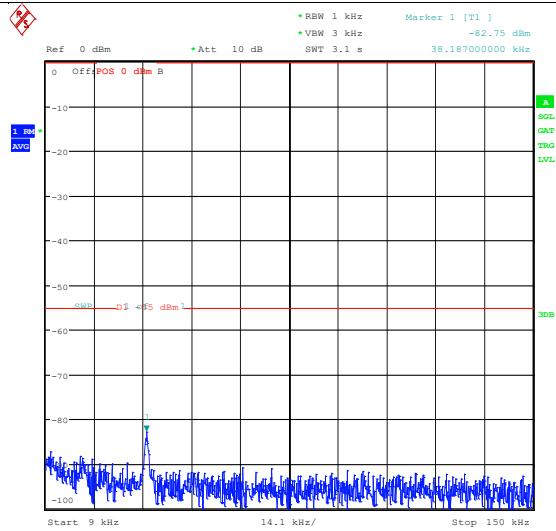


Date: 20.JUN.2024 07:58:41

Band41_10MHz_QPSK_41190_50RB#0_20000~27000_20000~27000

Band41_10MHz_16QAM_41190_50RB#0_0.009~0.15_0.009~0.15

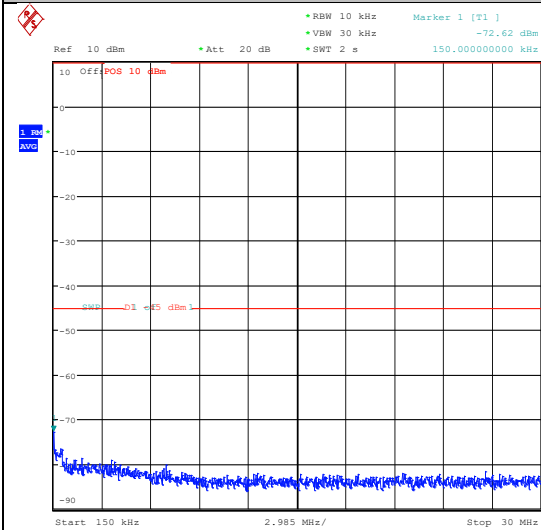


Date: 20.JUN.2024 07:59:47

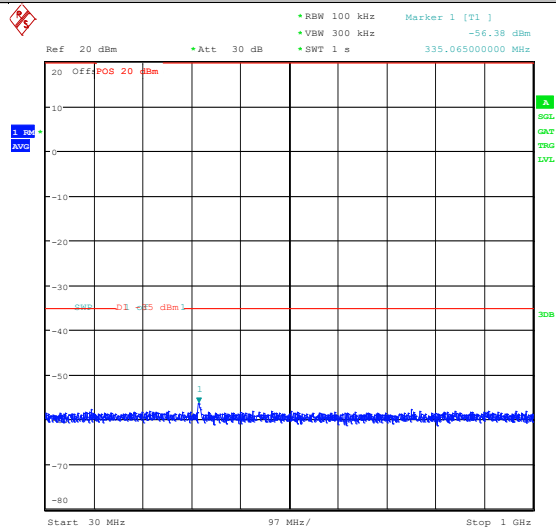


Date: 20.JUN.2024 08:00:03

Band41_10MHz_16QAM_41190_50RB#0_0.15~30_0.15~30

Band41_10MHz_16QAM_41190_50RB#0_30~100_30~100

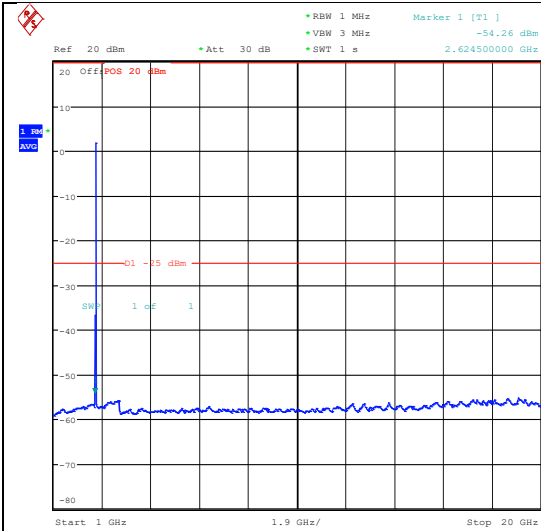


Date: 20.JUN.2024 08:00:19

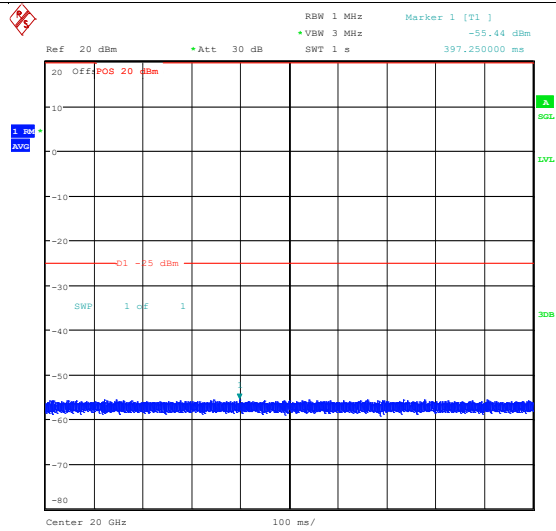


Date: 20.JUN.2024 08:00:35

Band41_10MHz_16QAM_41190_50RB#0_1000~20000_1000~20000

Band41_10MHz_16QAM_41190_50RB#0_20000~27000_20000~27000

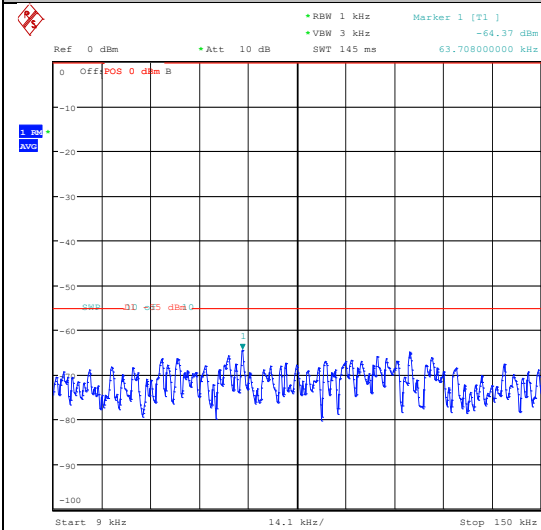


Date: 20.JUN.2024 08:29:23

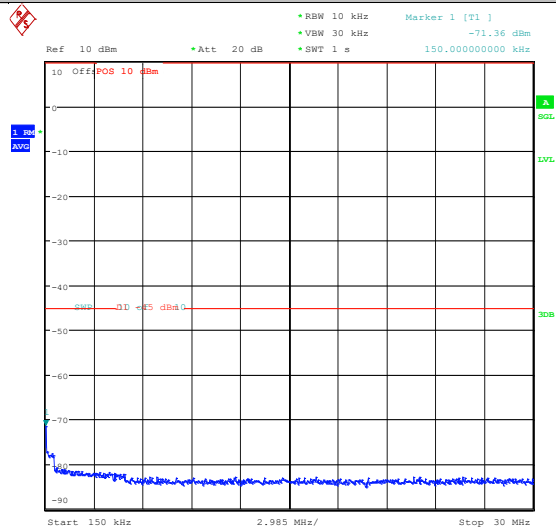

Date: 20.JUN.2024 08:29:38


Band41_15MHz_QPSK_40115_1RB#0_0.009~0.15_0.009~0.15

Band41_15MHz_QPSK_40115_1RB#0_0.15~30_0.15~30

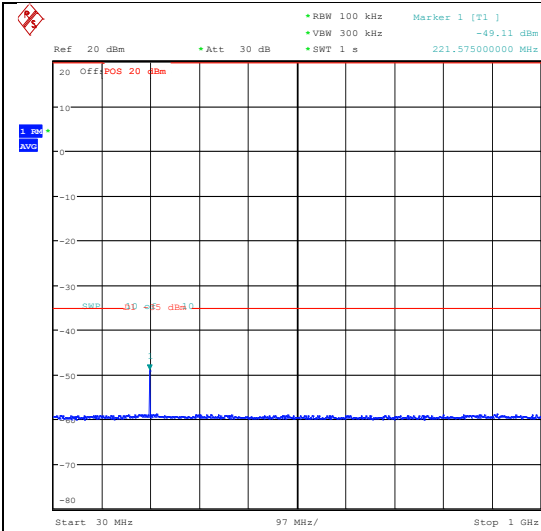


Date: 20.JUN.2024 08:29:51

Band41_15MHz_QPSK_40115_1RB#0_30~1000
 _30~1000

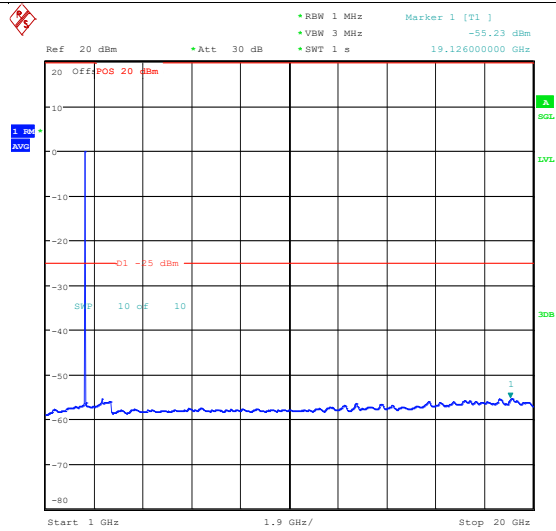


Date: 20.JUN.2024 08:30:06

Band41_15MHz_QPSK_40115_1RB#0_1000~200
 00_1000~20000

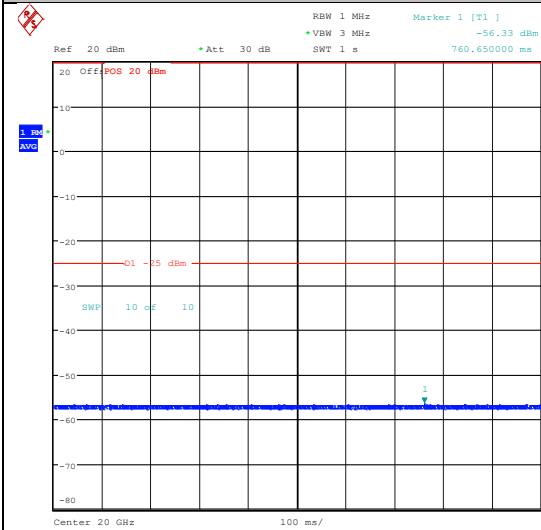


Date: 20.JUN.2024 08:30:28

Band41_15MHz_QPSK_40115_1RB#0_20000~2
 7000_20000~27000

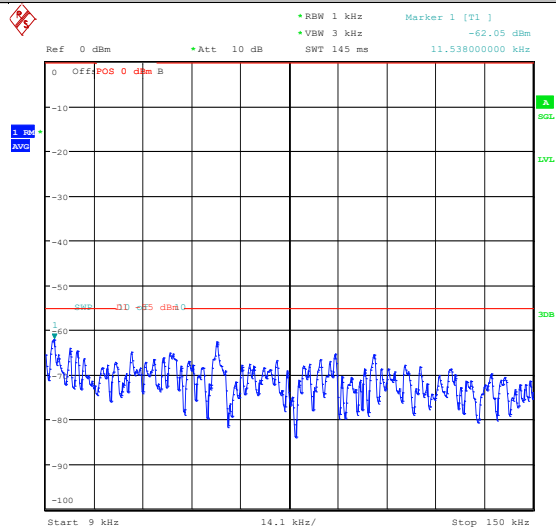


Date: 20.JUN.2024 08:30:38

Band41_15MHz_16QAM_40115_1RB#0_0.009~0.
 15_0.009~0.15

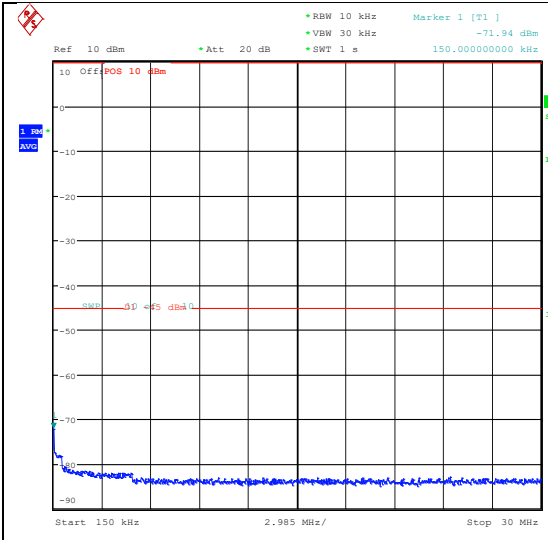


Date: 20.JUN.2024 08:30:53

Band41_15MHz_16QAM_40115_1RB#0_0.15~30
 _0.15~30

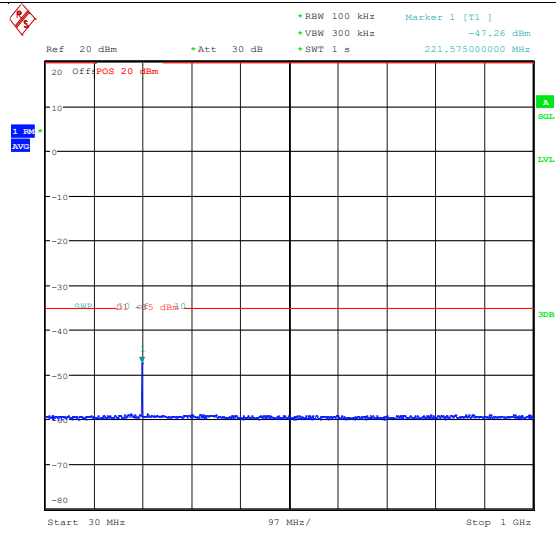


Date: 20.JUN.2024 08:31:06

Band41_15MHz_16QAM_40115_1RB#0_30~1000
 _30~1000

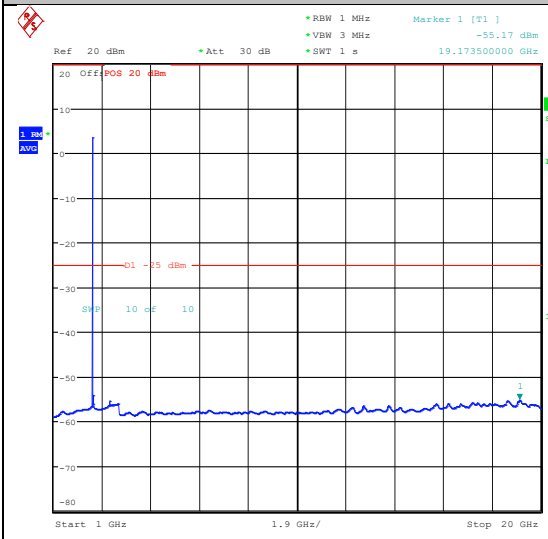


Date: 20.JUN.2024 08:31:21

Band41_15MHz_16QAM_40115_1RB#0_1000~20000
 0000_1000~20000

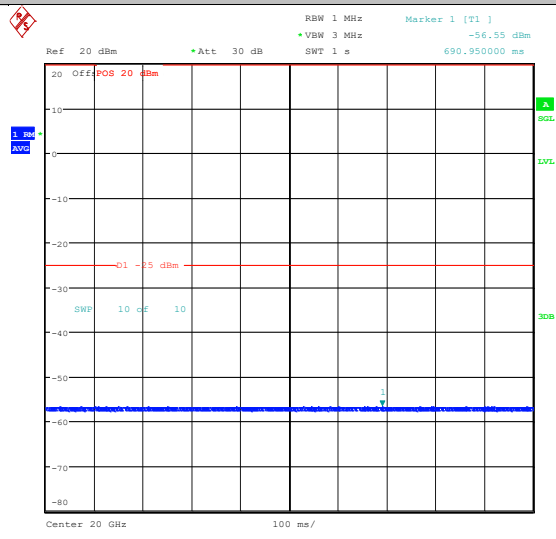


Date: 20.JUN.2024 08:31:46

Band41_15MHz_16QAM_40115_1RB#0_20000~27000
 7000_20000~27000

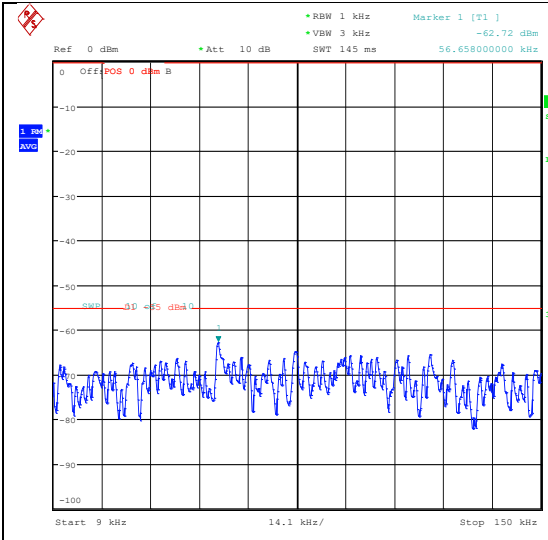


Date: 20.JUN.2024 08:31:54

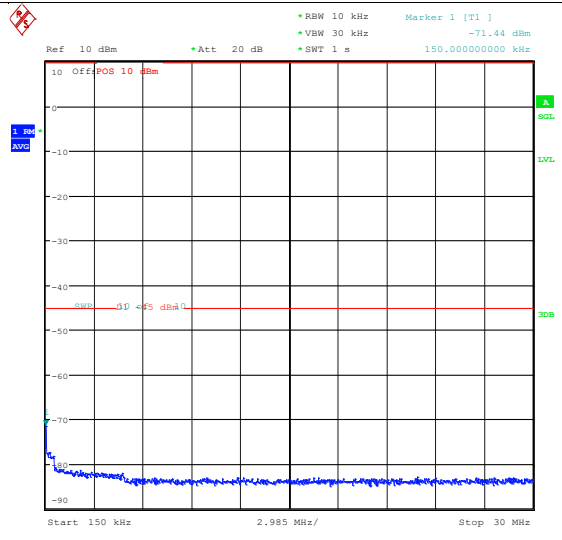


Date: 20.JUN.2024 08:32:09

Band41_15MHz_QPSK_40115_1RB#74_0.009~0.15_0.009~0.15

Band41_15MHz_QPSK_40115_1RB#74_0.15~30_0.15~30

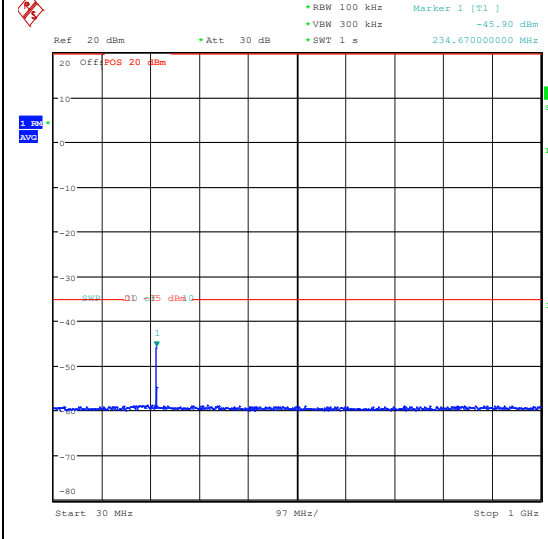


Date: 20.JUN.2024 08:32:23

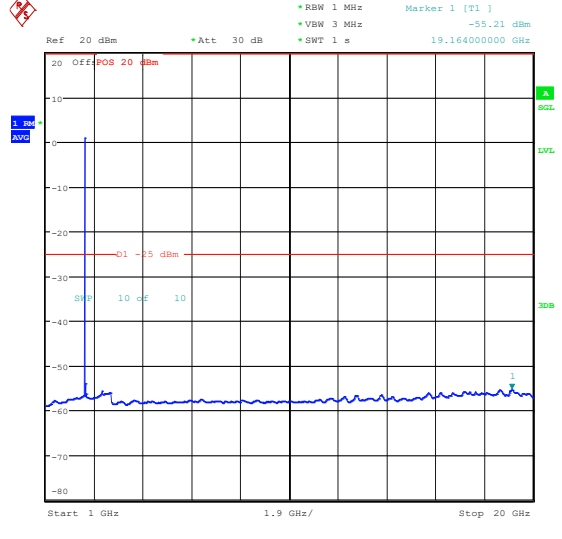

Date: 20.JUN.2024 08:32:38


Band41_15MHz_QPSK_40115_1RB#74_30~100_0_30~1000

Band41_15MHz_QPSK_40115_1RB#74_1000~20000_000_1000~20000

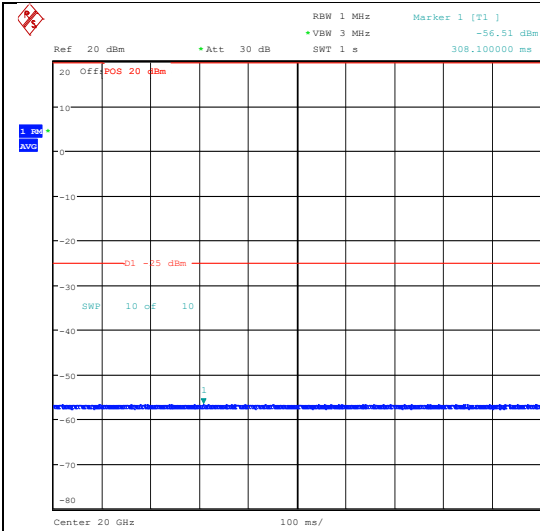


Date: 20.JUN.2024 08:33:03

Band41_15MHz_QPSK_40115_1RB#74_20000~27000_20000~27000

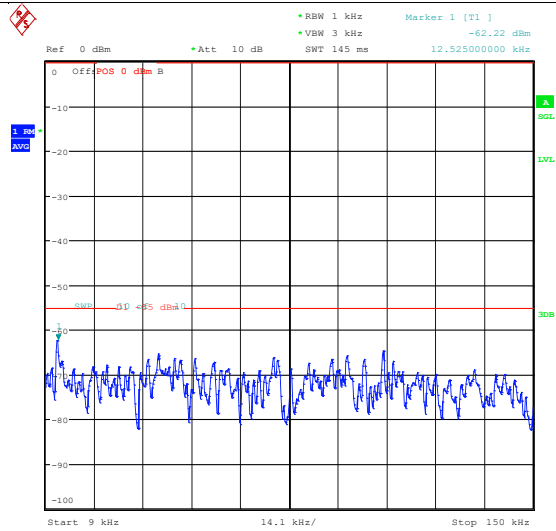


Date: 20.JUN.2024 08:33:12

Band41_15MHz_16QAM_40115_1RB#74_0.009~0.15_0.009~0.15

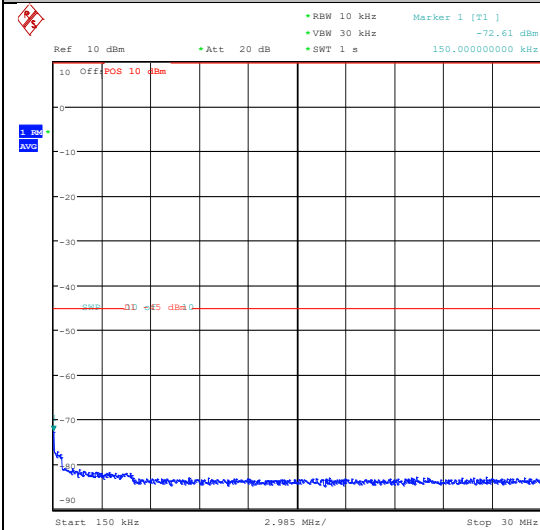


Date: 20.JUN.2024 08:33:27

Band41_15MHz_16QAM_40115_1RB#74_0.15~30_0_0.15~30

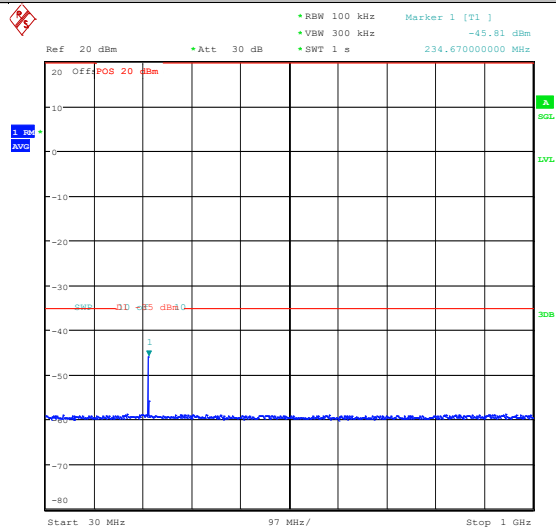


Date: 20.JUN.2024 08:33:41

Band41_15MHz_16QAM_40115_1RB#74_30~100_0_30~100

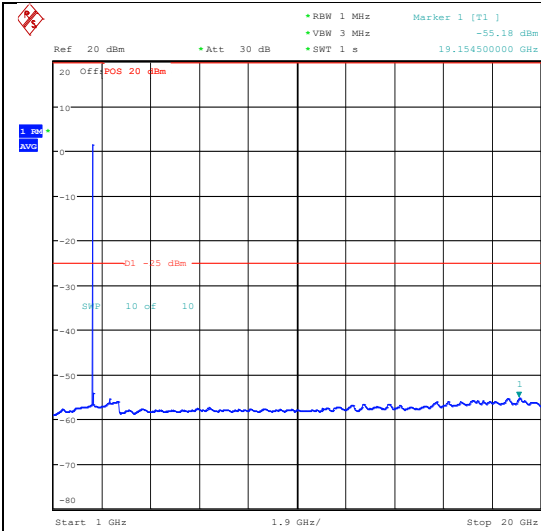


Date: 20.JUN.2024 08:33:56

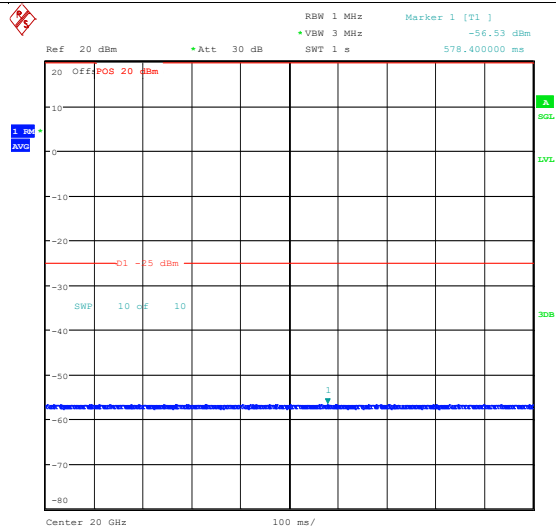


Date: 20.JUN.2024 08:34:21

Band41_15MHz_16QAM_40115_1RB#74_1000~20000_1000~20000

Band41_15MHz_16QAM_40115_1RB#74_20000~27000_20000~27000

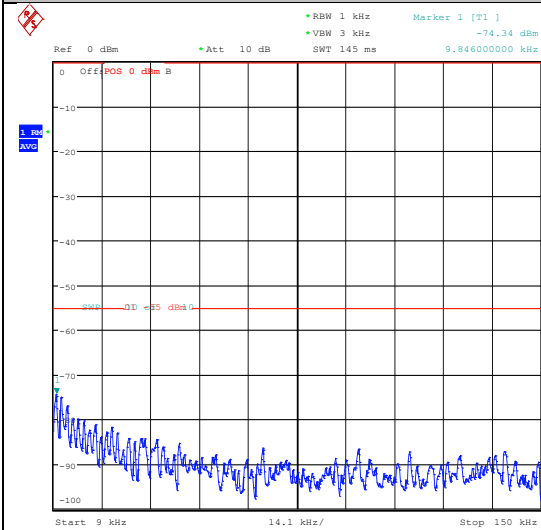


Date: 20.JUN.2024 08:34:29

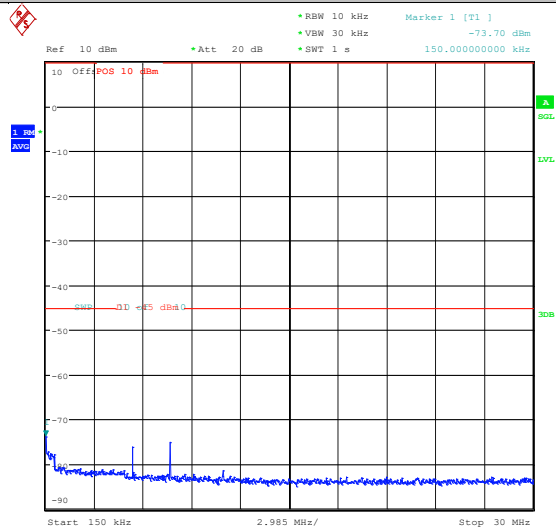


Date: 20.JUN.2024 08:34:44

Band41_15MHz_QPSK_40115_75RB#0_0.009~0.15_0.009~0.15

Band41_15MHz_QPSK_40115_75RB#0_0.15~0.30_0.15~0.30

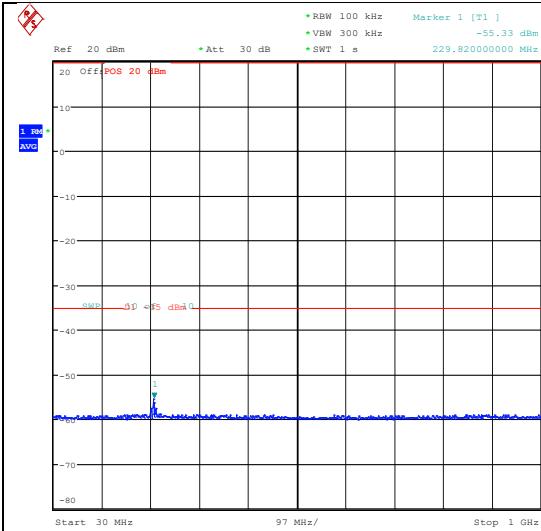


Date: 20.JUN.2024 08:34:58

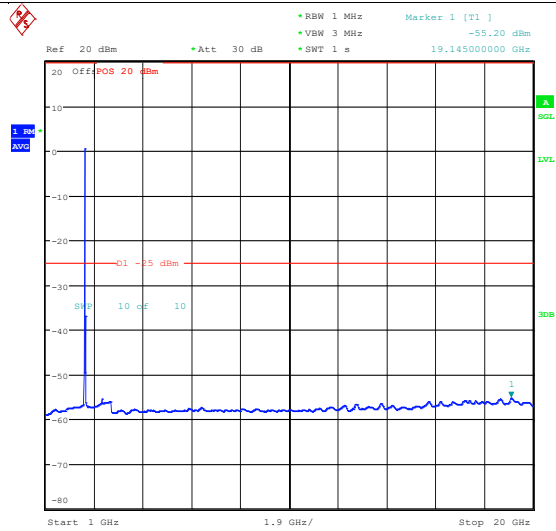


Date: 20.JUN.2024 08:35:13

Band41_15MHz_QPSK_40115_75RB#0_30~100
 0_30~1000

Band41_15MHz_QPSK_40115_75RB#0_1000~20
 000_1000~20000

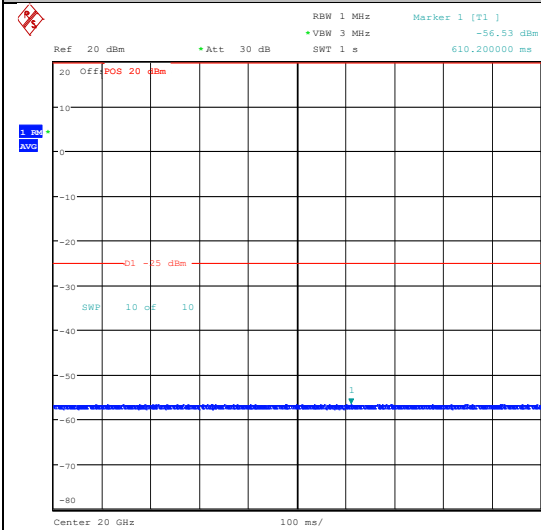


Date: 20.JUN.2024 08:35:38

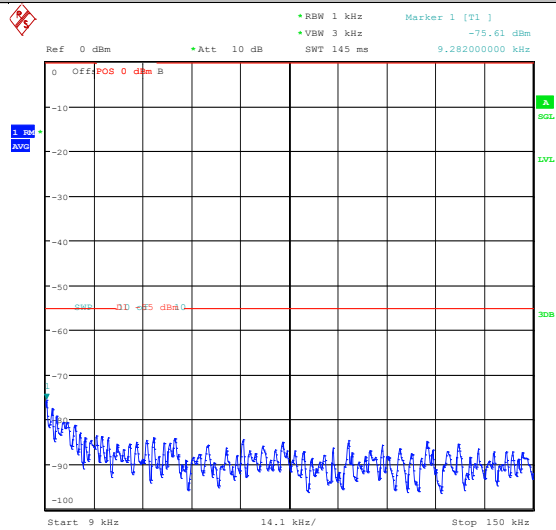


Date: 20.JUN.2024 08:35:47

Band41_15MHz_QPSK_40115_75RB#0_20000~
 27000_20000~27000

Band41_15MHz_16QAM_40115_75RB#0_0.009~
 0.15_0.009~0.15

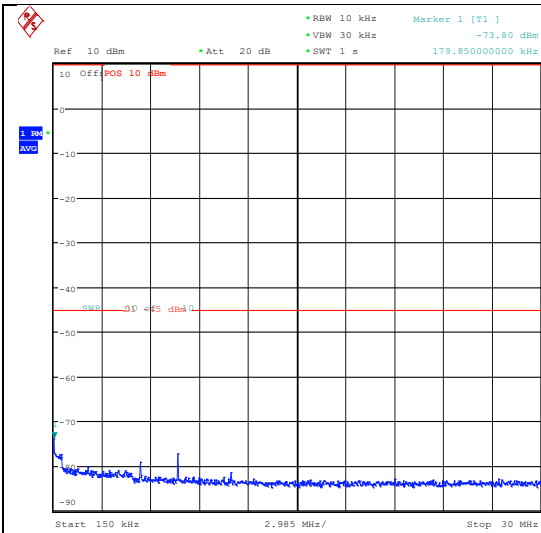


Date: 20.JUN.2024 08:36:02

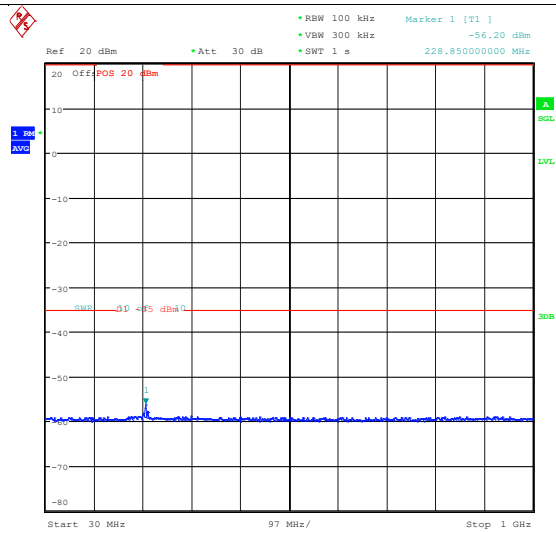


Date: 20.JUN.2024 08:36:15

Band41_15MHz_16QAM_40115_75RB#0_0.15~30
 0_0.15~30

Band41_15MHz_16QAM_40115_75RB#0_30~100
 0_30~1000

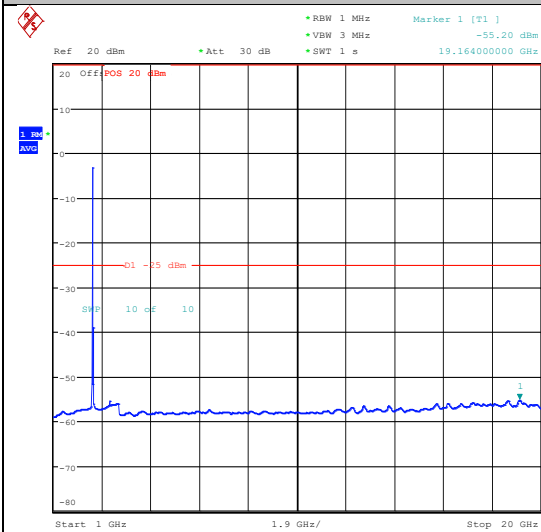


Date: 20.JUN.2024 08:36:30

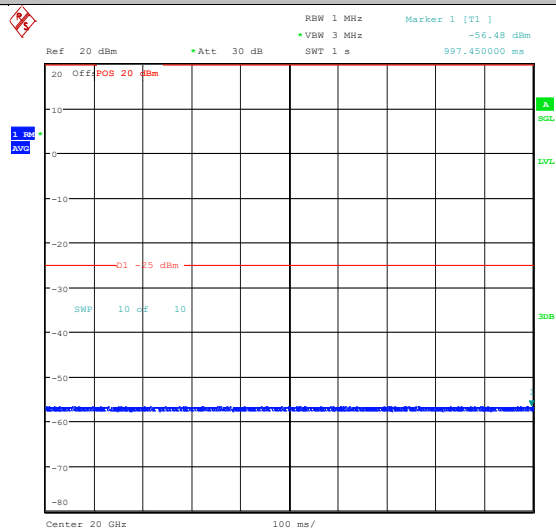

Date: 20.JUN.2024 08:36:55


Band41_15MHz_16QAM_40115_75RB#0_1000~
 20000_1000~20000

Band41_15MHz_16QAM_40115_75RB#0_20000~
 27000_20000~27000

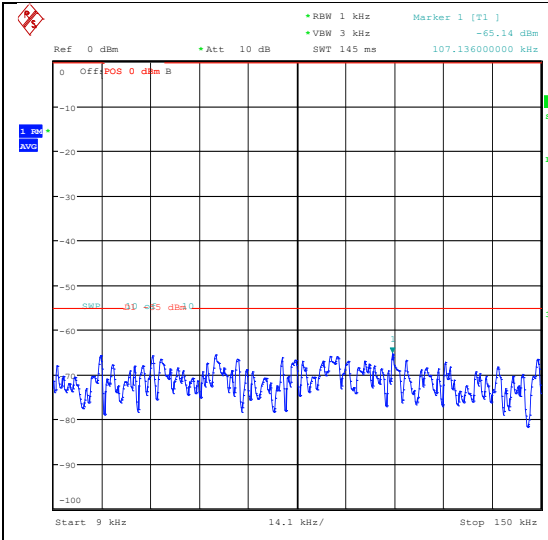


Date: 20.JUN.2024 08:37:06

Band41_15MHz_QPSK_40590_1RB#0_0.009~0.15_0.009~0.15

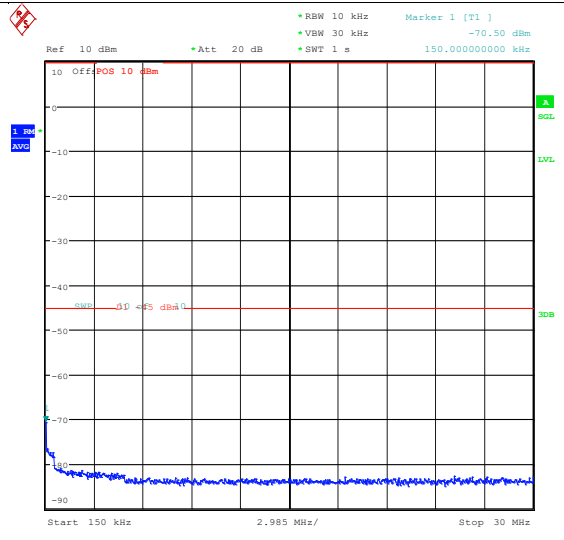


Date: 20.JUN.2024 08:37:21

Band41_15MHz_QPSK_40590_1RB#0_0.15~30_0.15~30

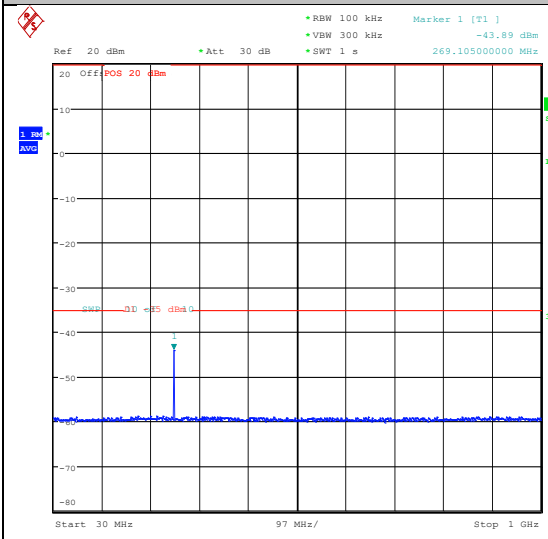


Date: 20.JUN.2024 08:37:34

Band41_15MHz_QPSK_40590_1RB#0_30~1000_30~1000

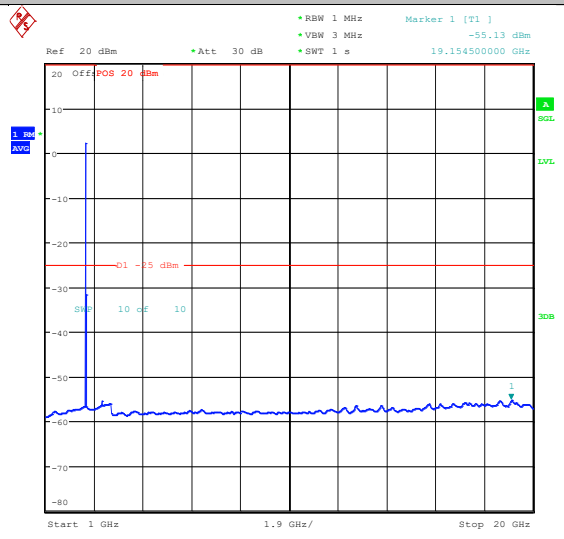


Date: 20.JUN.2024 08:37:49

Band41_15MHz_QPSK_40590_1RB#0_1000~2000_00_1000~20000

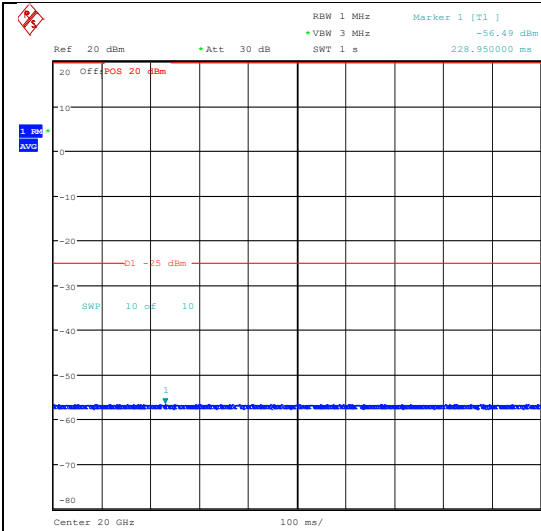


Date: 20.JUN.2024 08:38:10

Band41_15MHz_QPSK_40590_1RB#0_20000~27000

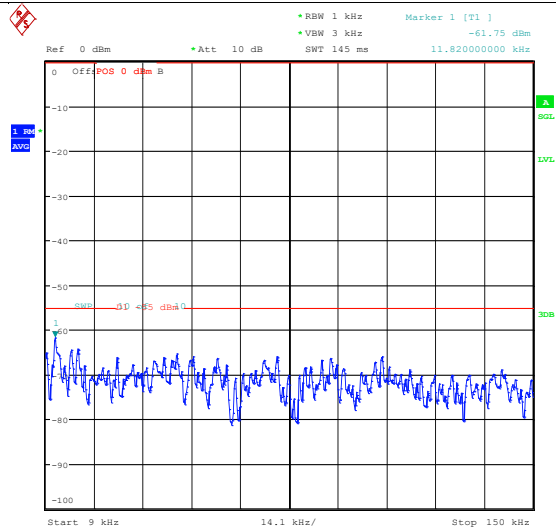


Date: 20.JUN.2024 08:38:20

Band41_15MHz_16QAM_40590_1RB#0_0.009~0.15

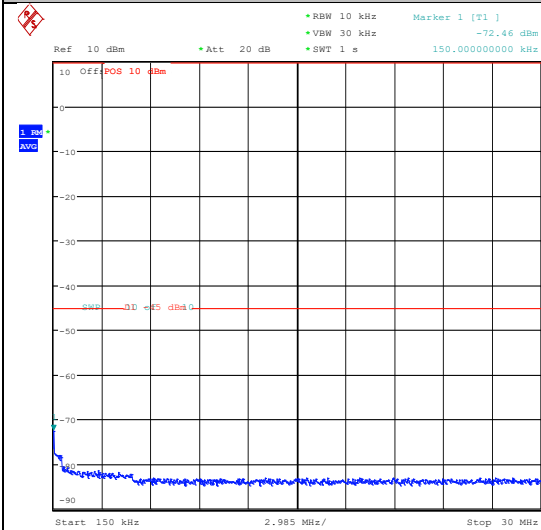


Date: 20.JUN.2024 08:38:35

Band41_15MHz_16QAM_40590_1RB#0_0.15~3

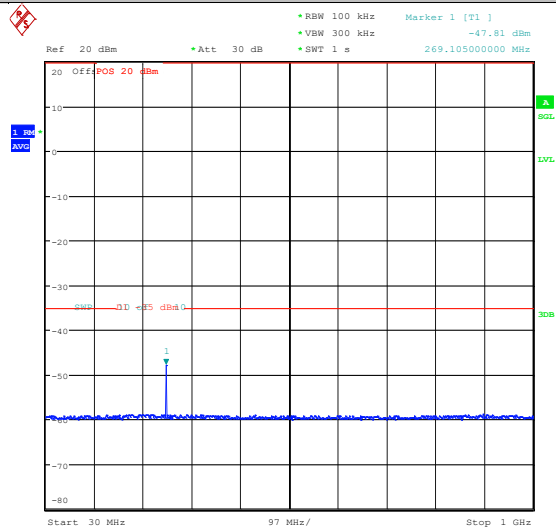


Date: 20.JUN.2024 08:38:49

Band41_15MHz_16QAM_40590_1RB#0_30~1000

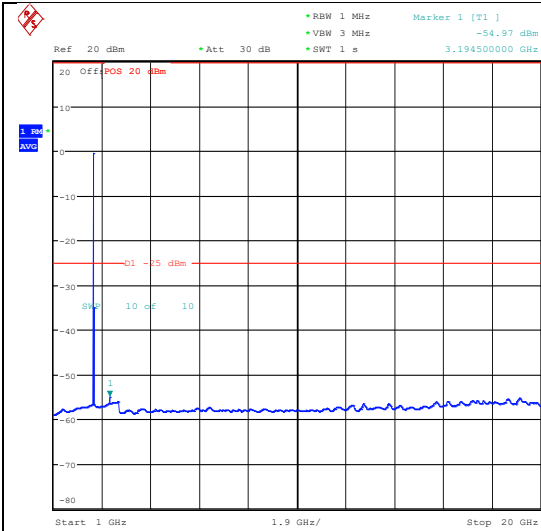


Date: 20.JUN.2024 08:39:04

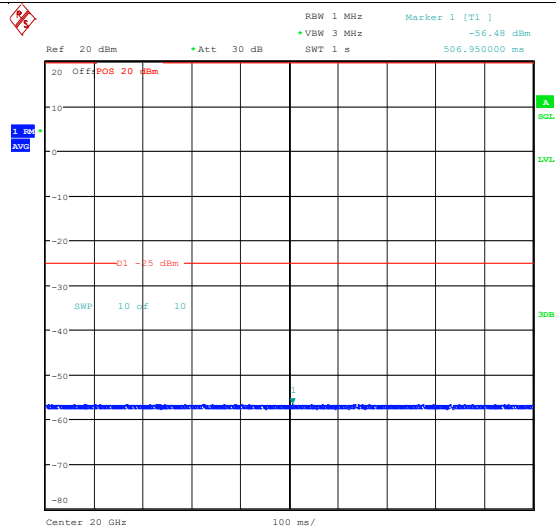


Date: 20.JUN.2024 08:39:21

Band41_15MHz_16QAM_40590_1RB#0_1000~20000_1000~20000

Band41_15MHz_16QAM_40590_1RB#0_20000~7000_7000~27000

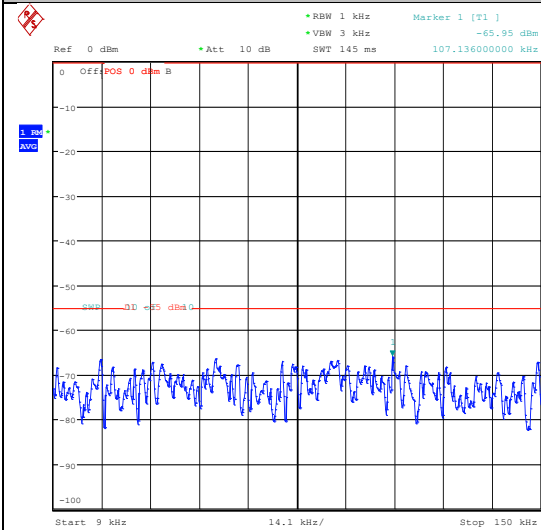


Date: 20.JUN.2024 08:39:29

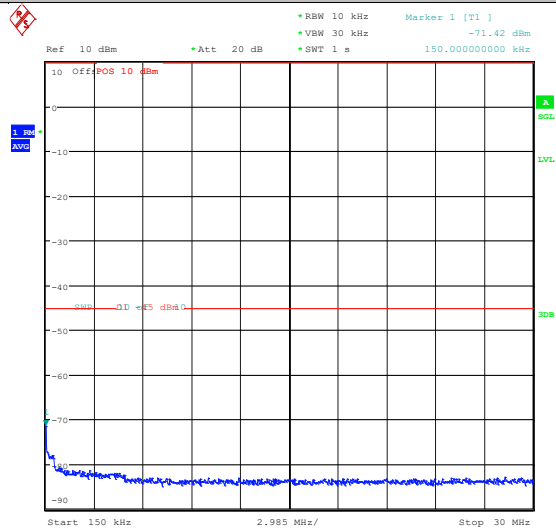


Date: 20.JUN.2024 08:39:44

Band41_15MHz_QPSK_40590_1RB#74_0.009~0.15_0.009~0.15

Band41_15MHz_QPSK_40590_1RB#74_0.15~30_0.15~30

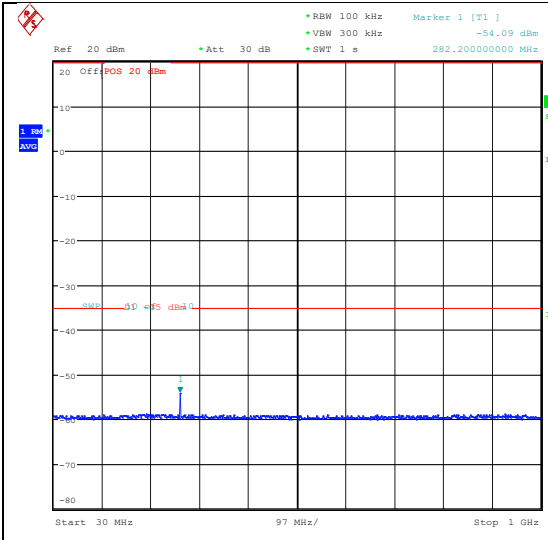


Date: 20.JUN.2024 08:39:58

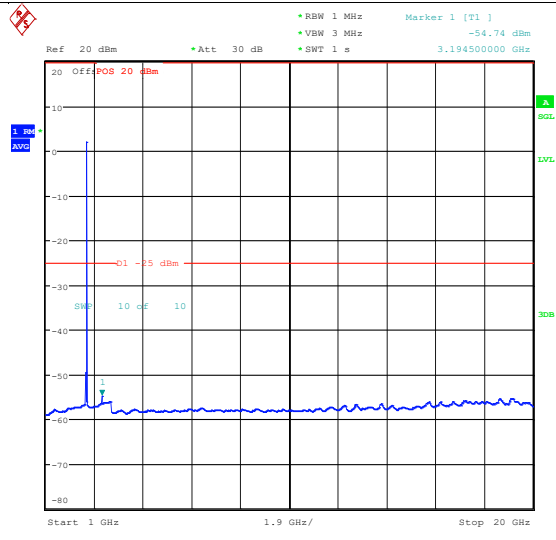


Date: 20.JUN.2024 08:40:13

Band41_15MHz_QPSK_40590_1RB#74_30~100
 0_30~1000

Band41_15MHz_QPSK_40590_1RB#74_1000~20000
 000_1000~20000

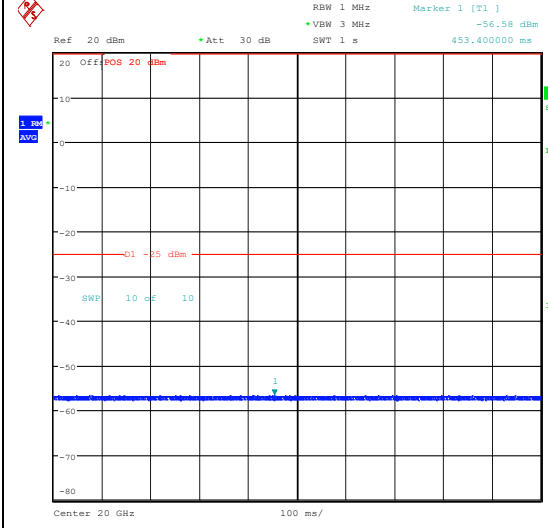


Date: 20.JUN.2024 08:40:37

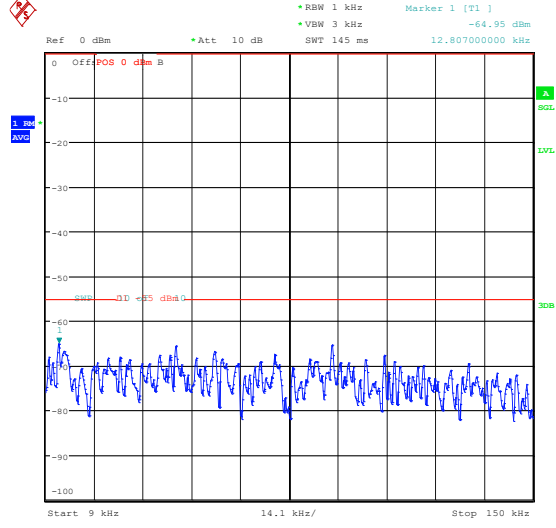

Date: 20.JUN.2024 08:40:46


Band41_15MHz_QPSK_40590_1RB#74_20000~27000_20000~27000

Band41_15MHz_16QAM_40590_1RB#74_0.009~0.15_0.009~0.15

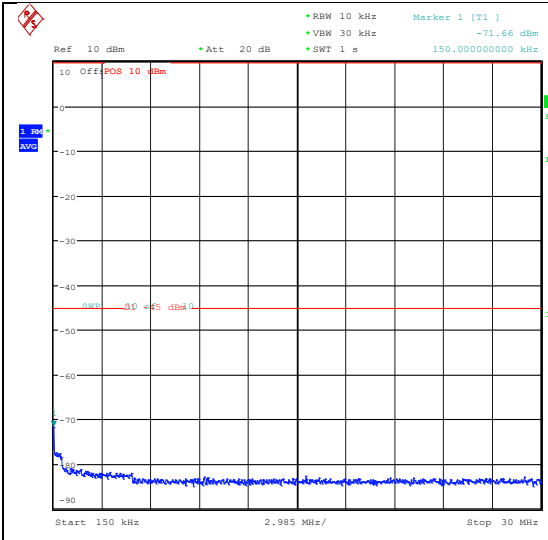


Date: 20.JUN.2024 08:41:01

Band41_15MHz_16QAM_40590_1RB#74_0.15~30_0.15~30

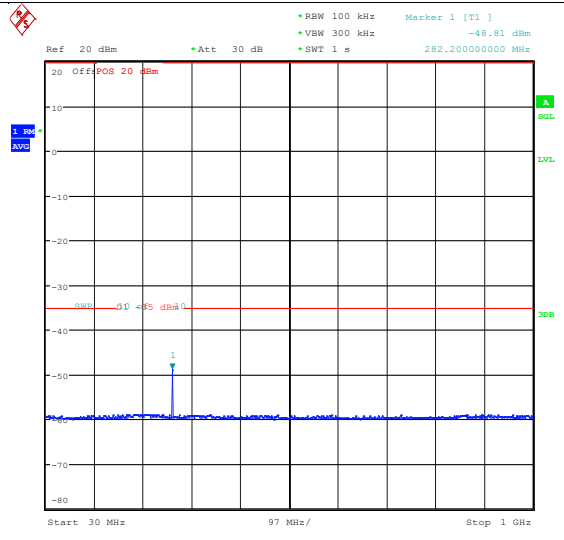


Date: 20.JUN.2024 08:41:15

Band41_15MHz_16QAM_40590_1RB#74_0.30~100_0.30~1000

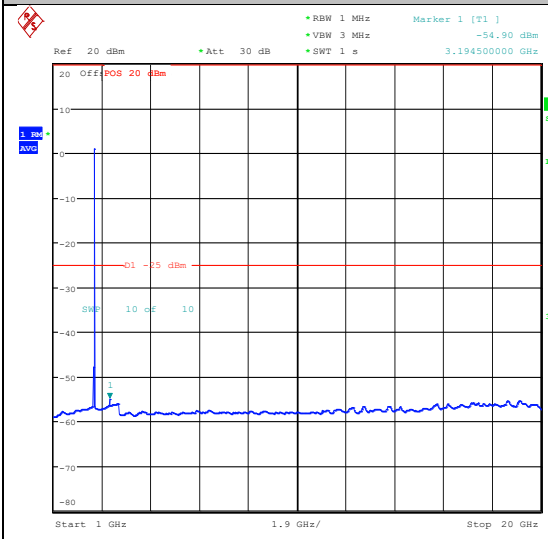


Date: 20.JUN.2024 08:41:30

Band41_15MHz_16QAM_40590_1RB#74_1000~20000_1000~20000

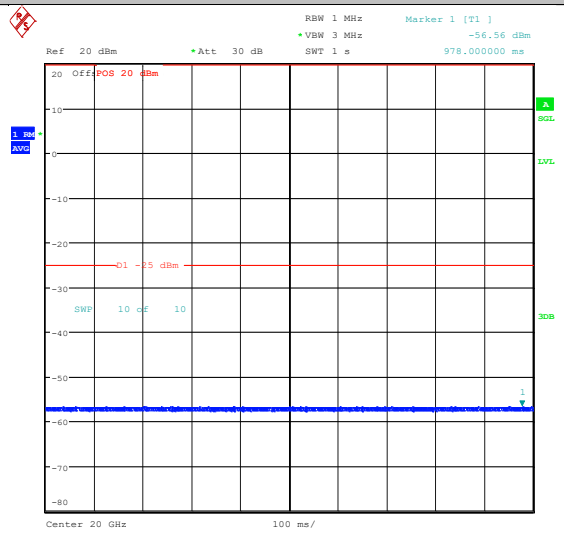


Date: 20.JUN.2024 08:41:55

Band41_15MHz_16QAM_40590_1RB#74_20000~27000_20000~27000

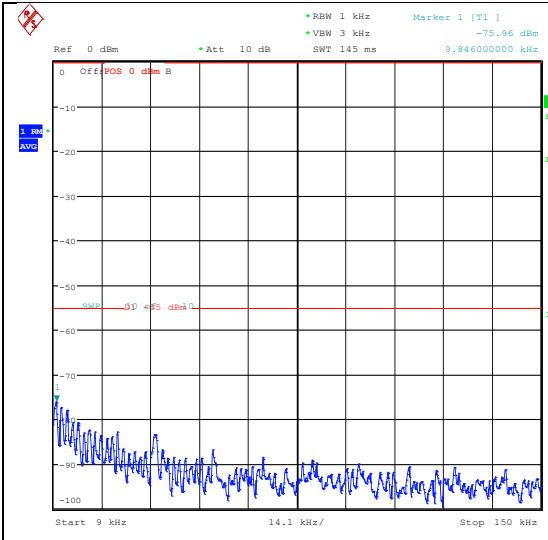


Date: 20 JUN 2024 08:42:03

Band41_15MHz_QPSK_40590_75RB#0_0.009~0.15_0.009~0.15

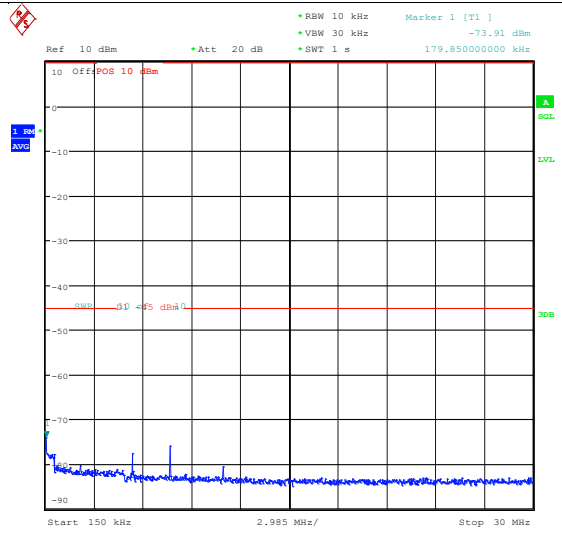


Date: 20 JUN 2024 08:42:18

Band41_15MHz_QPSK_40590_75RB#0_0.15~30_0.15~30

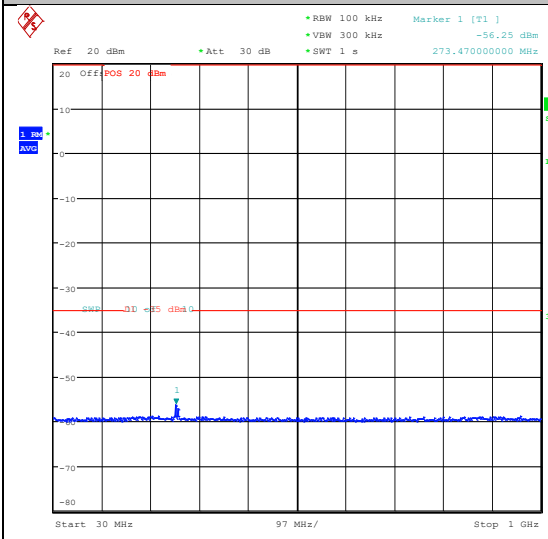


Date: 20 JUN 2024 08:42:32

Band41_15MHz_QPSK_40590_75RB#0_30~100_0_30~1000

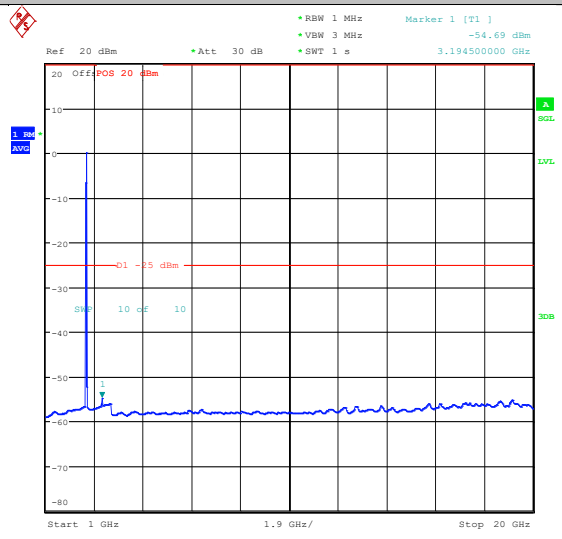


Date: 20 JUN 2024 08:42:47

Band41_15MHz_QPSK_40590_75RB#0_1000~20000_000_1000~20000

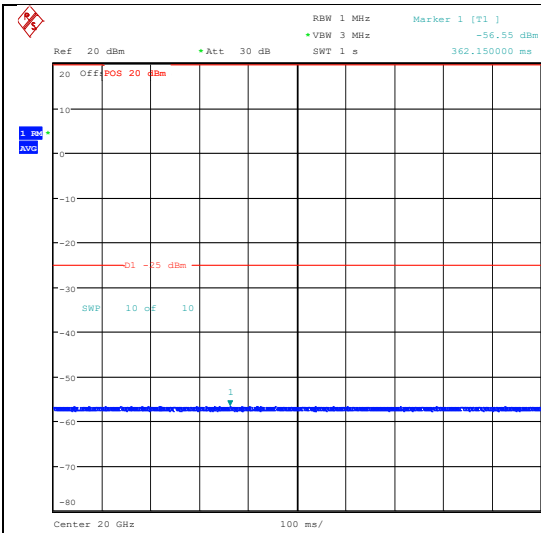


Date: 20.JUN.2024 08:43:12

Band41_15MHz_QPSK_40590_75RB#0_20000~27000_20000~27000

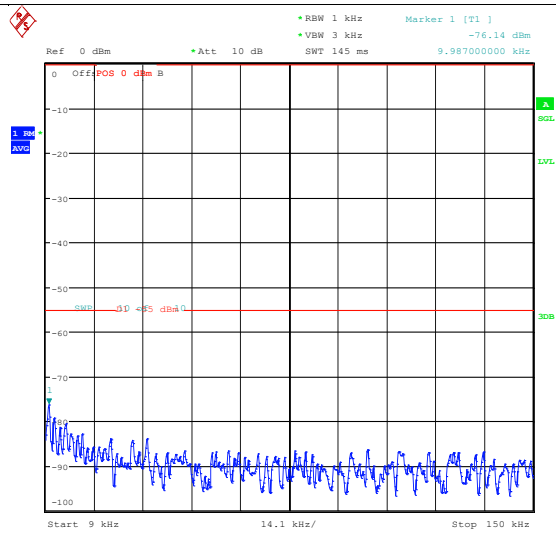


Date: 20.JUN.2024 08:43:21

Band41_15MHz_16QAM_40590_75RB#0_0.009~0.15_0.009~0.15

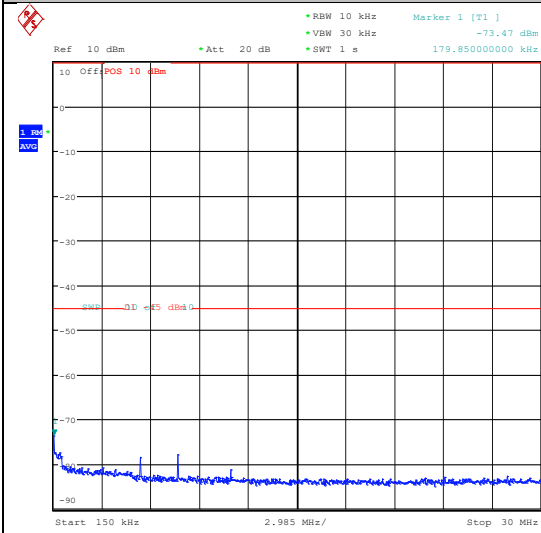



Date: 20.JUN.2024 08:43:36

Band41_15MHz_16QAM_40590_75RB#0_0.15~30_0.15~30

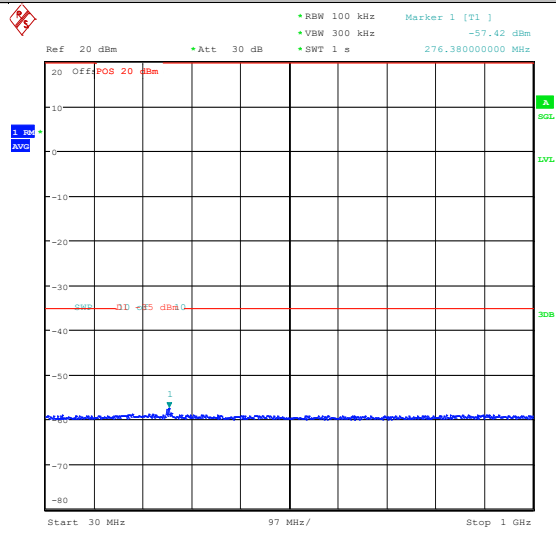



Date: 20.JUN.2024 08:43:49

Band41_15MHz_16QAM_40590_75RB#0_30~100_0_30~1000

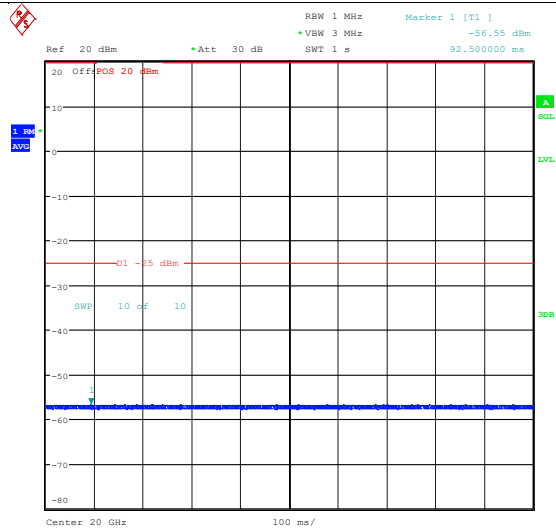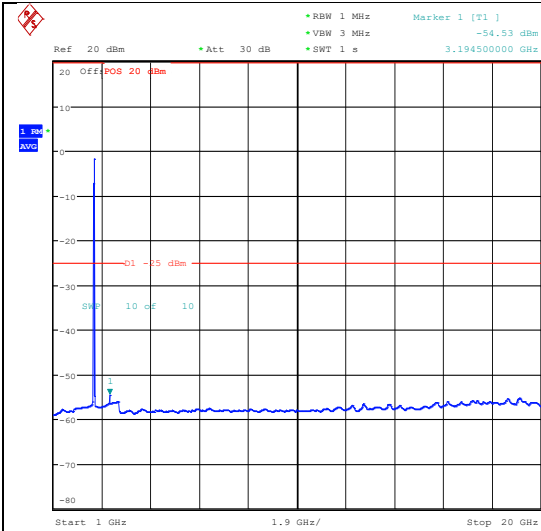


Band41_15MHz_16QAM_40590_75RB#0_1000~
20000_1000~20000

Band41_15MHz_16QAM_40590_75RB#0_20000~
27000_20000~27000

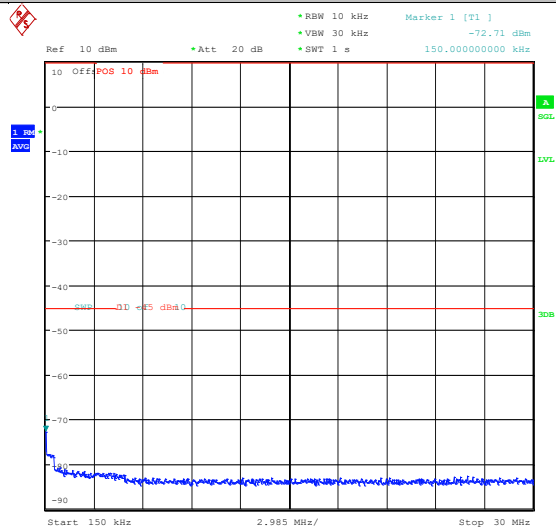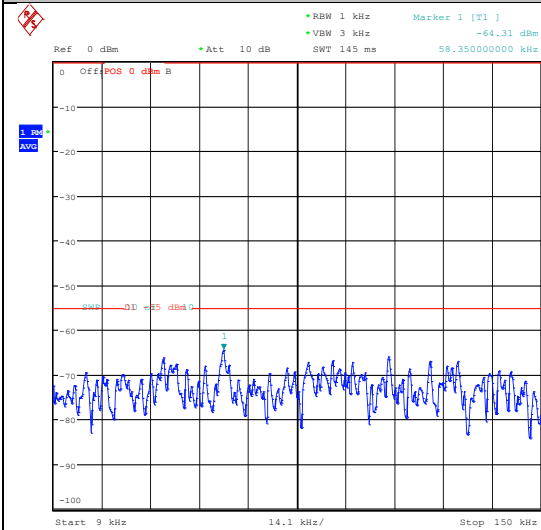


Band41_15MHz_QPSK_41165_1RB#0_0.009~0.
15_0.009~0.15

Band41_15MHz_QPSK_41165_1RB#0_0.15~30_
0.15~30

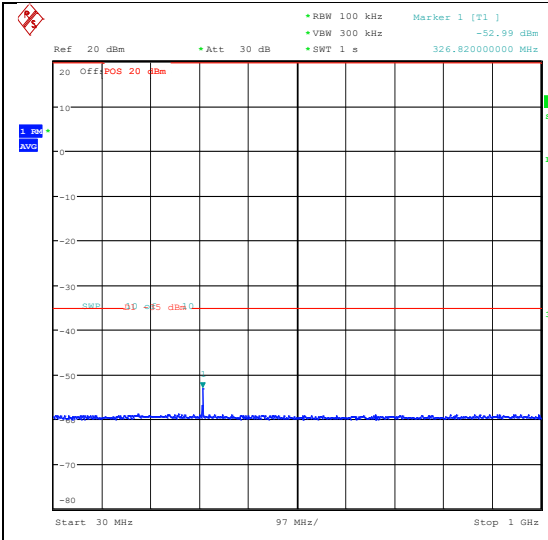


Date: 20.JUN.2024 08:45:08

Band41_15MHz_QPSK_41165_1RB#0_30~1000
_30~1000

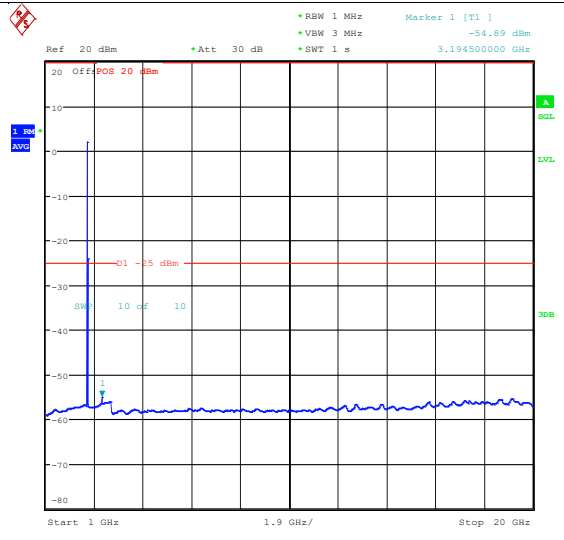


Date: 20.JUN.2024 08:45:23

Band41_15MHz_QPSK_41165_1RB#0_1000~200
00_1000~20000

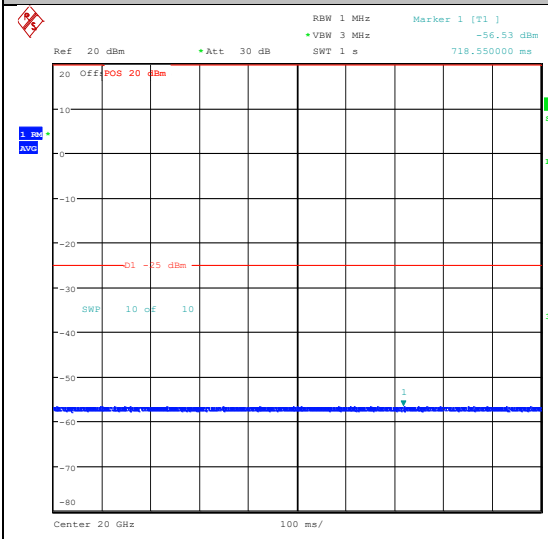


Date: 20.JUN.2024 08:45:48

Band41_15MHz_QPSK_41165_1RB#0_20000~7000
7000_20000~27000

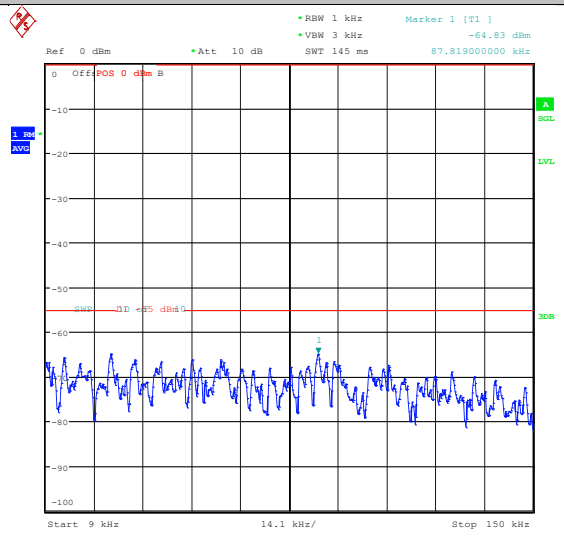


Date: 20.JUN.2024 08:45:58

Band41_15MHz_16QAM_41165_1RB#0_0.009~0.15
15_0.009~0.15

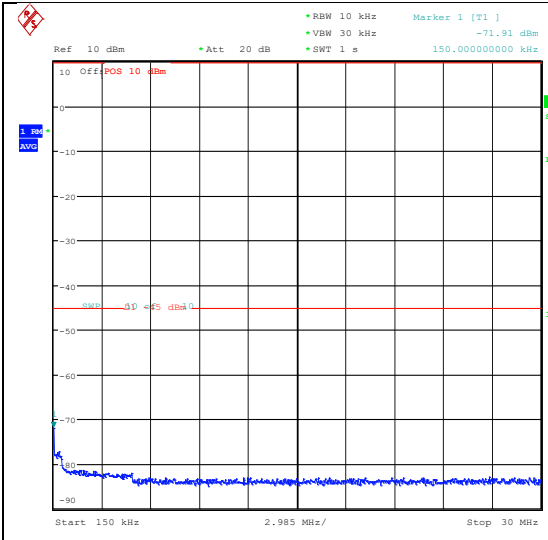


Date: 20.JUN.2024 08:46:13

Band41_15MHz_16QAM_41165_1RB#0_0.15~30

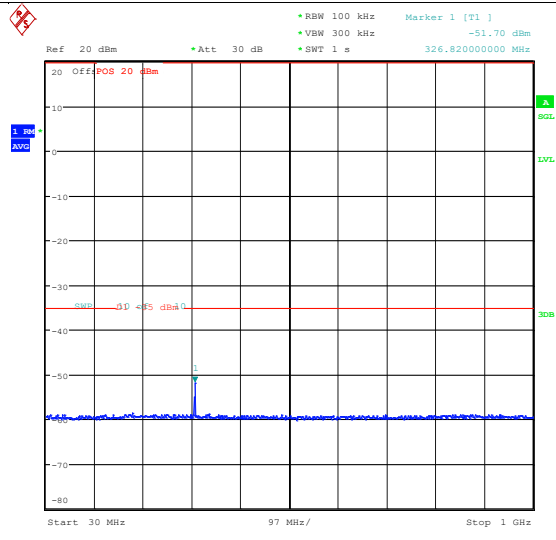


Date: 20.JUN.2024 08:46:26

Band41_15MHz_16QAM_41165_1RB#0_30~1000

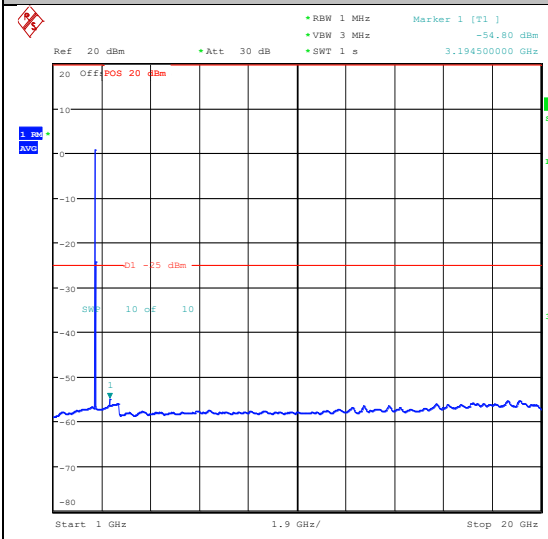


Date: 20.JUN.2024 08:46:41

Band41_15MHz_16QAM_41165_1RB#0_1000~20000

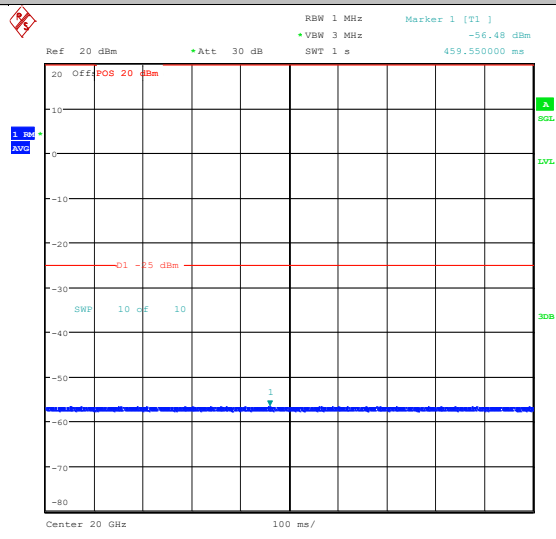


Date: 20.JUN.2024 08:47:06

Band41_15MHz_16QAM_41165_1RB#0_20000~27000

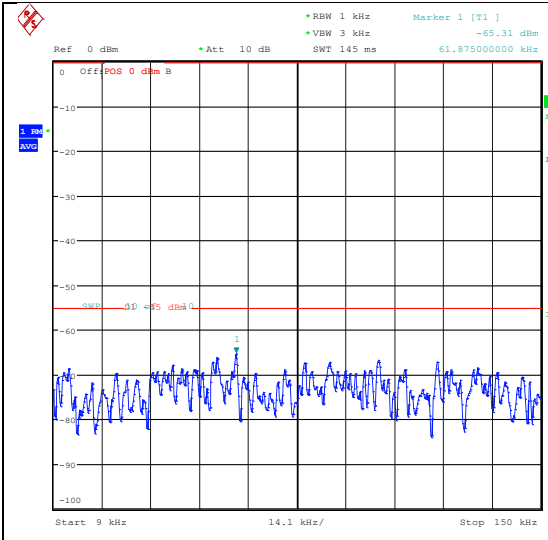


Date: 20.JUN.2024 08:47:14

Band41_15MHz_QPSK_41165_1RB#74_0.009~0.15_0.009~0.15

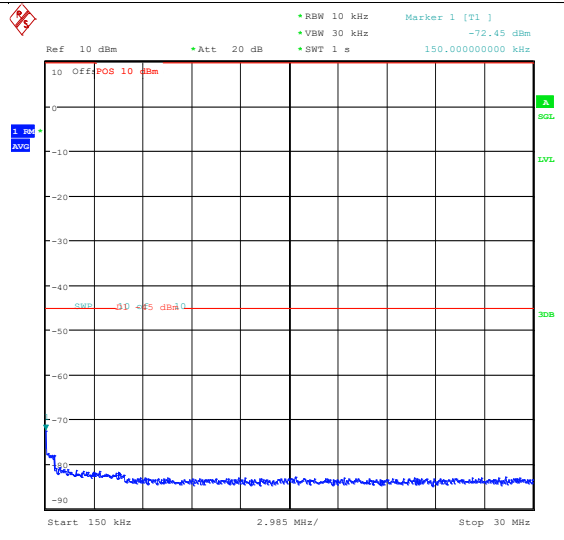


Date: 20.JUN.2024 08:47:29

Band41_15MHz_QPSK_41165_1RB#74_0.15~30_0.15~30

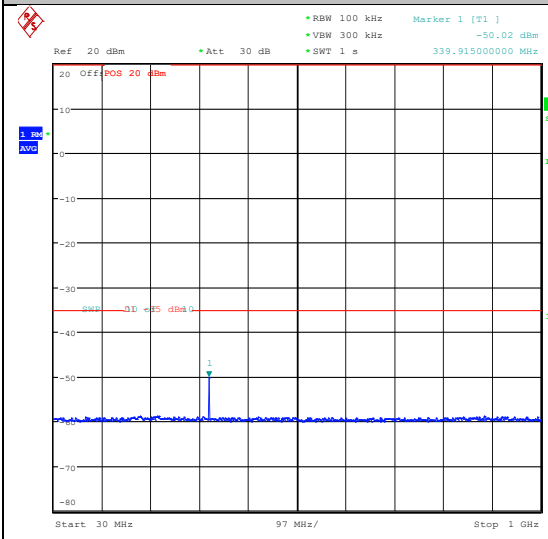


Date: 20.JUN.2024 08:47:43

Band41_15MHz_QPSK_41165_1RB#74_30~100_0_30~1000

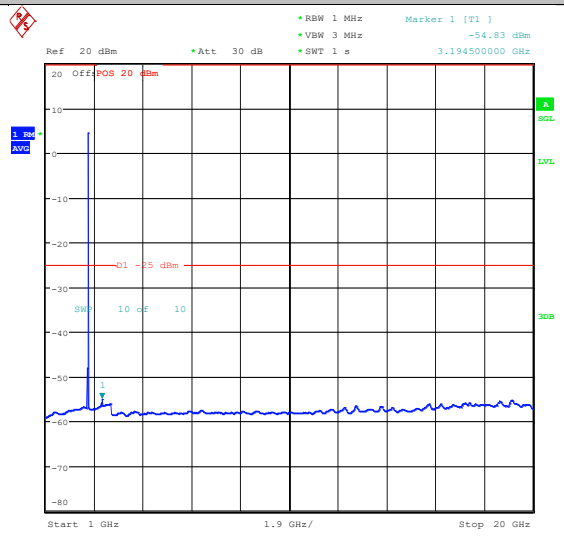


Date: 20.JUN.2024 08:47:58

Band41_15MHz_QPSK_41165_1RB#74_1000~20000_000_1000~20000

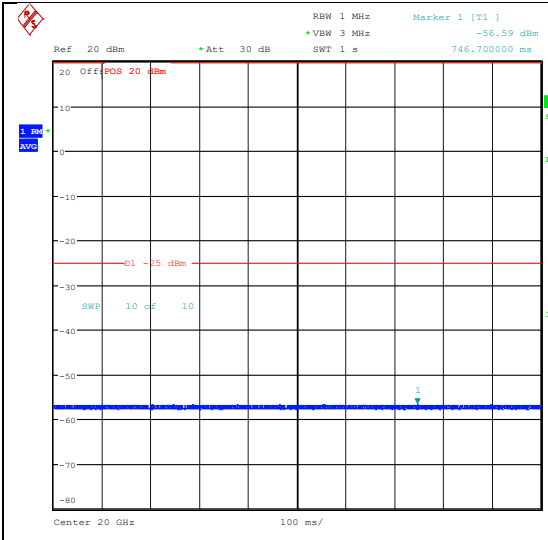


Date: 20.JUN.2024 08:48:18

Band41_15MHz_QPSK_41165_1RB#74_20000~27000_20000~27000

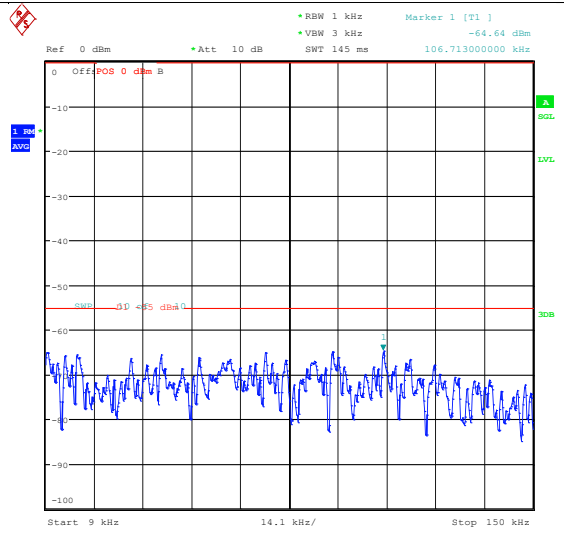


Date: 20.JUN.2024 08:48:27

Band41_15MHz_16QAM_41165_1RB#74_0.009~0.15_0.009~0.15

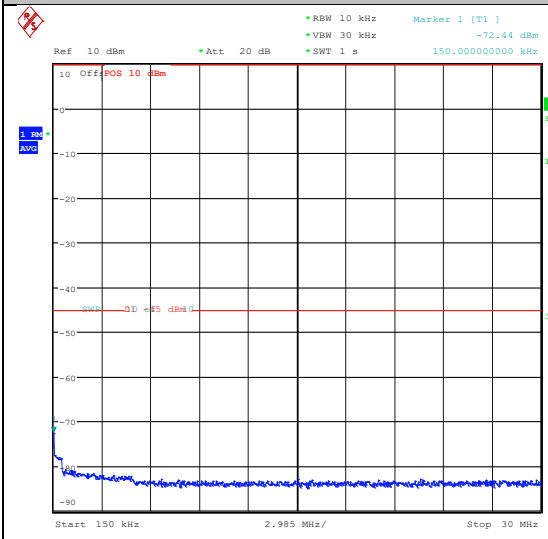



Date: 20.JUN.2024 08:48:43

Band41_15MHz_16QAM_41165_1RB#74_0.15~30_0.15~30

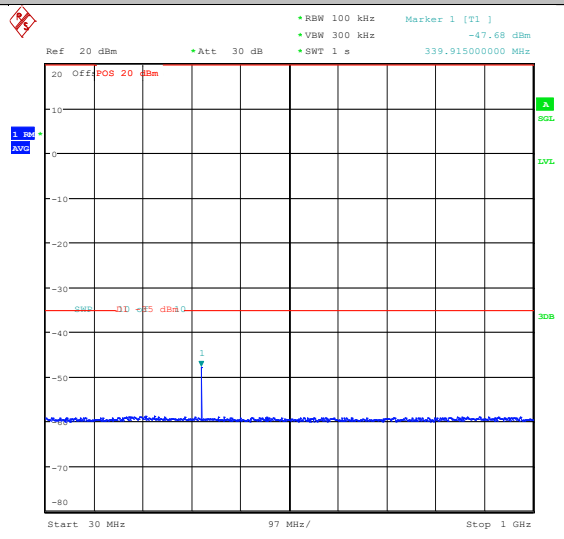



Date: 20.JUN.2024 08:48:57

Band41_15MHz_16QAM_41165_1RB#74_30~100_30~100

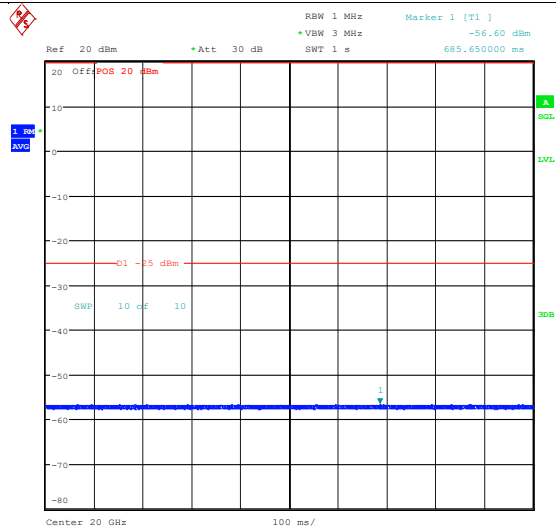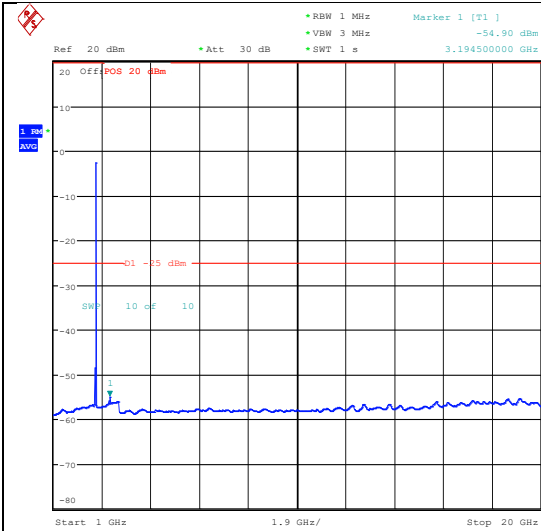


Band41_15MHz_16QAM_41165_1RB#74_1000~20000_1000~20000

Band41_15MHz_16QAM_41165_1RB#74_20000~27000_20000~27000

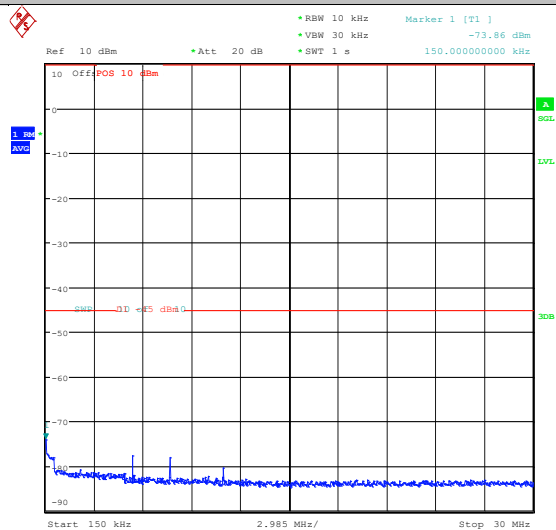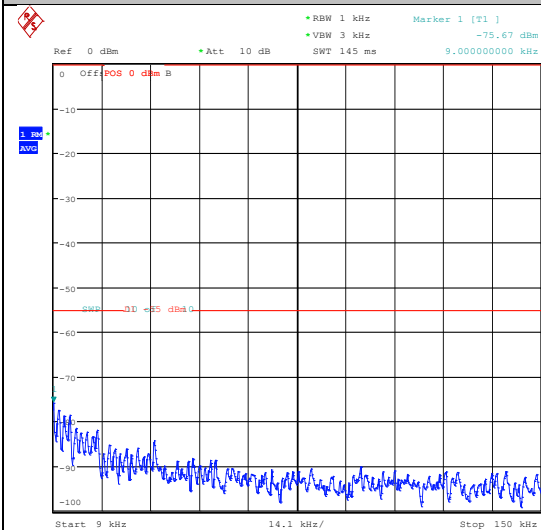


Band41_15MHz_QPSK_41165_75RB#0_0.009~0.15_0.009~0.15

Band41_15MHz_QPSK_41165_75RB#0_0.15~30_0.15~30

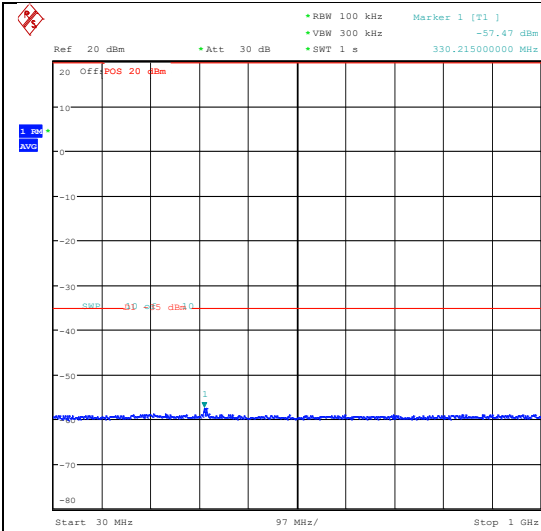


Date: 20.JUN.2024 08:50:13

Band41_15MHz_QPSK_41165_75RB#0_30~100
0_30~1000

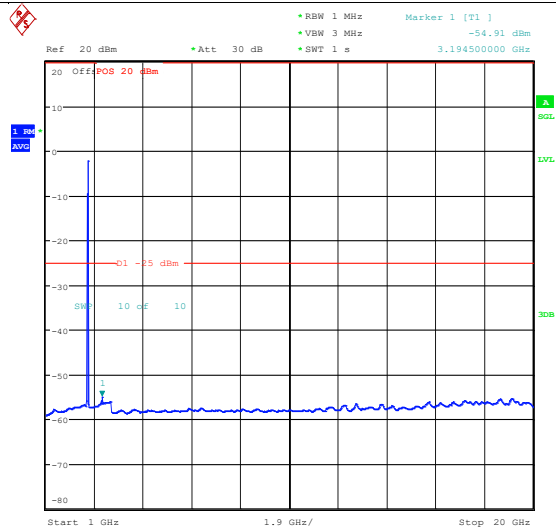


Date: 20.JUN.2024 08:50:28

Band41_15MHz_QPSK_41165_75RB#0_1000~20
000_1000~20000

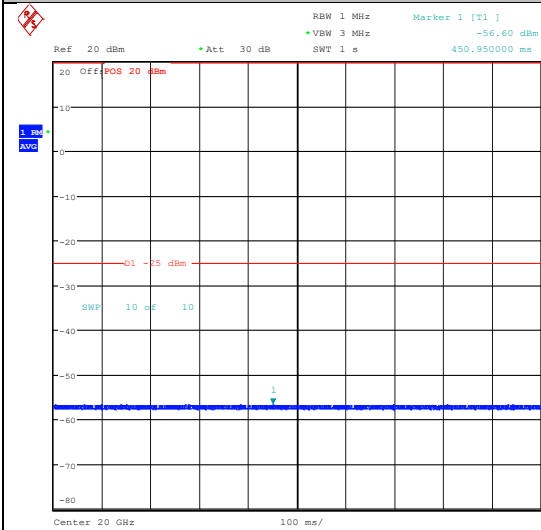


Date: 20.JUN.2024 08:50:45

Band41_15MHz_QPSK_41165_75RB#0_20000~27000_20000~27000

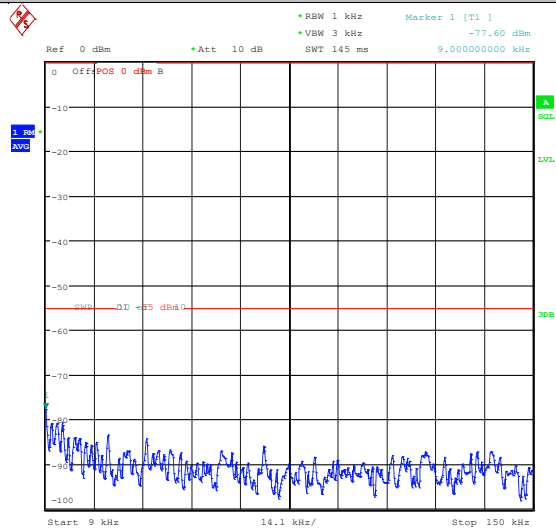


Date: 20.JUN.2024 08:50:54

Band41_15MHz_16QAM_41165_75RB#0_0.009~0.15_0.009~0.15

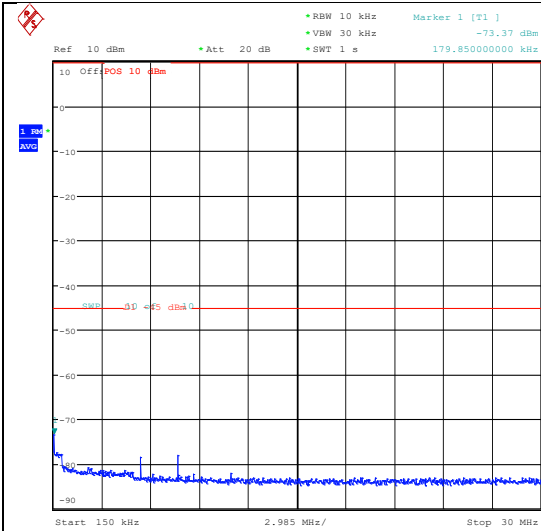


Date: 20.JUN.2024 08:51:09

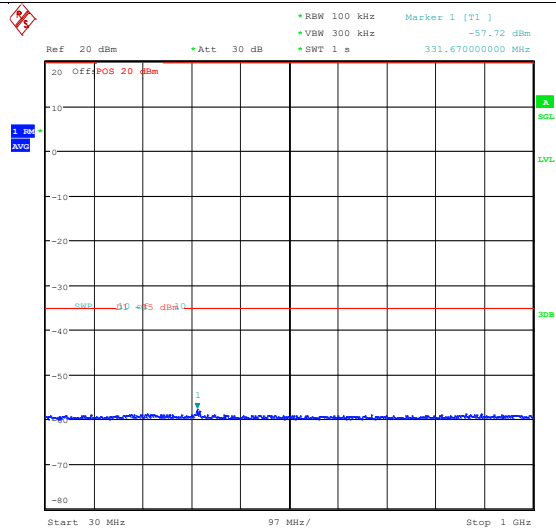


Date: 20.JUN.2024 08:51:23

Band41_15MHz_16QAM_41165_75RB#0_0.15~30
0_0.15~30

Band41_15MHz_16QAM_41165_75RB#0_30~100
0_30~1000

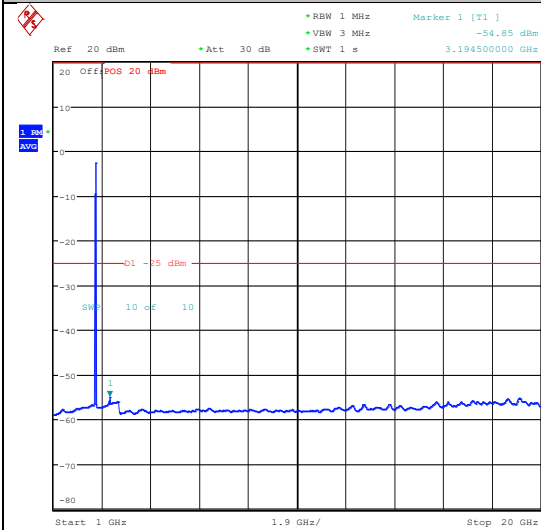


Date: 20.JUN.2024 08:51:37

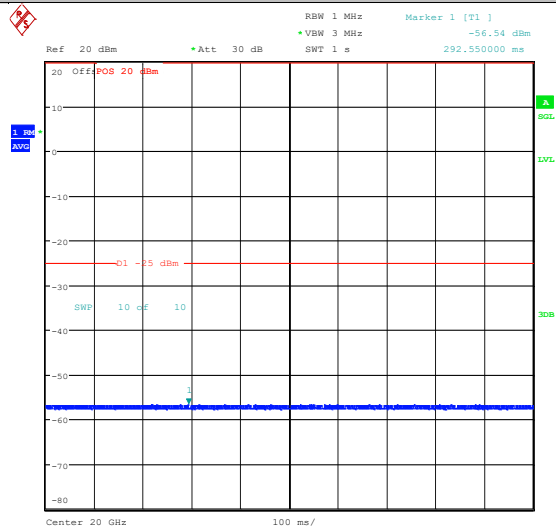

Date: 20.JUN.2024 08:51:53


Band41_15MHz_16QAM_41165_75RB#0_1000~
20000_1000~20000

Band41_15MHz_16QAM_41165_75RB#0_20000~
27000_20000~27000

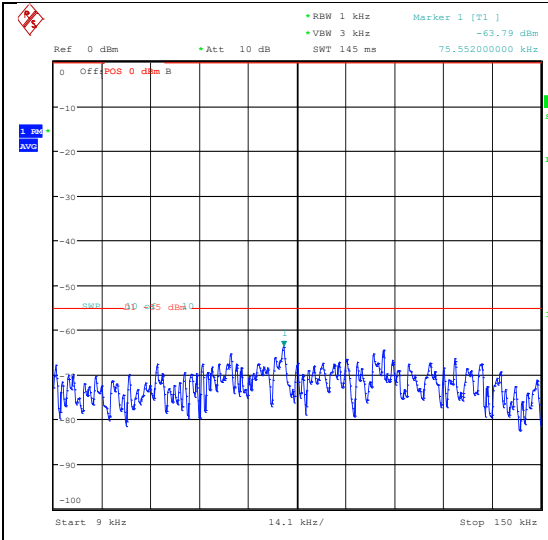


Date: 20.JUN.2024 09:07:11

Band41_20MHz_QPSK_40140_1RB#0_0.009~0.15_0.009~0.15

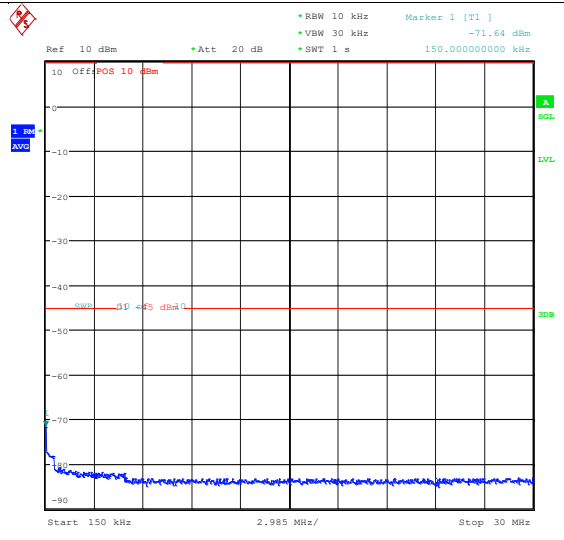


Date: 20.JUN.2024 09:07:26

Band41_20MHz_QPSK_40140_1RB#0_0.15~30_0.15~30

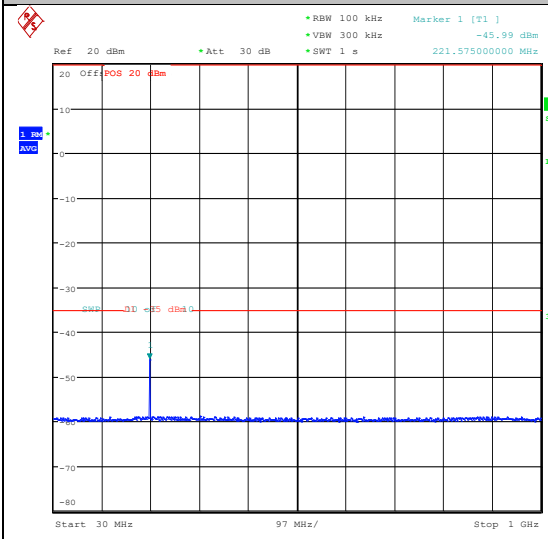


Date: 20.JUN.2024 09:07:40

Band41_20MHz_QPSK_40140_1RB#0_30~1000_30~1000

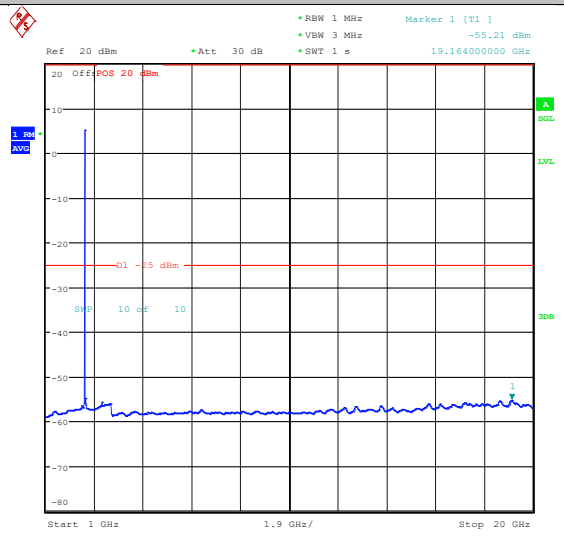


Date: 20.JUN.2024 09:07:55

Band41_20MHz_QPSK_40140_1RB#0_1000~20000_00_1000~20000

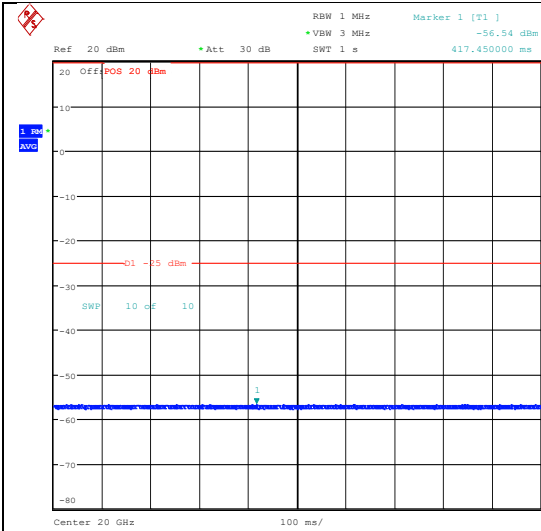


Date: 20.JUN.2024 09:08:20

Band41_20MHz_QPSK_40140_1RB#0_20000~27000

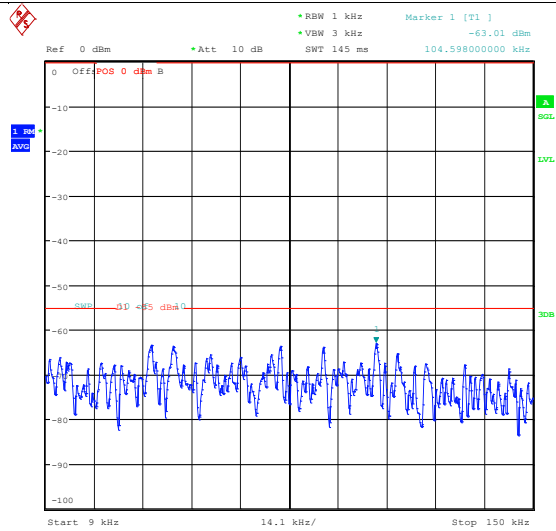


Date: 20.JUN.2024 09:08:29

Band41_20MHz_16QAM_40140_1RB#0_0.009~0.15

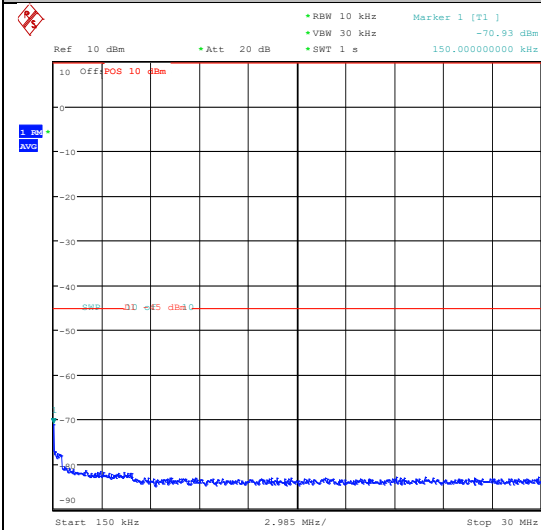


Date: 20.JUN.2024 09:08:44

Band41_20MHz_16QAM_40140_1RB#0_0.15~30

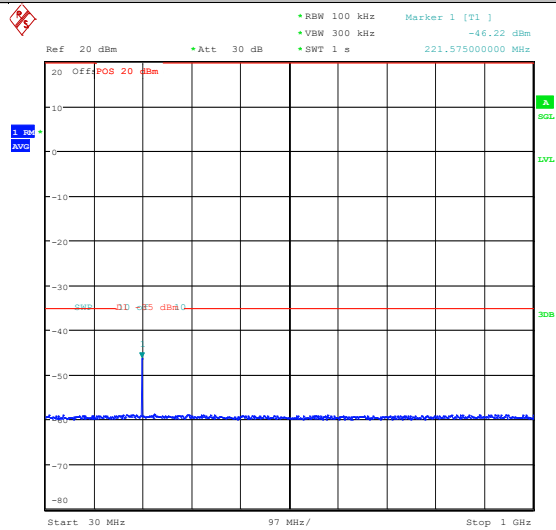


Date: 20.JUN.2024 09:08:57

Band41_20MHz_16QAM_40140_1RB#0_30~1000

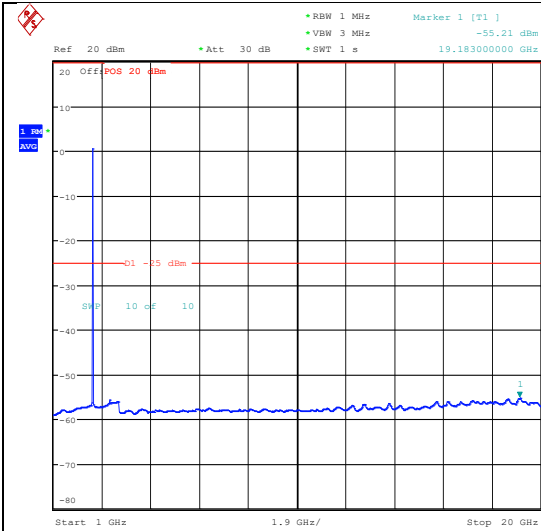


Date: 20.JUN.2024 09:09:12

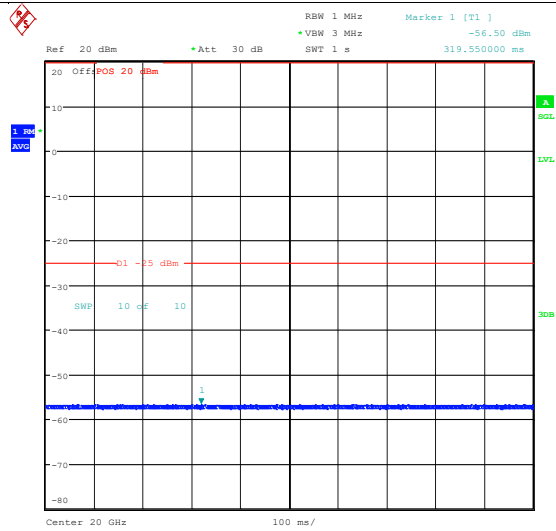


Date: 20.JUN.2024 09:09:36

Band41_20MHz_16QAM_40140_1RB#0_1000~20000_1000~20000

Band41_20MHz_16QAM_40140_1RB#0_20000~7000_7000~27000

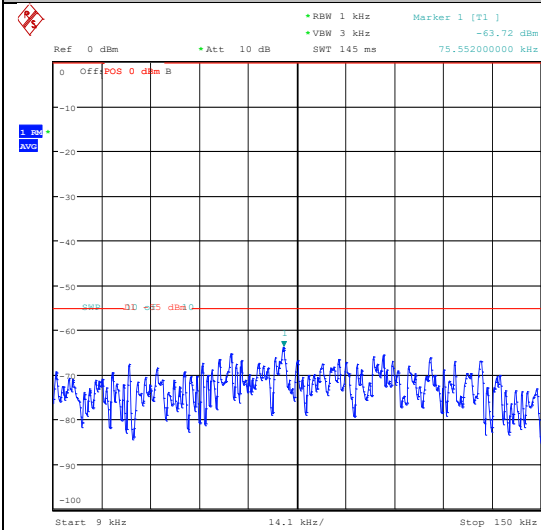


Date: 20.JUN.2024 09:09:45

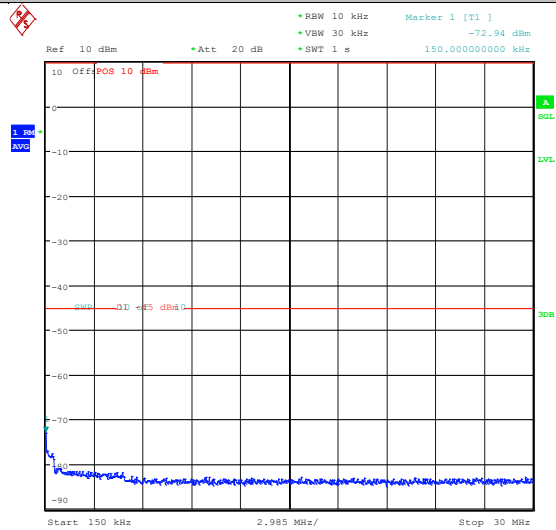


Date: 20.JUN.2024 09:09:59

Band41_20MHz_QPSK_40140_1RB#99_0.009~0.15_0.15_0.009~0.15

Band41_20MHz_QPSK_40140_1RB#99_0.15~0.30_0.15~0.30

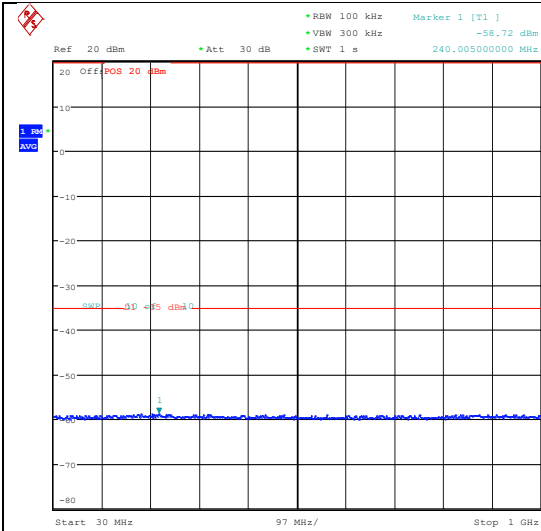


Date: 20.JUN.2024 09:10:13

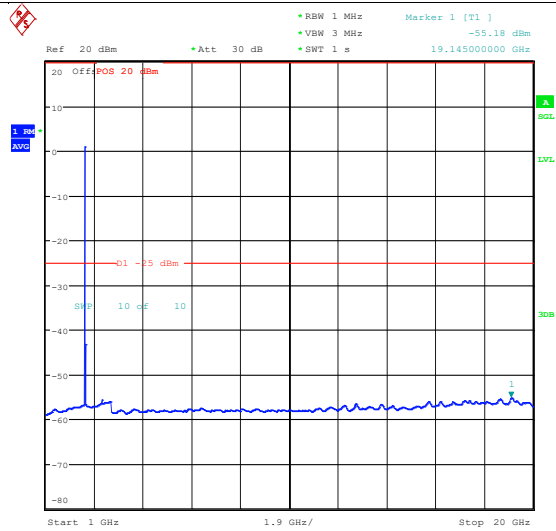


Date: 20.JUN.2024 09:10:28

Band41_20MHz_QPSK_40140_1RB#99_30~100
0_30~1000

Band41_20MHz_QPSK_40140_1RB#99_1000~20
000_1000~20000

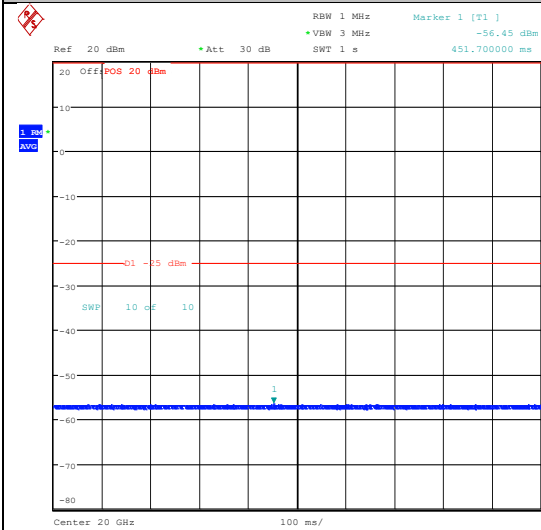


Date: 20.JUN.2024 09:10:52

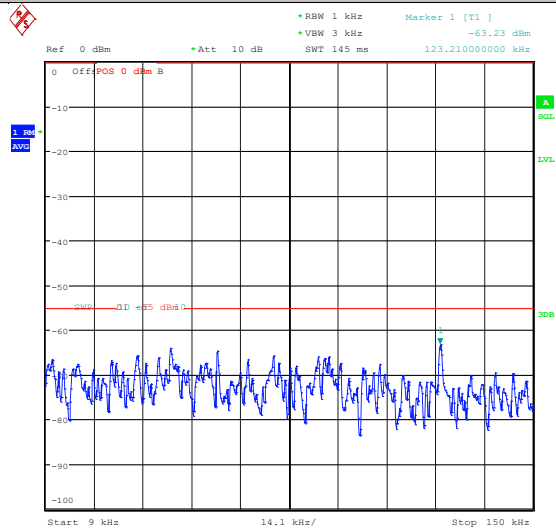

Date: 20.JUN.2024 09:11:01


Band41_20MHz_QPSK_40140_1RB#99_20000~27000_20000~27000

Band41_20MHz_16QAM_40140_1RB#99_0.009~0.15_0.009~0.15

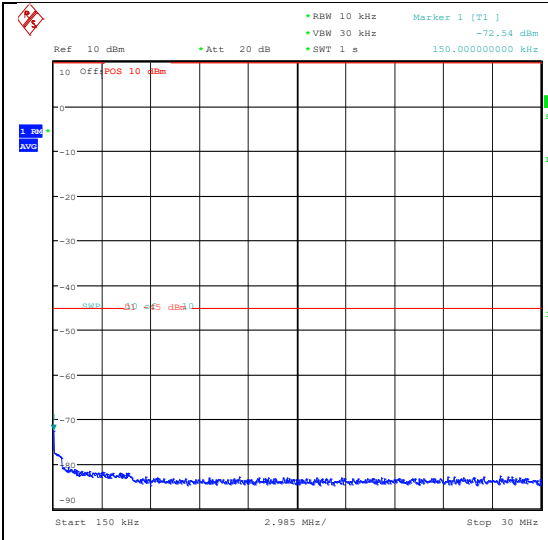


Date: 20.JUN.2024 09:11:16

Band41_20MHz_16QAM_40140_1RB#99_0.15~30_0.15~30

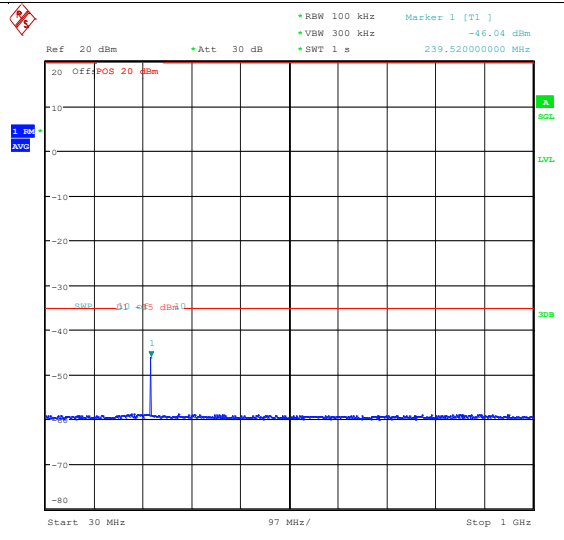


Date: 20.JUN.2024 09:11:30

Band41_20MHz_16QAM_40140_1RB#99_30~100_0_30~1000

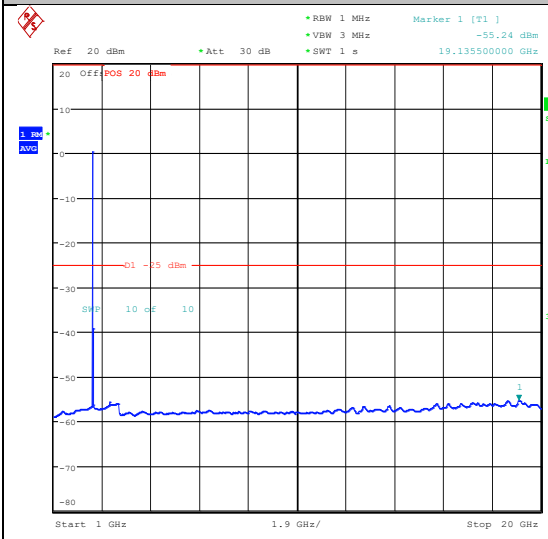


Date: 20.JUN.2024 09:11:44

Band41_20MHz_16QAM_40140_1RB#99_1000~20000_1000~20000

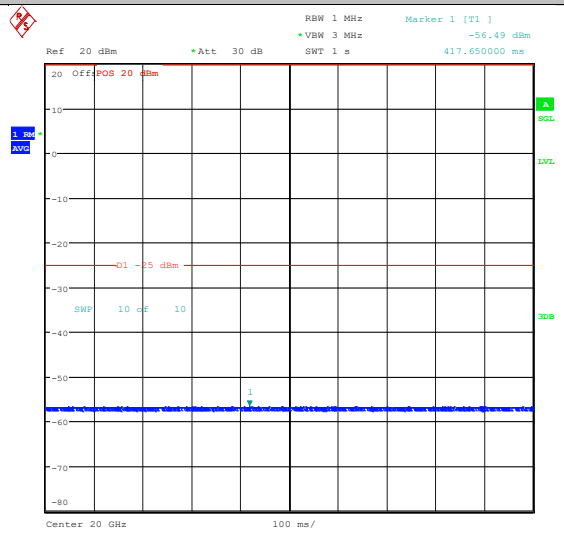


Date: 20.JUN.2024 09:12:01

Band41_20MHz_16QAM_40140_1RB#99_20000~27000_20000~27000

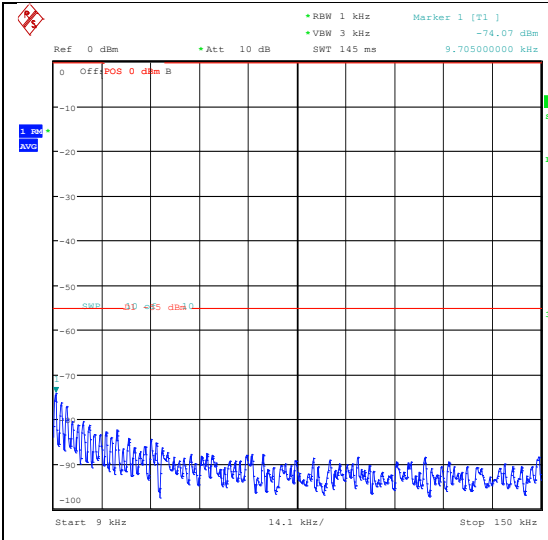


Date: 20.JUN.2024 09:12:09

Band41_20MHz_QPSK_40140_100RB#0_0.009~0.15_0.009~0.15

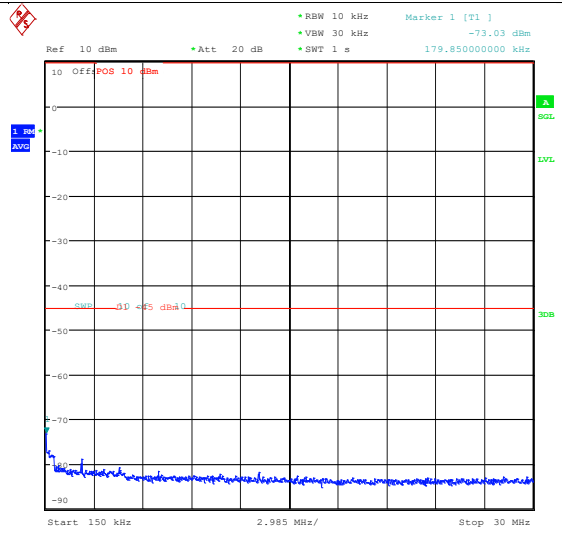


Date: 20.JUN.2024 09:12:24

Band41_20MHz_QPSK_40140_100RB#0_0.15~3_0_0.15~30

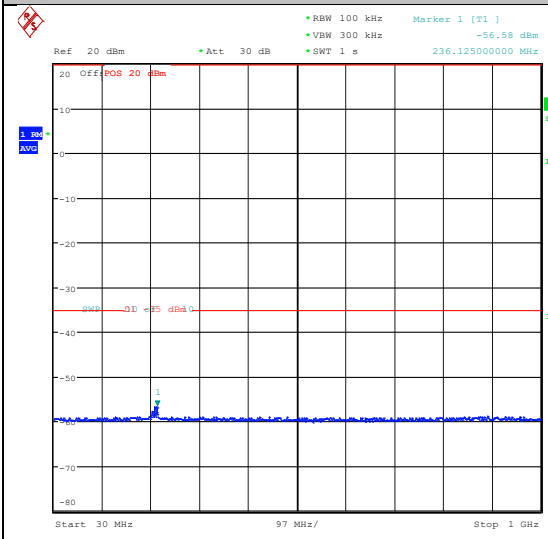


Date: 20.JUN.2024 09:12:37

Band41_20MHz_QPSK_40140_100RB#0_30~1000_30~1000

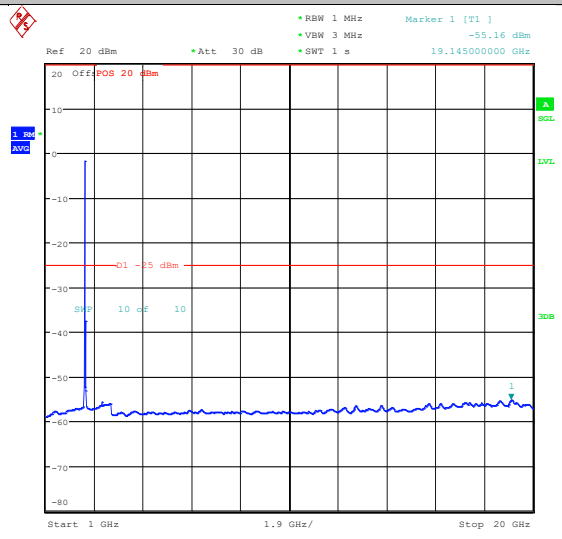


Date: 20.JUN.2024 09:12:52

Band41_20MHz_QPSK_40140_100RB#0_1000~20000_1000~20000

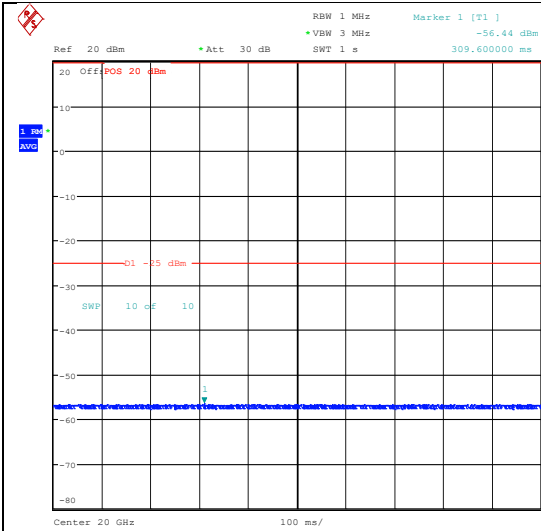


Date: 20.JUN.2024 09:13:17

Band41_20MHz_QPSK_40140_100RB#0_20000
 ~27000_20000~27000

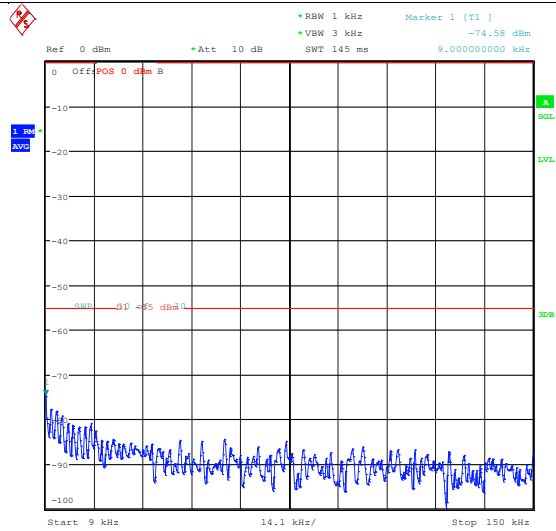


Date: 20.JUN.2024 09:13:26

Band41_20MHz_16QAM_40140_100RB#0_0.009
 ~0.15_0.009~0.15

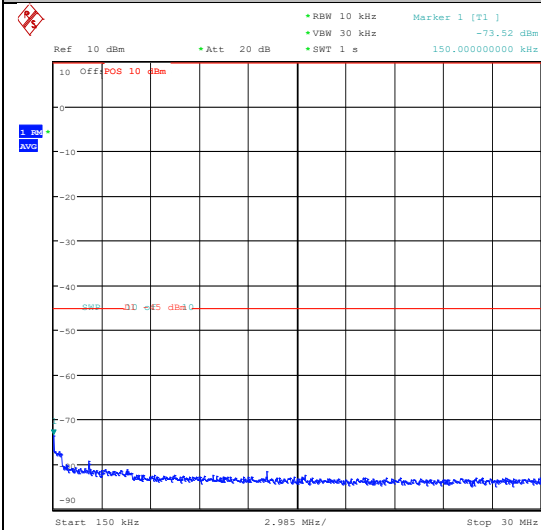


Date: 20.JUN.2024 09:13:41

Band41_20MHz_16QAM_40140_100RB#0_0.15
 ~30_0.15~30

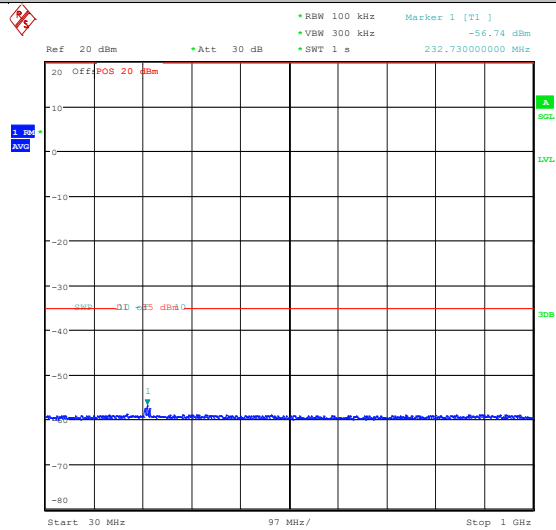


Date: 20.JUN.2024 09:13:54

Band41_20MHz_16QAM_40140_100RB#0_30~1000
 00_30~1000

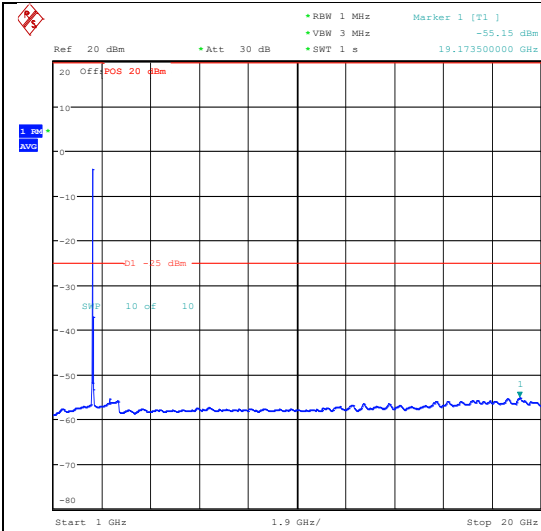


Date: 20.JUN.2024 09:14:09

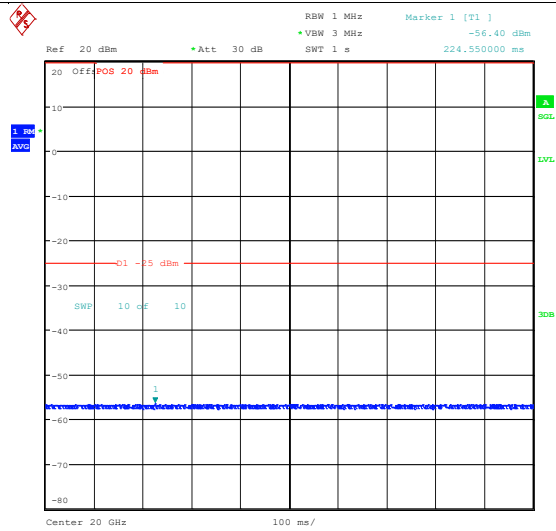


Date: 20.JUN.2024 09:14:25

Band41_20MHz_16QAM_40140_100RB#0_1000
~20000_1000~20000

Band41_20MHz_16QAM_40140_100RB#0_20000
~27000_20000~27000

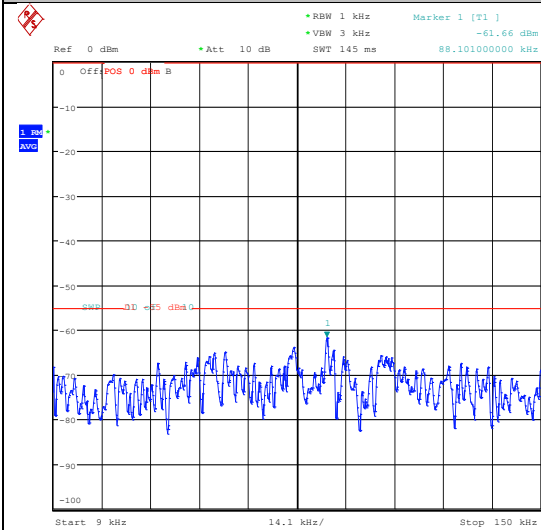


Date: 20.JUN.2024 09:14:36

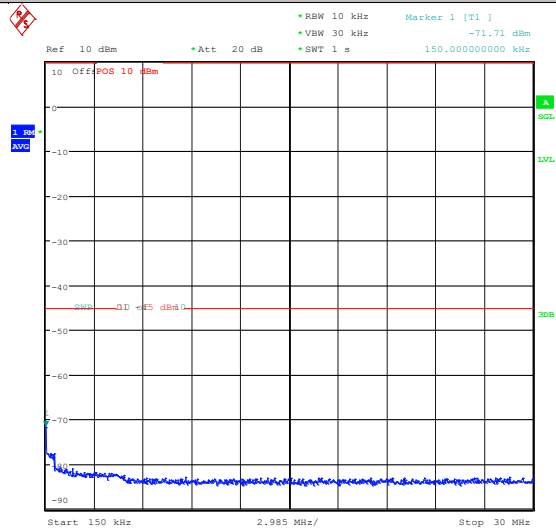

Date: 20.JUN.2024 09:14:50


Band41_20MHz_QPSK_40590_1RB#0_0.009~0.15
15_0.009~0.15

Band41_20MHz_QPSK_40590_1RB#0_0.15~30
0.15~30

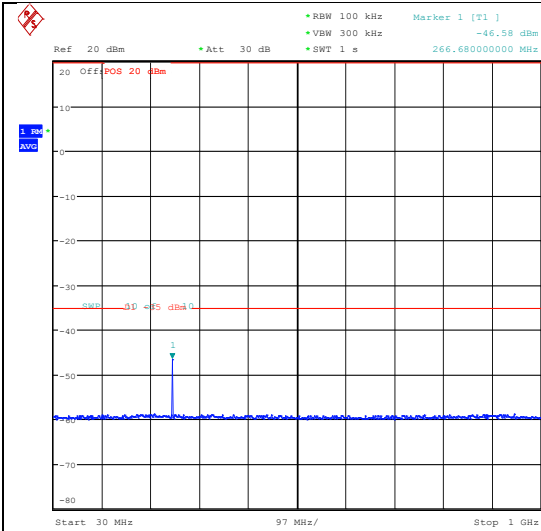


Date: 20 JUN 2024 09:15:04

Band41_20MHz_QPSK_40590_1RB#0_30~1000

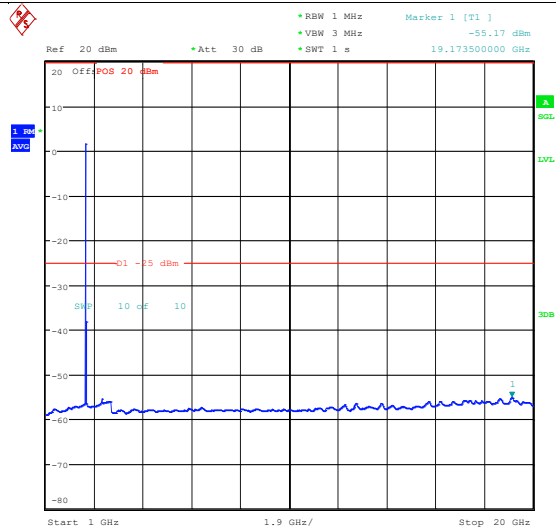


Date: 20 JUN 2024 09:15:19

Band41_20MHz_QPSK_40590_1RB#0_1000~20000

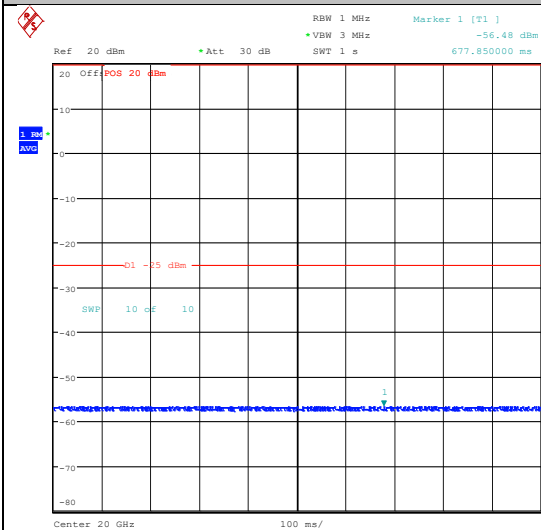


Date: 20 JUN 2024 09:15:44

Band41_20MHz_QPSK_40590_1RB#0_20000~7000_20000~27000

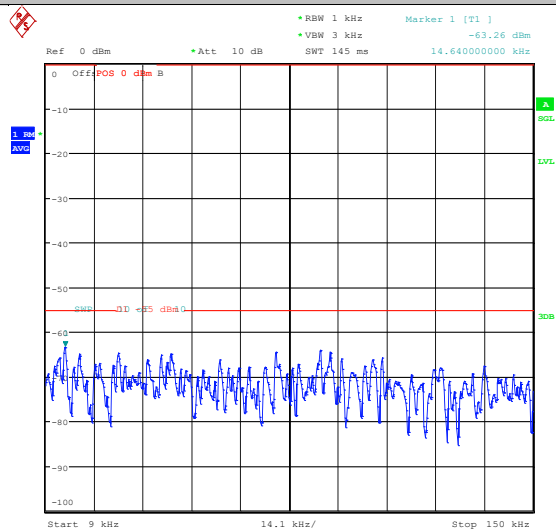


Date: 20 JUN 2024 09:15:53

Band41_20MHz_16QAM_40590_1RB#0_0.009~0.15_0.009~0.15

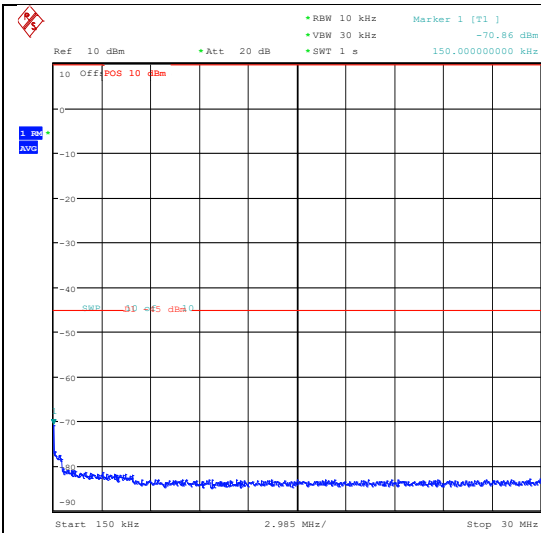


Date: 20.JUN.2024 09:16:08

Band41_20MHz_16QAM_40590_1RB#0_0.15~3
 0_0.15~30

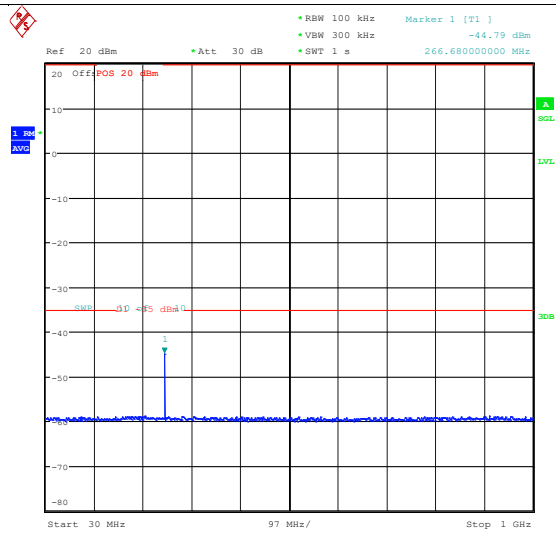


Date: 20.JUN.2024 09:16:21

Band41_20MHz_16QAM_40590_1RB#0_30~1000
 _30~1000

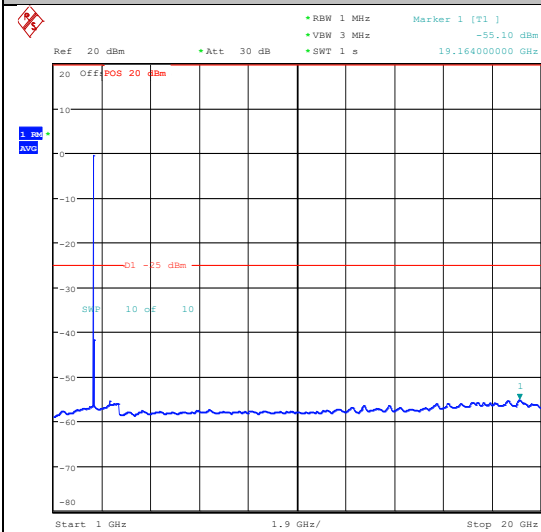


Date: 20.JUN.2024 09:16:36

Band41_20MHz_16QAM_40590_1RB#0_1000~20000
 0000_1000~20000

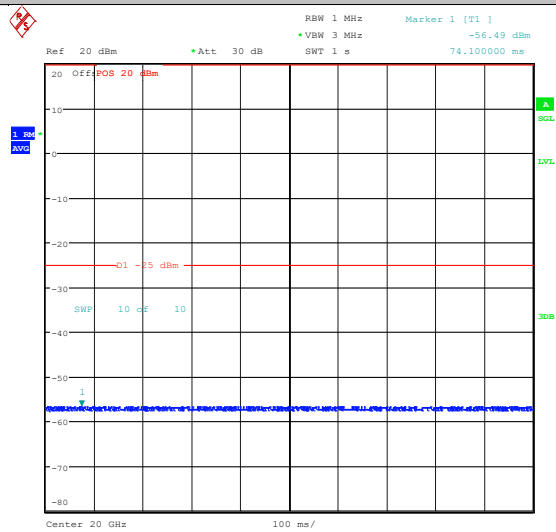


Date: 20.JUN.2024 09:16:55

Band41_20MHz_16QAM_40590_1RB#0_20000~27000
 7000_20000~27000

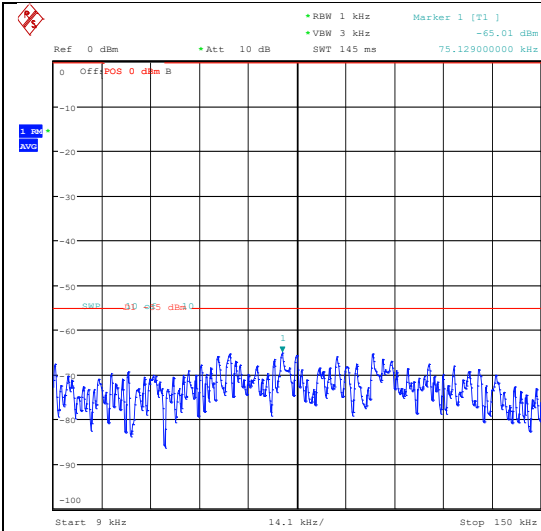


Date: 20.JUN.2024 09:17:03

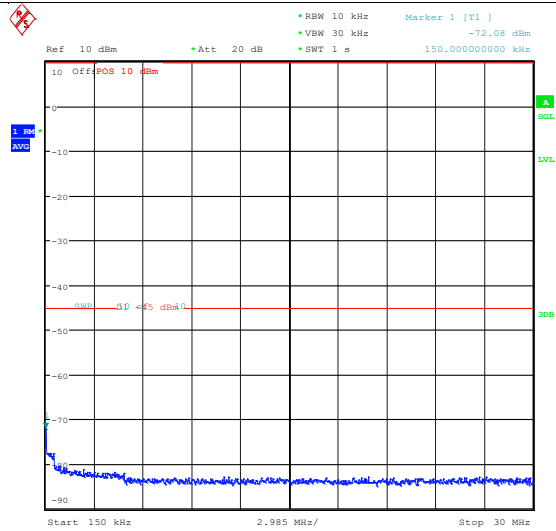


Date: 20.JUN.2024 09:17:18

Band41_20MHz_QPSK_40590_1RB#99_0.009~0.15_0.009~0.15

Band41_20MHz_QPSK_40590_1RB#99_0.15~30_0.15~30

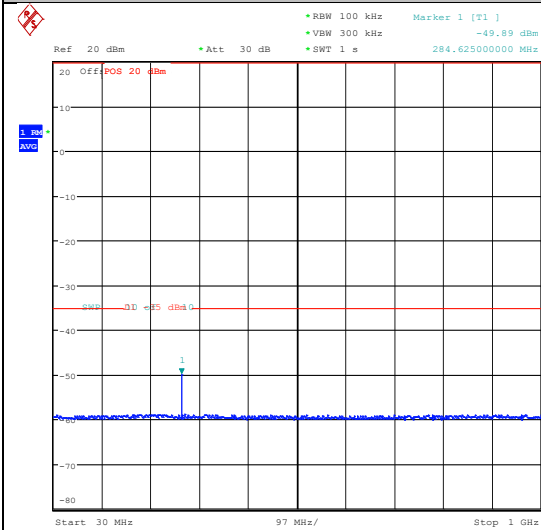


Date: 20.JUN.2024 09:17:32

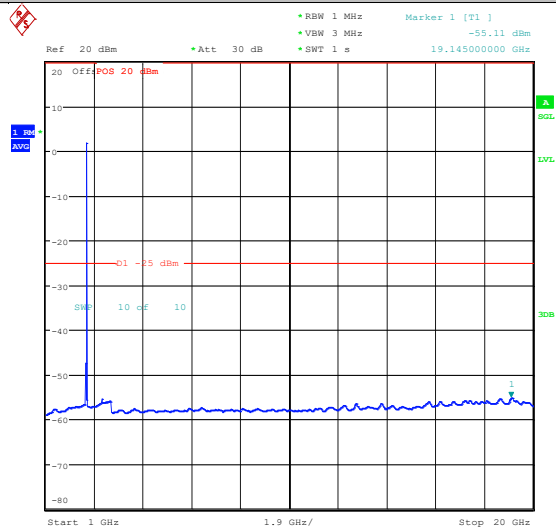

Date: 20.JUN.2024 09:17:46


Band41_20MHz_QPSK_40590_1RB#99_30~100_0_30~1000

Band41_20MHz_QPSK_40590_1RB#99_1000~2000_000_1000~20000

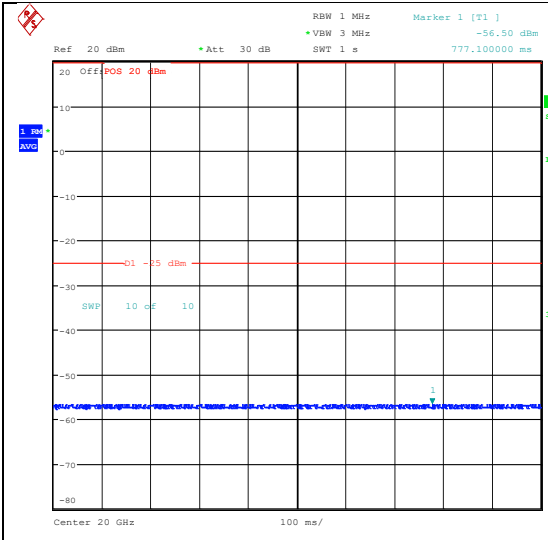


Date: 20.JUN.2024 09:18:11

Band41_20MHz_QPSK_40590_1RB#99_20000~27000_20000~27000

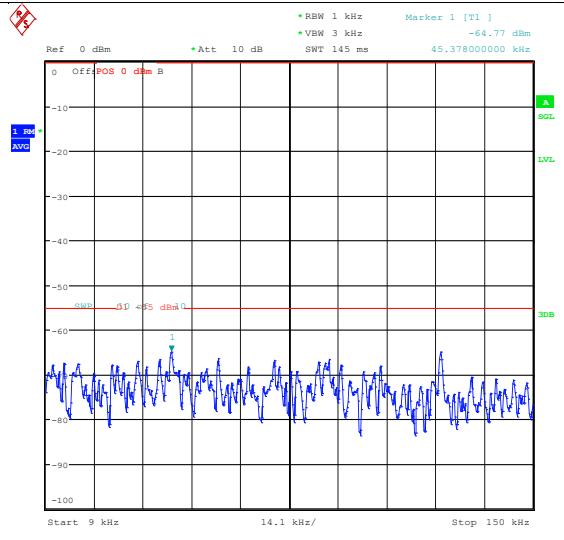


Date: 20.JUN.2024 09:18:20

Band41_20MHz_16QAM_40590_1RB#99_0.009~0.15_0.009~0.15

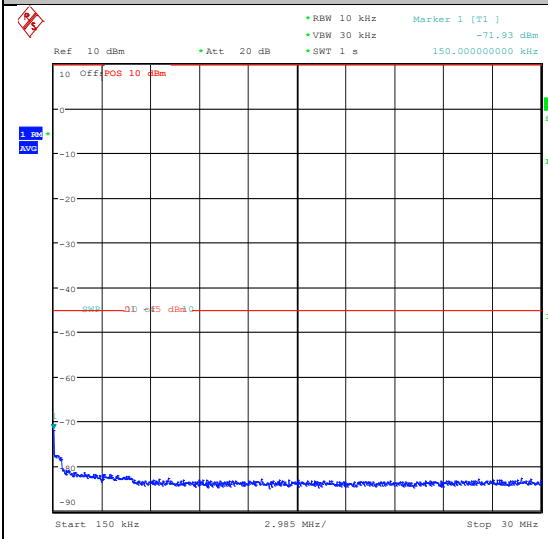


Date: 20.JUN.2024 09:18:35

Band41_20MHz_16QAM_40590_1RB#99_0.15~30_0.15~30

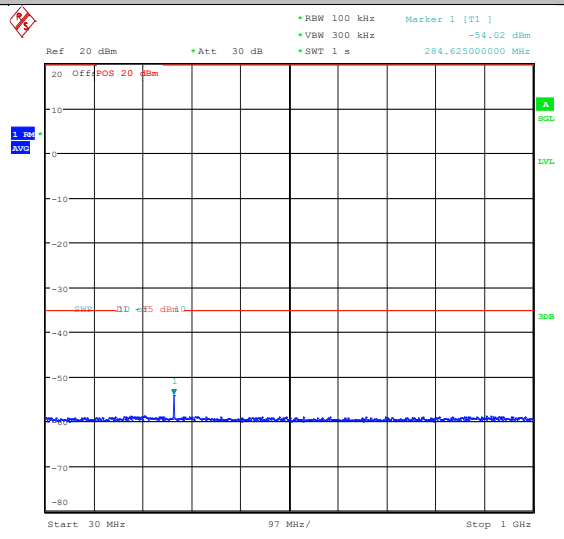


Date: 20.JUN.2024 09:18:48

Band41_20MHz_16QAM_40590_1RB#99_30~100_0_30~1000

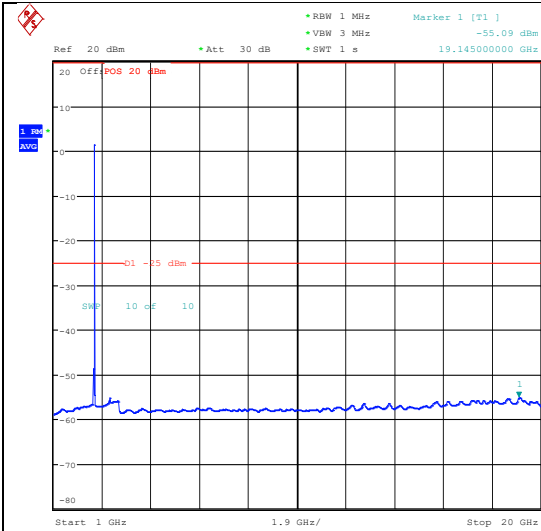


Date: 20.JUN.2024 09:19:03

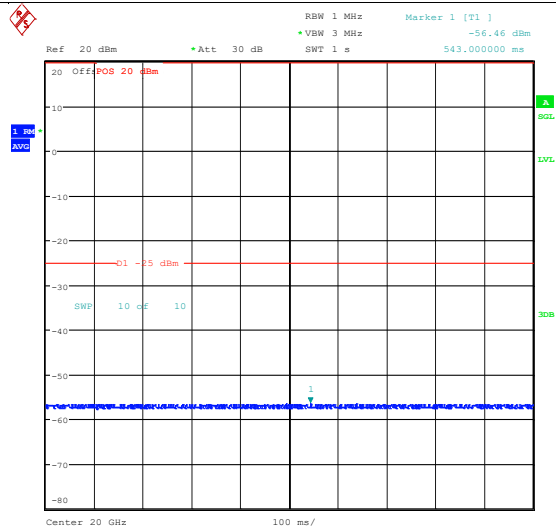


Date: 20.JUN.2024 09:19:28

Band41_20MHz_16QAM_40590_1RB#99_1000~20000_1000~20000

Band41_20MHz_16QAM_40590_1RB#99_20000~27000_20000~27000

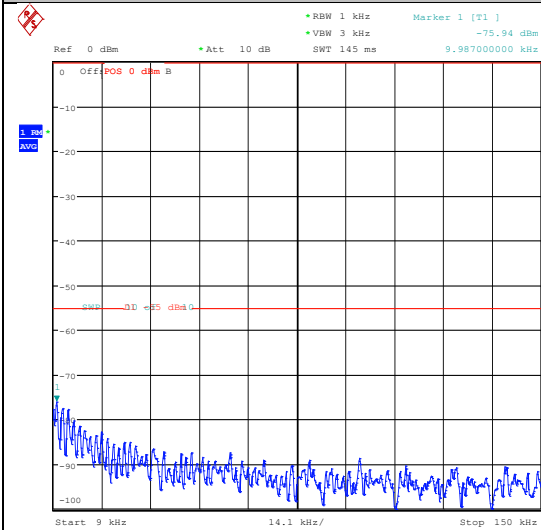


Date: 20.JUN.2024 09:19:36

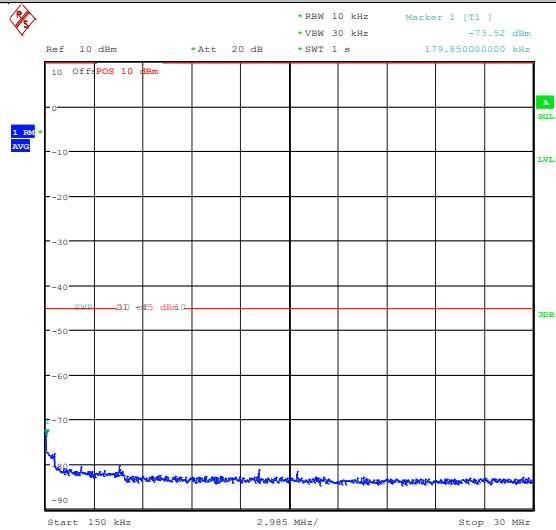


Date: 20.JUN.2024 09:19:51

Band41_20MHz_QPSK_40590_100RB#0_0.009~0.15_0.009~0.15

Band41_20MHz_QPSK_40590_100RB#0_0.15~3_0_0.15~30

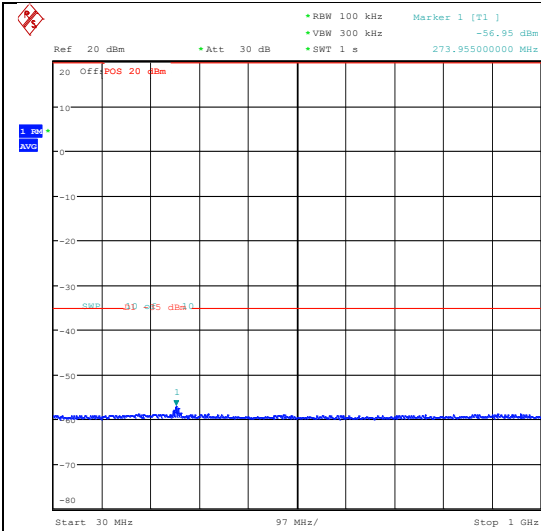


Date: 20 JUN 2024 09:20:04

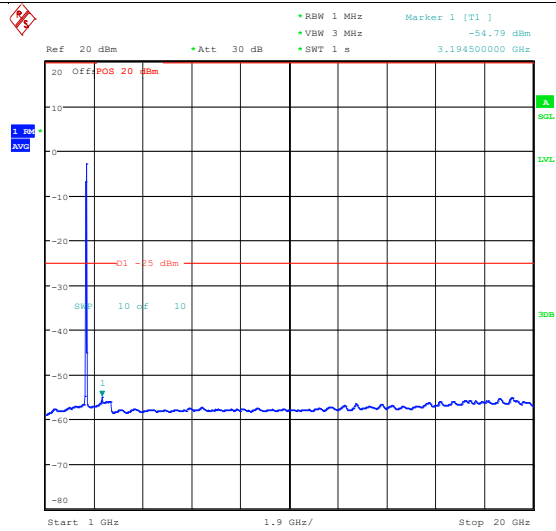


Date: 20 JUN 2024 09:20:19

Band41_20MHz_QPSK_40590_100RB#0_30~10
 00_30~1000

Band41_20MHz_QPSK_40590_100RB#0_1000~2
 0000_1000~20000

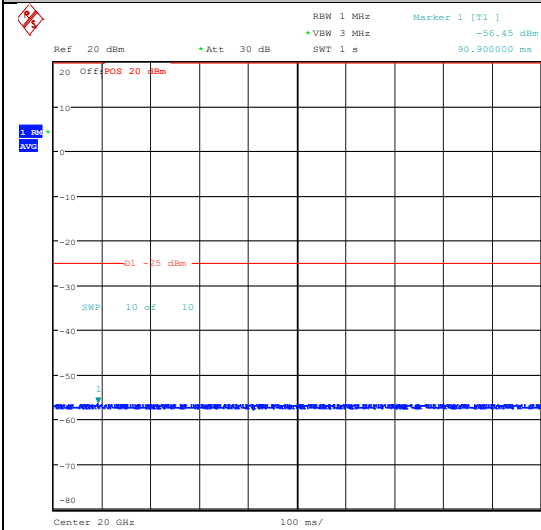


Date: 20 JUN 2024 09:20:44

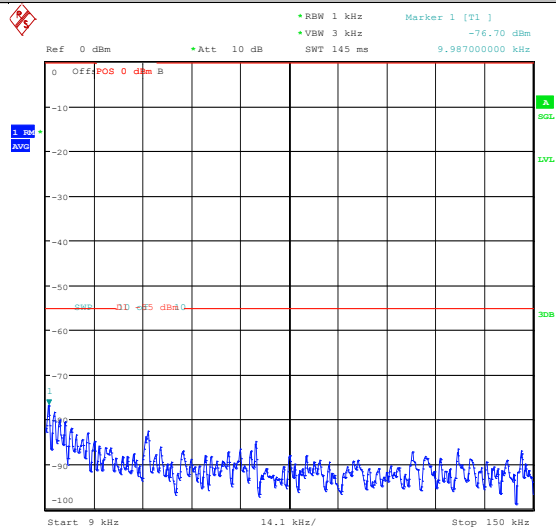


Date: 20 JUN 2024 09:20:53

Band41_20MHz_QPSK_40590_100RB#0_20000
 ~27000_20000~27000

Band41_20MHz_16QAM_40590_100RB#0_0.009
 ~0.15_0.009~0.15

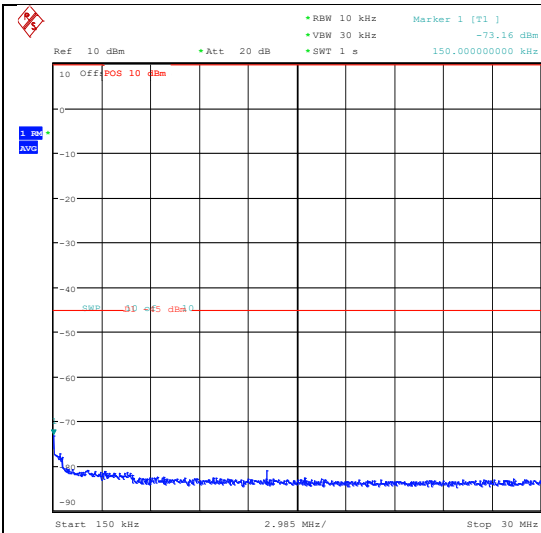


Date: 20.JUN.2024 09:21:08

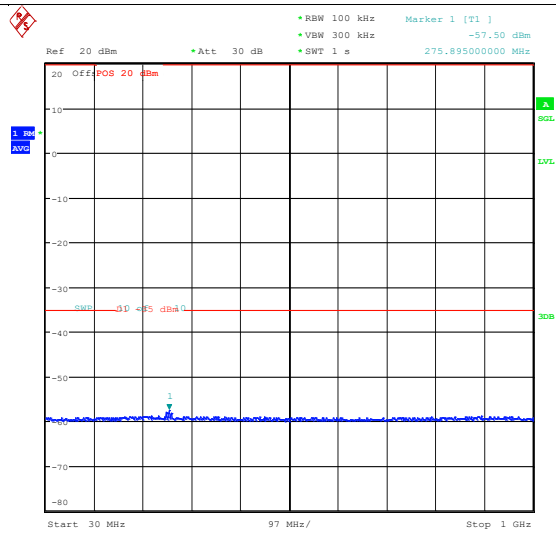


Date: 20.JUN.2024 09:21:21

Band41_20MHz_16QAM_40590_100RB#0_0.15
 ~30_0.15~30

Band41_20MHz_16QAM_40590_100RB#0_30~10
 00_30~1000

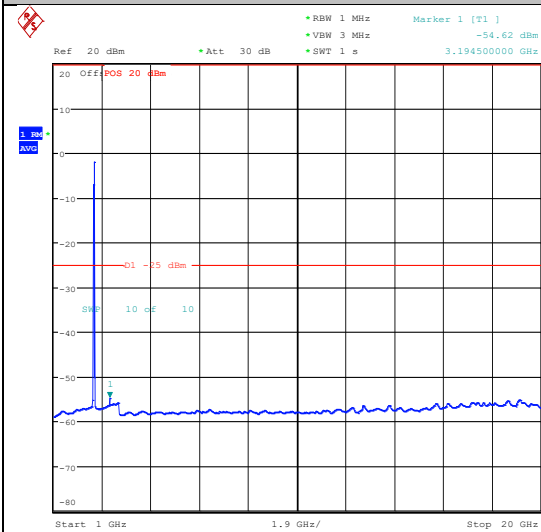


Date: 20.JUN.2024 09:21:36

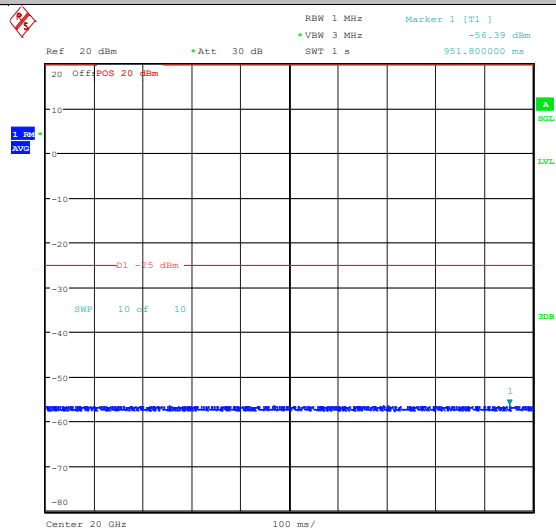

Date: 20.JUN.2024 09:21:51


Band41_20MHz_16QAM_40590_100RB#0_1000
 ~20000_1000~20000

Band41_20MHz_16QAM_40590_100RB#0_20000
 ~27000_20000~27000

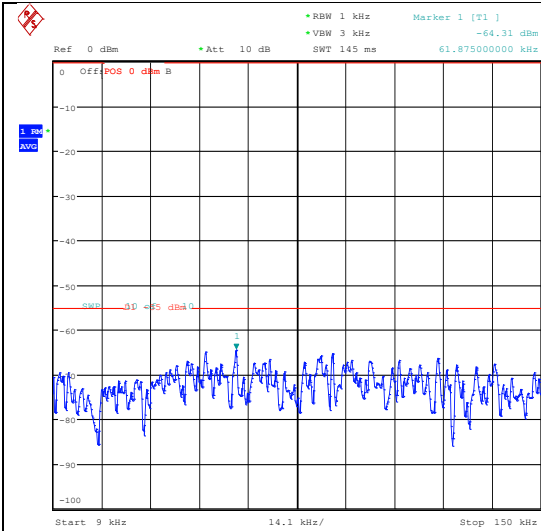


Date: 20 JUN 2024 09:22:01

Band41_20MHz_QPSK_41140_1RB#0_0.009~0.15_0.009~0.15

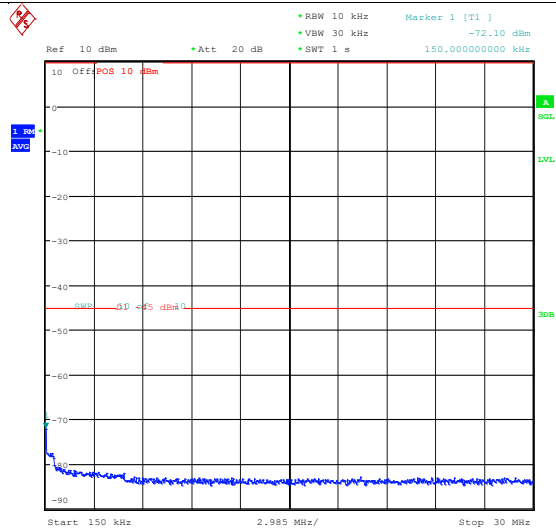


Date: 20 JUN 2024 09:22:16

Band41_20MHz_QPSK_41140_1RB#0_0.15~30_0.15~30

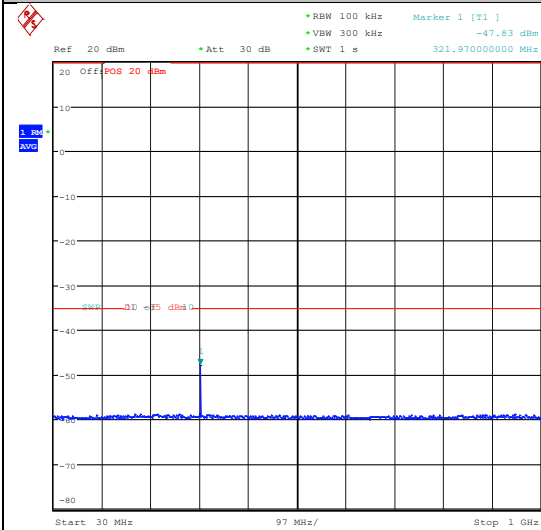


Date: 20 JUN 2024 09:22:30

Band41_20MHz_QPSK_41140_1RB#0_30~1000_30~1000

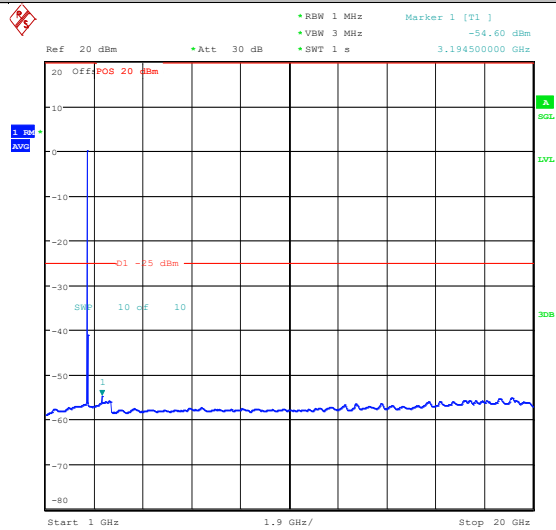


Date: 20 JUN 2024 09:22:44

Band41_20MHz_QPSK_41140_1RB#0_1000~2000_00_1000~20000

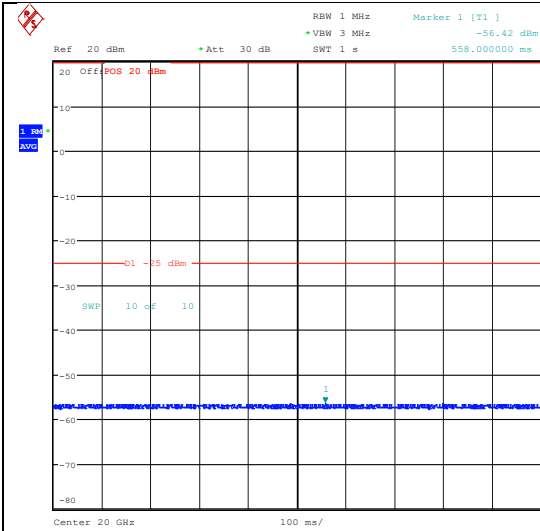


Date: 20.JUN.2024 09:23:00

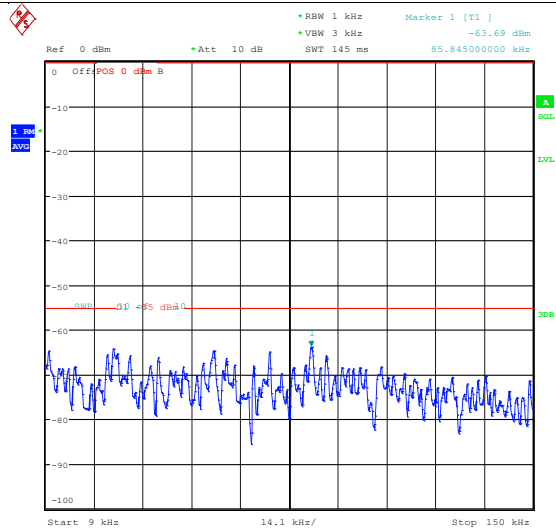


Date: 20.JUN.2024 09:23:09

Band41_20MHz_QPSK_41140_1RB#0_20000~27000

Band41_20MHz_16QAM_41140_1RB#0_0.009~0.15

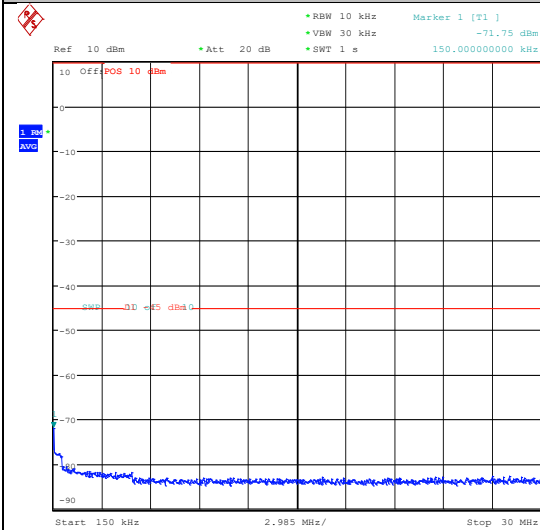


Date: 20.JUN.2024 09:23:24

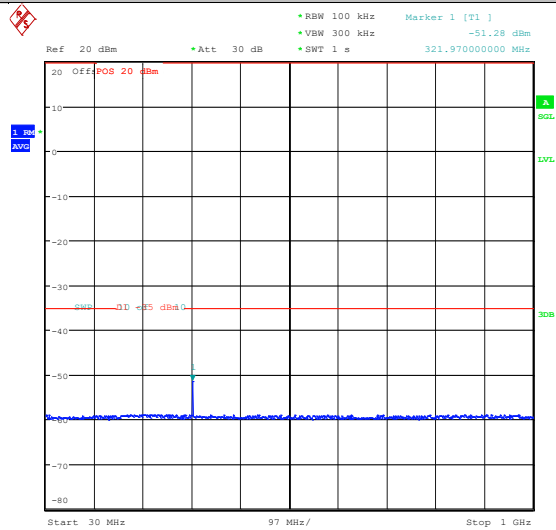


Date: 20.JUN.2024 09:23:38

Band41_20MHz_16QAM_41140_1RB#0_0.15~30

Band41_20MHz_16QAM_41140_1RB#0_30~1000

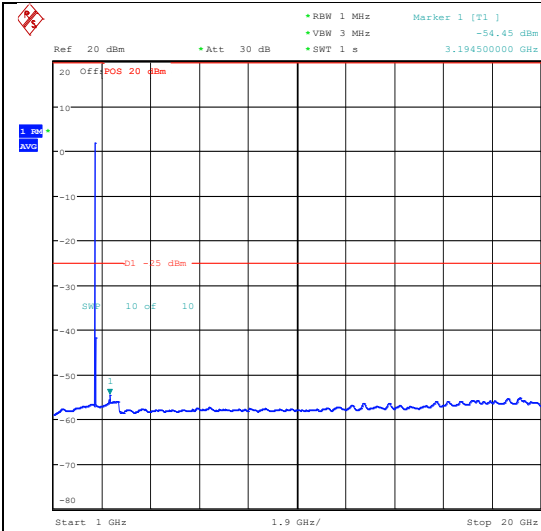


Date: 20.JUN.2024 09:23:52

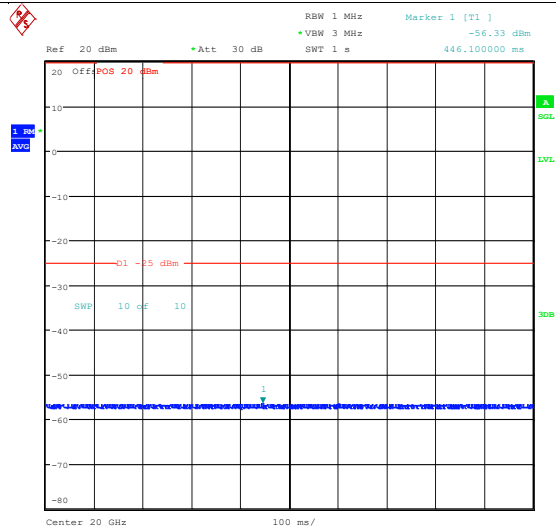


Date: 20.JUN.2024 09:24:10

Band41_20MHz_16QAM_41140_1RB#0_1000~20000_1000~20000

Band41_20MHz_16QAM_41140_1RB#0_20000~7000_20000~27000

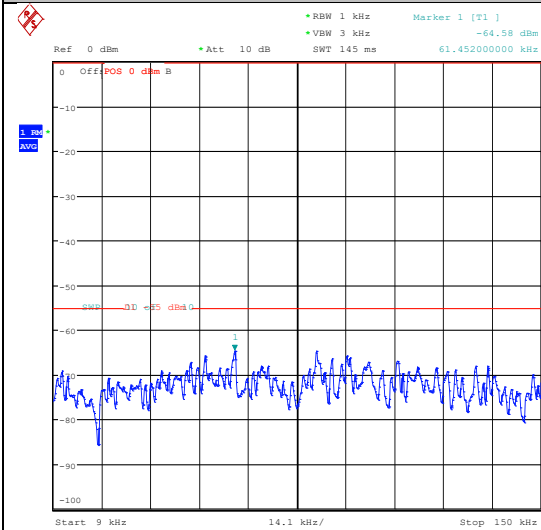


Date: 20.JUN.2024 09:24:18

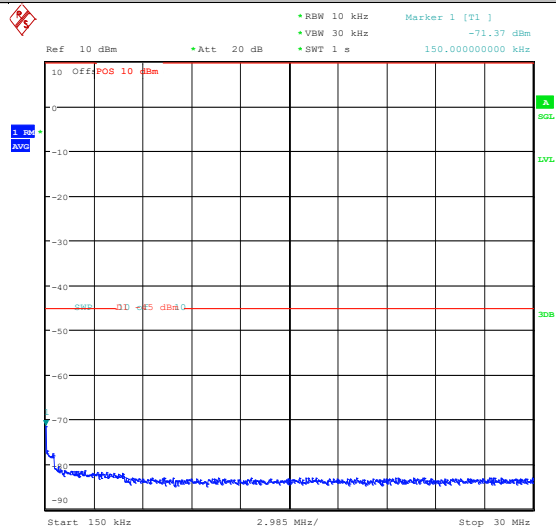

Date: 20.JUN.2024 09:24:33


Band41_20MHz_QPSK_41140_1RB#99_0.009~0.15_0.009~0.15

Band41_20MHz_QPSK_41140_1RB#99_0.15~30_0.15~30

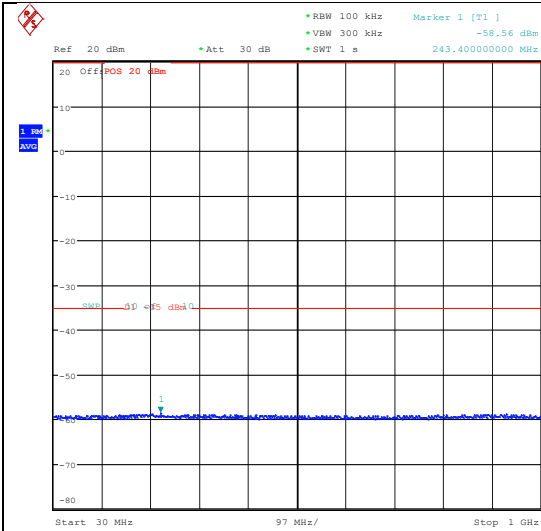


Date: 20.JUN.2024 09:24:46

Band41_20MHz_QPSK_41140_1RB#99_30~100
 0_30~1000

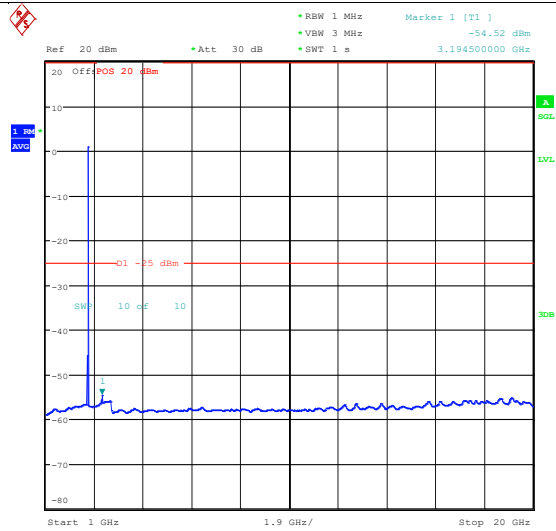


Date: 20.JUN.2024 09:25:01

Band41_20MHz_QPSK_41140_1RB#99_1000~20
 000_1000~20000

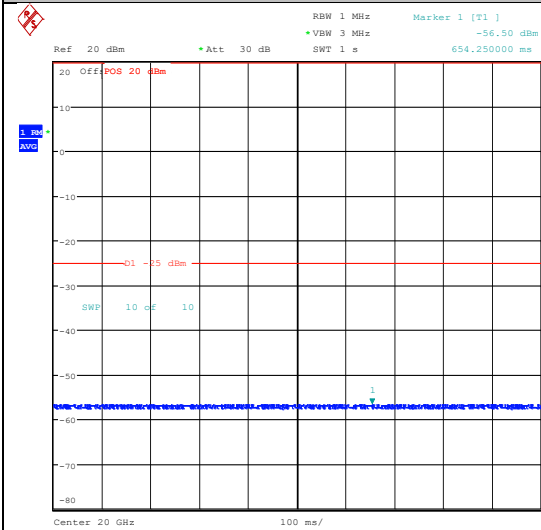


Date: 20.JUN.2024 09:25:17

Band41_20MHz_QPSK_41140_1RB#99_20000~
 27000_20000~27000

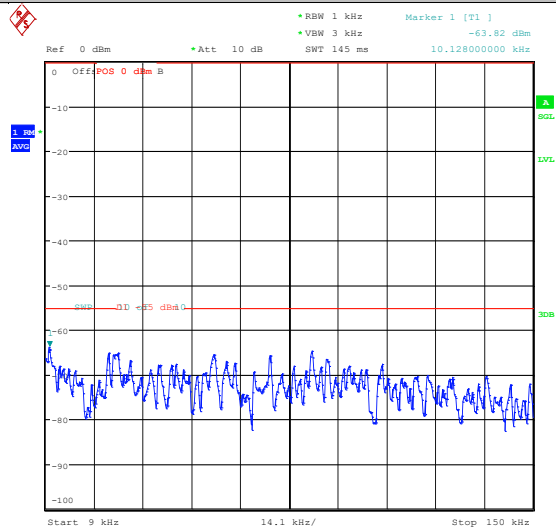


Date: 20.JUN.2024 09:25:26

Band41_20MHz_16QAM_41140_1RB#99_0.009~
 0.15_0.009~0.15

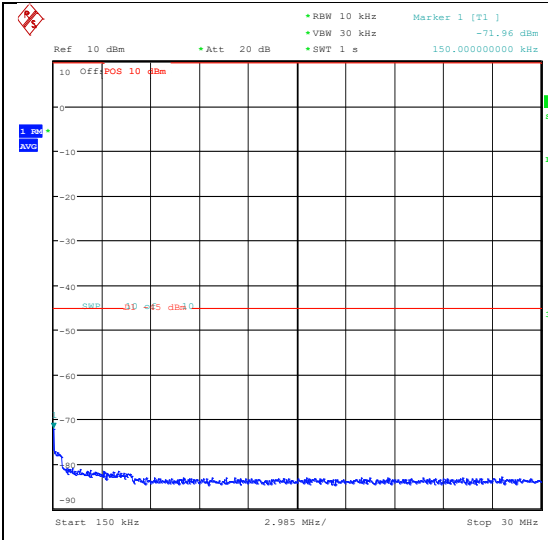


Date: 20.JUN.2024 09:25:41

Band41_20MHz_16QAM_41140_1RB#99_0.15~30
0_0.15~30

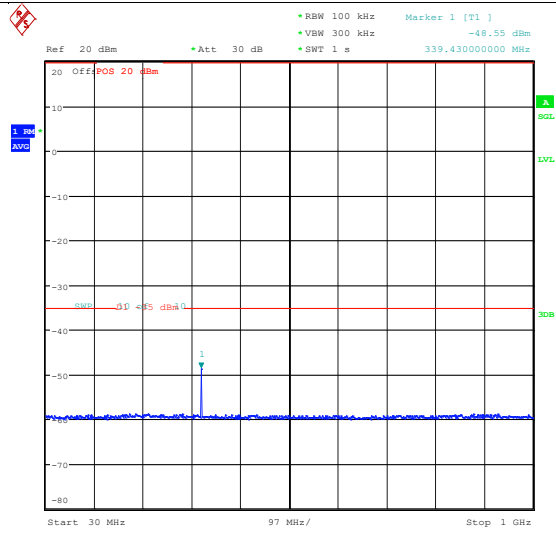


Date: 20.JUN.2024 09:25:55

Band41_20MHz_16QAM_41140_1RB#99_30~100
0_30~1000

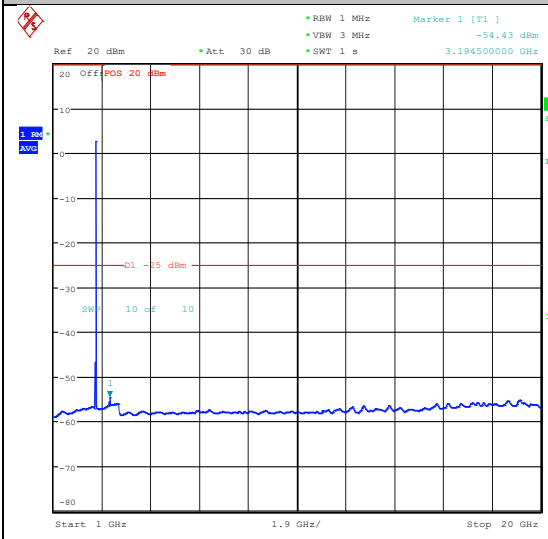


Date: 20.JUN.2024 09:26:09

Band41_20MHz_16QAM_41140_1RB#99_1000~20000_1000~20000

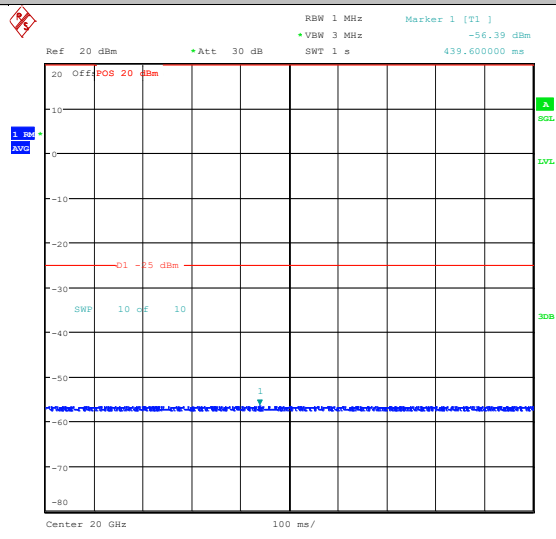


Date: 20.JUN.2024 09:26:25

Band41_20MHz_16QAM_41140_1RB#99_20000~27000_20000~27000

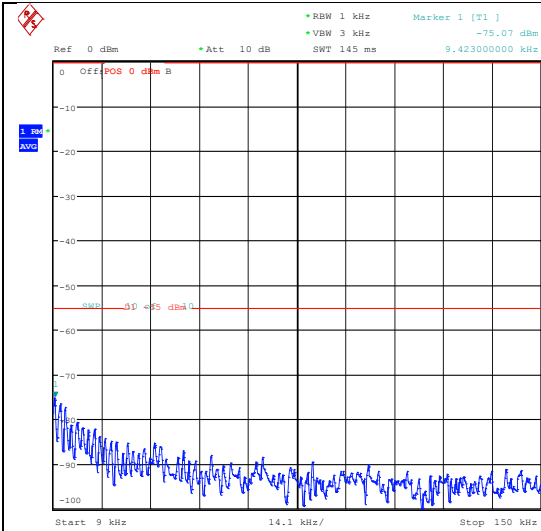


Date: 20.JUN.2024 09:26:34

Band41_20MHz_QPSK_41140_100RB#0_0.009~0.15_0.009~0.15

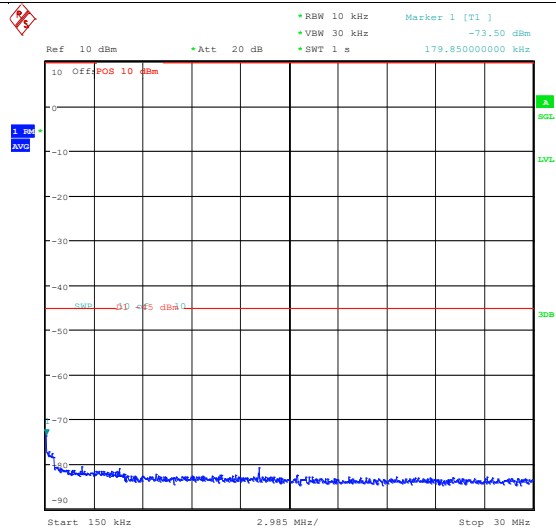


Date: 20.JUN.2024 09:26:48

Band41_20MHz_QPSK_41140_100RB#0_0.15~3_0_0.15~30

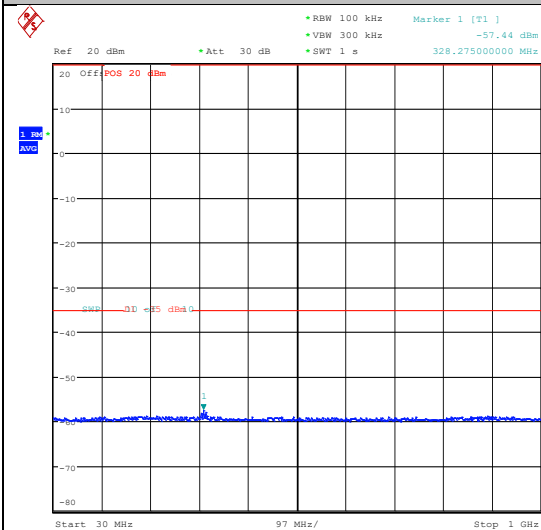


Date: 20.JUN.2024 09:27:02

Band41_20MHz_QPSK_41140_100RB#0_30~10_00_30~1000

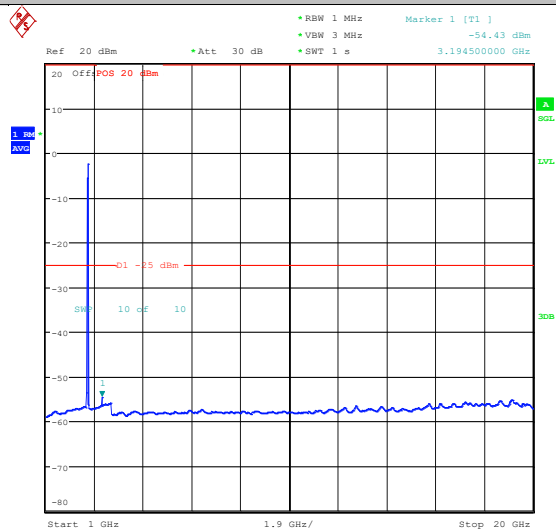


Date: 20.JUN.2024 09:27:17

Band41_20MHz_QPSK_41140_100RB#0_1000~2000_0000_1000~20000

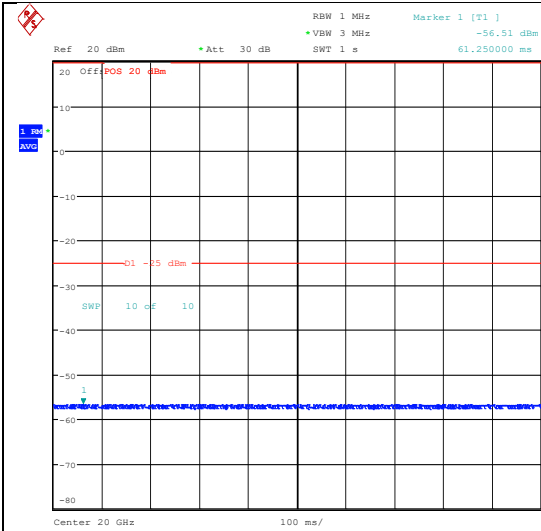


Date: 20.JUN.2024 09:27:32

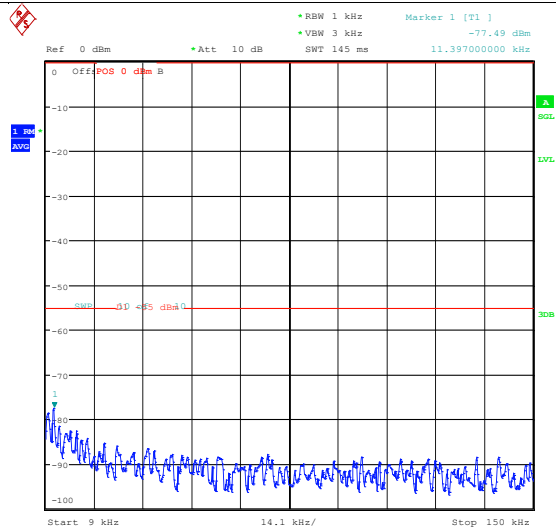


Date: 20.JUN.2024 09:27:41

Band41_20MHz_QPSK_41140_100RB#0_20000
 ~27000_20000~27000

Band41_20MHz_16QAM_41140_100RB#0_0.009
 ~0.15_0.009~0.15

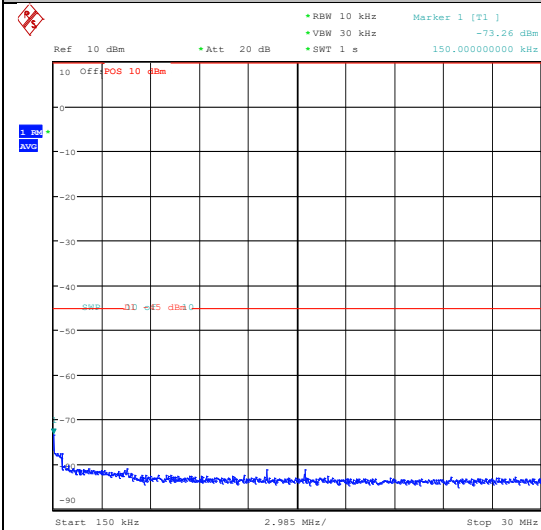


Date: 20.JUN.2024 09:27:56

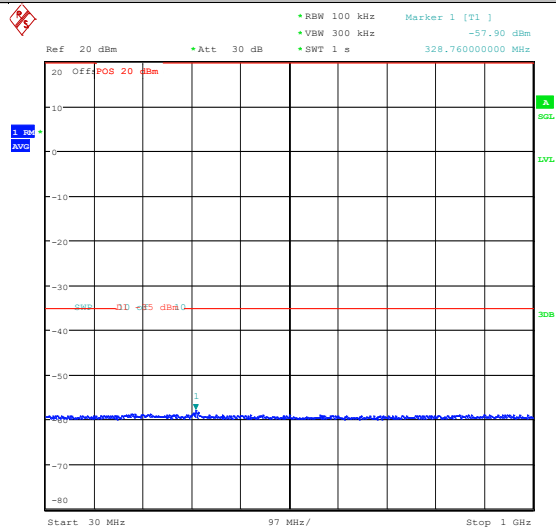

Date: 20.JUN.2024 09:28:10


Band41_20MHz_16QAM_41140_100RB#0_0.15~
 30_0.15~30

Band41_20MHz_16QAM_41140_100RB#0_30~10
 00_30~1000

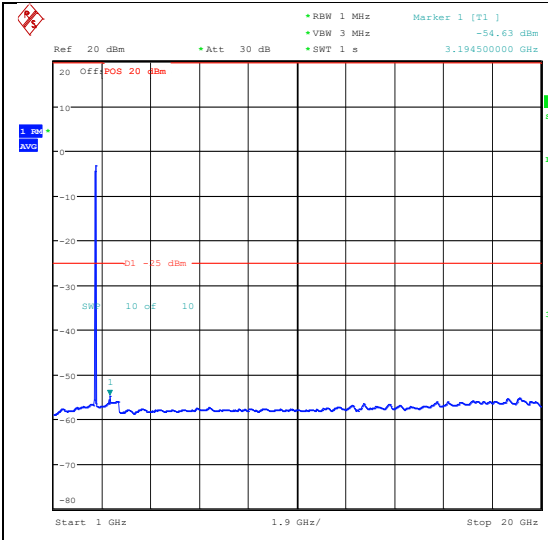

Date: 20.JUN.2024 09:28:26

Band41_20MHz_16QAM_41140_100RB#0_1000
~20000_1000~20000

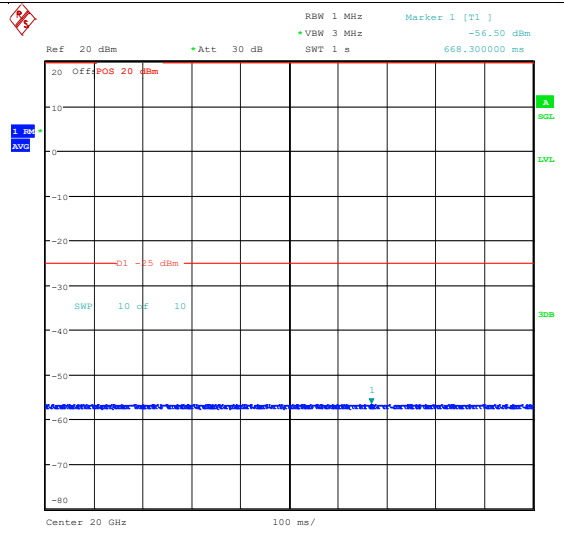

Date: 20.JUN.2024 09:28:41

Band41_20MHz_16QAM_41140_100RB#0_20000
~27000_20000~27000

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band41	5MHz	QPSK	39675	25RB#0	VL	NT	-66.10	-0.026456	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	VN	NT	-105.30	-0.042145	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	VH	NT	-53.27	-0.021321	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VL	NT	-84.03	-0.032406	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VN	NT	-126.11	-0.048635	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VH	NT	-64.59	-0.024909	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	VL	NT	-71.53	-0.026616	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	VN	NT	-68.44	-0.025466	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	VH	NT	-90.94	-0.033838	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	VL	NT	-97.23	-0.038915	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	VN	NT	-106.39	-0.042582	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	VH	NT	-91.97	-0.036810	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	VL	NT	41.04	0.015827	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	VN	NT	-90.47	-0.034890	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	VH	NT	-106.09	-0.040914	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	VL	NT	-125.11	-0.046553	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	VN	NT	-88.13	-0.032793	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	VH	NT	-75.17	-0.027970	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	VL	NT	-119.89	-0.047937	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	VN	NT	83.70	0.033467	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	VH	NT	-88.33	-0.035318	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VL	NT	-108.09	-0.041685	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VN	NT	-108.63	-0.041894	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VH	NT	-96.19	-0.037096	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	VL	NT	-104.79	-0.041899	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	VN	NT	-94.96	-0.037969	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	VH	NT	52.51	0.020996	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	VL	NT	-70.68	-0.027258	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	VN	NT	67.58	0.026062	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	VH	NT	-68.69	-0.026491	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	VL	NT	-93.78	-0.034927	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	VN	NT	-43.36	-0.016149	±2.5	PASS

Band41	10MHz	16QAM	41540	50RB#0	VH	NT	46.69	0.017389	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VL	NT	98.25	0.037890	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VN	NT	-133.85	-0.051620	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VH	NT	-136.33	-0.052576	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	VL	NT	-97.96	-0.037779	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	VN	NT	-87.88	-0.033891	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	VH	NT	-86.60	-0.033398	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VL	NT	-76.66	-0.029564	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VN	NT	-32.70	-0.012611	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VH	NT	-112.62	-0.043432	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	VL	NT	-102.94	-0.039699	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	VN	NT	76.16	0.029371	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	VH	NT	-109.58	-0.042260	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	VH	NT	0.00	0.000000	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict

Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-30	38.85	0.015310	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-20	42.34	0.016686	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	-10	44.05	0.017360	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	0	40.04	0.015779	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	10	32.87	0.012954	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	20	31.27	0.012323	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	30	30.91	0.012181	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	40	42.46	0.016733	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	NV	50	22.72	0.008954	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-30	22.52	0.008875	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-20	22.70	0.008946	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	-10	32.29	0.012725	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	0	36.39	0.014341	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	10	38.02	0.014983	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	20	43.20	0.017025	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	30	55.46	0.021856	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	40	31.56	0.012437	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	NV	50	25.36	0.009994	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-30	-9.73	-0.003757	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-20	-31.00	-0.011969	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	-10	-23.80	-0.009189	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	0	60.17	0.023232	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	10	37.74	0.014571	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	20	20.80	0.008031	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	30	-6.84	-0.002641	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	40	-15.26	-0.005892	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	40590	25RB#0	NV	50	-32.70	-0.012625	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-30	-17.17	-0.006629	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-20	-18.25	-0.007046	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	-10	-30.60	-0.011815	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	0	31.61	0.012205	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	10	31.46	0.012147	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	20	23.85	0.009208	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	30	18.88	0.007290	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	40	25.06	0.009676	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	40590	25RB#0	NV	50	16.05	0.006197	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-30	-44.23	-0.016675	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-20	-33.43	-0.012603	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	-10	51.96	0.019589	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	0	28.74	0.010835	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	10	40.87	0.015408	±2.5	PASS

Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	20	58.72	0.022138	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	30	29.18	0.011001	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	40	38.97	0.014692	±2.5	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	NV	50	26.01	0.009806	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-30	15.45	0.005825	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-20	33.85	0.012762	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	-10	38.71	0.014594	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	0	34.68	0.013074	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	10	47.48	0.017900	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	20	63.79	0.024049	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	30	27.55	0.010386	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	40	35.71	0.013463	±2.5	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	NV	50	47.14	0.017772	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-30	15.22	0.005992	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-20	25.23	0.009933	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	-10	-13.90	-0.005472	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	0	63.31	0.024925	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	10	22.40	0.008819	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	20	28.50	0.011220	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	30	35.59	0.014012	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	40	46.32	0.018236	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	NV	50	32.94	0.012969	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	-30	-19.41	-0.007642	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	-20	-7.42	-0.002921	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	-10	22.79	0.008972	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	0	33.82	0.013315	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	10	21.87	0.008610	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	20	31.84	0.012535	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	30	41.54	0.016354	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	40	56.20	0.022126	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	NV	50	14.98	0.005898	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-30	16.64	0.006425	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-20	-13.06	-0.005042	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	-10	-35.42	-0.013676	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	0	-42.20	-0.016293	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	10	21.40	0.008263	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	20	57.59	0.022236	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	30	36.16	0.013961	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	40	46.36	0.017900	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	40590	50RB#0	NV	50	54.97	0.021224	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	-30	13.33	0.005147	±2.5	PASS

Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	-20	27.97	0.010799	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	-10	38.48	0.014857	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	0	55.59	0.021463	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	10	32.39	0.012506	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	20	45.91	0.017726	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	30	24.76	0.009560	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	40	27.79	0.010730	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	40590	50RB#0	NV	50	50.40	0.019459	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-30	45.79	0.017279	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-20	27.58	0.010408	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	-10	53.27	0.020102	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	0	-15.52	-0.005857	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	10	18.21	0.006872	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	20	42.11	0.015891	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	30	-96.83	-0.036540	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	40	18.74	0.007072	±2.5	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	NV	50	34.86	0.013155	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	-30	28.77	0.010857	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	-20	57.12	0.021555	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	-10	28.00	0.010566	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	0	63.17	0.023838	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	10	52.34	0.019751	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	20	-29.41	-0.011098	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	30	20.46	0.007721	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	40	43.64	0.016468	±2.5	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	NV	50	28.22	0.010649	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-30	14.45	0.005683	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-20	27.27	0.010726	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	-10	34.82	0.013695	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	0	49.50	0.019469	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	10	31.89	0.012543	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	20	40.83	0.016059	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	30	50.43	0.019835	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	40	-44.95	-0.017679	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	NV	50	-36.15	-0.014218	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	-30	40.66	0.015992	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	-20	53.69	0.021117	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	-10	22.52	0.008857	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	0	51.30	0.020177	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	10	49.64	0.019524	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	20	55.38	0.021782	±2.5	PASS

Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	30	-9.21	-0.003622	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	40	19.60	0.007709	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	NV	50	40.94	0.016102	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-30	-44.85	-0.017317	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-20	16.98	0.006556	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	-10	-11.77	-0.004544	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	0	-31.86	-0.012301	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	10	-45.76	-0.017668	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	20	-61.11	-0.023595	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	30	-30.63	-0.011826	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	40	-52.39	-0.020228	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	40590	75RB#0	NV	50	40.71	0.015718	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	-30	-17.19	-0.006637	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	-20	-11.96	-0.004618	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	-10	-13.13	-0.005069	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	0	30.03	0.011595	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	10	40.61	0.015680	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	20	50.63	0.019548	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	30	49.48	0.019104	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	40	63.39	0.024475	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	40590	75RB#0	NV	50	-13.02	-0.005027	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-30	13.95	0.005269	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-20	22.93	0.008661	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	-10	38.75	0.014636	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	0	19.97	0.007543	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	10	24.75	0.009348	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	20	33.00	0.012465	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	30	55.07	0.020801	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	40	30.16	0.011392	±2.5	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	NV	50	15.46	0.005839	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	-30	13.66	0.005160	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	-20	30.17	0.011396	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	-10	47.22	0.017836	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	0	34.07	0.012869	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	10	44.49	0.016805	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	20	53.59	0.020242	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	30	-13.38	-0.005054	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	40	7.40	0.002795	±2.5	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	NV	50	26.38	0.009964	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-30	-102.81	-0.040397	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-20	48.19	0.018935	±2.5	PASS

Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	-10	55.20	0.021690	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	0	25.38	0.009972	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	10	38.94	0.015301	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	20	48.59	0.019092	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	30	50.33	0.019776	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	40	47.22	0.018554	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	NV	50	25.66	0.010083	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	-30	43.62	0.017139	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	-20	50.40	0.019804	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	-10	-18.15	-0.007132	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	0	-12.40	-0.004872	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	10	26.89	0.010566	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	20	44.25	0.017387	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	30	39.80	0.015639	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	40	52.51	0.020633	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	NV	50	54.52	0.021422	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-30	-11.79	-0.004552	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-20	-44.25	-0.017085	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	-10	-32.06	-0.012378	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	0	44.27	0.017093	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	10	19.86	0.007668	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	20	11.22	0.004332	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	30	-49.02	-0.018927	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	40	-40.58	-0.015668	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	40590	100RB#0	NV	50	-56.26	-0.021722	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	-30	-18.88	-0.007290	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	-20	-18.08	-0.006981	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	-10	-14.71	-0.005680	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	0	24.05	0.009286	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	10	26.75	0.010328	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	20	35.68	0.013776	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	30	35.82	0.013830	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	40	35.59	0.013741	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	40590	100RB#0	NV	50	17.55	0.006776	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-30	10.91	0.004125	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-20	24.59	0.009297	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	-10	45.86	0.017338	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	0	-16.06	-0.006072	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	10	28.20	0.010662	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	20	34.68	0.013112	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	30	41.61	0.015732	±2.5	PASS

Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	40	54.07	0.020442	±2.5	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	NV	50	44.69	0.016896	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	-30	56.63	0.021410	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	-20	27.97	0.010575	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	-10	47.69	0.018030	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	0	-13.90	-0.005255	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	10	27.15	0.010265	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	20	14.22	0.005376	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	30	28.74	0.010866	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	40	41.36	0.015637	±2.5	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	NV	50	11.12	0.004204	±2.5	PASS