

8 EUT Constructional Details (EUT Photos)

Please refer to the report No. BTF230817R00401

Appendix

1. Duty Cycle

1.1 Ant1


1.1.1 Test Result


TestMode	Antenna	Freq(MHz)	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Limit	Verdict
11A	Ant1	5180	1.40	1.43	97.90	---	---
		5200	1.40	1.43	97.90	---	---
		5240	1.39	1.42	97.89	---	---
		5260	5.11	5.48	93.25	---	---
		5280	1.38	1.43	96.50	---	---
		5320	1.39	1.43	97.20	---	---
		5500	1.39	1.43	97.20	---	---
		5580	1.39	1.43	97.20	---	---
		5700	1.39	1.42	97.89	---	---
		5745	1.39	1.43	97.20	---	---
		5785	1.39	1.42	97.89	---	---
		5825	1.39	1.43	97.20	---	---
11N20SISO	Ant1	5180	4.73	5.09	92.93	---	---
		5200	1.30	1.34	97.01	---	---
		5240	1.30	1.34	97.01	---	---
		5260	1.30	1.34	97.01	---	---
		5280	1.30	1.34	97.01	---	---
		5320	1.29	1.33	96.99	---	---
		5500	1.30	1.33	97.74	---	---
		5580	1.29	1.33	96.99	---	---
		5700	1.30	1.34	97.01	---	---
		5745	1.30	1.34	97.01	---	---
		5785	1.29	1.34	96.27	---	---
		5825	1.30	1.34	97.01	---	---
11N40SISO	Ant1	5190	4.56	4.97	91.75	---	---
		5230	0.65	0.68	95.59	---	---
		5270	0.65	0.68	95.59	---	---
		5310	0.65	0.68	95.59	---	---
		5510	0.64	0.68	94.12	---	---
		5550	0.65	0.69	94.20	---	---
		5670	0.65	0.68	95.59	---	---

		5755	0.65	0.69	94.20	---	---
		5795	0.65	0.68	95.59	---	---
11AC20SISO	Ant1	5180	1.31	1.35	97.04	---	---
		5200	1.31	1.35	97.04	---	---
		5240	1.31	1.35	97.04	---	---
		5260	1.32	1.35	97.78	---	---
		5280	1.31	1.34	97.76	---	---
		5320	1.31	1.35	97.04	---	---
		5500	1.31	1.35	97.04	---	---
		5580	1.31	1.35	97.04	---	---
		5700	1.31	1.35	97.04	---	---
		5745	1.31	1.35	97.04	---	---
		5785	1.31	1.35	97.04	---	---
		5825	1.31	1.35	97.04	---	---
11AC40SISO	Ant1	5190	4.57	4.89	93.46	---	---
		5230	0.63	0.67	94.03	---	---
		5270	0.63	0.67	94.03	---	---
		5310	0.64	0.67	95.52	---	---
		5510	0.64	0.67	95.52	---	---
		5550	0.64	0.67	95.52	---	---
		5670	0.63	0.67	94.03	---	---
		5755	0.64	0.67	95.52	---	---
11AC80SISO	Ant1	5210	0.32	0.36	88.89	---	---
		5290	0.32	0.36	88.89	---	---
		5530	0.33	0.36	91.67	---	---
		5610	0.33	0.36	91.67	---	---
		5775	0.32	0.36	88.89	---	---
11AX20SISO	Ant1	5180	3.61	3.99	90.48	---	---
		5200	3.61	4.02	89.80	---	---
		5240	4.80	5.10	94.12	---	---
		5260	3.61	4.03	89.58	---	---
		5280	3.61	4.00	90.25	---	---
		5320	4.81	5.19	92.68	---	---
		5500	3.62	4.03	89.83	---	---
		5580	3.63	4.03	90.07	---	---
		5700	3.61	3.94	91.62	---	---
		5745	4.81	5.15	93.40	---	---
		5785	3.62	3.98	90.95	---	---


		5825	3.62	4.01	90.27	---	---
11AX40SISO	Ant1	5190	5.39	5.71	94.40	---	---
		5230	4.20	4.53	92.72	---	---
		5270	4.20	4.49	93.54	---	---
		5310	0.95	1.29	73.64	---	---
		5510	0.95	1.36	69.85	---	---
		5550	0.94	1.31	71.76	---	---
		5670	0.94	1.24	75.81	---	---
		5755	1.25	1.54	81.17	---	---
		5795	1.24	1.61	77.02	---	---
11AX80SISO	Ant1	5210	4.57	4.95	92.32	---	---
		5290	4.57	4.98	91.77	---	---
		5530	4.58	4.91	93.28	---	---
		5610	4.57	4.98	91.77	---	---
		5775	4.58	4.91	93.28	---	---

1.1.2 Test Graph

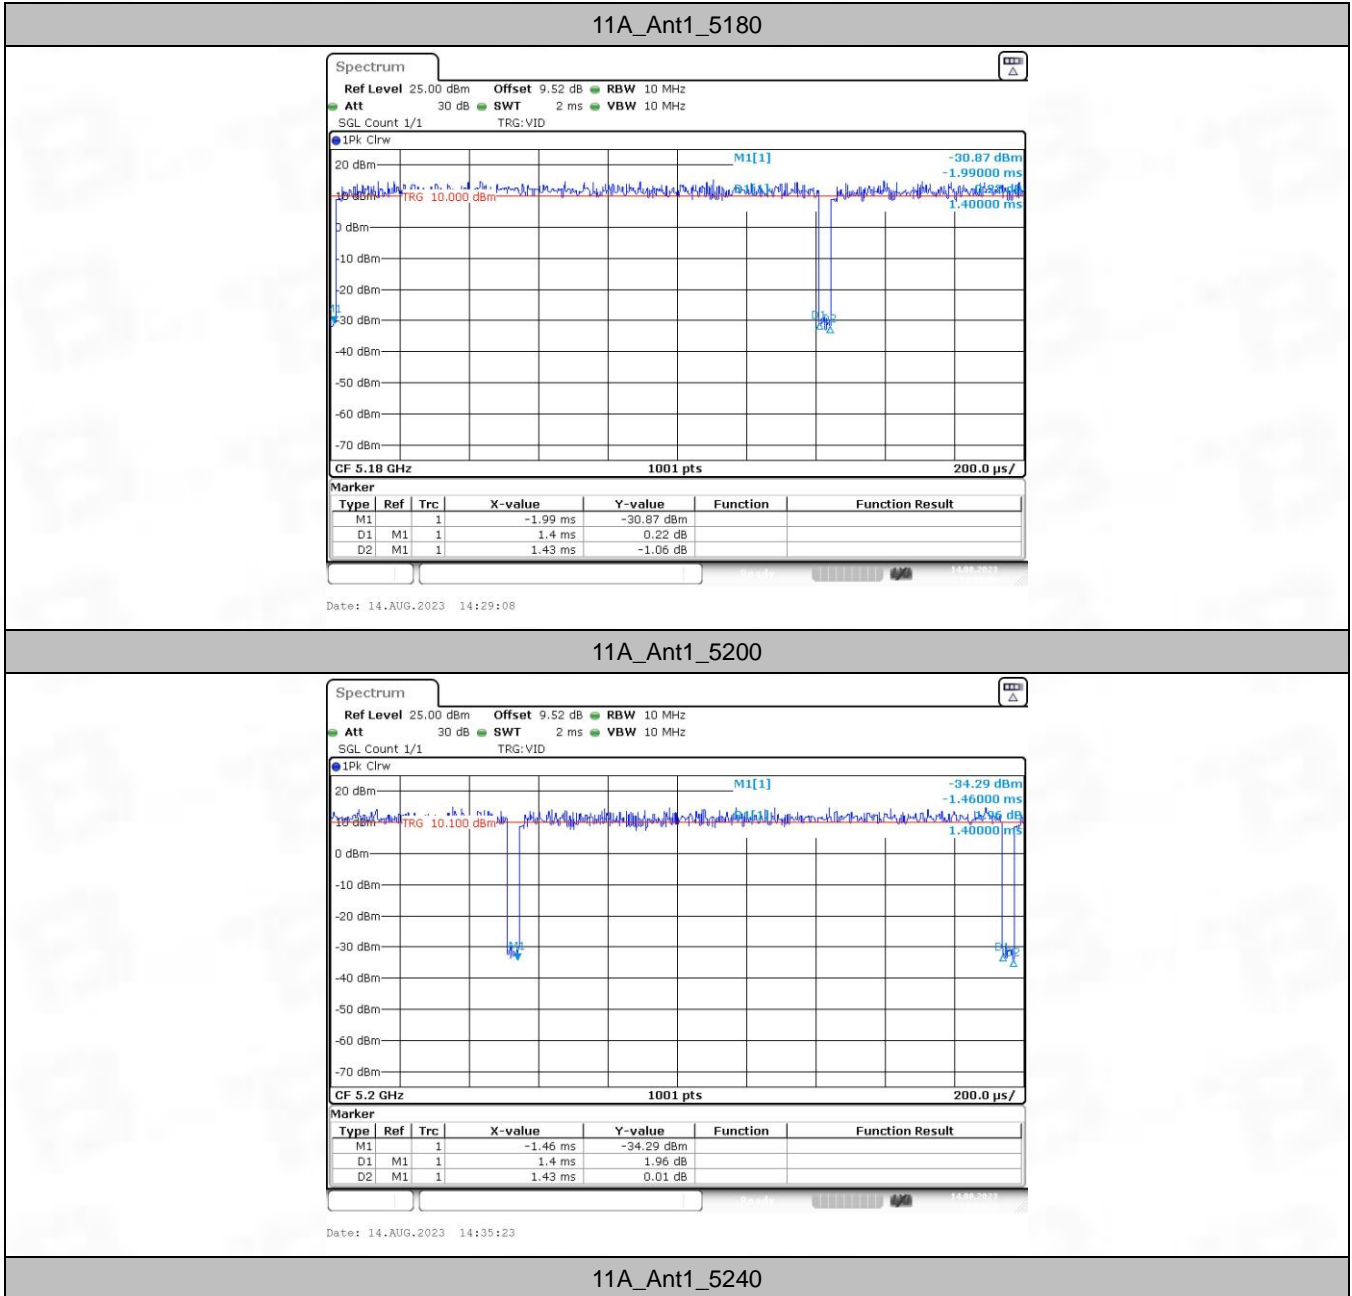


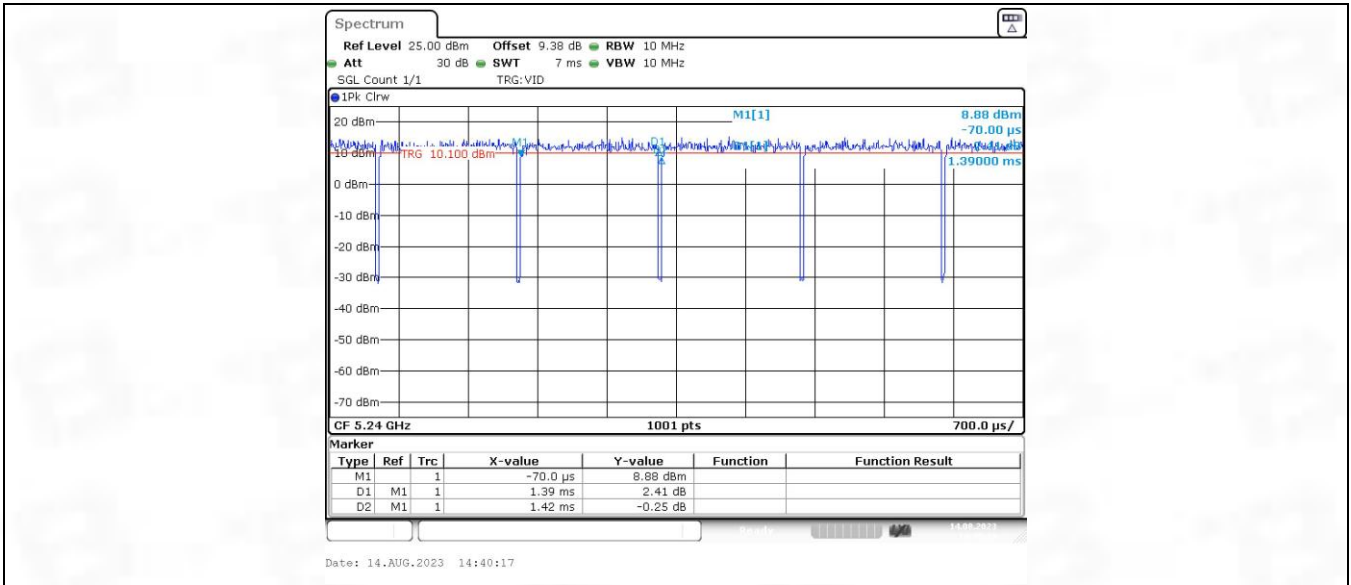


11A_Ant1_5260

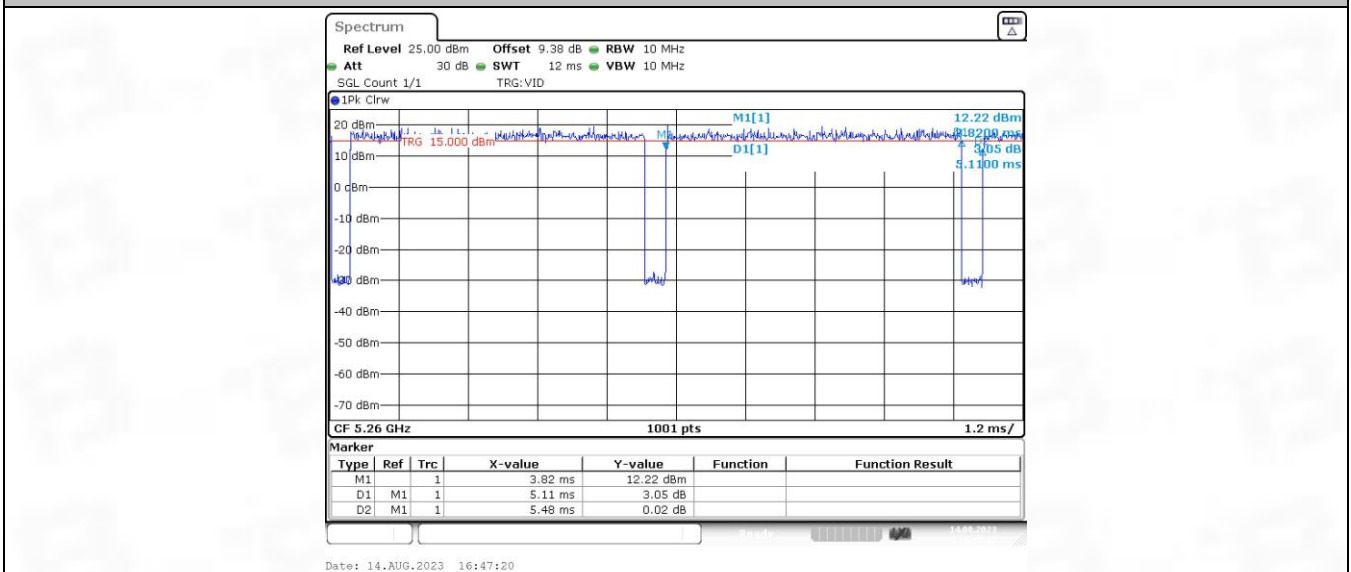


11A_Ant1_5280

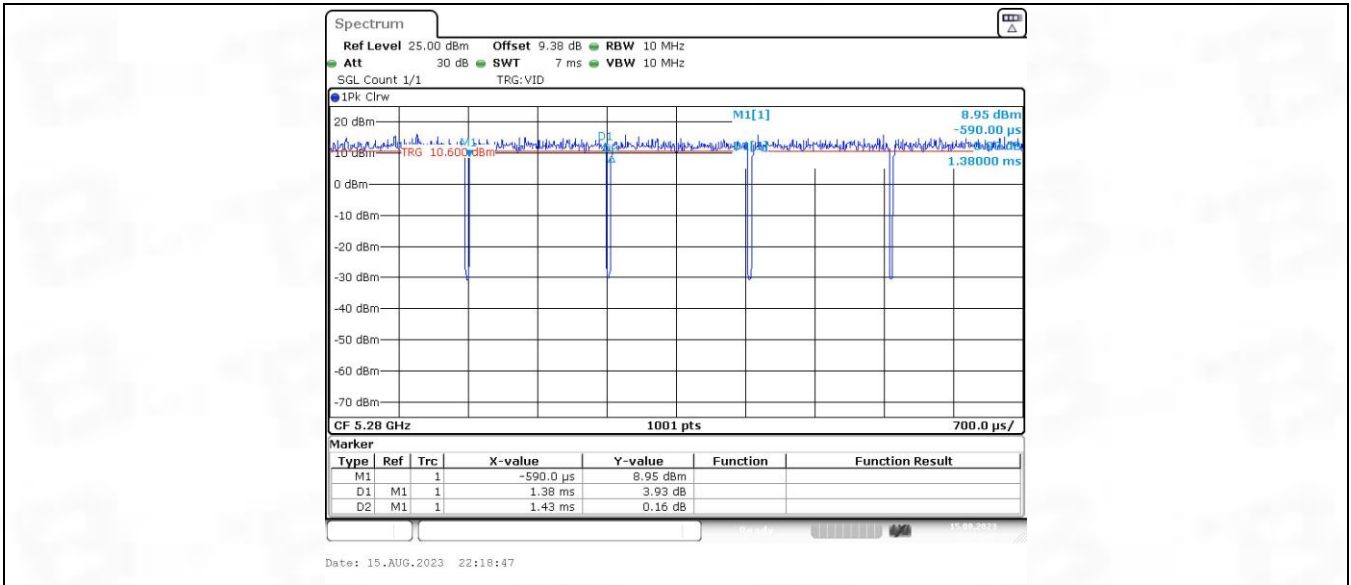


11A_Ant1_5320

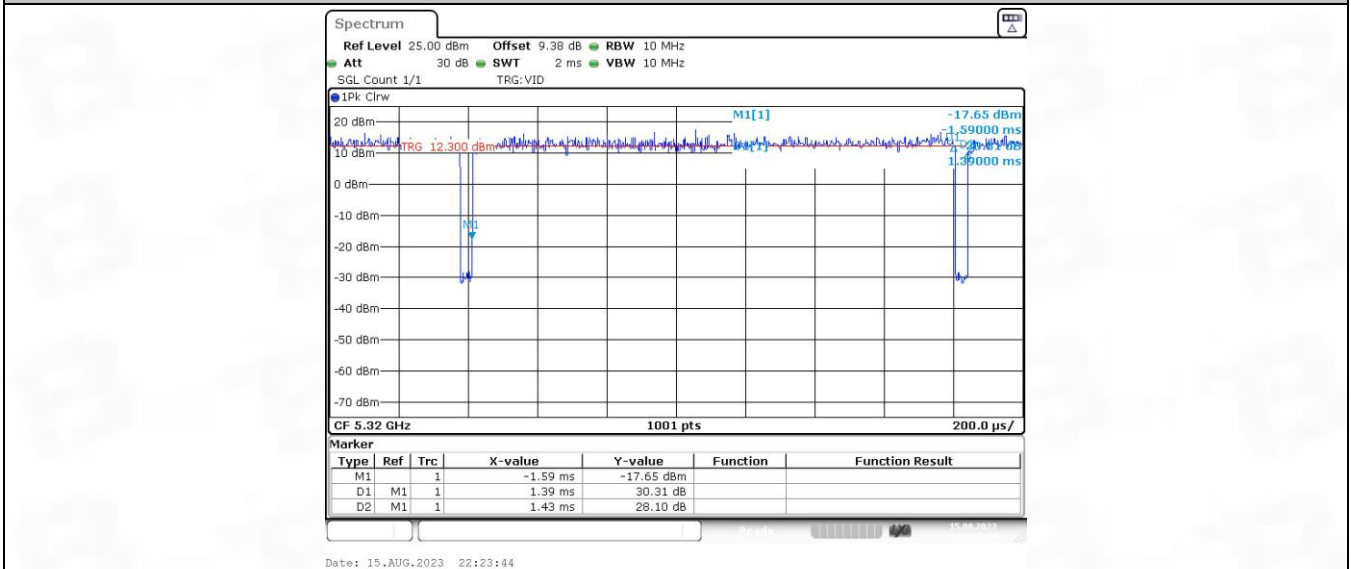


11A_Ant1_5500

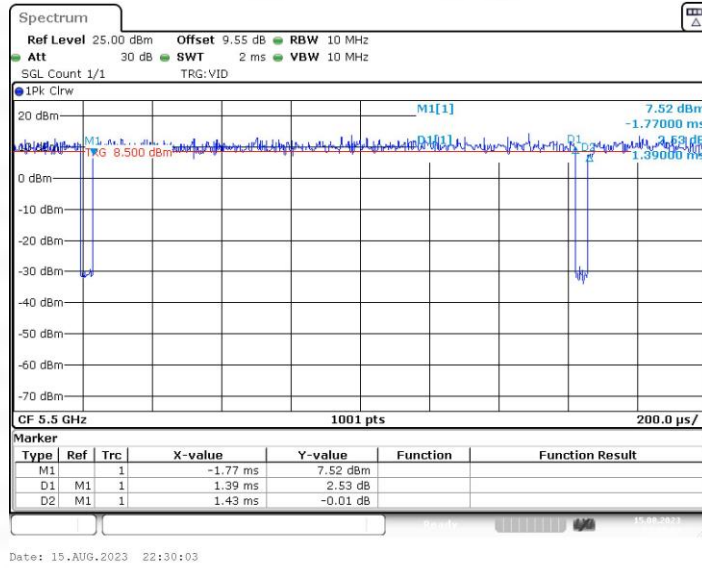


11A_Ant1_5580

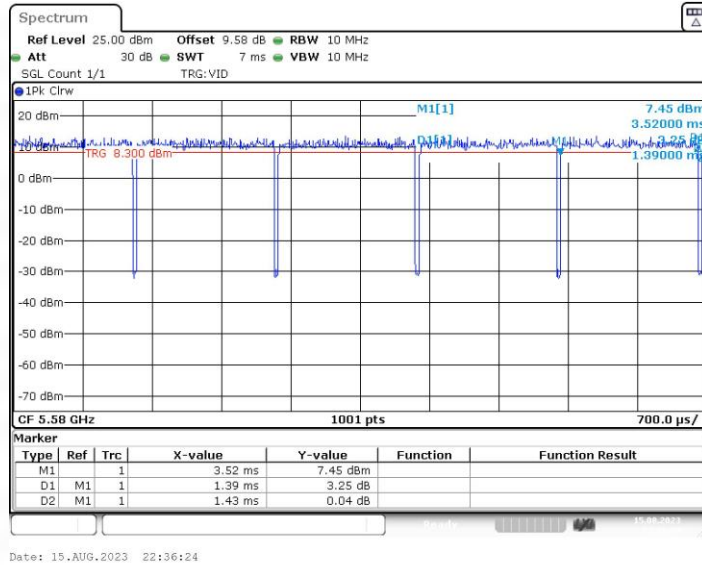


11A_Ant1_5700

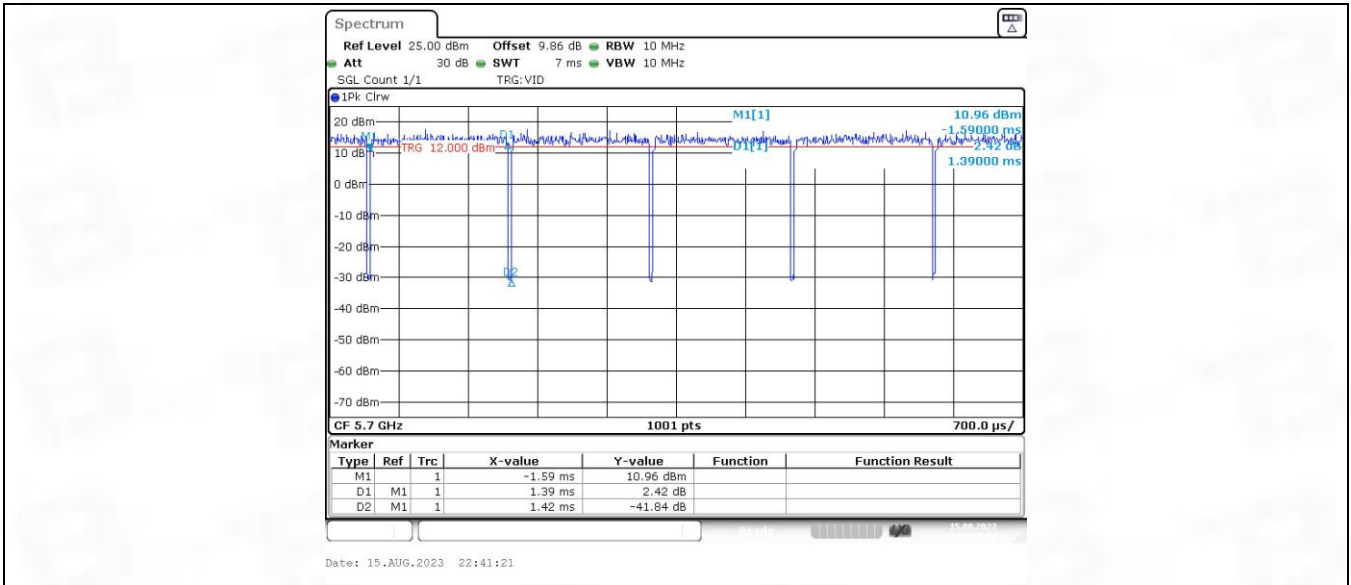


11A_Ant1_5745

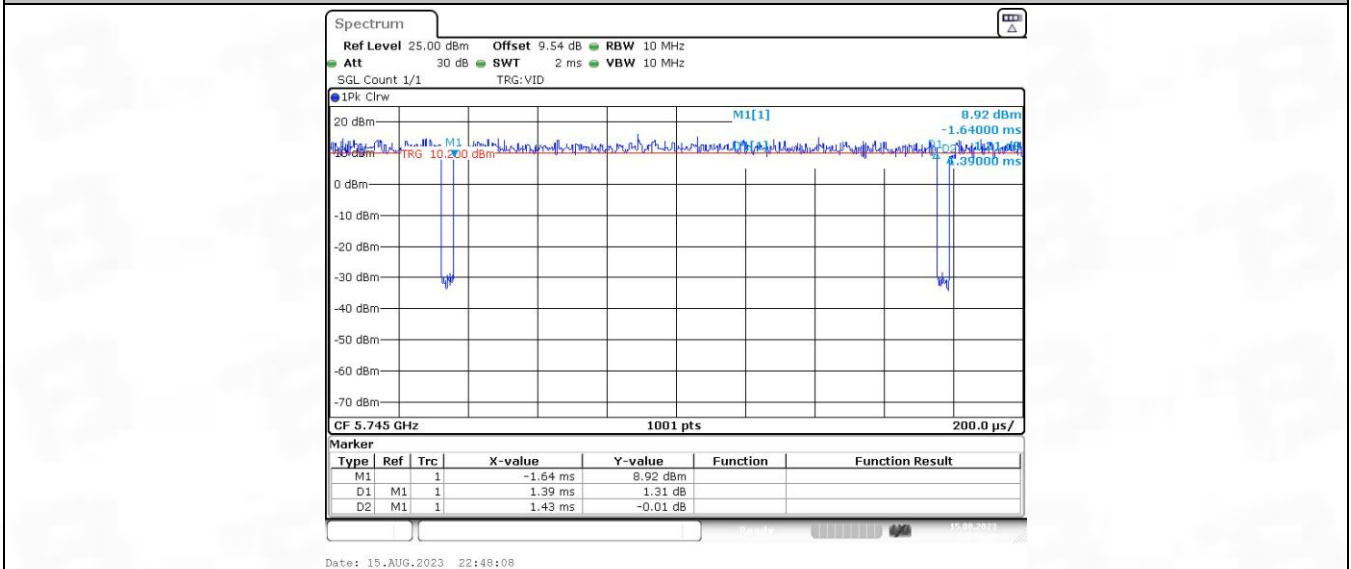


11A_Ant1_5785

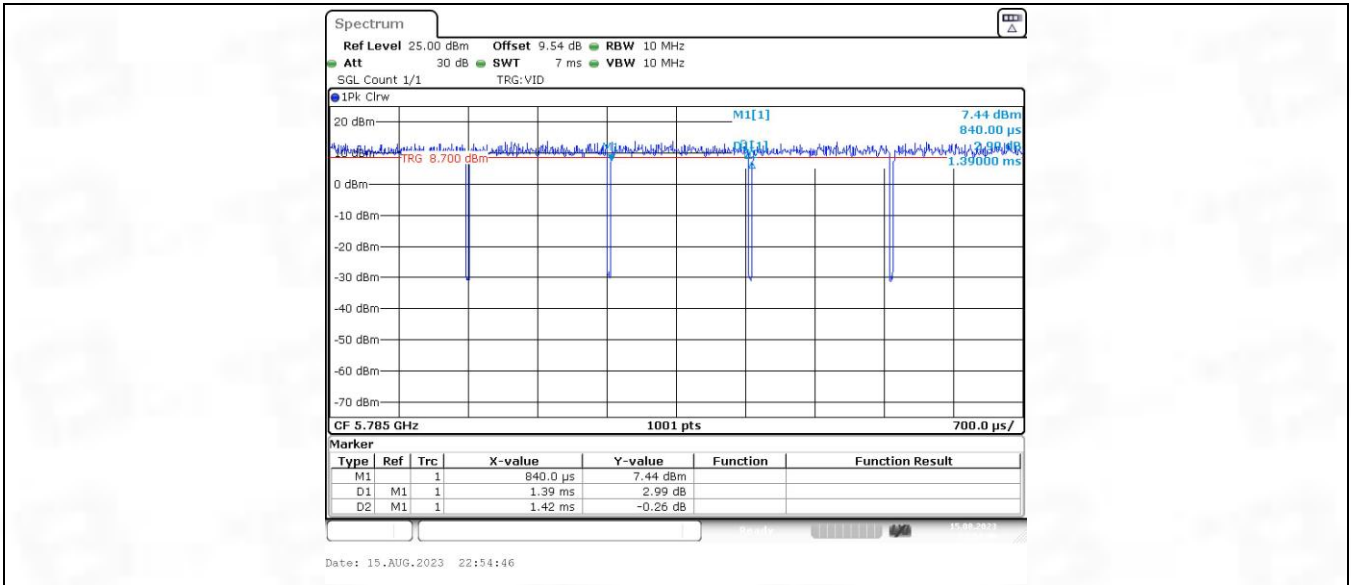


11A_Ant1_5825

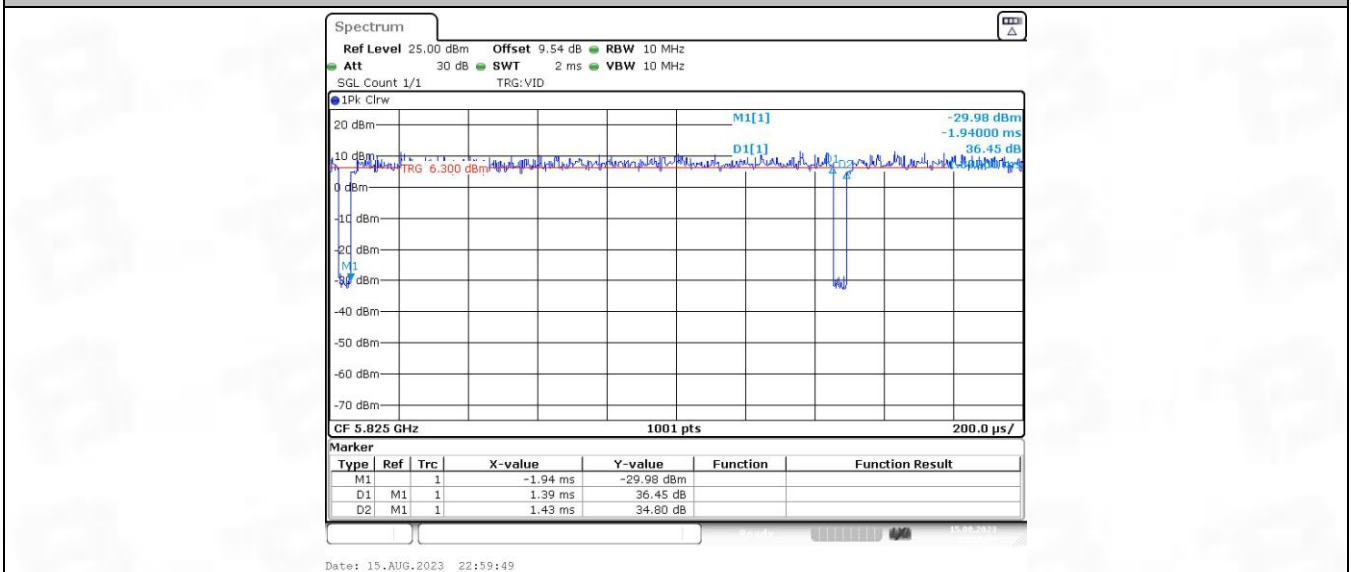


11N20SISO_Ant1_5180

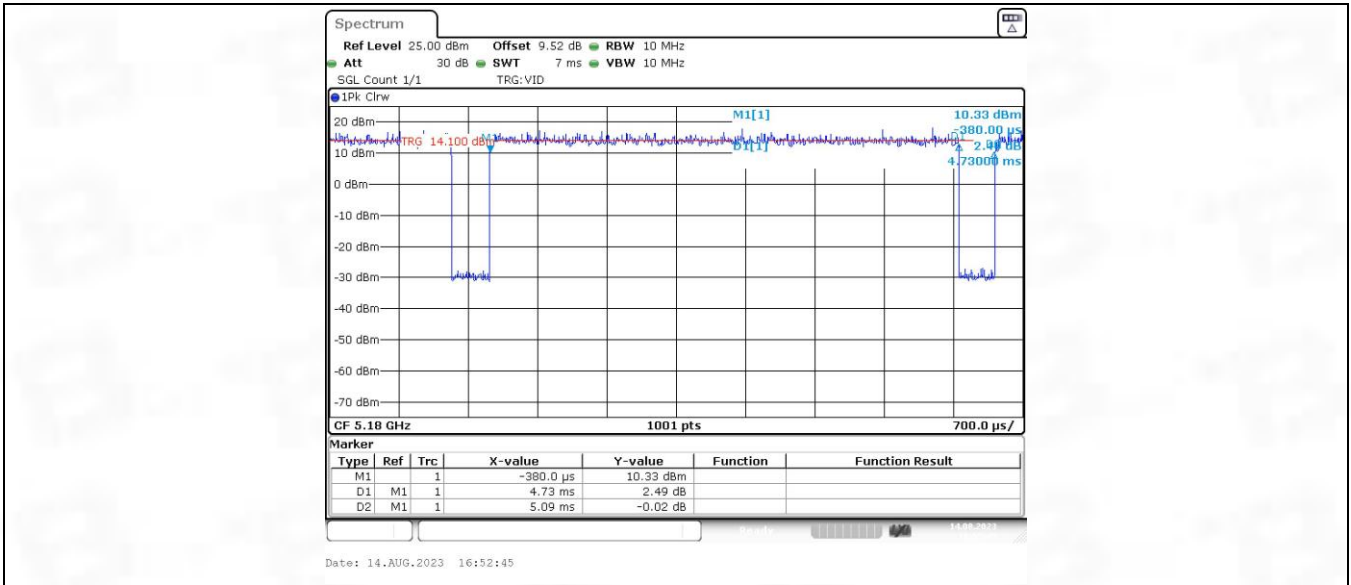


11N20SISO_Ant1_5200

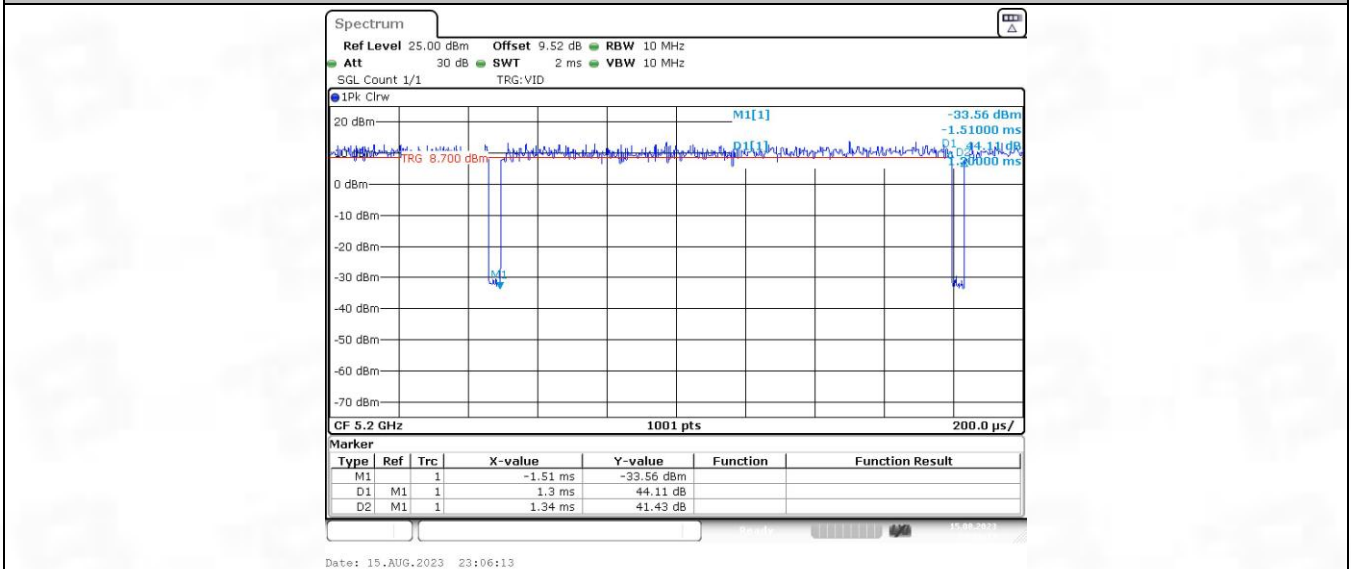


11N20SISO_Ant1_5240

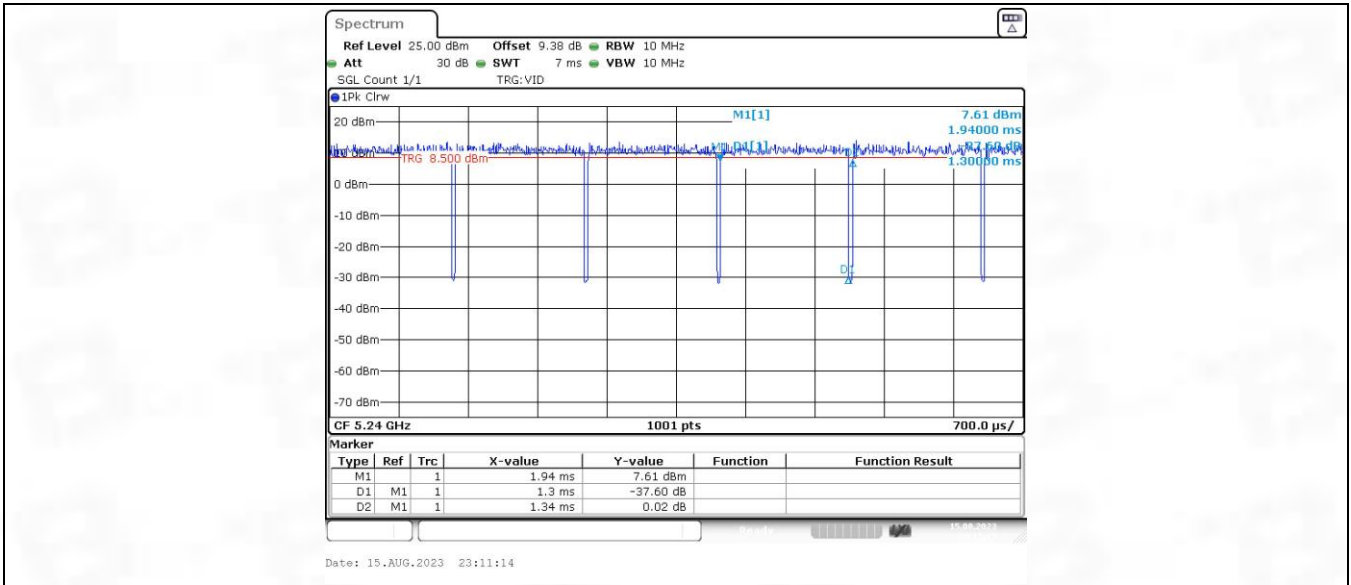

11N20SISO_Ant1_5260

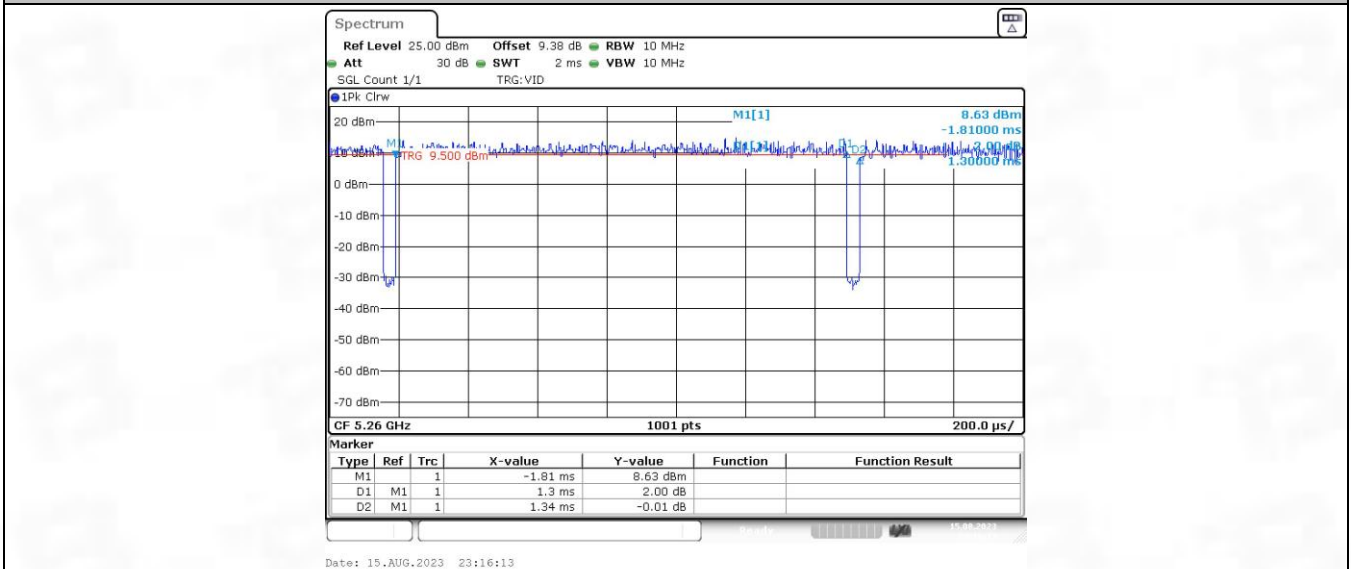


11N20SISO_Ant1_5280

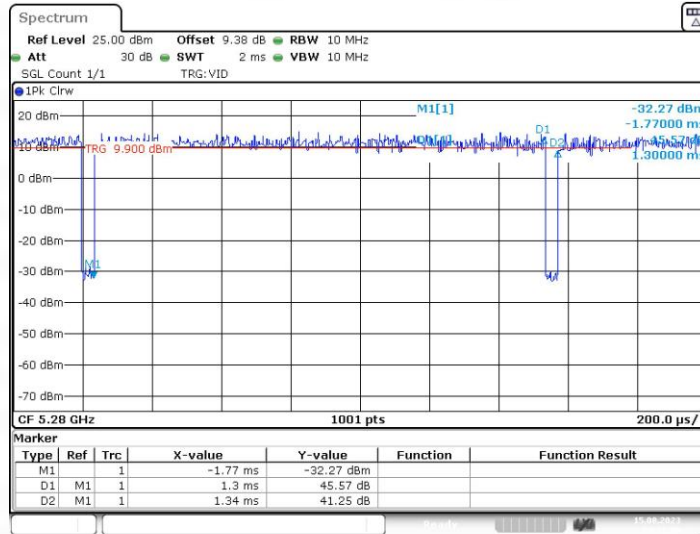


Date: 15.AUG.2023 23:21:08

11N20SISO_Ant1_5320

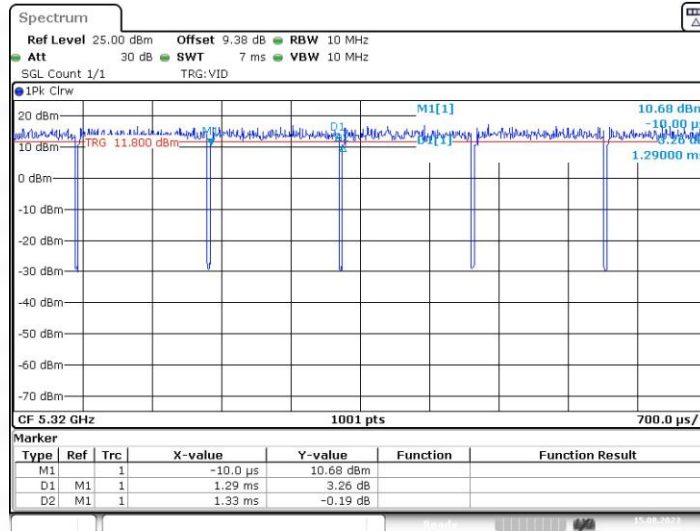


Date: 15.AUG.2023 23:26:25

11N20SISO_Ant1_5500

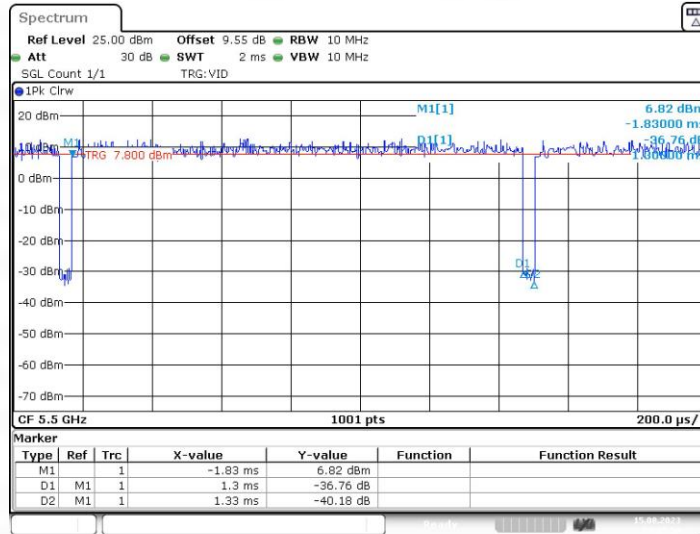


Date: 15.AUG.2023 23:32:57

11N20SISO_Ant1_5580

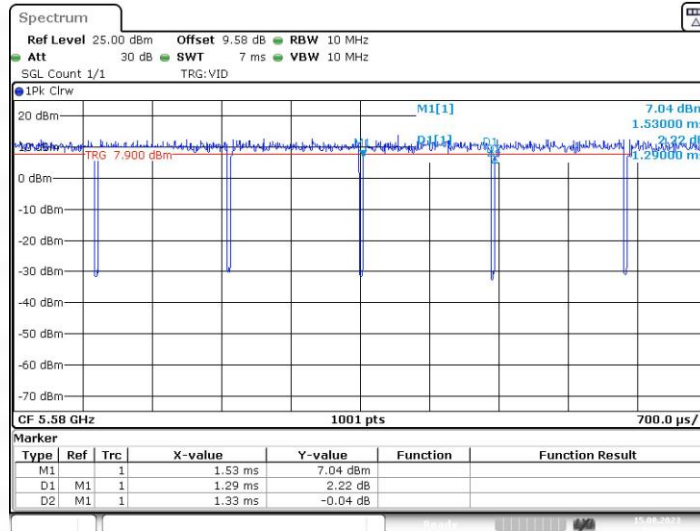


Date: 15.AUG.2023 23:39:22

11N20SISO_Ant1_5700

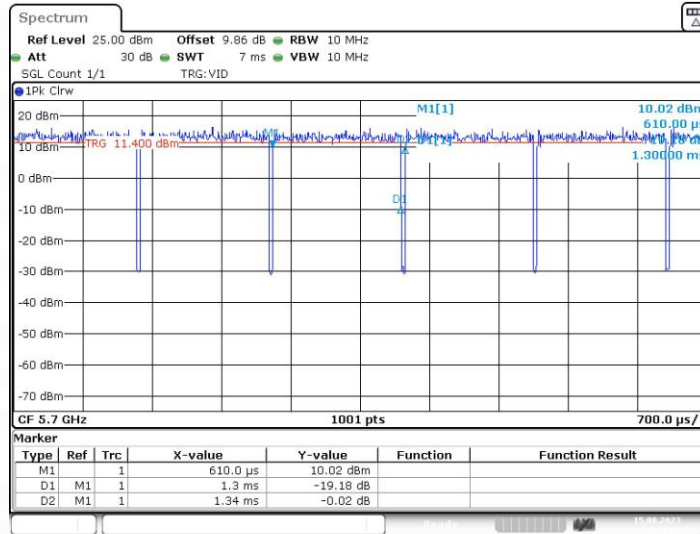


Date: 15.AUG.2023 23:44:28

11N20SISO_Ant1_5745

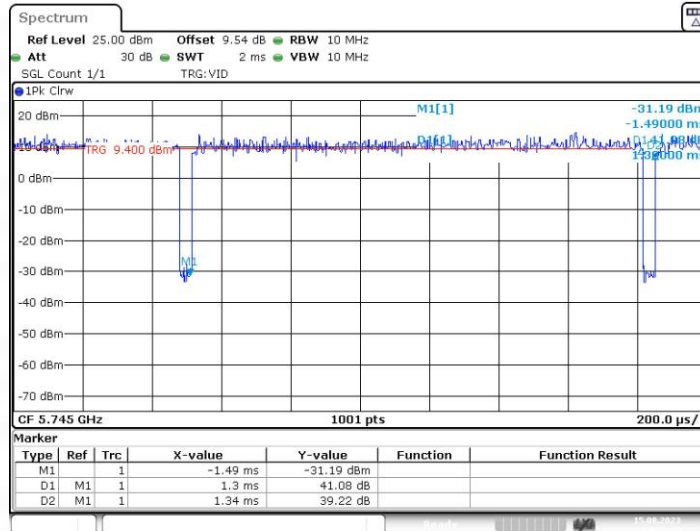


Date: 15.AUG.2023 23:51:15


11N20SISO_Ant1_5785

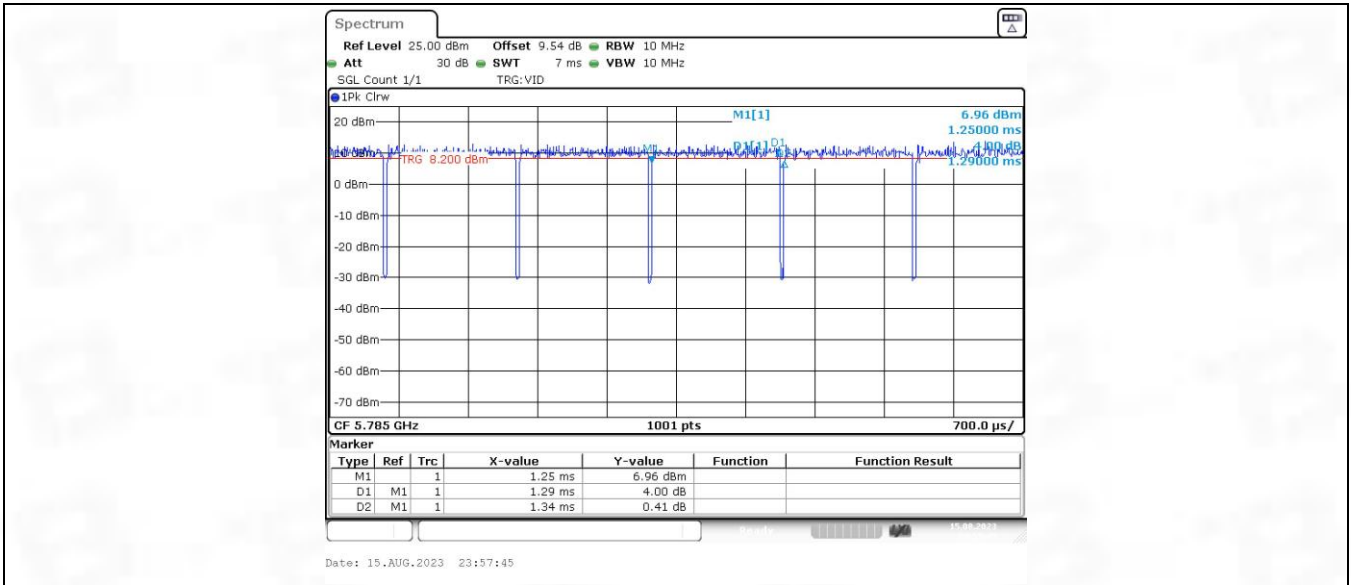

11N20SISO_Ant1_5825

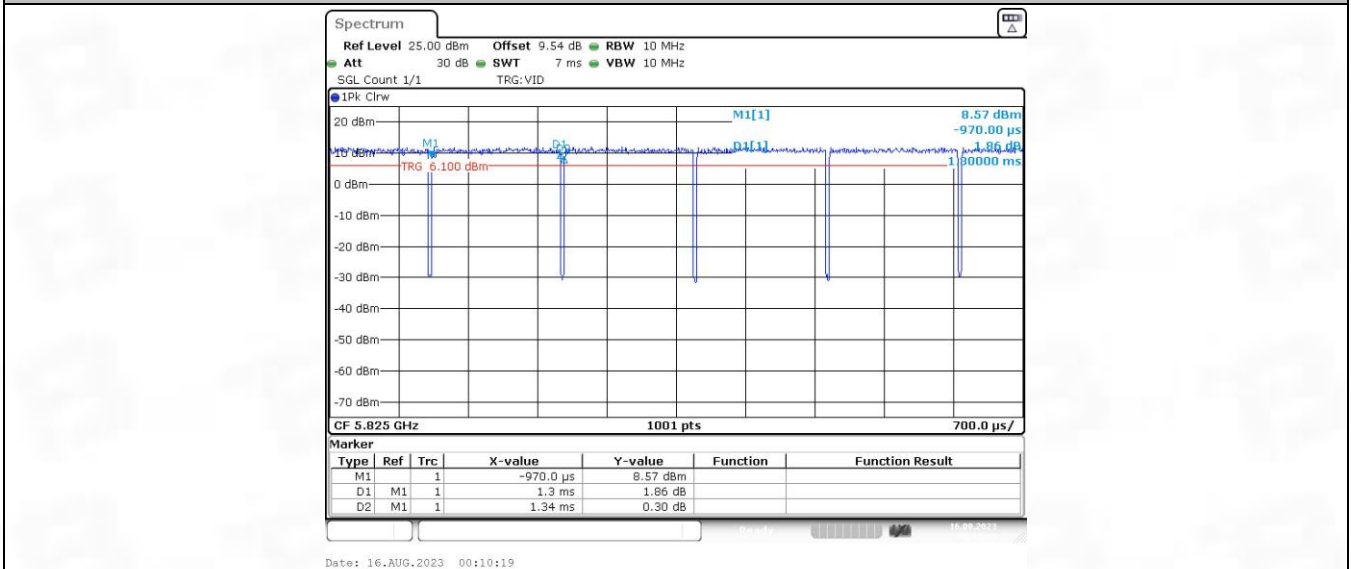


11N40SISO_Ant1_5190

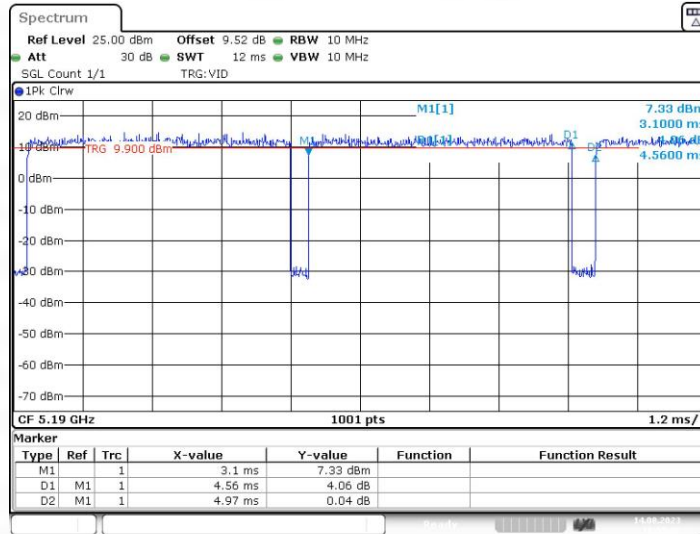


Date: 14.AUG.2023 16:59:32

11N40SISO_Ant1_5230

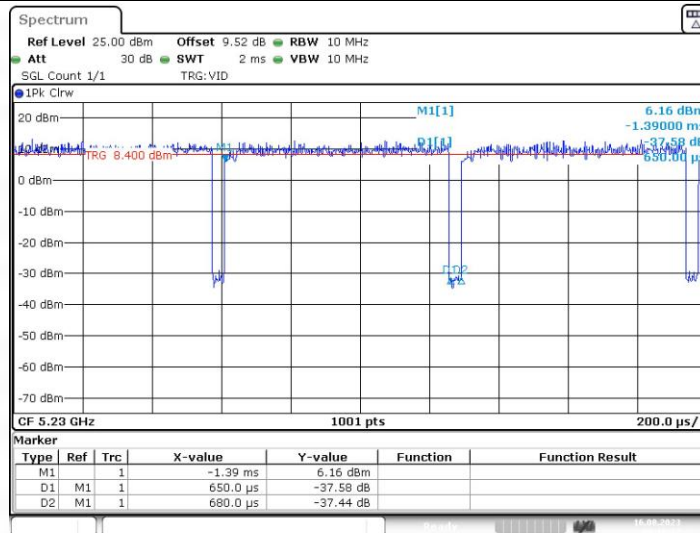


Date: 16.AUG.2023 00:16:37


11N40SISO_Ant1_5270

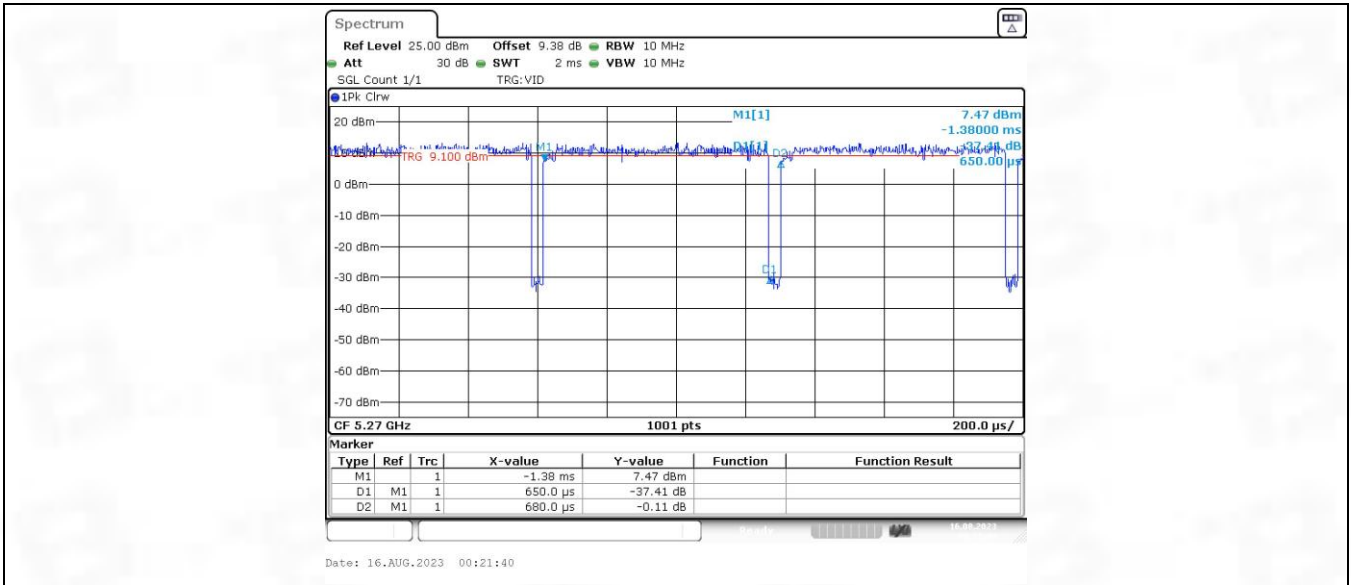


11N40SISO_Ant1_5310

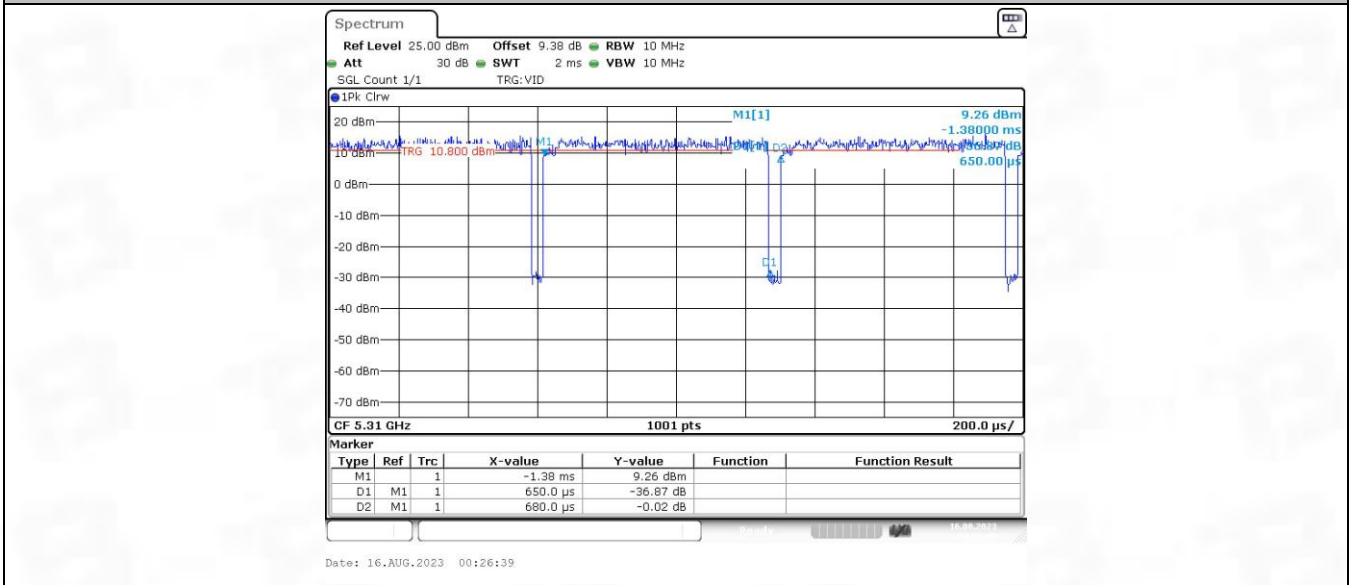


11N40SISO_Ant1_5510

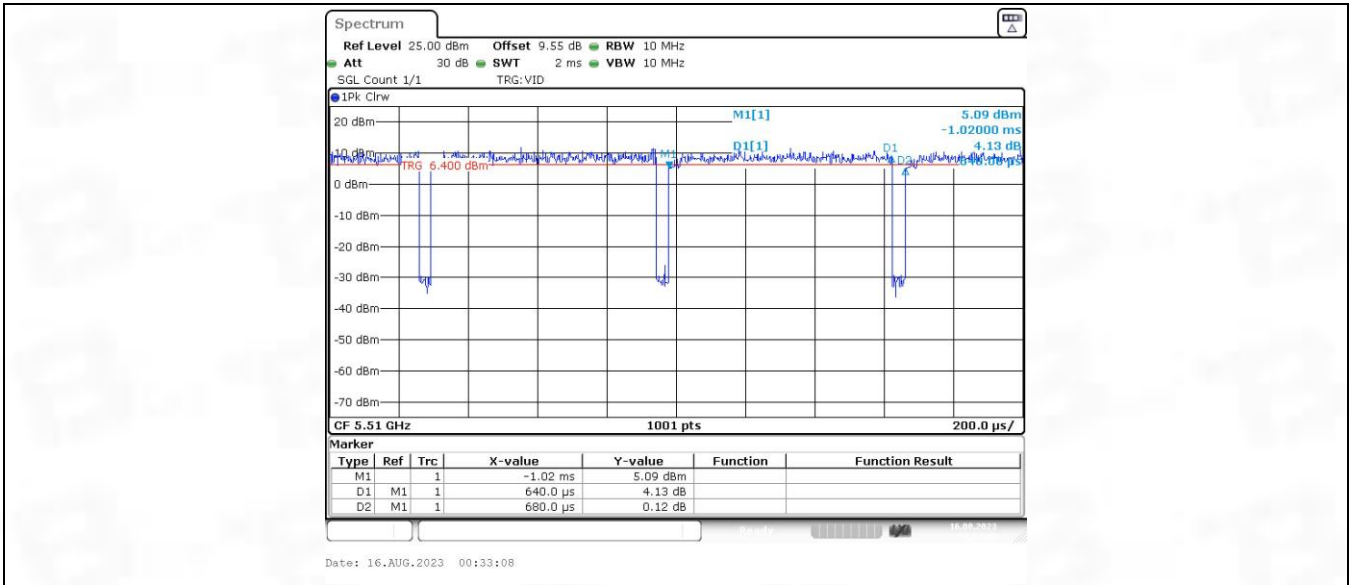

11N40SISO_Ant1_5550

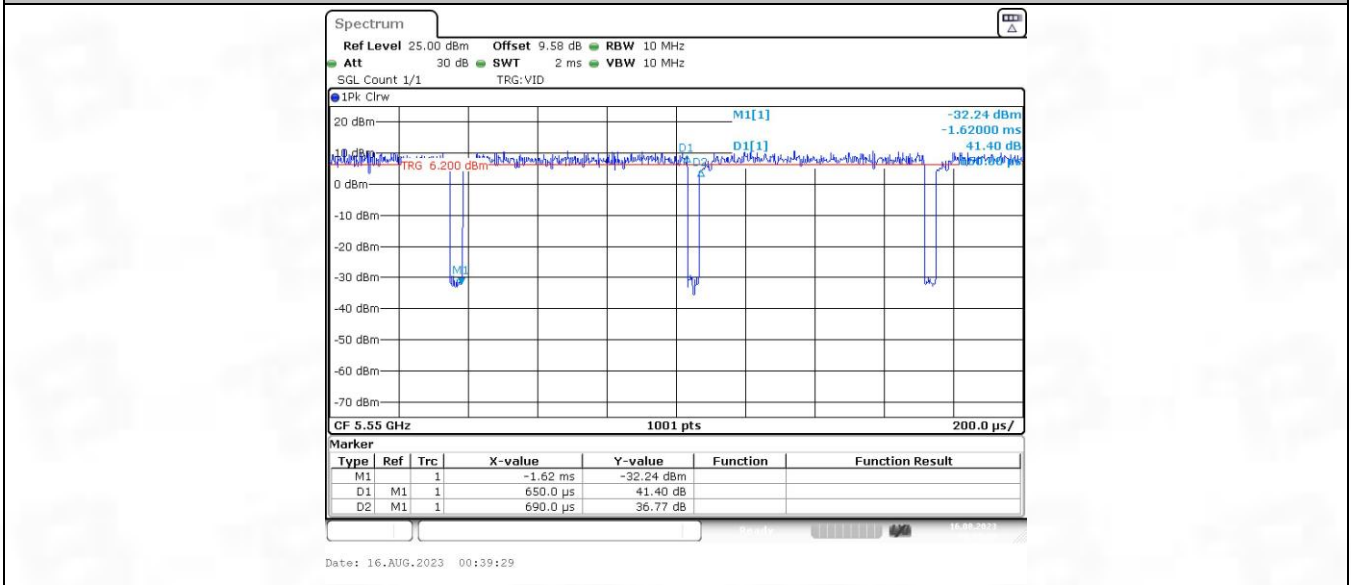


11N40SISO_Ant1_5670

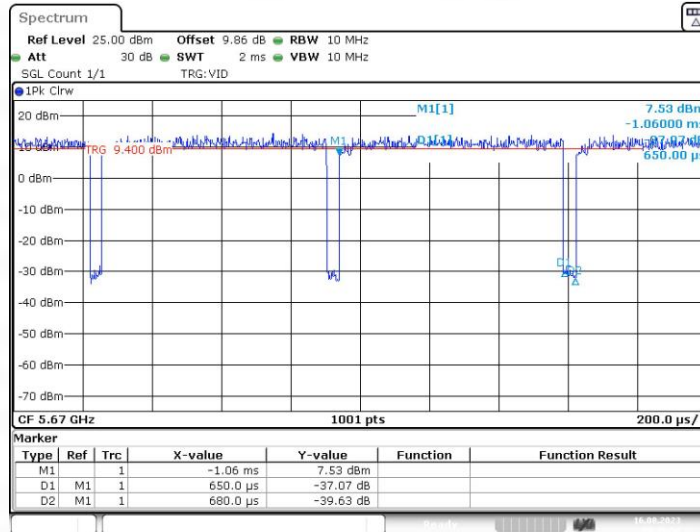


Date: 16.AUG.2023 00:46:51

11N40SISO_Ant1_5755

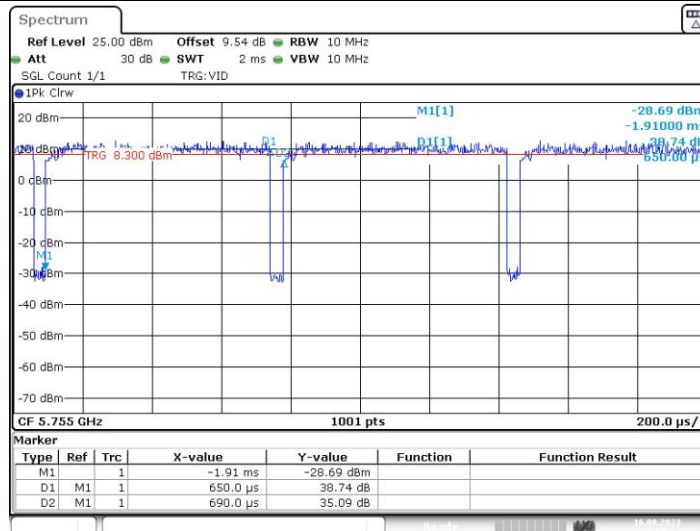


Date: 16.AUG.2023 00:53:10

11N40SISO_Ant1_5795

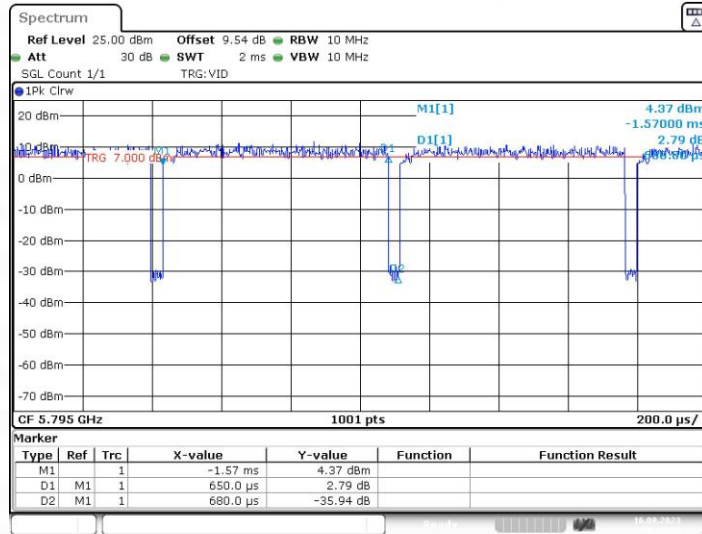


Date: 16.AUG.2023 00:59:25

11AC20SISO_Ant1_5180

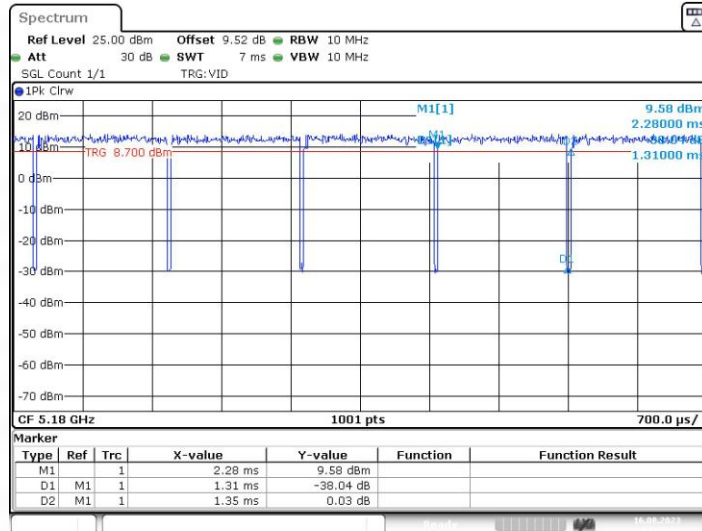


Date: 16.AUG.2023 01:05:59

11AC20SISO_Ant1_5200

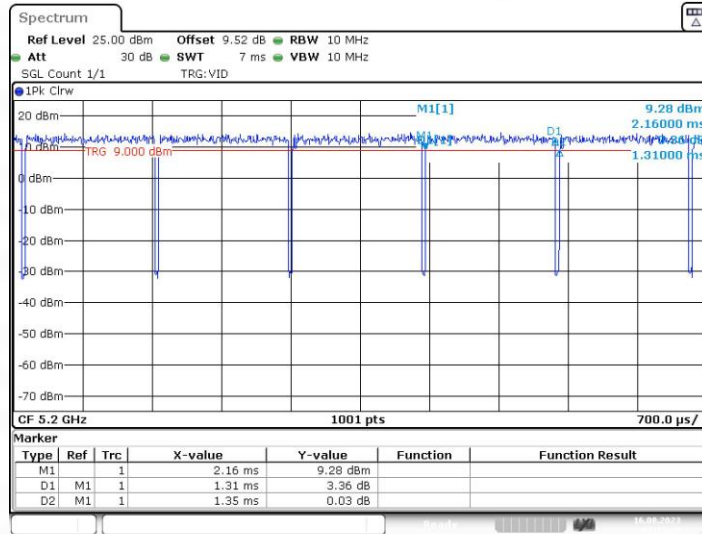


Date: 16.AUG.2023 01:12:23

11AC20SISO_Ant1_5240

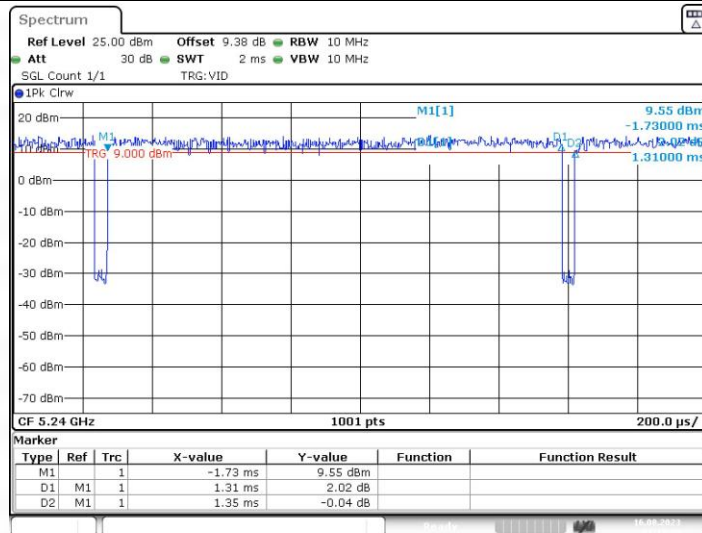


Date: 16.AUG.2023 01:17:21


11AC20SISO_Ant1_5260

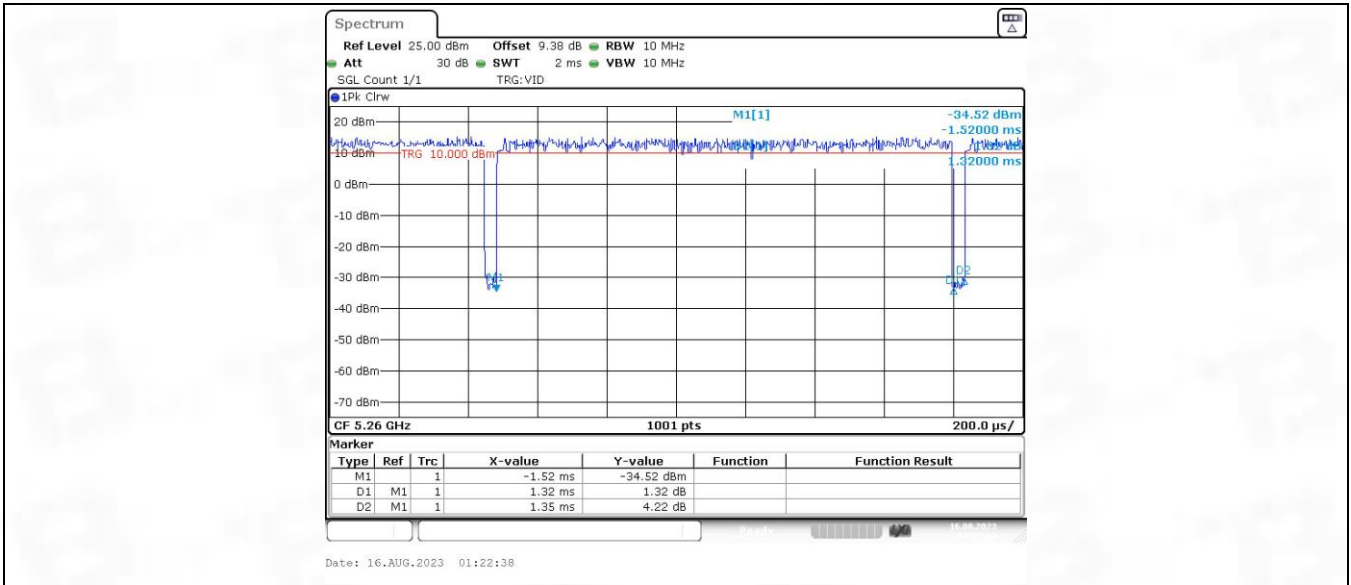


11AC20SISO_Ant1_5280

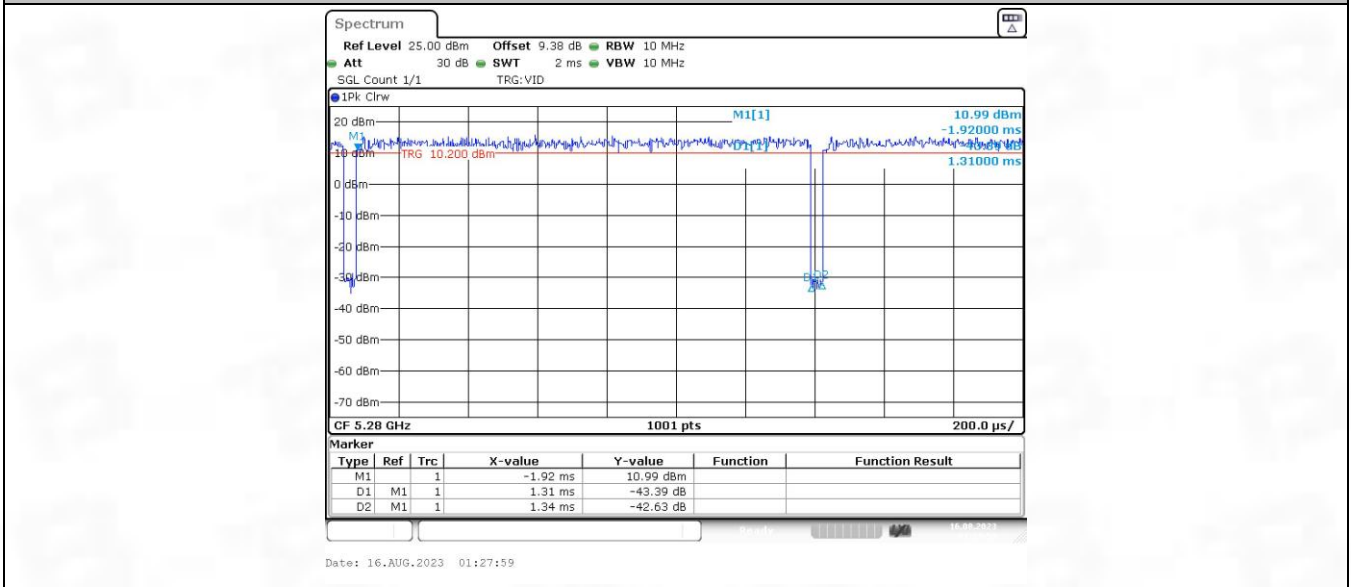


11AC20SISO_Ant1_5320

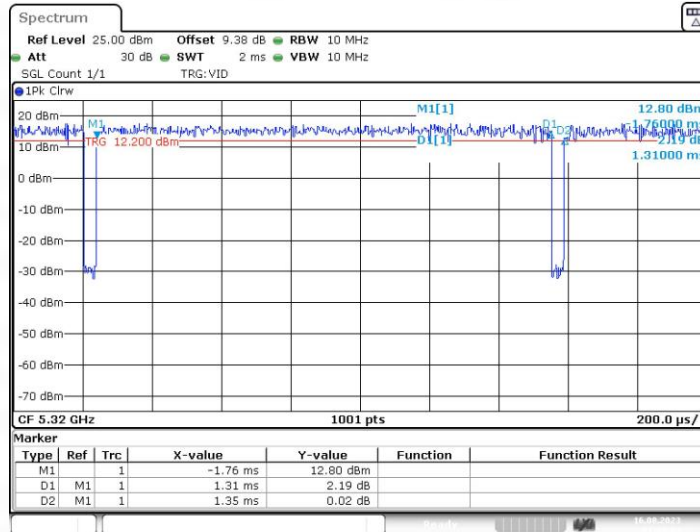


11AC20SISO_Ant1_5500

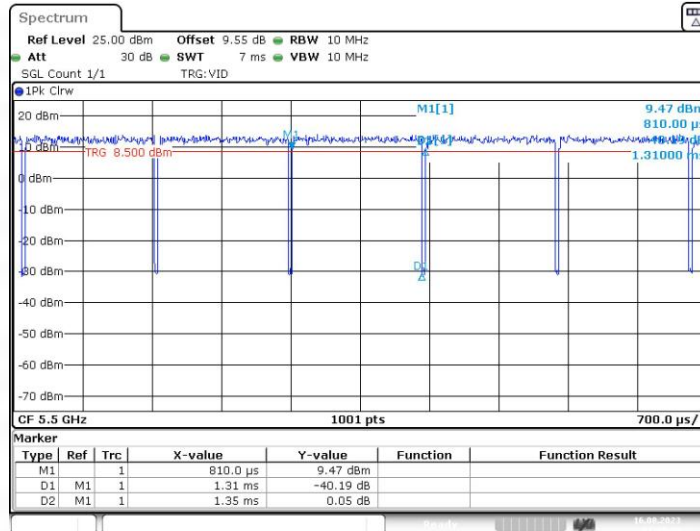


11AC20SISO_Ant1_5580

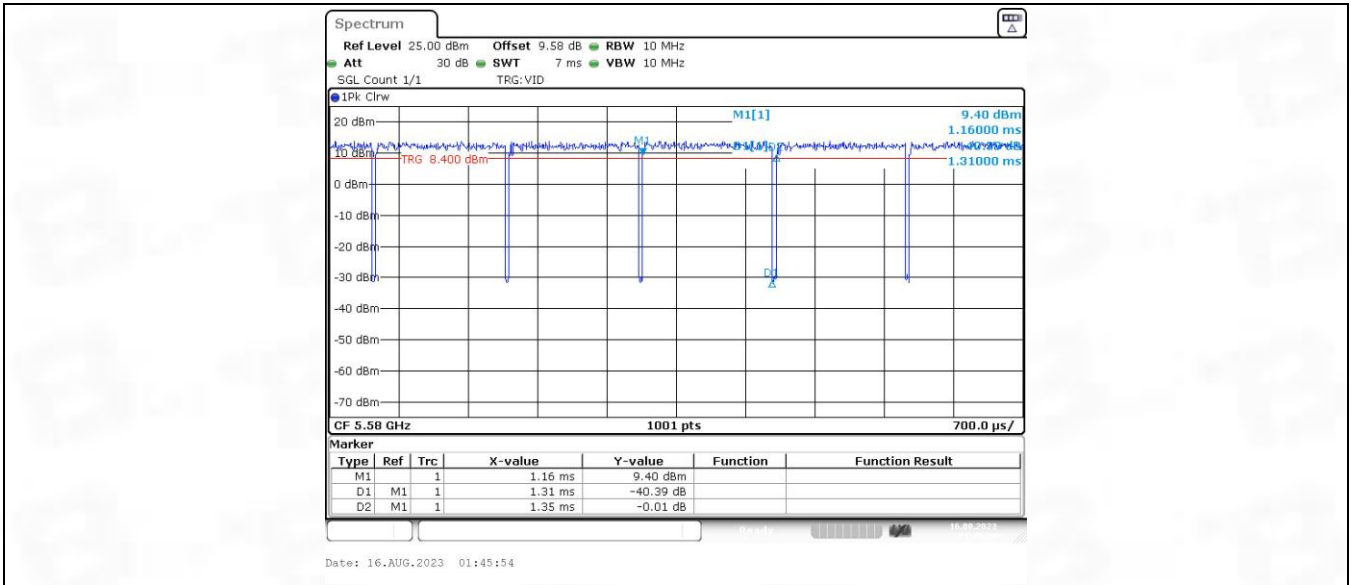

11AC20SISO_Ant1_5700

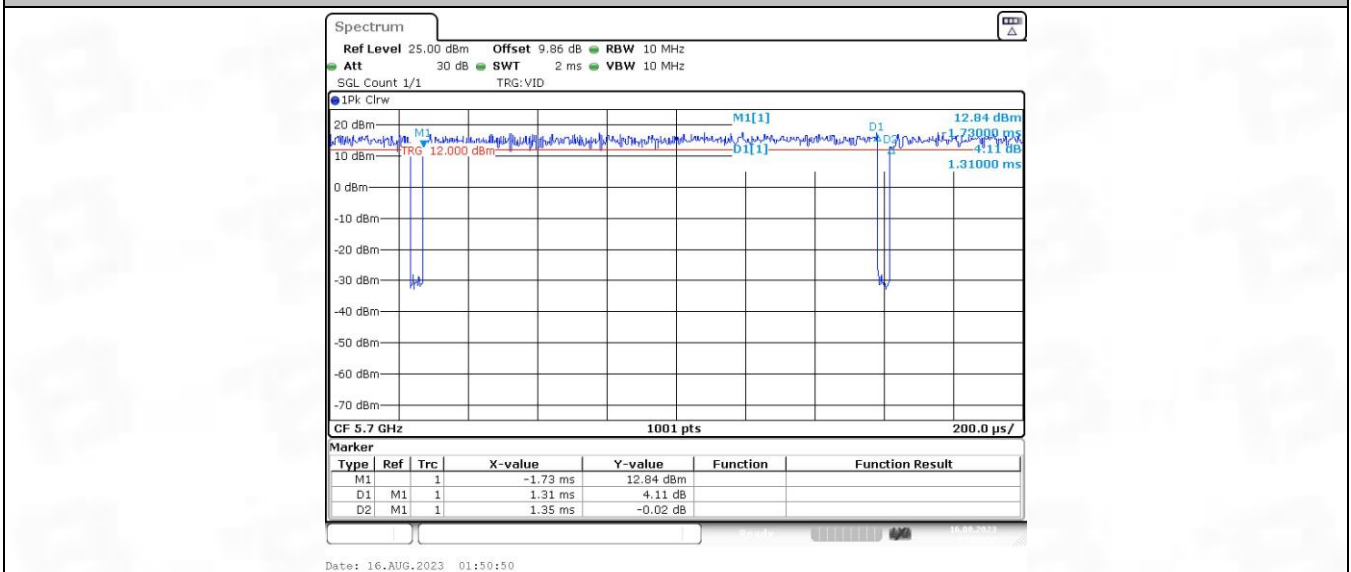


11AC20SISO_Ant1_5745

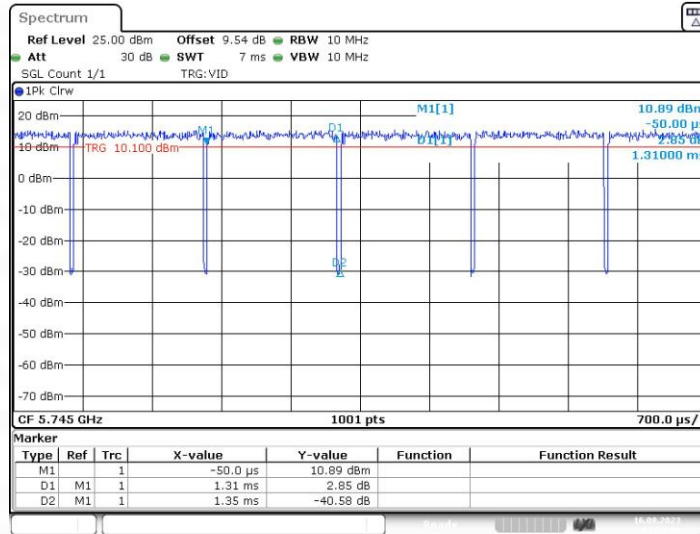


Date: 16.AUG.2023 01:57:06

11AC20SISO_Ant1_5785

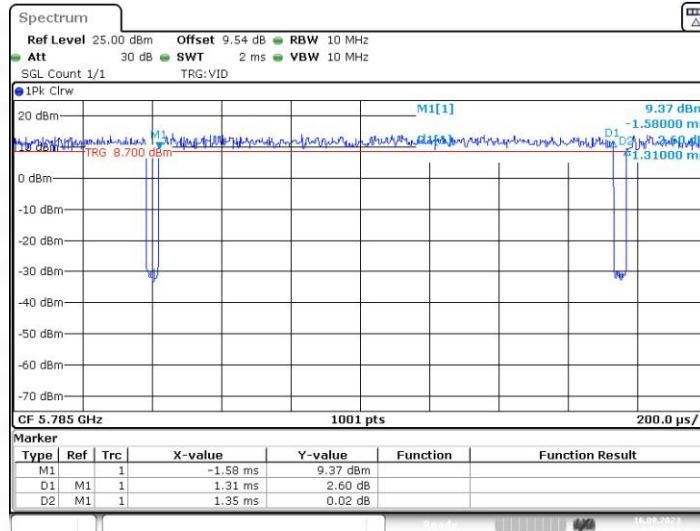


Date: 16.AUG.2023 02:03:20


11AC20SISO_Ant1_5825

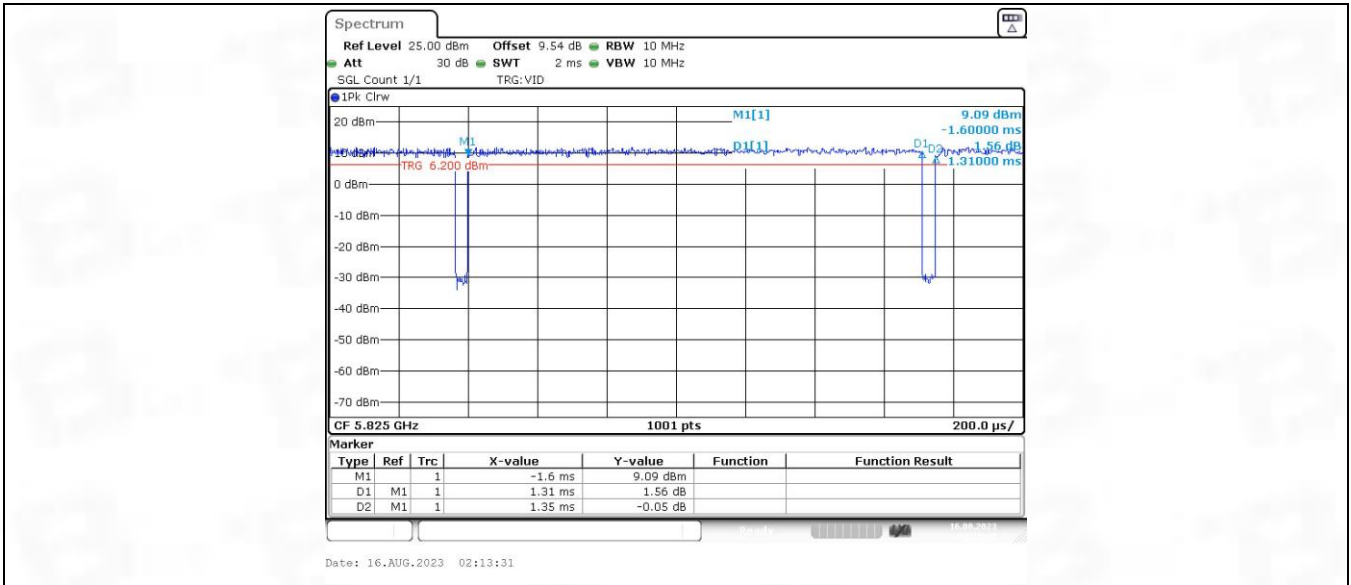


11AC40SISO_Ant1_5190

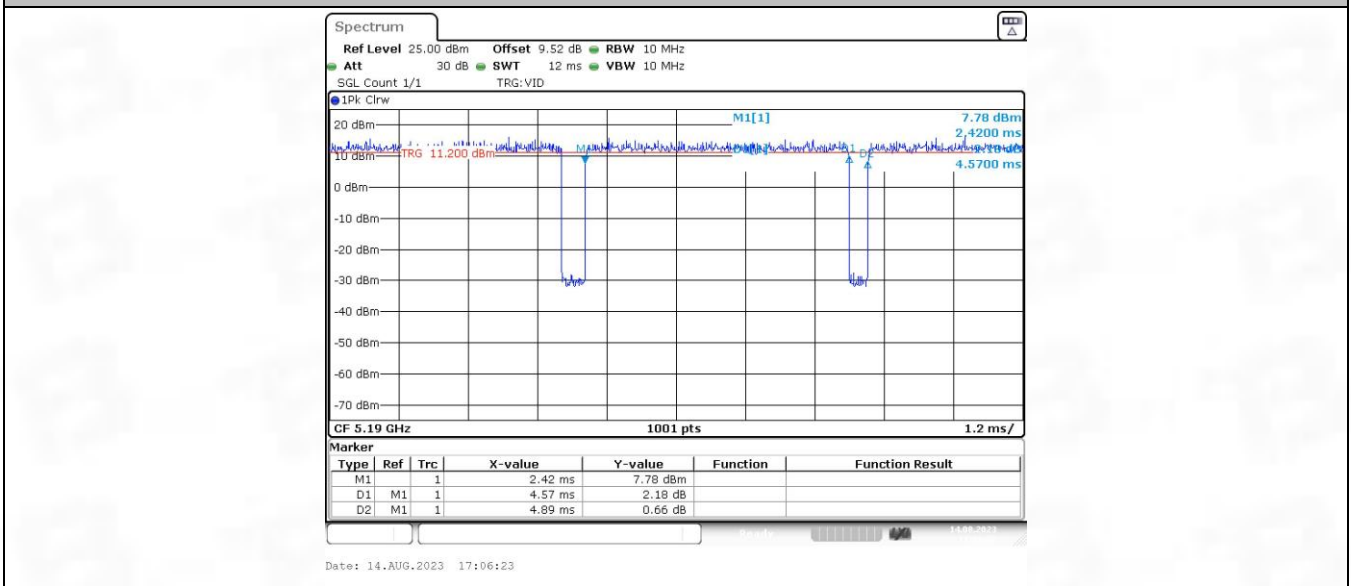


11AC40SISO_Ant1_5230

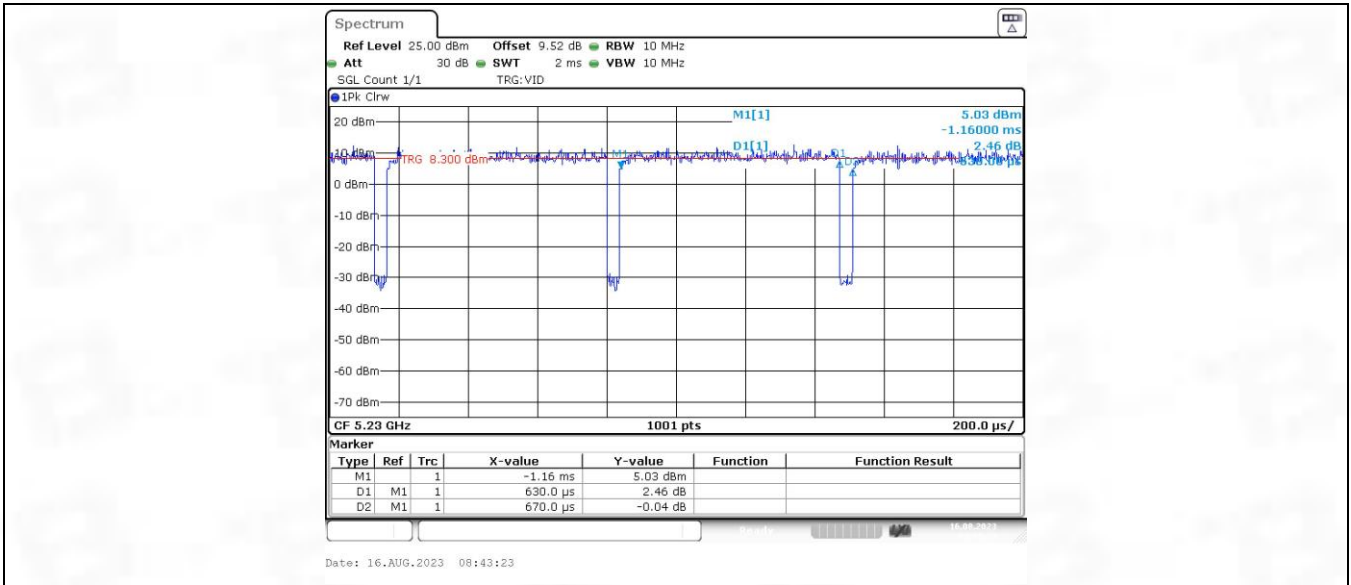

11AC40SISO_Ant1_5270

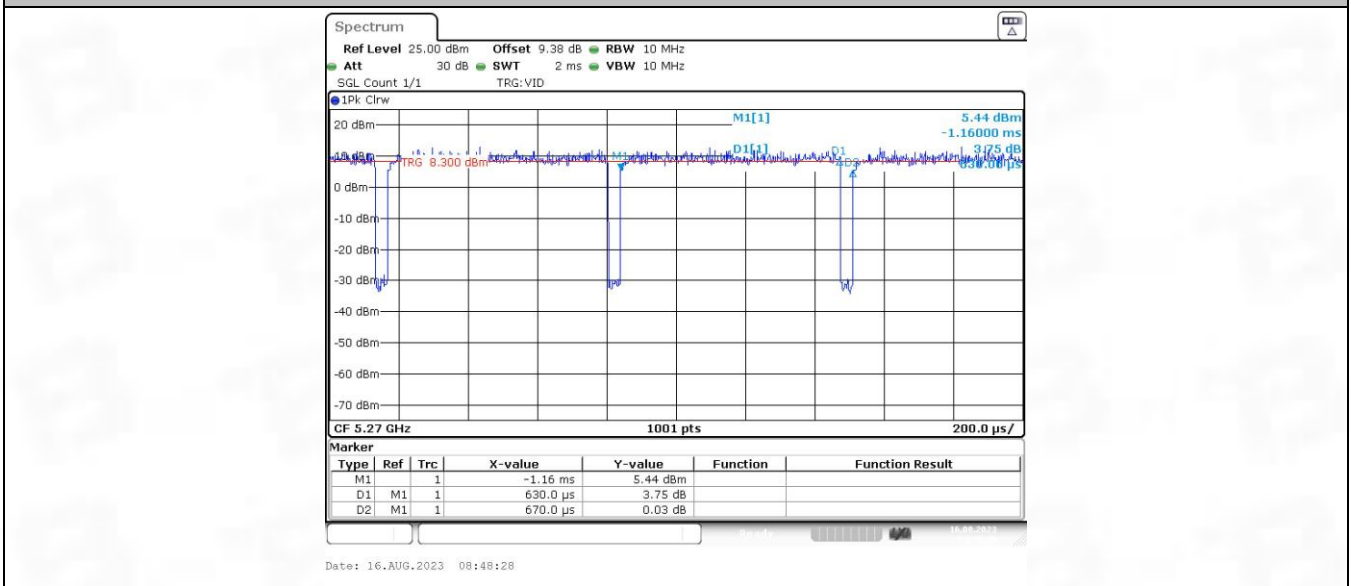


11AC40SISO_Ant1_5310

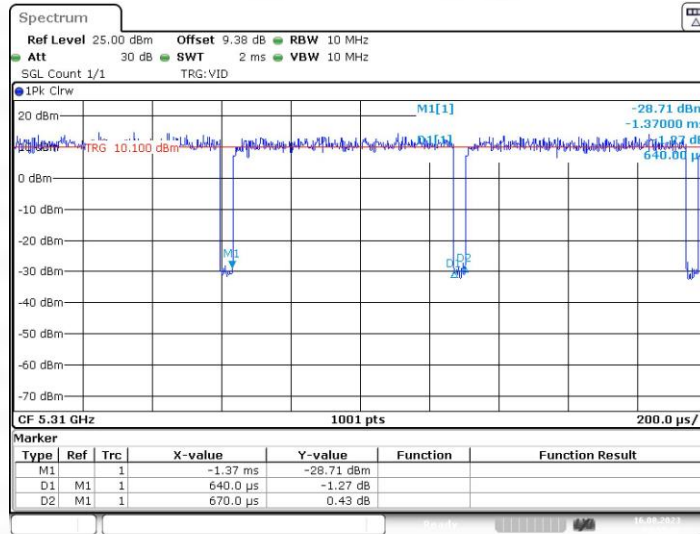


Date: 16.AUG.2023 08:53:33

11AC40SISO_Ant1_5510

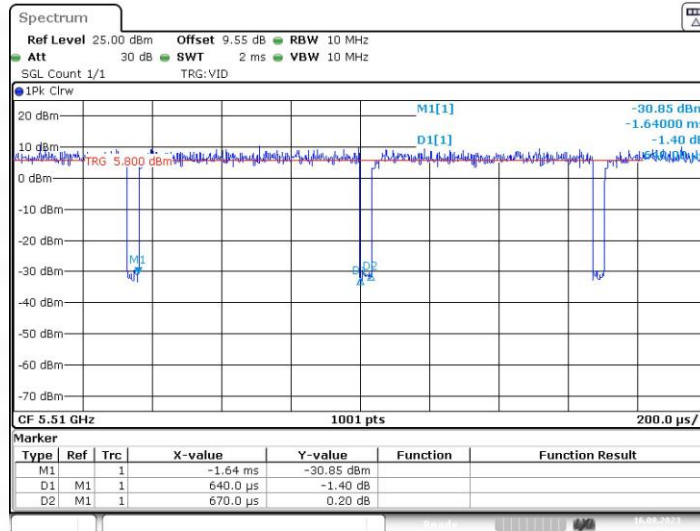


Date: 16.AUG.2023 08:59:52


11AC40SISO_Ant1_5550

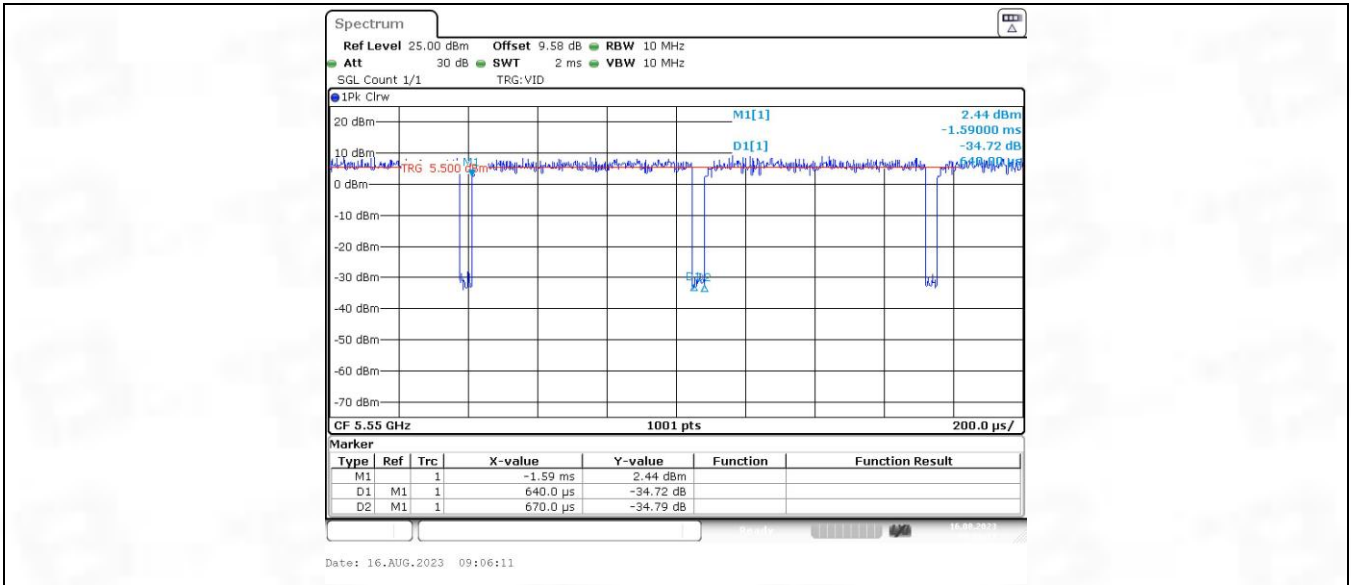


11AC40SISO_Ant1_5670

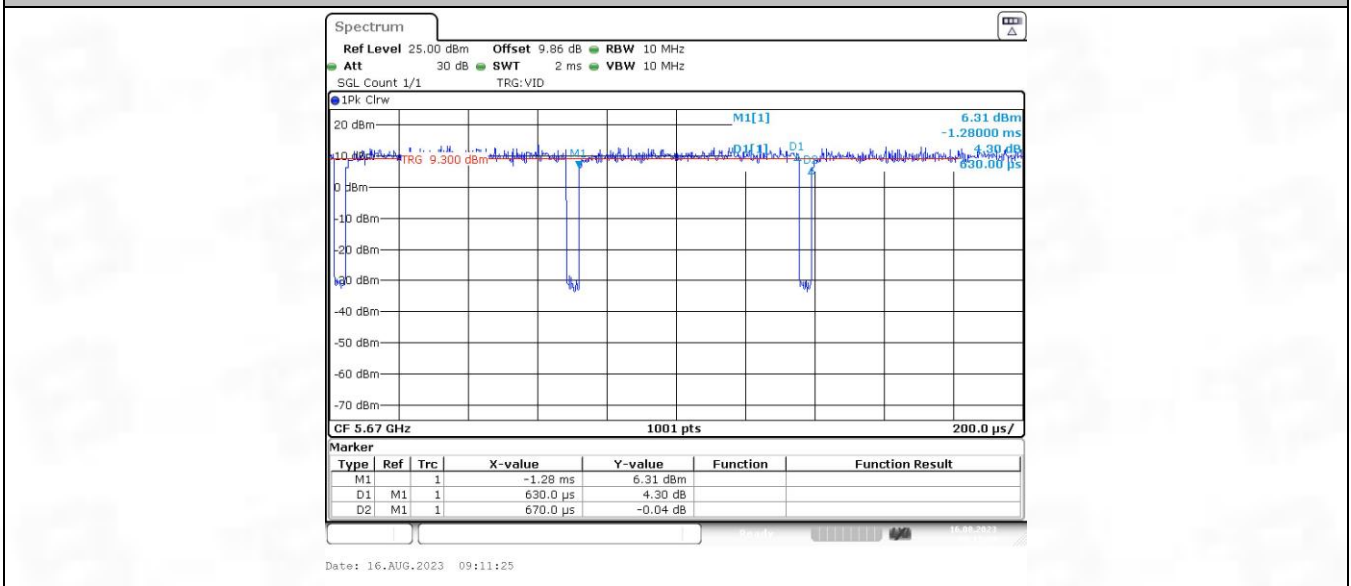


11AC40SISO_Ant1_5755

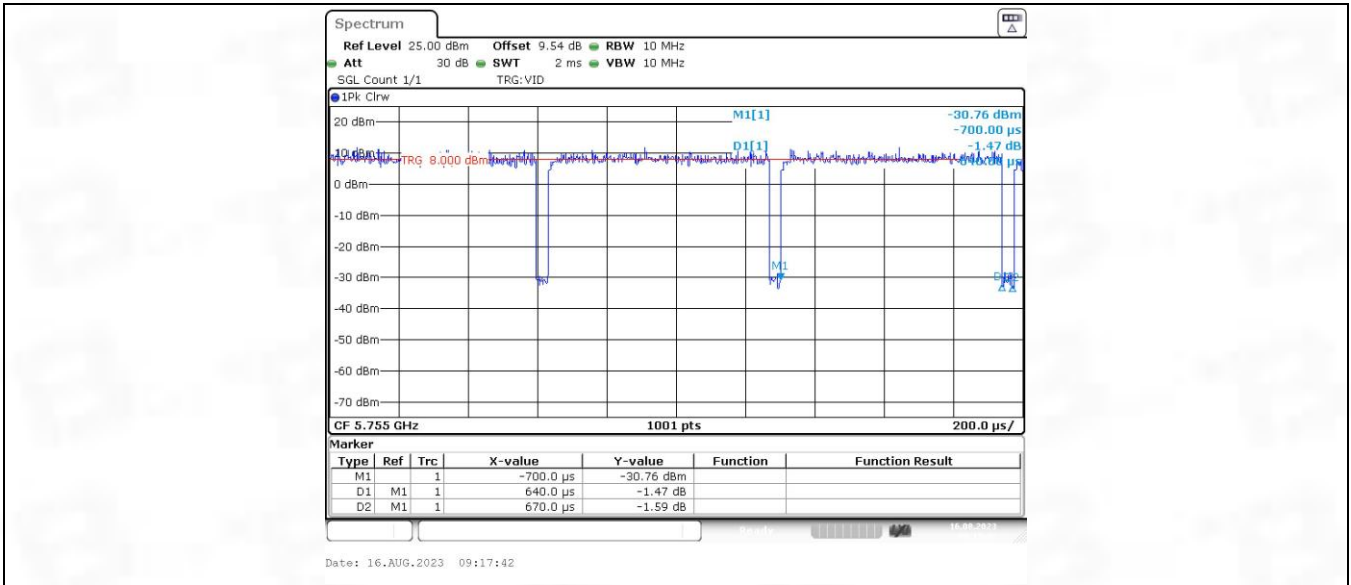


11AC40SISO_Ant1_5795

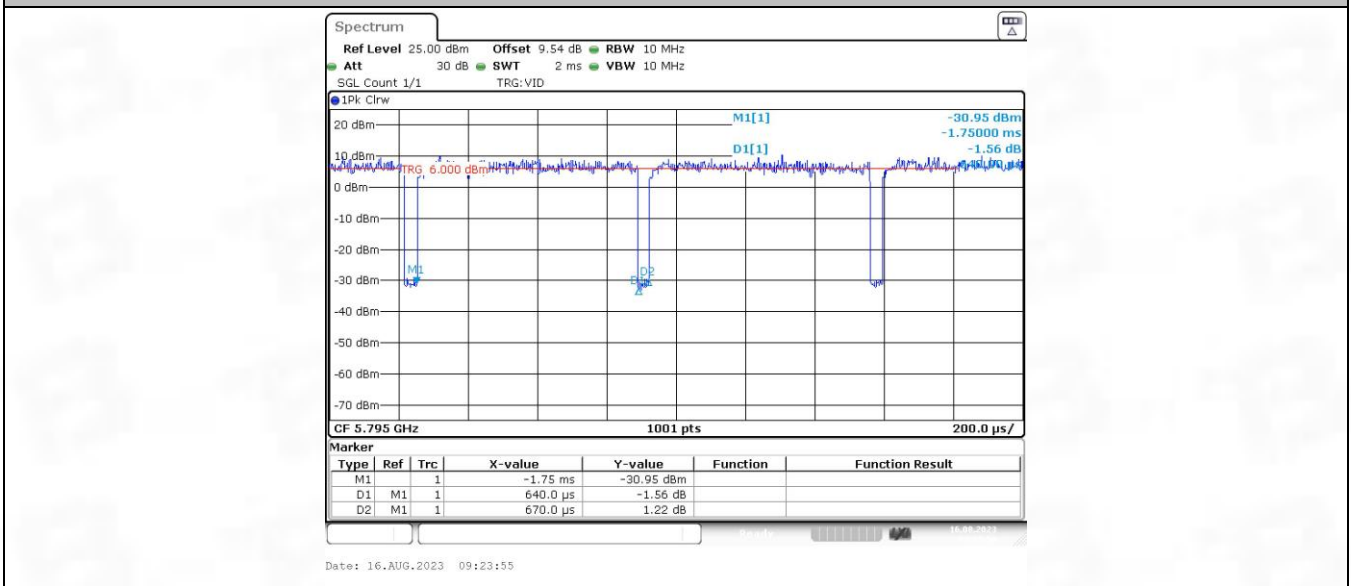


11AC80SISO_Ant1_5210

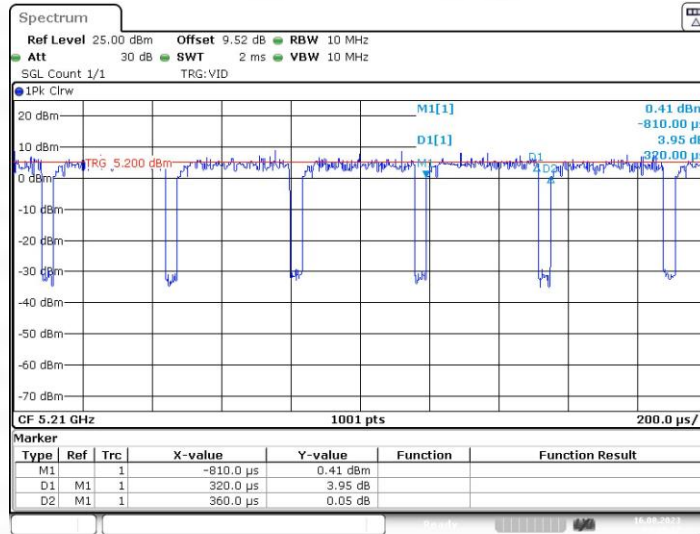

11AC80SISO_Ant1_5290

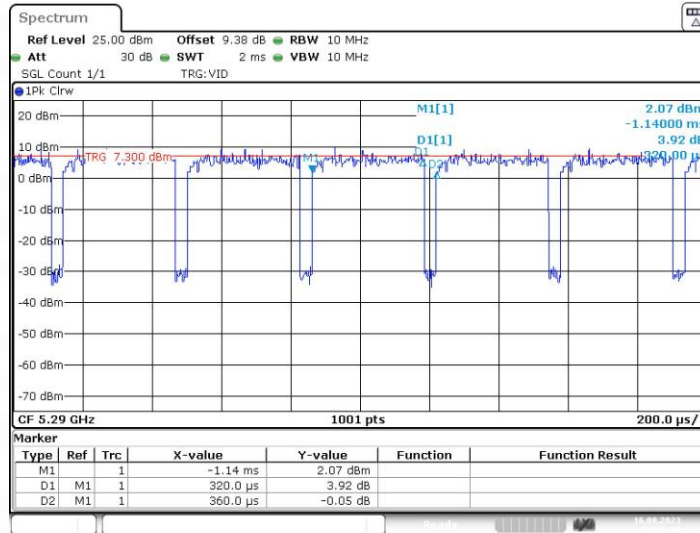


11AC80SISO_Ant1_5530

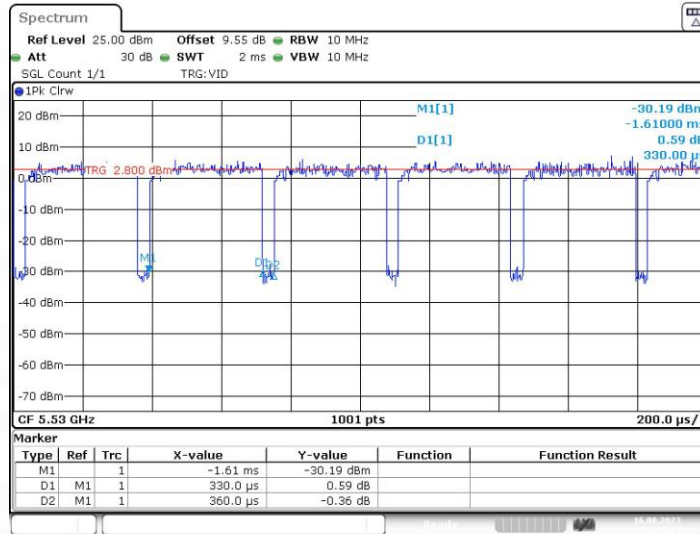


Date: 16.AUG.2023 09:43:11

11AC80SISO_Ant1_5610

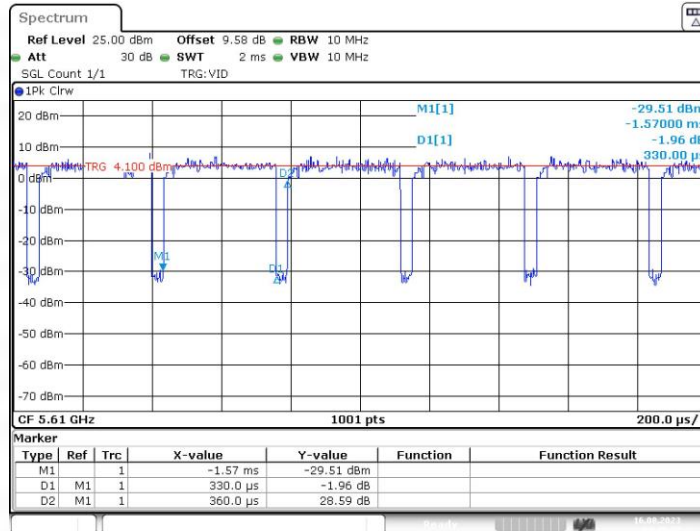


Date: 16.AUG.2023 09:49:27


11AC80SISO_Ant1_5775

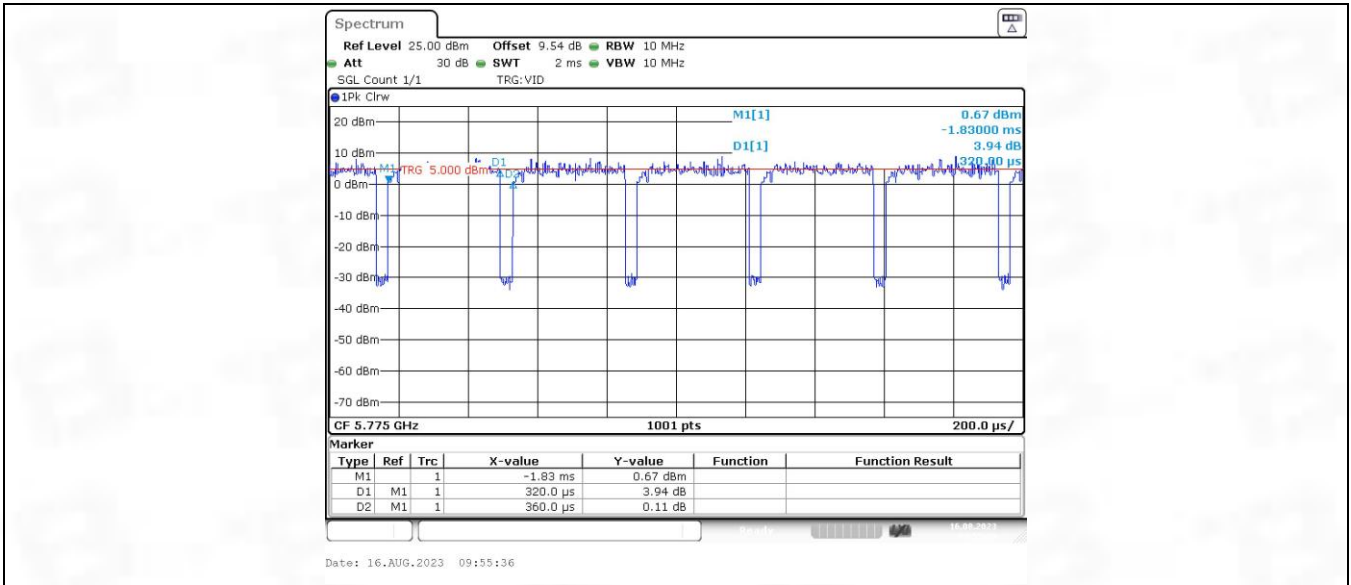

11AX20SISO_Ant1_5180

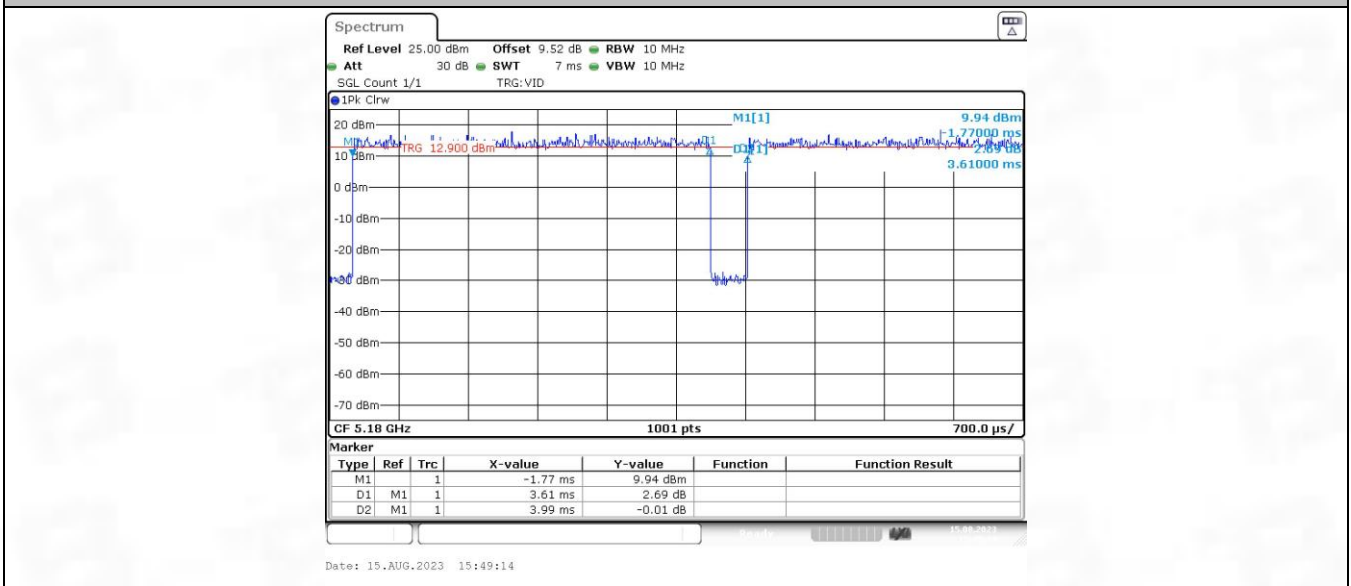


11AX20SISO_Ant1_5200

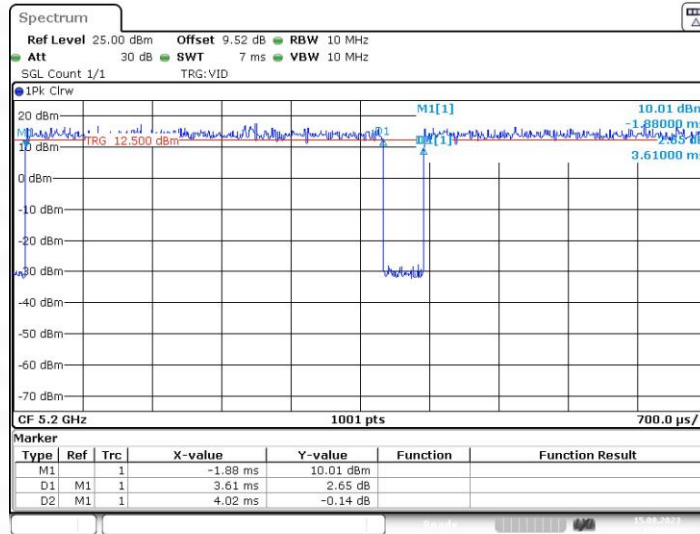


Date: 15.AUG.2023 15:55:34

11AX20SISO_Ant1_5240

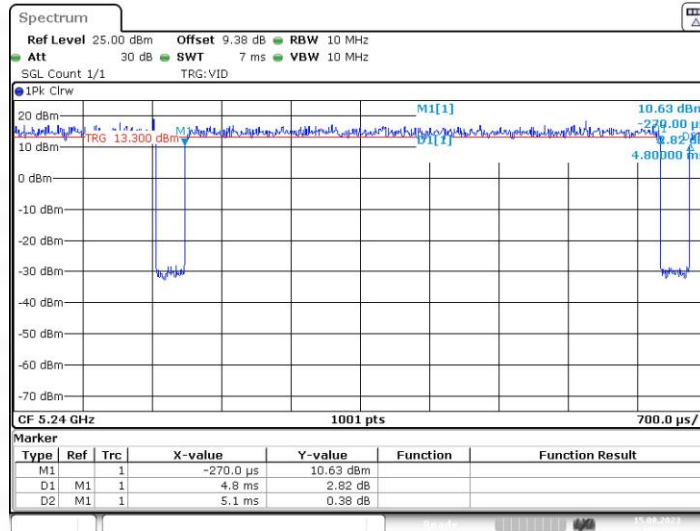


Date: 15.AUG.2023 16:00:32


11AX20SISO_Ant1_5260

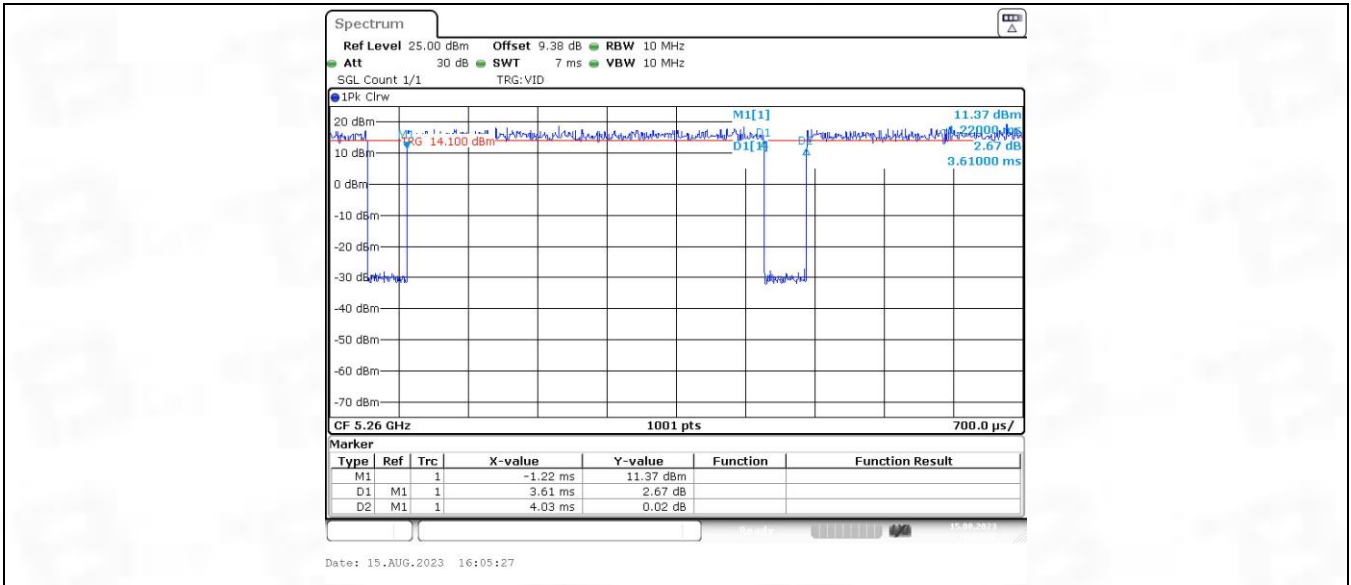


11AX20SISO_Ant1_5280

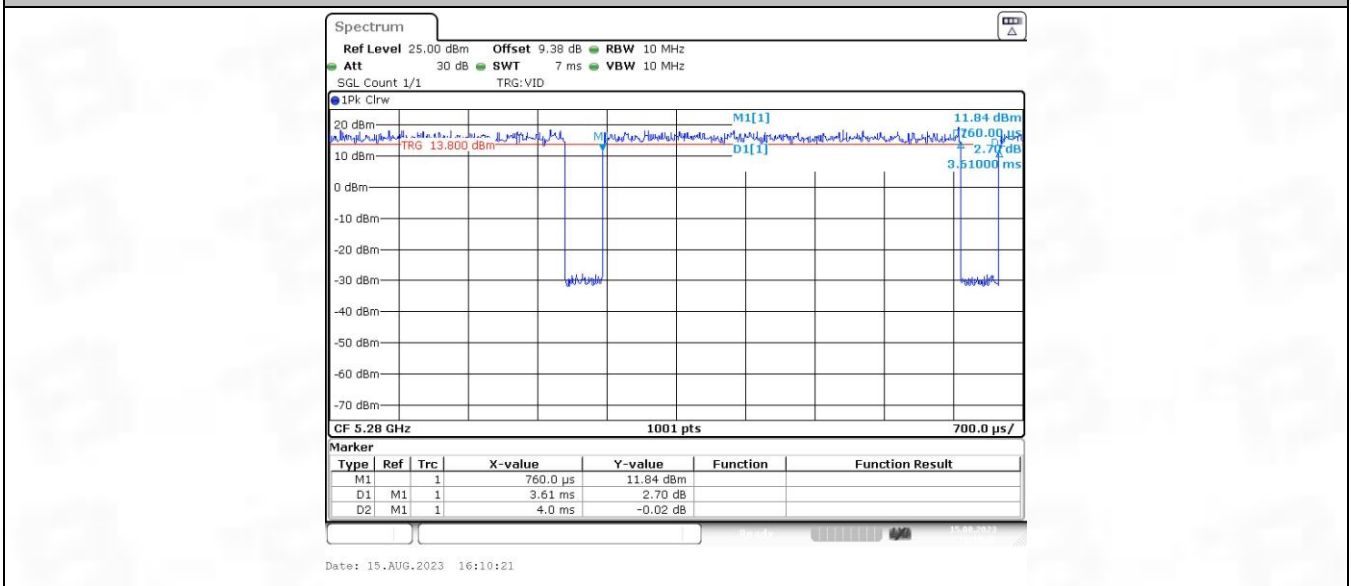


11AX20SISO_Ant1_5320

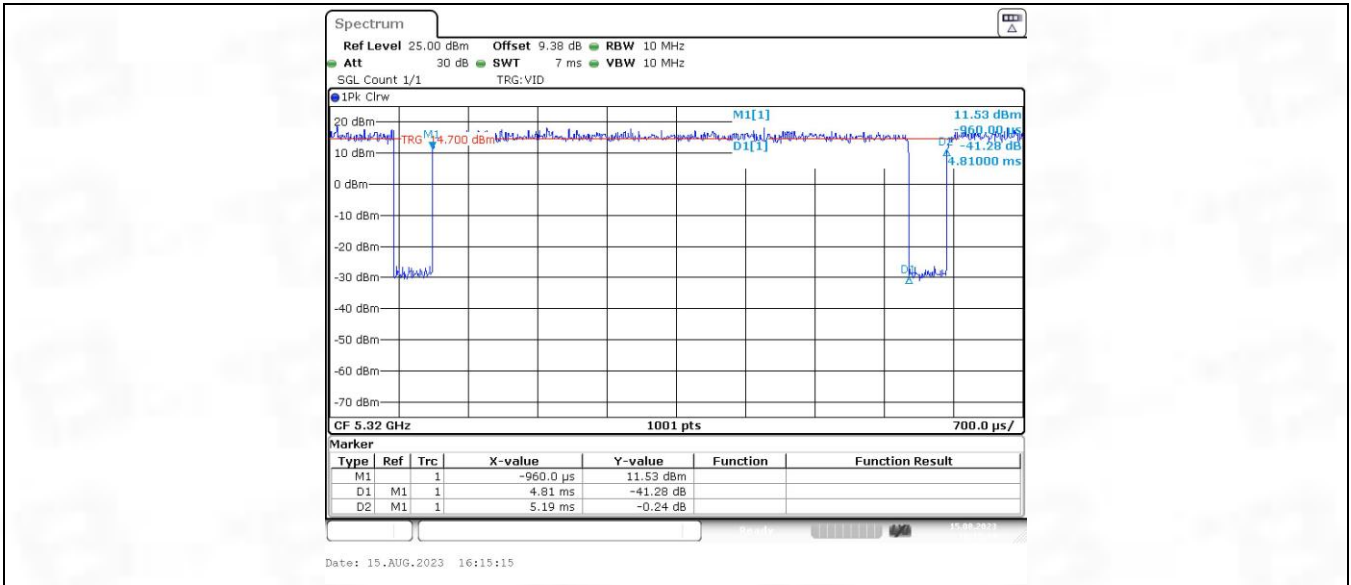


11AX20SISO_Ant1_5500

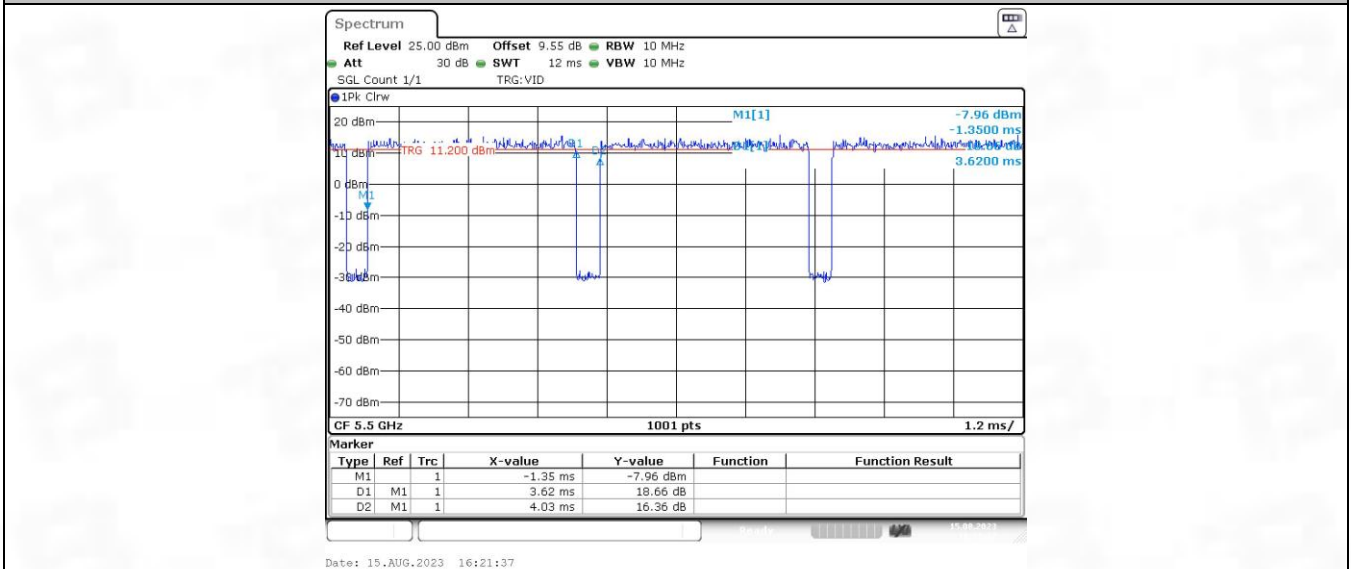


11AX20SISO_Ant1_5580

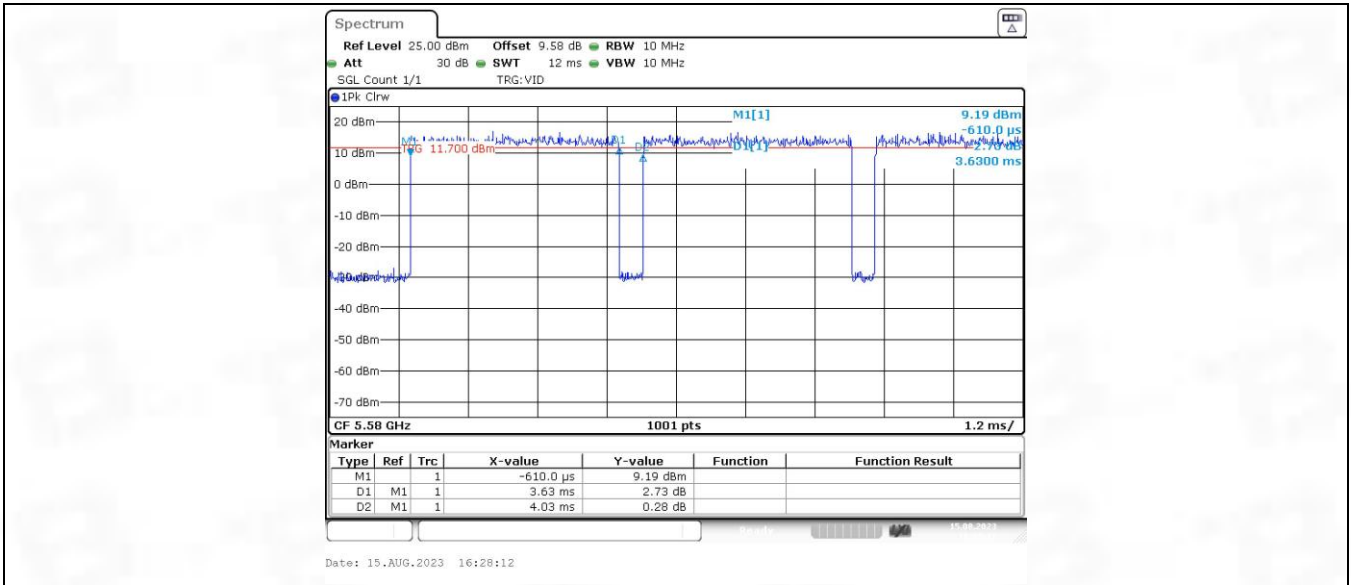


11AX20SISO_Ant1_5700

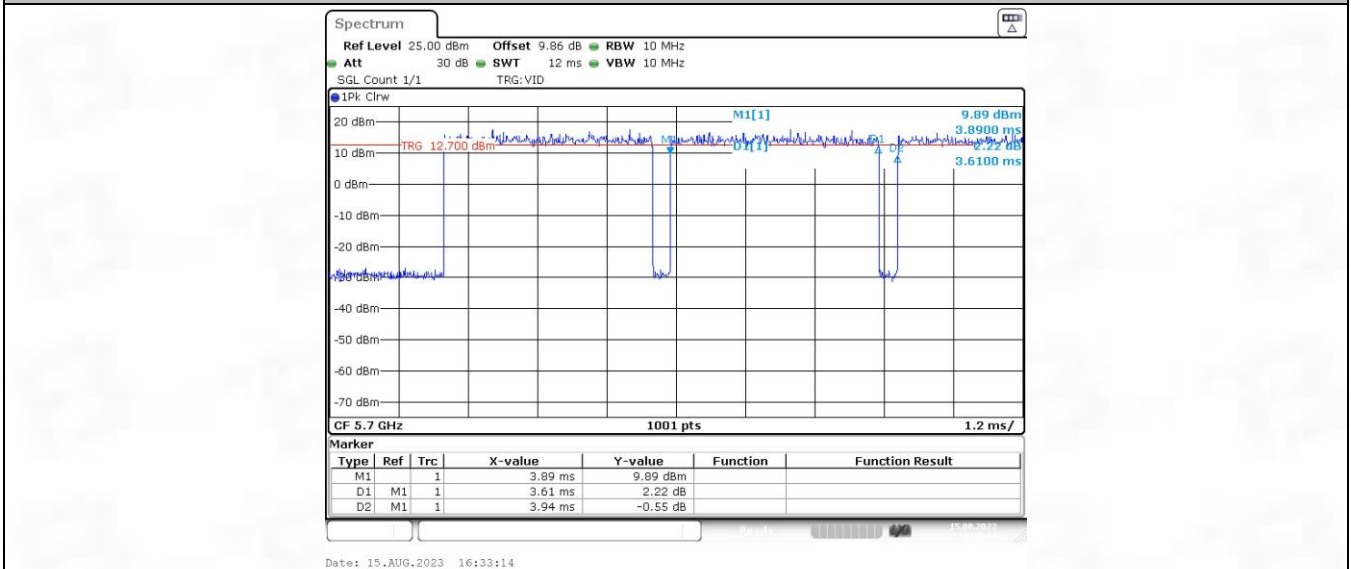

11AX20SISO_Ant1_5745

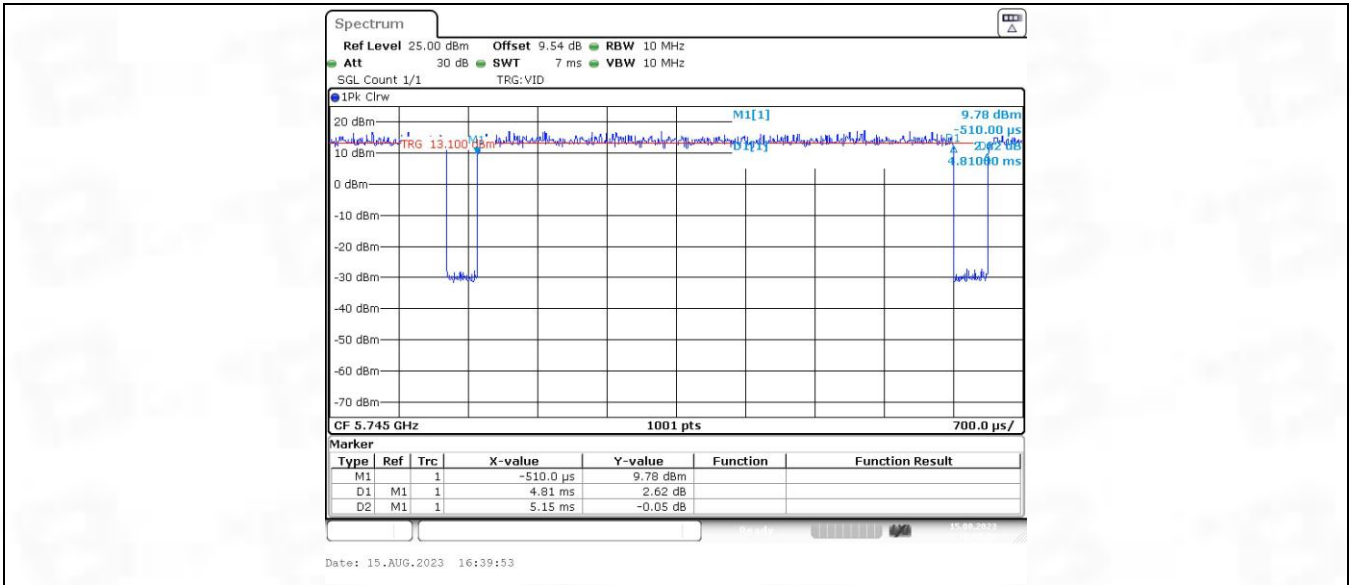

11AX20SISO_Ant1_5785

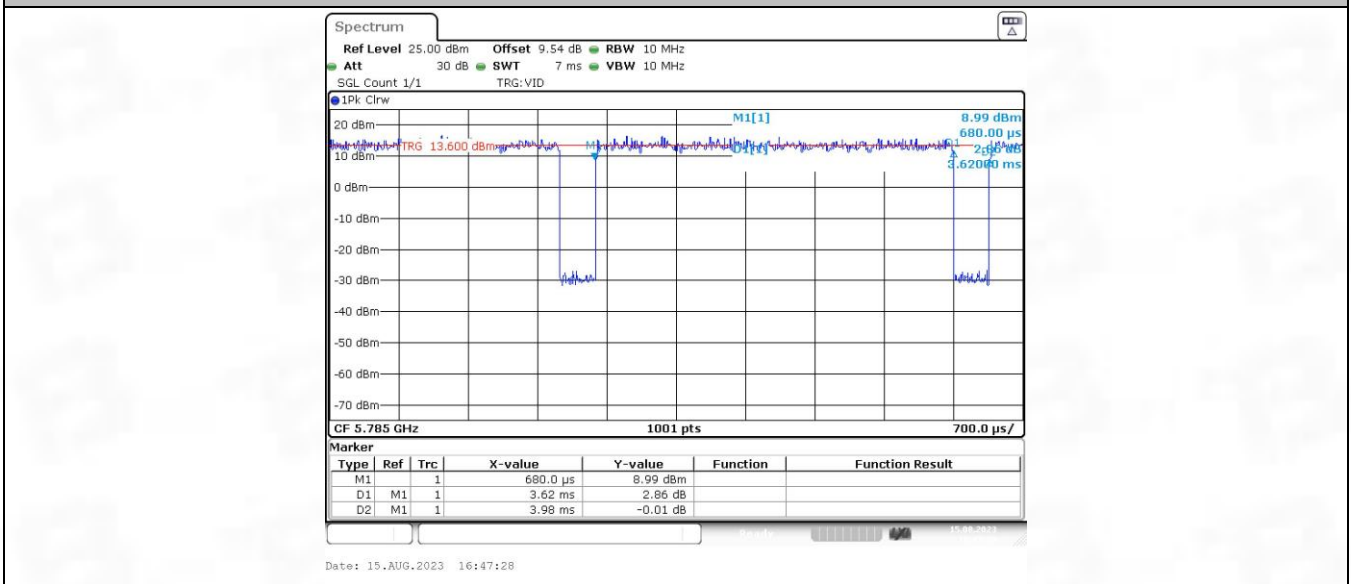

11AX20SISO_Ant1_5825