




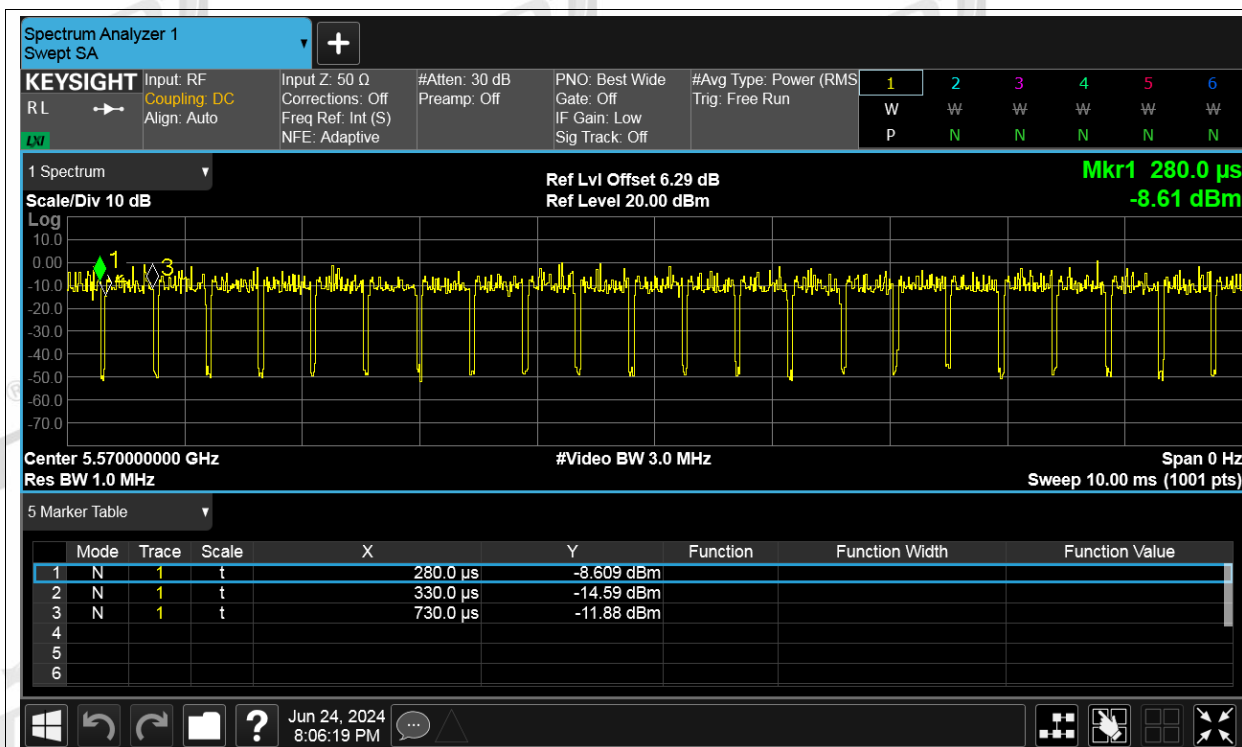


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU2 5250MHz Sum

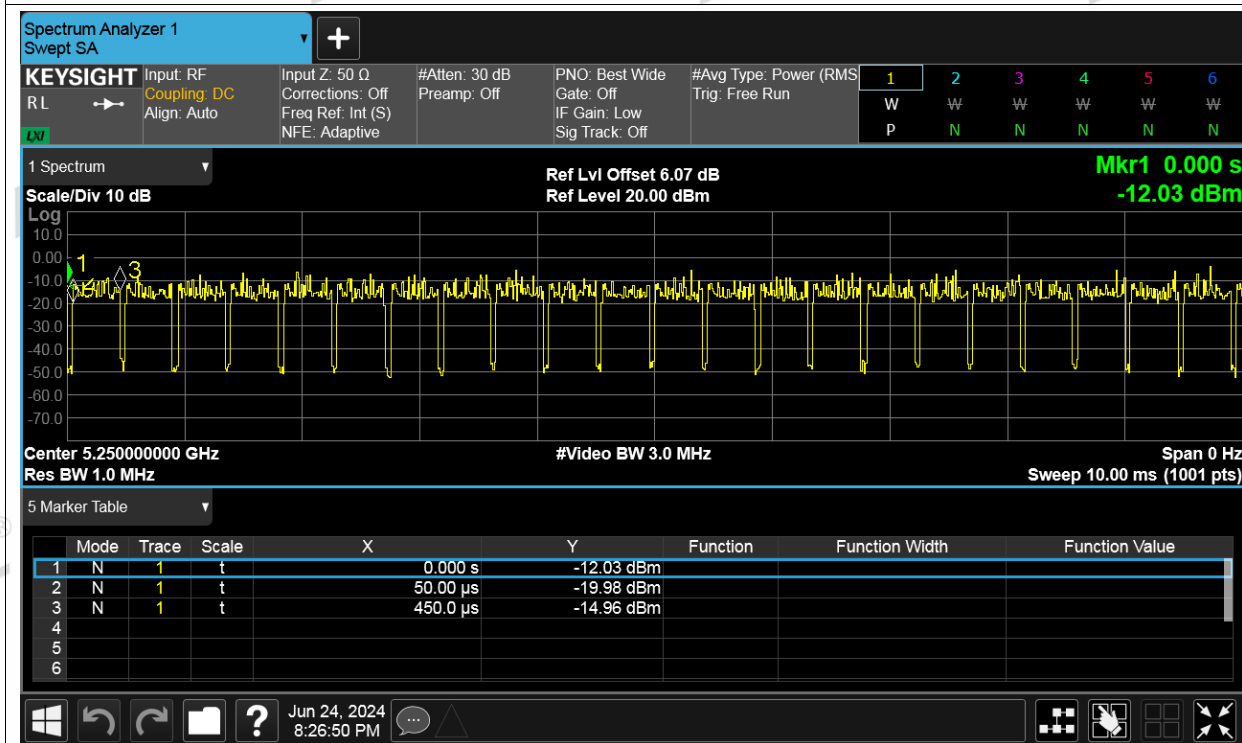


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU2 5570MHz Sum

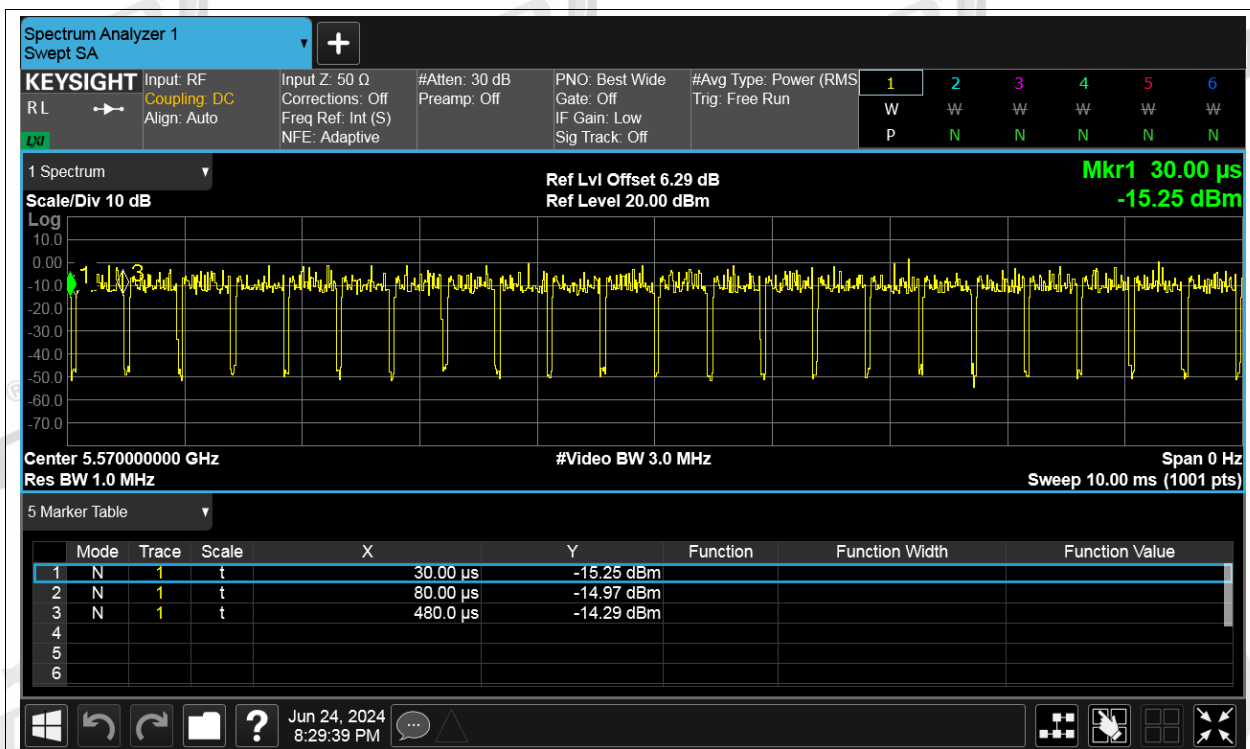


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU3 5250MHz Sum

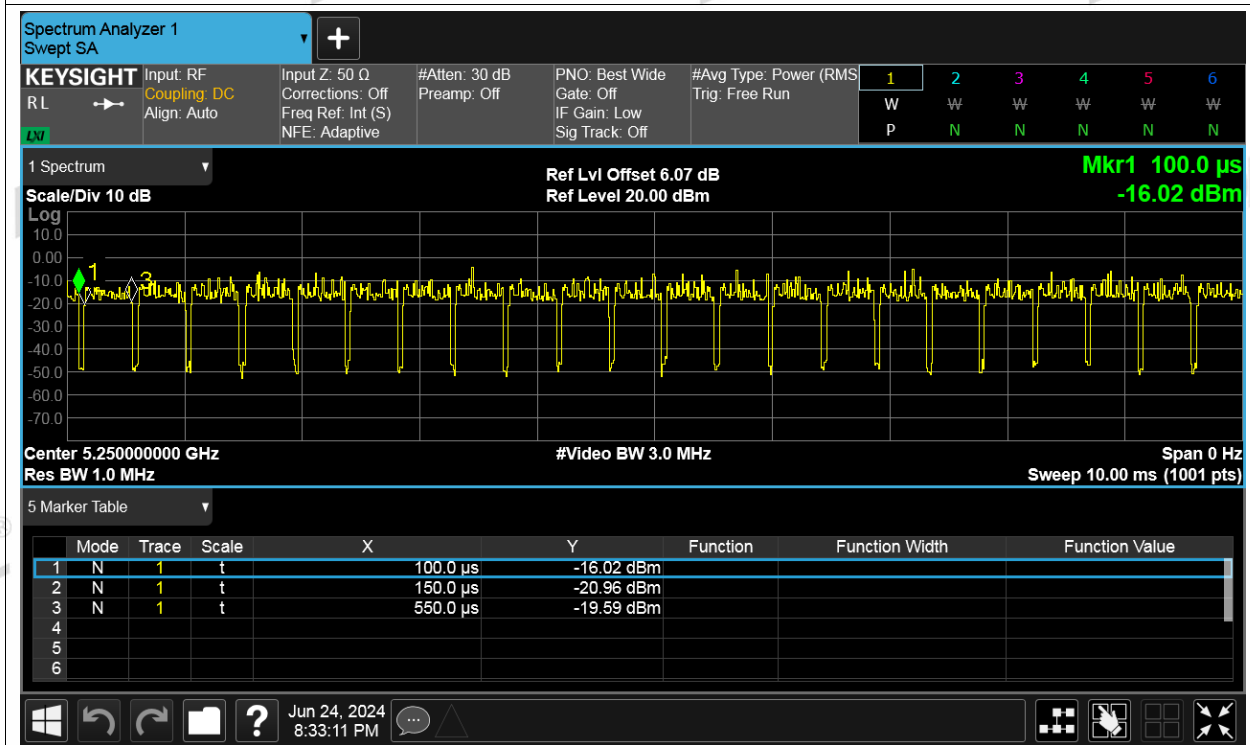


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU3 5570MHz Sum

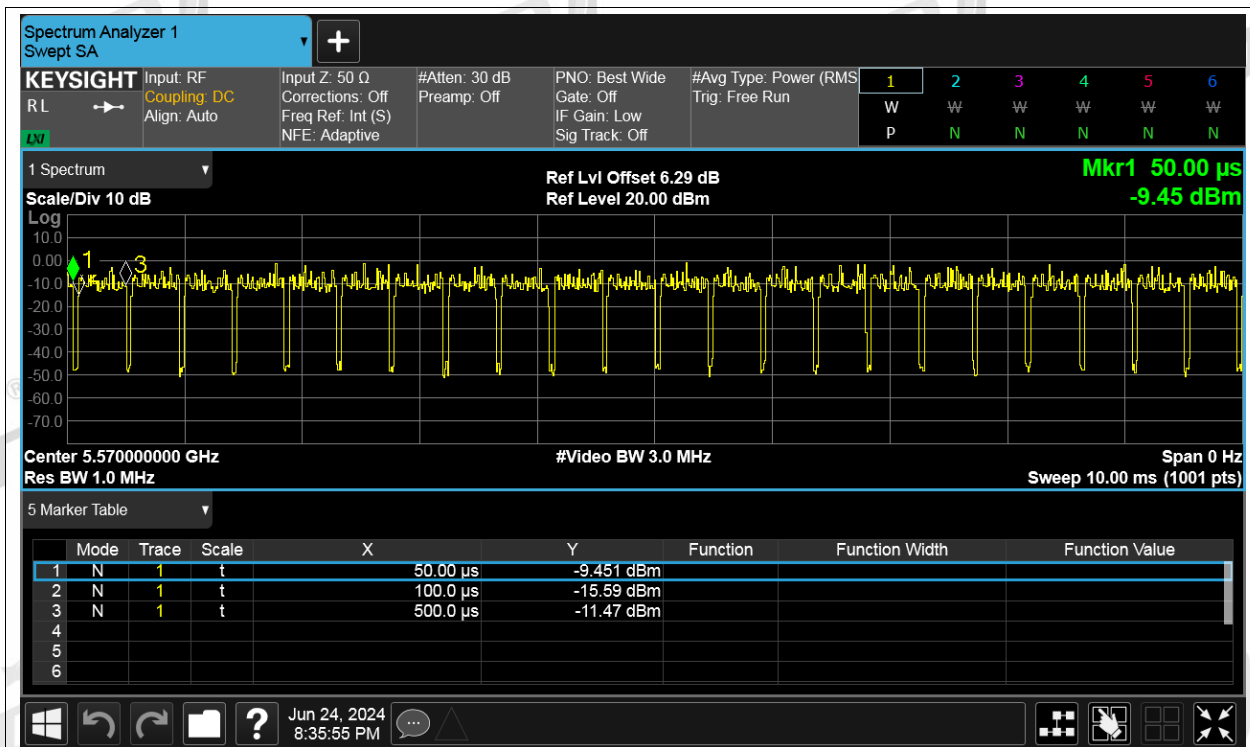

Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU4 5250MHz Sum

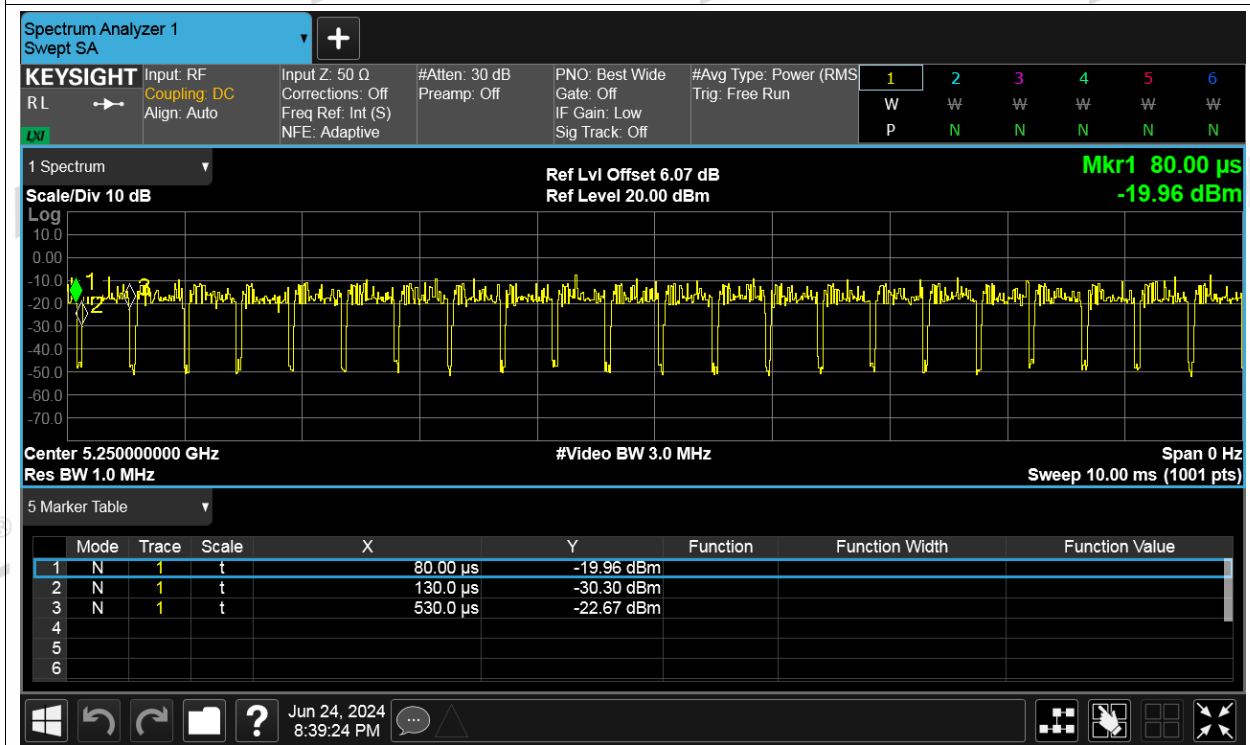


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU4 5570MHz Sum

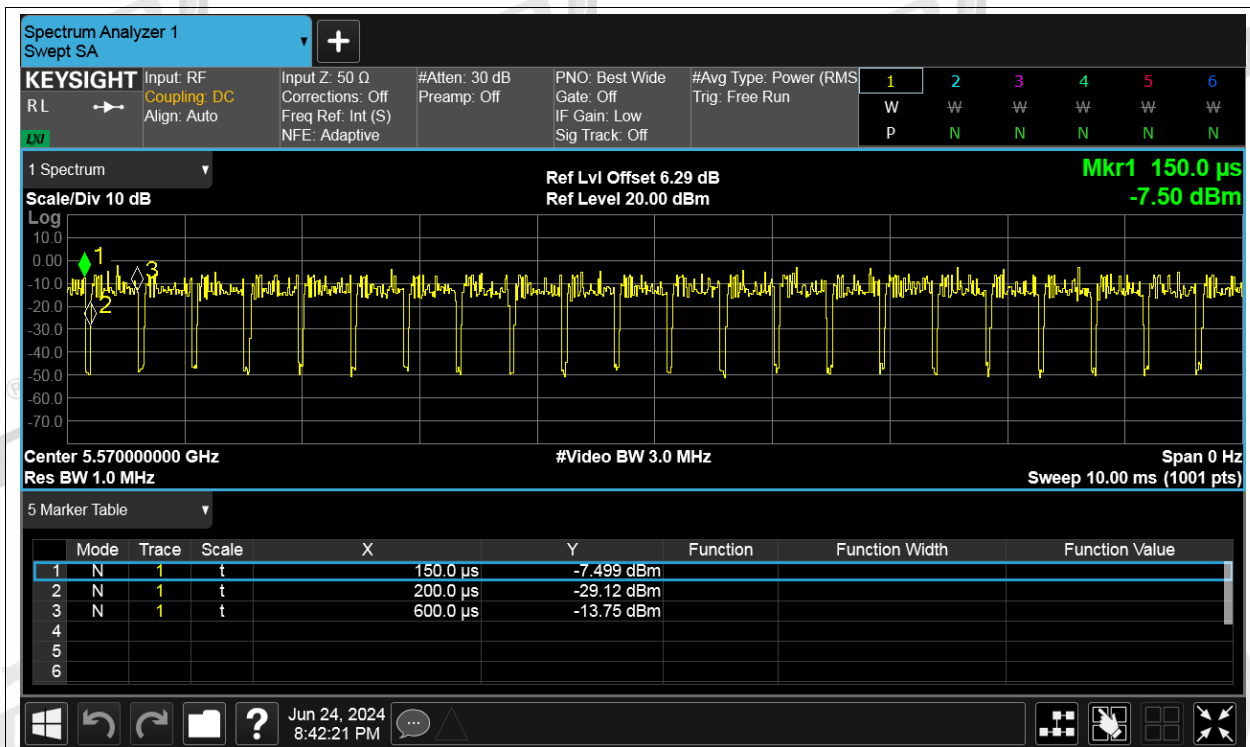


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU5 5250MHz Sum




Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU5 5570MHz Sum

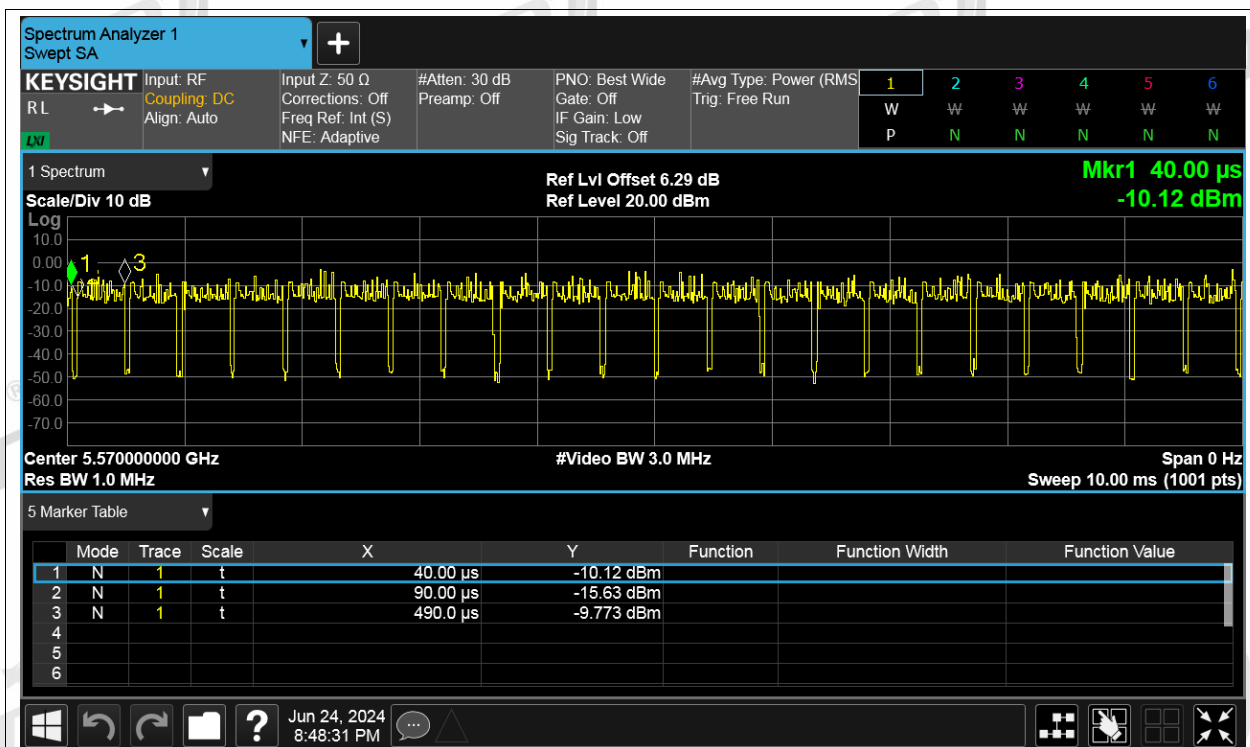


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU6 5250MHz Sum

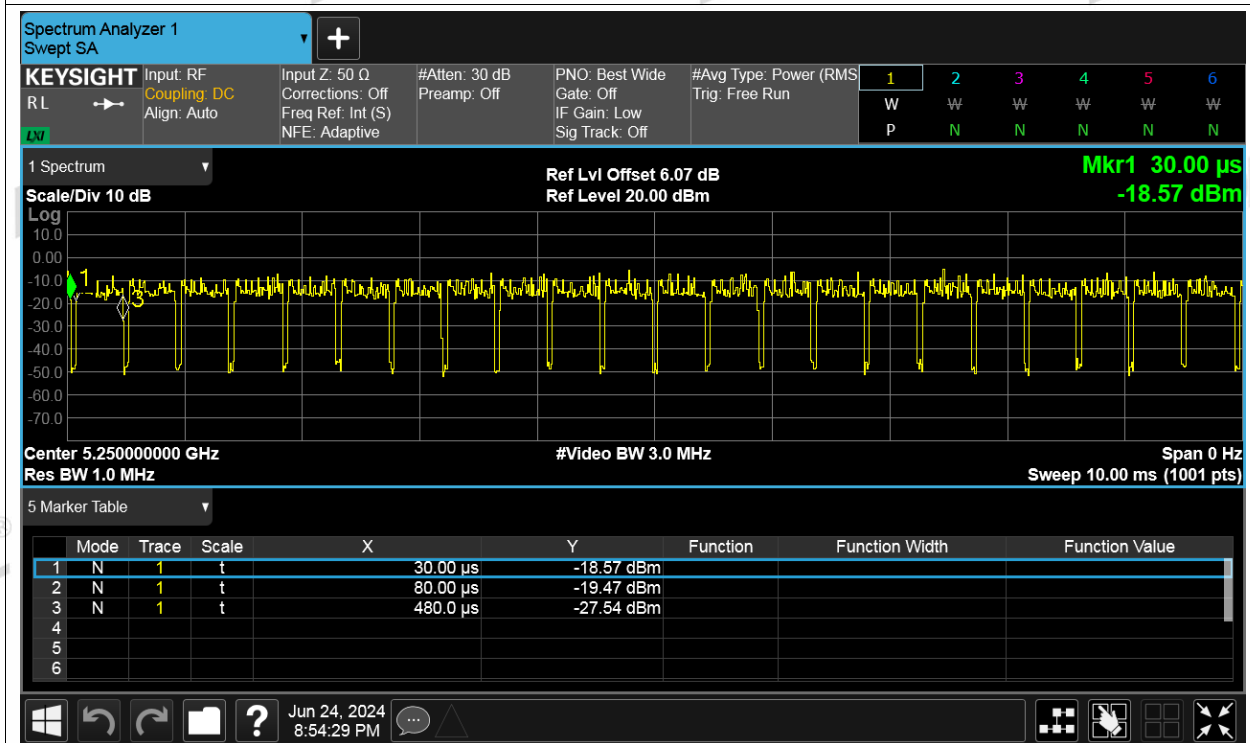


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU6 5570MHz Sum

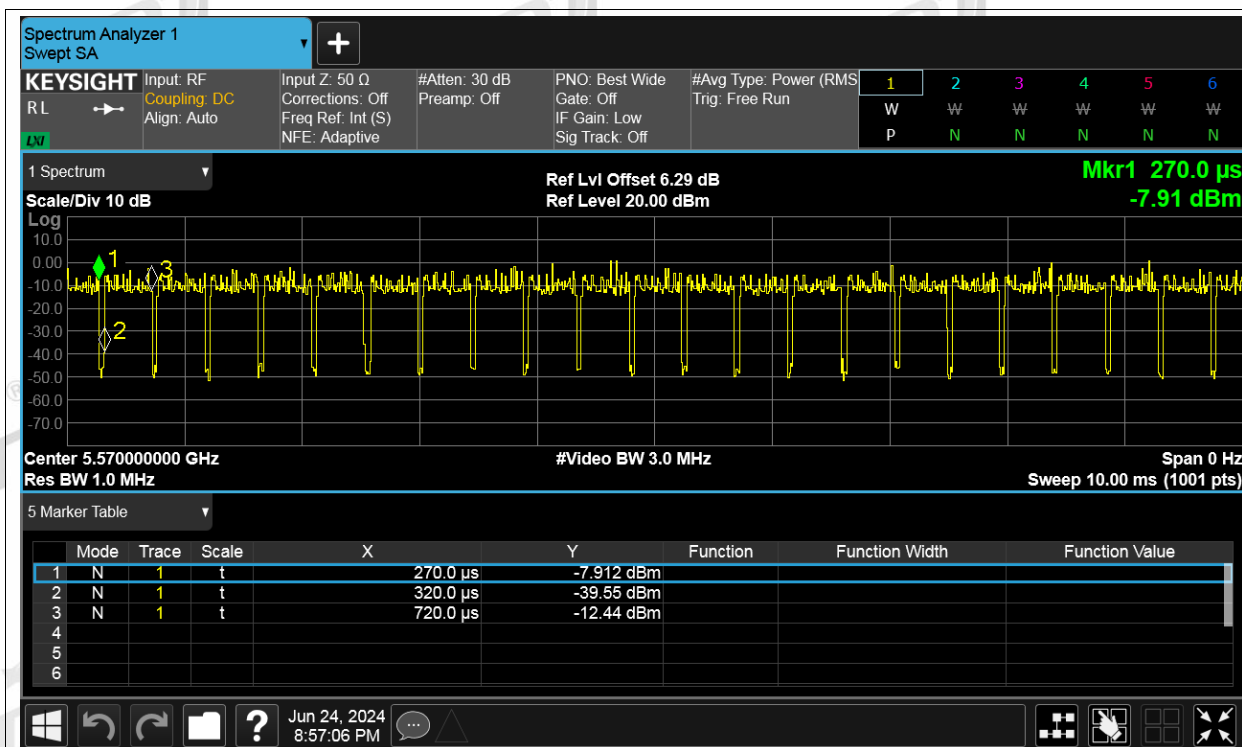


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU7 5250MHz Sum

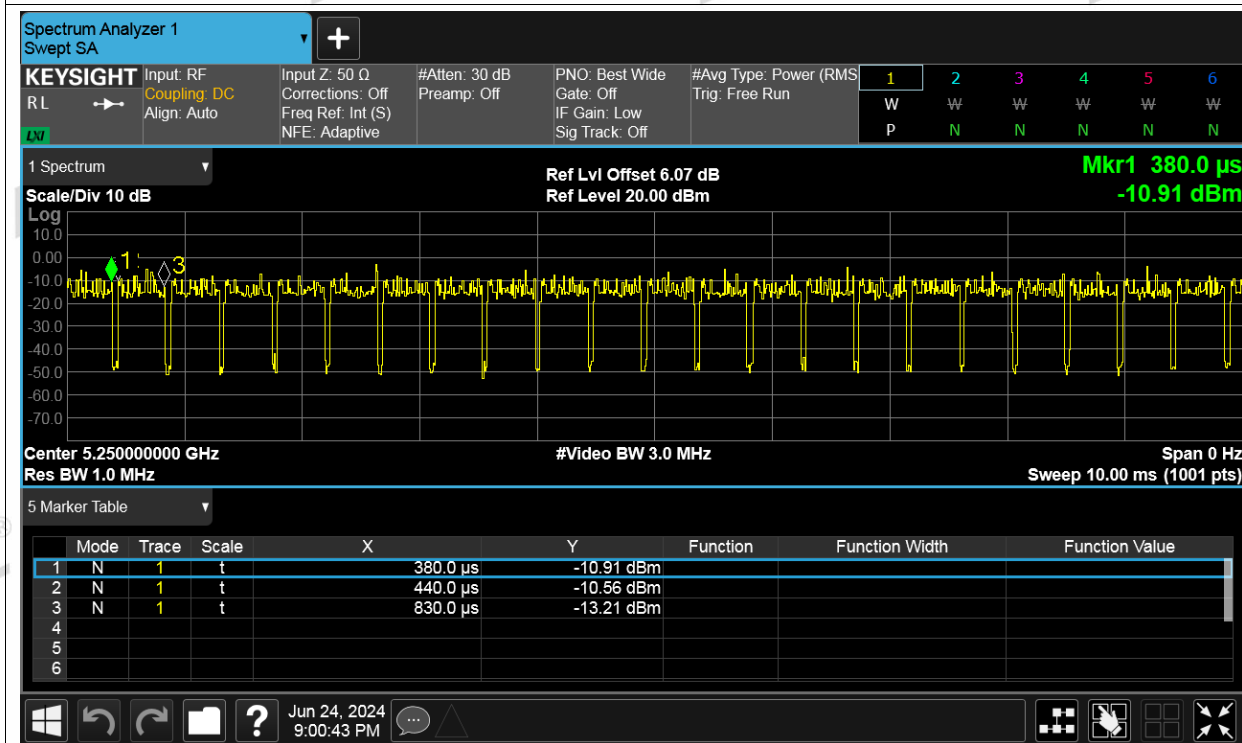


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU7 5570MHz Sum

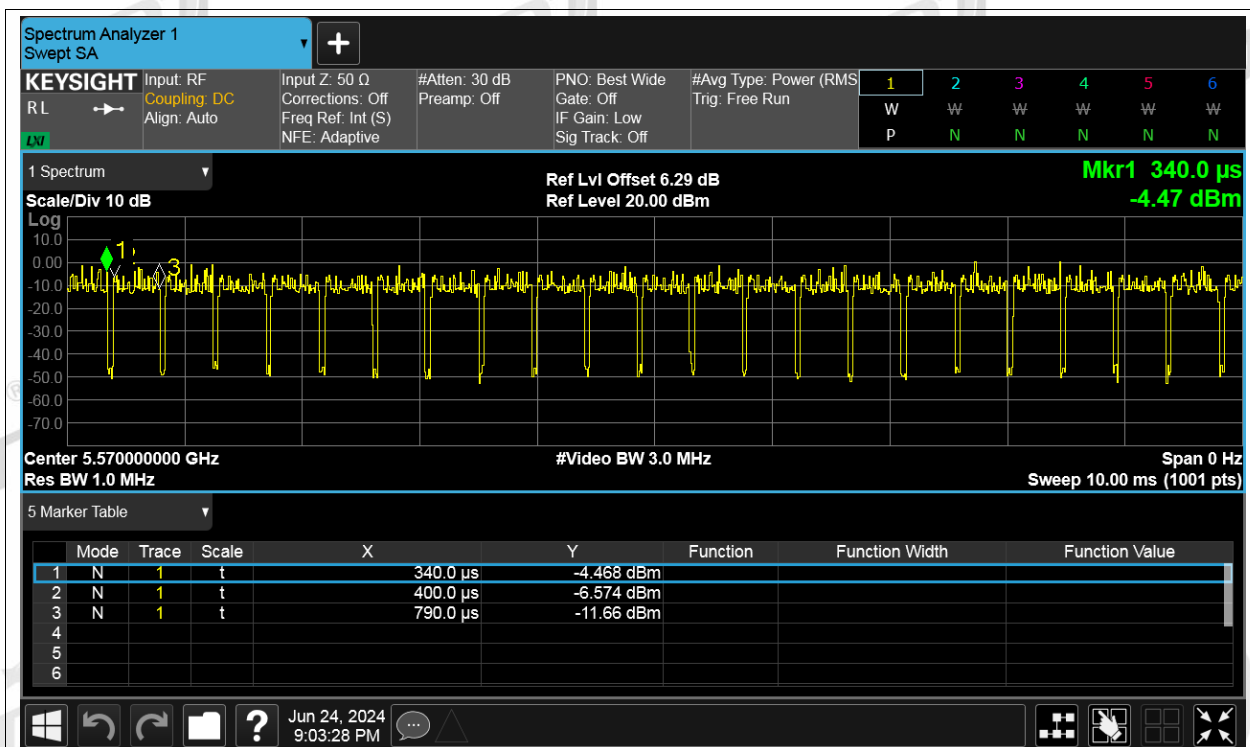

Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU8 5250MHz Sum

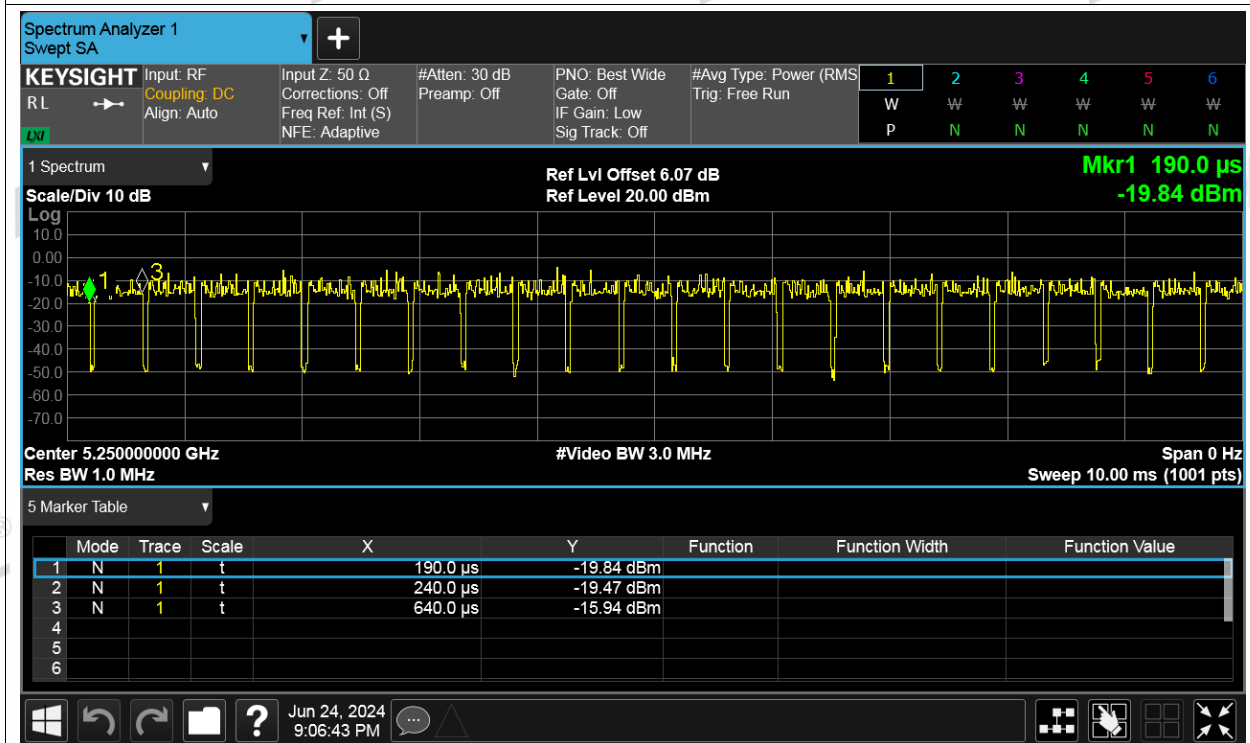


Duty Cycle NVNT be160 996+484+242-tone in a non-OFDMA MRU8 5570MHz Sum

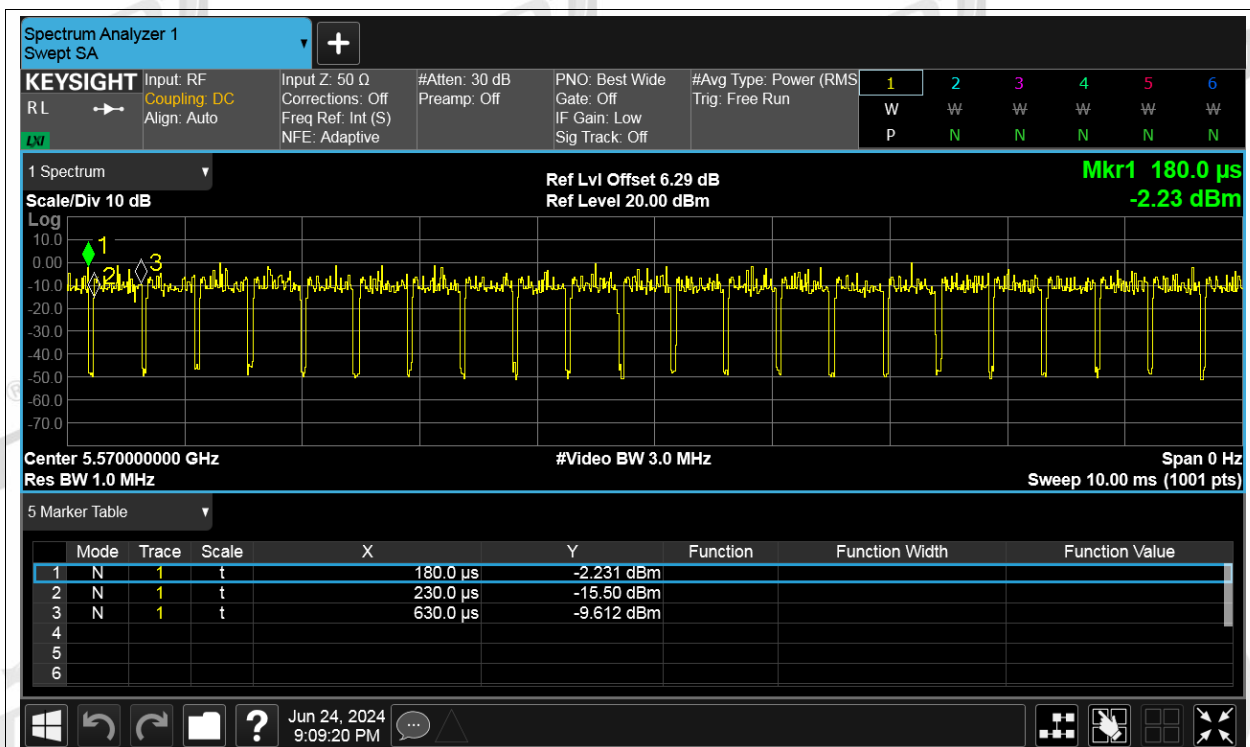


Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU1 5250MHz Sum




Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU1 5570MHz Sum

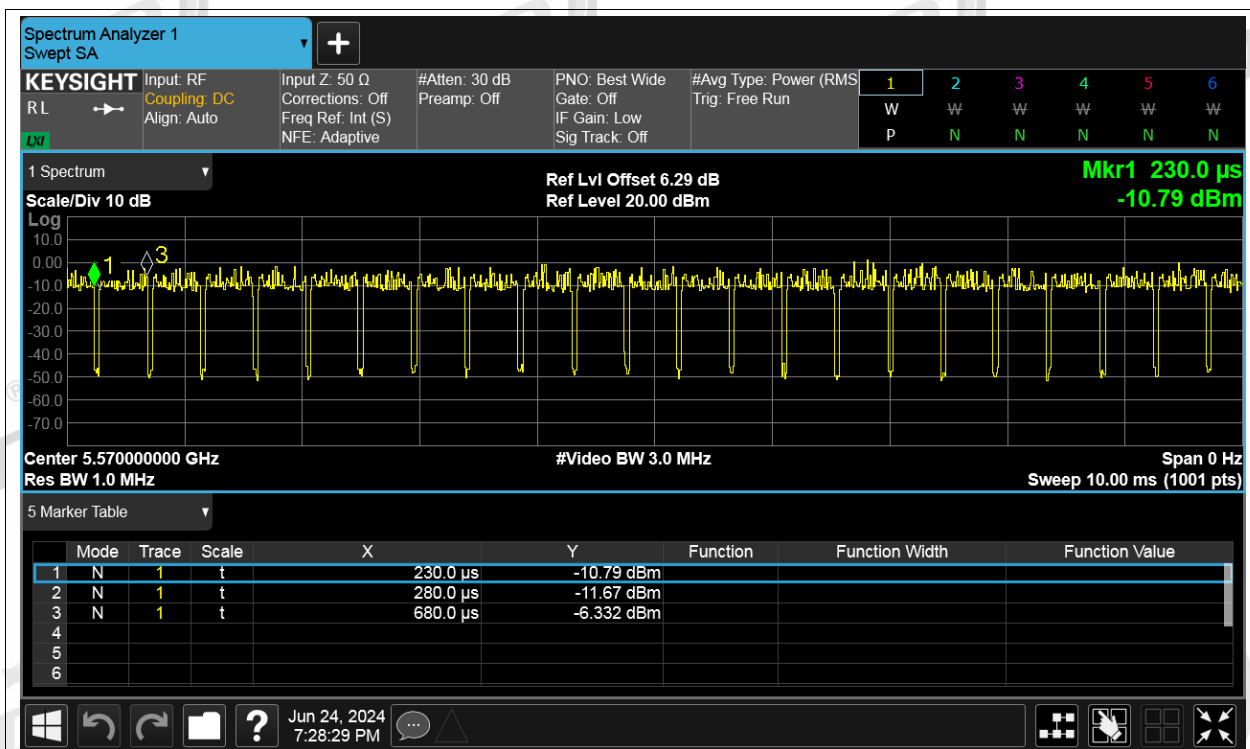


Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU2 5250MHz Sum

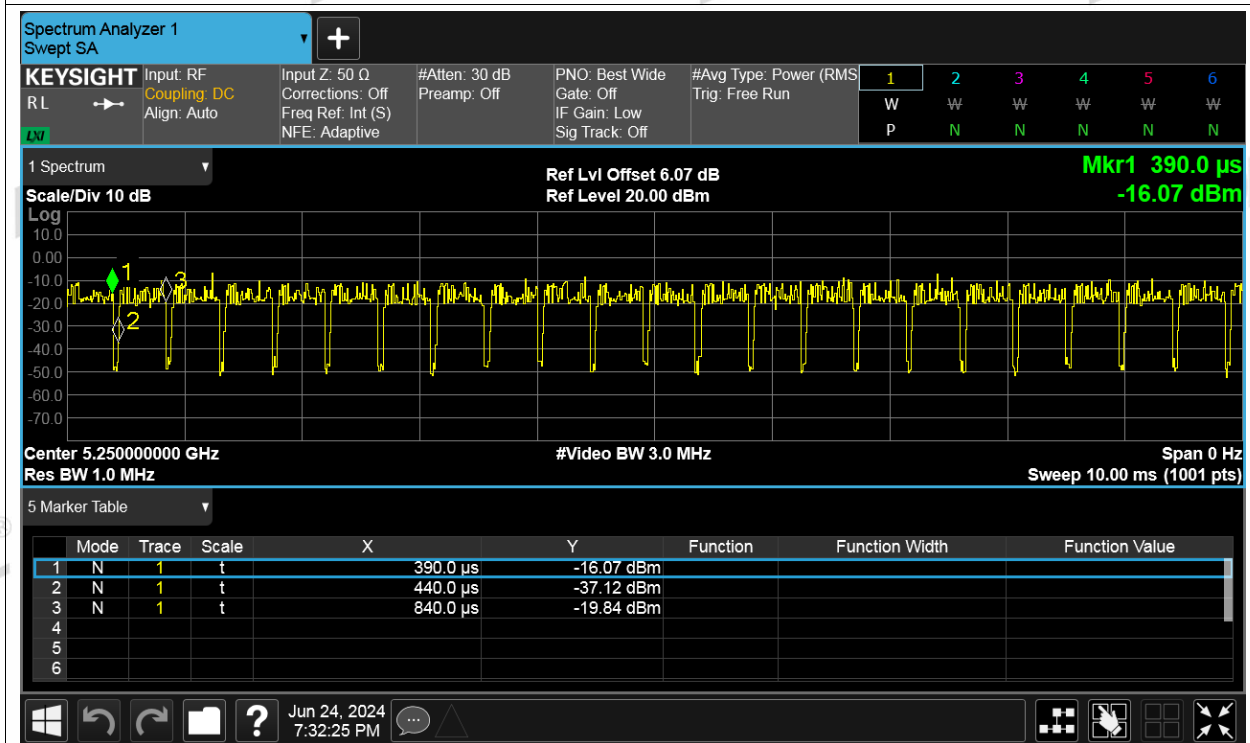


Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU2 5570MHz Sum

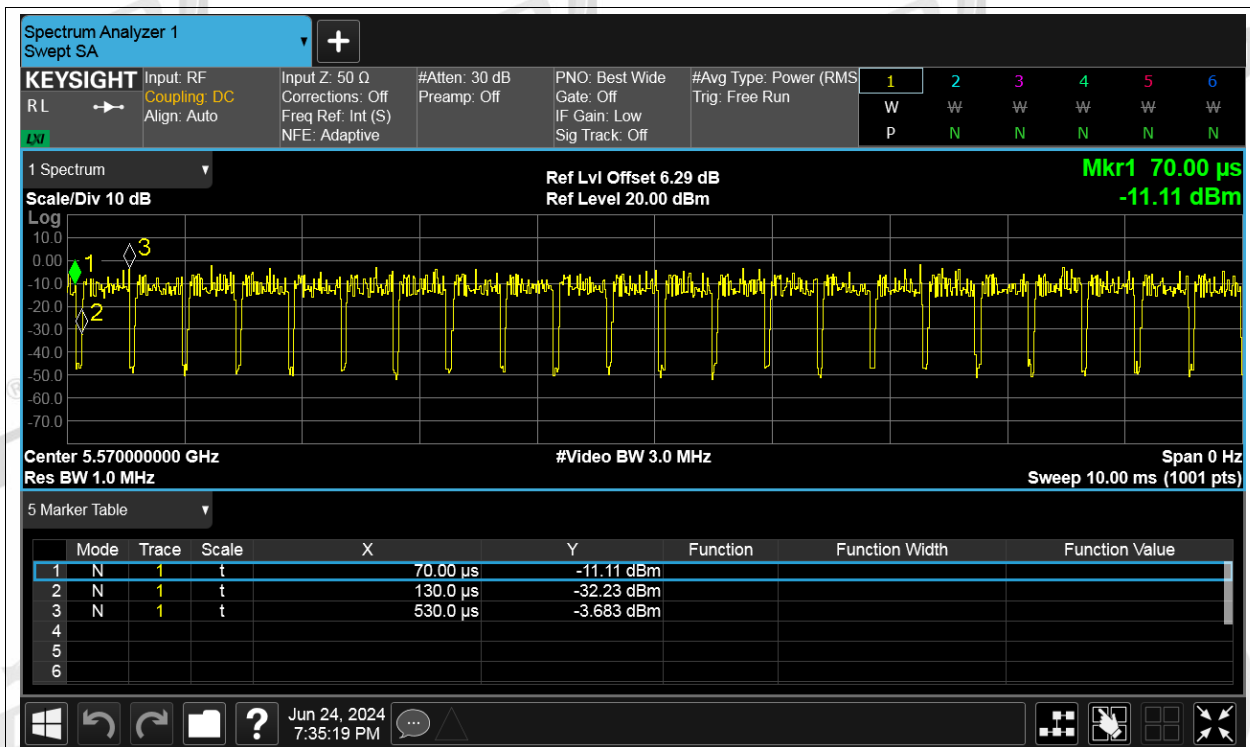


Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU3 5250MHz Sum

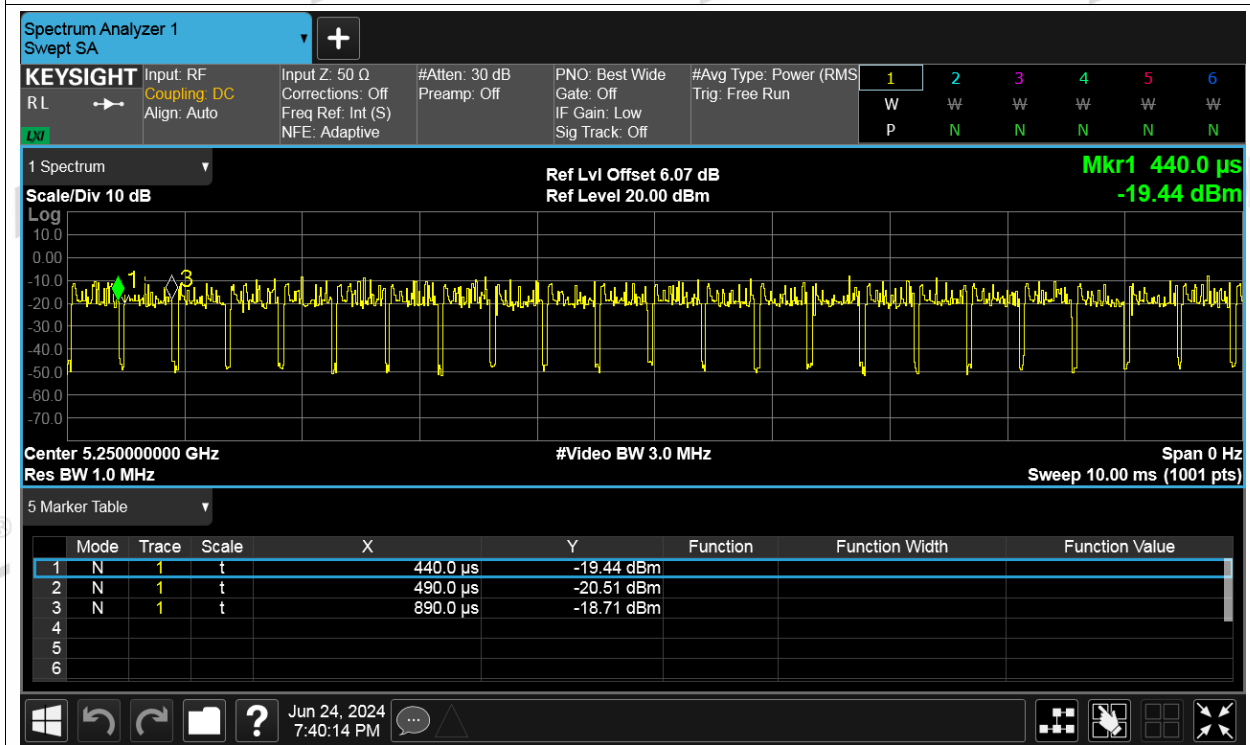


Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU3 5570MHz Sum

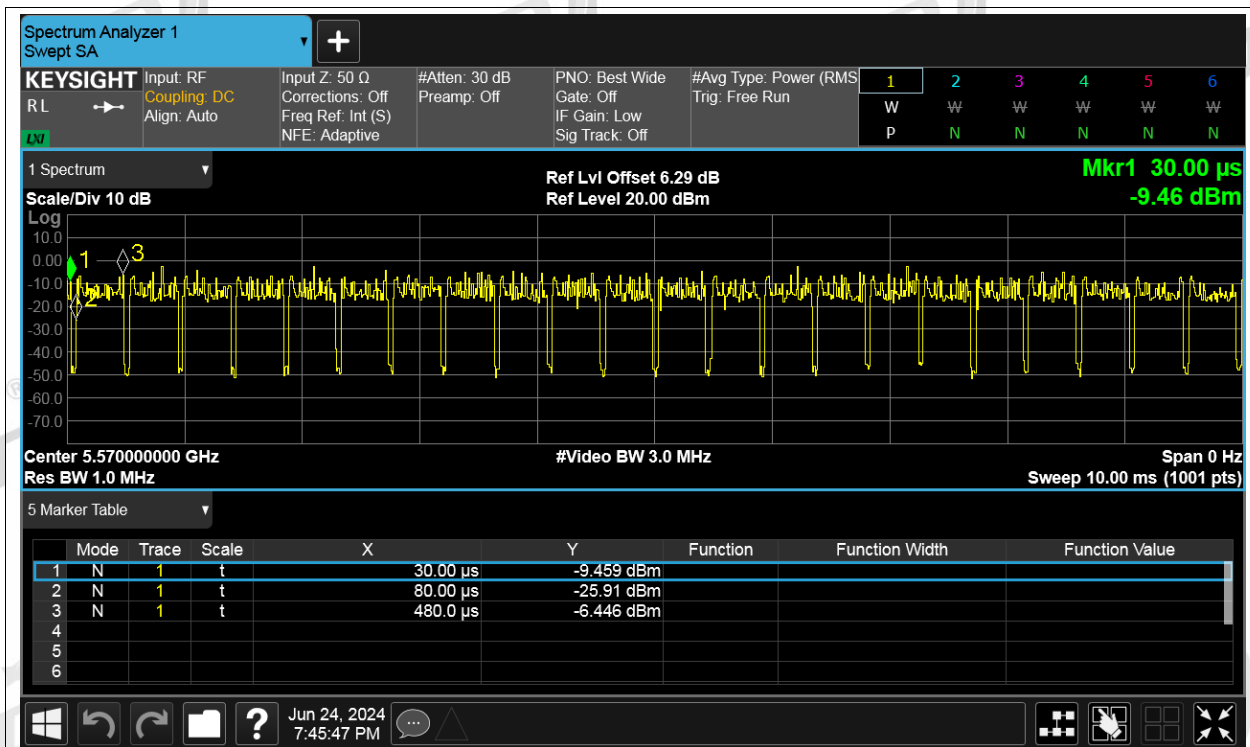

Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU4 5250MHz Sum

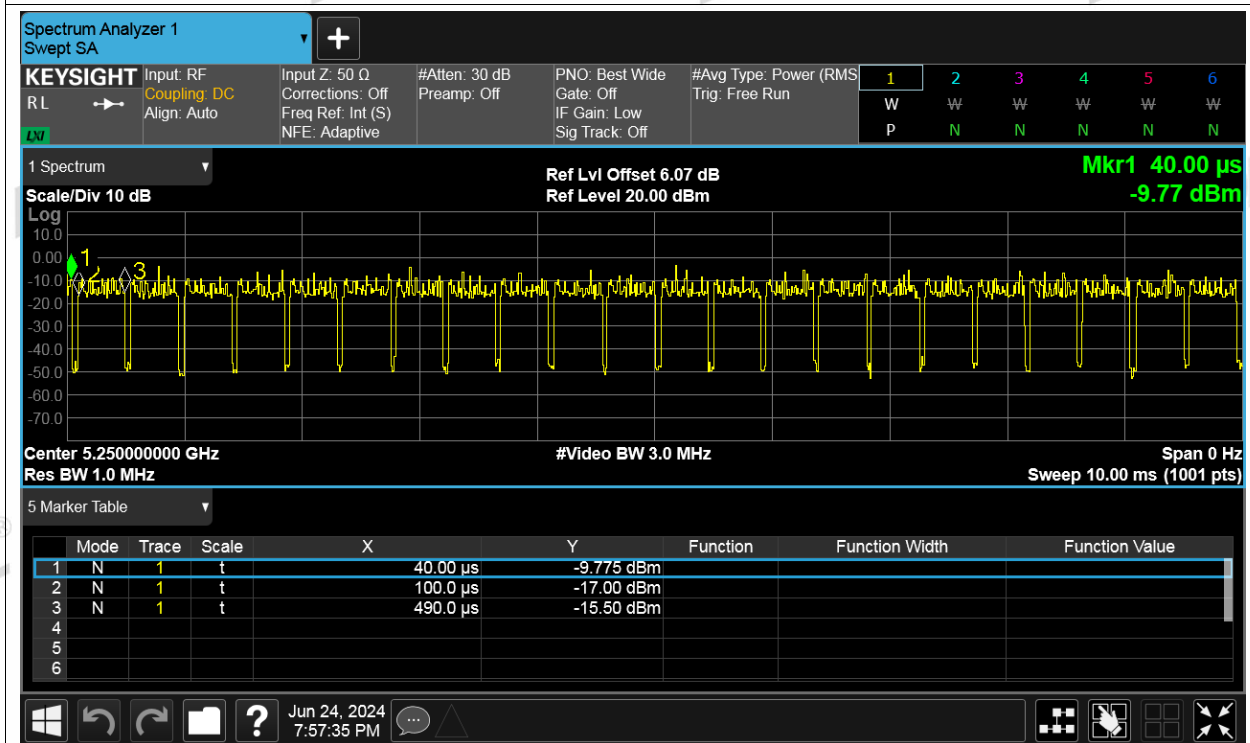

Duty Cycle NVNT be160 996+484-tone in a non-OFDMA MRU4 5570MHz Sum

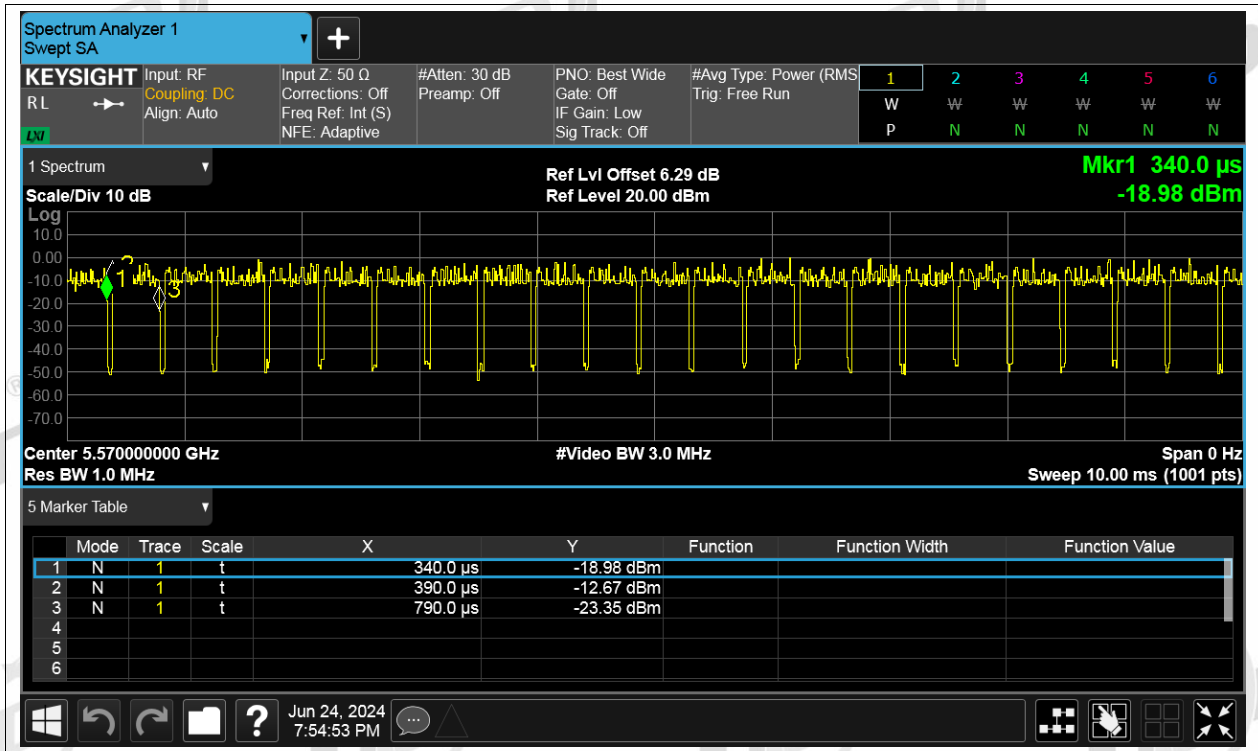

Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Power setting	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	2C	Ant1	22.78	0.12	22.9	30	Pass
NVNT	a	5200	2C	Ant1	22.85	0.13	22.98	30	Pass
NVNT	a	5240	2C	Ant1	22.53	0.14	22.67	30	Pass
NVNT	a	5260	28	Ant1	20.05	0.13	20.18	23.59	Pass
NVNT	a	5280	28	Ant1	20.04	0.13	20.17	23.59	Pass
NVNT	a	5320	2A	Ant1	20.17	0.14	20.31	23.59	Pass
NVNT	a	5500	2A	Ant1	20.57	0.14	20.71	23.59	Pass
NVNT	a	5580	26	Ant1	20.71	0.11	20.82	23.59	Pass
NVNT	a	5700	26	Ant1	20.47	0.13	20.6	23.59	Pass
NVNT	a	5745	2C	Ant1	22.85	0.13	22.98	30	Pass
NVNT	a	5785	2C	Ant1	22.19	0.13	22.32	30	Pass
NVNT	a	5825	2C	Ant1	21.64	0.14	21.78	30	Pass
NVNT	a	5180	2C	Ant2	21.99	0.14	22.13	30	Pass
NVNT	a	5200	2C	Ant2	21.8	0.14	21.94	30	Pass
NVNT	a	5240	2C	Ant2	21.14	0.13	21.27	30	Pass
NVNT	a	5260	26	Ant2	20.21	0.13	20.34	23.59	Pass
NVNT	a	5280	26	Ant2	20.01	0.13	20.14	23.59	Pass
NVNT	a	5320	28	Ant2	19.96	0.14	20.1	23.59	Pass
NVNT	a	5500	28	Ant2	20.33	0.14	20.47	23.59	Pass
NVNT	a	5580	25	Ant2	20.65	0.14	20.79	23.59	Pass
NVNT	a	5700	25	Ant2	20.67	0.12	20.79	23.59	Pass
NVNT	a	5745	2C	Ant2	24.25	0.13	24.38	30	Pass
NVNT	a	5785	2C	Ant2	23.59	0.13	23.72	30	Pass
NVNT	a	5825	2C	Ant2	22.14	0.14	22.28	30	Pass
NVNT	a	5180	2C	Ant3	24.37	0.14	24.51	30	Pass
NVNT	a	5200	2C	Ant3	24.13	0.14	24.27	30	Pass
NVNT	a	5240	2C	Ant3	24.14	0.12	24.26	30	Pass
NVNT	a	5260	24	Ant3	20.35	0.14	20.49	23.60	Pass
NVNT	a	5280	24	Ant3	20	0.13	20.13	23.60	Pass
NVNT	a	5320	25	Ant3	20.13	0.14	20.27	23.60	Pass
NVNT	a	5500	25	Ant3	19.72	0.14	19.86	23.60	Pass
NVNT	a	5580	24	Ant3	20.7	0.14	20.84	23.60	Pass
NVNT	a	5700	21	Ant3	20.07	0.14	20.21	23.60	Pass
NVNT	a	5745	2C	Ant3	25.54	0.14	25.68	30	Pass
NVNT	a	5785	2C	Ant3	25.46	0.14	25.6	30	Pass
NVNT	a	5825	2C	Ant3	24.22	0.14	24.36	30	Pass
NVNT	ac160	5250	18	Ant1	10.13	1.66	11.79	24	Pass

NVNT	ac160	5250	18	Ant2	7.94	1.66	9.6	24	Pass
NVNT	ac160	5250	18	Ant3	11.49	1.66	13.15	24	Pass
NVNT	ac160	5250	18	Sum	14.86	1.66	16.52	24	Pass
NVNT	ac160	5570	23	Ant1	15.62	1.52	17.14	24	Pass
NVNT	ac160	5570	23	Ant2	16.36	1.52	17.88	24	Pass
NVNT	ac160	5570	23	Ant3	17.68	1.52	19.2	24	Pass
NVNT	ac160	5570	23	Sum	21.41	1.52	22.93	24	Pass
NVNT	ac20	5180	23	Ant1	18.46	0.38	18.84	30	Pass
NVNT	ac20	5180	23	Ant2	17.3	0.38	17.68	30	Pass
NVNT	ac20	5180	23	Ant3	19.73	0.38	20.11	30	Pass
NVNT	ac20	5180	23	Sum	23.38	0.38	23.76	30	Pass
NVNT	ac20	5200	23	Ant1	18.38	0.37	18.75	30	Pass
NVNT	ac20	5200	23	Ant2	17.15	0.37	17.52	30	Pass
NVNT	ac20	5200	23	Ant3	19.59	0.37	19.96	30	Pass
NVNT	ac20	5200	23	Sum	23.26	0.37	23.63	30	Pass
NVNT	ac20	5240	23	Ant1	17.98	0.38	18.36	30	Pass
NVNT	ac20	5240	23	Ant2	16.37	0.38	16.75	30	Pass
NVNT	ac20	5240	23	Ant3	19.59	0.38	19.97	30	Pass
NVNT	ac20	5240	23	Sum	22.95	0.38	23.33	30	Pass
NVNT	ac20	5260	15	Ant1	10.23	0.39	10.62	23.76	Pass
NVNT	ac20	5260	15	Ant2	11.17	0.39	11.56	23.76	Pass
NVNT	ac20	5260	15	Ant3	12.75	0.39	13.14	23.76	Pass
NVNT	ac20	5260	15	Sum	16.28	0.39	16.67	23.76	Pass
NVNT	ac20	5280	15	Ant1	10.15	0.37	10.52	23.76	Pass
NVNT	ac20	5280	15	Ant2	10.95	0.37	11.32	23.76	Pass
NVNT	ac20	5280	15	Ant3	12.47	0.37	12.84	23.76	Pass
NVNT	ac20	5280	15	Sum	16.07	0.37	16.44	23.76	Pass
NVNT	ac20	5320	15	Ant1	9.4	0.36	9.76	23.76	Pass
NVNT	ac20	5320	15	Ant2	10.01	0.36	10.37	23.76	Pass
NVNT	ac20	5320	15	Ant3	12.1	0.36	12.46	23.76	Pass
NVNT	ac20	5320	15	Sum	15.43	0.36	15.79	23.76	Pass
NVNT	ac20	5500	15	Ant1	10.17	0.37	10.54	23.76	Pass
NVNT	ac20	5500	15	Ant2	10.51	0.37	10.88	23.76	Pass
NVNT	ac20	5500	15	Ant3	11.98	0.37	12.35	23.76	Pass
NVNT	ac20	5500	15	Sum	15.73	0.37	16.1	23.76	Pass
NVNT	ac20	5580	13	Ant1	10.76	0.37	11.13	23.76	Pass
NVNT	ac20	5580	13	Ant2	11.03	0.37	11.4	23.76	Pass
NVNT	ac20	5580	13	Ant3	12.19	0.37	12.56	23.76	Pass
NVNT	ac20	5580	13	Sum	16.14	0.37	16.51	23.76	Pass
NVNT	ac20	5700	13	Ant1	10.37	0.35	10.72	23.76	Pass
NVNT	ac20	5700	13	Ant2	10.76	0.35	11.11	23.76	Pass
NVNT	ac20	5700	13	Ant3	12.8	0.35	13.15	23.76	Pass

NVNT	ac20	5700	13	Sum	16.22	0.35	16.57	23.76	Pass
NVNT	ac20	5745	2C	Ant1	22.37	0.36	22.73	30	Pass
NVNT	ac20	5745	2C	Ant2	23.96	0.36	24.32	30	Pass
NVNT	ac20	5745	2C	Ant3	25.32	0.36	25.68	30	Pass
NVNT	ac20	5745	2C	Sum	28.82	0.36	29.18	30	Pass
NVNT	ac20	5785	2C	Ant1	21.89	0.36	22.25	30	Pass
NVNT	ac20	5785	2C	Ant2	23.37	0.36	23.73	30	Pass
NVNT	ac20	5785	2C	Ant3	25.22	0.36	25.58	30	Pass
NVNT	ac20	5785	2C	Sum	28.48	0.36	28.84	30	Pass
NVNT	ac20	5825	2C	Ant1	21.32	0.37	21.69	30	Pass
NVNT	ac20	5825	2C	Ant2	22.23	0.37	22.6	30	Pass
NVNT	ac20	5825	2C	Ant3	24.2	0.37	24.57	30	Pass
NVNT	ac20	5825	2C	Sum	27.53	0.37	27.9	30	Pass
NVNT	ac40	5190	26	Ant1	19.98	0.64	20.62	30	Pass
NVNT	ac40	5190	26	Ant2	18.93	0.64	19.57	30	Pass
NVNT	ac40	5190	26	Ant3	21.5	0.64	22.14	30	Pass
NVNT	ac40	5190	26	Sum	25.04	0.64	25.68	30	Pass
NVNT	ac40	5230	26	Ant1	19.64	0.64	20.28	30	Pass
NVNT	ac40	5230	26	Ant2	17.98	0.64	18.62	30	Pass
NVNT	ac40	5230	26	Ant3	21.25	0.64	21.89	30	Pass
NVNT	ac40	5230	26	Sum	24.6	0.64	25.24	30	Pass
NVNT	ac40	5270	19	Ant1	11.97	0.65	12.62	24	Pass
NVNT	ac40	5270	19	Ant2	13.02	0.65	13.67	24	Pass
NVNT	ac40	5270	19	Ant3	14.63	0.65	15.28	24	Pass
NVNT	ac40	5270	19	Sum	18.12	0.65	18.77	24	Pass
NVNT	ac40	5310	19	Ant1	11.13	0.64	11.77	24	Pass
NVNT	ac40	5310	19	Ant2	11.88	0.64	12.52	24	Pass
NVNT	ac40	5310	19	Ant3	13.91	0.64	14.55	24	Pass
NVNT	ac40	5310	19	Sum	17.24	0.64	17.88	24	Pass
NVNT	ac40	5510	19	Ant1	11.68	0.65	12.33	24	Pass
NVNT	ac40	5510	19	Ant2	12.09	0.65	12.74	24	Pass
NVNT	ac40	5510	19	Ant3	13.68	0.65	14.33	24	Pass
NVNT	ac40	5510	19	Sum	17.34	0.65	17.99	24	Pass
NVNT	ac40	5550	19	Ant1	12.82	0.64	13.46	24	Pass
NVNT	ac40	5550	19	Ant2	13.32	0.64	13.96	24	Pass
NVNT	ac40	5550	19	Ant3	14.63	0.64	15.27	24	Pass
NVNT	ac40	5550	19	Sum	18.43	0.64	19.07	24	Pass
NVNT	ac40	5670	17	Ant1	12.37	0.64	13.01	24	Pass
NVNT	ac40	5670	17	Ant2	12.67	0.64	13.31	24	Pass
NVNT	ac40	5670	17	Ant3	14.49	0.64	15.13	24	Pass
NVNT	ac40	5670	17	Sum	18.05	0.64	18.69	24	Pass
NVNT	ac40	5755	2B	Ant1	22.42	0.65	23.07	30	Pass

NVNT	ac40	5755	2B	Ant2	24.07	0.65	24.72	30	Pass
NVNT	ac40	5755	2B	Ant3	25.77	0.65	26.42	30	Pass
NVNT	ac40	5755	2B	Sum	29.07	0.65	29.72	30	Pass
NVNT	ac40	5795	2B	Ant1	21.84	0.65	22.49	30	Pass
NVNT	ac40	5795	2B	Ant2	23.5	0.65	24.15	30	Pass
NVNT	ac40	5795	2B	Ant3	25.54	0.65	26.19	30	Pass
NVNT	ac40	5795	2B	Sum	28.66	0.65	29.31	30	Pass
NVNT	ac80	5210	2C	Ant1	21.96	1.03	22.99	30	Pass
NVNT	ac80	5210	2C	Ant2	20.88	1.03	21.91	30	Pass
NVNT	ac80	5210	2C	Ant3	23.63	1.03	24.66	30	Pass
NVNT	ac80	5210	2C	Sum	27.08	1.03	28.11	30	Pass
NVNT	ac80	5290	20	Ant1	14.4	1.03	15.43	24	Pass
NVNT	ac80	5290	20	Ant2	15.74	1.03	16.77	24	Pass
NVNT	ac80	5290	20	Ant3	17.16	1.03	18.19	24	Pass
NVNT	ac80	5290	20	Sum	20.68	1.03	21.71	24	Pass
NVNT	ac80	5530	20	Ant1	14.94	1.04	15.98	24	Pass
NVNT	ac80	5530	20	Ant2	15.76	1.04	16.8	24	Pass
NVNT	ac80	5530	20	Ant3	17.16	1.04	18.2	24	Pass
NVNT	ac80	5530	20	Sum	20.82	1.04	21.86	24	Pass
NVNT	ac80	5610	1C	Ant1	14.69	1.04	15.73	24	Pass
NVNT	ac80	5610	1C	Ant2	15.22	1.04	16.26	24	Pass
NVNT	ac80	5610	1C	Ant3	16.77	1.04	17.81	24	Pass
NVNT	ac80	5610	1C	Sum	20.42	1.04	21.46	24	Pass
NVNT	ac80	5775	2C	Ant1	22.07	1.02	23.09	30	Pass
NVNT	ac80	5775	2C	Ant2	23.68	1.02	24.7	30	Pass
NVNT	ac80	5775	2C	Ant3	25.44	1.02	26.46	30	Pass
NVNT	ac80	5775	2C	Sum	28.72	1.02	29.74	30	Pass
NVNT	ax160	5250	18	Ant1	11.77	0.43	12.2	24	Pass
NVNT	ax160	5250	18	Ant2	12.18	0.43	12.61	24	Pass
NVNT	ax160	5250	18	Ant3	13.2	0.43	13.63	24	Pass
NVNT	ax160	5250	18	Sum	17.2	0.43	17.63	24	Pass
NVNT	ax160	5570	21	Ant1	16.43	0.42	16.85	24	Pass
NVNT	ax160	5570	21	Ant2	17.23	0.42	17.65	24	Pass
NVNT	ax160	5570	21	Ant3	18.52	0.42	18.94	24	Pass
NVNT	ax160	5570	21	Sum	22.25	0.42	22.67	24	Pass
NVNT	ax20	5180	23	Ant1	18.58	0.4	18.98	30	Pass
NVNT	ax20	5180	23	Ant2	17.38	0.4	17.78	30	Pass
NVNT	ax20	5180	23	Ant3	19.87	0.4	20.27	30	Pass
NVNT	ax20	5180	23	Sum	23.5	0.4	23.9	30	Pass
NVNT	ax20	5200	23	Ant1	18.41	0.38	18.79	30	Pass
NVNT	ax20	5200	23	Ant2	17.18	0.38	17.56	30	Pass
NVNT	ax20	5200	23	Ant3	19.67	0.38	20.05	30	Pass

NVNT	ax20	5200	23	Sum	23.31	0.38	23.69	30	Pass
NVNT	ax20	5240	23	Ant1	18.09	0.4	18.49	30	Pass
NVNT	ax20	5240	23	Ant2	16.51	0.4	16.91	30	Pass
NVNT	ax20	5240	23	Ant3	19.78	0.4	20.18	30	Pass
NVNT	ax20	5240	23	Sum	23.1	0.4	23.5	30	Pass
NVNT	ax20	5260	15	Ant1	10.12	0.39	10.51	23.96	Pass
NVNT	ax20	5260	15	Ant2	11.09	0.39	11.48	23.96	Pass
NVNT	ax20	5260	15	Ant3	12.73	0.39	13.12	23.96	Pass
NVNT	ax20	5260	15	Sum	16.22	0.39	16.61	23.96	Pass
NVNT	ax20	5280	15	Ant1	10.12	0.38	10.5	23.96	Pass
NVNT	ax20	5280	15	Ant2	10.91	0.38	11.29	23.96	Pass
NVNT	ax20	5280	15	Ant3	12.46	0.38	12.84	23.96	Pass
NVNT	ax20	5280	15	Sum	16.05	0.38	16.43	23.96	Pass
NVNT	ax20	5320	15	Ant1	9.39	0.38	9.77	23.96	Pass
NVNT	ax20	5320	15	Ant2	10.03	0.38	10.41	23.96	Pass
NVNT	ax20	5320	15	Ant3	12.18	0.38	12.56	23.96	Pass
NVNT	ax20	5320	15	Sum	15.48	0.38	15.86	23.96	Pass
NVNT	ax20	5500	15	Ant1	10.2	0.4	10.6	23.96	Pass
NVNT	ax20	5500	15	Ant2	10.51	0.4	10.91	23.96	Pass
NVNT	ax20	5500	15	Ant3	11.97	0.4	12.37	23.96	Pass
NVNT	ax20	5500	15	Sum	15.74	0.4	16.14	23.96	Pass
NVNT	ax20	5580	13	Ant1	10.73	0.38	11.11	23.96	Pass
NVNT	ax20	5580	13	Ant2	10.94	0.38	11.32	23.96	Pass
NVNT	ax20	5580	13	Ant3	12.18	0.38	12.56	23.96	Pass
NVNT	ax20	5580	13	Sum	16.1	0.38	16.48	23.96	Pass
NVNT	ax20	5700	13	Ant1	10.34	0.4	10.74	23.96	Pass
NVNT	ax20	5700	13	Ant2	10.63	0.4	11.03	23.96	Pass
NVNT	ax20	5700	13	Ant3	12.65	0.4	13.05	23.96	Pass
NVNT	ax20	5700	13	Sum	16.1	0.4	16.5	23.96	Pass
NVNT	ax20	5745	2C	Ant1	22.11	0.38	22.49	30	Pass
NVNT	ax20	5745	2C	Ant2	23.64	0.38	24.02	30	Pass
NVNT	ax20	5745	2C	Ant3	25.01	0.38	25.39	30	Pass
NVNT	ax20	5745	2C	Sum	28.52	0.38	28.9	30	Pass
NVNT	ax20	5785	2C	Ant1	21.57	0.38	21.95	30	Pass
NVNT	ax20	5785	2C	Ant2	23.11	0.38	23.49	30	Pass
NVNT	ax20	5785	2C	Ant3	24.96	0.38	25.34	30	Pass
NVNT	ax20	5785	2C	Sum	28.21	0.38	28.59	30	Pass
NVNT	ax20	5825	2C	Ant1	20.85	0.4	21.25	30	Pass
NVNT	ax20	5825	2C	Ant2	21.64	0.4	22.04	30	Pass
NVNT	ax20	5825	2C	Ant3	23.71	0.4	24.11	30	Pass
NVNT	ax20	5825	2C	Sum	27.01	0.4	27.41	30	Pass
NVNT	ax40	5190	26	Ant1	20.41	0.4	20.81	30	Pass

NVNT	ax40	5190	26	Ant2	19.31	0.4	19.71	30	Pass
NVNT	ax40	5190	26	Ant3	21.89	0.4	22.29	30	Pass
NVNT	ax40	5190	26	Sum	25.44	0.4	25.84	30	Pass
NVNT	ax40	5230	26	Ant1	20.14	0.39	20.53	30	Pass
NVNT	ax40	5230	26	Ant2	18.67	0.39	19.06	30	Pass
NVNT	ax40	5230	26	Ant3	21.79	0.39	22.18	30	Pass
NVNT	ax40	5230	26	Sum	25.16	0.39	25.55	30	Pass
NVNT	ax40	5270	19	Ant1	12.18	0.41	12.59	24	Pass
NVNT	ax40	5270	19	Ant2	13.61	0.41	14.02	24	Pass
NVNT	ax40	5270	19	Ant3	15.01	0.41	15.42	24	Pass
NVNT	ax40	5270	19	Sum	18.52	0.41	18.93	24	Pass
NVNT	ax40	5310	19	Ant1	11.31	0.41	11.72	24	Pass
NVNT	ax40	5310	19	Ant2	12.5	0.41	12.91	24	Pass
NVNT	ax40	5310	19	Ant3	14.44	0.41	14.85	24	Pass
NVNT	ax40	5310	19	Sum	17.72	0.41	18.13	24	Pass
NVNT	ax40	5510	19	Ant1	11.91	1.03	12.94	24	Pass
NVNT	ax40	5510	19	Ant2	12.67	1.03	13.7	24	Pass
NVNT	ax40	5510	19	Ant3	14.08	1.03	15.11	24	Pass
NVNT	ax40	5510	19	Sum	17.75	1.03	18.78	24	Pass
NVNT	ax40	5550	19	Ant1	13.21	0.39	13.6	24	Pass
NVNT	ax40	5550	19	Ant2	13.87	0.39	14.26	24	Pass
NVNT	ax40	5550	19	Ant3	15.07	0.39	15.46	24	Pass
NVNT	ax40	5550	19	Sum	18.89	0.39	19.28	24	Pass
NVNT	ax40	5670	17	Ant1	12.99	0.39	13.38	24	Pass
NVNT	ax40	5670	17	Ant2	13.28	0.39	13.67	24	Pass
NVNT	ax40	5670	17	Ant3	14.85	0.39	15.24	24	Pass
NVNT	ax40	5670	17	Sum	18.56	0.39	18.95	24	Pass
NVNT	ax40	5755	2B	Ant1	22.92	0.39	23.31	30	Pass
NVNT	ax40	5755	2B	Ant2	24.43	0.39	24.82	30	Pass
NVNT	ax40	5755	2B	Ant3	26.06	0.39	26.45	30	Pass
NVNT	ax40	5755	2B	Sum	29.43	0.39	29.82	30	Pass
NVNT	ax40	5795	2B	Ant1	22.35	0.41	22.76	30	Pass
NVNT	ax40	5795	2B	Ant2	23.88	0.41	24.29	30	Pass
NVNT	ax40	5795	2B	Ant3	25.87	0.41	26.28	30	Pass
NVNT	ax40	5795	2B	Sum	29.04	0.41	29.45	30	Pass
NVNT	ax80	5210	2C	Ant1	23.03	0.41	23.44	30	Pass
NVNT	ax80	5210	2C	Ant2	21.82	0.41	22.23	30	Pass
NVNT	ax80	5210	2C	Ant3	24.65	0.41	25.06	30	Pass
NVNT	ax80	5210	2C	Sum	28.09	0.41	28.5	30	Pass
NVNT	ax80	5290	20	Ant1	15.48	0.49	15.97	24	Pass
NVNT	ax80	5290	20	Ant2	16.83	0.49	17.32	24	Pass
NVNT	ax80	5290	20	Ant3	18.24	0.49	18.73	24	Pass

NVNT	ax80	5290	20	Sum	21.77	0.49	22.26	24	Pass
NVNT	ax80	5530	1F	Ant1	15.58	0.49	16.07	24	Pass
NVNT	ax80	5530	1F	Ant2	16.41	0.49	16.9	24	Pass
NVNT	ax80	5530	1F	Ant3	17.98	0.49	18.47	24	Pass
NVNT	ax80	5530	1F	Sum	21.54	0.49	22.03	24	Pass
NVNT	ax80	5610	1B	Ant1	15.38	0.48	15.86	24	Pass
NVNT	ax80	5610	1B	Ant2	15.81	0.48	16.29	24	Pass
NVNT	ax80	5610	1B	Ant3	17.41	0.48	17.89	24	Pass
NVNT	ax80	5610	1B	Sum	21.06	0.48	21.54	24	Pass
NVNT	ax80	5775	2B	Ant1	22.54	0.48	23.02	30	Pass
NVNT	ax80	5775	2B	Ant2	24.08	0.48	24.56	30	Pass
NVNT	ax80	5775	2B	Ant3	25.87	0.48	26.35	30	Pass
NVNT	ax80	5775	2B	Sum	29.15	0.48	29.63	30	Pass
NVNT	be160	5250	18	Ant1	11.83	0.41	12.24	24	Pass
NVNT	be160	5250	18	Ant2	12.14	0.41	12.55	24	Pass
NVNT	be160	5250	18	Ant3	13.19	0.41	13.6	24	Pass
NVNT	be160	5250	18	Sum	17.2	0.41	17.61	24	Pass
NVNT	be160	5570	21	Ant1	16.49	0.41	16.9	24	Pass
NVNT	be160	5570	21	Ant2	17.16	0.41	17.57	24	Pass
NVNT	be160	5570	21	Ant3	18.53	0.41	18.94	24	Pass
NVNT	be160	5570	21	Sum	22.25	0.41	22.66	24	Pass
NVNT	be20	5180	23	Ant1	18.61	0.37	18.98	30	Pass
NVNT	be20	5180	23	Ant2	17.43	0.37	17.8	30	Pass
NVNT	be20	5180	23	Ant3	19.79	0.37	20.16	30	Pass
NVNT	be20	5180	23	Sum	23.49	0.37	23.86	30	Pass
NVNT	be20	5200	23	Ant1	18.48	0.39	18.87	30	Pass
NVNT	be20	5200	23	Ant2	17.25	0.39	17.64	30	Pass
NVNT	be20	5200	23	Ant3	19.72	0.39	20.11	30	Pass
NVNT	be20	5200	23	Sum	23.37	0.39	23.76	30	Pass
NVNT	be20	5240	23	Ant1	18.18	0.39	18.57	30	Pass
NVNT	be20	5240	23	Ant2	16.5	0.39	16.89	30	Pass
NVNT	be20	5240	23	Ant3	19.75	0.39	20.14	30	Pass
NVNT	be20	5240	23	Sum	23.11	0.39	23.5	30	Pass
NVNT	be20	5260	15	Ant1	10.16	0.39	10.55	23.95	Pass
NVNT	be20	5260	15	Ant2	11.06	0.39	11.45	23.95	Pass
NVNT	be20	5260	15	Ant3	12.76	0.39	13.15	23.95	Pass
NVNT	be20	5260	15	Sum	16.23	0.39	16.62	23.95	Pass
NVNT	be20	5280	15	Ant1	10.1	0.39	10.49	23.95	Pass
NVNT	be20	5280	15	Ant2	10.96	0.39	11.35	23.95	Pass
NVNT	be20	5280	15	Ant3	12.41	0.39	12.8	23.95	Pass
NVNT	be20	5280	15	Sum	16.03	0.39	16.42	23.95	Pass
NVNT	be20	5320	15	Ant1	9.41	0.39	9.8	23.95	Pass

NVNT	be20	5320	15	Ant2	9.97	0.39	10.36	23.95	Pass
NVNT	be20	5320	15	Ant3	12.07	0.39	12.46	23.95	Pass
NVNT	be20	5320	15	Sum	15.41	0.39	15.8	23.95	Pass
NVNT	be20	5500	15	Ant1	10.16	0.39	10.55	23.95	Pass
NVNT	be20	5500	15	Ant2	10.48	0.39	10.87	23.95	Pass
NVNT	be20	5500	15	Ant3	11.97	0.39	12.36	23.95	Pass
NVNT	be20	5500	15	Sum	15.72	0.39	16.11	23.95	Pass
NVNT	be20	5580	13	Ant1	10.76	0.37	11.13	23.95	Pass
NVNT	be20	5580	13	Ant2	10.88	0.37	11.25	23.95	Pass
NVNT	be20	5580	13	Ant3	12.07	0.37	12.44	23.95	Pass
NVNT	be20	5580	13	Sum	16.05	0.37	16.42	23.95	Pass
NVNT	be20	5700	13	Ant1	10.36	0.38	10.74	23.95	Pass
NVNT	be20	5700	13	Ant2	10.66	0.38	11.04	23.95	Pass
NVNT	be20	5700	13	Ant3	12.68	0.38	13.06	23.95	Pass
NVNT	be20	5700	13	Sum	16.13	0.38	16.51	23.95	Pass
NVNT	be20	5745	2C	Ant1	22.37	0.37	22.74	30	Pass
NVNT	be20	5745	2C	Ant2	23.85	0.37	24.22	30	Pass
NVNT	be20	5745	2C	Ant3	25.36	0.37	25.73	30	Pass
NVNT	be20	5745	2C	Sum	28.8	0.37	29.17	30	Pass
NVNT	be20	5785	2C	Ant1	21.66	0.38	22.04	30	Pass
NVNT	be20	5785	2C	Ant2	23.14	0.38	23.52	30	Pass
NVNT	be20	5785	2C	Ant3	25.14	0.38	25.52	30	Pass
NVNT	be20	5785	2C	Sum	28.32	0.38	28.7	30	Pass
NVNT	be20	5825	2C	Ant1	21.1	0.37	21.47	30	Pass
NVNT	be20	5825	2C	Ant2	21.95	0.37	22.32	30	Pass
NVNT	be20	5825	2C	Ant3	24.11	0.37	24.48	30	Pass
NVNT	be20	5825	2C	Sum	27.35	0.37	27.72	30	Pass
NVNT	be40	5190	26	Ant1	20.53	0.39	20.92	30	Pass
NVNT	be40	5190	26	Ant2	19.36	0.39	19.75	30	Pass
NVNT	be40	5190	26	Ant3	21.98	0.39	22.37	30	Pass
NVNT	be40	5190	26	Sum	25.53	0.39	25.92	30	Pass
NVNT	be40	5230	26	Ant1	20.15	0.4	20.55	30	Pass
NVNT	be40	5230	26	Ant2	18.79	0.4	19.19	30	Pass
NVNT	be40	5230	26	Ant3	21.84	0.4	22.24	30	Pass
NVNT	be40	5230	26	Sum	25.21	0.4	25.61	30	Pass
NVNT	be40	5270	19	Ant1	12.29	0.39	12.68	24	Pass
NVNT	be40	5270	19	Ant2	13.66	0.39	14.05	24	Pass
NVNT	be40	5270	19	Ant3	15.29	0.39	15.68	24	Pass
NVNT	be40	5270	19	Sum	18.69	0.39	19.08	24	Pass
NVNT	be40	5310	19	Ant1	11.45	0.39	11.84	24	Pass
NVNT	be40	5310	19	Ant2	12.6	0.39	12.99	24	Pass
NVNT	be40	5310	19	Ant3	14.58	0.39	14.97	24	Pass

NVNT	be40	5310	19	Sum	17.84	0.39	18.23	24	Pass
NVNT	be40	5510	19	Ant1	11.78	0.39	12.17	24	Pass
NVNT	be40	5510	19	Ant2	12.52	0.39	12.91	24	Pass
NVNT	be40	5510	19	Ant3	14.21	0.39	14.6	24	Pass
NVNT	be40	5510	19	Sum	17.73	0.39	18.12	24	Pass
NVNT	be40	5550	19	Ant1	12.92	0.41	13.33	24	Pass
NVNT	be40	5550	19	Ant2	13.68	0.41	14.09	24	Pass
NVNT	be40	5550	19	Ant3	15.13	0.41	15.54	24	Pass
NVNT	be40	5550	19	Sum	18.78	0.41	19.19	24	Pass
NVNT	be40	5670	17	Ant1	12.8	0.39	13.19	24	Pass
NVNT	be40	5670	17	Ant2	13.21	0.39	13.6	24	Pass
NVNT	be40	5670	17	Ant3	15.03	0.39	15.42	24	Pass
NVNT	be40	5670	17	Sum	18.56	0.39	18.95	24	Pass
NVNT	be40	5755	2B	Ant1	22.82	0.39	23.21	30	Pass
NVNT	be40	5755	2B	Ant2	24.56	0.39	24.95	30	Pass
NVNT	be40	5755	2B	Ant3	26.31	0.39	26.7	30	Pass
NVNT	be40	5755	2B	Sum	29.57	0.39	29.96	30	Pass
NVNT	be40	5795	2B	Ant1	22.23	0.39	22.62	30	Pass
NVNT	be40	5795	2B	Ant2	23.95	0.39	24.34	30	Pass
NVNT	be40	5795	2B	Ant3	26.05	0.39	26.44	30	Pass
NVNT	be40	5795	2B	Sum	29.13	0.39	29.52	30	Pass
NVNT	be80	5210	2C	Ant1	22.94	0.42	23.36	30	Pass
NVNT	be80	5210	2C	Ant2	21.88	0.42	22.3	30	Pass
NVNT	be80	5210	2C	Ant3	24.63	0.42	25.05	30	Pass
NVNT	be80	5210	2C	Sum	28.07	0.42	28.49	30	Pass
NVNT	be80	5290	20	Ant1	15.53	0.41	15.94	24	Pass
NVNT	be80	5290	20	Ant2	16.9	0.41	17.31	24	Pass
NVNT	be80	5290	20	Ant3	18.36	0.41	18.77	24	Pass
NVNT	be80	5290	20	Sum	21.85	0.41	22.26	24	Pass
NVNT	be80	5530	1F	Ant1	15.68	0.42	16.1	24	Pass
NVNT	be80	5530	1F	Ant2	16.55	0.42	16.97	24	Pass
NVNT	be80	5530	1F	Ant3	18	0.42	18.42	24	Pass
NVNT	be80	5530	1F	Sum	21.62	0.42	22.04	24	Pass
NVNT	be80	5610	1B	Ant1	15.43	0.43	15.86	24	Pass
NVNT	be80	5610	1B	Ant2	15.82	0.43	16.25	24	Pass
NVNT	be80	5610	1B	Ant3	17.39	0.43	17.82	24	Pass
NVNT	be80	5610	1B	Sum	21.07	0.43	21.5	24	Pass
NVNT	be80	5775	2B	Ant1	22.68	0.43	23.11	30	Pass
NVNT	be80	5775	2B	Ant2	24.2	0.43	24.63	30	Pass
NVNT	be80	5775	2B	Ant3	25.98	0.43	26.41	30	Pass
NVNT	be80	5775	2B	Sum	29.27	0.43	29.7	30	Pass
NVNT	n20	5180	23	Ant1	18.43	0.37	18.8	30	Pass

NVNT	n20	5180	23	Ant2	17.25	0.37	17.62	30	Pass
NVNT	n20	5180	23	Ant3	19.76	0.37	20.13	30	Pass
NVNT	n20	5180	23	Sum	23.37	0.37	23.74	30	Pass
NVNT	n20	5200	23	Ant1	18.3	0.37	18.67	30	Pass
NVNT	n20	5200	23	Ant2	17.06	0.37	17.43	30	Pass
NVNT	n20	5200	23	Ant3	19.59	0.37	19.96	30	Pass
NVNT	n20	5200	23	Sum	23.21	0.37	23.58	30	Pass
NVNT	n20	5240	23	Ant1	17.98	0.38	18.36	30	Pass
NVNT	n20	5240	23	Ant2	16.45	0.38	16.83	30	Pass
NVNT	n20	5240	23	Ant3	19.56	0.38	19.94	30	Pass
NVNT	n20	5240	23	Sum	22.95	0.38	23.33	30	Pass
NVNT	n20	5260	15	Ant1	10.18	0.38	10.56	23.74	Pass
NVNT	n20	5260	15	Ant2	11.03	0.38	11.41	23.74	Pass
NVNT	n20	5260	15	Ant3	12.7	0.38	13.08	23.74	Pass
NVNT	n20	5260	15	Sum	16.2	0.38	16.58	23.74	Pass
NVNT	n20	5280	15	Ant1	10.19	0.38	10.57	23.74	Pass
NVNT	n20	5280	15	Ant2	11.04	0.38	11.42	23.74	Pass
NVNT	n20	5280	15	Ant3	12.48	0.38	12.86	23.74	Pass
NVNT	n20	5280	15	Sum	16.11	0.38	16.49	23.74	Pass
NVNT	n20	5320	15	Ant1	9.5	0.38	9.88	23.74	Pass
NVNT	n20	5320	15	Ant2	10.1	0.38	10.48	23.74	Pass
NVNT	n20	5320	15	Ant3	12.08	0.38	12.46	23.74	Pass
NVNT	n20	5320	15	Sum	15.48	0.38	15.86	23.74	Pass
NVNT	n20	5500	15	Ant1	10.2	0.38	10.58	23.74	Pass
NVNT	n20	5500	15	Ant2	10.57	0.38	10.95	23.74	Pass
NVNT	n20	5500	15	Ant3	12.01	0.38	12.39	23.74	Pass
NVNT	n20	5500	15	Sum	15.77	0.38	16.15	23.74	Pass
NVNT	n20	5580	13	Ant1	10.81	0.37	11.18	23.74	Pass
NVNT	n20	5580	13	Ant2	11.07	0.37	11.44	23.74	Pass
NVNT	n20	5580	13	Ant3	12.21	0.37	12.58	23.74	Pass
NVNT	n20	5580	13	Sum	16.18	0.37	16.55	23.74	Pass
NVNT	n20	5700	13	Ant1	10.46	0.38	10.84	23.74	Pass
NVNT	n20	5700	13	Ant2	10.87	0.38	11.25	23.74	Pass
NVNT	n20	5700	13	Ant3	12.76	0.38	13.14	23.74	Pass
NVNT	n20	5700	13	Sum	16.25	0.38	16.63	23.74	Pass
NVNT	n20	5745	2C	Ant1	21.93	0.37	22.3	30	Pass
NVNT	n20	5745	2C	Ant2	23.37	0.37	23.74	30	Pass
NVNT	n20	5745	2C	Ant3	24.99	0.37	25.36	30	Pass
NVNT	n20	5745	2C	Sum	28.38	0.37	28.75	30	Pass
NVNT	n20	5785	2C	Ant1	21.38	0.37	21.75	30	Pass
NVNT	n20	5785	2C	Ant2	22.84	0.37	23.21	30	Pass
NVNT	n20	5785	2C	Ant3	24.86	0.37	25.23	30	Pass

NVNT	n20	5785	2C	Sum	28.03	0.37	28.4	30	Pass
NVNT	n20	5825	2C	Ant1	20.67	0.38	21.05	30	Pass
NVNT	n20	5825	2C	Ant2	21.5	0.38	21.88	30	Pass
NVNT	n20	5825	2C	Ant3	23.66	0.38	24.04	30	Pass
NVNT	n20	5825	2C	Sum	26.9	0.38	27.28	30	Pass
NVNT	n40	5190	26	Ant1	20.69	0.63	21.32	30	Pass
NVNT	n40	5190	26	Ant2	19.72	0.63	20.35	30	Pass
NVNT	n40	5190	26	Ant3	22.25	0.63	22.88	30	Pass
NVNT	n40	5190	26	Sum	25.78	0.63	26.41	30	Pass
NVNT	n40	5230	26	Ant1	19.81	0.64	20.45	30	Pass
NVNT	n40	5230	26	Ant2	18.47	0.64	19.11	30	Pass
NVNT	n40	5230	26	Ant3	21.52	0.64	22.16	30	Pass
NVNT	n40	5230	26	Sum	24.88	0.64	25.52	30	Pass
NVNT	n40	5270	19	Ant1	11.97	0.65	12.62	24	Pass
NVNT	n40	5270	19	Ant2	13	0.65	13.65	24	Pass
NVNT	n40	5270	19	Ant3	14.52	0.65	15.17	24	Pass
NVNT	n40	5270	19	Sum	18.06	0.65	18.71	24	Pass
NVNT	n40	5310	19	Ant1	11.2	0.65	11.85	24	Pass
NVNT	n40	5310	19	Ant2	11.93	0.65	12.58	24	Pass
NVNT	n40	5310	19	Ant3	13.93	0.65	14.58	24	Pass
NVNT	n40	5310	19	Sum	17.28	0.65	17.93	24	Pass
NVNT	n40	5510	19	Ant1	11.67	0.65	12.32	24	Pass
NVNT	n40	5510	19	Ant2	12.08	0.65	12.73	24	Pass
NVNT	n40	5510	19	Ant3	13.77	0.65	14.42	24	Pass
NVNT	n40	5510	19	Sum	17.38	0.65	18.03	24	Pass
NVNT	n40	5550	19	Ant1	12.85	0.65	13.5	24	Pass
NVNT	n40	5550	19	Ant2	13.27	0.65	13.92	24	Pass
NVNT	n40	5550	19	Ant3	14.58	0.65	15.23	24	Pass
NVNT	n40	5550	19	Sum	18.4	0.65	19.05	24	Pass
NVNT	n40	5670	17	Ant1	13.45	0.67	14.12	24	Pass
NVNT	n40	5670	17	Ant2	13.86	0.67	14.53	24	Pass
NVNT	n40	5670	17	Ant3	15.45	0.67	16.12	24	Pass
NVNT	n40	5670	17	Sum	19.11	0.67	19.78	24	Pass
NVNT	n40	5755	2B	Ant1	22.29	0.65	22.94	30	Pass
NVNT	n40	5755	2B	Ant2	23.89	0.65	24.54	30	Pass
NVNT	n40	5755	2B	Ant3	25.49	0.65	26.14	30	Pass
NVNT	n40	5755	2B	Sum	28.86	0.65	29.51	30	Pass
NVNT	n40	5795	2B	Ant1	21.75	0.64	22.39	30	Pass
NVNT	n40	5795	2B	Ant2	23.21	0.64	23.85	30	Pass
NVNT	n40	5795	2B	Ant3	25.23	0.64	25.87	30	Pass
NVNT	n40	5795	2B	Sum	28.4	0.64	29.04	30	Pass

Mode	RU Type	Index	Antenna	Power Setting	Frequency (MHz)	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
ax20	26RU	4	Ant1	0E	5180	11.04	0.31	11.35	30	Pass
ax20	26RU	4	Ant2	0E	5180	10.8	0.31	11.11	30	Pass
ax20	26RU	4	Ant3	0E	5180	12.42	0.31	12.73	30	Pass
ax20	26RU	4	Sum	0E	5180	16.25	0.31	16.56	30	Pass
ax20	26RU	4	Ant1	0E	5200	11.03	0.31	11.34	30	Pass
ax20	26RU	4	Ant2	0E	5200	10.88	0.31	11.19	30	Pass
ax20	26RU	4	Ant3	0E	5200	12.04	0.31	12.35	30	Pass
ax20	26RU	4	Sum	0E	5200	16.12	0.31	16.43	30	Pass
ax20	26RU	4	Ant1	0E	5240	10.54	0.31	10.85	30	Pass
ax20	26RU	4	Ant2	0E	5240	10.26	0.31	10.57	30	Pass
ax20	26RU	4	Ant3	0E	5240	12.05	0.31	12.36	30	Pass
ax20	26RU	4	Sum	0E	5240	15.79	0.31	16.1	30	Pass
ax20	26RU	4	Ant1	6	5260	3.32	0.34	3.66	23.96	Pass
ax20	26RU	4	Ant2	6	5260	2.78	0.34	3.12	23.96	Pass
ax20	26RU	4	Ant3	6	5260	4.95	0.34	5.29	23.96	Pass
ax20	26RU	4	Sum	6	5260	8.56	0.34	8.9	23.96	Pass
ax20	26RU	4	Ant1	6	5280	3.72	0.32	4.04	23.96	Pass
ax20	26RU	4	Ant2	6	5280	3.42	0.32	3.74	23.96	Pass
ax20	26RU	4	Ant3	6	5280	5.07	0.32	5.39	23.96	Pass
ax20	26RU	4	Sum	6	5280	8.9	0.32	9.22	23.96	Pass
ax20	26RU	4	Ant1	6	5320	2.88	0.34	3.22	23.96	Pass
ax20	26RU	4	Ant2	6	5320	2.52	0.34	2.86	23.96	Pass
ax20	26RU	4	Ant3	6	5320	4.24	0.34	4.58	23.96	Pass
ax20	26RU	4	Sum	6	5320	8.05	0.34	8.39	23.96	Pass
ax20	26RU	4	Ant1	5	5500	2.95	0.31	3.26	23.96	Pass
ax20	26RU	4	Ant2	5	5500	2.52	0.31	2.83	23.96	Pass
ax20	26RU	4	Ant3	5	5500	4.6	0.31	4.91	23.96	Pass
ax20	26RU	4	Sum	5	5500	8.22	0.31	8.53	23.96	Pass
ax20	26RU	4	Ant1	5	5580	4.97	0.31	5.28	23.96	Pass
ax20	26RU	4	Ant2	5	5580	3.36	0.31	3.67	23.96	Pass
ax20	26RU	4	Ant3	5	5580	4.68	0.31	4.99	23.96	Pass
ax20	26RU	4	Sum	5	5580	9.16	0.31	9.47	23.96	Pass
ax20	26RU	4	Ant1	5	5700	4.66	0.31	4.97	23.96	Pass
ax20	26RU	4	Ant2	5	5700	3.32	0.31	3.63	23.96	Pass
ax20	26RU	4	Ant3	5	5700	6.13	0.31	6.44	23.96	Pass
ax20	26RU	4	Sum	5	5700	9.63	0.31	9.94	23.96	Pass
ax20	26RU	4	Ant1	14	5745	13.72	0.32	14.04	30	Pass
ax20	26RU	4	Ant2	14	5745	14.47	0.32	14.79	30	Pass
ax20	26RU	4	Ant3	14	5745	16.15	0.32	16.47	30	Pass

ax20	26RU	4	Sum	14	5745	19.67	0.32	19.99	30	Pass
ax20	26RU	4	Ant1	14	5785	13.05	0.31	13.36	30	Pass
ax20	26RU	4	Ant2	14	5785	14.51	0.31	14.82	30	Pass
ax20	26RU	4	Ant3	14	5785	16.35	0.31	16.66	30	Pass
ax20	26RU	4	Sum	14	5785	19.62	0.31	19.93	30	Pass
ax20	26RU	4	Ant1	14	5825	12.72	0.32	13.04	30	Pass
ax20	26RU	4	Ant2	14	5825	12.96	0.32	13.28	30	Pass
ax20	26RU	4	Ant3	14	5825	15.11	0.32	15.43	30	Pass
ax20	26RU	4	Sum	14	5825	18.51	0.32	18.83	30	Pass
be20	52+26RU	38+1	Ant1	20	5180	14.43	0.26	14.69	30	Pass
be20	52+26RU	38+1	Ant2	20	5180	14.59	0.26	14.85	30	Pass
be20	52+26RU	38+1	Ant3	20	5180	15.57	0.26	15.83	30	Pass
be20	52+26RU	38+1	Sum	20	5180	19.66	0.26	19.92	30	Pass
be20	52+26RU	38+1	Ant1	20	5200	13.82	0.26	14.08	30	Pass
be20	52+26RU	38+1	Ant2	20	5200	14.23	0.26	14.49	30	Pass
be20	52+26RU	38+1	Ant3	20	5200	15.37	0.26	15.63	30	Pass
be20	52+26RU	38+1	Sum	20	5200	19.3	0.26	19.56	30	Pass
be20	52+26RU	38+1	Ant1	20	5240	13.53	0.26	13.79	30	Pass
be20	52+26RU	38+1	Ant2	20	5240	13.67	0.26	13.93	30	Pass
be20	52+26RU	38+1	Ant3	20	5240	15.16	0.26	15.42	30	Pass
be20	52+26RU	38+1	Sum	20	5240	18.96	0.26	19.22	30	Pass
be20	52+26RU	38+1	Ant1	14	5260	5.56	0.29	5.85	23.95	Pass
be20	52+26RU	38+1	Ant2	14	5260	6.63	0.29	6.92	23.95	Pass
be20	52+26RU	38+1	Ant3	14	5260	8.88	0.29	9.17	23.95	Pass
be20	52+26RU	38+1	Sum	14	5260	12.02	0.29	12.31	23.95	Pass
be20	52+26RU	38+1	Ant1	14	5280	6.01	0.27	6.28	23.95	Pass
be20	52+26RU	38+1	Ant2	14	5280	7.09	0.27	7.36	23.95	Pass
be20	52+26RU	38+1	Ant3	14	5280	9.18	0.27	9.45	23.95	Pass
be20	52+26RU	38+1	Sum	14	5280	12.4	0.27	12.67	23.95	Pass
be20	52+26RU	38+1	Ant1	14	5320	5.23	0.26	5.49	23.95	Pass
be20	52+26RU	38+1	Ant2	14	5320	6.51	0.26	6.77	23.95	Pass
be20	52+26RU	38+1	Ant3	14	5320	8.73	0.26	8.99	23.95	Pass
be20	52+26RU	38+1	Sum	14	5320	11.84	0.26	12.1	23.95	Pass
be20	52+26RU	38+1	Ant1	13	5500	6.12	0.25	6.37	23.95	Pass
be20	52+26RU	38+1	Ant2	13	5500	6.6	0.25	6.85	23.95	Pass
be20	52+26RU	38+1	Ant3	13	5500	8.33	0.25	8.58	23.95	Pass
be20	52+26RU	38+1	Sum	13	5500	11.9	0.25	12.15	23.95	Pass
be20	52+26RU	38+1	Ant1	13	5580	4.78	0.26	5.04	23.95	Pass
be20	52+26RU	38+1	Ant2	13	5580	3.68	0.26	3.94	23.95	Pass
be20	52+26RU	38+1	Ant3	13	5580	4.79	0.26	5.05	23.95	Pass
be20	52+26RU	38+1	Sum	13	5580	9.22	0.26	9.48	23.95	Pass
be20	52+26RU	38+1	Ant1	13	5700	6.03	0.29	6.32	23.95	Pass

be20	52+26RU	38+1	Ant2	13	5700	4.73	0.29	5.02	23.95	Pass
be20	52+26RU	38+1	Ant3	13	5700	6.32	0.29	6.61	23.95	Pass
be20	52+26RU	38+1	Sum	13	5700	10.52	0.29	10.81	23.95	Pass
be20	52+26RU	38+1	Ant1	28	5745	17.66	0.26	17.92	30	Pass
be20	52+26RU	38+1	Ant2	28	5745	19.28	0.26	19.54	30	Pass
be20	52+26RU	38+1	Ant3	28	5745	20.39	0.26	20.65	30	Pass
be20	52+26RU	38+1	Sum	28	5745	24.02	0.26	24.28	30	Pass
be20	52+26RU	38+1	Ant1	28	5785	17.03	0.28	17.31	30	Pass
be20	52+26RU	38+1	Ant2	28	5785	18.83	0.28	19.11	30	Pass
be20	52+26RU	38+1	Ant3	28	5785	20.28	0.28	20.56	30	Pass
be20	52+26RU	38+1	Sum	28	5785	23.68	0.28	23.96	30	Pass
be20	52+26RU	38+1	Ant1	28	5825	16.42	0.28	16.7	30	Pass
be20	52+26RU	38+1	Ant2	28	5825	17.47	0.28	17.75	30	Pass
be20	52+26RU	38+1	Ant3	28	5825	19.26	0.28	19.54	30	Pass
be20	52+26RU	38+1	Sum	28	5825	22.65	0.28	22.93	30	Pass
be20	52+26RU	38+4	Ant1	20	5180	-0.18	0.27	0.09	30	Pass
be20	52+26RU	38+4	Ant2	20	5180	-0.72	0.27	-0.45	30	Pass
be20	52+26RU	38+4	Ant3	20	5180	0.83	0.27	1.1	30	Pass
be20	52+26RU	38+4	Sum	20	5180	4.8	0.27	5.07	30	Pass
be20	52+26RU	38+4	Ant1	20	5200	0.2	0.27	0.47	30	Pass
be20	52+26RU	38+4	Ant2	20	5200	-0.21	0.27	0.06	30	Pass
be20	52+26RU	38+4	Ant3	20	5200	1.06	0.27	1.33	30	Pass
be20	52+26RU	38+4	Sum	20	5200	5.15	0.27	5.42	30	Pass
be20	52+26RU	38+4	Ant1	20	5240	0.27	0.28	0.55	30	Pass
be20	52+26RU	38+4	Ant2	20	5240	0	0.28	0.28	30	Pass
be20	52+26RU	38+4	Ant3	20	5240	1.19	0.28	1.47	30	Pass
be20	52+26RU	38+4	Sum	20	5240	5.29	0.28	5.57	30	Pass
be20	52+26RU	38+4	Ant1	13	5260	6.12	0.26	6.38	23.95	Pass
be20	52+26RU	38+4	Ant2	13	5260	6.96	0.26	7.22	23.95	Pass
be20	52+26RU	38+4	Ant3	13	5260	9.4	0.26	9.66	23.95	Pass
be20	52+26RU	38+4	Sum	13	5260	12.5	0.26	12.76	23.95	Pass
be20	52+26RU	38+4	Ant1	13	5280	4.41	0.26	4.67	23.95	Pass
be20	52+26RU	38+4	Ant2	13	5280	4.06	0.26	4.32	23.95	Pass
be20	52+26RU	38+4	Ant3	13	5280	5.25	0.26	5.51	23.95	Pass
be20	52+26RU	38+4	Sum	13	5280	9.37	0.26	9.63	23.95	Pass
be20	52+26RU	38+4	Ant1	13	5320	4.05	0.26	4.31	23.95	Pass
be20	52+26RU	38+4	Ant2	13	5320	3.97	0.26	4.23	23.95	Pass
be20	52+26RU	38+4	Ant3	13	5320	5.46	0.26	5.72	23.95	Pass
be20	52+26RU	38+4	Sum	13	5320	9.32	0.26	9.58	23.95	Pass
be20	52+26RU	38+4	Ant1	13	5500	3.39	0.3	3.69	23.95	Pass
be20	52+26RU	38+4	Ant2	13	5500	3.52	0.3	3.82	23.95	Pass
be20	52+26RU	38+4	Ant3	13	5500	4.26	0.3	4.56	23.95	Pass

be20	52+26RU	38+4	Sum	13	5500	8.51	0.3	8.81	23.95	Pass
be20	52+26RU	38+4	Ant1	13	5580	5.67	0.29	5.96	23.95	Pass
be20	52+26RU	38+4	Ant2	13	5580	4.39	0.29	4.68	23.95	Pass
be20	52+26RU	38+4	Ant3	13	5580	4.71	0.29	5	23.95	Pass
be20	52+26RU	38+4	Sum	13	5580	9.73	0.29	10.02	23.95	Pass
be20	52+26RU	38+4	Ant1	13	5700	6.34	0.28	6.62	23.95	Pass
be20	52+26RU	38+4	Ant2	13	5700	5.09	0.28	5.37	23.95	Pass
be20	52+26RU	38+4	Ant3	13	5700	6.6	0.28	6.88	23.95	Pass
be20	52+26RU	38+4	Sum	13	5700	10.83	0.28	11.11	23.95	Pass
be20	52+26RU	38+4	Ant1	28	5745	18.31	0.29	18.6	30	Pass
be20	52+26RU	38+4	Ant2	28	5745	20.04	0.29	20.33	30	Pass
be20	52+26RU	38+4	Ant3	28	5745	21.04	0.29	21.33	30	Pass
be20	52+26RU	38+4	Sum	28	5745	24.71	0.29	25	30	Pass
be20	52+26RU	38+4	Ant1	28	5785	17.58	0.26	17.84	30	Pass
be20	52+26RU	38+4	Ant2	28	5785	19.43	0.26	19.69	30	Pass
be20	52+26RU	38+4	Ant3	28	5785	20.93	0.26	21.19	30	Pass
be20	52+26RU	38+4	Sum	28	5785	24.3	0.26	24.56	30	Pass
be20	52+26RU	38+4	Ant1	28	5825	16.91	0.29	17.2	30	Pass
be20	52+26RU	38+4	Ant2	28	5825	17.82	0.29	18.11	30	Pass
be20	52+26RU	38+4	Ant3	28	5825	19.87	0.29	20.16	30	Pass
be20	52+26RU	38+4	Sum	28	5825	23.15	0.29	23.44	30	Pass
be20	52+26RU	39+7	Ant1	20	5180	13.79	0.26	14.05	30	Pass
be20	52+26RU	39+7	Ant2	20	5180	14.05	0.26	14.31	30	Pass
be20	52+26RU	39+7	Ant3	20	5180	15.32	0.26	15.58	30	Pass
be20	52+26RU	39+7	Sum	20	5180	19.21	0.26	19.47	30	Pass
be20	52+26RU	39+7	Ant1	20	5200	13.78	0.26	14.04	30	Pass
be20	52+26RU	39+7	Ant2	20	5200	14.04	0.26	14.3	30	Pass
be20	52+26RU	39+7	Ant3	20	5200	15.02	0.26	15.28	30	Pass
be20	52+26RU	39+7	Sum	20	5200	19.08	0.26	19.34	30	Pass
be20	52+26RU	39+7	Ant1	20	5240	13.61	0.26	13.87	30	Pass
be20	52+26RU	39+7	Ant2	20	5240	13.49	0.26	13.75	30	Pass
be20	52+26RU	39+7	Ant3	20	5240	14.91	0.26	15.17	30	Pass
be20	52+26RU	39+7	Sum	20	5240	18.82	0.26	19.08	30	Pass
be20	52+26RU	39+7	Ant1	13	5260	6.01	0.29	6.3	23.95	Pass
be20	52+26RU	39+7	Ant2	13	5260	6.92	0.29	7.21	23.95	Pass
be20	52+26RU	39+7	Ant3	13	5260	9.19	0.29	9.48	23.95	Pass
be20	52+26RU	39+7	Sum	13	5260	12.36	0.29	12.65	23.95	Pass
be20	52+26RU	39+7	Ant1	13	5280	5.86	0.28	6.14	23.95	Pass
be20	52+26RU	39+7	Ant2	13	5280	6.9	0.28	7.18	23.95	Pass
be20	52+26RU	39+7	Ant3	13	5280	8.62	0.28	8.9	23.95	Pass
be20	52+26RU	39+7	Sum	13	5280	12.05	0.28	12.33	23.95	Pass
be20	52+26RU	39+7	Ant1	13	5320	4.68	0.26	4.94	23.95	Pass