




5.2.47 TM3_5MHz_HCH_RB1#0

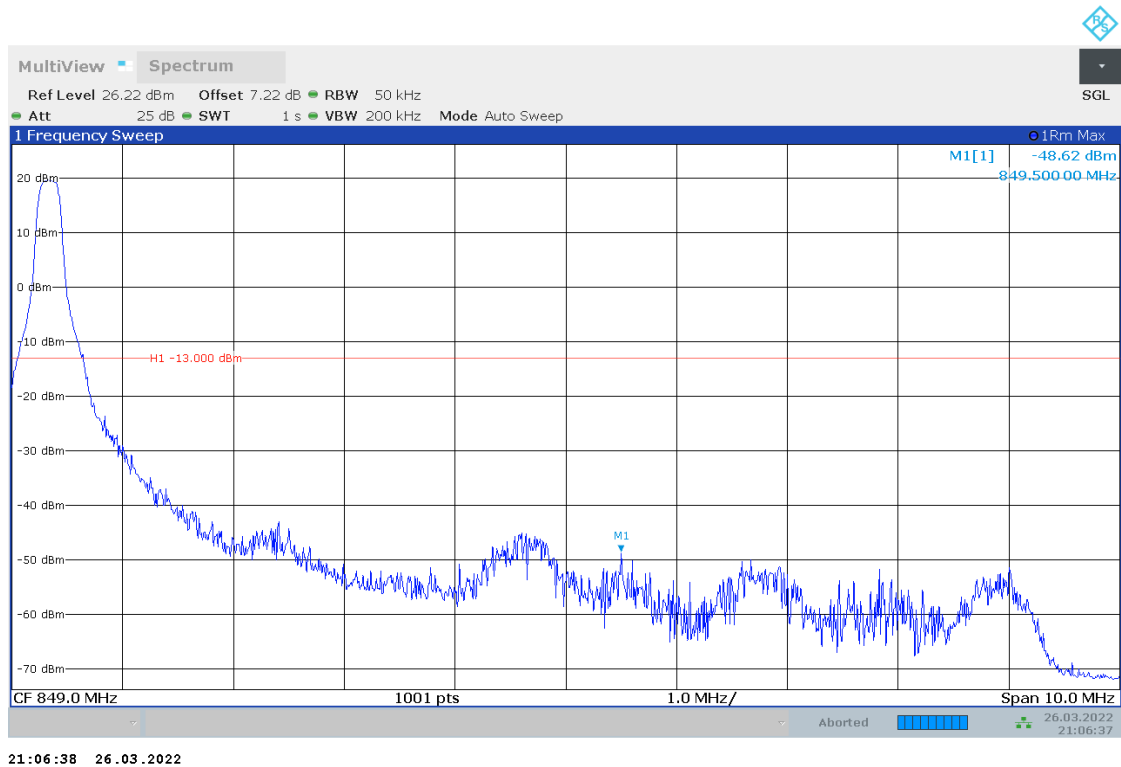


5.2.48 TM3_5MHz_HCH_RB1#24

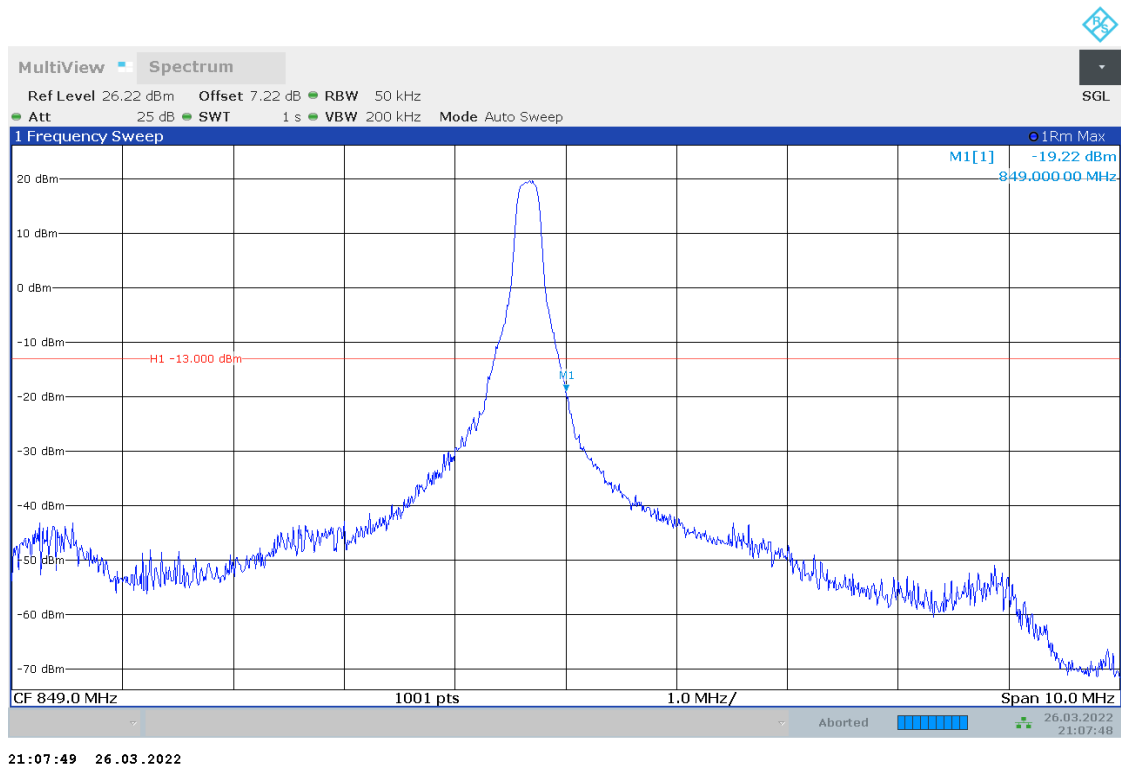

5.2.49 TM3_10MHz_LCH_RB50#0

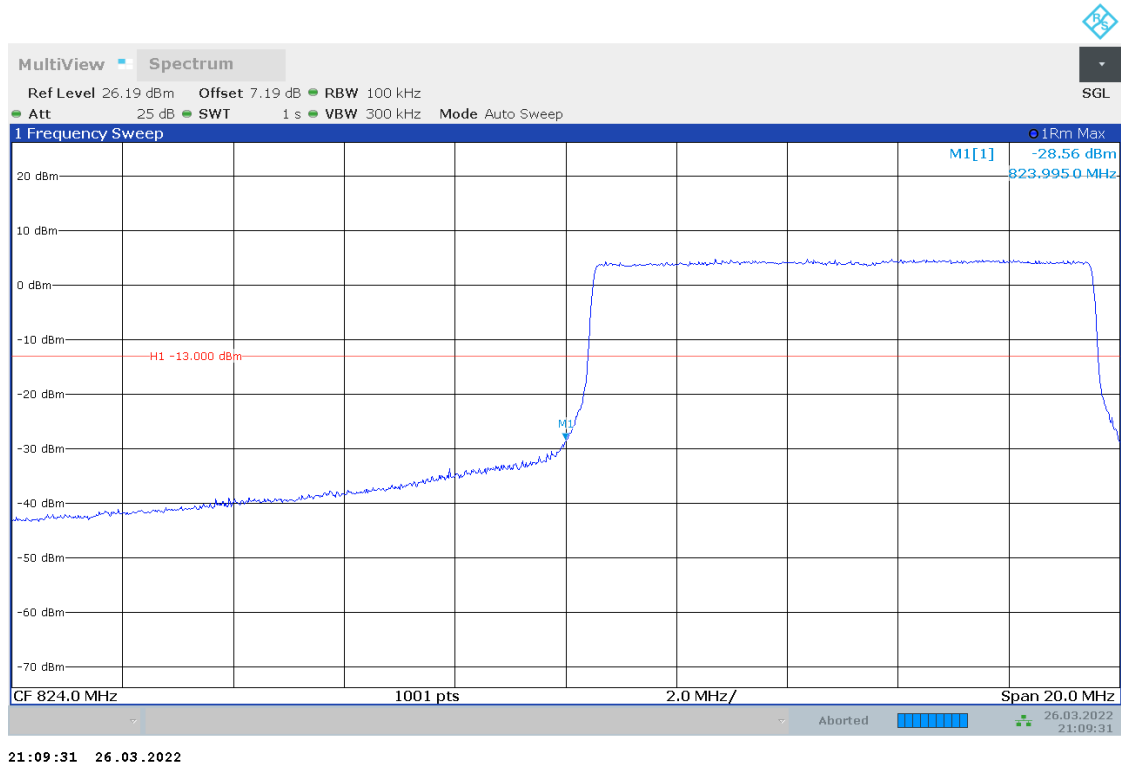


5.2.50 TM3_10MHz_LCH_RB1#0

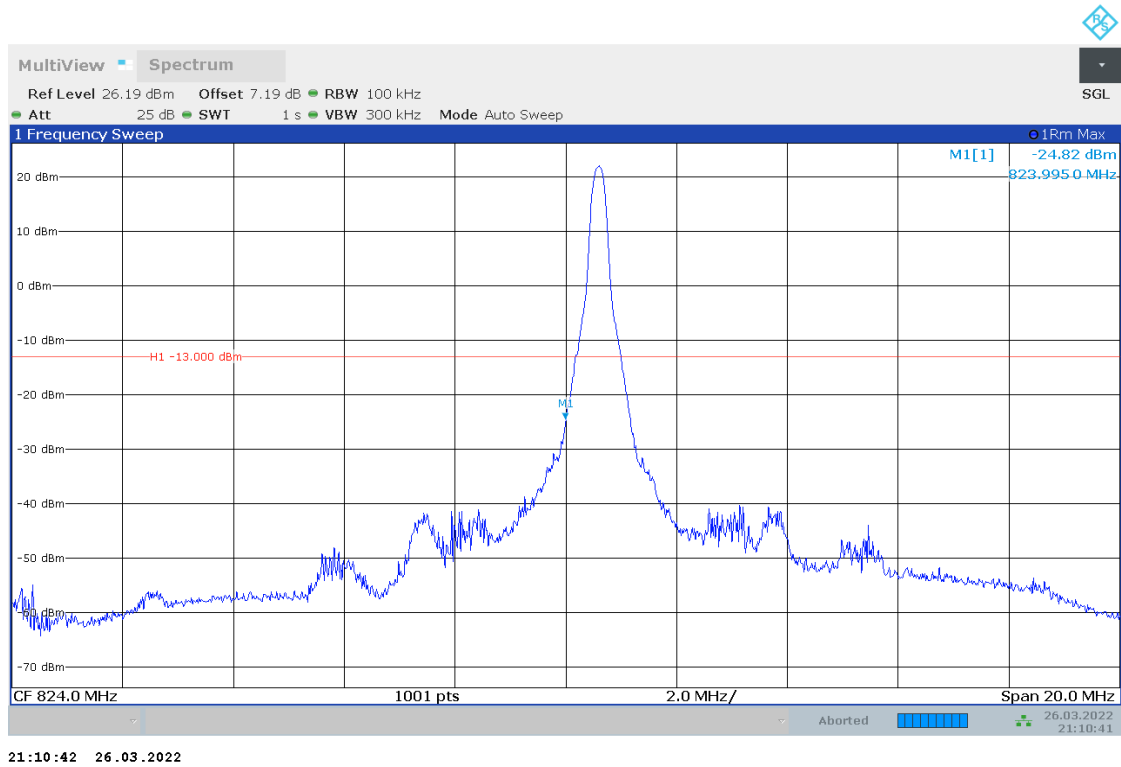

5.2.51 TM3_10MHz_LCH_RB1#49




5.2.52 TM3_10MHz_HCH_RB50#0

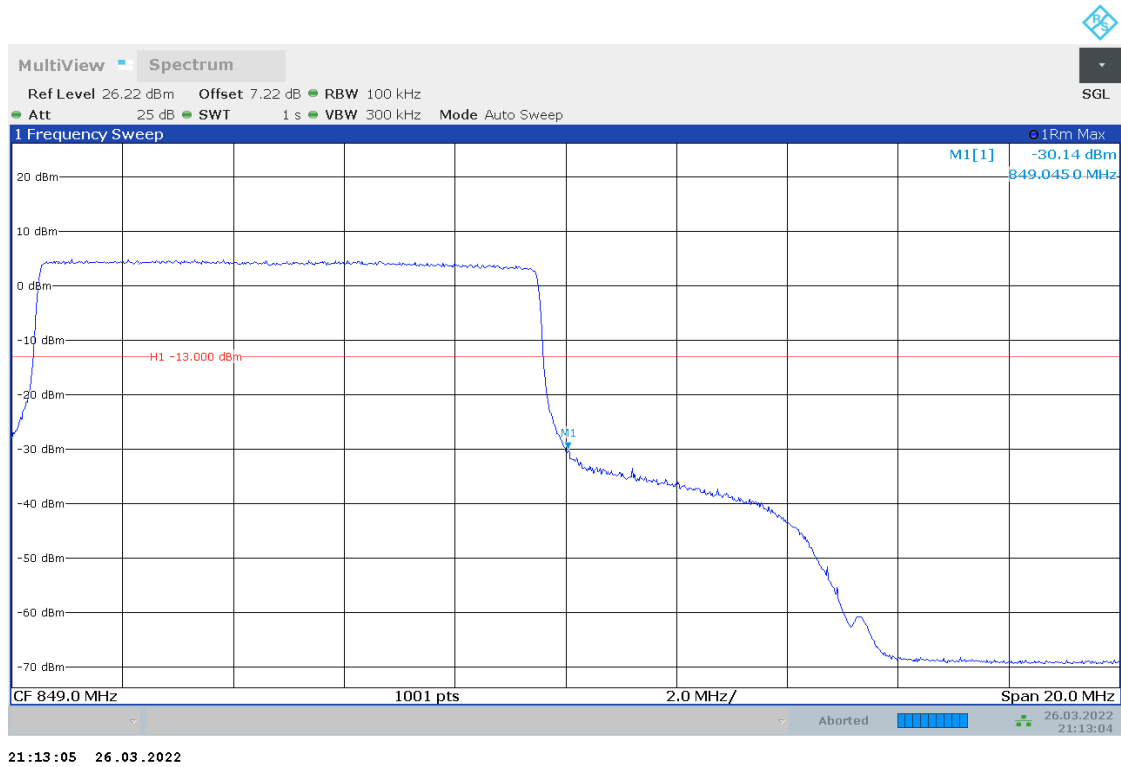

5.2.53 TM3_10MHz_HCH_RB1#0



5.2.54 TM3_10MHz_HCH_RB1#49

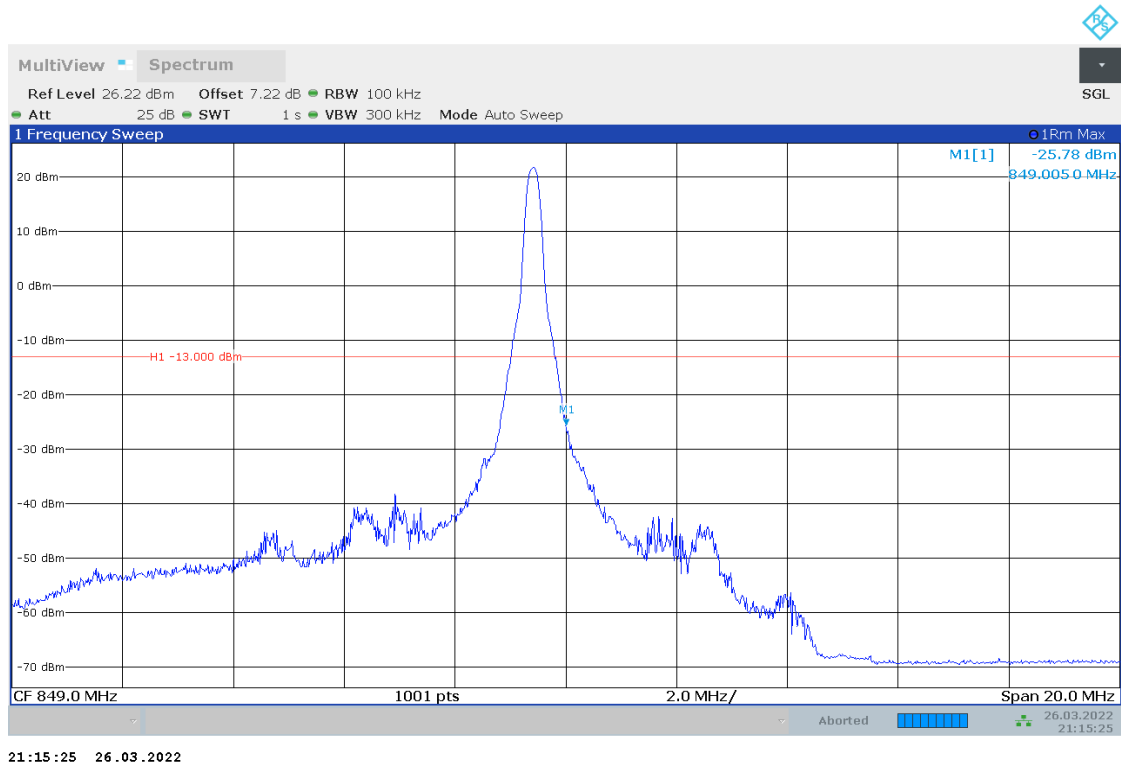

6. Appendix_F: Spurious Emission at Antenna Terminal

6.1 Test Results

Spurious Emission at Antenna Terminal								
Test Mode	Test Bandwidth [MHz]	Test Channel	Test RB	Modulation	Frequency [MHz]	Power [dBm]	Limit [dBm]	Verdict
TM1	1.4	LCH	RB1#0	QPSK	0.01	-83.22	-33	PASS
			RB1#0	QPSK	20.24	-78.33	-23	PASS
			RB1#0	QPSK	822.92	-29.31	-13	PASS
			RB1#0	QPSK	2472.68	-43.26	-13	PASS
			RB1#5	QPSK	0.01	-84.88	-33	PASS
			RB1#5	QPSK	22.94	-78.69	-23	PASS
			RB1#5	QPSK	822.82	-36.09	-13	PASS
			RB1#5	QPSK	12255.78	-42.54	-13	PASS
			RB6#0	QPSK	0.01	-83.52	-33	PASS
			RB6#0	QPSK	0.15	-78.12	-23	PASS
			RB6#0	QPSK	822.89	-17.51	-13	PASS
			RB6#0	QPSK	7931	-43.03	-13	PASS
		MCH	RB1#0	QPSK	0.01	-84.00	-33	PASS
			RB1#0	QPSK	29.87	-77.66	-23	PASS
			RB1#0	QPSK	881.21	-47.24	-13	PASS
			RB1#0	QPSK	7944.52	-42.74	-13	PASS
			RB1#5	QPSK	0.01	-84.61	-33	PASS
			RB1#5	QPSK	26.28	-78.80	-23	PASS
			RB1#5	QPSK	881.77	-48.06	-13	PASS
			RB1#5	QPSK	12413.52	-42.49	-13	PASS
			RB6#0	QPSK	0.01	-83.44	-33	PASS
			RB6#0	QPSK	29.5	-78.89	-23	PASS
			RB6#0	QPSK	881.63	-48.74	-13	PASS
			RB6#0	QPSK	7963.02	-42.22	-13	PASS
		HCH	RB1#0	QPSK	0.01	-84.11	-33	PASS
			RB1#0	QPSK	28.95	-78.77	-23	PASS
			RB1#0	QPSK	850.15	-40.25	-13	PASS
			RB1#0	QPSK	7896.05	-42.66	-13	PASS
			RB1#5	QPSK	0.01	-83.72	-33	PASS
			RB1#5	QPSK	28.06	-78.72	-23	PASS
			RB1#5	QPSK	893.34	-48.27	-13	PASS
			RB1#5	QPSK	12464.04	-43.08	-13	PASS
			RB6#0	QPSK	0.01	-83.38	-33	PASS
			RB6#0	QPSK	19.36	-78.60	-23	PASS
			RB6#0	QPSK	850.17	-19.62	-13	PASS
			RB6#0	QPSK	12161.78	-42.90	-13	PASS

Spurious Emission at Antenna Terminal								
Test Mode	Test Bandwidth [MHz]	Test Channel	Test RB	Modulation	Frequency [MHz]	Power [dBm]	Limit [dBm]	Verdict
TM1	5	LCH	RB1#0	QPSK	0.01	-84.75	-33	PASS
			RB1#0	QPSK	18.33	-78.13	-23	PASS
			RB1#0	QPSK	822.82	-26.63	-13	PASS
			RB1#0	QPSK	7969.49	-42.50	-13	PASS
			RB1#24	QPSK	0.01	-82.17	-33	PASS
			RB1#24	QPSK	23.85	-78.65	-23	PASS
			RB1#24	QPSK	819.91	-29.63	-13	PASS
			RB1#24	QPSK	2486.48	-42.08	-13	PASS
			RB25#0	QPSK	0.01	-84.42	-33	PASS
			RB25#0	QPSK	28.19	-78.62	-23	PASS
			RB25#0	QPSK	822.82	-18.74	-13	PASS
			RB25#0	QPSK	12323.34	-42.87	-13	PASS
		MCH	RB1#0	QPSK	0.01	-84.04	-33	PASS
			RB1#0	QPSK	26.57	-78.35	-23	PASS
			RB1#0	QPSK	882.26	-47.39	-13	PASS
			RB1#0	QPSK	12288.97	-42.62	-13	PASS
			RB1#24	QPSK	0.01	-83.93	-33	PASS
			RB1#24	QPSK	27.95	-78.42	-23	PASS
			RB1#24	QPSK	882.21	-48.47	-13	PASS
			RB1#24	QPSK	11979.37	-42.73	-13	PASS
			RB25#0	QPSK	0.01	-84.04	-33	PASS
			RB25#0	QPSK	18.98	-78.76	-23	PASS
			RB25#0	QPSK	822.34	-37.98	-13	PASS
			RB25#0	QPSK	12232.57	-42.90	-13	PASS
		HCH	RB1#0	QPSK	0.01	-83.12	-33	PASS
			RB1#0	QPSK	17.73	-78.53	-23	PASS
			RB1#0	QPSK	852.84	-34.09	-13	PASS
			RB1#0	QPSK	7962.44	-43.13	-13	PASS
			RB1#24	QPSK	0.01	-84.40	-33	PASS
			RB1#24	QPSK	27.44	-78.90	-23	PASS
			RB1#24	QPSK	852.38	-38.03	-13	PASS
			RB1#24	QPSK	12521.91	-42.69	-13	PASS
			RB25#0	QPSK	0.01	-84.67	-33	PASS
			RB25#0	QPSK	26.49	-78.60	-23	PASS
			RB25#0	QPSK	850.1	-20.92	-13	PASS
			RB25#0	QPSK	12489.3	-42.59	-13	PASS

Spurious Emission at Antenna Terminal								
Test Mode	Test Bandwidth [MHz]	Test Channel	Test RB	Modulation	Frequency [MHz]	Power [dBm]	Limit [dBm]	Verdict
TM1	10	LCH	RB1#0	QPSK	0.01	-84.31	-33	PASS
			RB1#0	QPSK	22.63	-78.50	-23	PASS
			RB1#0	QPSK	821.73	-32.81	-13	PASS
			RB1#0	QPSK	7989.17	-42.86	-13	PASS
			RB1#49	QPSK	0.01	-84.69	-33	PASS
			RB1#49	QPSK	25.56	-78.81	-23	PASS
			RB1#49	QPSK	820.57	-45.62	-13	PASS
			RB1#49	QPSK	9308.36	-43.10	-13	PASS
			RB50#0	QPSK	0.01	-83.69	-33	PASS
			RB50#0	QPSK	26.38	-78.05	-23	PASS
			RB50#0	QPSK	822.89	-24.32	-13	PASS
			RB50#0	QPSK	7932.77	-43.21	-13	PASS
		MCH	RB1#0	QPSK	0.01	-84.46	-33	PASS
			RB1#0	QPSK	26.06	-78.20	-23	PASS
			RB1#0	QPSK	819.67	-44.84	-13	PASS
			RB1#0	QPSK	7962.44	-43.16	-13	PASS
			RB1#49	QPSK	0.01	-84.60	-33	PASS
			RB1#49	QPSK	29.12	-78.17	-23	PASS
			RB1#49	QPSK	879.98	-47.13	-13	PASS
			RB1#49	QPSK	2522.32	-42.72	-13	PASS
			RB50#0	QPSK	0.01	-84.12	-33	PASS
			RB50#0	QPSK	21.52	-78.47	-23	PASS
			RB50#0	QPSK	822.05	-30.39	-13	PASS
			RB50#0	QPSK	7990.93	-42.36	-13	PASS
		HCH	RB1#0	QPSK	0.01	-83.83	-33	PASS
			RB1#0	QPSK	28.03	-78.37	-23	PASS
			RB1#0	QPSK	850.35	-46.52	-13	PASS
			RB1#0	QPSK	12344.49	-42.49	-13	PASS
			RB1#49	QPSK	0.01	-83.79	-33	PASS
			RB1#49	QPSK	27.5	-78.86	-23	PASS
			RB1#49	QPSK	851.58	-26.48	-13	PASS
			RB1#49	QPSK	12308.65	-42.64	-13	PASS
			RB50#0	QPSK	0.01	-84.44	-33	PASS
			RB50#0	QPSK	21.2	-78.84	-23	PASS
			RB50#0	QPSK	850.08	-23.15	-13	PASS
			RB50#0	QPSK	7978.59	-42.33	-13	PASS


Spurious Emission at Antenna Terminal								
Test Mode	Test Bandwidth [MHz]	Test Channel	Test RB	Modulation	Frequency [MHz]	Power [dBm]	Limit [dBm]	Verdict
TM2	1.4	LCH	RB1#0	16QAM	0.01	-84.29	-33	PASS
			RB1#0	16QAM	29.28	-78.59	-23	PASS
			RB1#0	16QAM	822.87	-30.66	-13	PASS
			RB1#0	16QAM	7360.26	-42.84	-13	PASS
			RB1#5	16QAM	0.01	-82.27	-33	PASS
			RB1#5	16QAM	25.34	-78.43	-23	PASS
			RB1#5	16QAM	822.36	-35.87	-13	PASS
			RB1#5	16QAM	12417.34	-42.43	-13	PASS
			RB6#0	16QAM	0.01	-84.34	-33	PASS
			RB6#0	16QAM	26.31	-78.70	-23	PASS
			RB6#0	16QAM	822.92	-18.70	-13	PASS
			RB6#0	16QAM	7941.29	-42.91	-13	PASS
		MCH	RB1#0	16QAM	0.01	-84.08	-33	PASS
			RB1#0	16QAM	26.98	-78.93	-23	PASS
			RB1#0	16QAM	881.38	-48.33	-13	PASS
			RB1#0	16QAM	2508.22	-41.57	-13	PASS
			RB1#5	16QAM	0.01	-84.24	-33	PASS
			RB1#5	16QAM	25.53	-78.25	-23	PASS
			RB1#5	16QAM	881.41	-48.68	-13	PASS
			RB1#5	16QAM	2511.16	-42.04	-13	PASS
			RB6#0	16QAM	0.01	-83.89	-33	PASS
			RB6#0	16QAM	15.86	-79.03	-23	PASS
			RB6#0	16QAM	881.29	-48.08	-13	PASS
			RB6#0	16QAM	7948.34	-43.14	-13	PASS
		HCH	RB1#0	16QAM	0.01	-83.94	-33	PASS
			RB1#0	16QAM	27.94	-78.83	-23	PASS
			RB1#0	16QAM	850.08	-37.56	-13	PASS
			RB1#0	16QAM	2543.76	-42.73	-13	PASS
			RB1#5	16QAM	0.01	-84.69	-33	PASS
			RB1#5	16QAM	17.49	-78.35	-23	PASS
			RB1#5	16QAM	851.39	-34.60	-13	PASS
			RB1#5	16QAM	12451.7	-42.49	-13	PASS
			RB6#0	16QAM	0.01	-84.20	-33	PASS
			RB6#0	16QAM	27.58	-78.12	-23	PASS
			RB6#0	16QAM	893.05	-48.03	-13	PASS
			RB6#0	16QAM	7985.93	-42.54	-13	PASS

Spurious Emission at Antenna Terminal								
Test Mode	Test Bandwidth [MHz]	Test Channel	Test RB	Modulation	Frequency [MHz]	Power [dBm]	Limit [dBm]	Verdict
TM2	5	LCH	RB1#0	16QAM	0.01	-84.00	-33	PASS
			RB1#0	16QAM	28.68	-78.65	-23	PASS
			RB1#0	16QAM	822.17	-23.44	-13	PASS
			RB1#0	16QAM	2472.97	-41.98	-13	PASS
			RB1#24	16QAM	0.01	-84.44	-33	PASS
			RB1#24	16QAM	28.02	-78.19	-23	PASS
			RB1#24	16QAM	820.13	-23.50	-13	PASS
			RB1#24	16QAM	12405	-42.76	-13	PASS
			RB25#0	16QAM	0.01	-84.46	-33	PASS
			RB25#0	16QAM	11	-78.78	-23	PASS
			RB25#0	16QAM	822.12	-17.59	-13	PASS
			RB25#0	16QAM	7780.02	-42.75	-13	PASS
		MCH	RB1#0	16QAM	0.01	-83.17	-33	PASS
			RB1#0	16QAM	24.61	-78.19	-23	PASS
			RB1#0	16QAM	882.43	-46.90	-13	PASS
			RB1#0	16QAM	2503.23	-42.46	-13	PASS
			RB1#24	16QAM	0.01	-82.83	-33	PASS
			RB1#24	16QAM	18.96	-78.58	-23	PASS
			RB1#24	16QAM	881.53	-47.38	-13	PASS
			RB1#24	16QAM	2516.15	-42.13	-13	PASS
			RB25#0	16QAM	0.01	-83.77	-33	PASS
			RB25#0	16QAM	26.54	-78.59	-23	PASS
			RB25#0	16QAM	821.85	-37.97	-13	PASS
			RB25#0	16QAM	7960.38	-43.11	-13	PASS
		HCH	RB1#0	16QAM	0.01	-84.52	-33	PASS
			RB1#0	16QAM	11.43	-78.60	-23	PASS
			RB1#0	16QAM	852.91	-30.91	-13	PASS
			RB1#0	16QAM	12506.34	-42.61	-13	PASS
			RB1#24	16QAM	0.01	-82.97	-33	PASS
			RB1#24	16QAM	29.24	-78.05	-23	PASS
			RB1#24	16QAM	850.32	-24.15	-13	PASS
			RB1#24	16QAM	2545.82	-41.64	-13	PASS
			RB25#0	16QAM	0.01	-83.78	-33	PASS
			RB25#0	16QAM	26.85	-78.53	-23	PASS
			RB25#0	16QAM	850.2	-20.55	-13	PASS
			RB25#0	16QAM	7858.74	-42.95	-13	PASS


Spurious Emission at Antenna Terminal								
Test Mode	Test Bandwidth [MHz]	Test Channel	Test RB	Modulation	Frequency [MHz]	Power [dBm]	Limit [dBm]	Verdict
TM2	10	LCH	RB1#0	16QAM	0.01	-83.38	-33	PASS
			RB1#0	16QAM	18.33	-78.68	-23	PASS
			RB1#0	16QAM	822.19	-20.08	-13	PASS
			RB1#0	16QAM	2473.56	-42.05	-13	PASS
			RB1#49	16QAM	0.01	-83.37	-33	PASS
			RB1#49	16QAM	24.7	-78.56	-23	PASS
			RB1#49	16QAM	822.89	-41.33	-13	PASS
			RB1#49	16QAM	2500	-42.11	-13	PASS
			RB50#0	16QAM	0.01	-84.35	-33	PASS
			RB50#0	16QAM	21.97	-78.86	-23	PASS
			RB50#0	16QAM	822.89	-19.34	-13	PASS
			RB50#0	16QAM	12181.75	-43.01	-13	PASS
		MCH	RB1#0	16QAM	0.01	-83.96	-33	PASS
			RB1#0	16QAM	28.49	-78.39	-23	PASS
			RB1#0	16QAM	819.11	-36.34	-13	PASS
			RB1#0	16QAM	7979.47	-42.73	-13	PASS
			RB1#49	16QAM	0.01	-83.31	-33	PASS
			RB1#49	16QAM	25.24	-78.81	-23	PASS
			RB1#49	16QAM	850.88	-42.22	-13	PASS
			RB1#49	16QAM	2522.62	-42.09	-13	PASS
			RB50#0	16QAM	0.01	-83.69	-33	PASS
			RB50#0	16QAM	27.84	-78.95	-23	PASS
			RB50#0	16QAM	822.58	-29.50	-13	PASS
			RB50#0	16QAM	12194.09	-43.28	-13	PASS
		HCH	RB1#0	16QAM	0.01	-83.70	-33	PASS
			RB1#0	16QAM	29.44	-78.63	-23	PASS
			RB1#0	16QAM	850.93	-47.17	-13	PASS
			RB1#0	16QAM	2519.09	-41.99	-13	PASS
			RB1#49	16QAM	0.01	-83.30	-33	PASS
			RB1#49	16QAM	22.19	-78.61	-23	PASS
			RB1#49	16QAM	851.51	-23.84	-13	PASS
			RB1#49	16QAM	2545.53	-42.76	-13	PASS
			RB50#0	16QAM	0.01	-84.59	-33	PASS
			RB50#0	16QAM	24.16	-78.41	-23	PASS
			RB50#0	16QAM	850.08	-22.56	-13	PASS
			RB50#0	16QAM	12385.91	-42.92	-13	PASS

6.2 Test Plots


6.2.1 TM1_1.4MHz_LCH_RB1#0

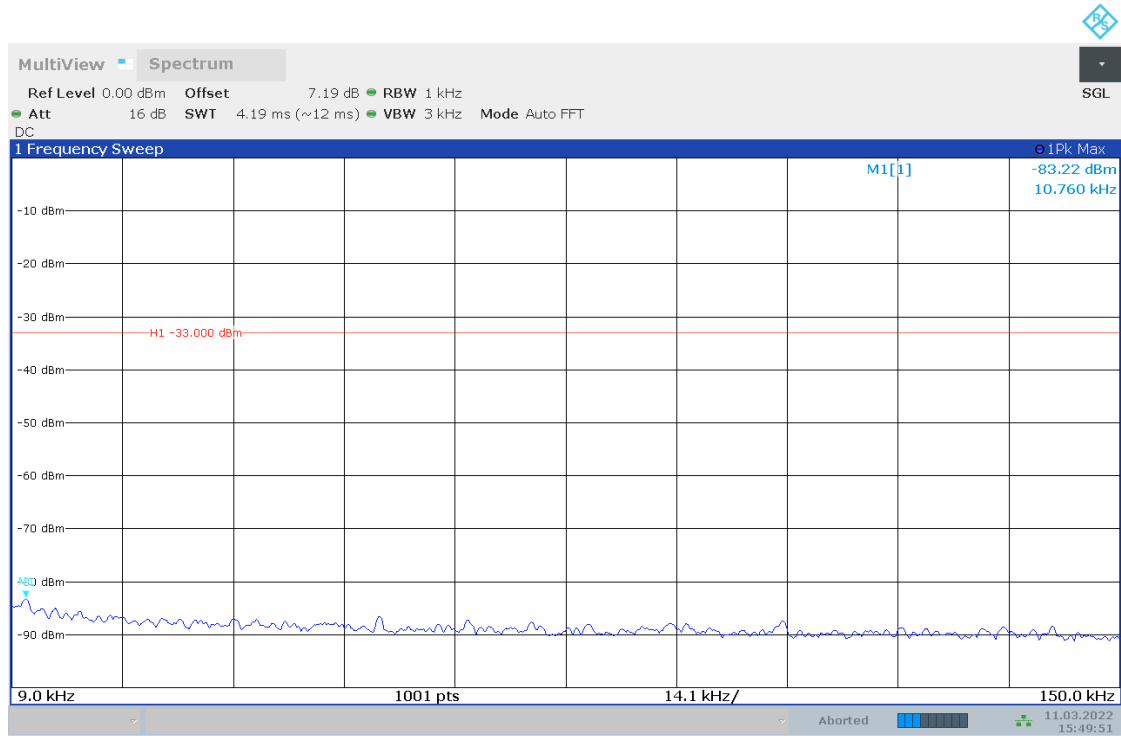


15:49:51 11.03.2022

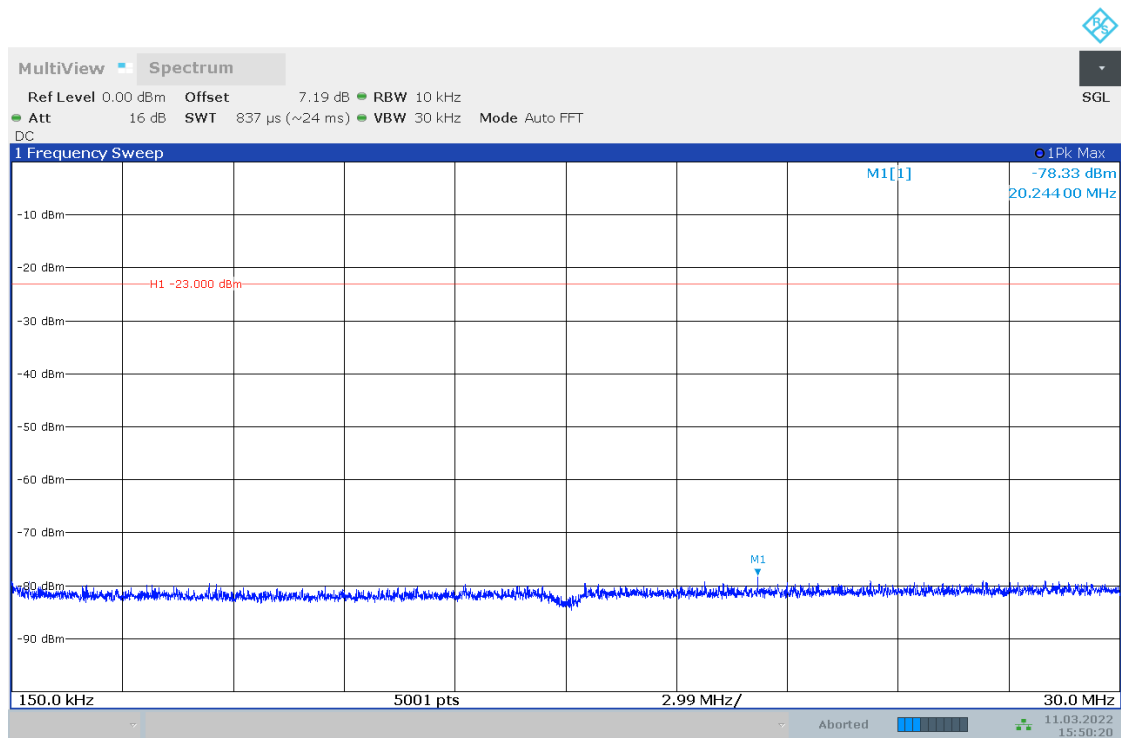

15:50:21 11.03.2022

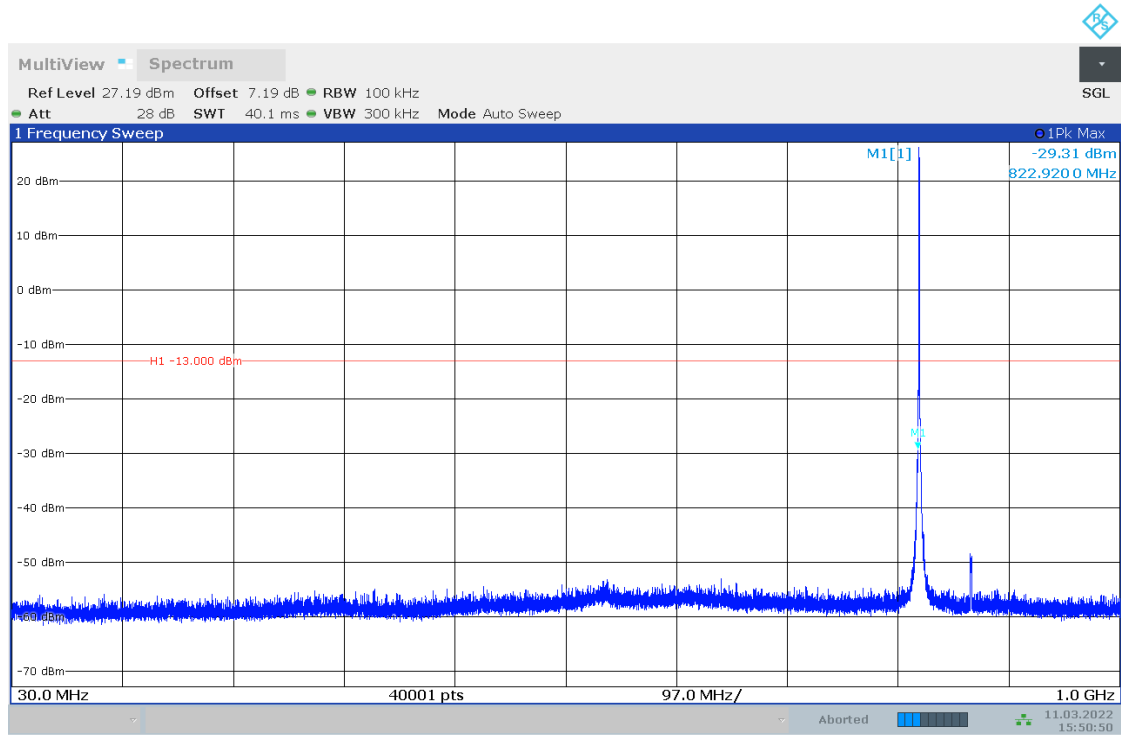


15:50:50 11.03.2022

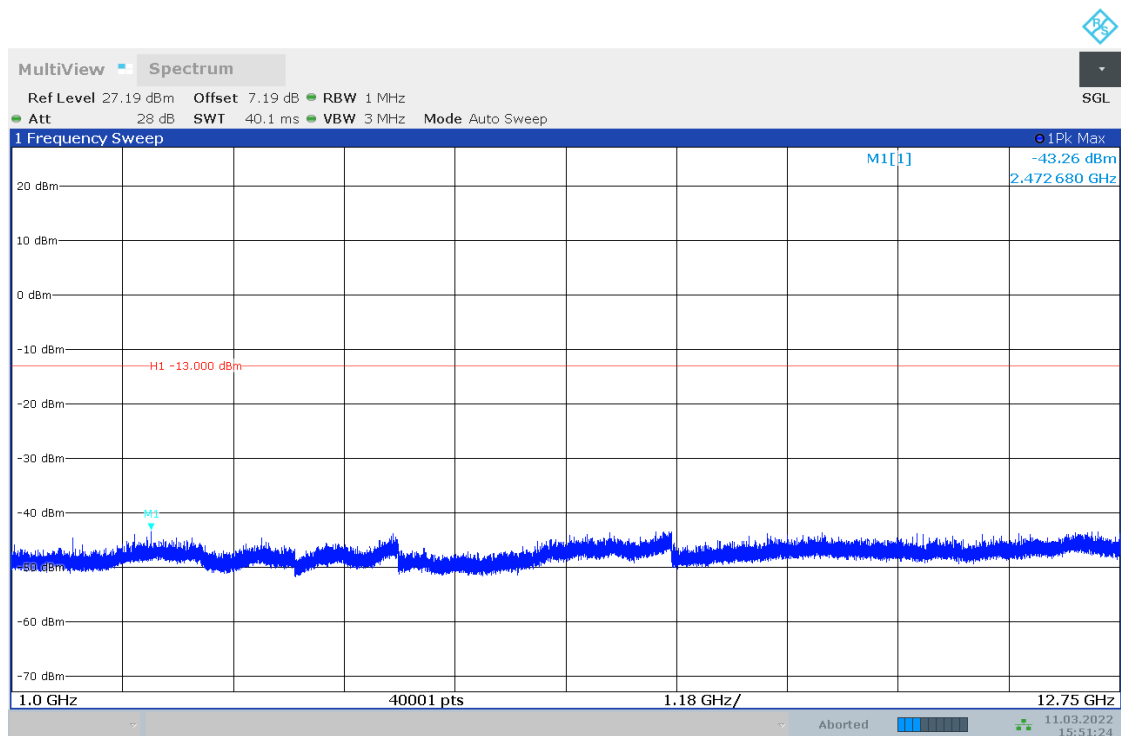


15:51:24 11.03.2022


6.2.2 TM1_1.4MHz_LCH_RB1#5

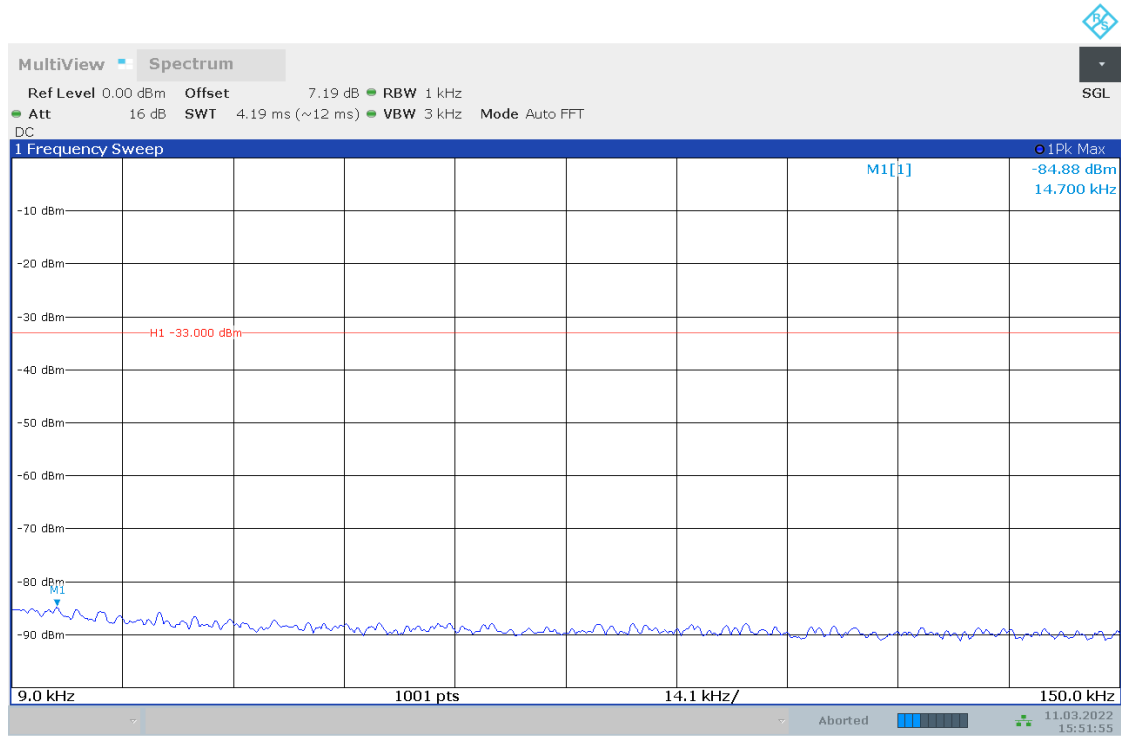


15:51:55 11.03.2022

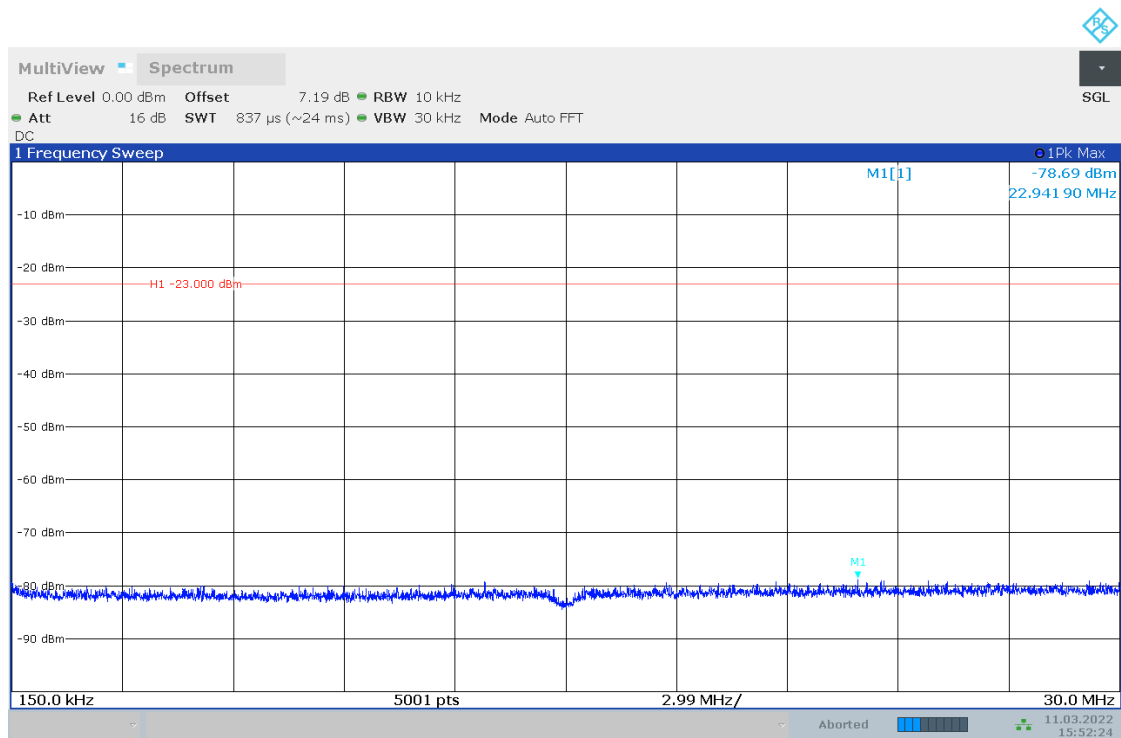

15:52:24 11.03.2022


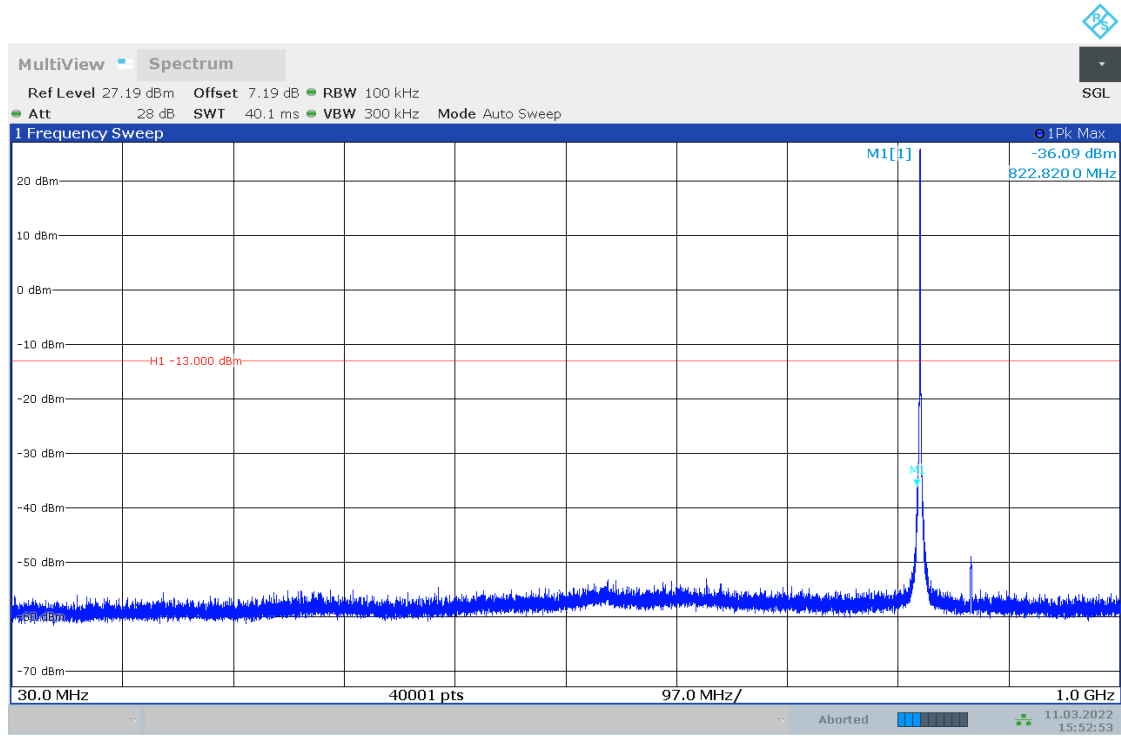



15:52:53 11.03.2022

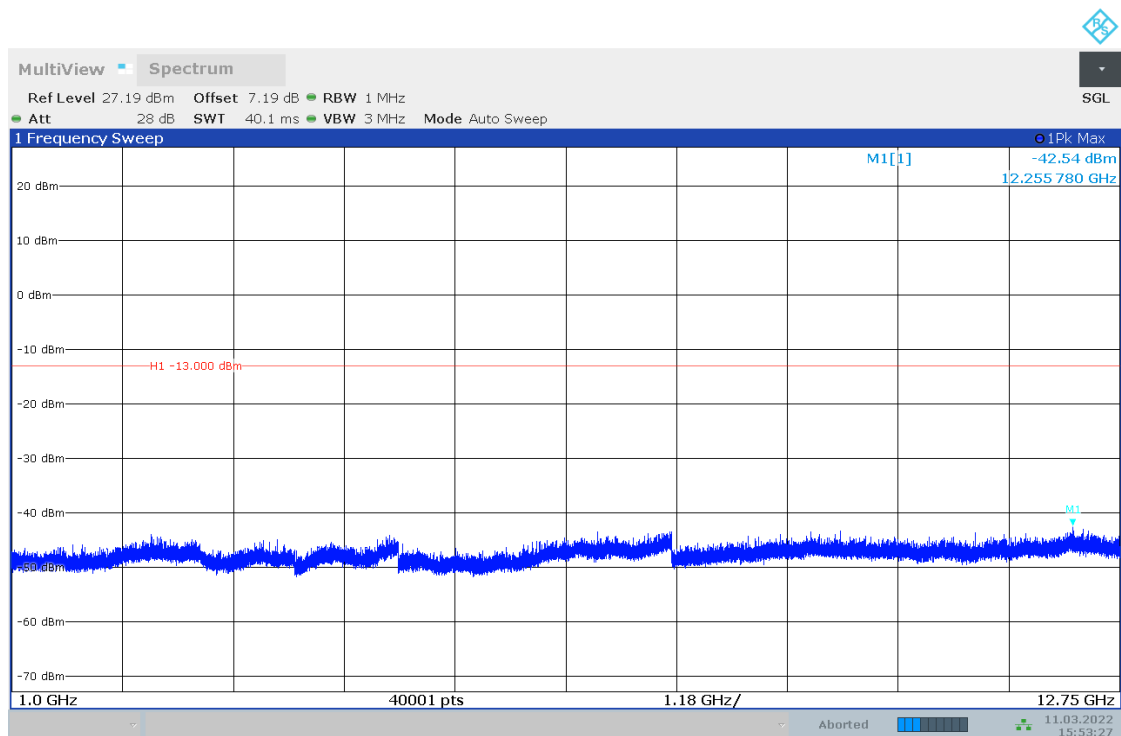


15:53:28 11.03.2022

6.2.3 TM1_1.4MHz_LCH_RB6#0

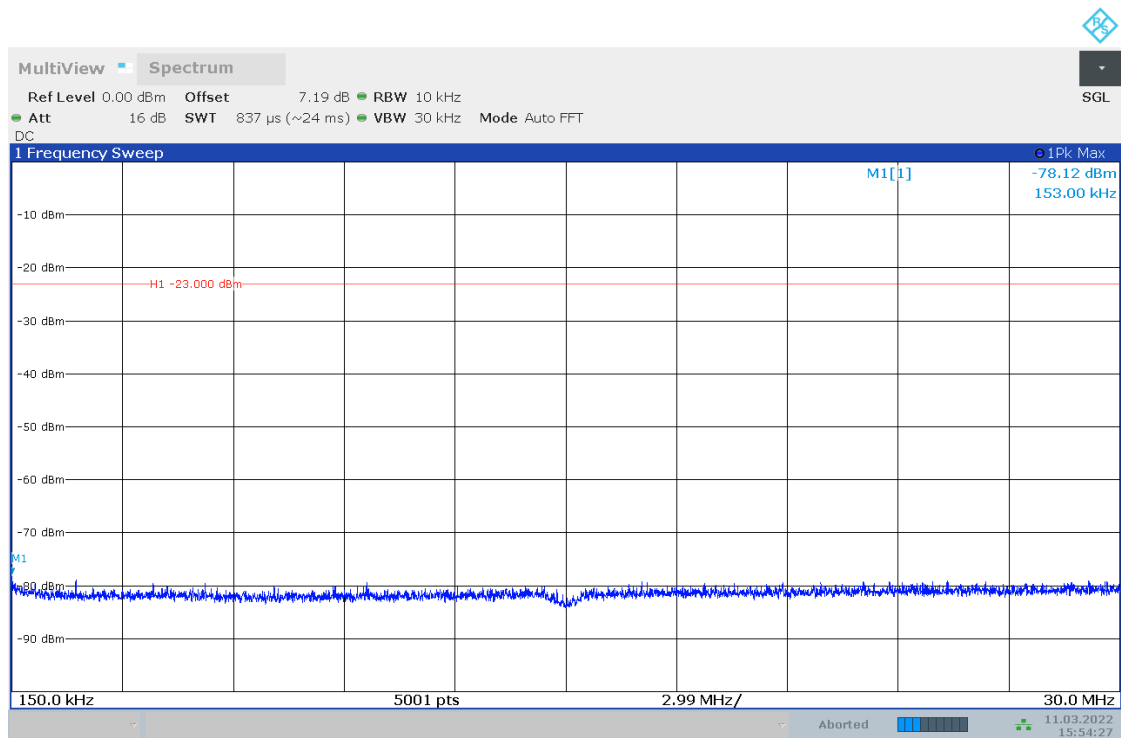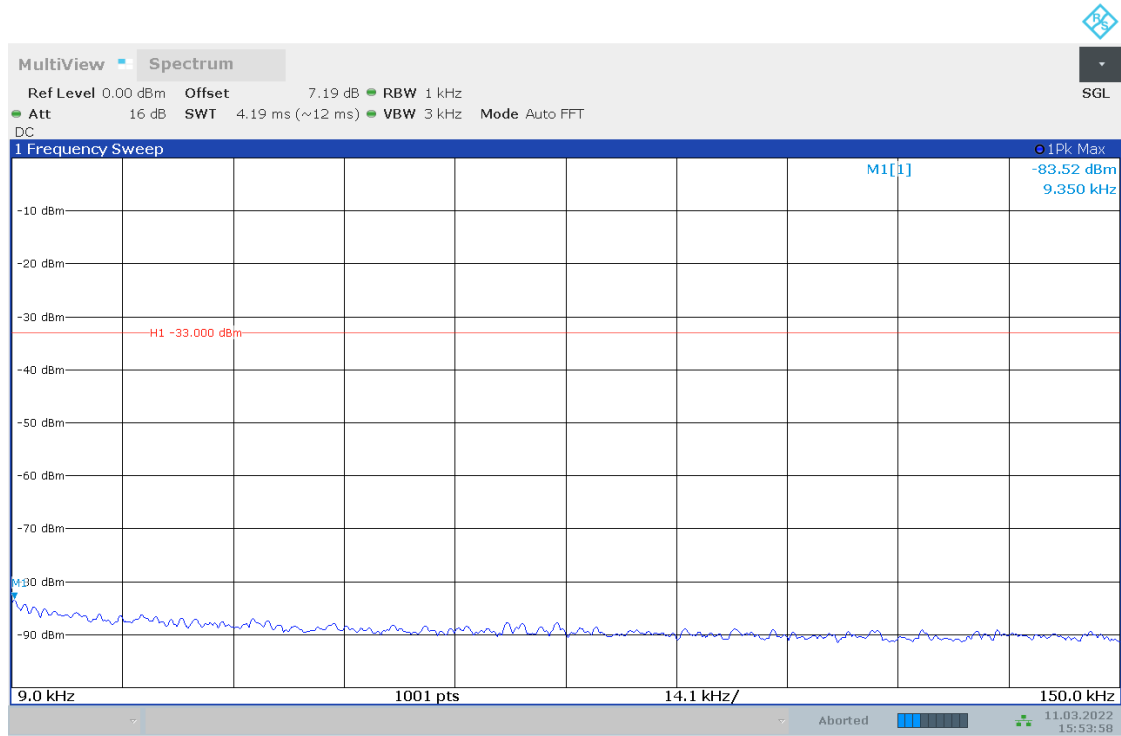

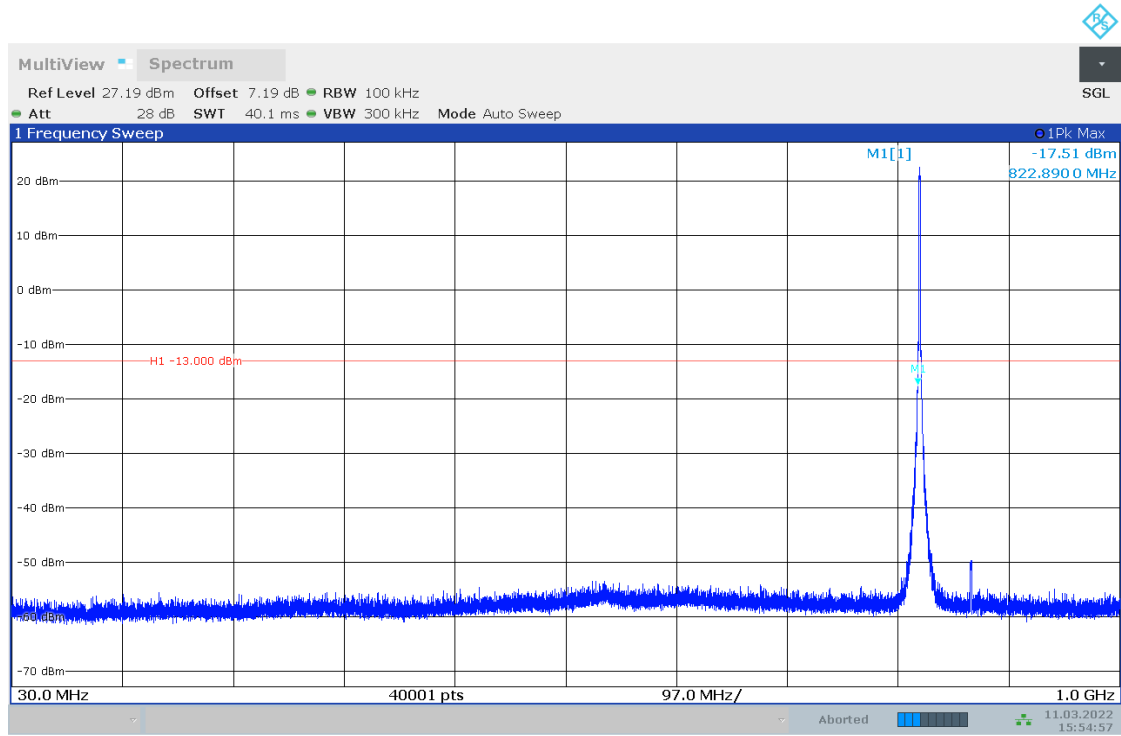


15:54:57 11.03.2022

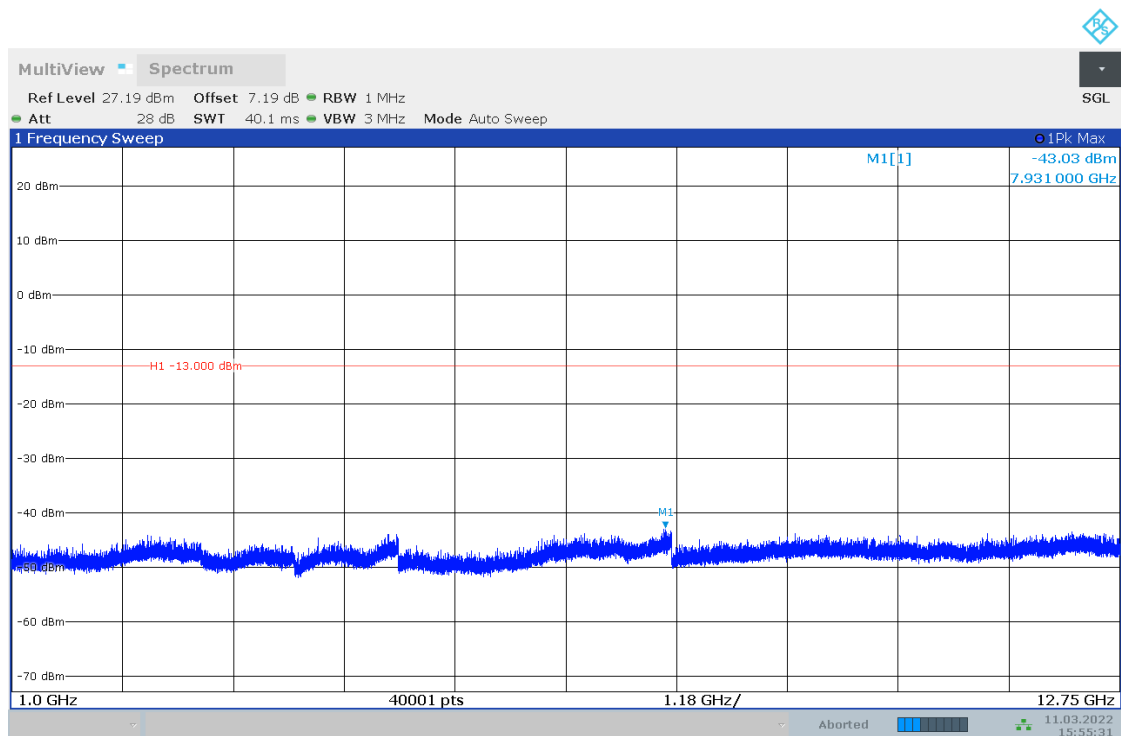


15:55:31 11.03.2022


6.2.4 TM1_1.4MHz_MCH_RB1#0

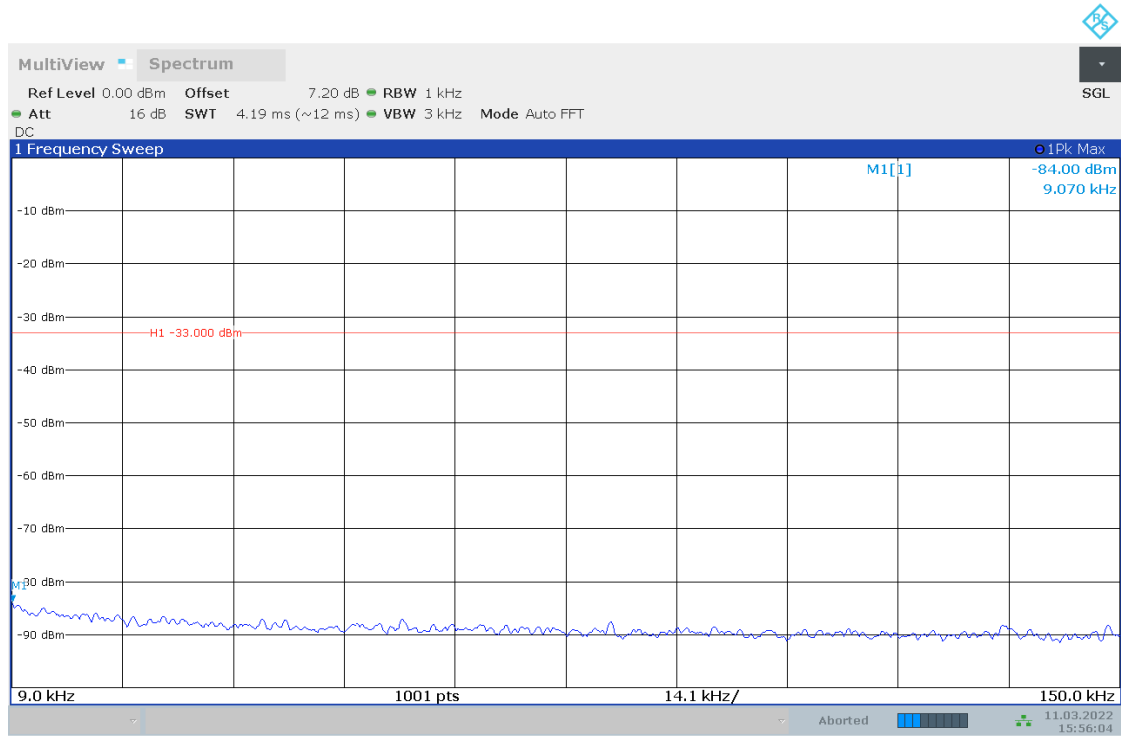


15:56:04 11.03.2022

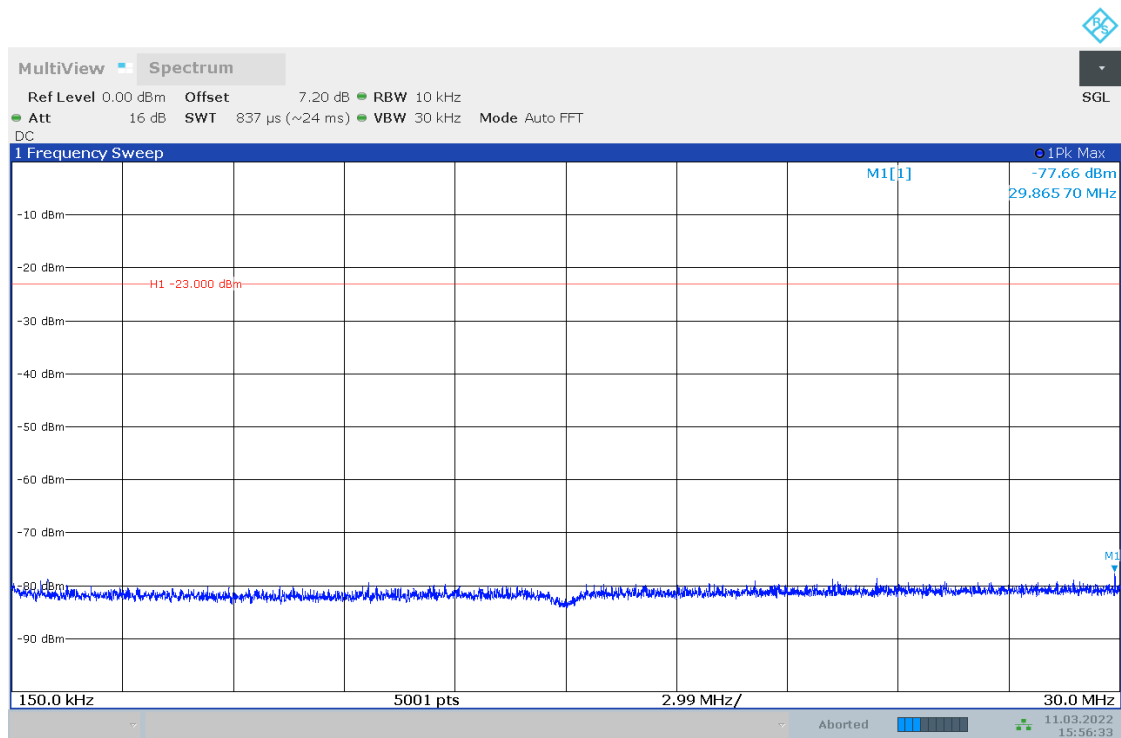

15:56:34 11.03.2022

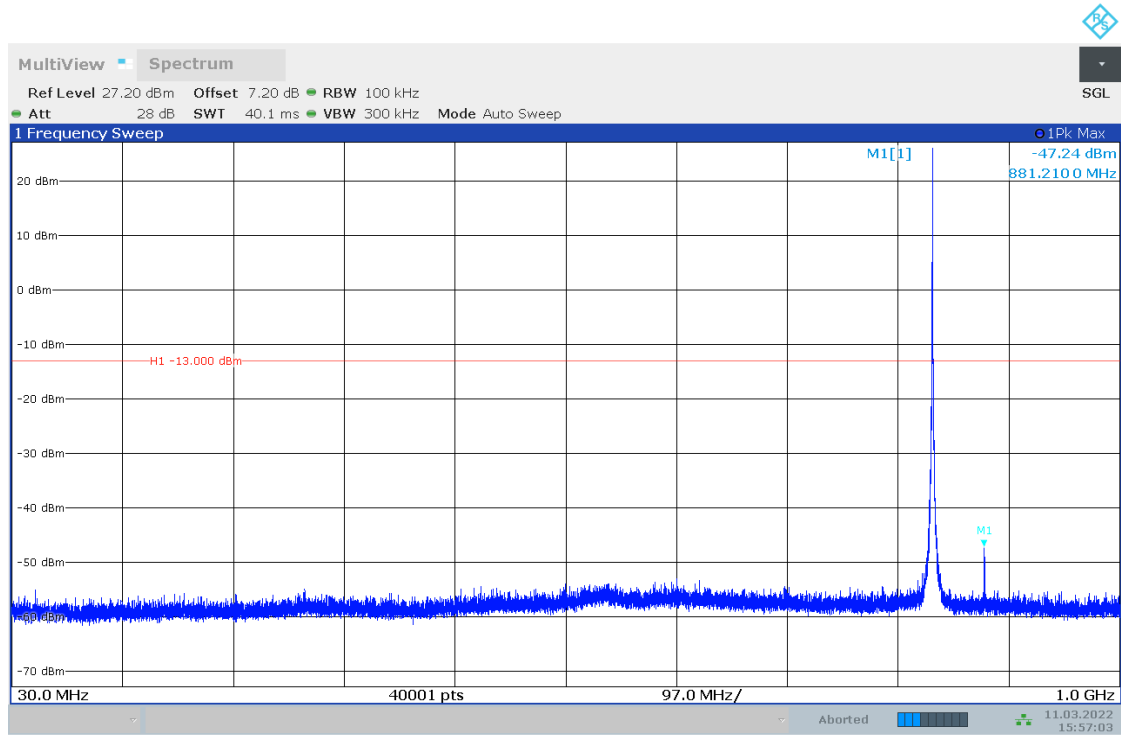


15:57:03 11.03.2022

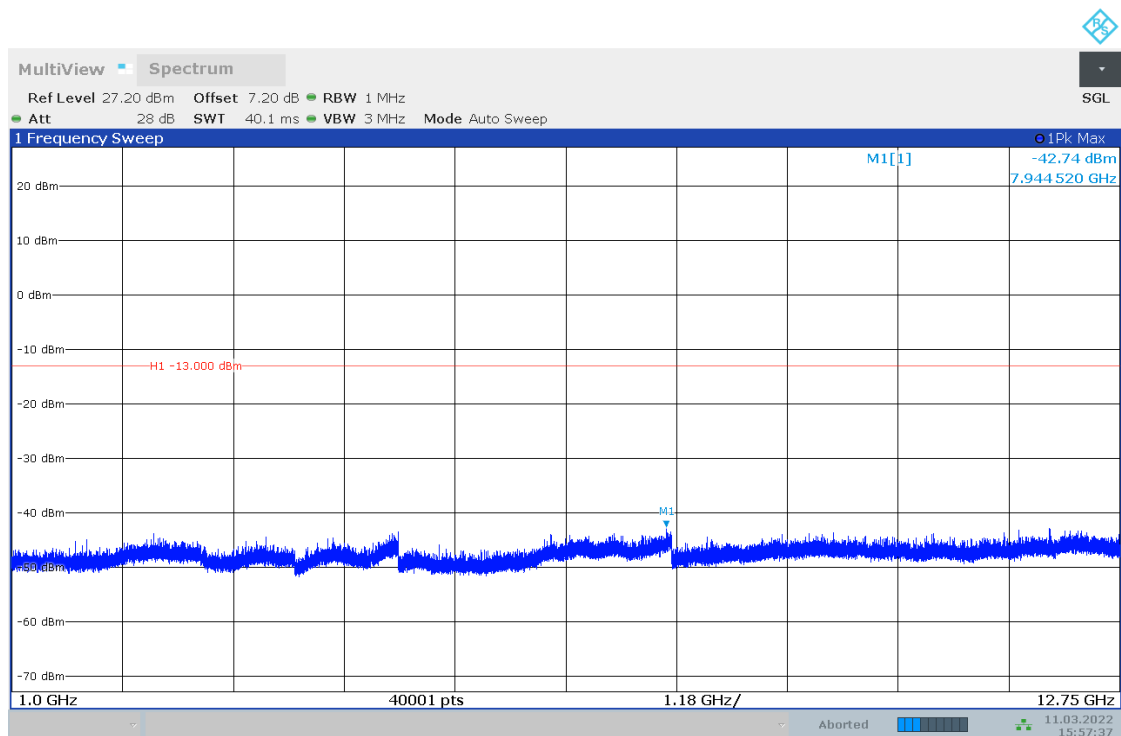


15:57:37 11.03.2022


6.2.5 TM1_1.4MHz_MCH_RB1#5

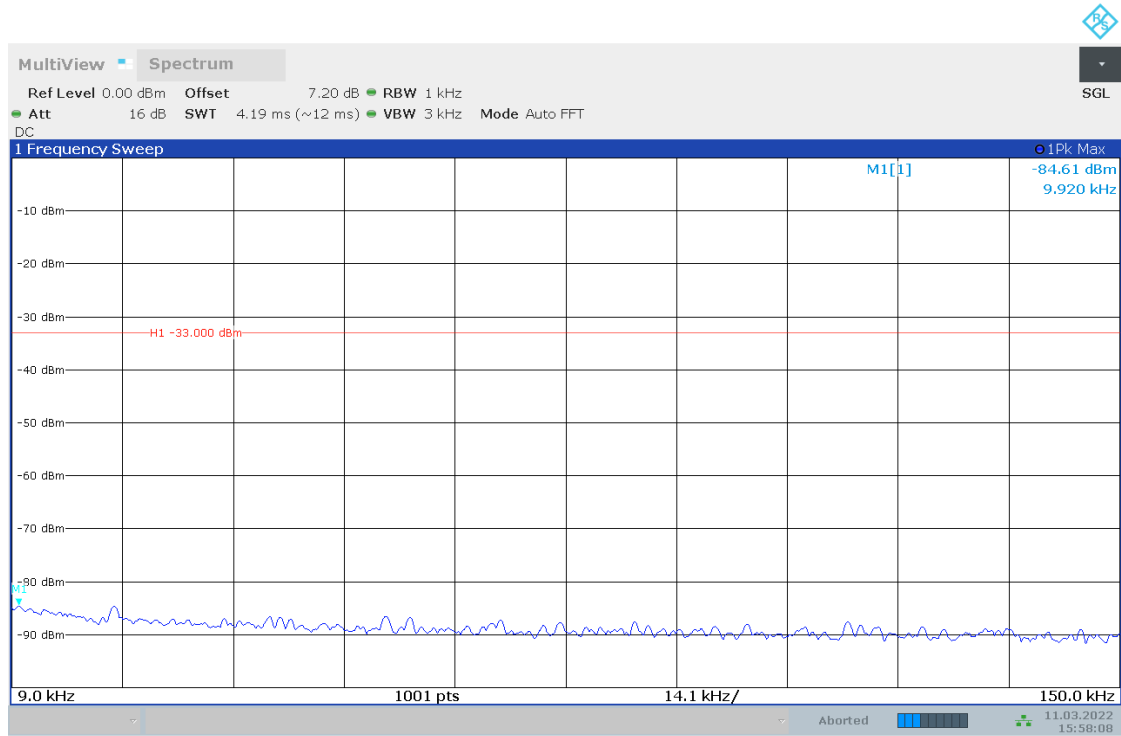


15:58:08 11.03.2022

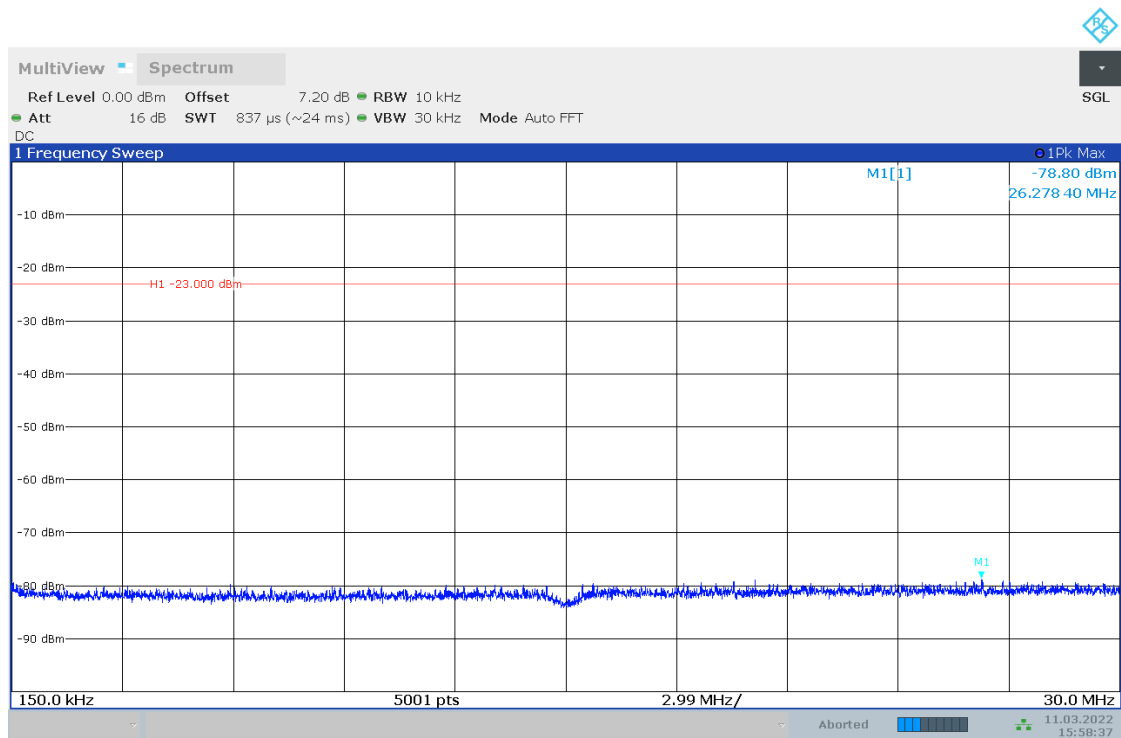

15:58:37 11.03.2022

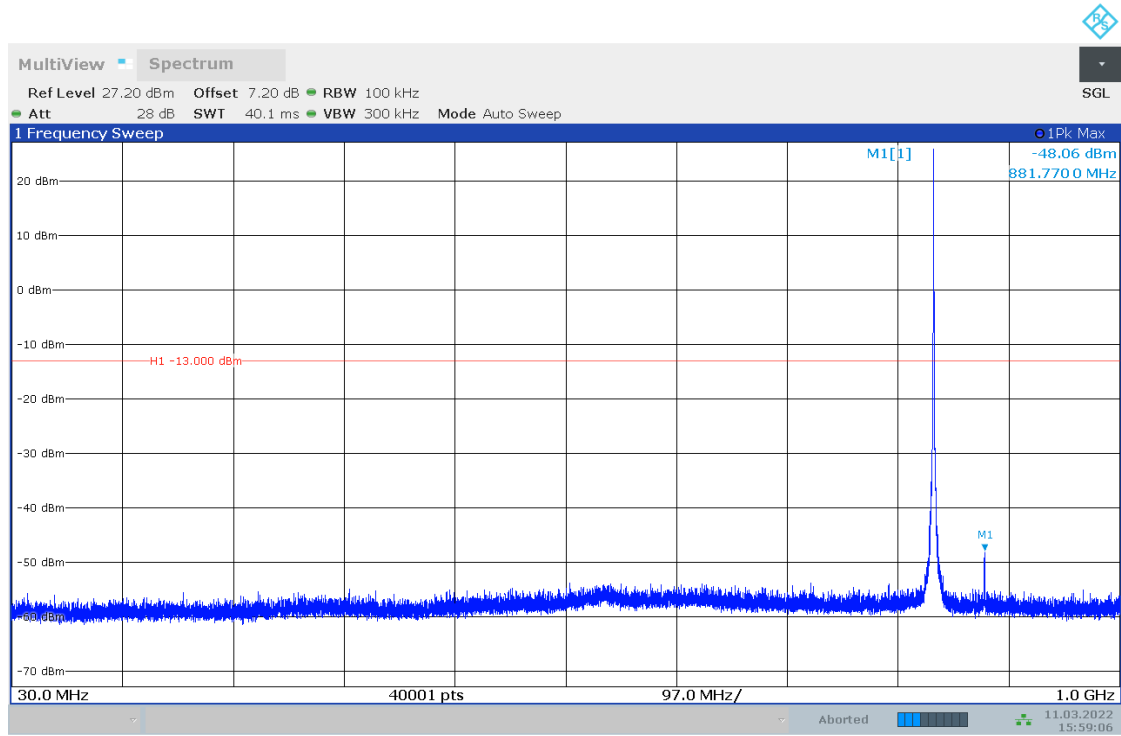


15:59:06 11.03.2022

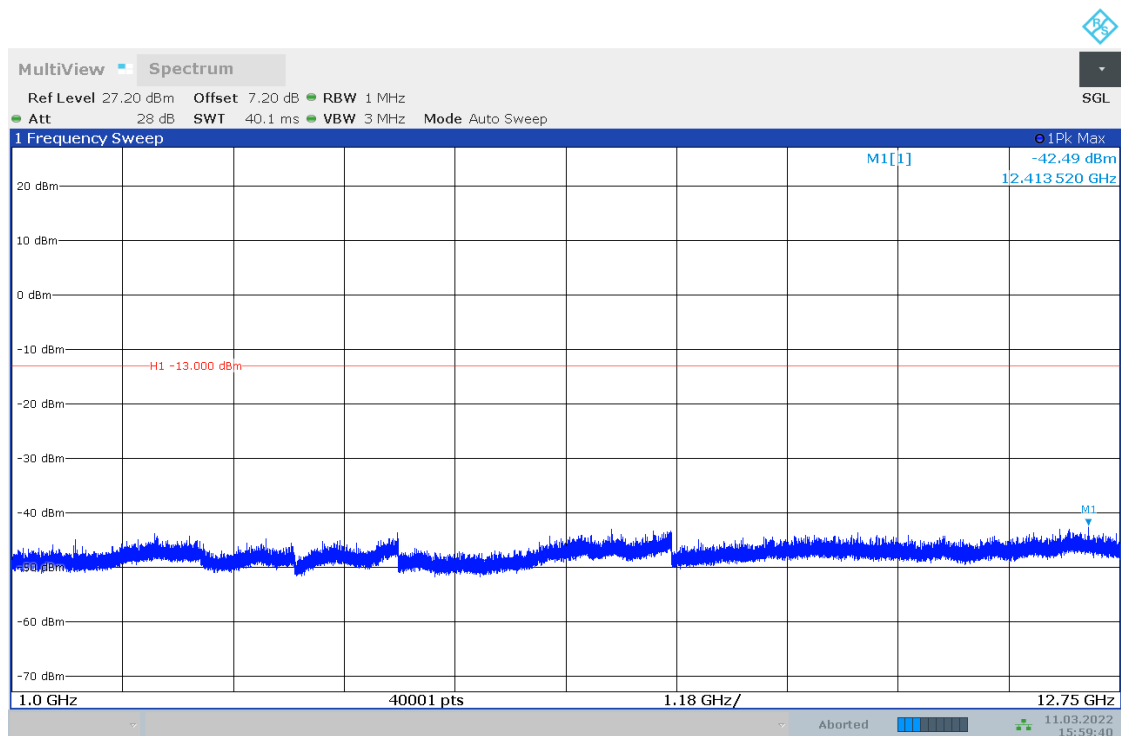


15:59:40 11.03.2022


6.2.6 TM1_1.4MHz_MCH_RB6#0

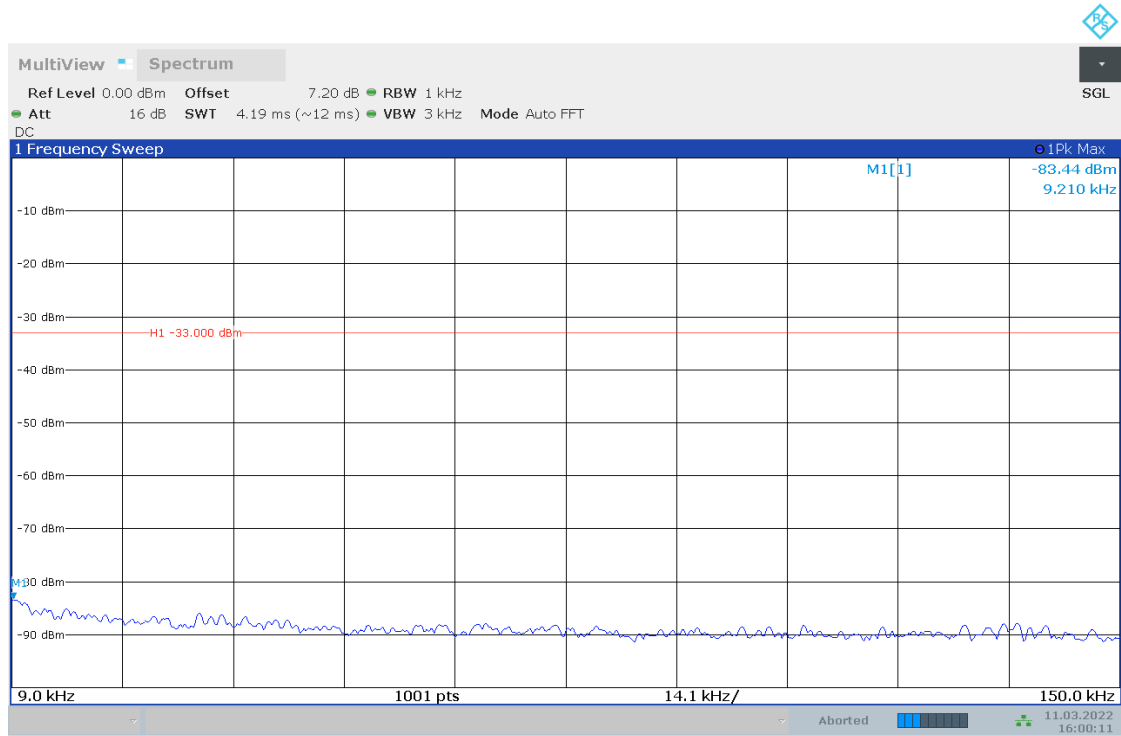


16:00:11 11.03.2022

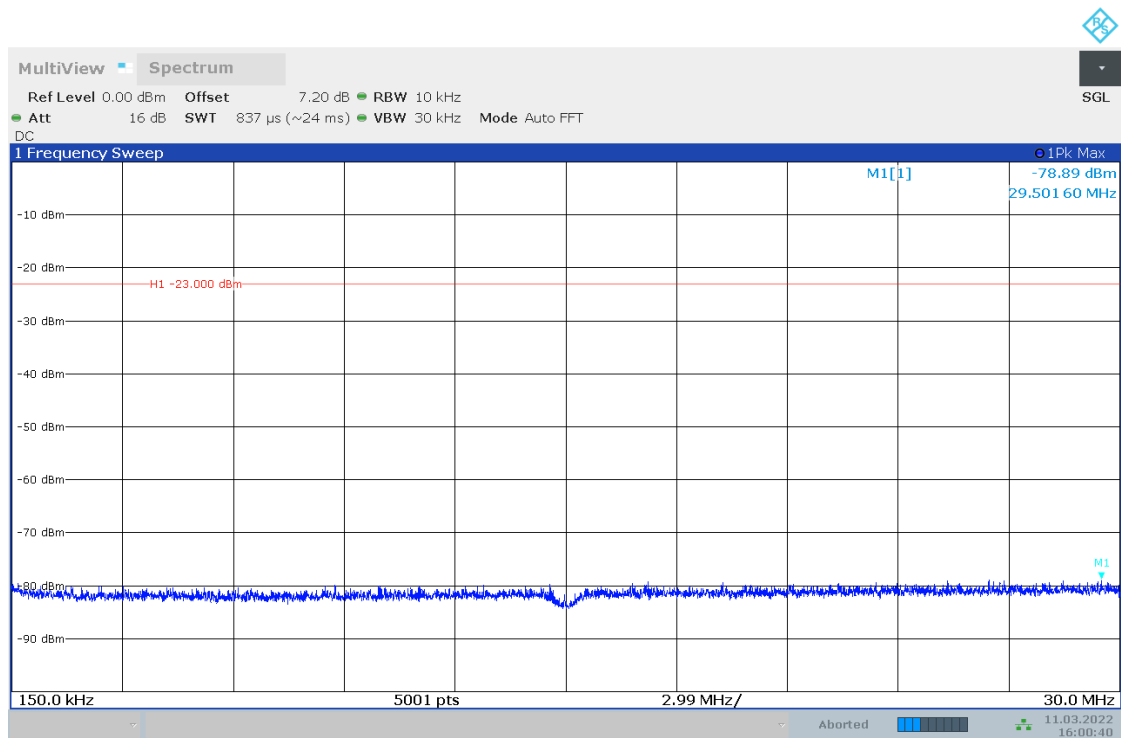

16:00:41 11.03.2022

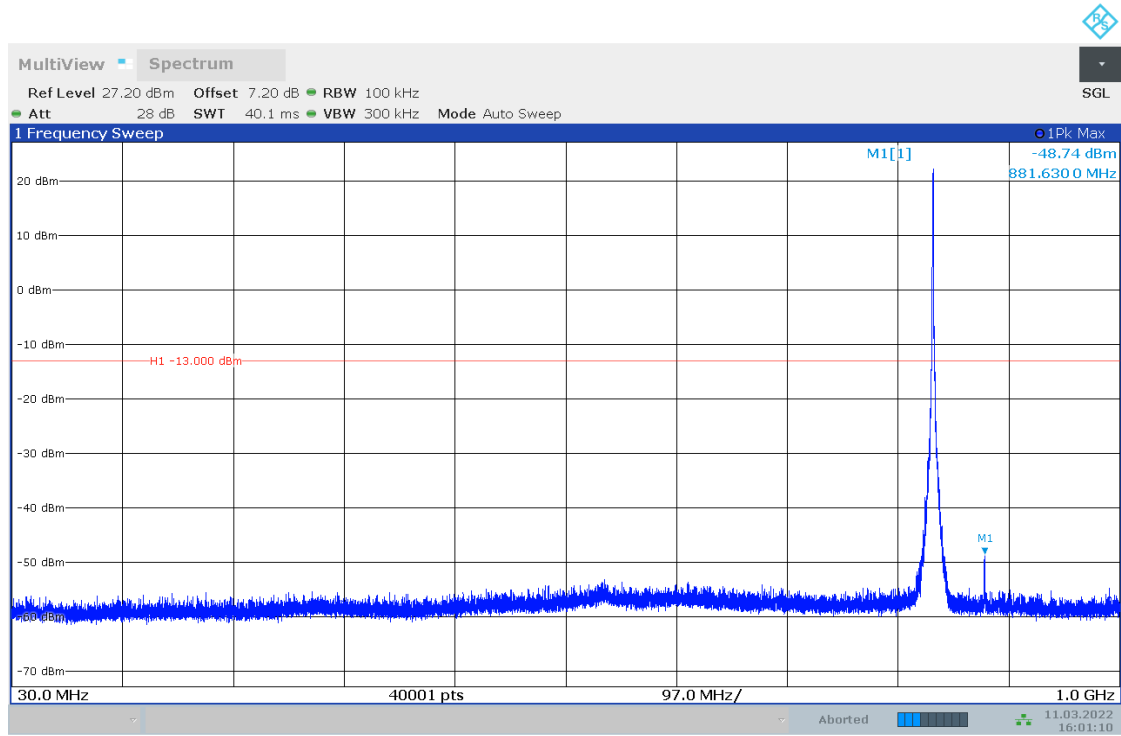


16:01:10 11.03.2022

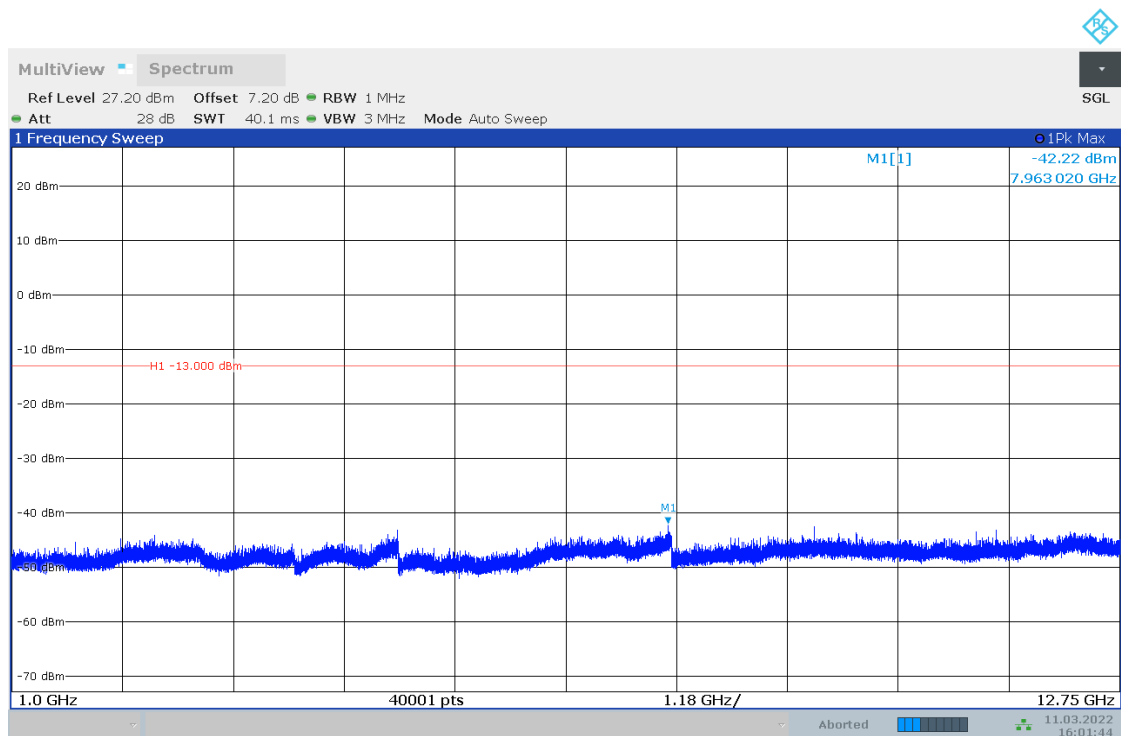


16:01:44 11.03.2022


6.2.7 TM1_1.4MHz_HCH_RB1#0

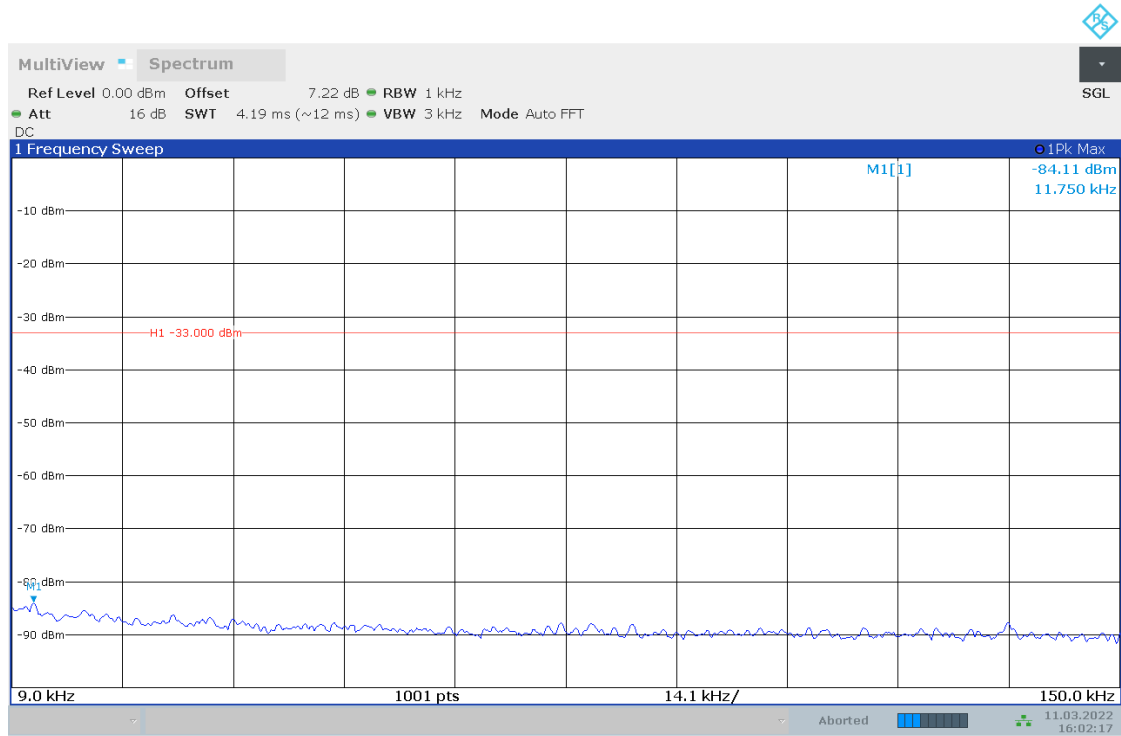


16:02:17 11.03.2022

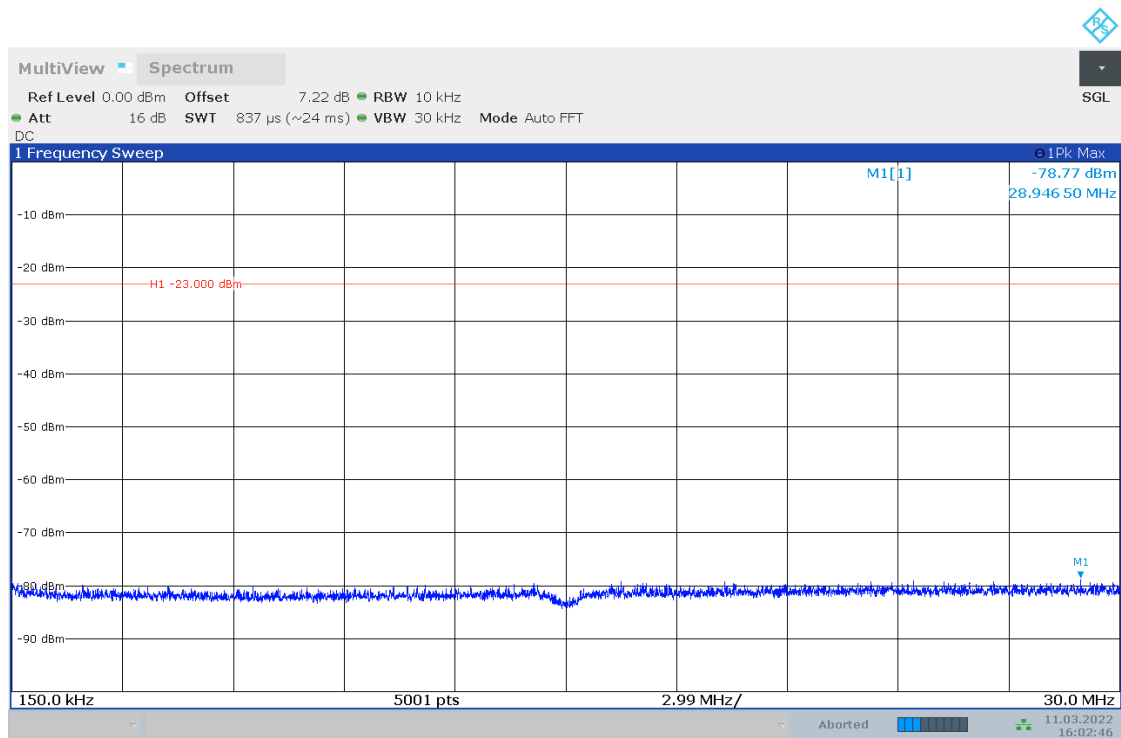

16:02:46 11.03.2022

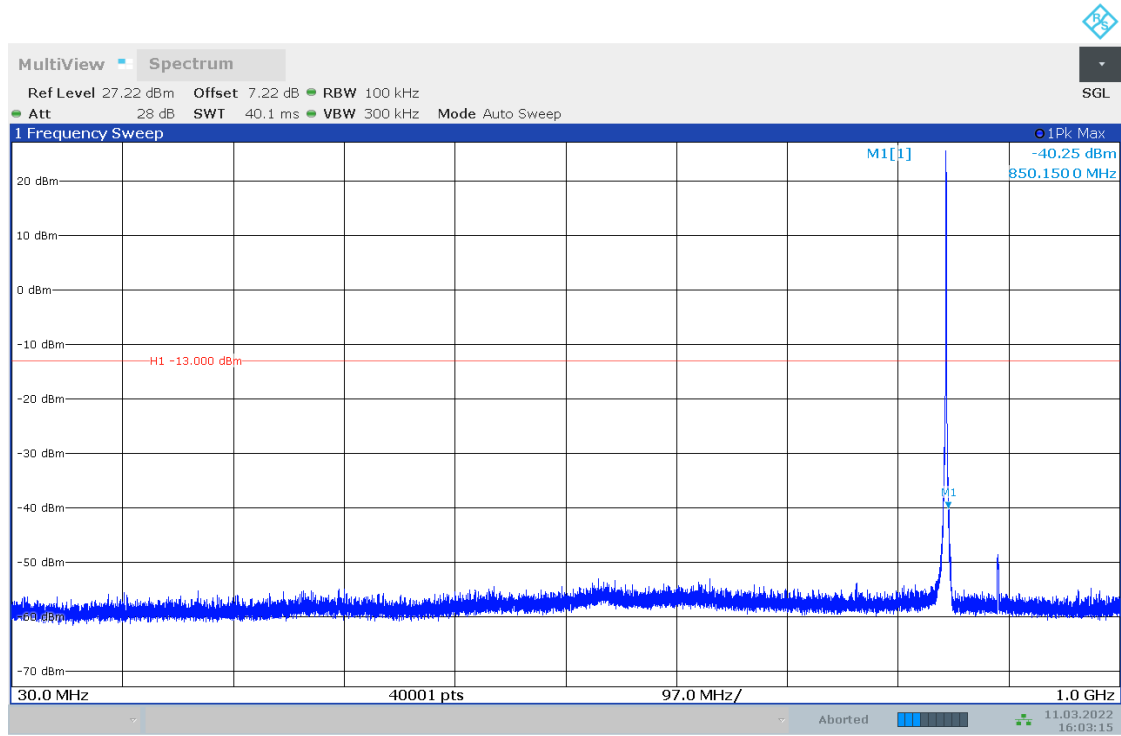


16:03:16 11.03.2022

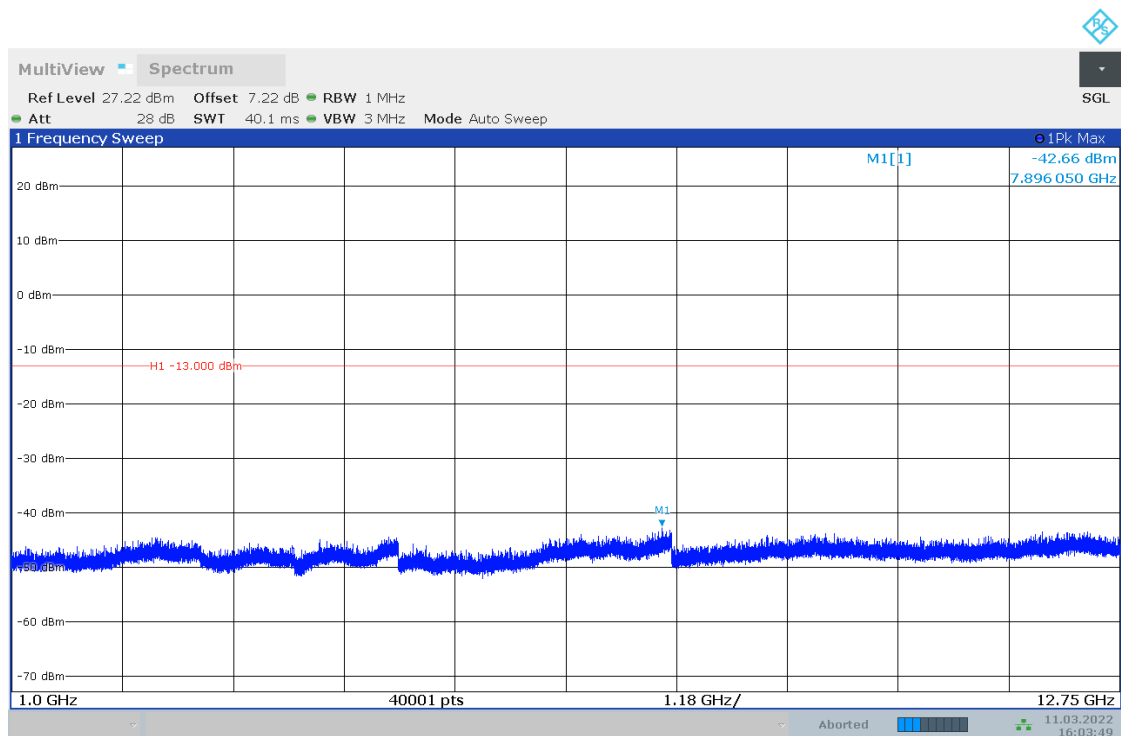


16:03:50 11.03.2022


6.2.8 TM1_1.4MHz_HCH_RB1#5

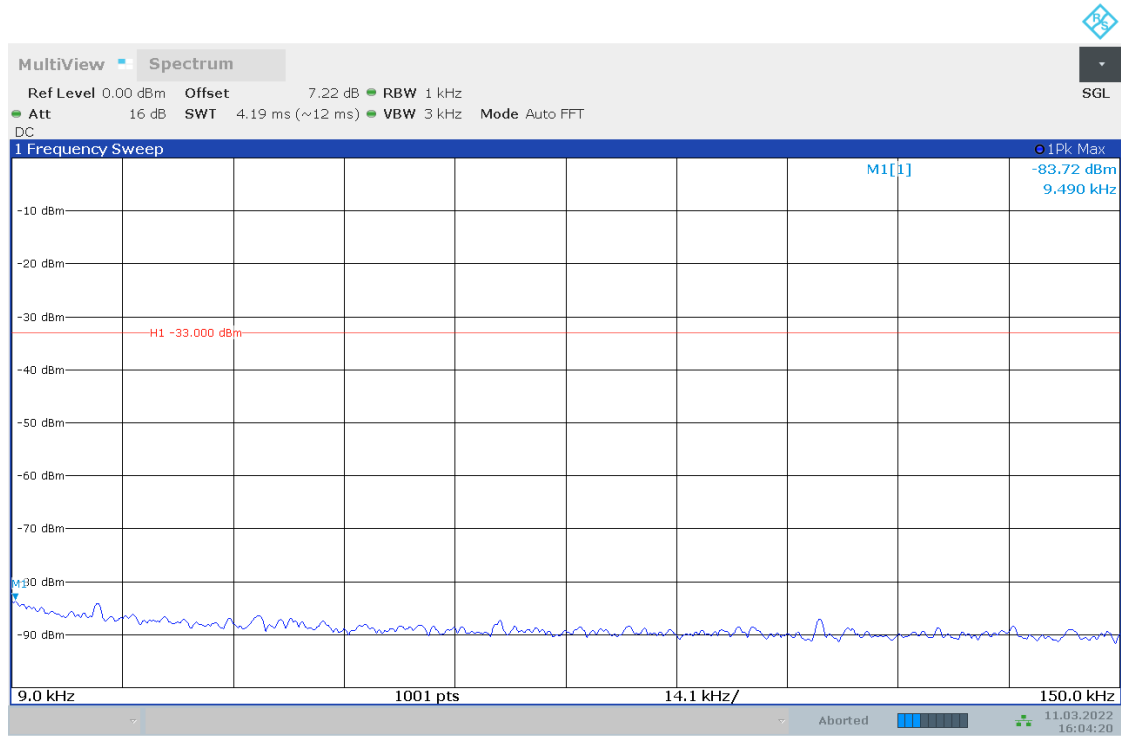


16:04:20 11.03.2022

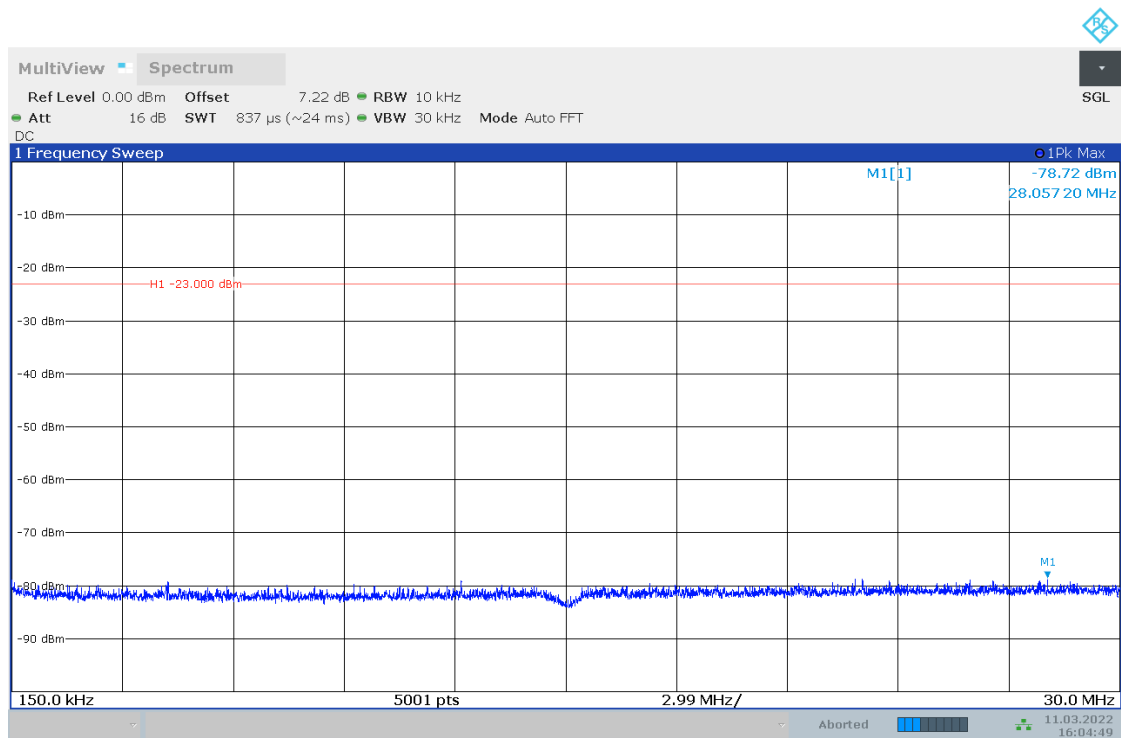

16:04:50 11.03.2022


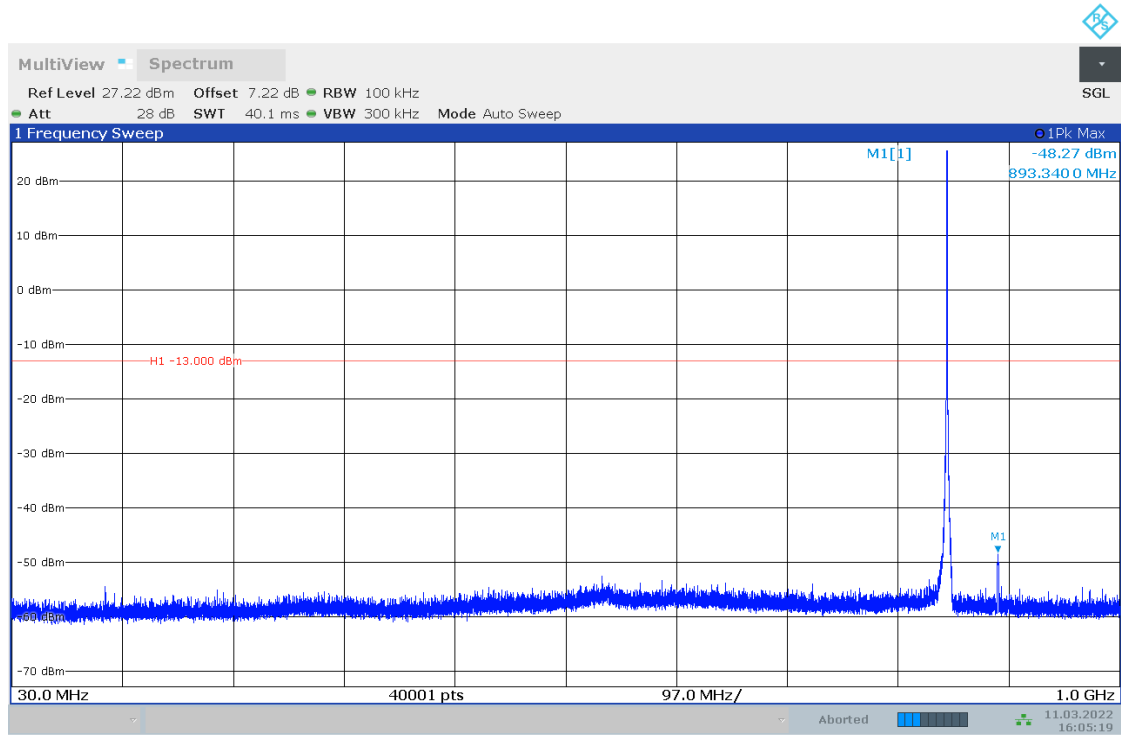



16:05:19 11.03.2022

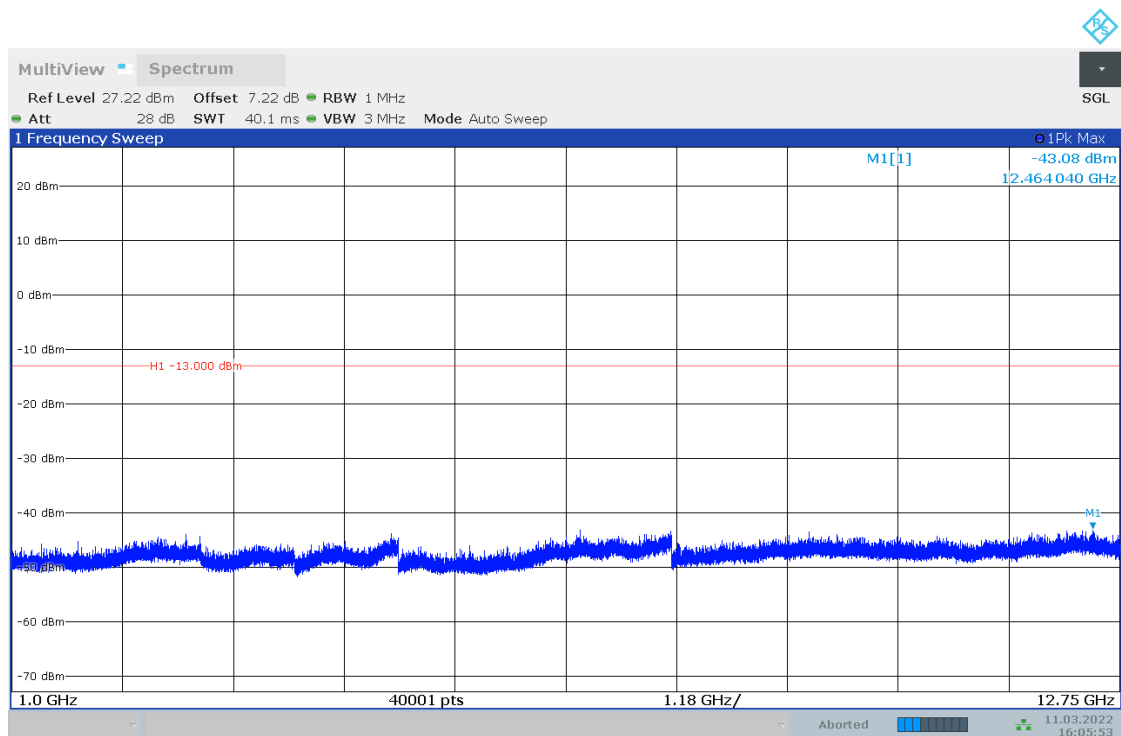


16:05:53 11.03.2022

6.2.9 TM1_1.4MHz_HCH_RB6#0

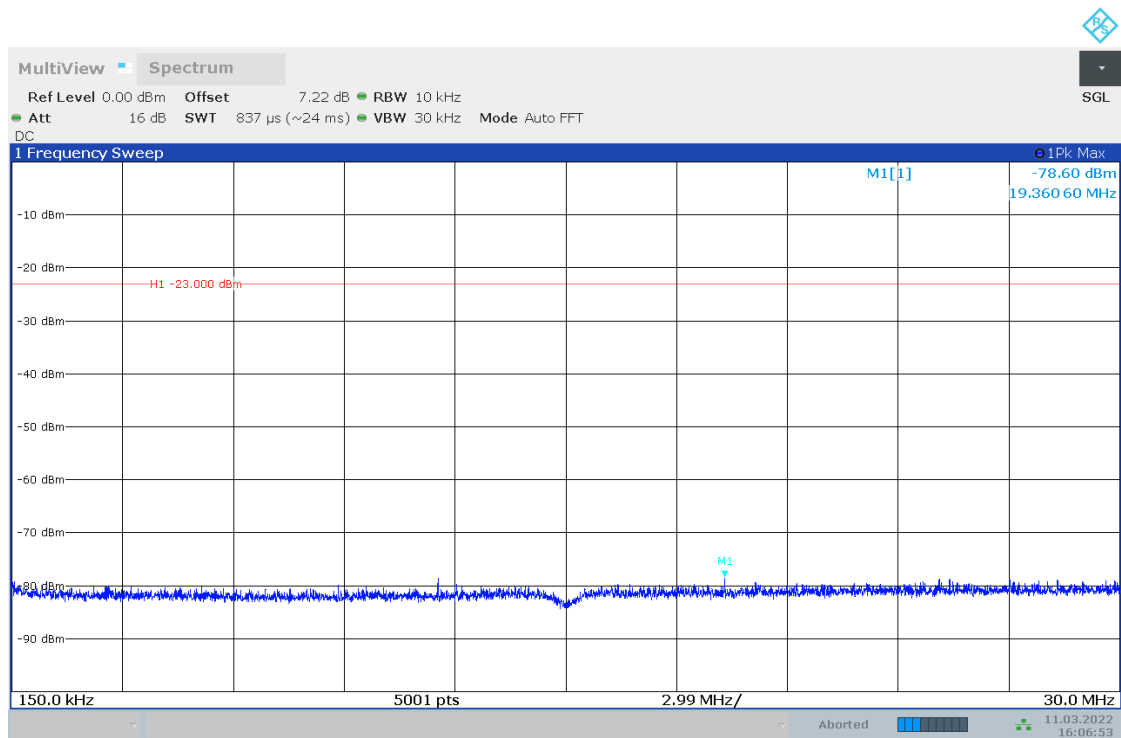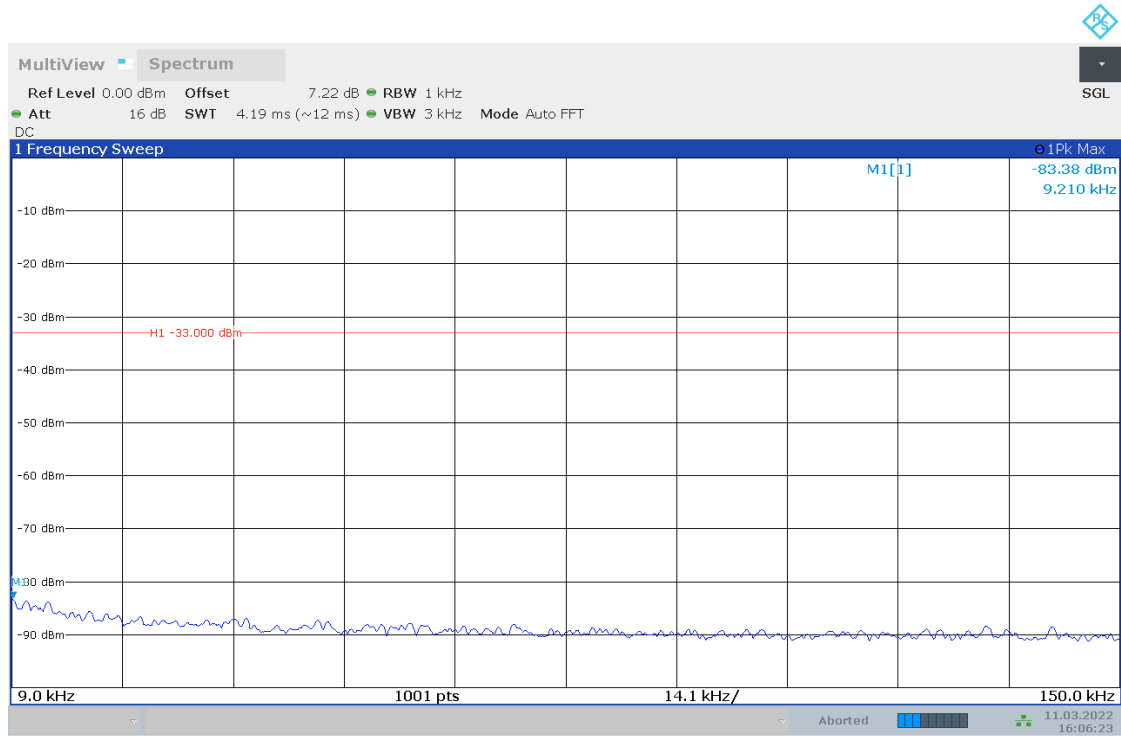

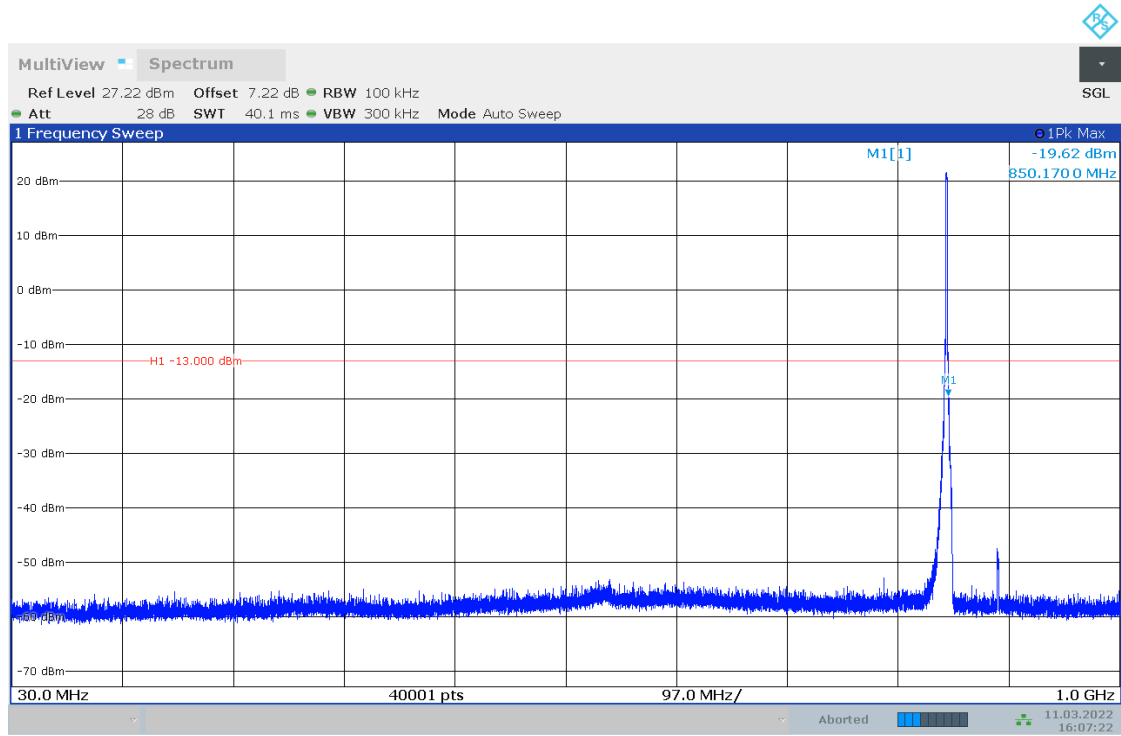


16:07:23 11.03.2022

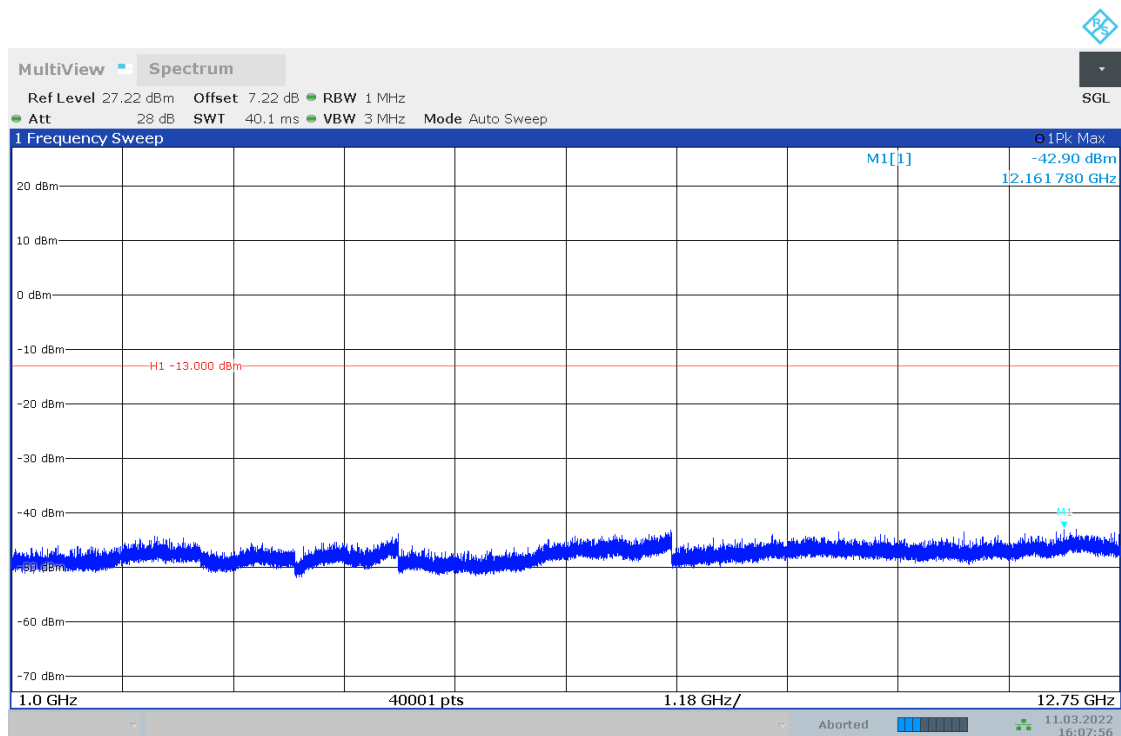


16:07:57 11.03.2022


6.2.10 TM1_5MHz_LCH_RB1#0

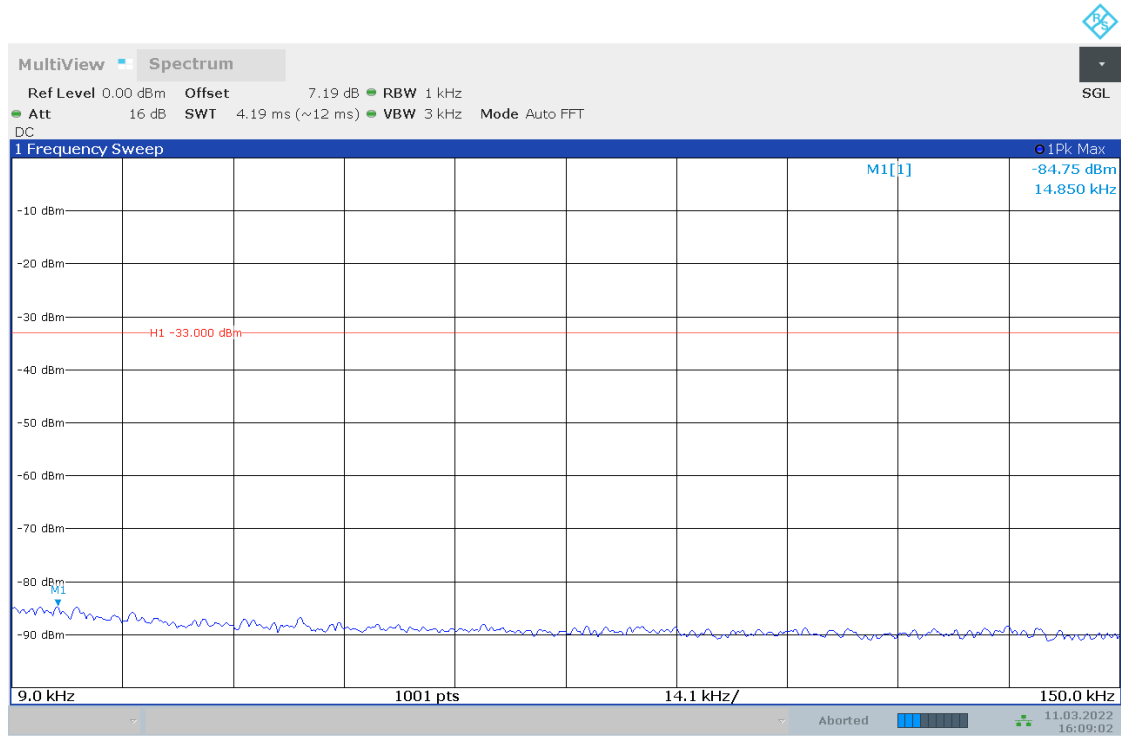


16:09:02 11.03.2022

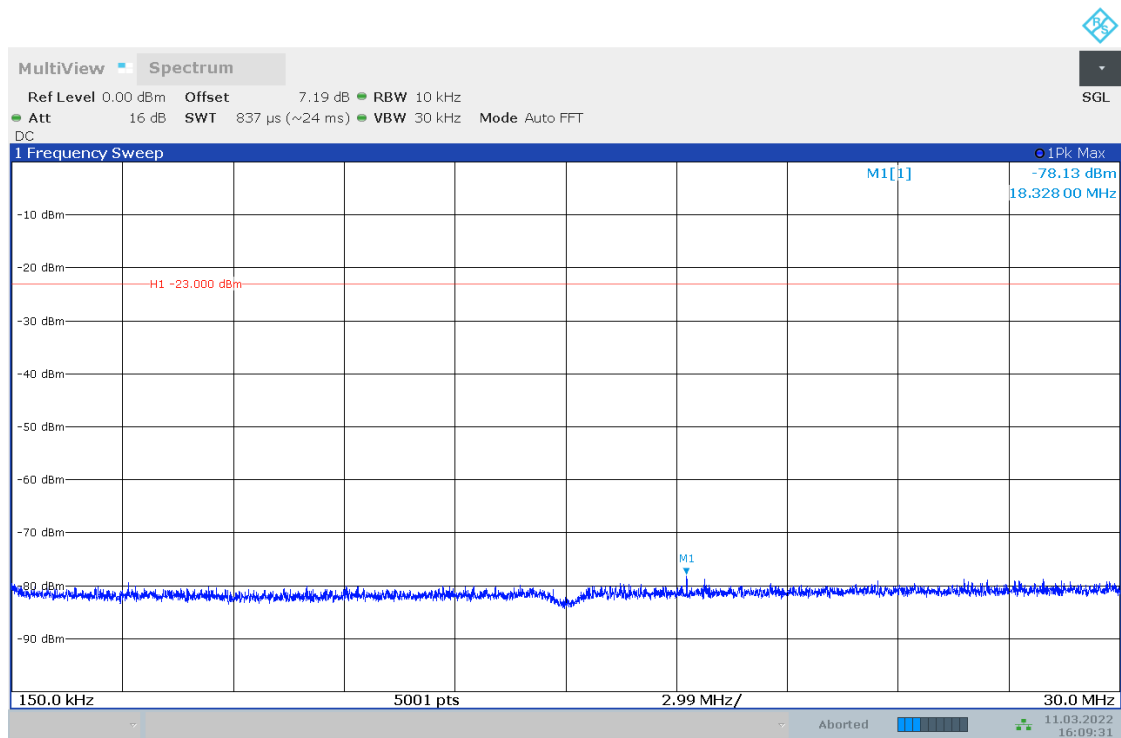

16:09:31 11.03.2022

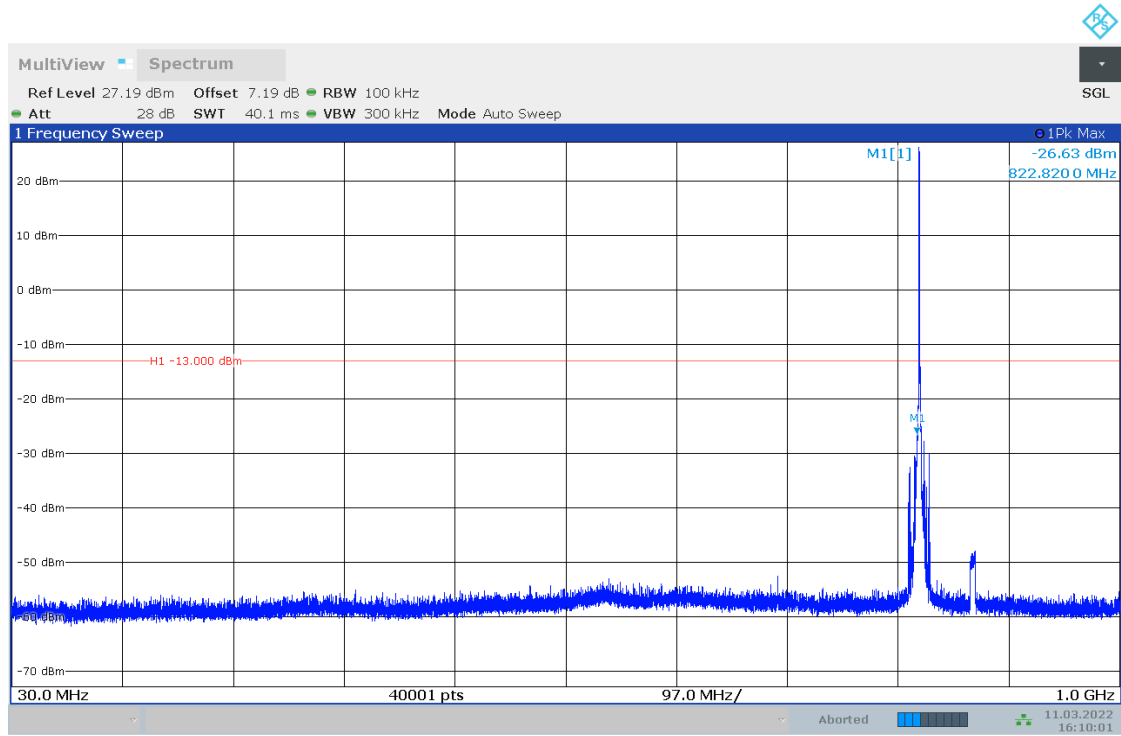


16:10:02 11.03.2022

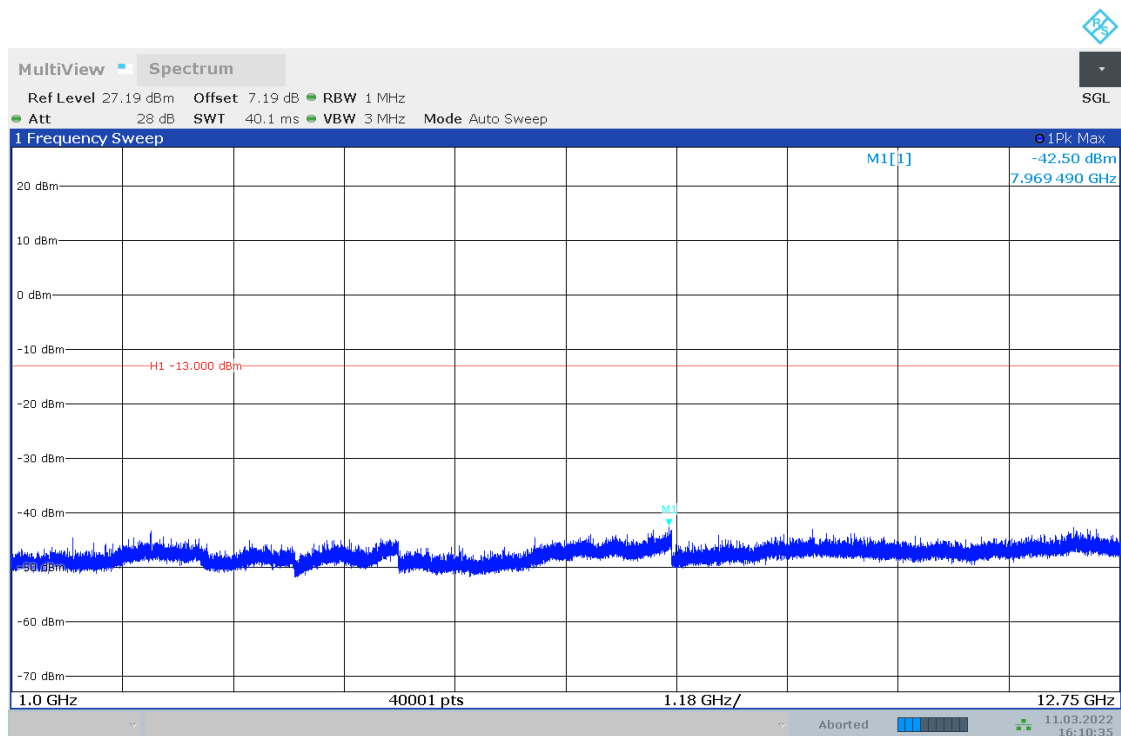


16:10:36 11.03.2022


6.2.11 TM1_5MHz_LCH_RB1#24

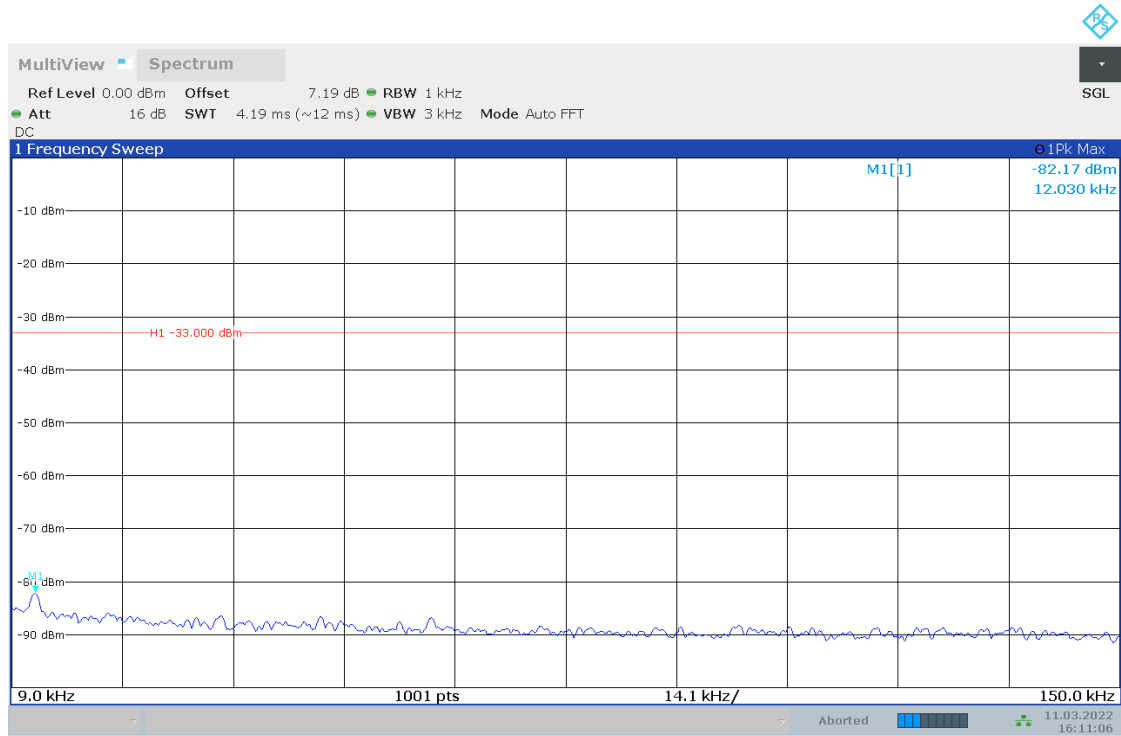


16:11:07 11.03.2022

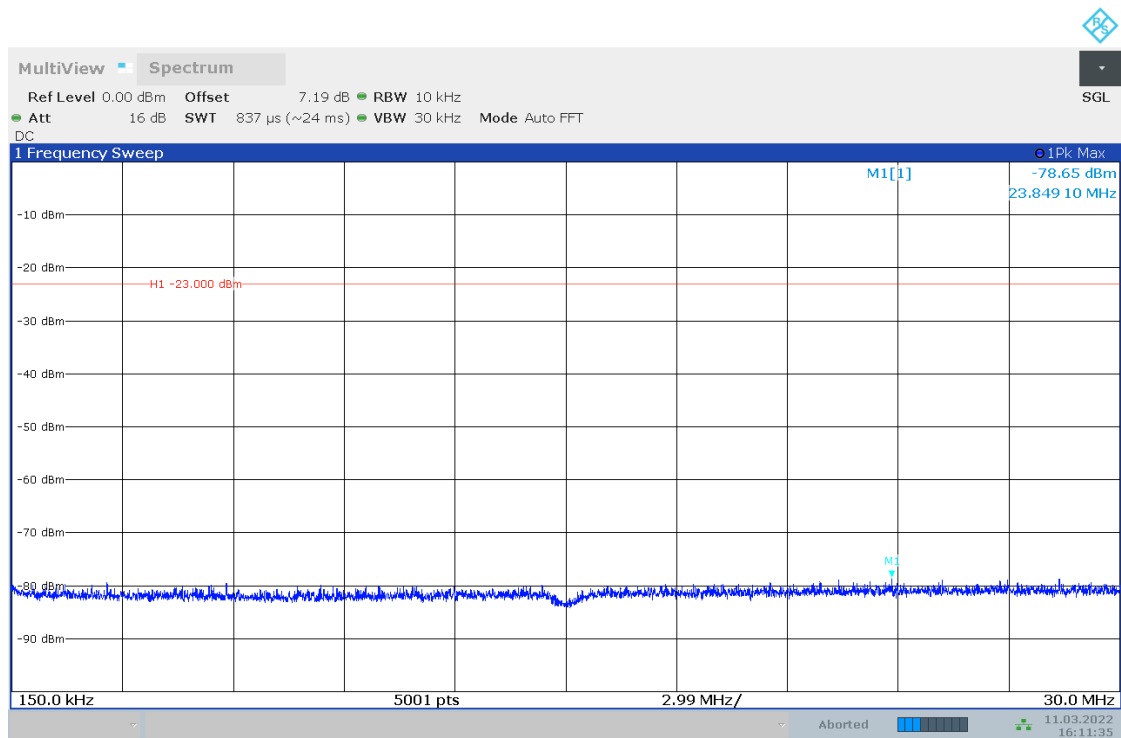

16:11:36 11.03.2022

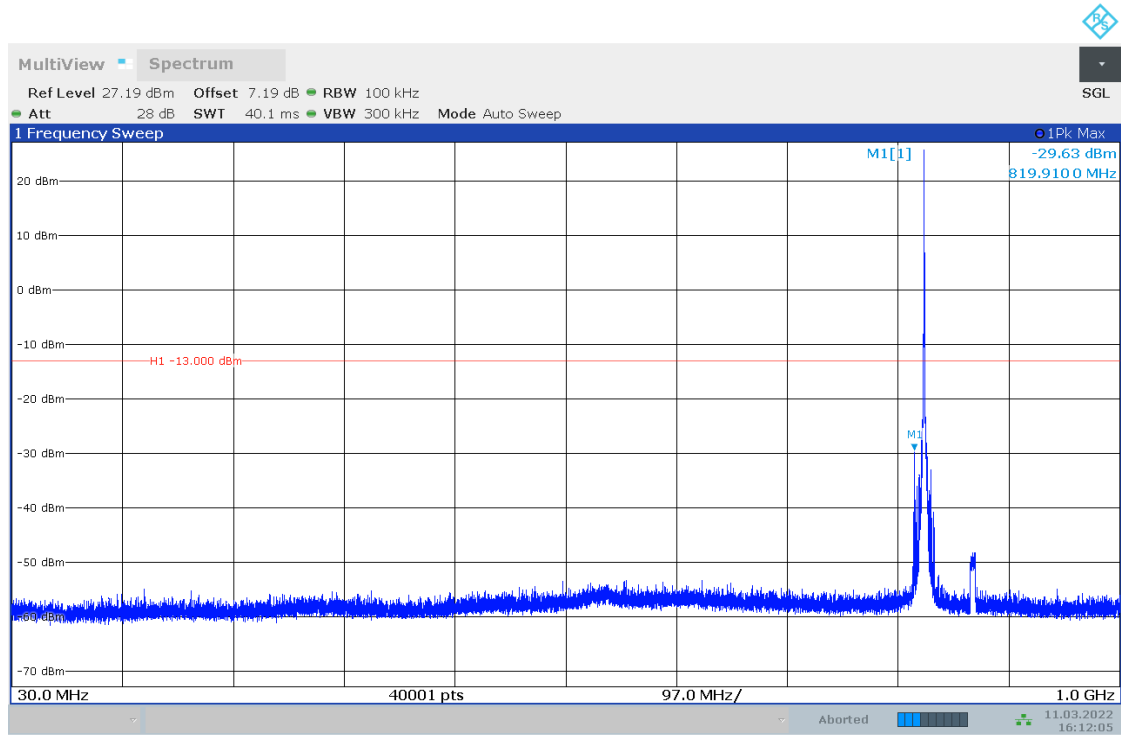


16:12:06 11.03.2022

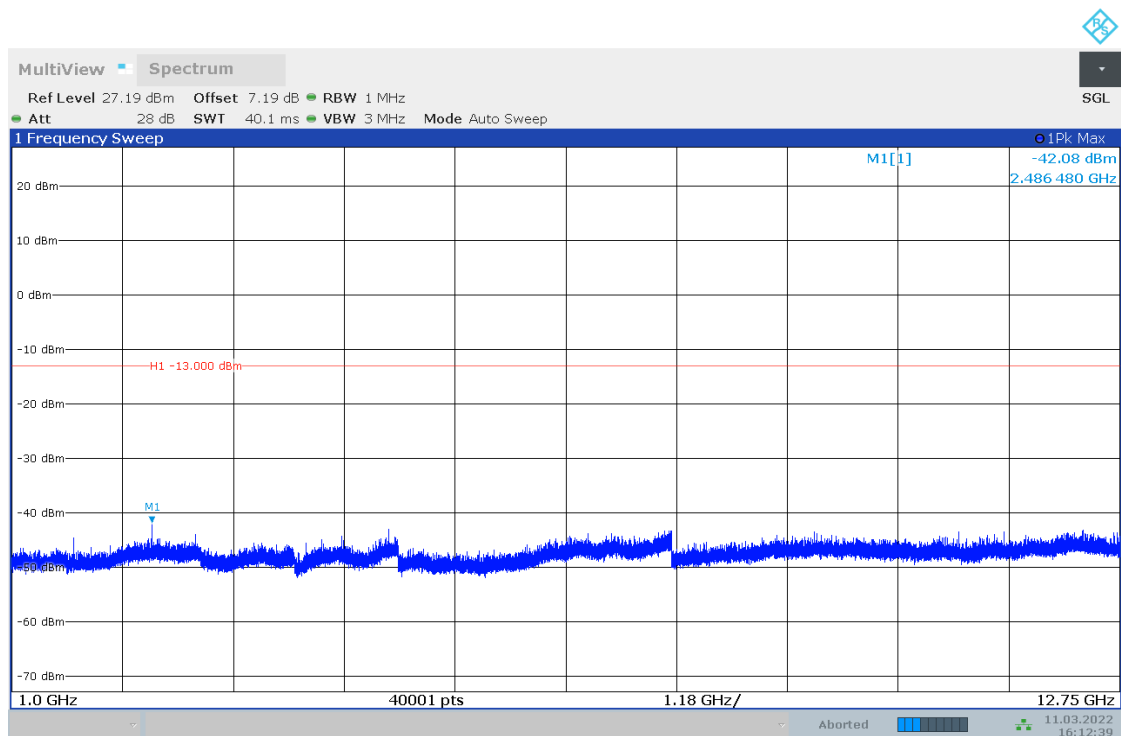


16:12:40 11.03.2022


6.2.12 TM1_5MHz_LCH_RB25#0

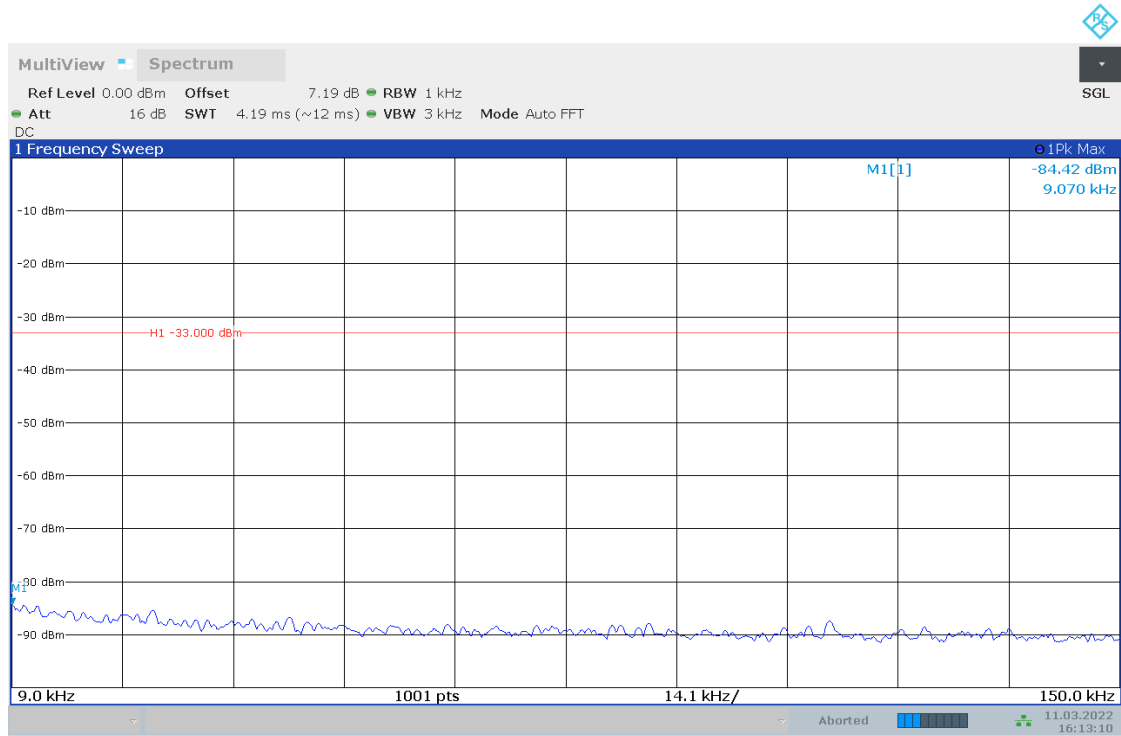


16:13:11 11.03.2022

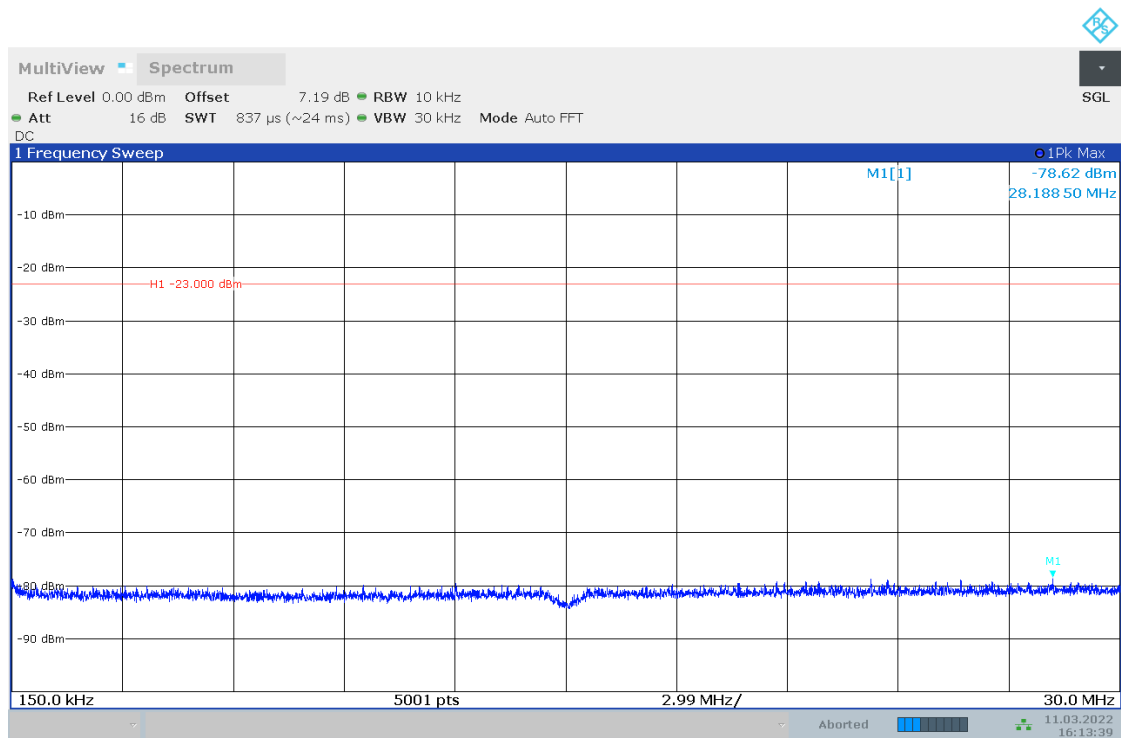

16:13:40 11.03.2022

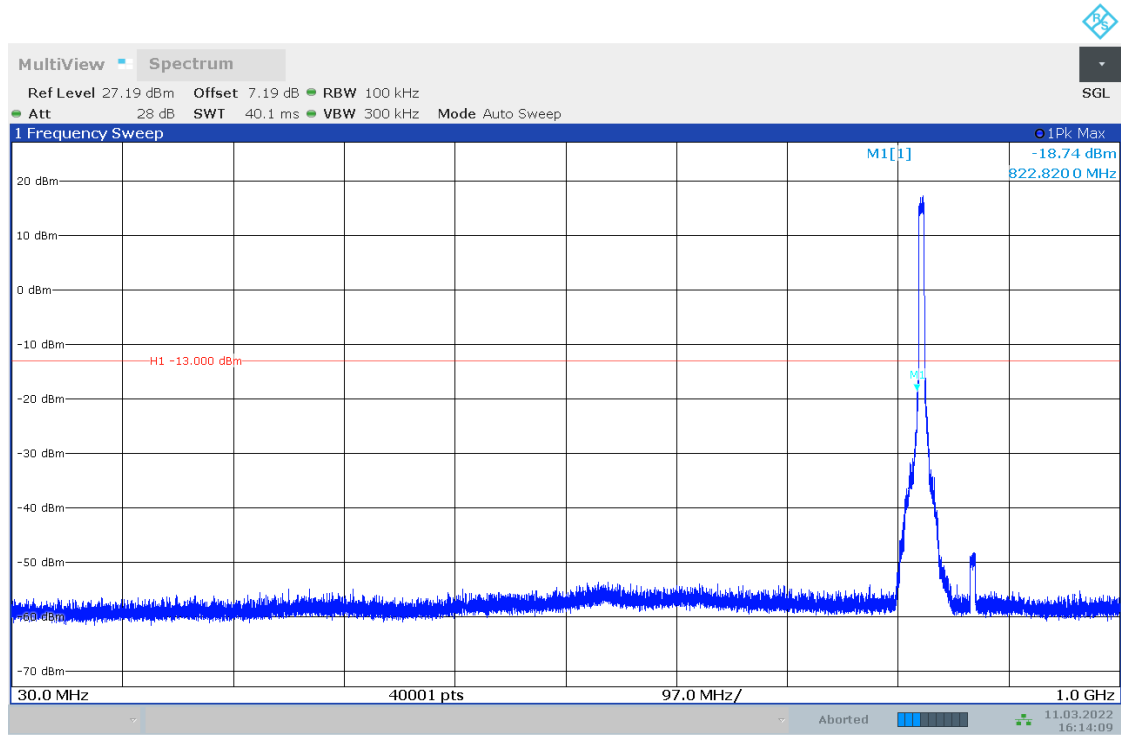


16:14:10 11.03.2022

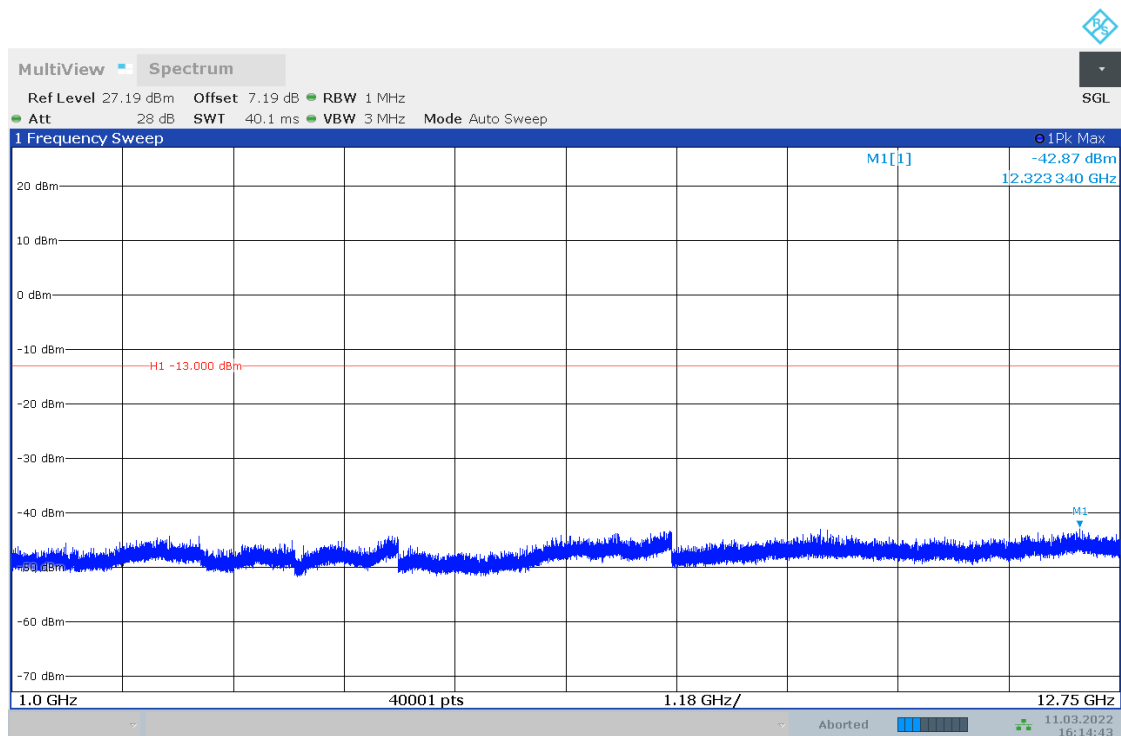


16:14:44 11.03.2022


6.2.13 TM1_5MHz_MCH_RB1#0

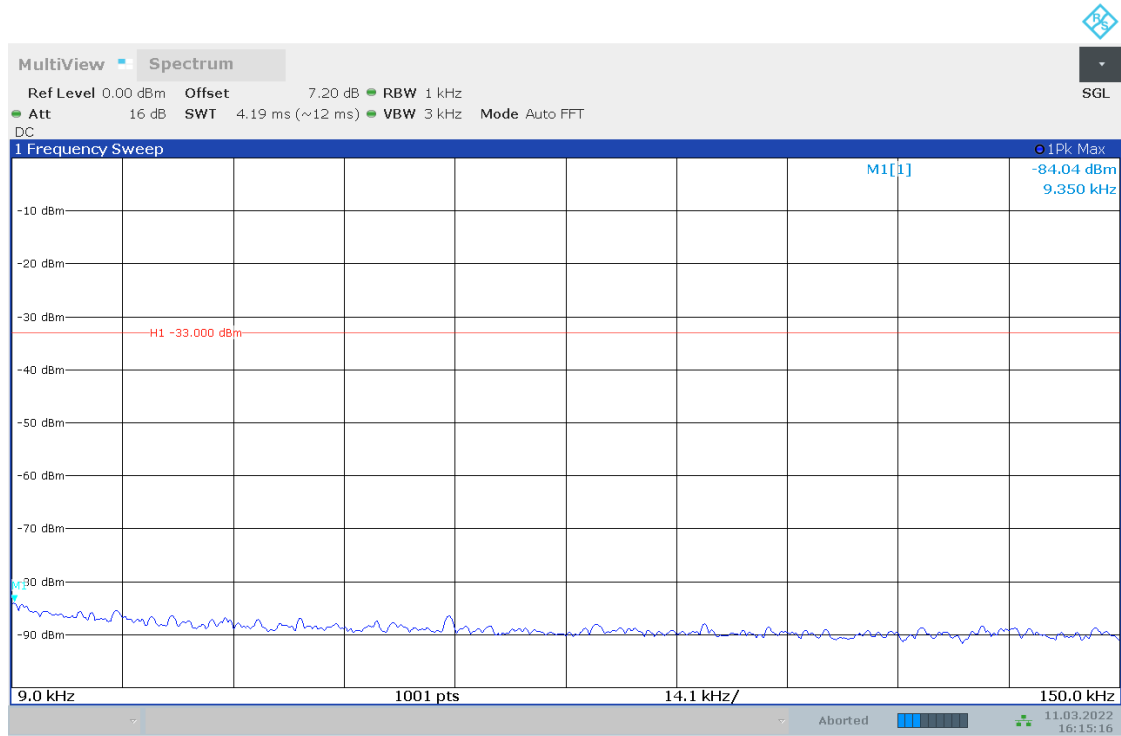


16:15:17 11.03.2022

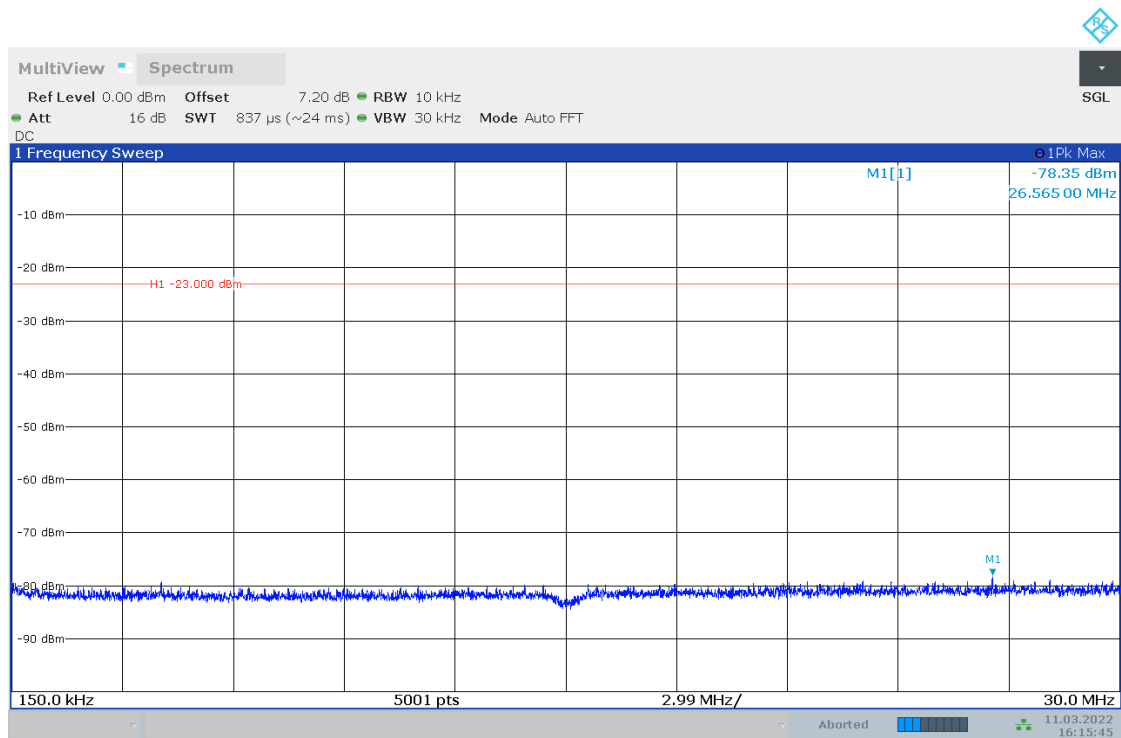

16:15:46 11.03.2022

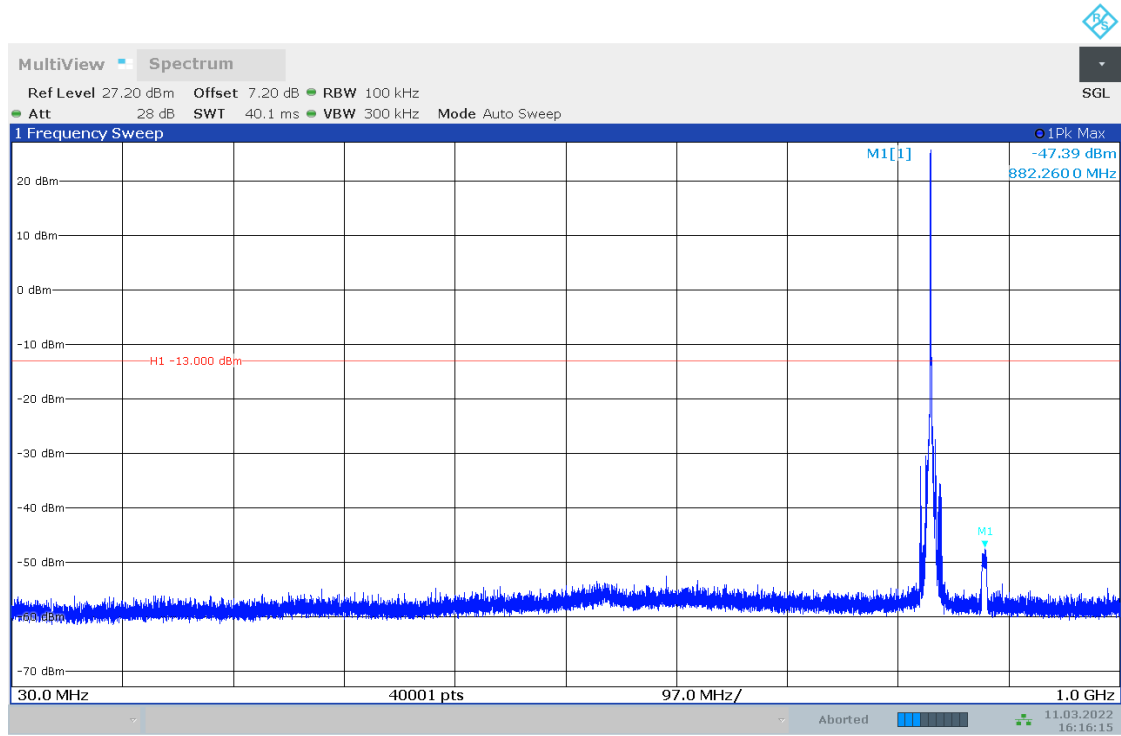


16:16:15 11.03.2022

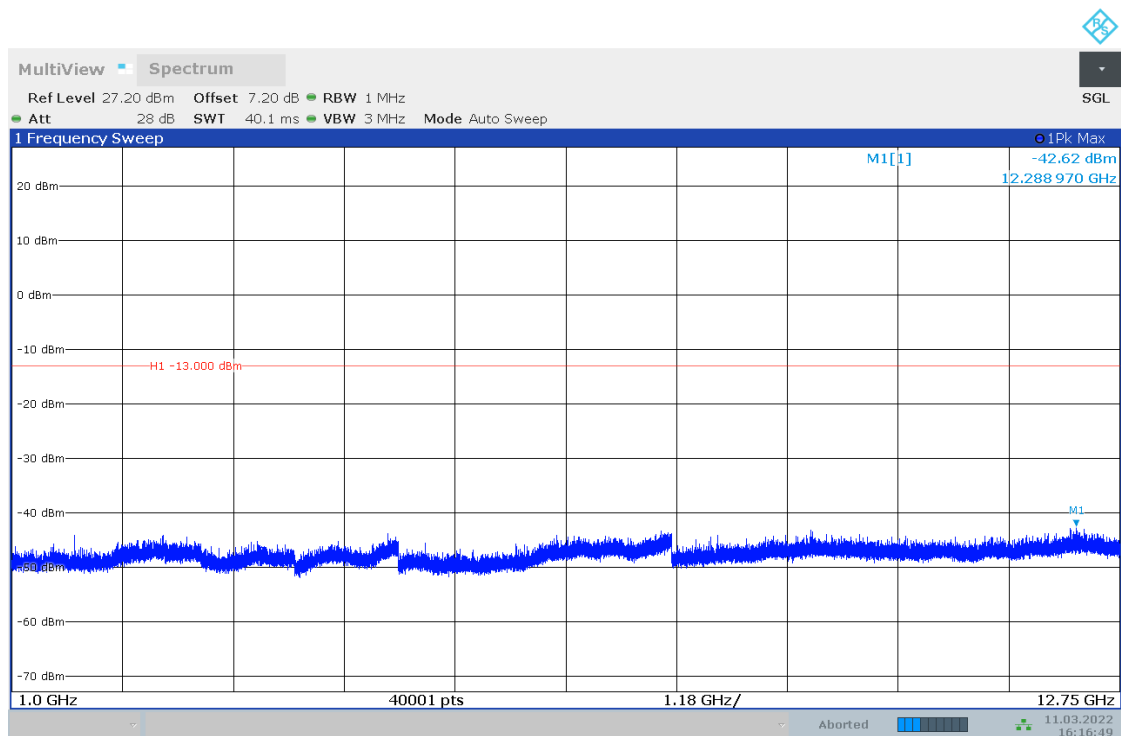


16:16:49 11.03.2022


6.2.14 TM1_5MHz_MCH_RB1#24

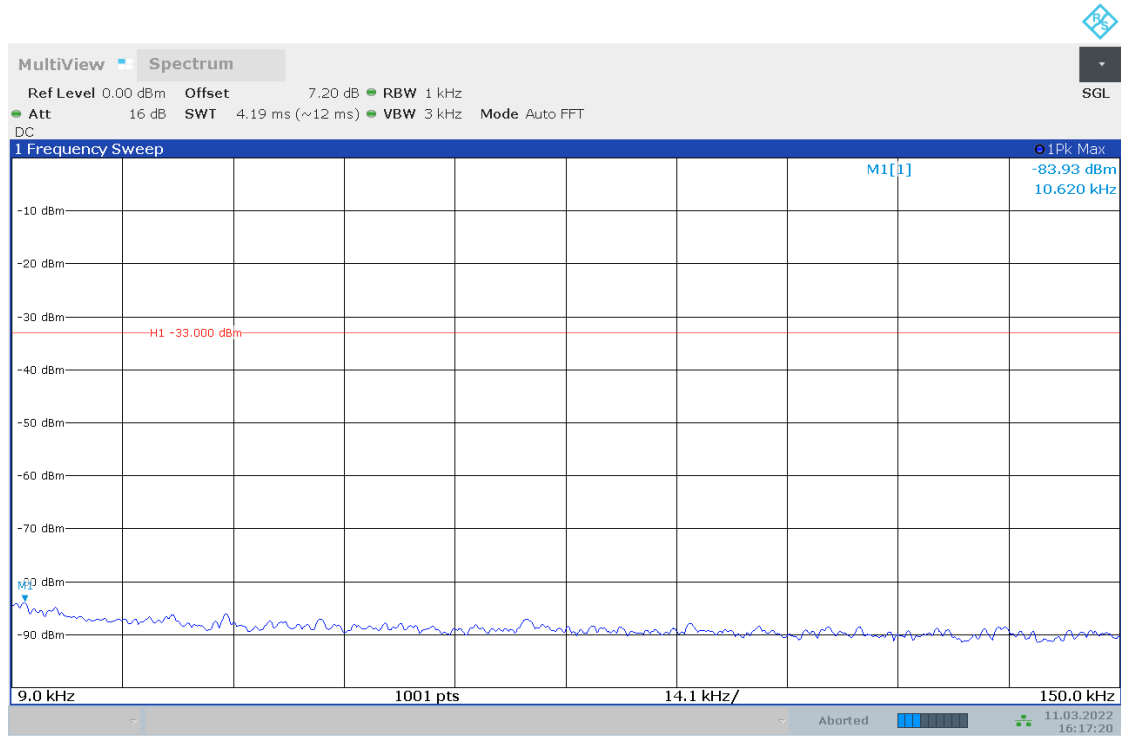


16:17:20 11.03.2022

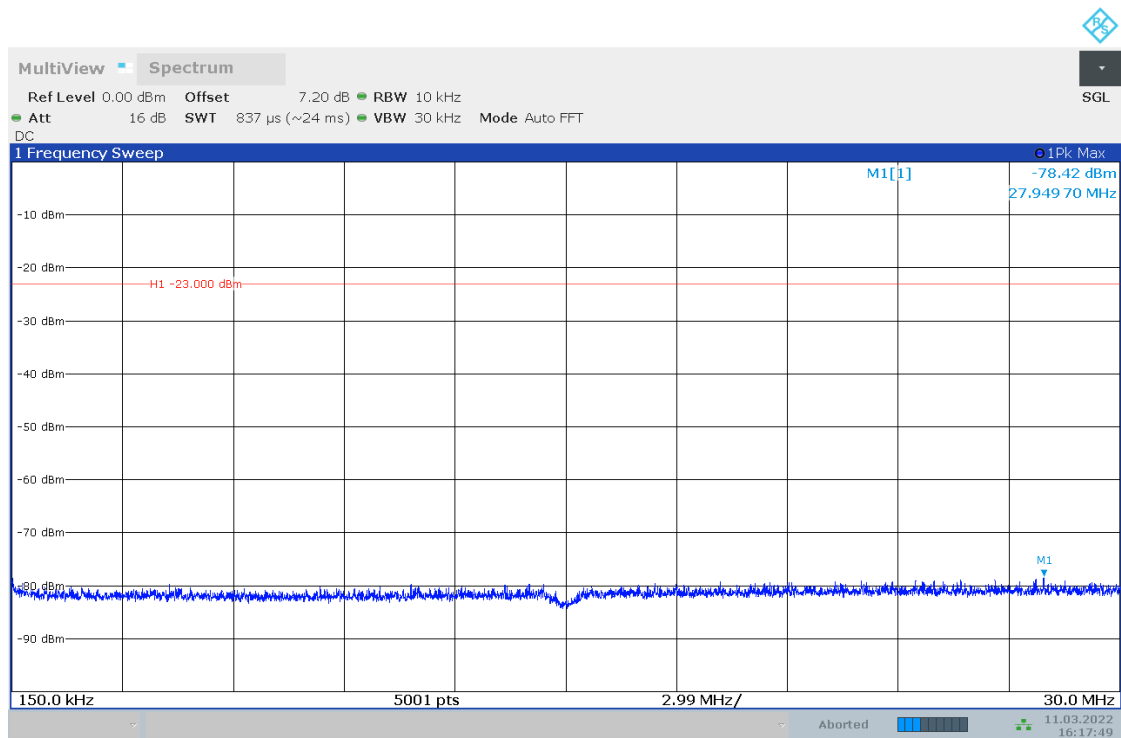

16:17:49 11.03.2022

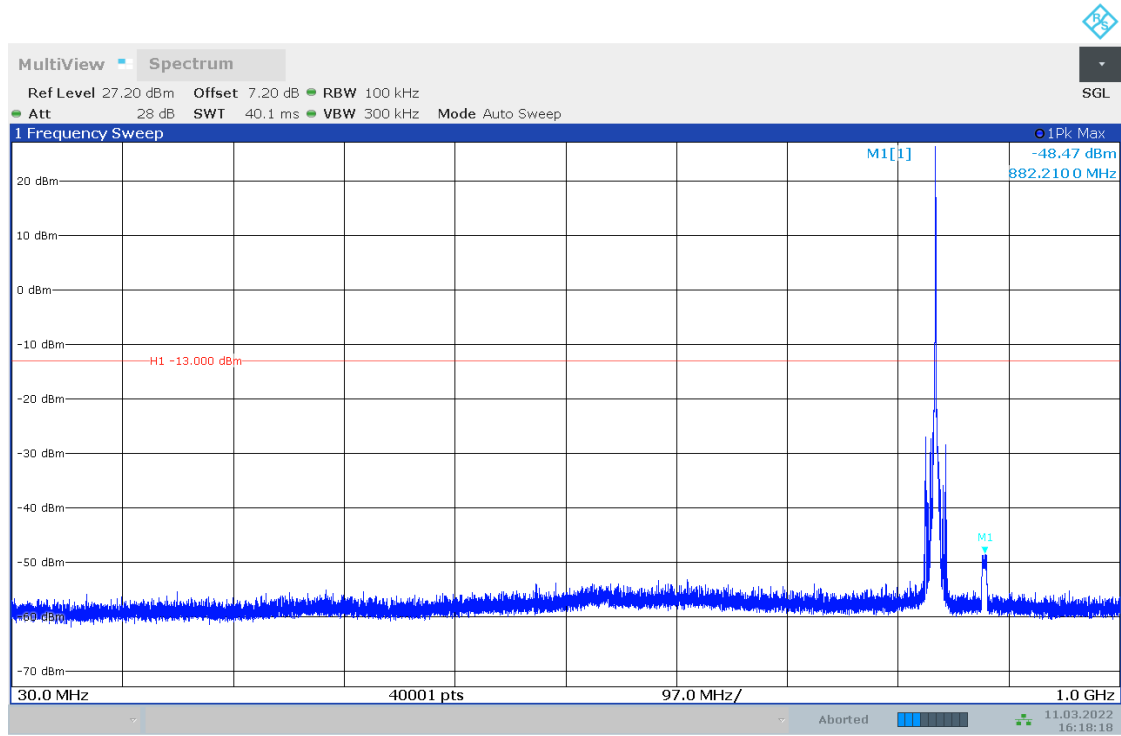


16:18:19 11.03.2022

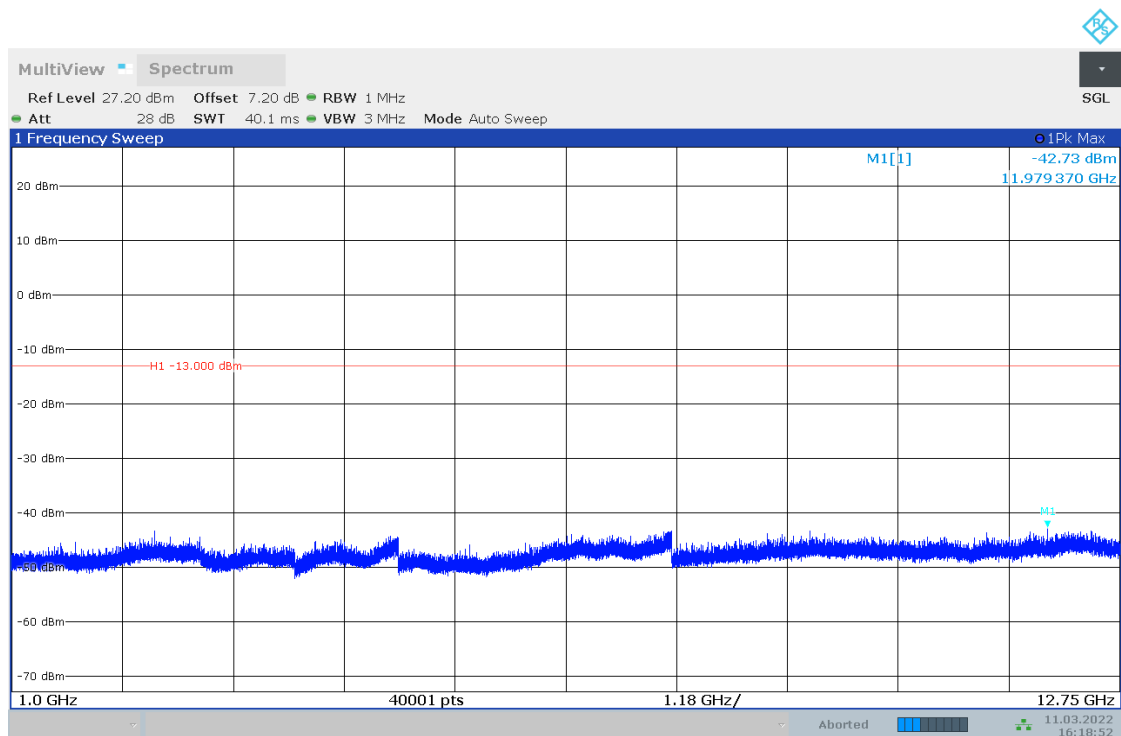


16:18:53 11.03.2022


6.2.15 TM1_5MHz_MCH_RB25#0

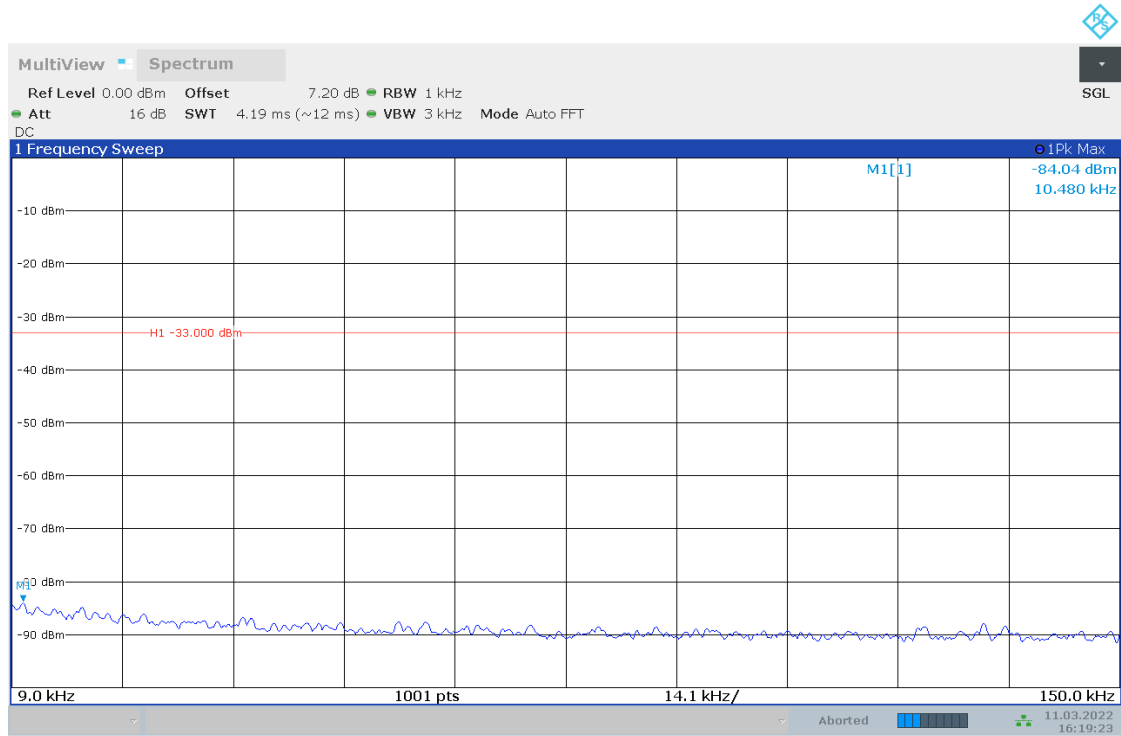


16:19:24 11.03.2022

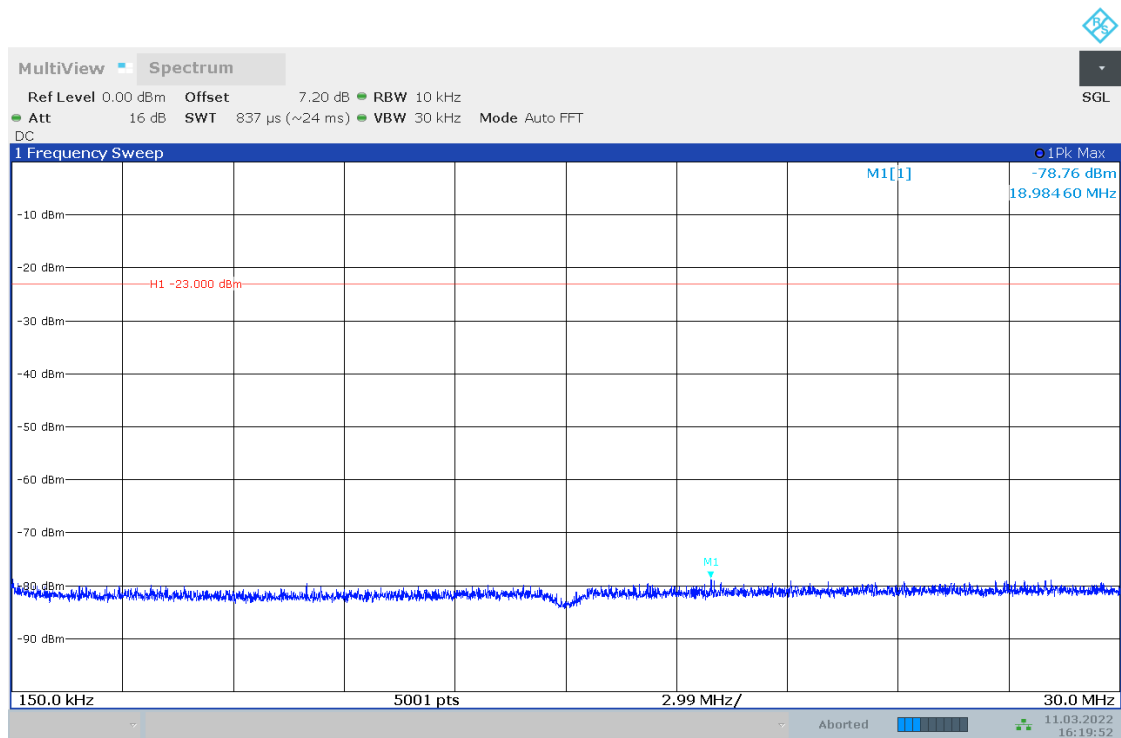

16:19:53 11.03.2022

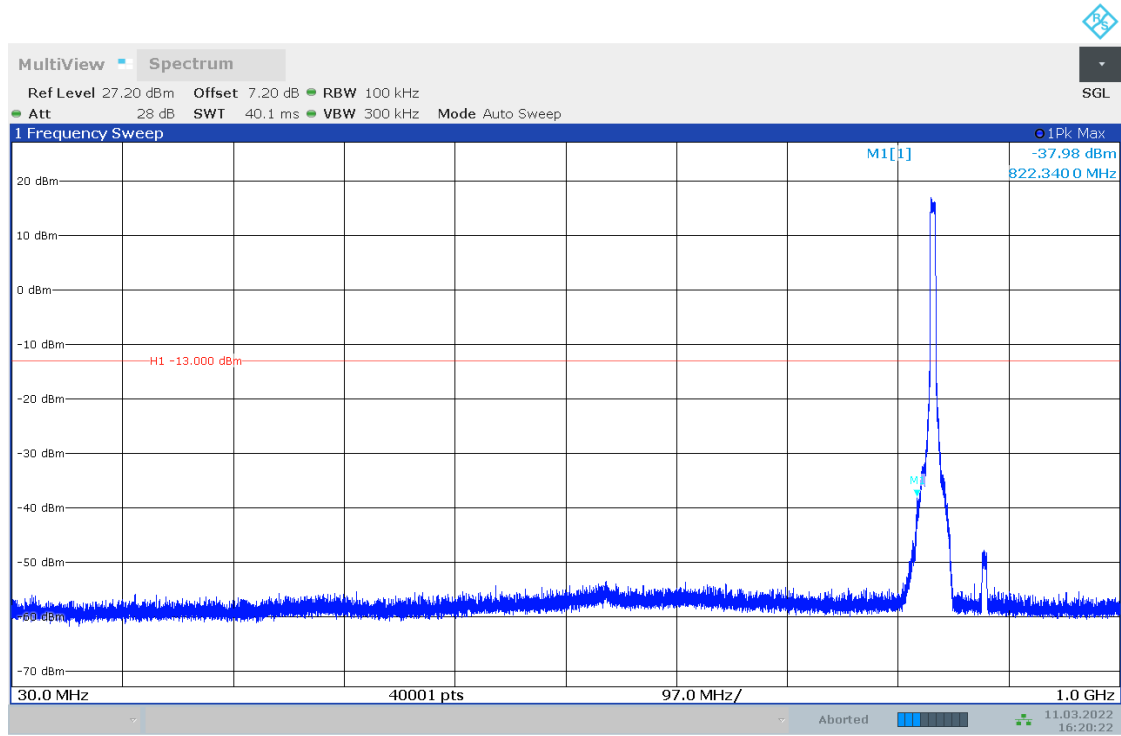

16:20:22 11.03.2022

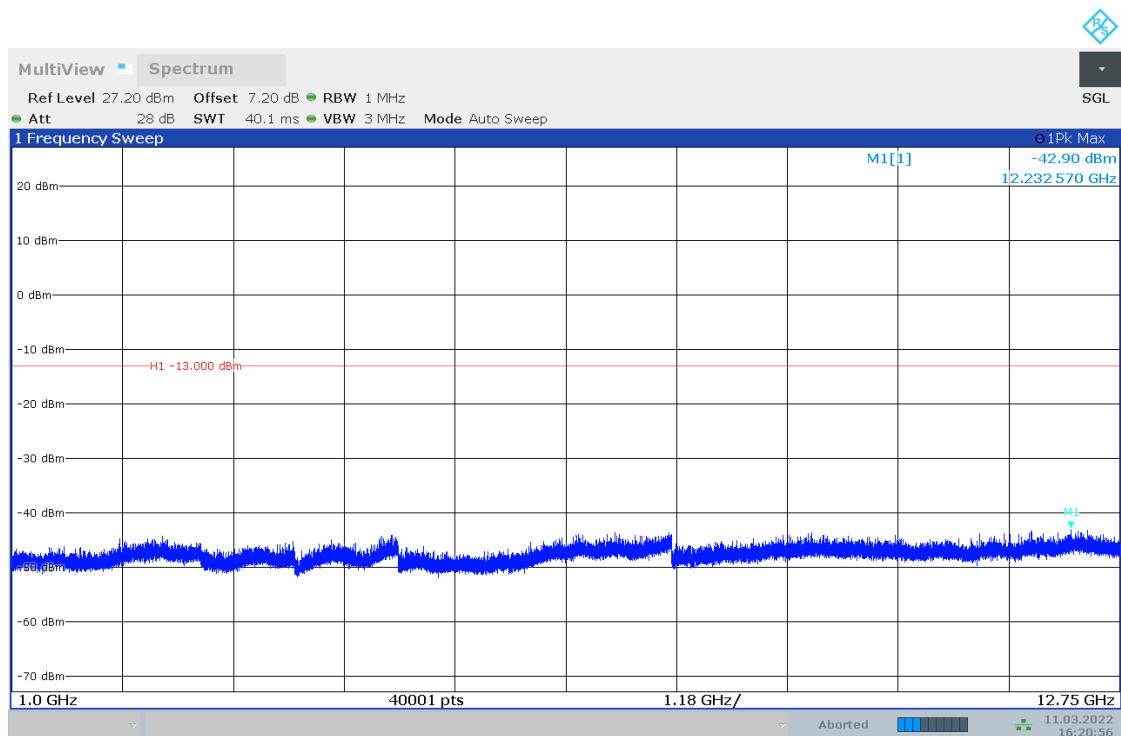


16:20:57 11.03.2022


6.2.16 TM1_5MHz_HCH_RB1#0




16:21:30 11.03.2022

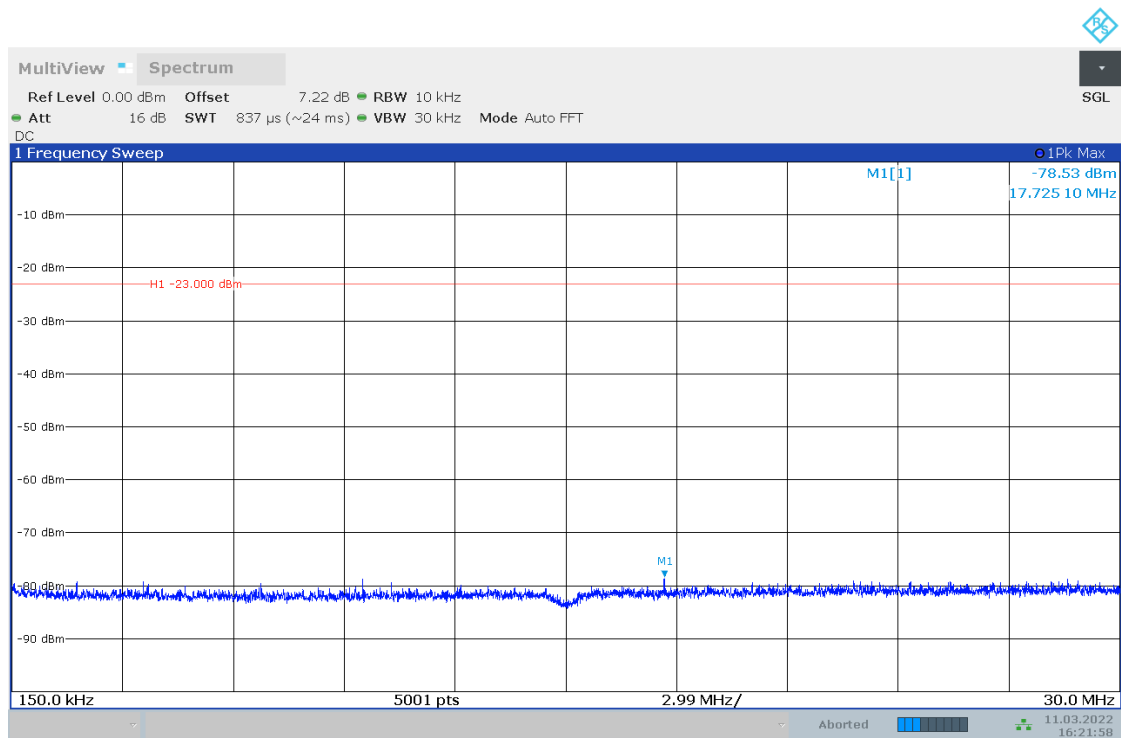

16:21:59 11.03.2022

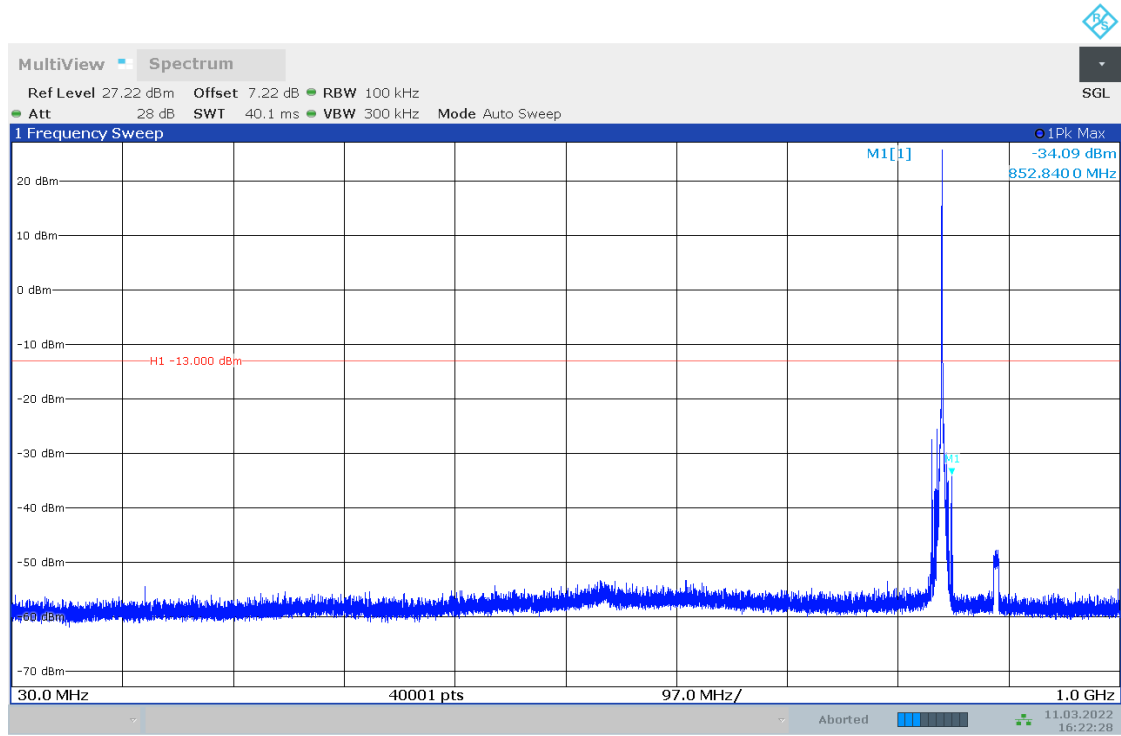


16:22:29 11.03.2022

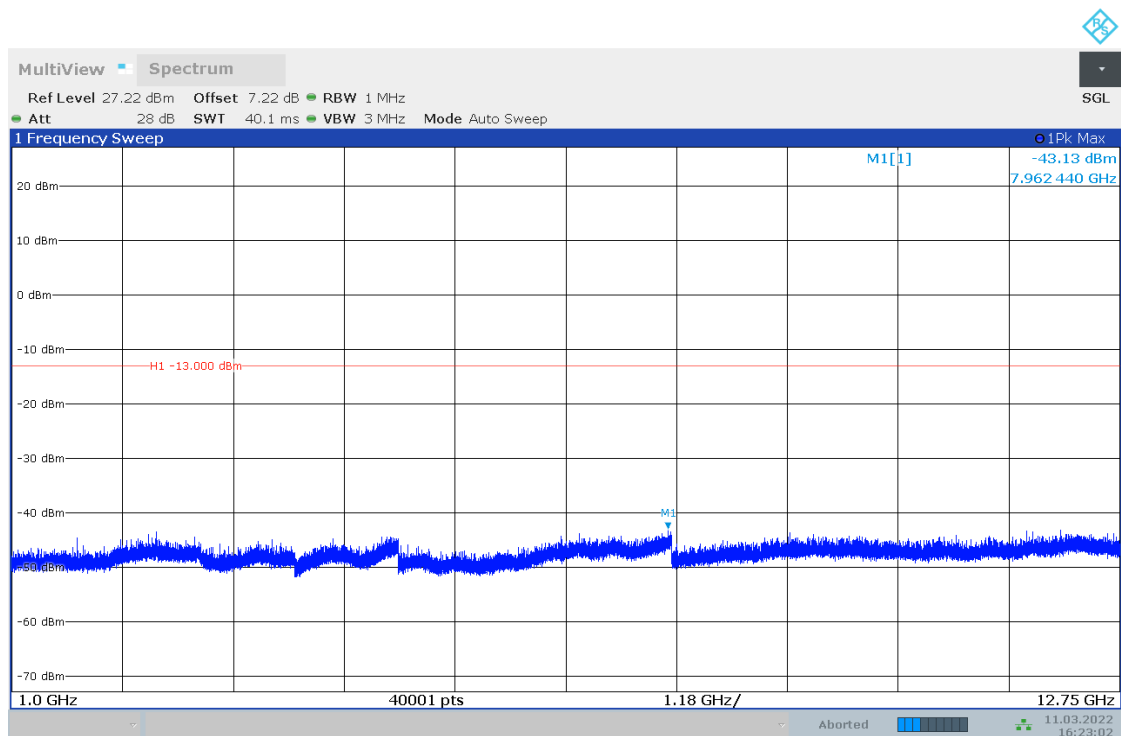


16:23:03 11.03.2022


6.2.17 TM1_5MHz_HCH_RB1#24

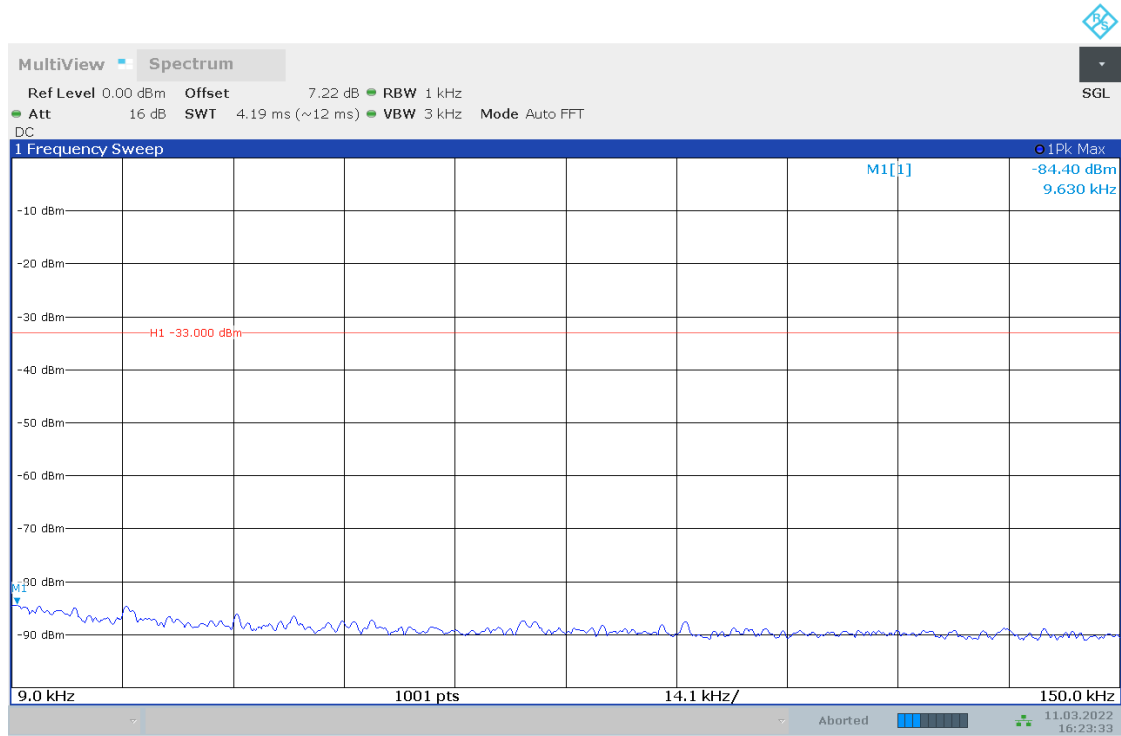


16:23:34 11.03.2022

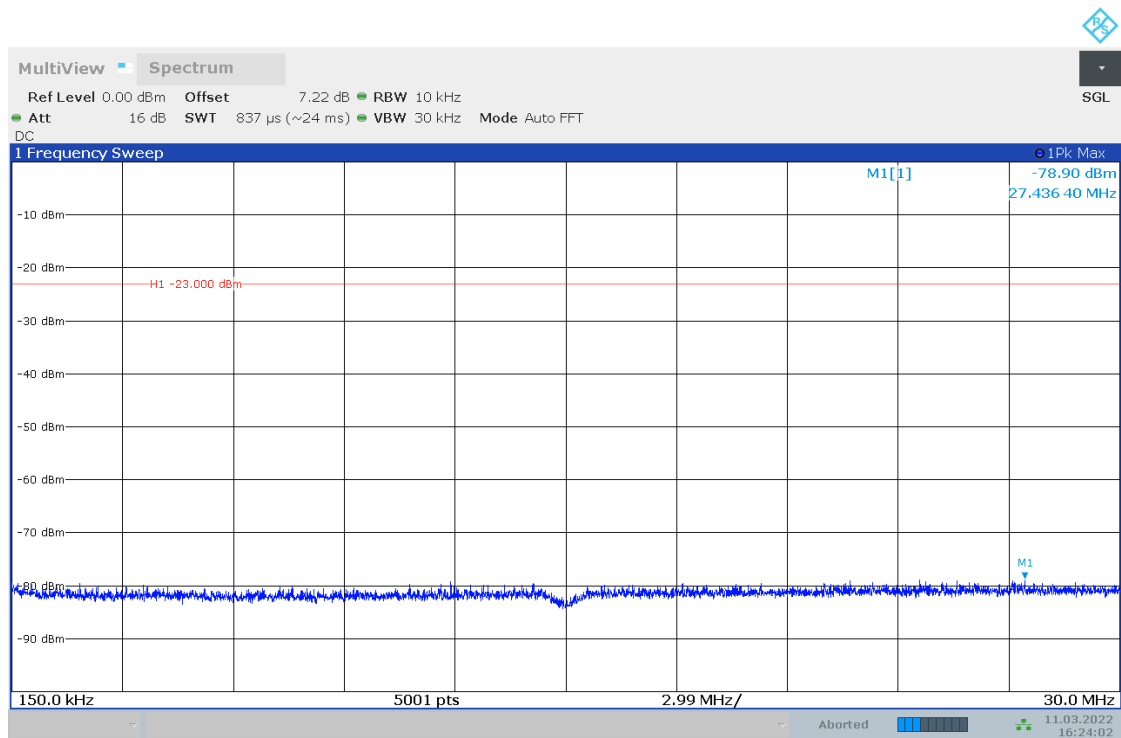

16:24:03 11.03.2022

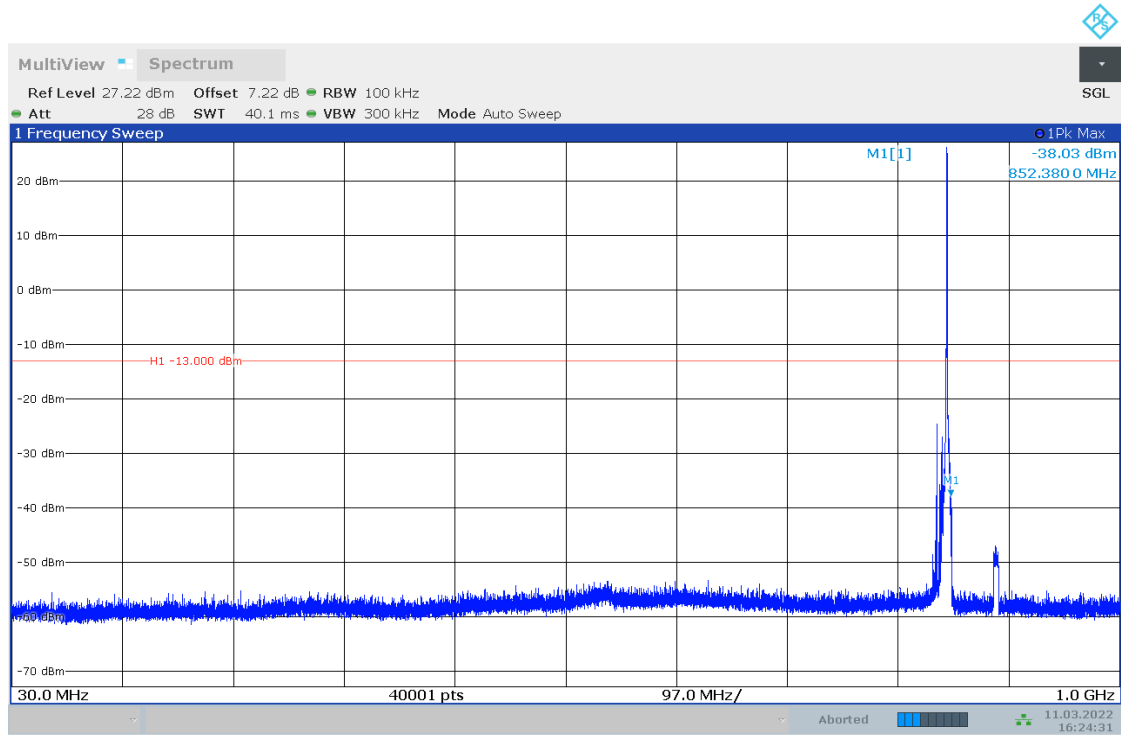


16:24:32 11.03.2022

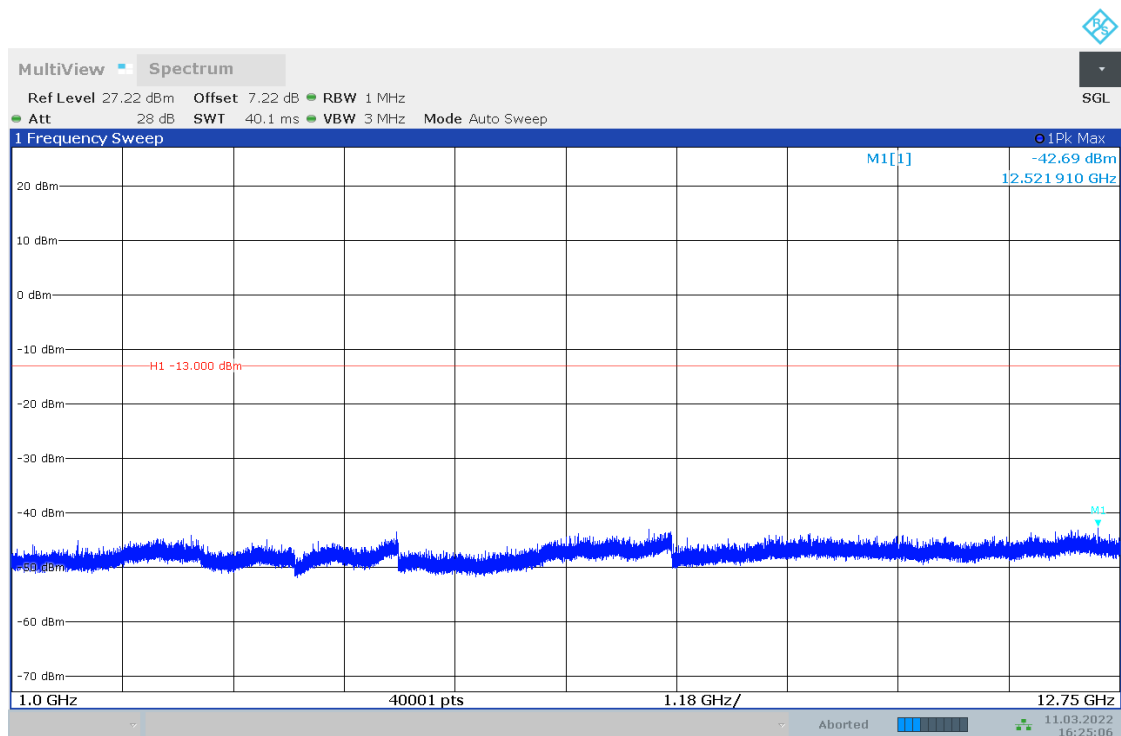


16:25:06 11.03.2022


6.2.18 TM1_5MHz_HCH_RB25#0

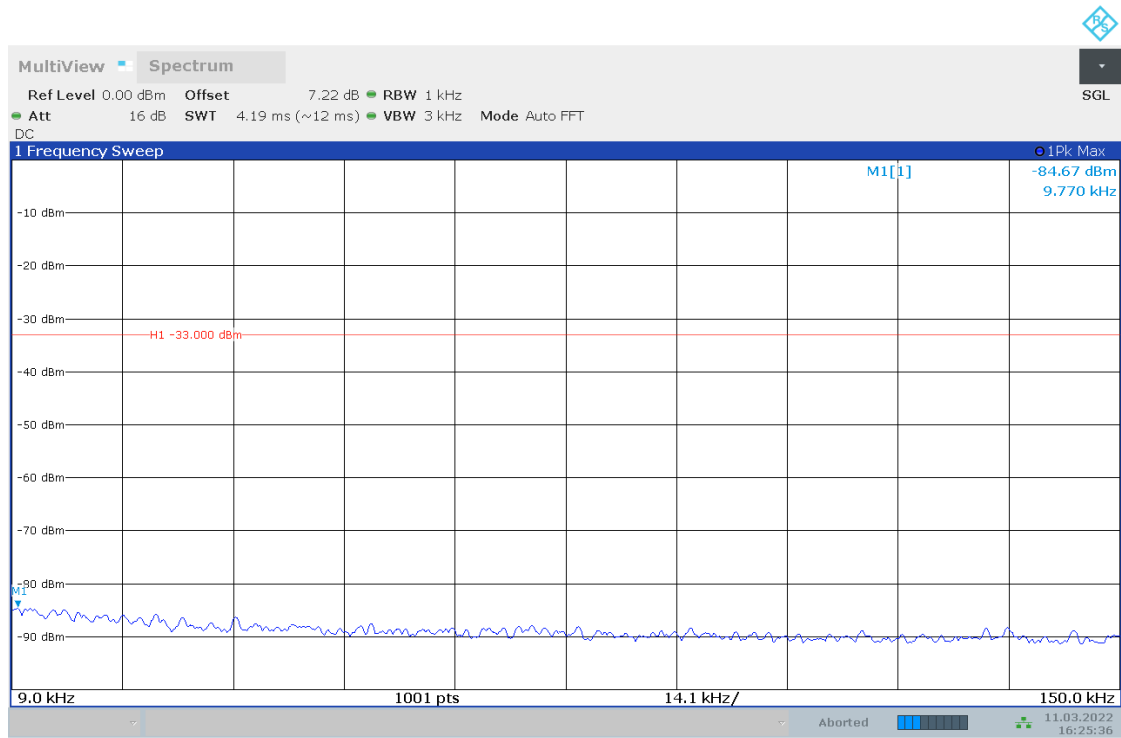


16:25:37 11.03.2022

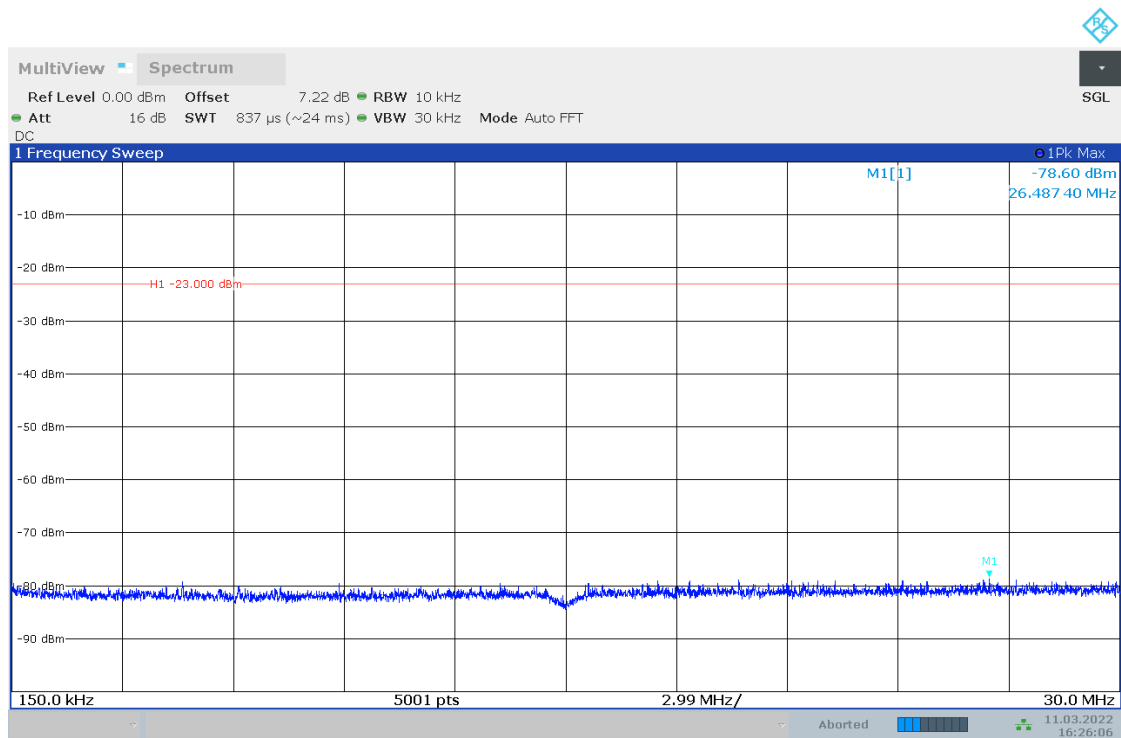

16:26:07 11.03.2022

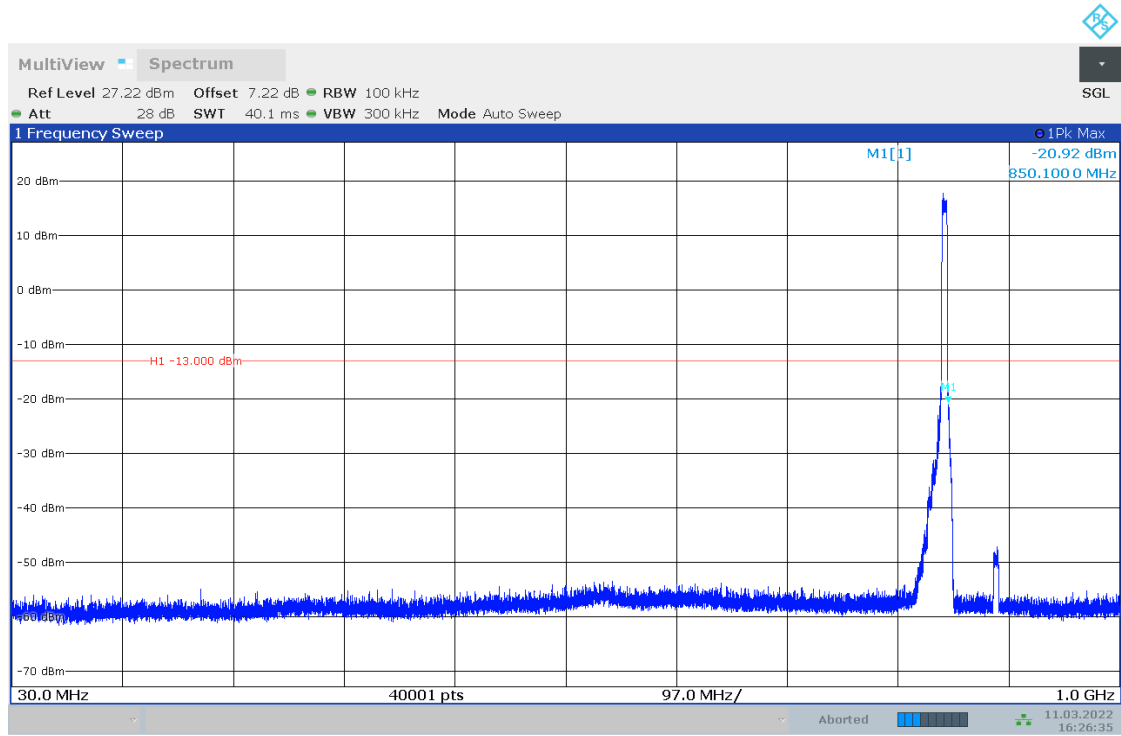


16:26:36 11.03.2022

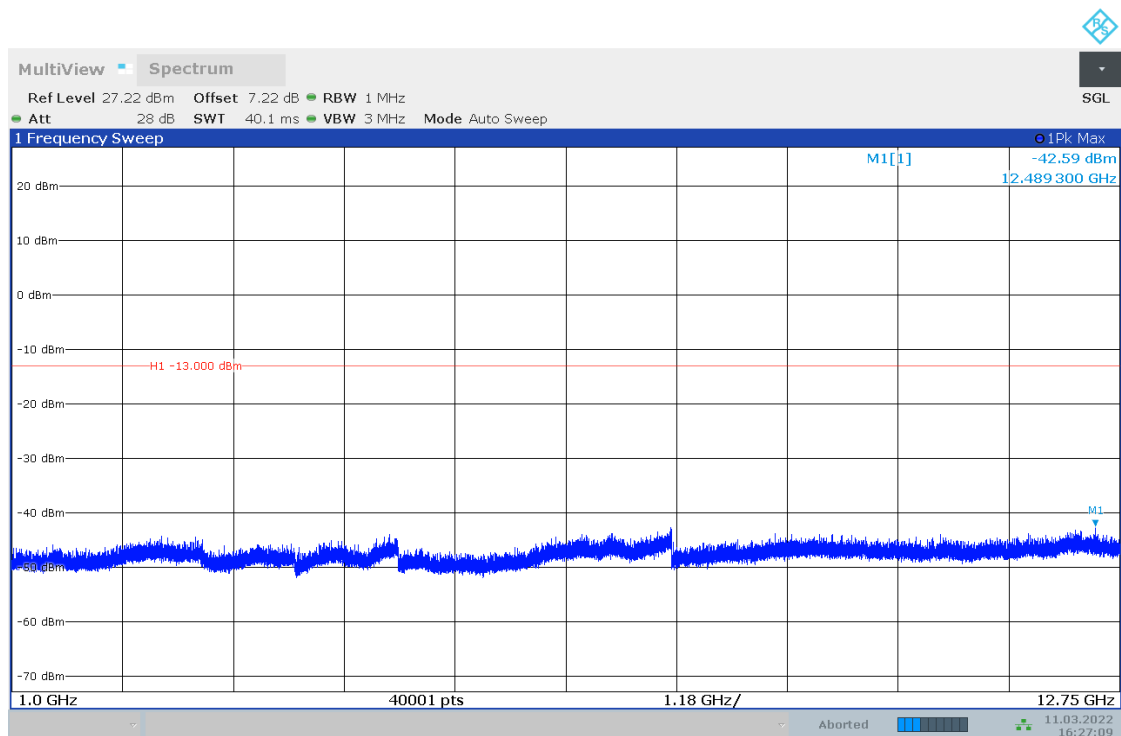


16:27:10 11.03.2022


6.2.19 TM1_10MHz_LCH_RB1#0

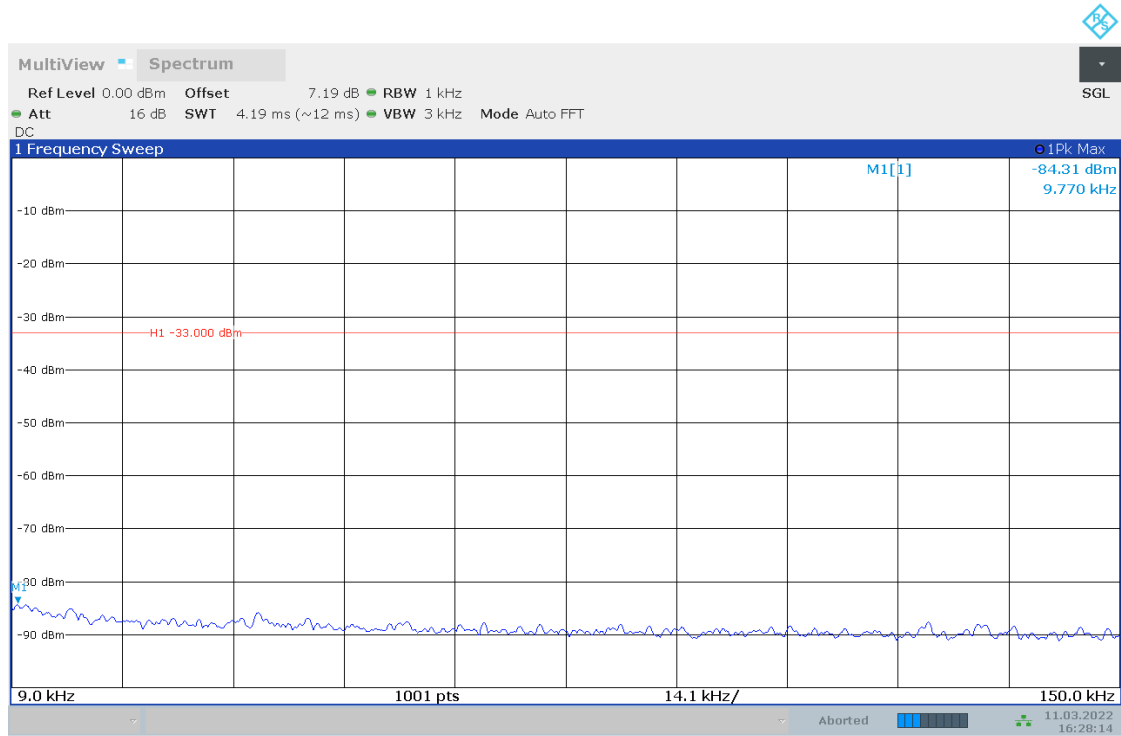


16:28:15 11.03.2022

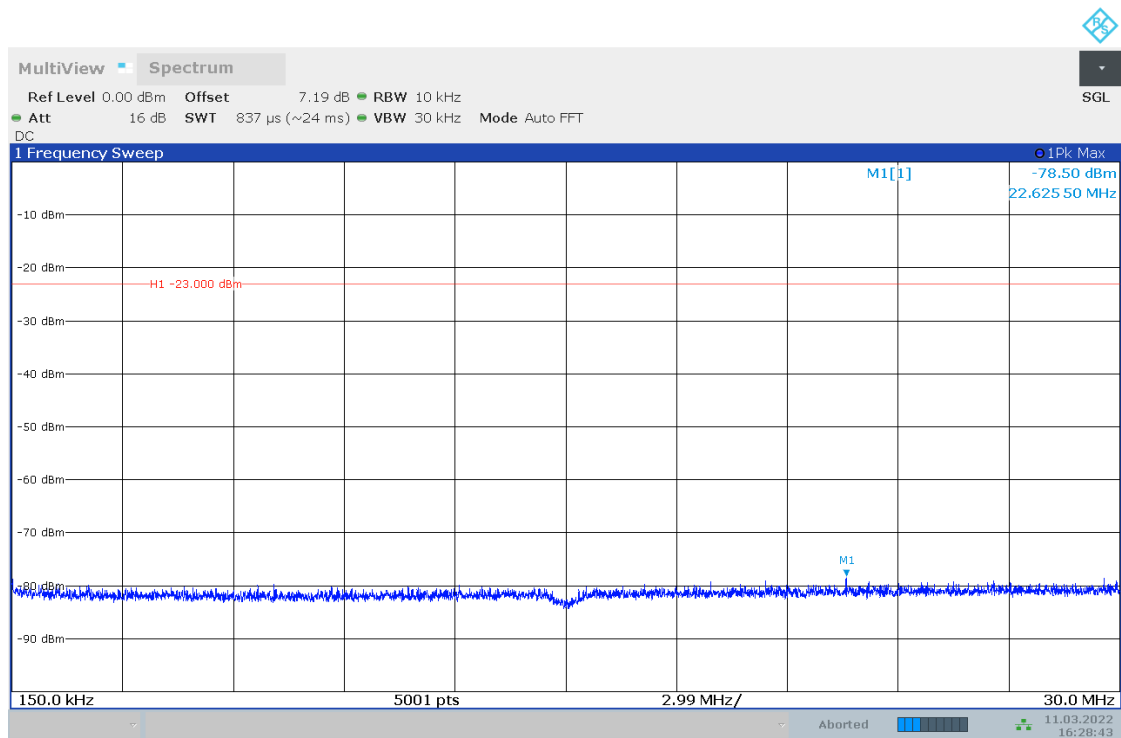

16:28:44 11.03.2022

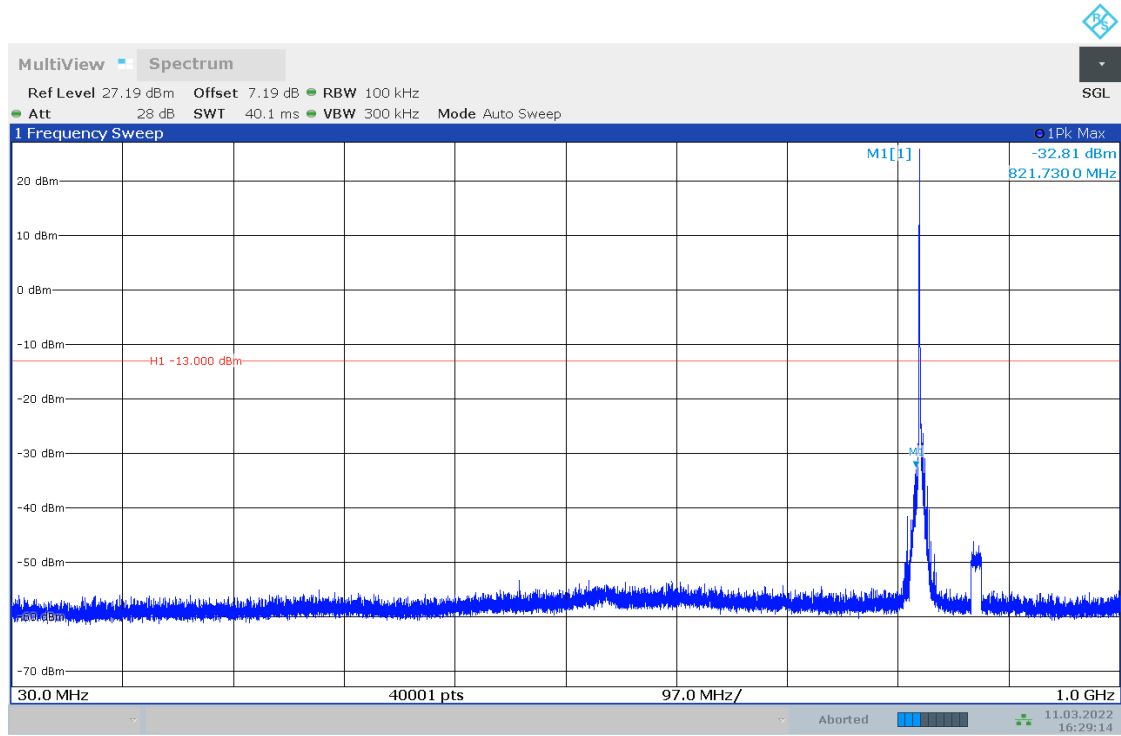


16:29:15 11.03.2022

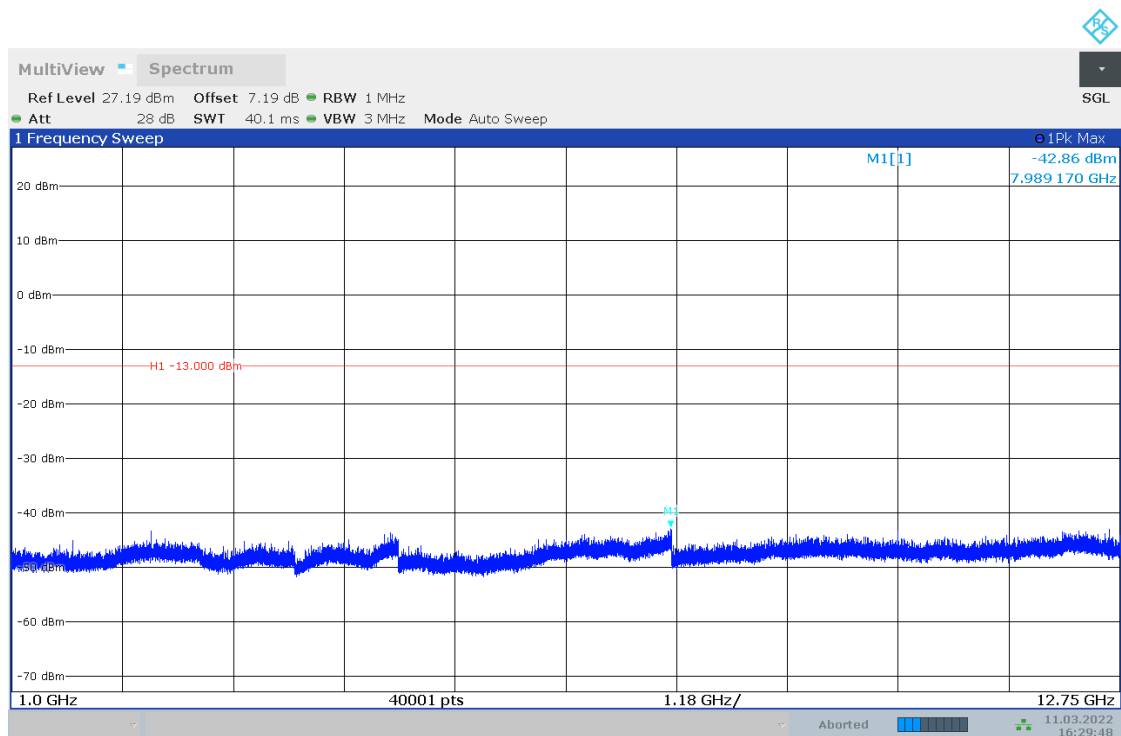


16:29:49 11.03.2022


6.2.20 TM1_10MHz_LCH_RB1#49

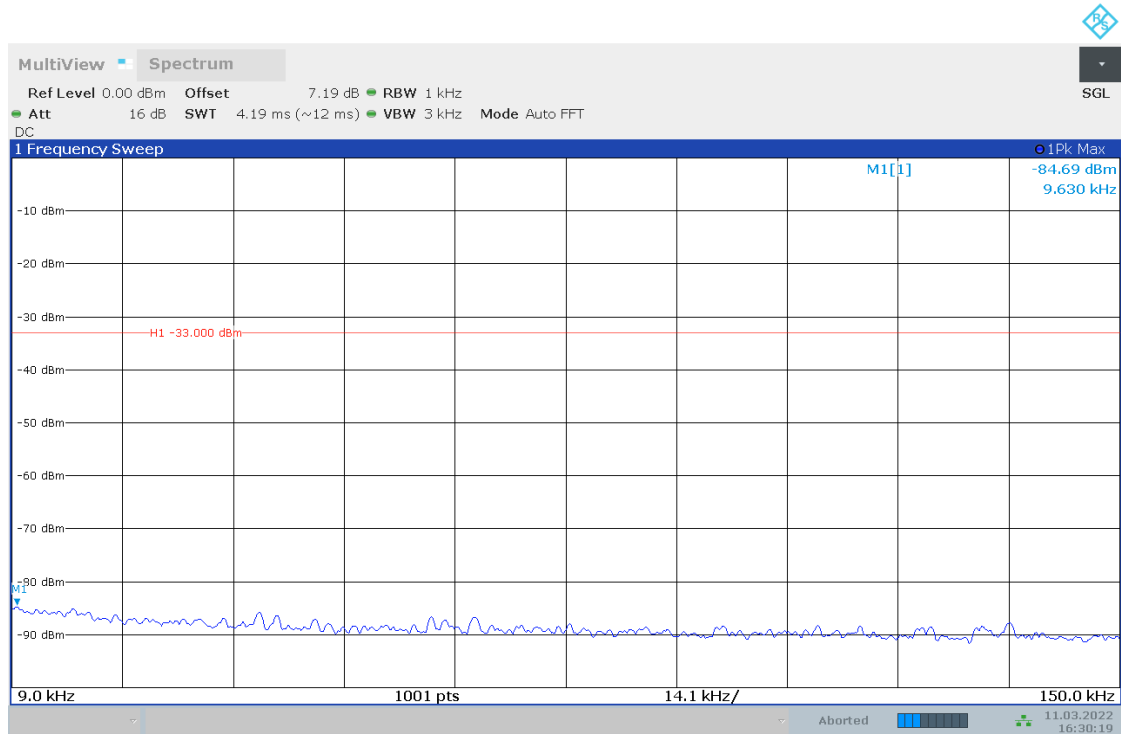


16:30:20 11.03.2022

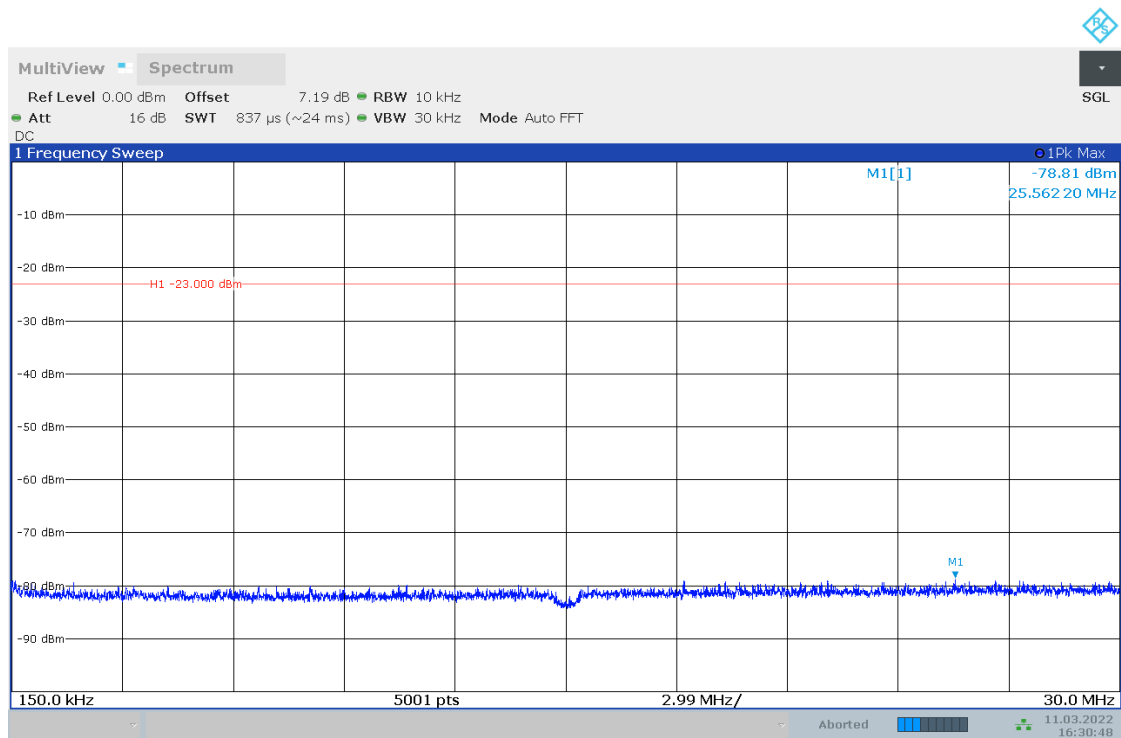

16:30:49 11.03.2022

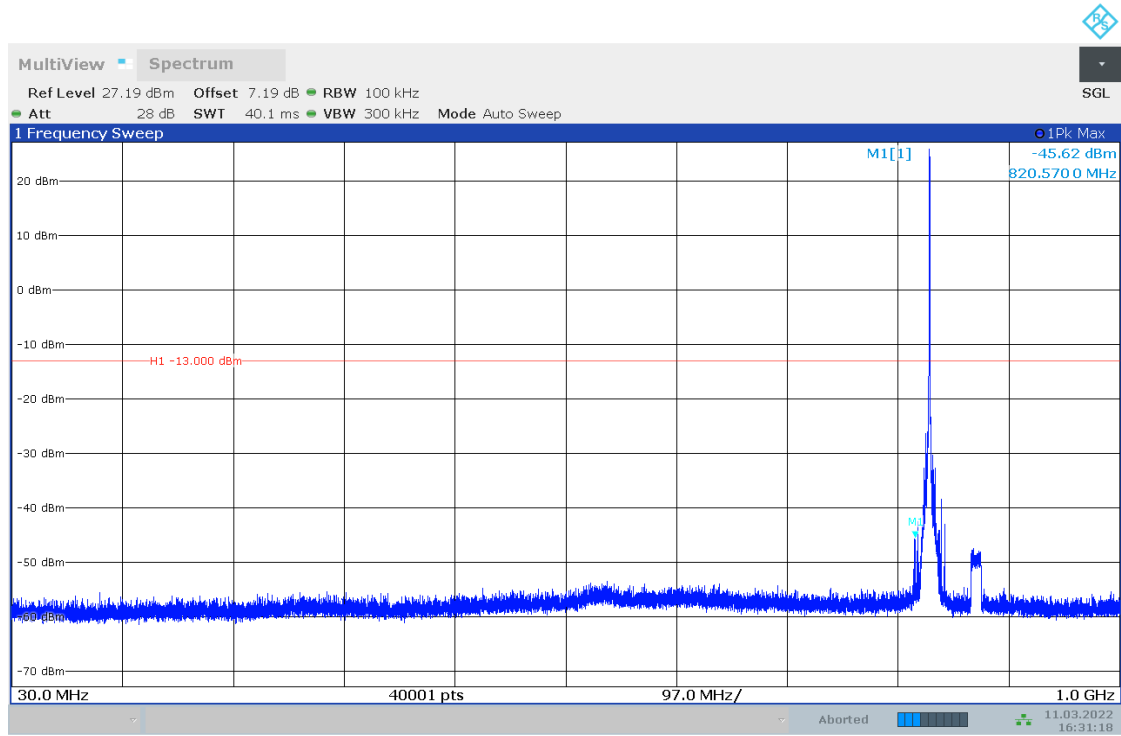


16:31:18 11.03.2022

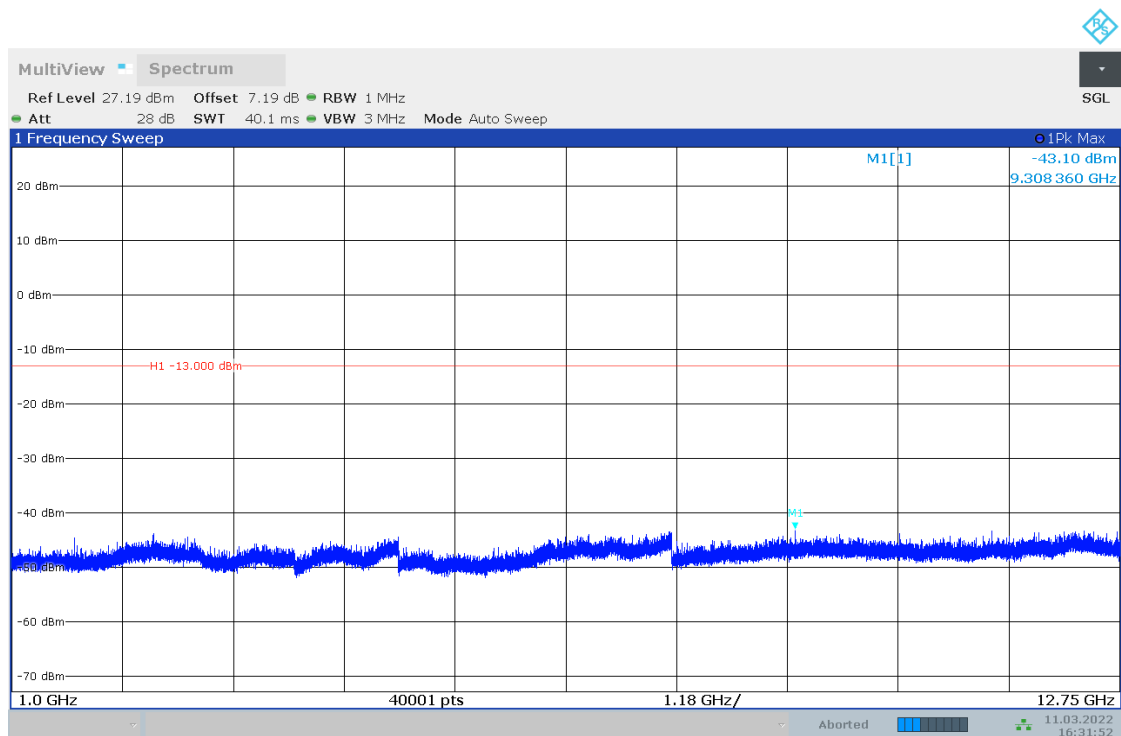


16:31:53 11.03.2022


6.2.21 TM1_10MHz_LCH_RB50#0

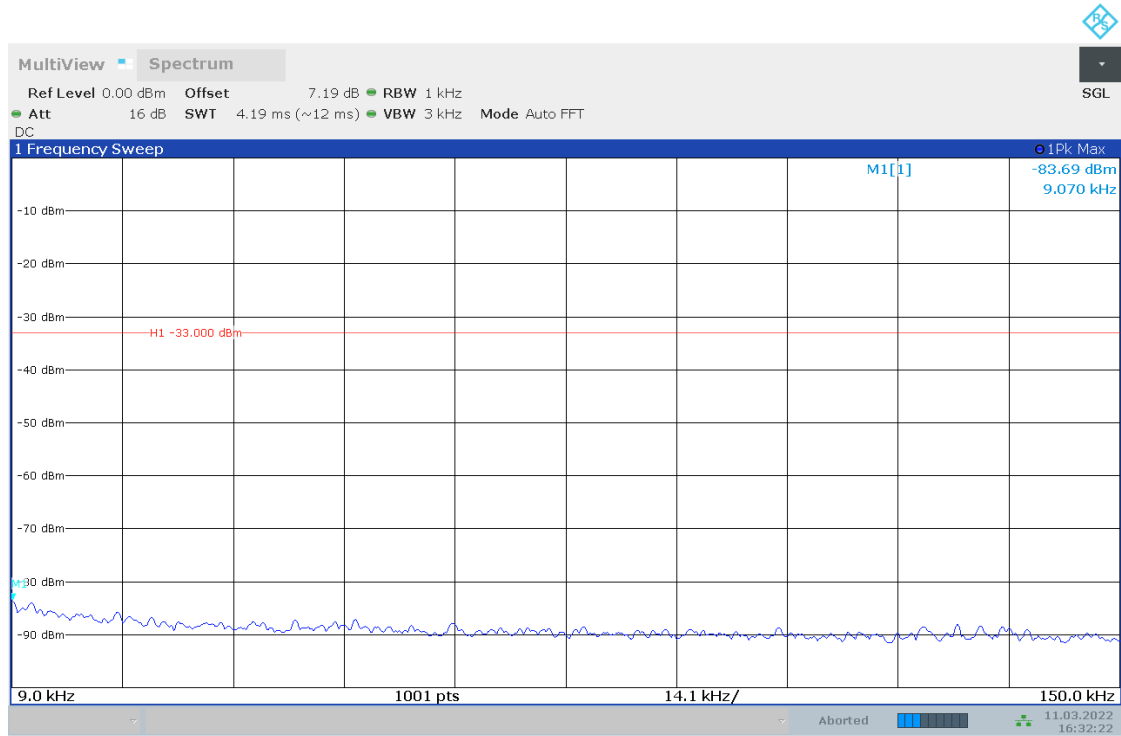


16:32:23 11.03.2022

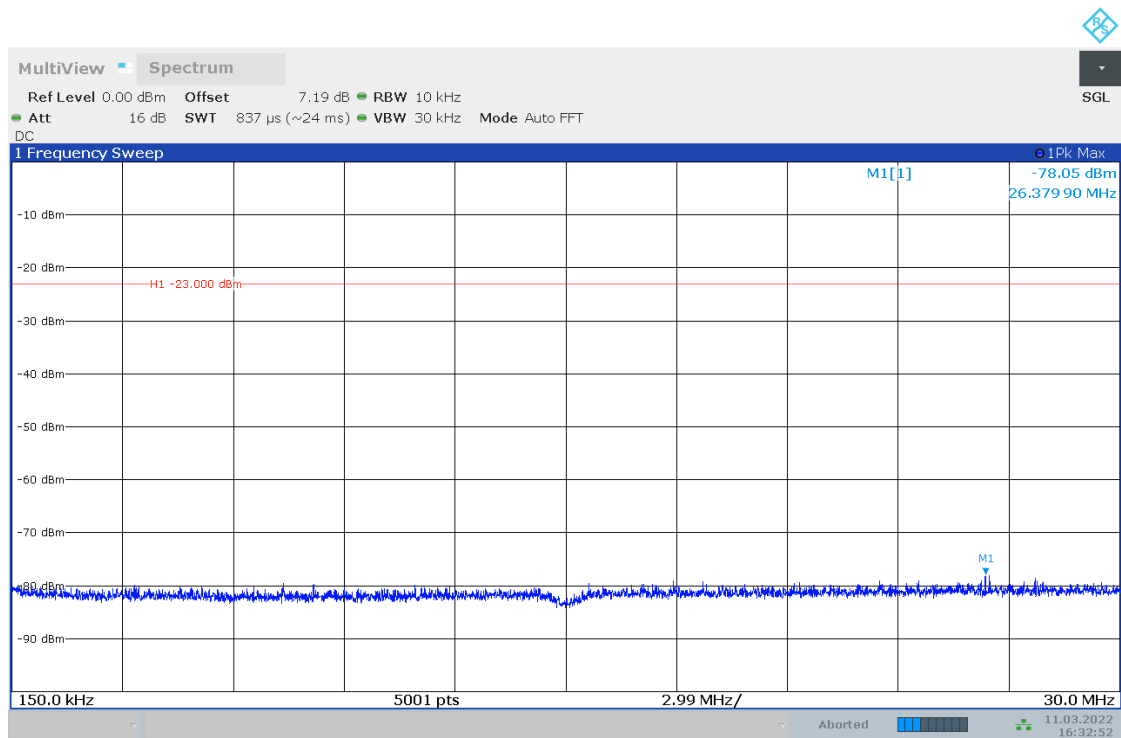

16:32:53 11.03.2022

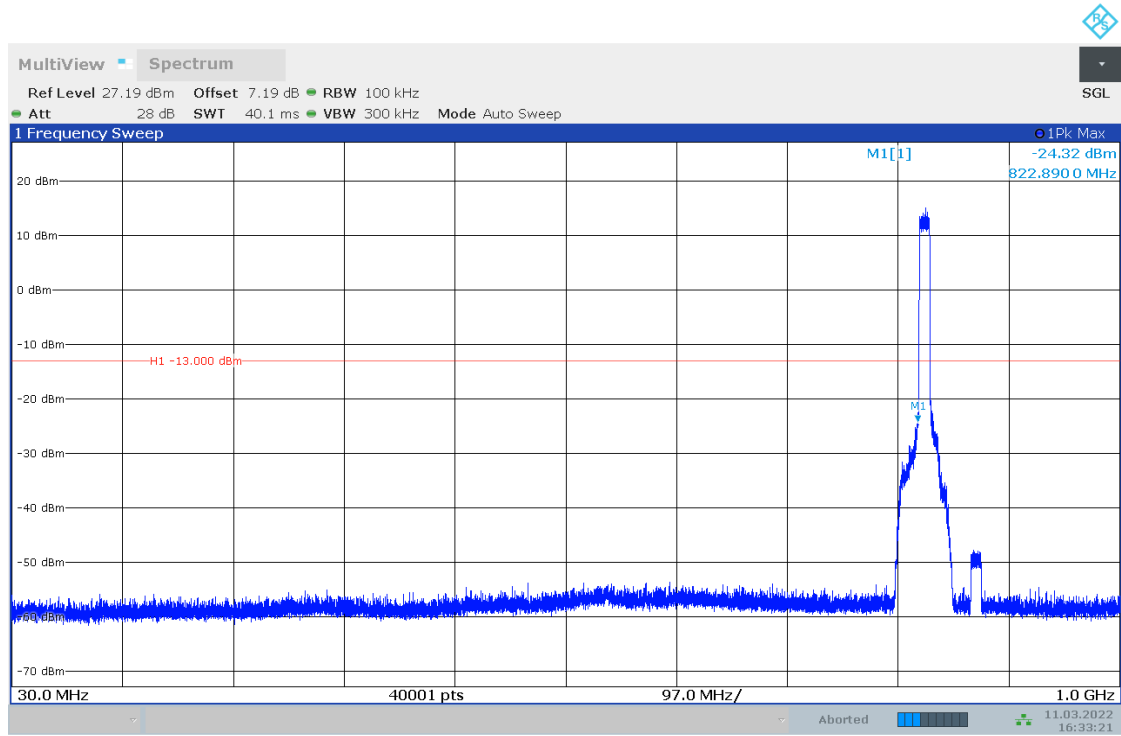


16:33:22 11.03.2022

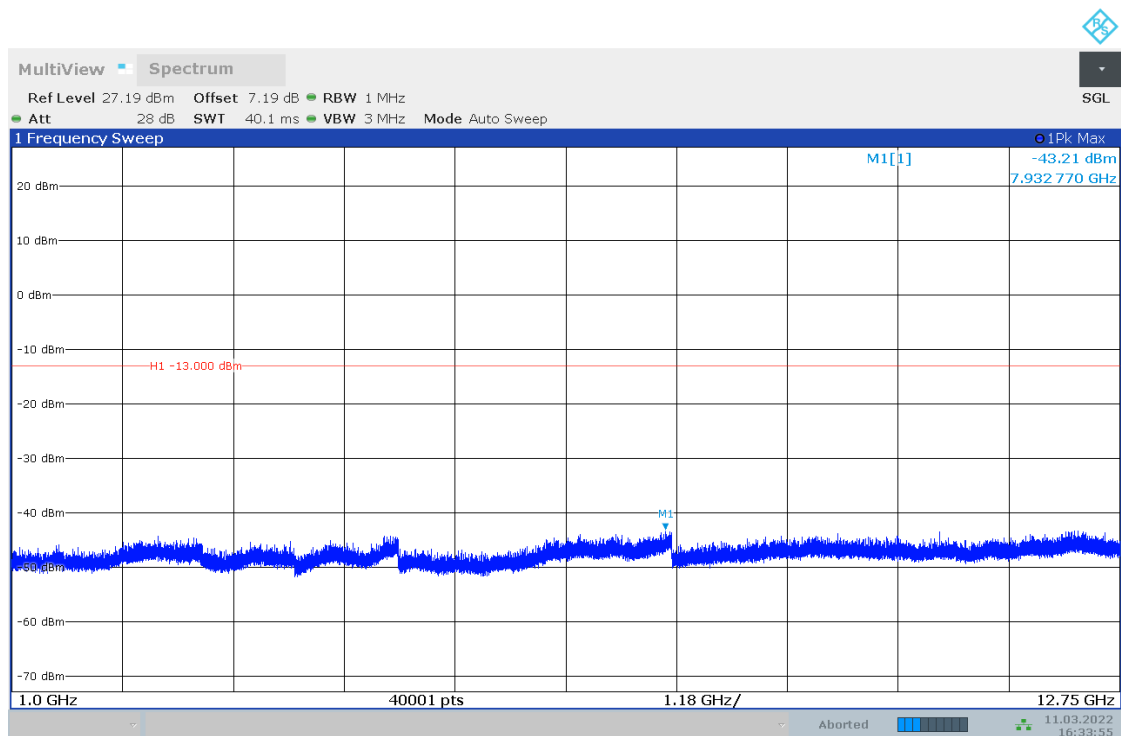


16:33:56 11.03.2022


6.2.22 TM1_10MHz_MCH_RB1#0

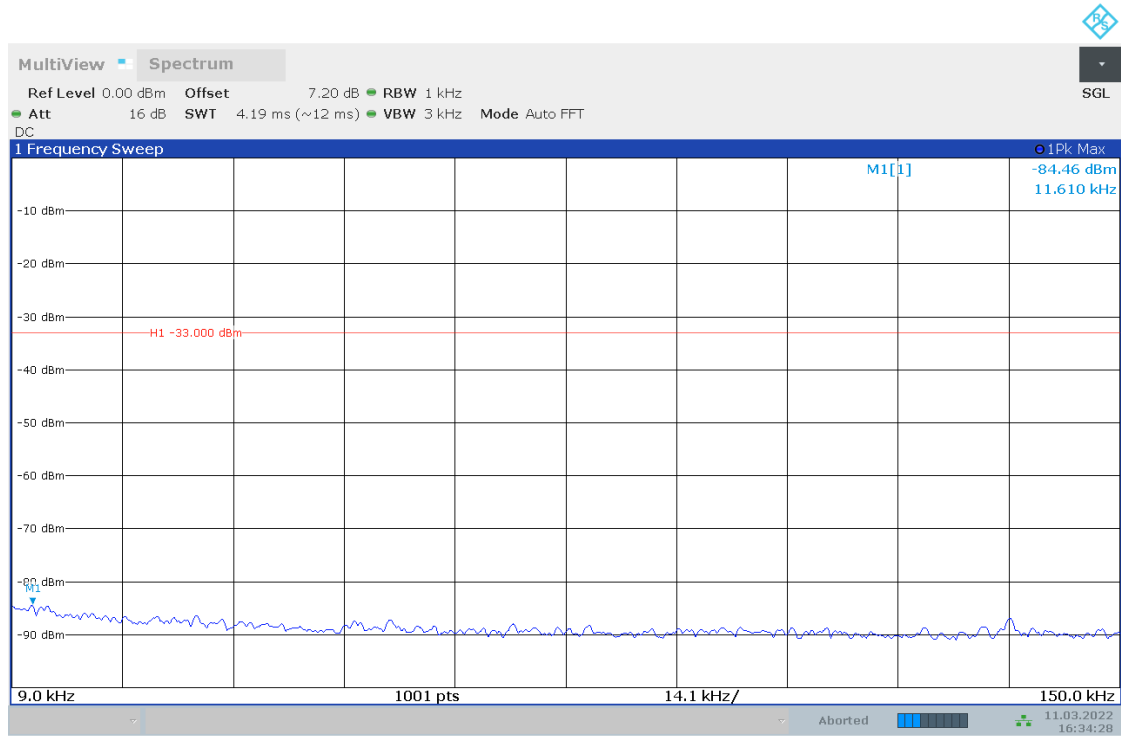


16:34:29 11.03.2022

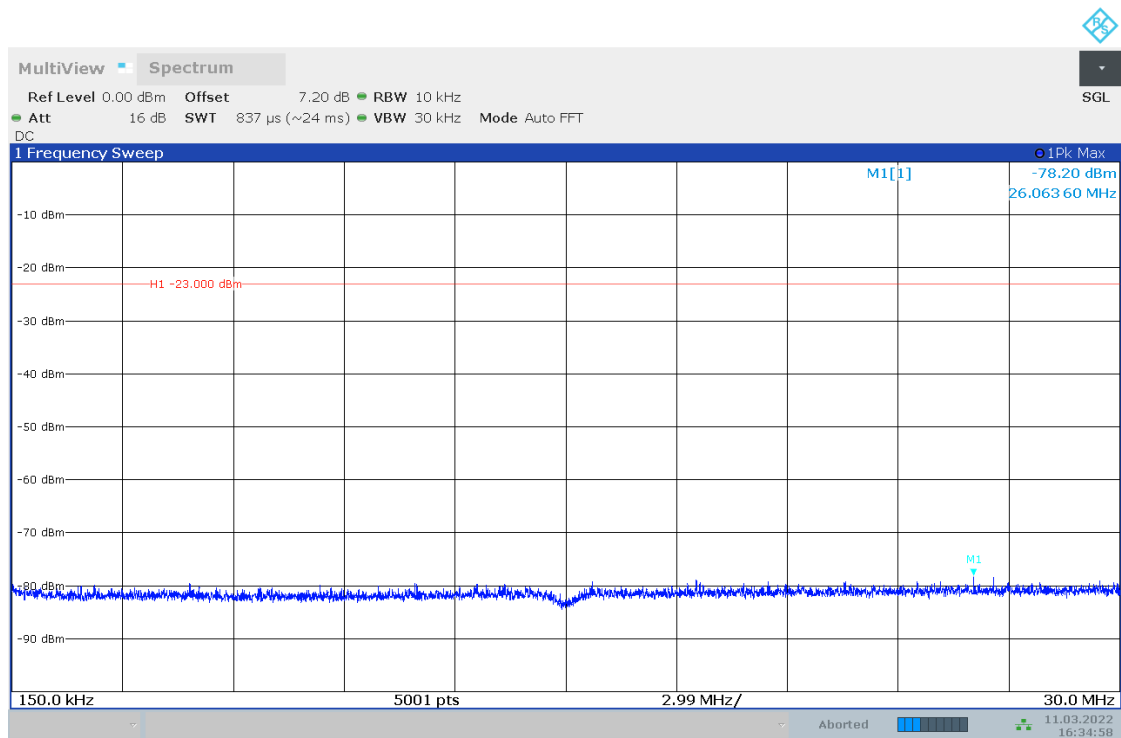

16:34:59 11.03.2022

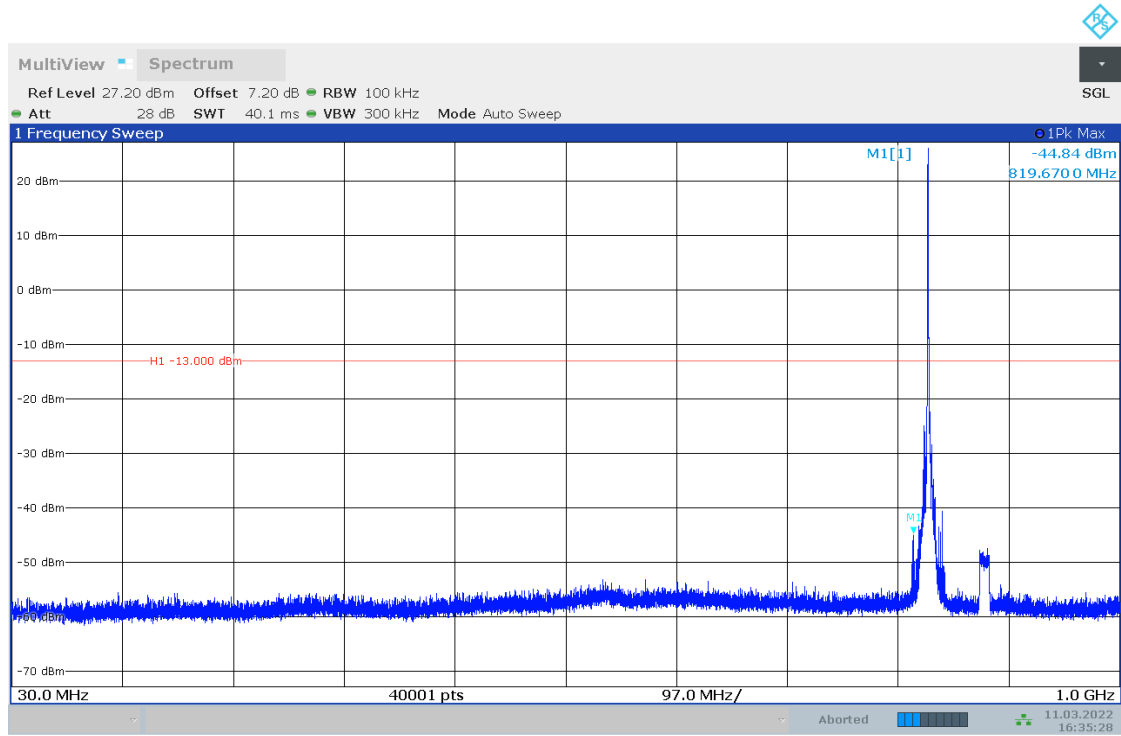


16:35:29 11.03.2022

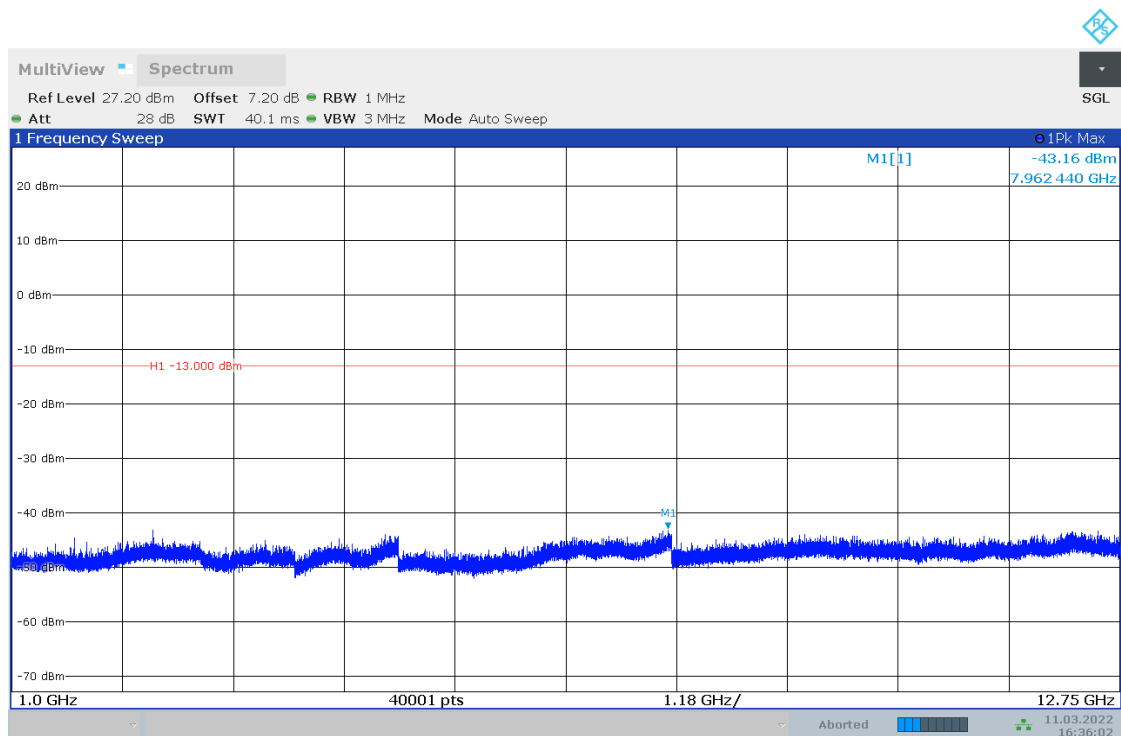


16:36:03 11.03.2022


6.2.23 TM1_10MHz_MCH_RB1#49

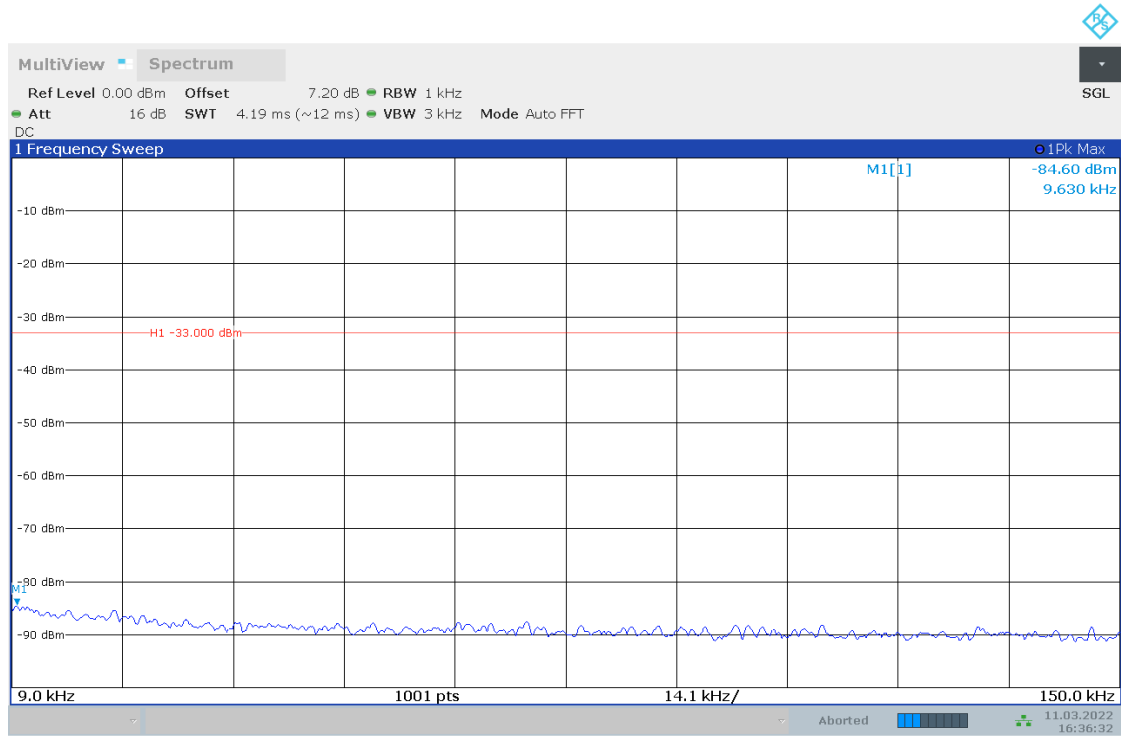


16:36:33 11.03.2022

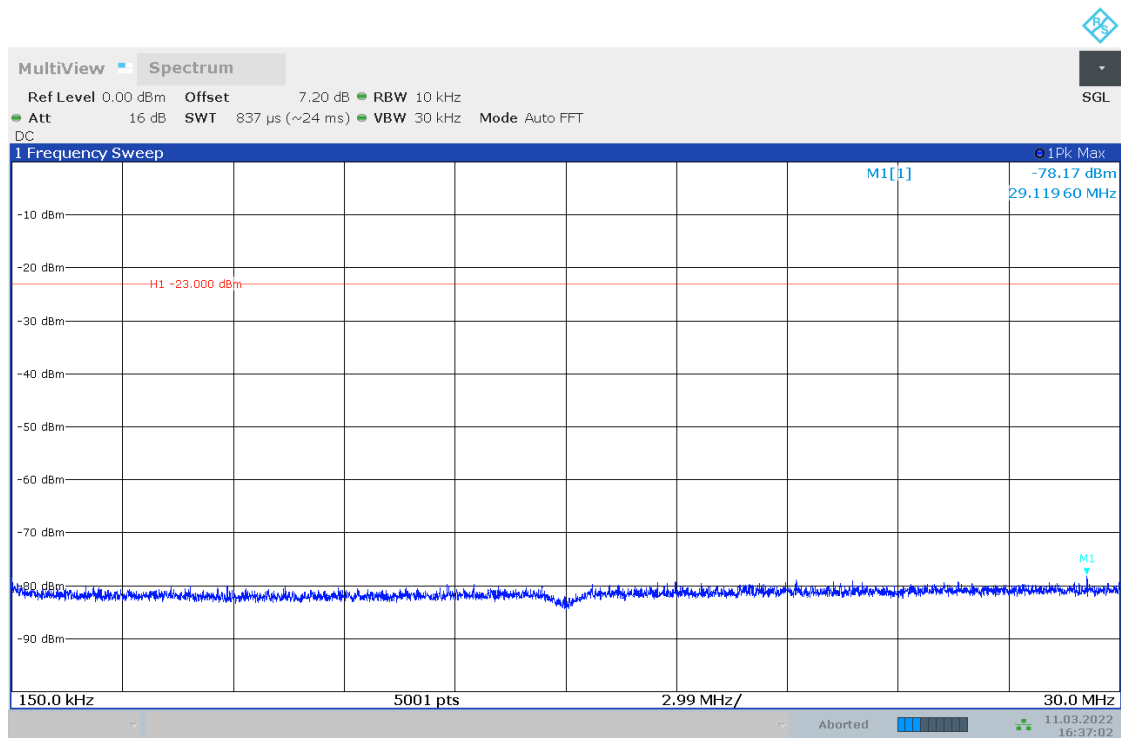

16:37:03 11.03.2022

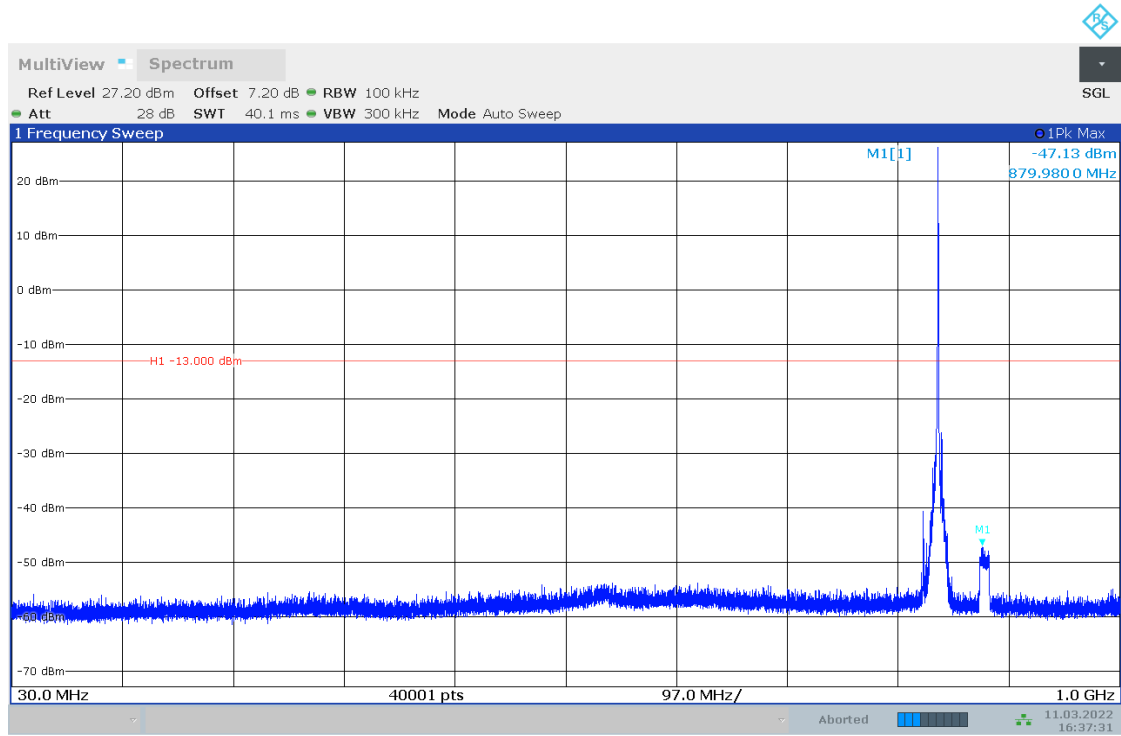


16:37:32 11.03.2022

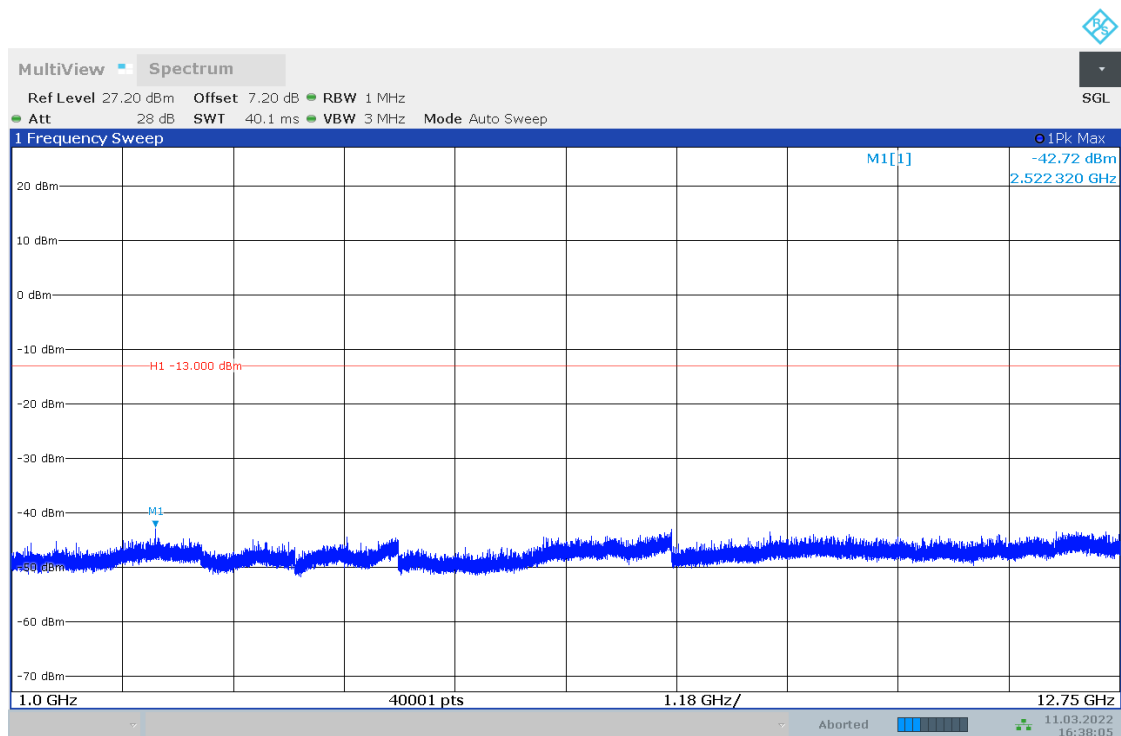


16:38:06 11.03.2022


6.2.24 TM1_10MHz_MCH_RB50#0

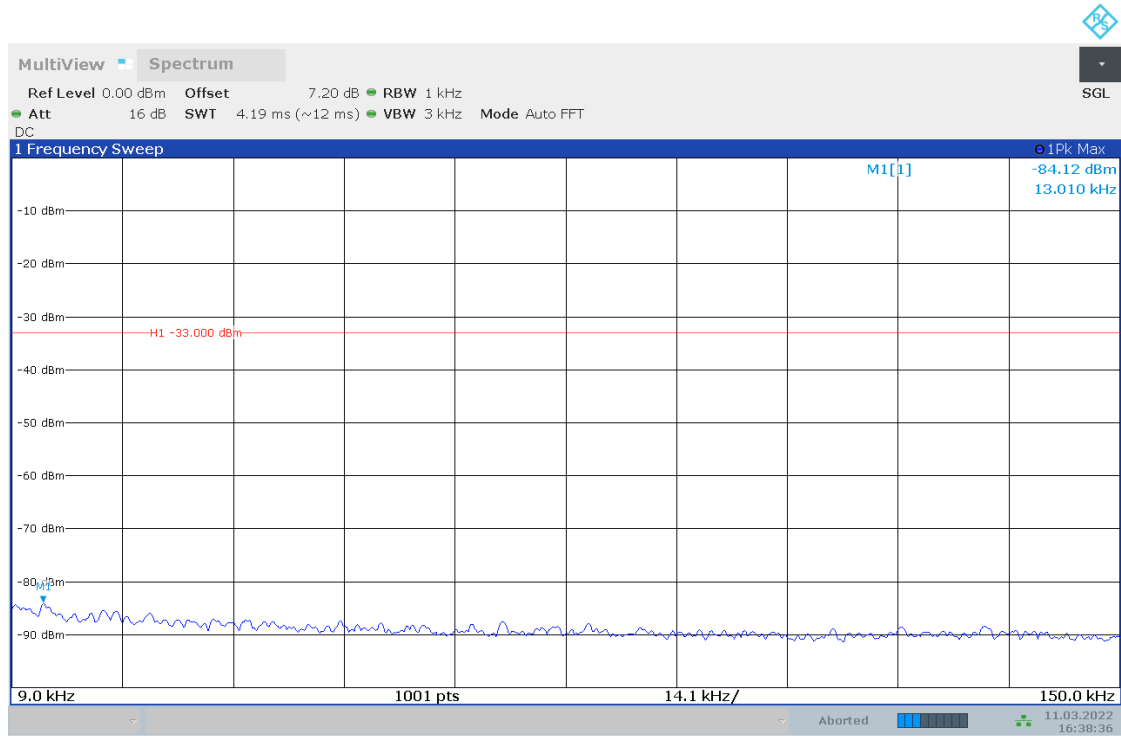


16:38:37 11.03.2022

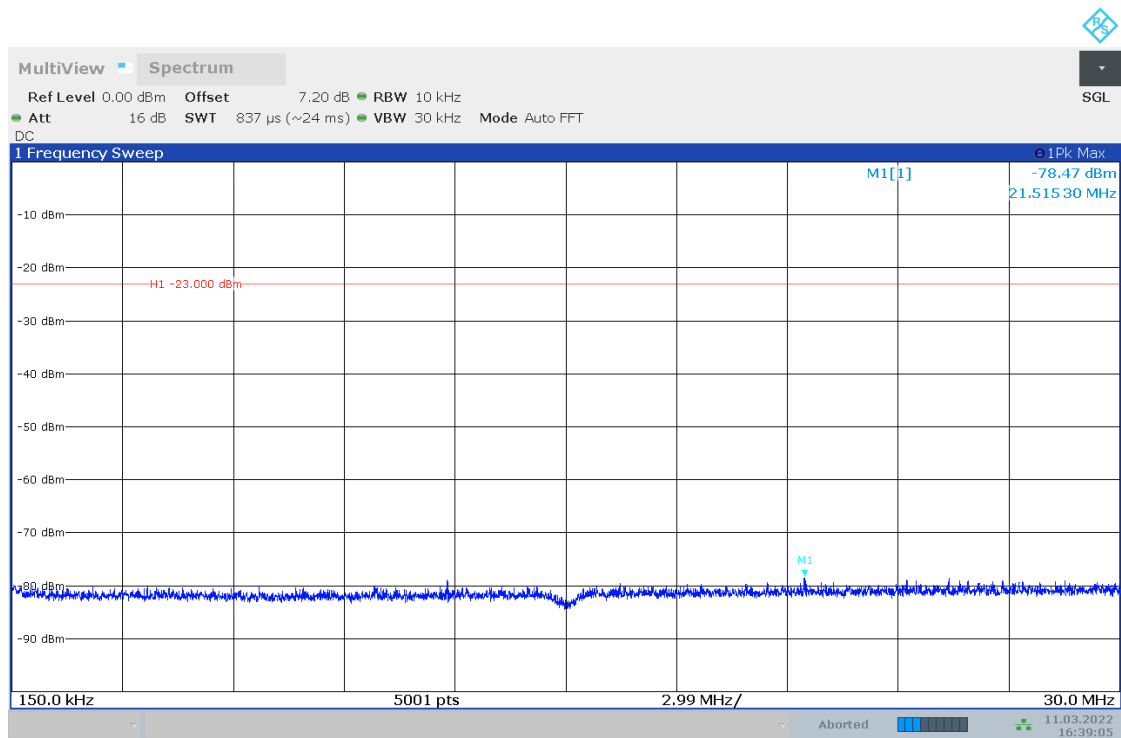

16:39:06 11.03.2022

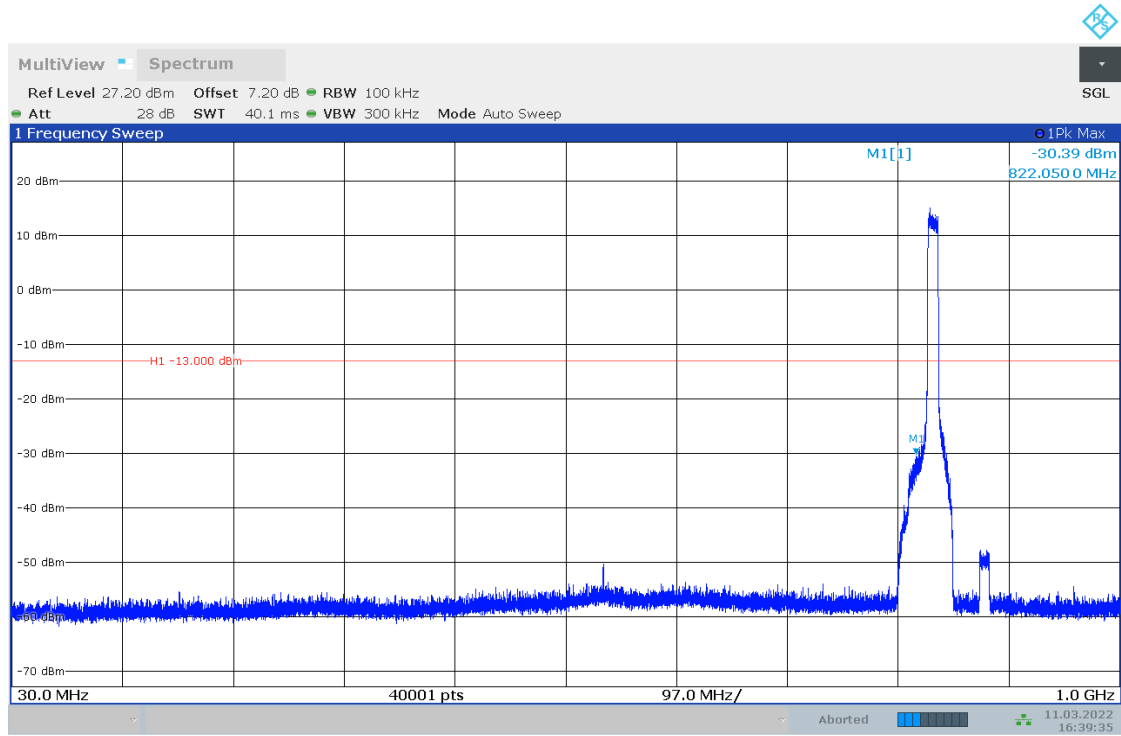


16:39:36 11.03.2022

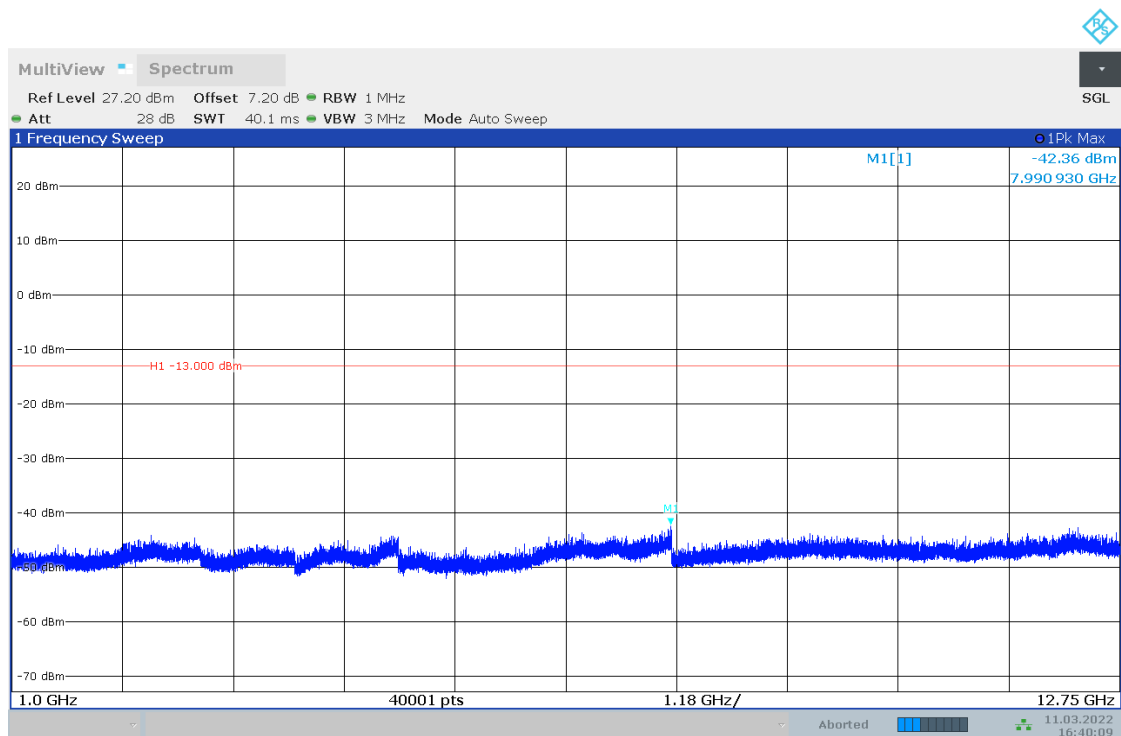


16:40:10 11.03.2022


6.2.25 TM1_10MHz_HCH_RB1#0

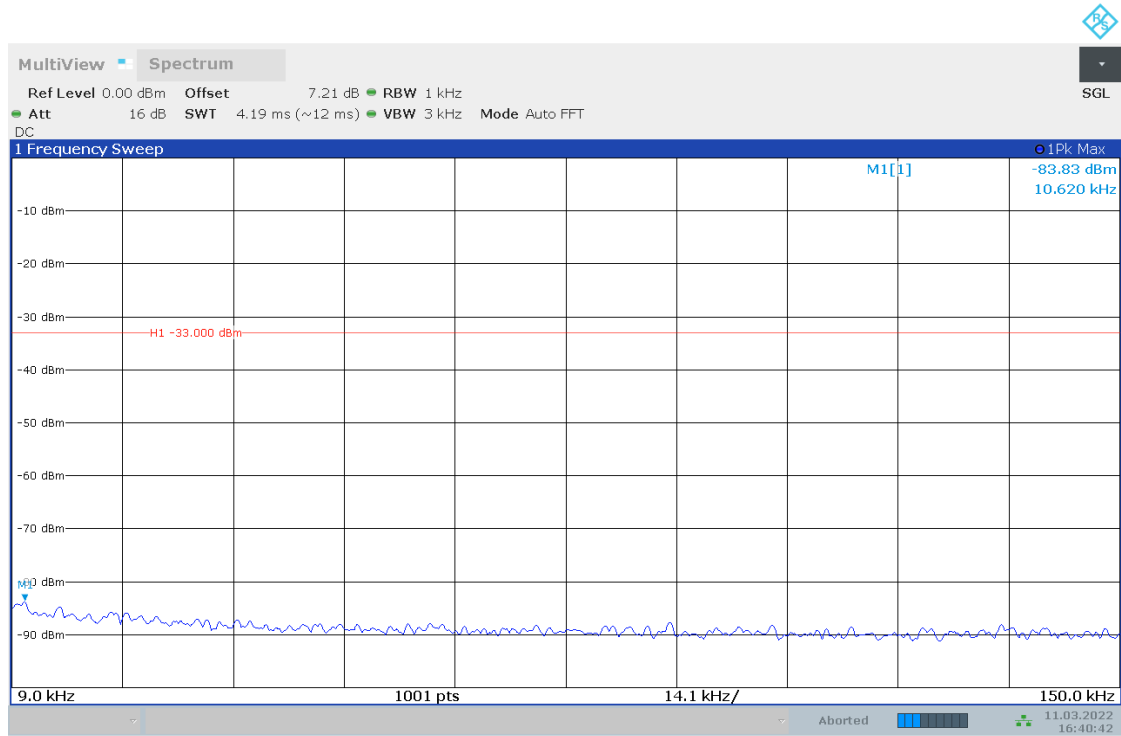


16:40:43 11.03.2022

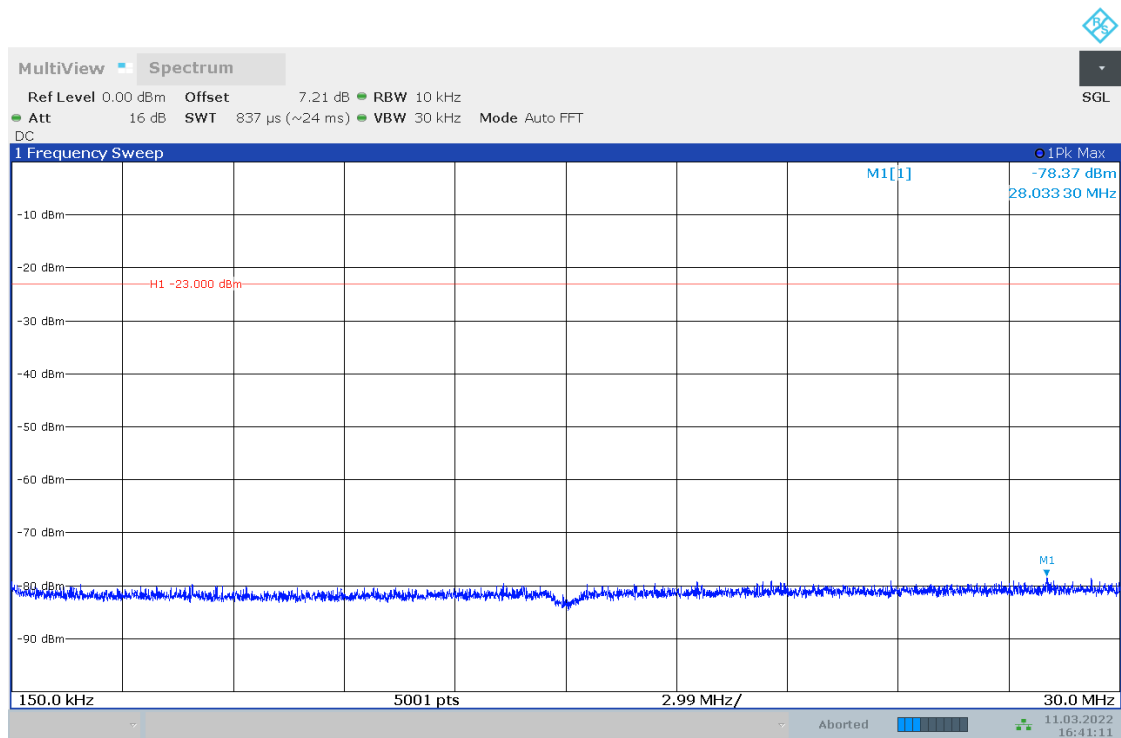

16:41:12 11.03.2022

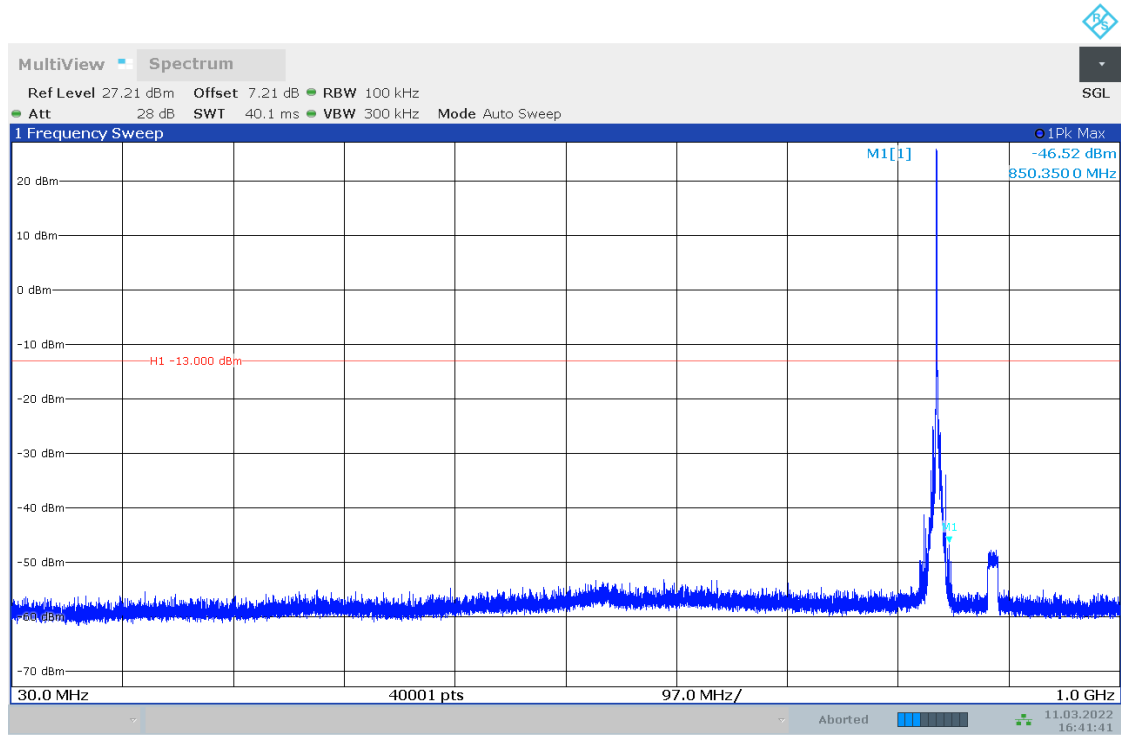


16:41:42 11.03.2022

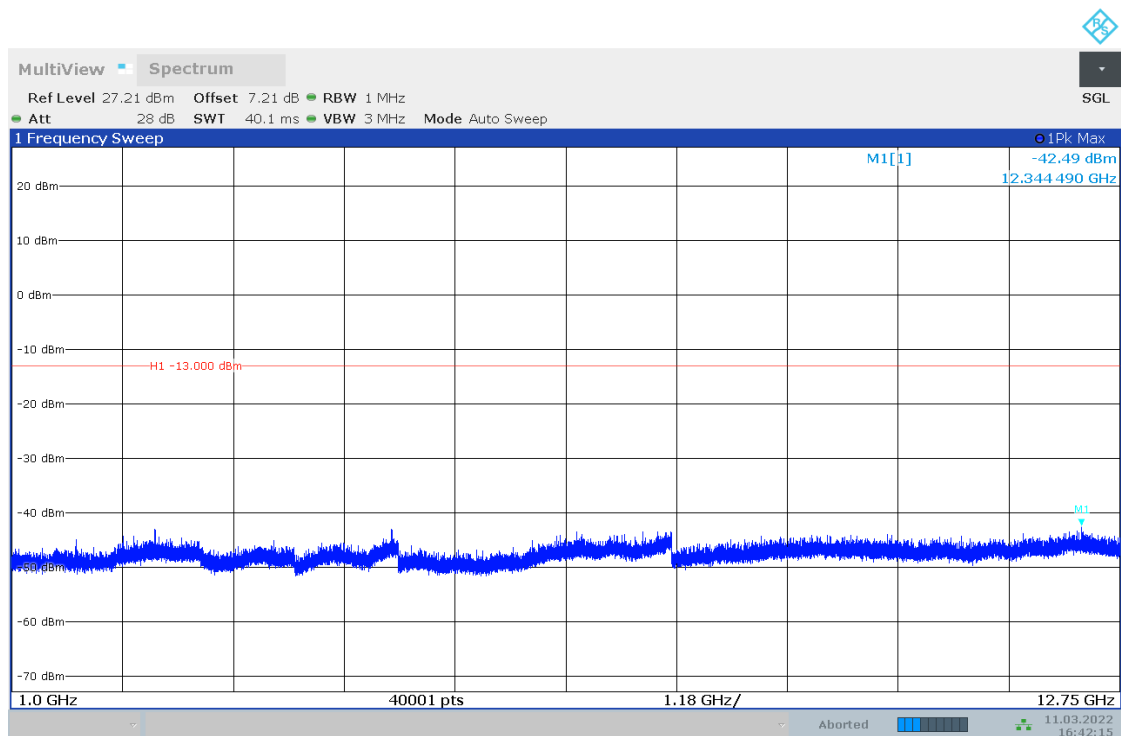


16:42:16 11.03.2022


6.2.26 TM1_10MHz_HCH_RB1#49

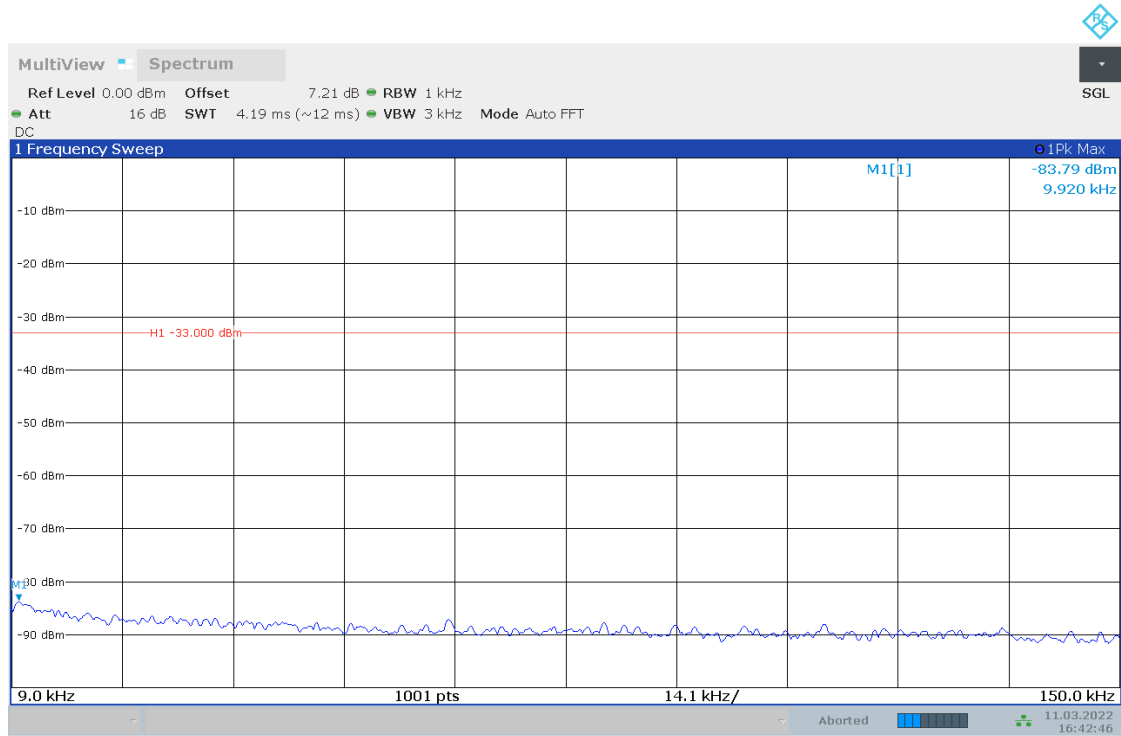


16:42:47 11.03.2022

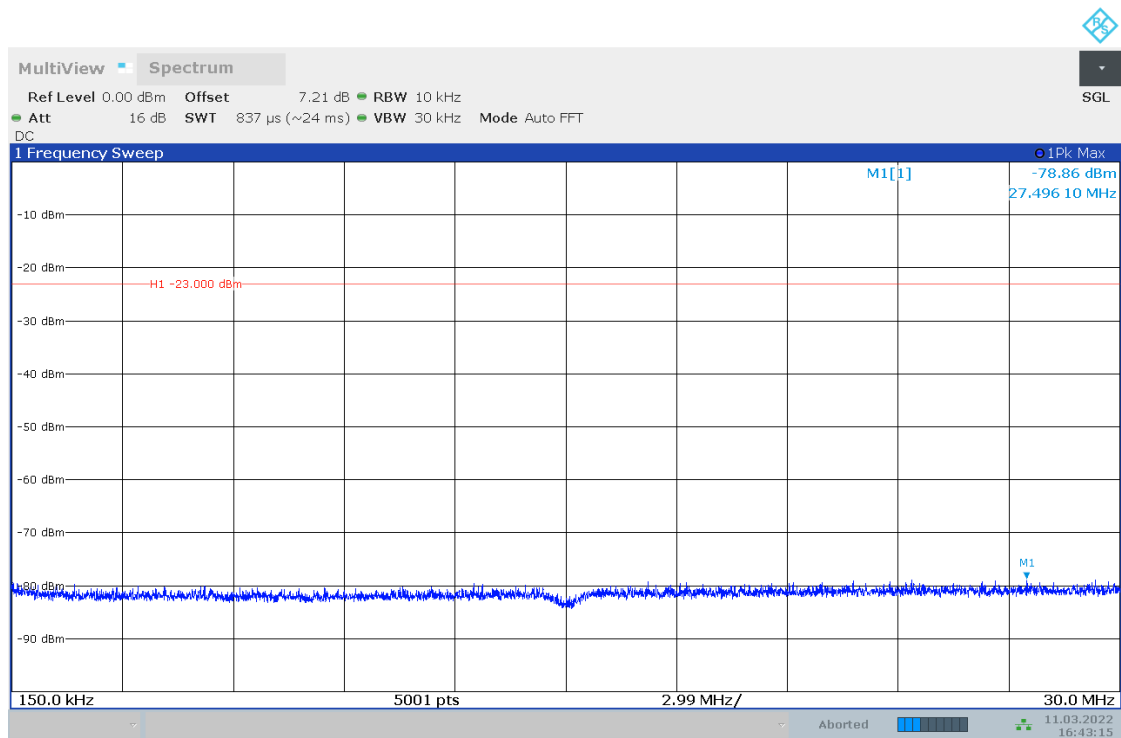

16:43:16 11.03.2022

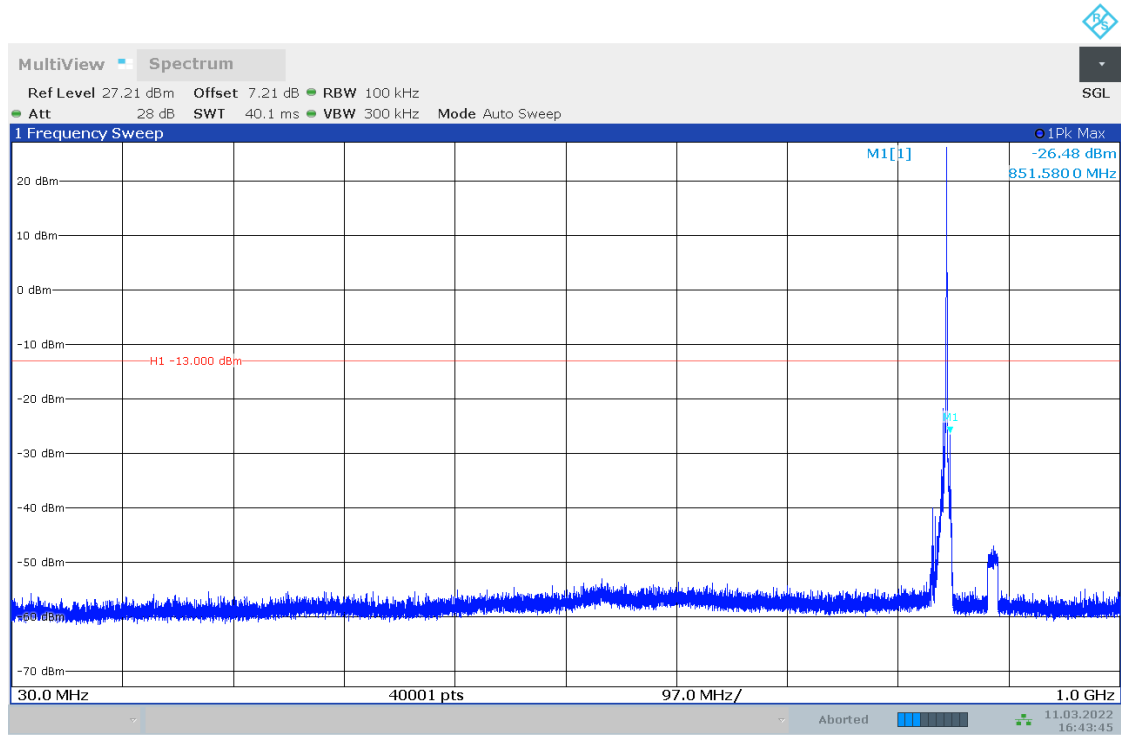


16:43:46 11.03.2022

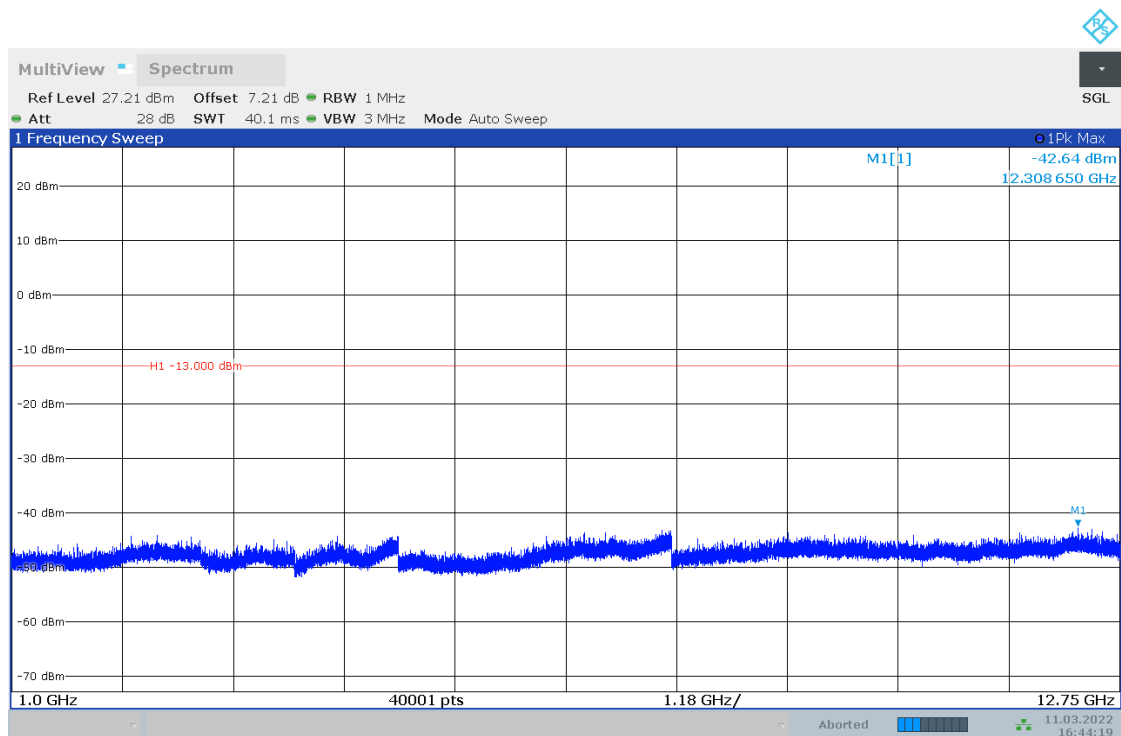


16:44:20 11.03.2022


6.2.27 TM1_10MHz_HCH_RB50#0

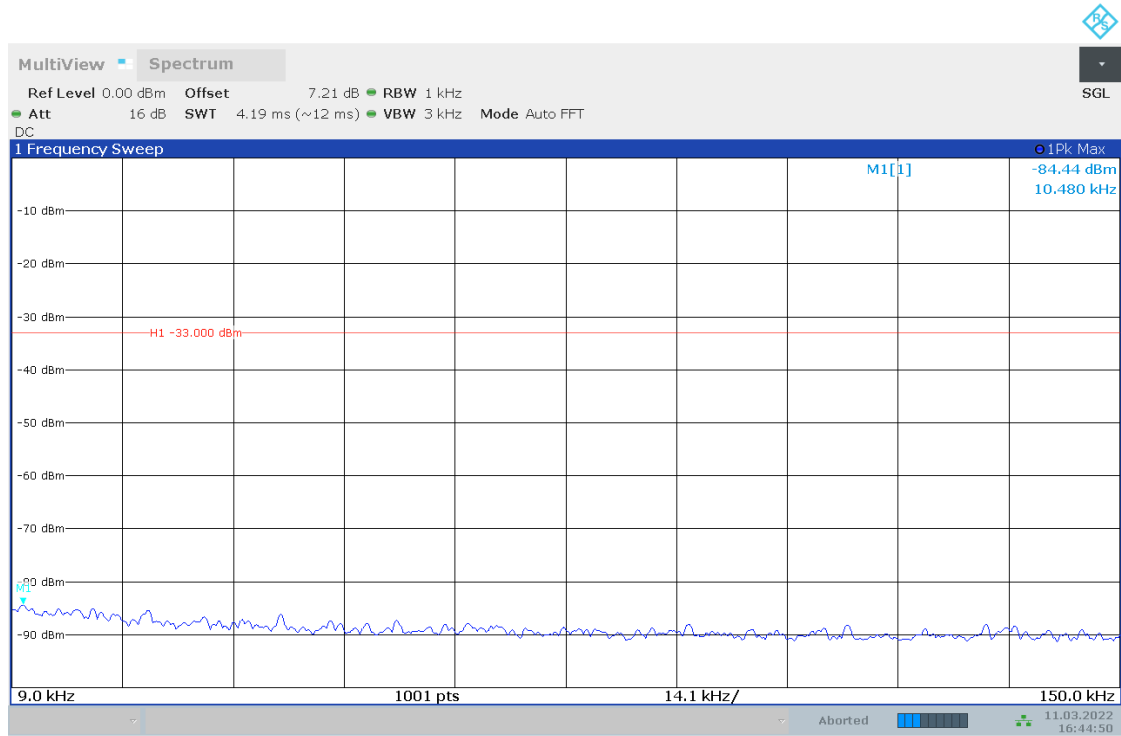


16:44:50 11.03.2022

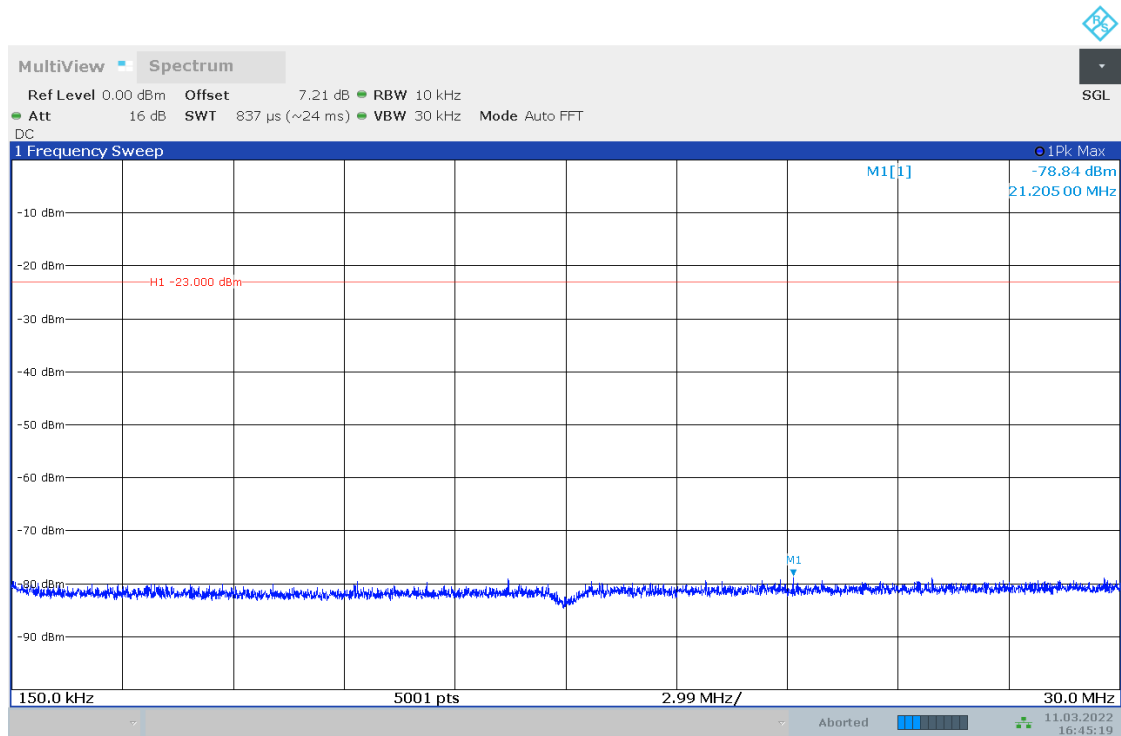

16:45:20 11.03.2022

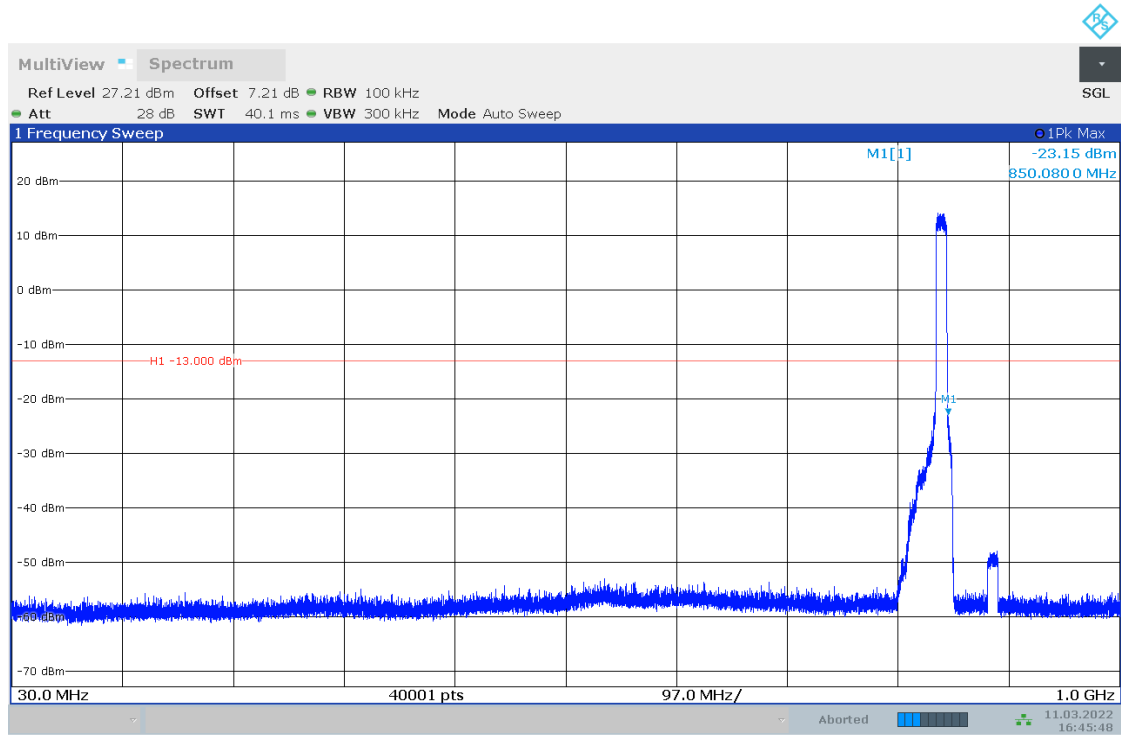


16:45:49 11.03.2022

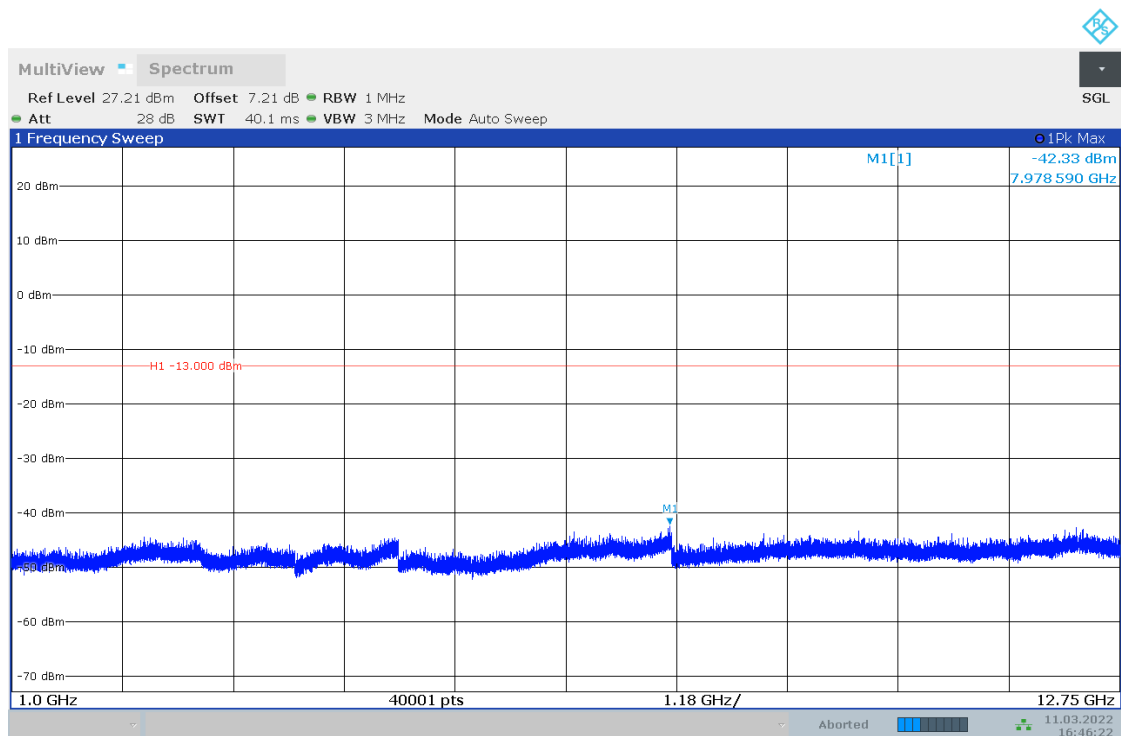


16:46:23 11.03.2022


6.2.28 TM2_1.4MHz_LCH_RB1#0

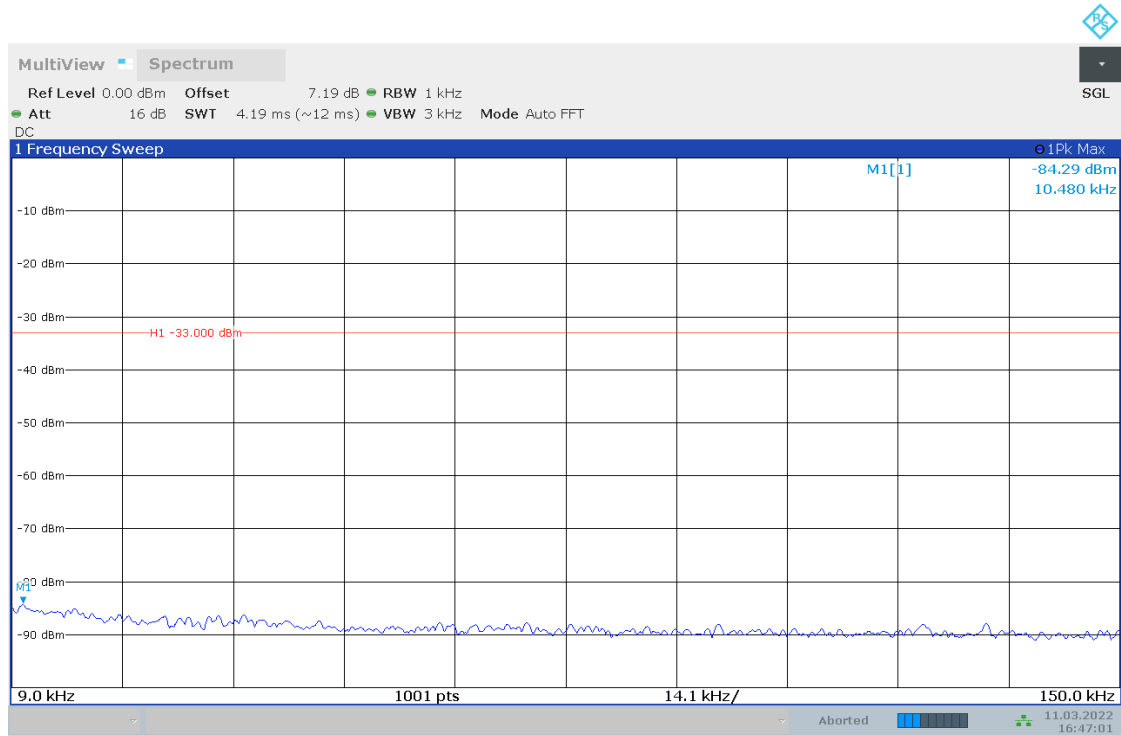


16:47:02 11.03.2022

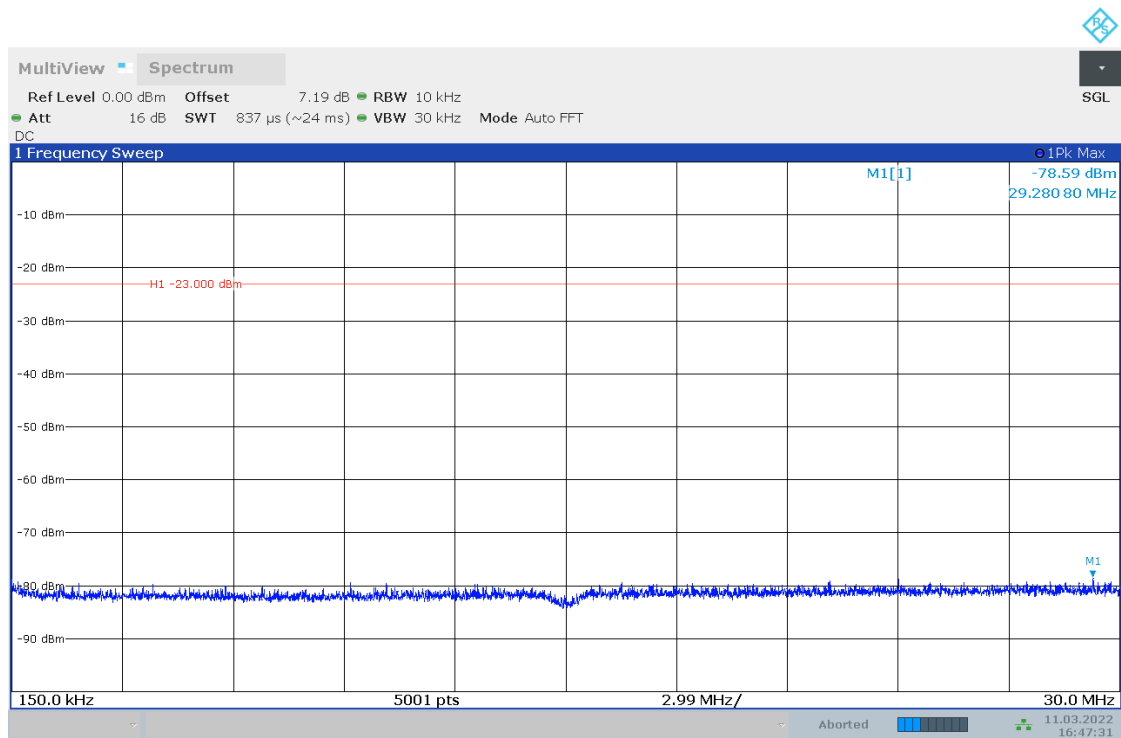

16:47:31 11.03.2022

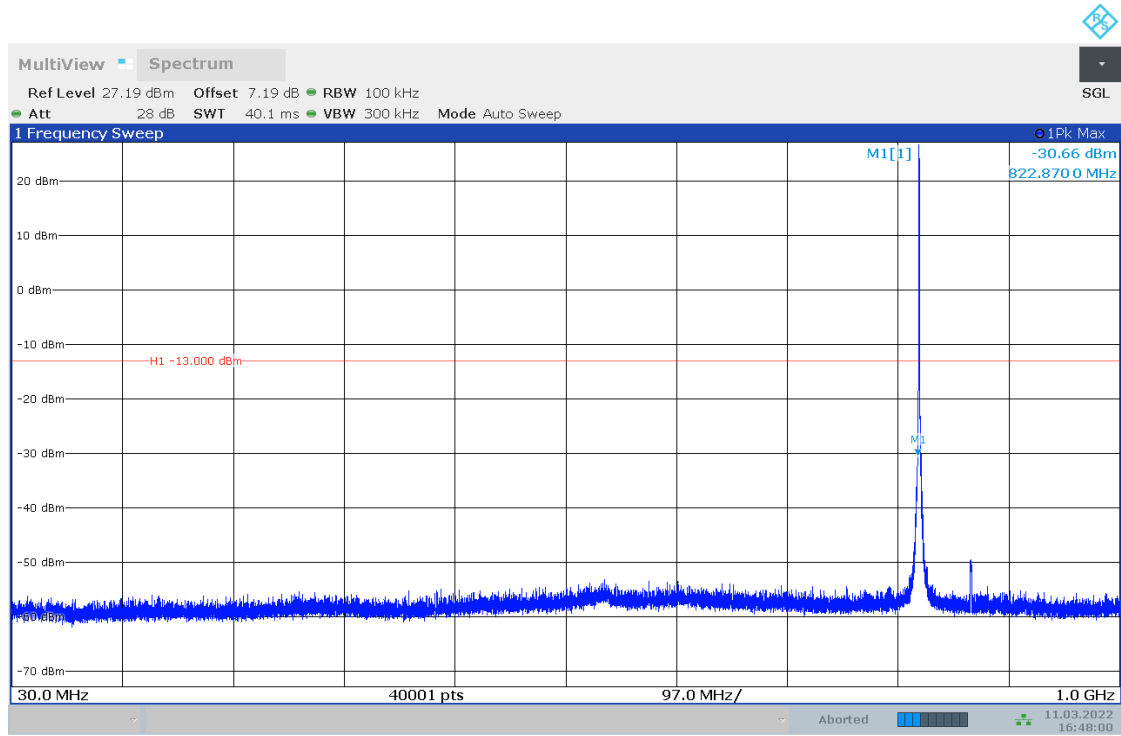

16:48:01 11.03.2022

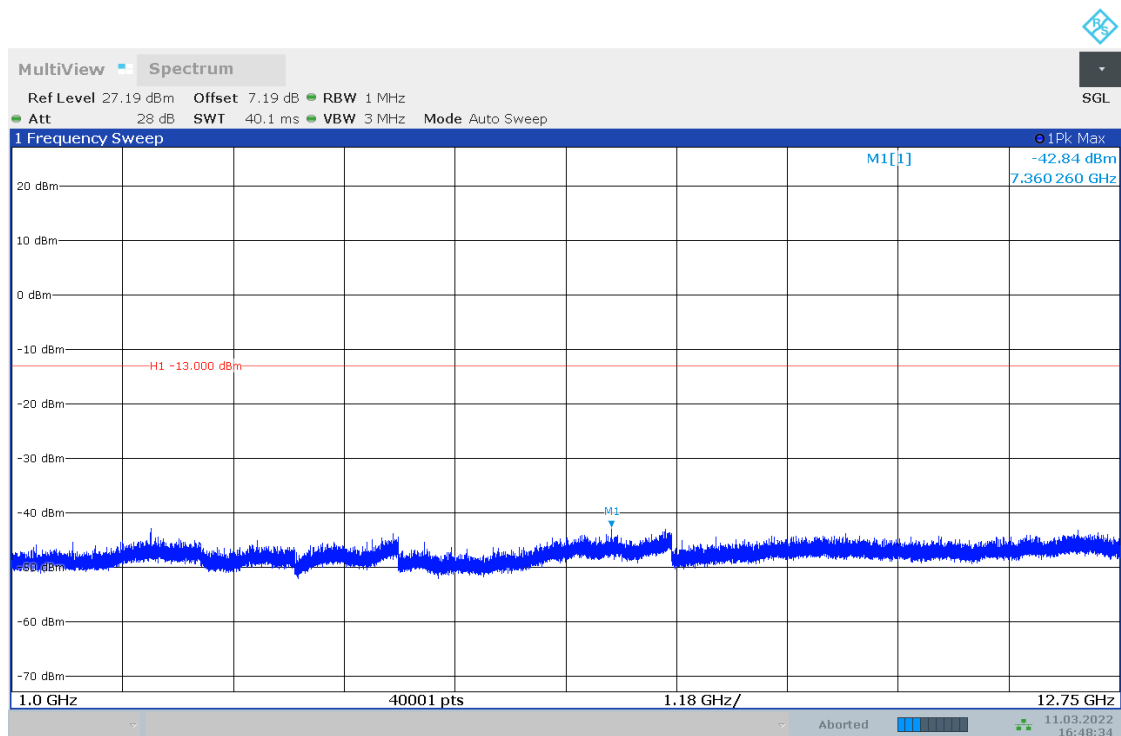


16:48:35 11.03.2022


6.2.29 TM2_1.4MHz_LCH_RB1#5




16:49:06 11.03.2022

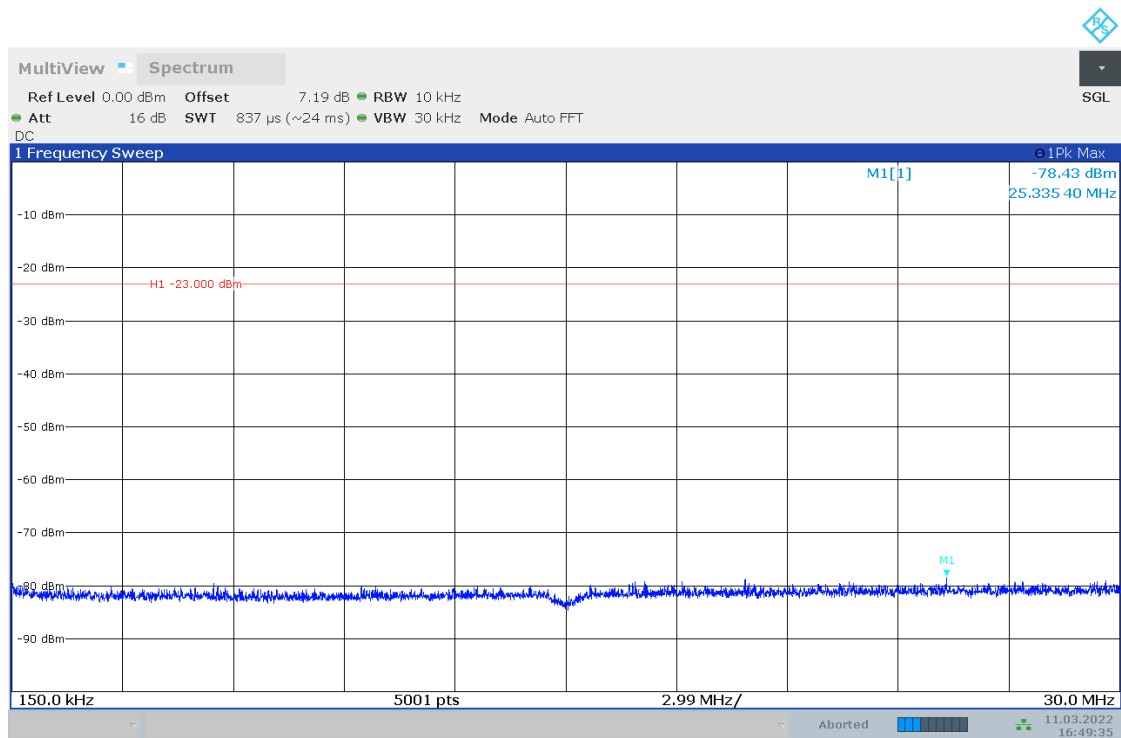

16:49:35 11.03.2022

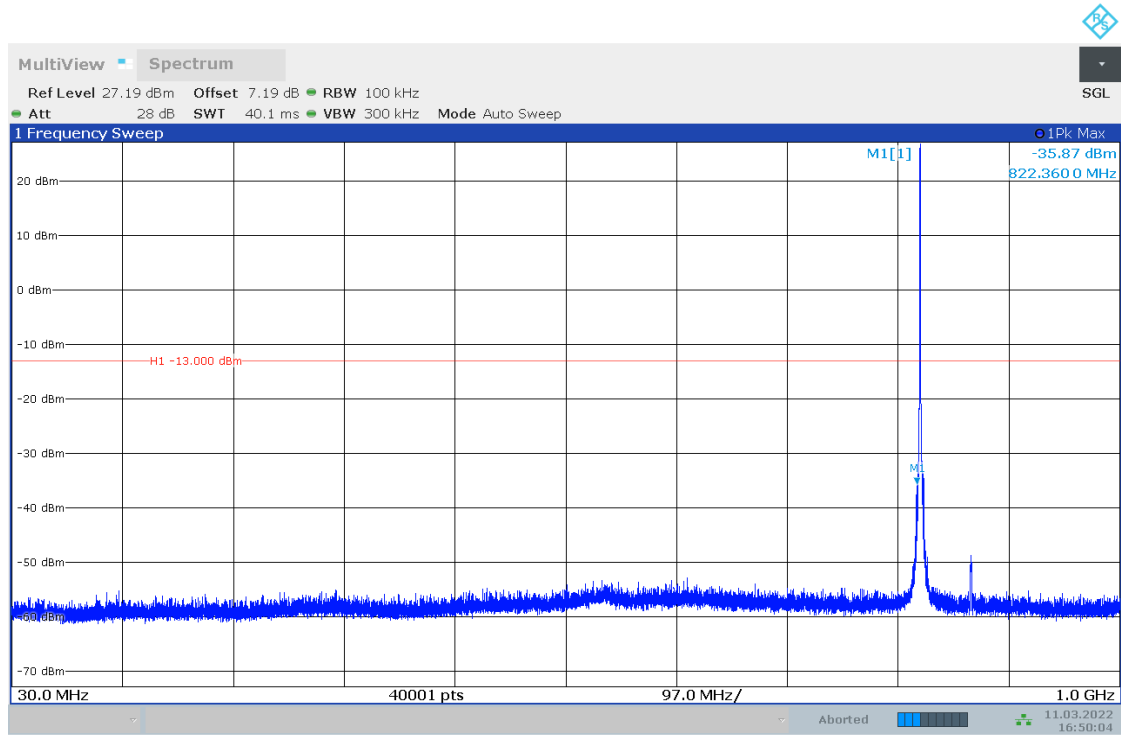


16:50:04 11.03.2022

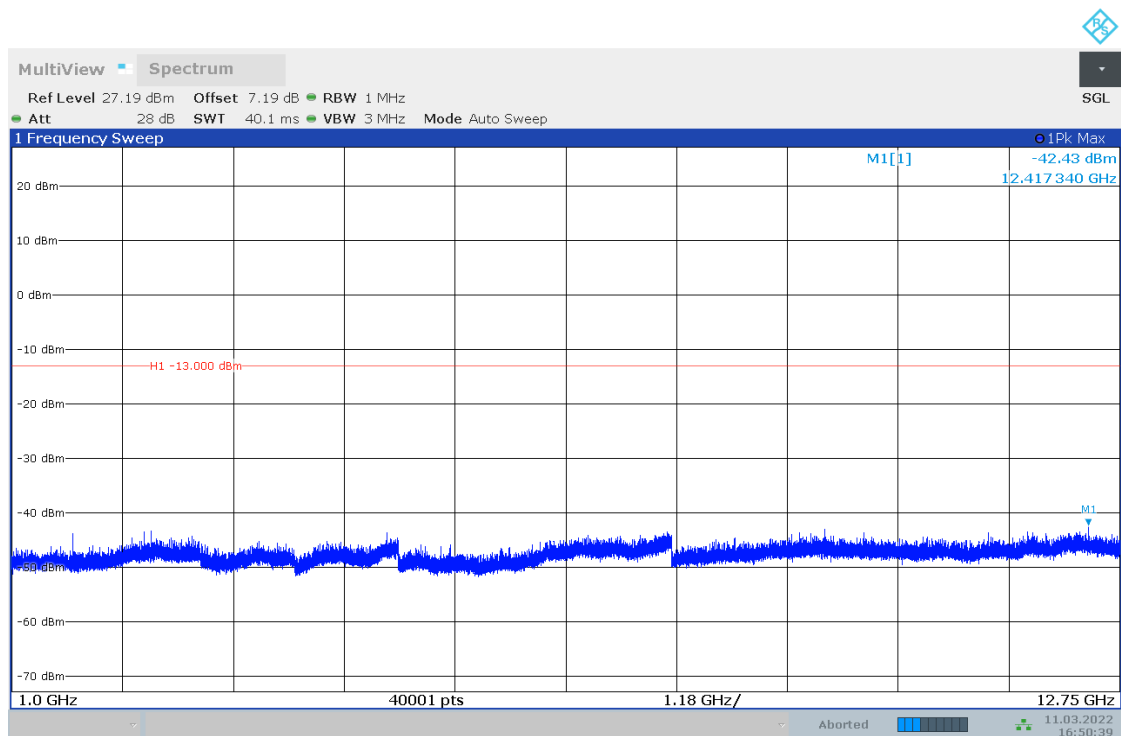


16:50:39 11.03.2022


6.2.30 TM2_1.4MHz_LCH_RB6#0

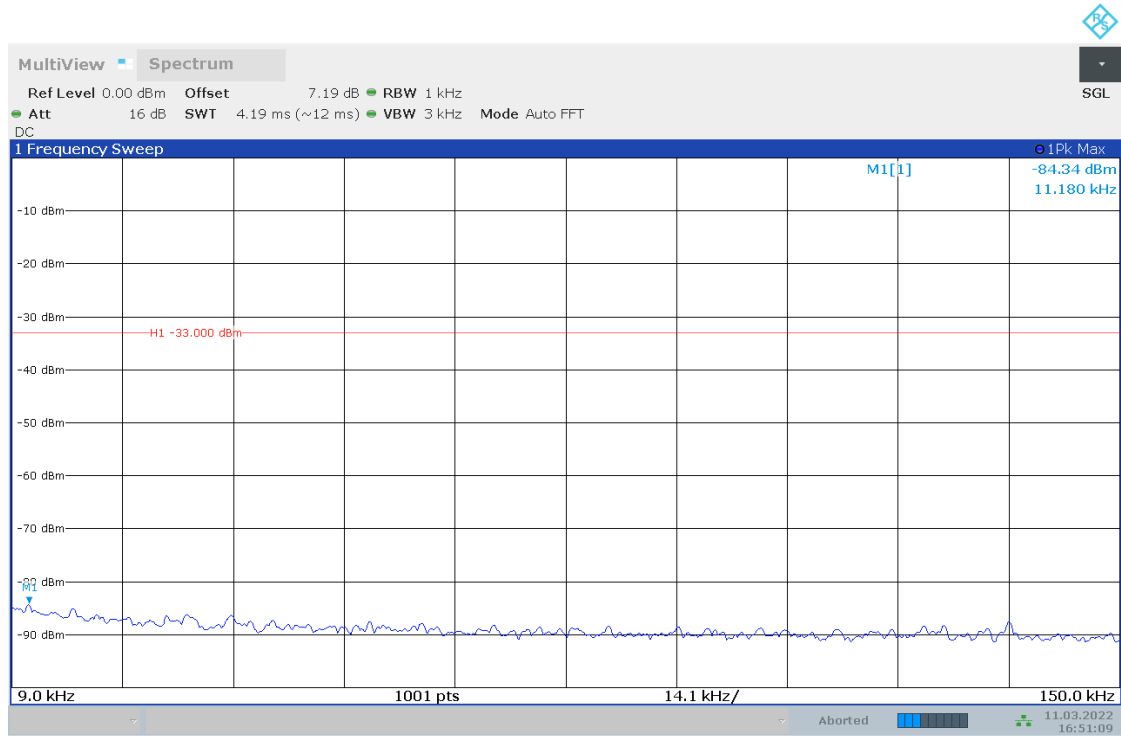


16:51:09 11.03.2022

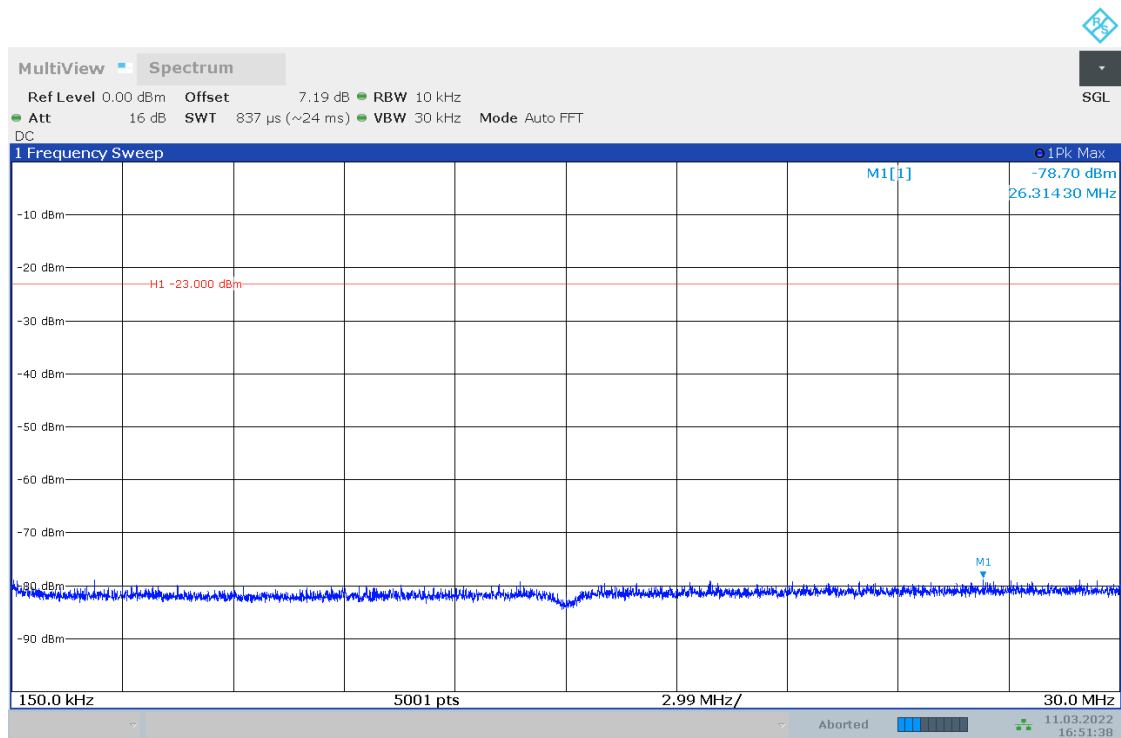

16:51:38 11.03.2022

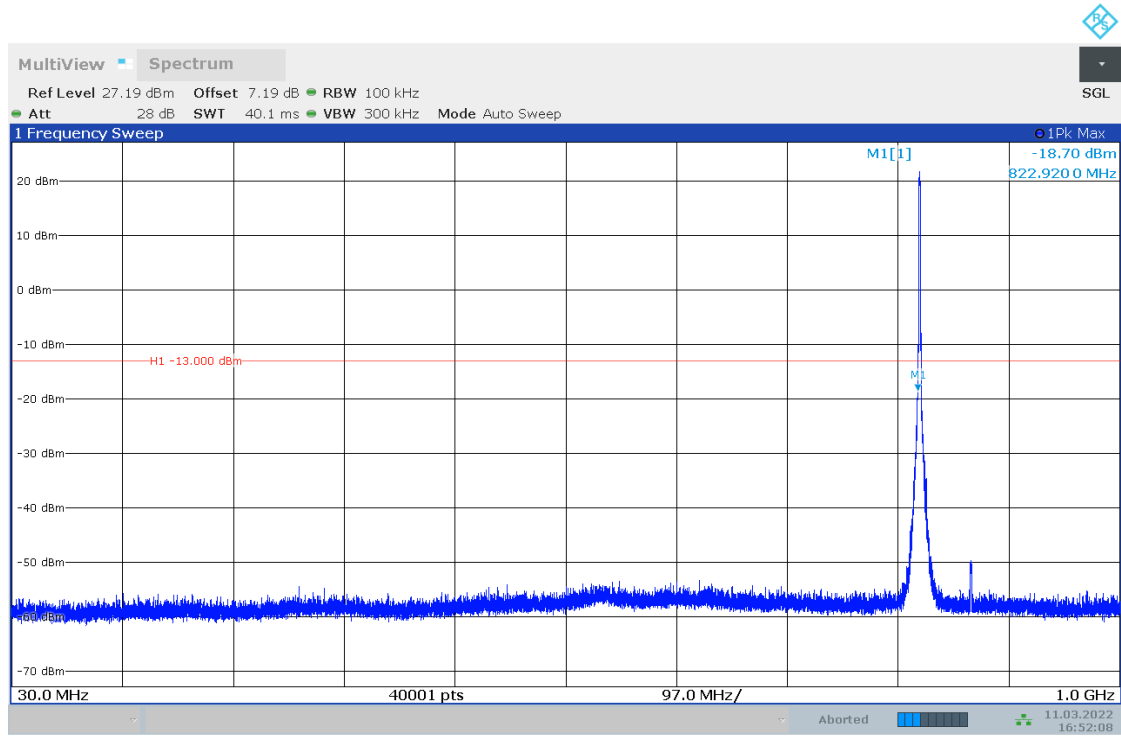


16:52:08 11.03.2022

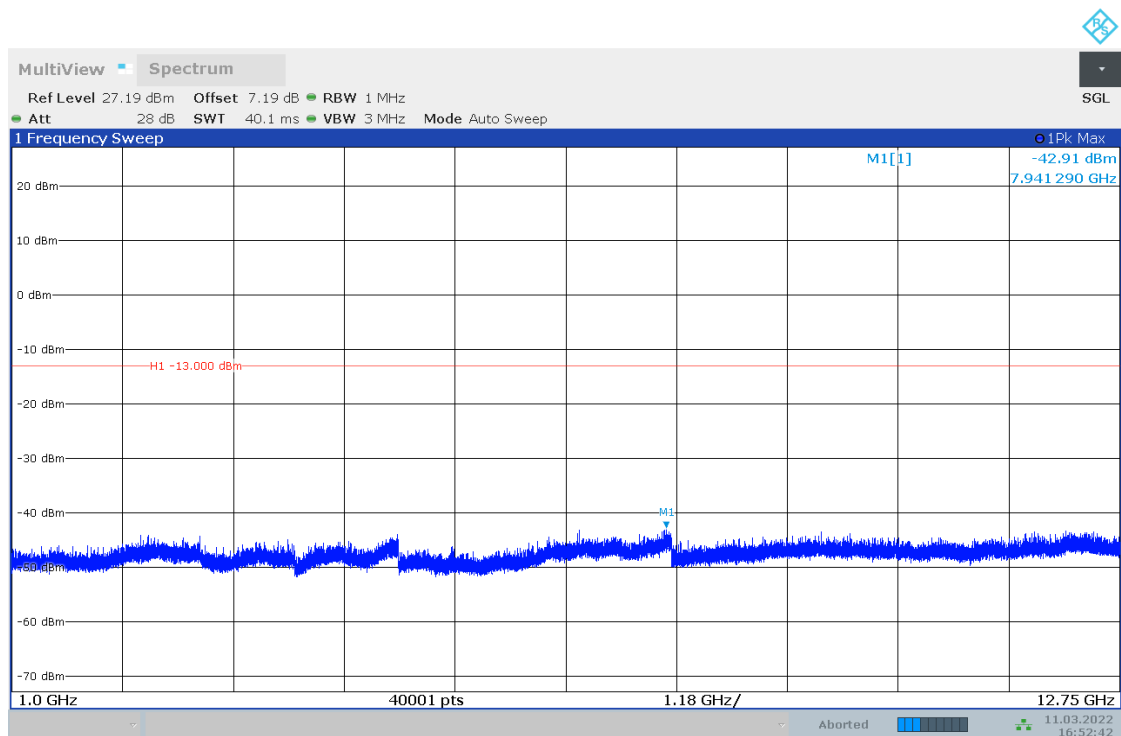


16:52:42 11.03.2022


6.2.31 TM2_1.4MHz_MCH_RB1#0

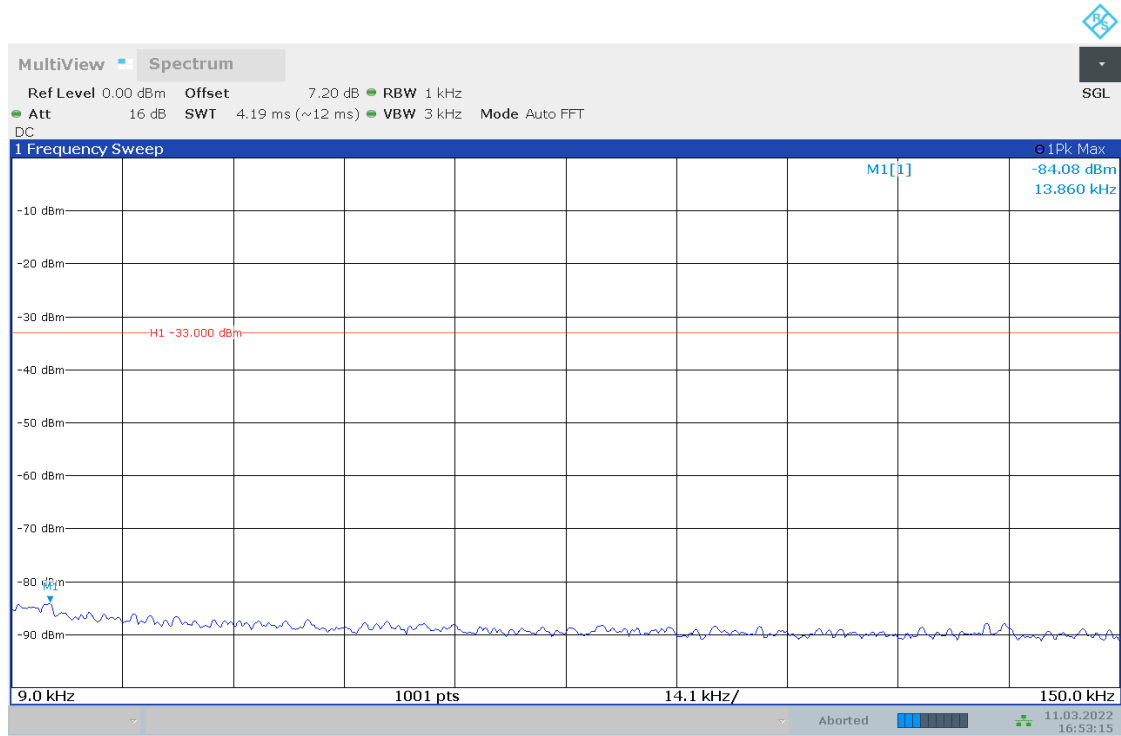


16:53:15 11.03.2022

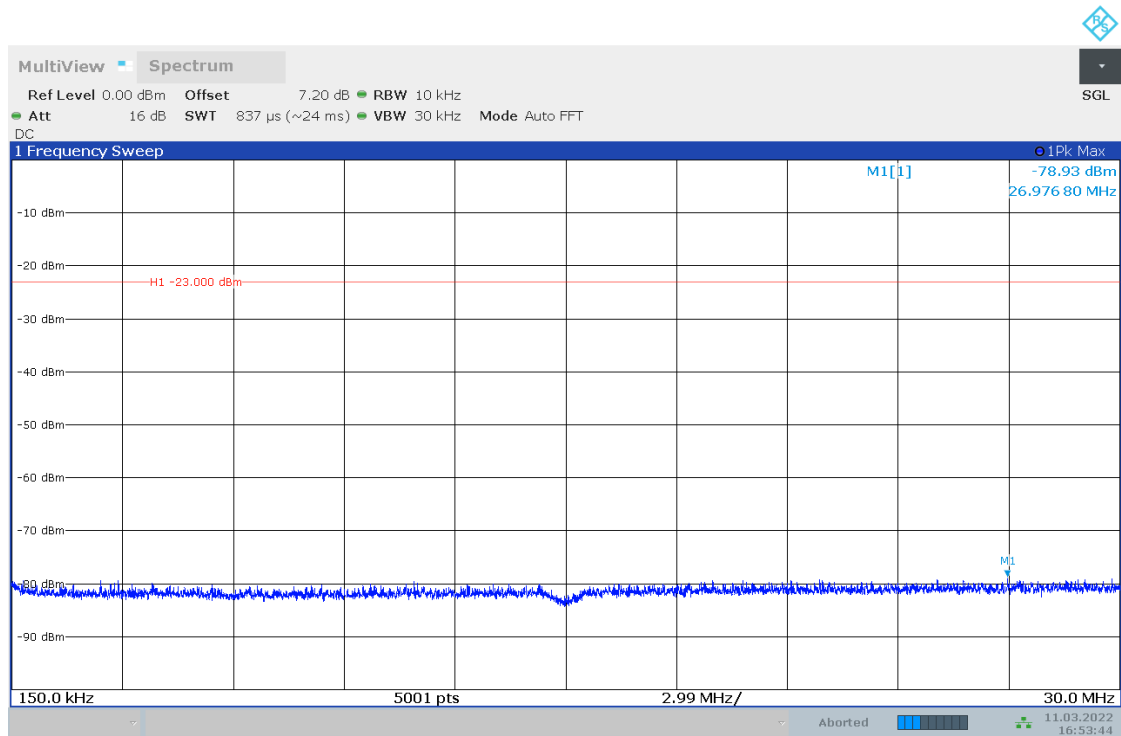

16:53:44 11.03.2022

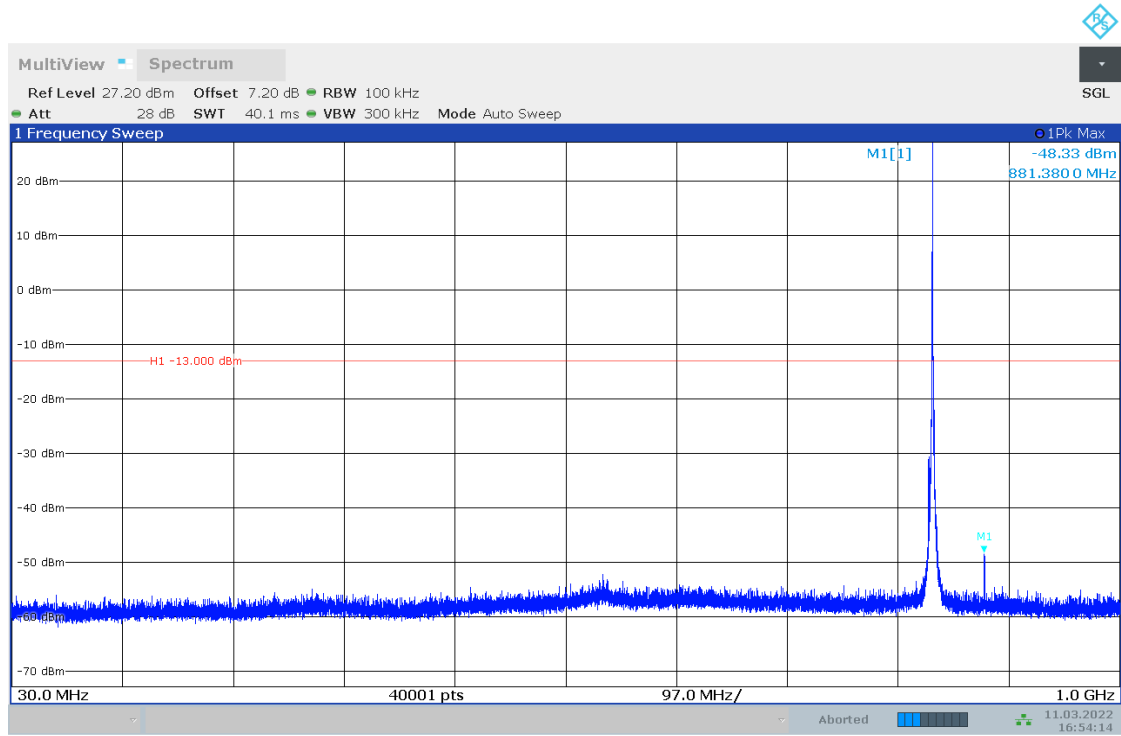


16:54:14 11.03.2022

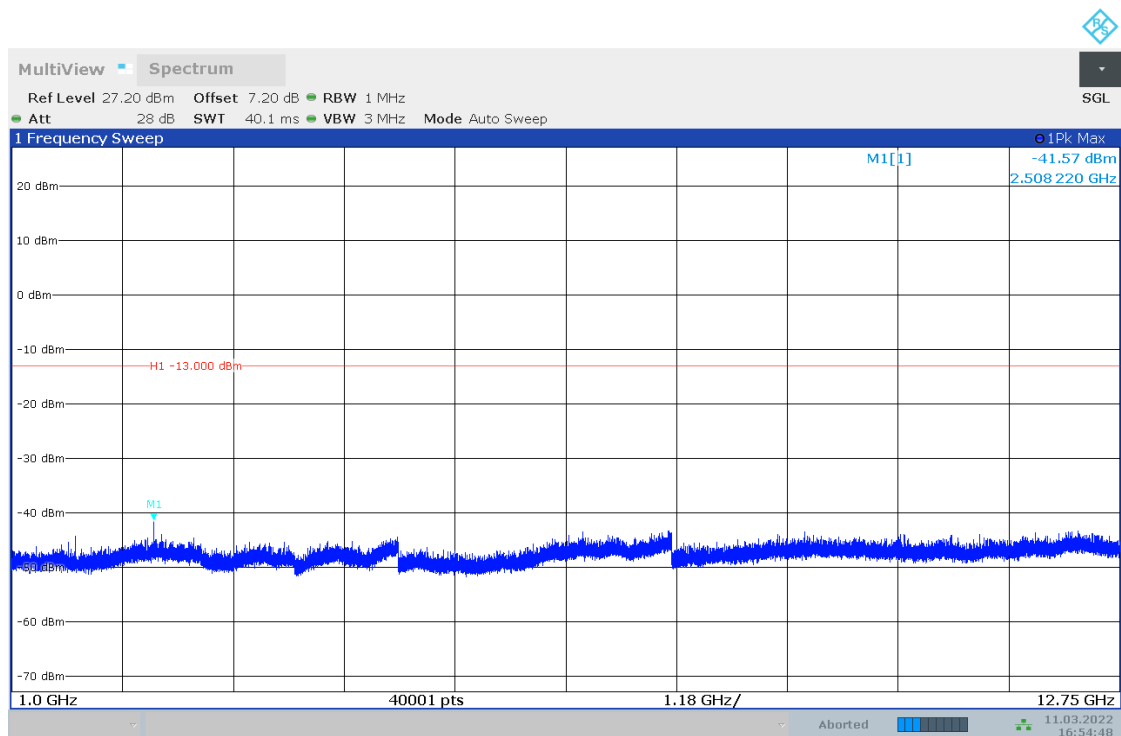


16:54:48 11.03.2022


6.2.32 TM2_1.4MHz_MCH_RB1#5

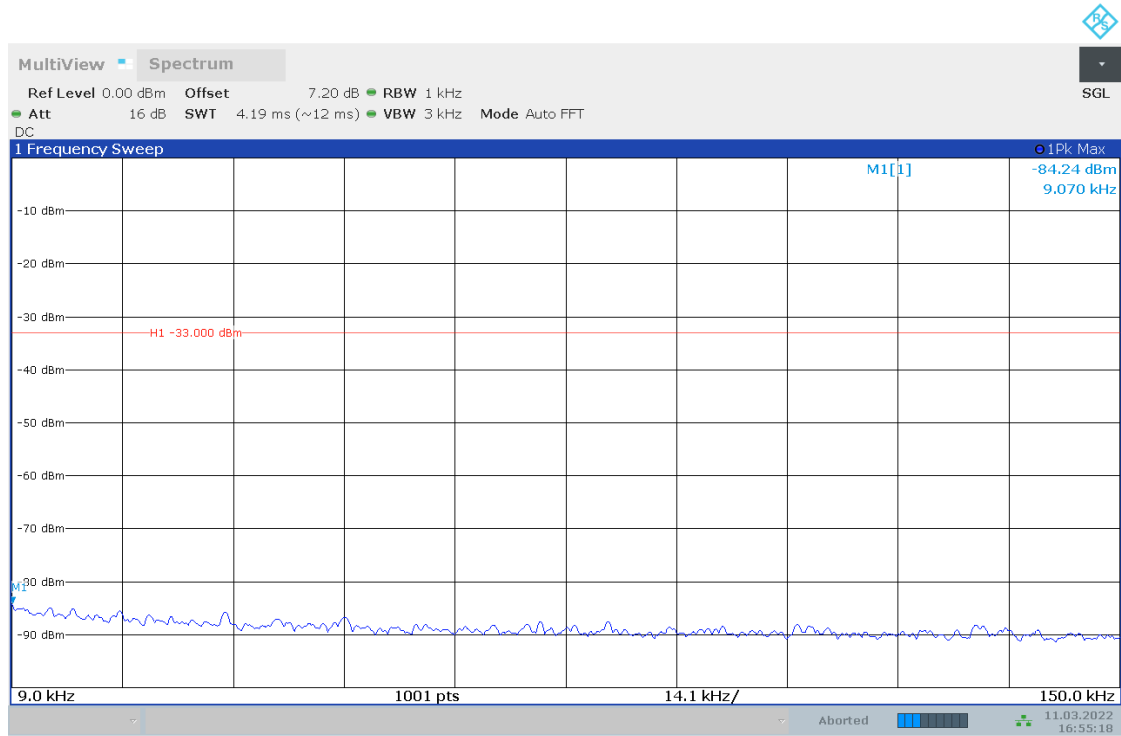


16:55:18 11.03.2022

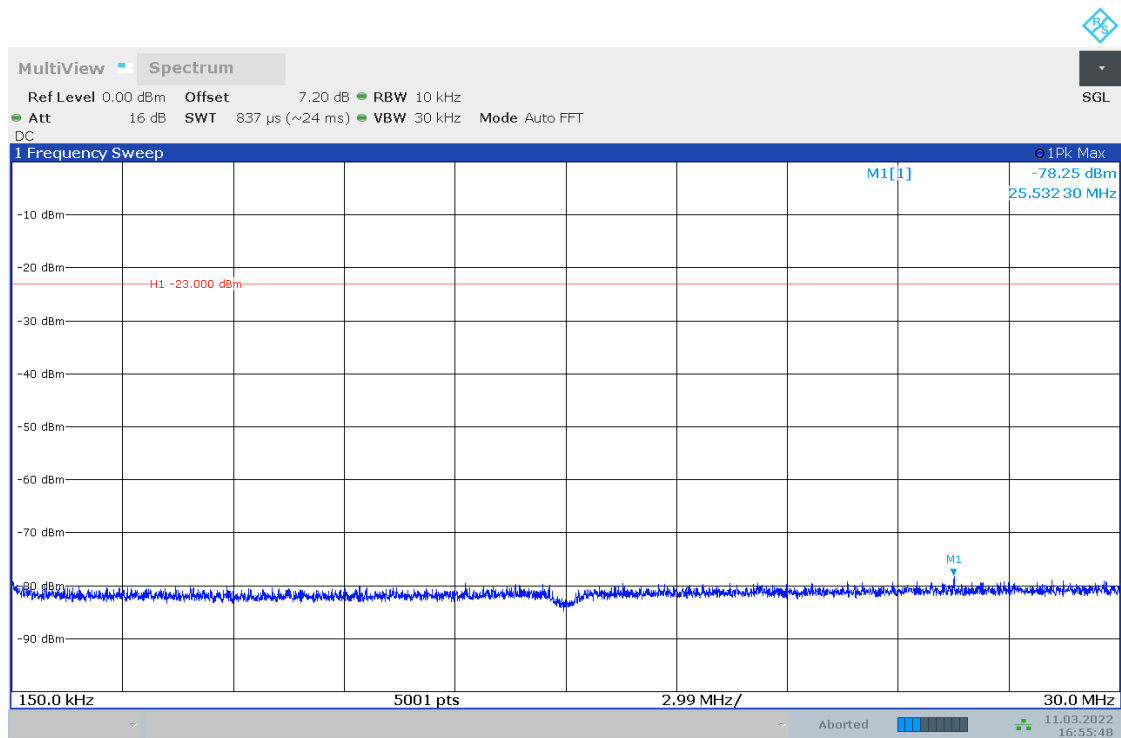

16:55:48 11.03.2022

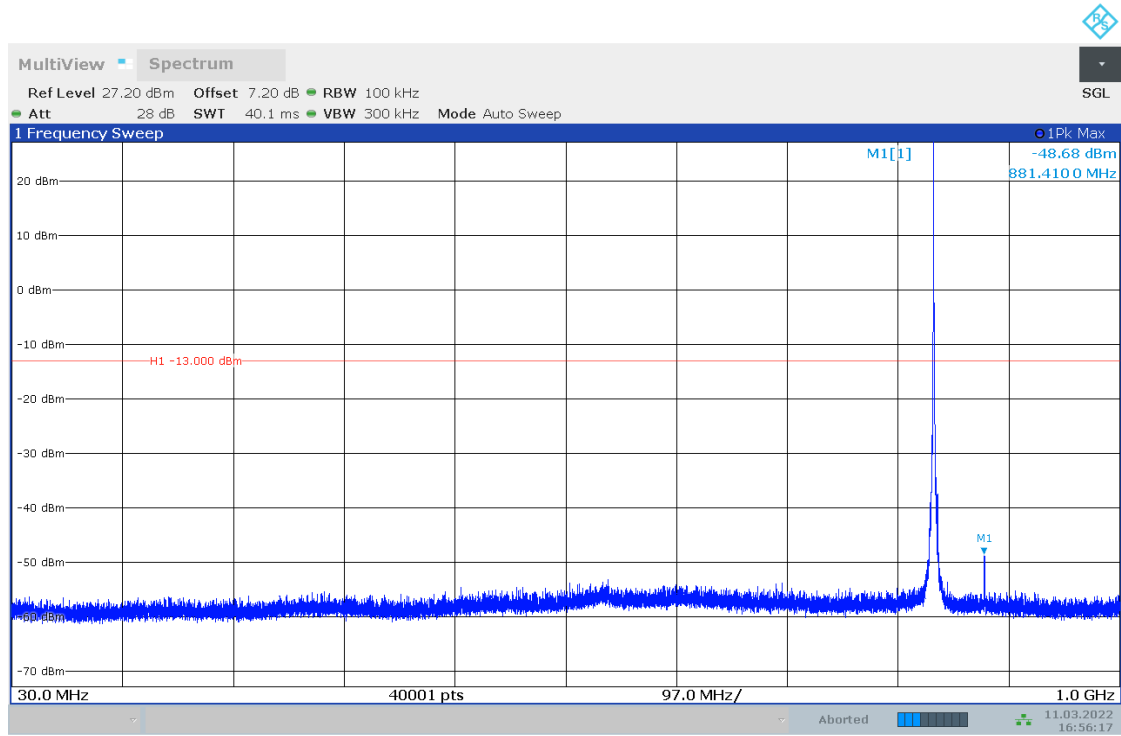


16:56:17 11.03.2022

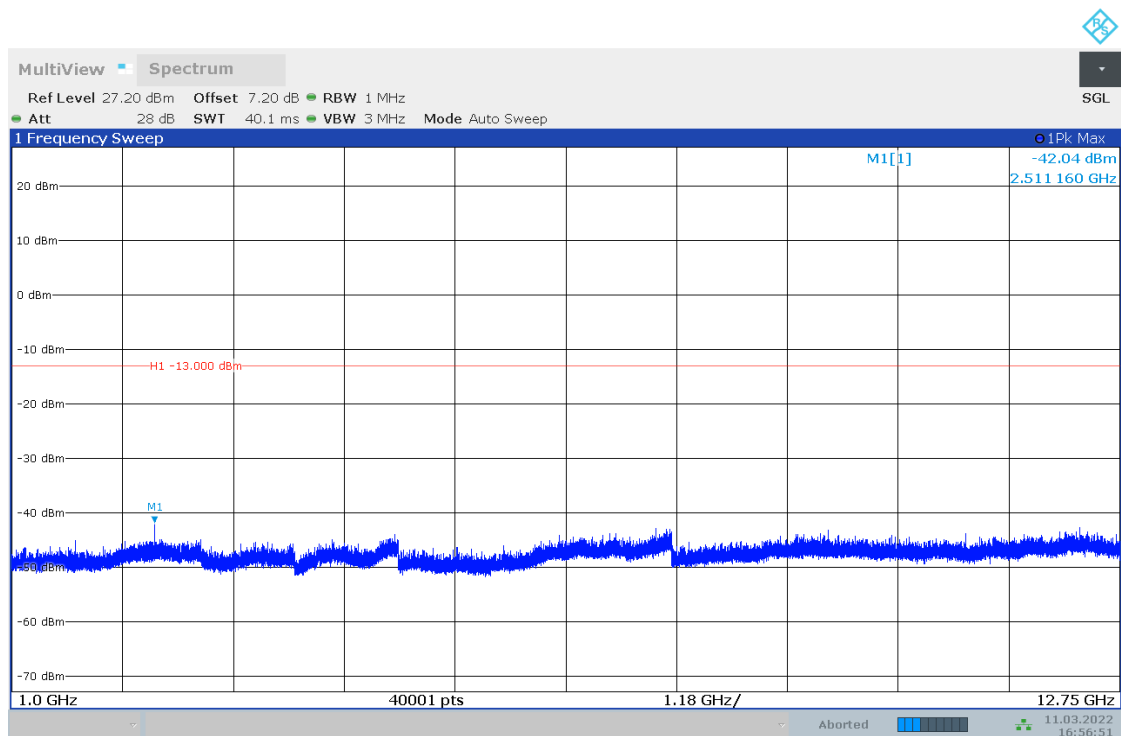


16:56:51 11.03.2022


6.2.33 TM2_1.4MHz_MCH_RB6#0

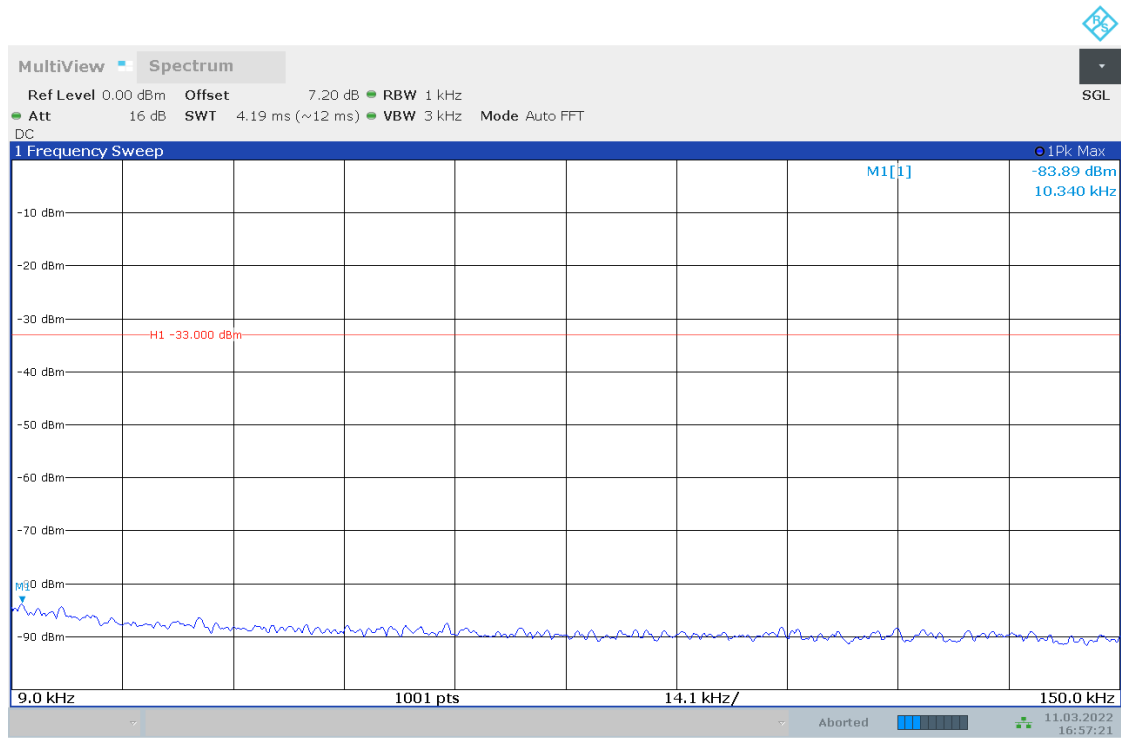


16:57:22 11.03.2022

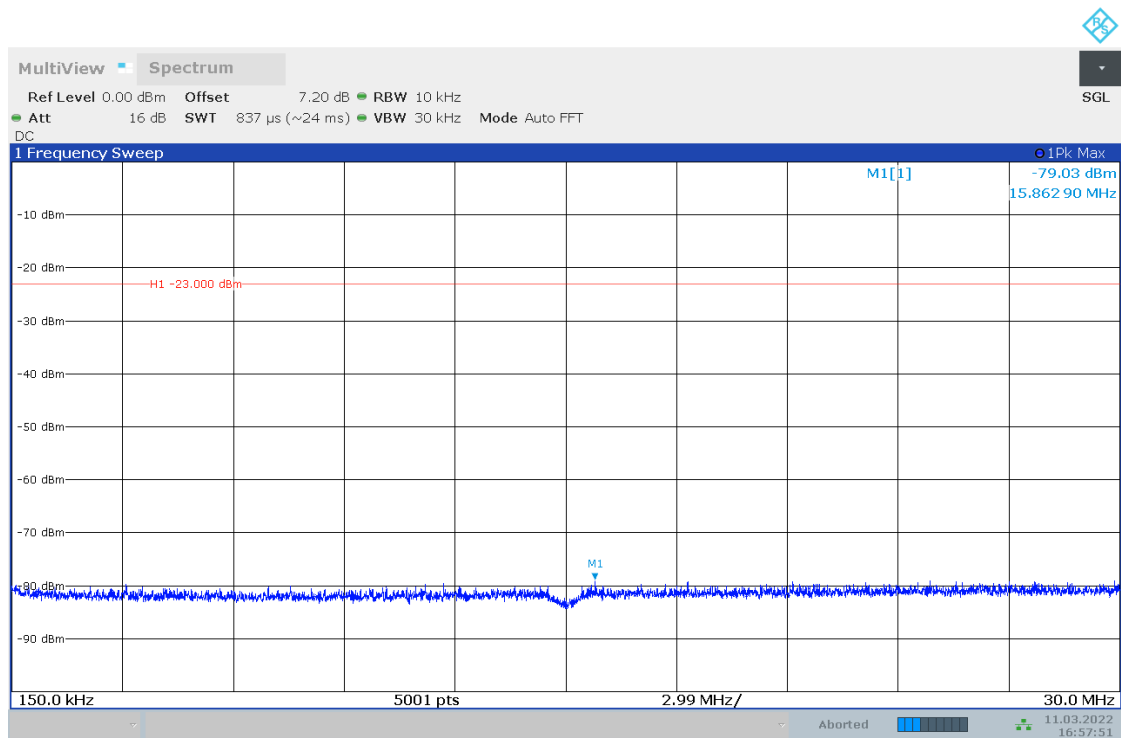

16:57:51 11.03.2022

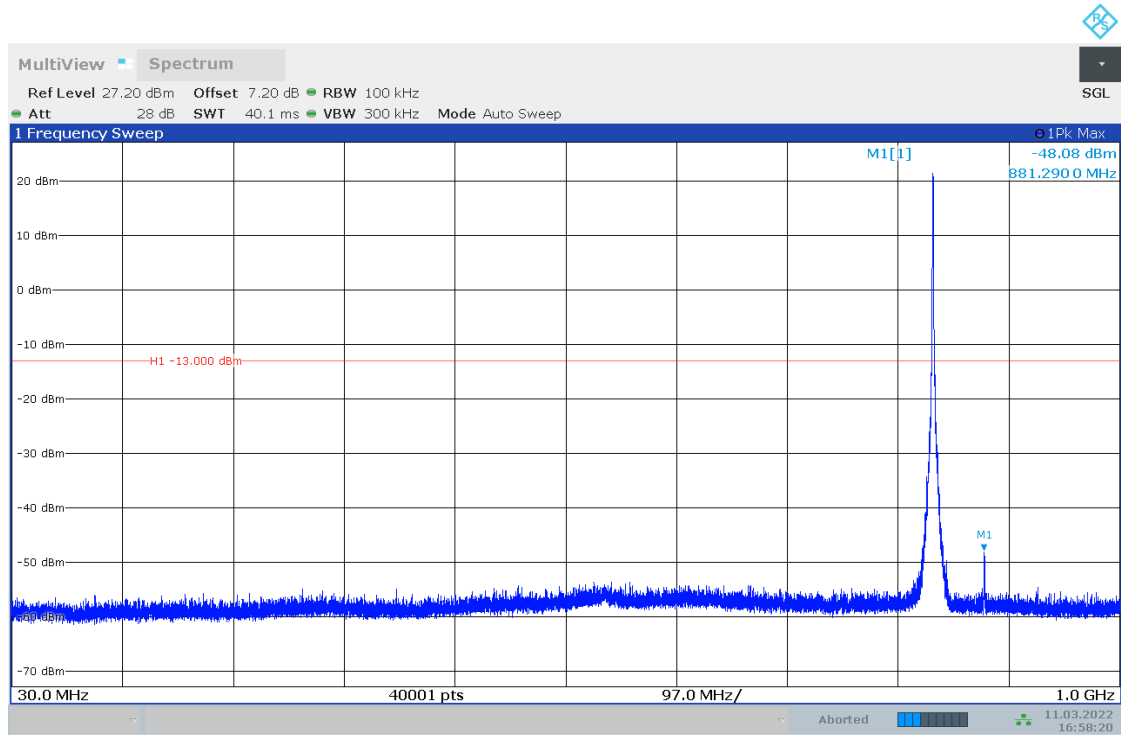


16:58:20 11.03.2022

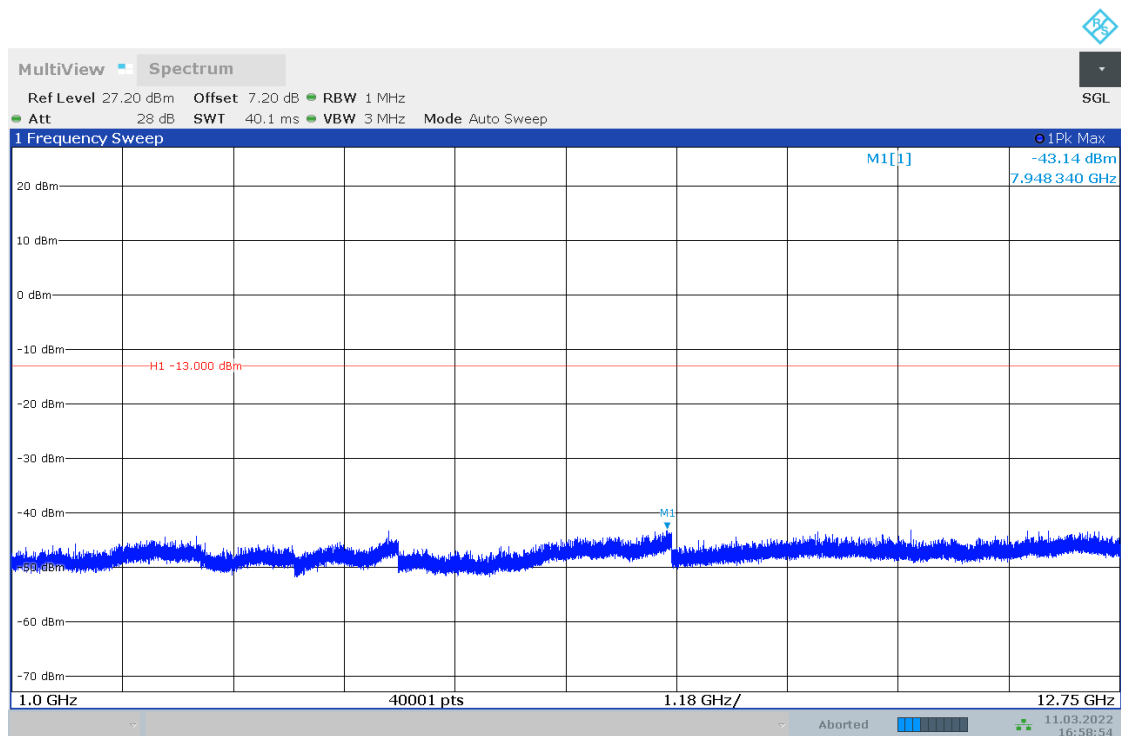


16:58:54 11.03.2022

6.2.34 TM2_1.4MHz_HCH_RB1#0

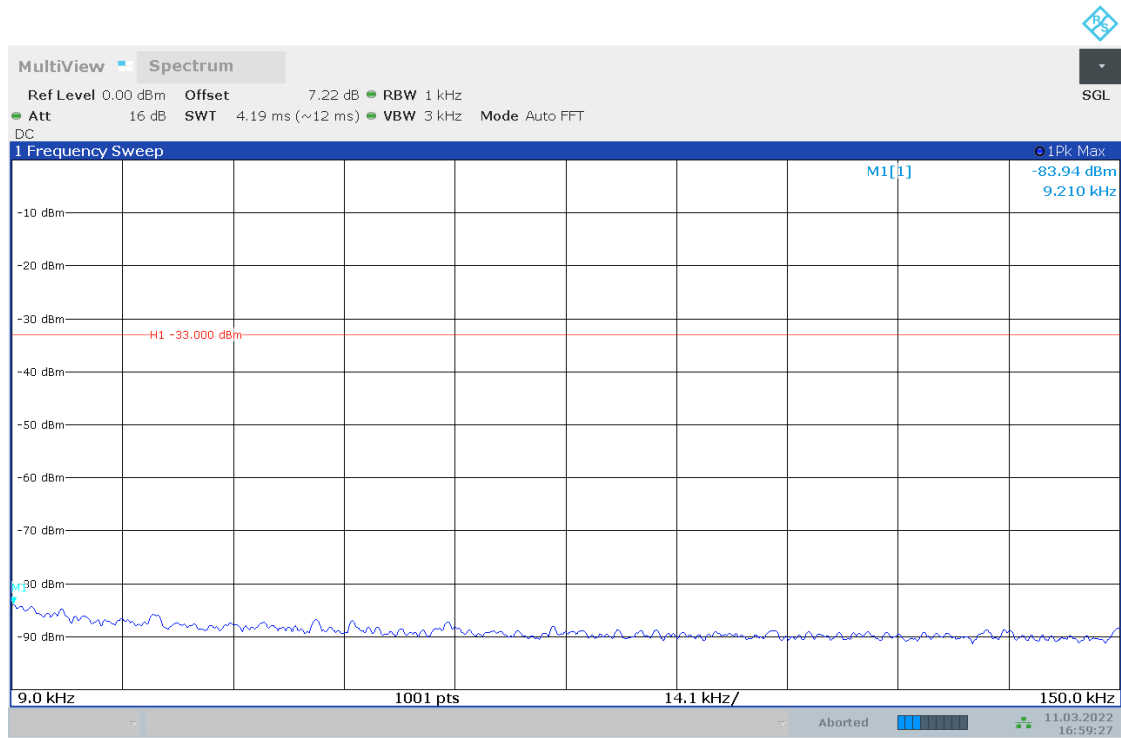

16:59:27 11.03.2022

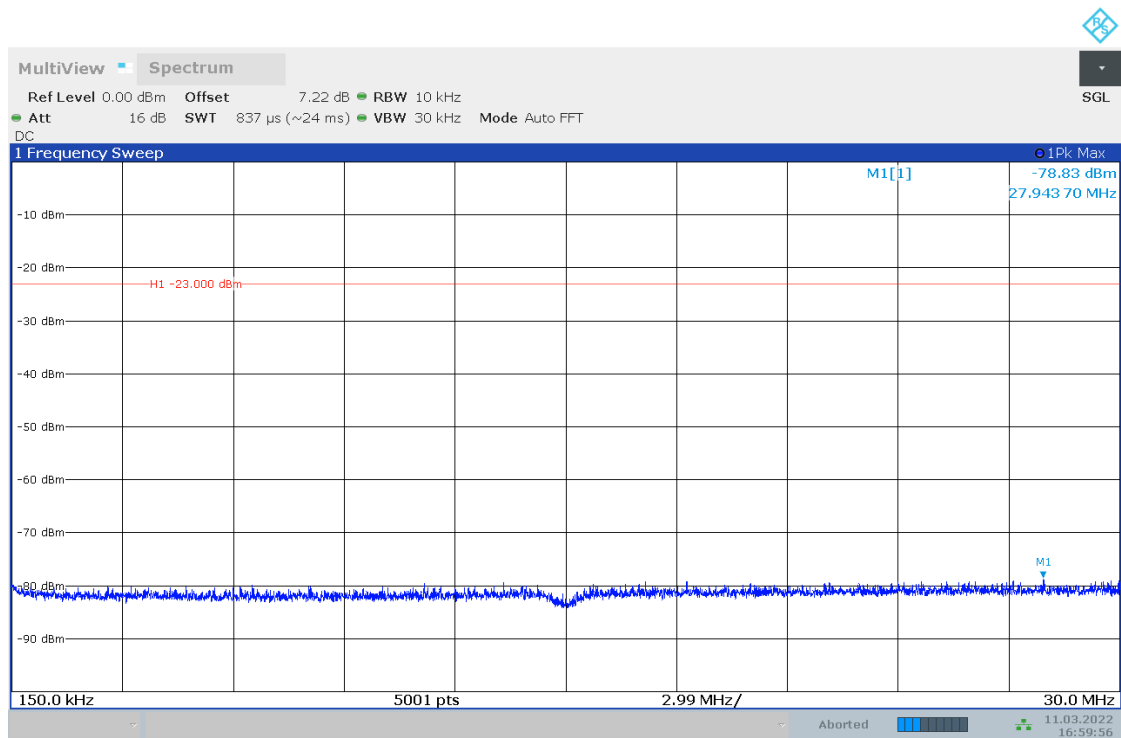

16:59:56 11.03.2022