# **FCC RF Test Report**

Report No.: FR082617-01A

Cert #5145.02

Page Number

Report Version

: 1 of 58

: Rev. 02

Report Issued Date: Jun. 30, 2021

Report Template No.: BU5-FR15CBT Version 2.0

APPLICANT : Amazon.com Services, LLC

**EQUIPMENT** : Digital Media Receiver

FCC ID : 2AZ5B21A01

STANDARD : FCC Part 15 Subpart C §15.247

**CLASSIFICATION**: (DSS) Spread Spectrum Transmitter

TEST DATE(S) : Apr. 29, 2021 ~ May 31, 2021

We, Sporton International (Kunshan) Inc., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International (Kunshan) Inc., the test report shall not be reproduced except in full.

Reviewed by: Jason Jia / Supervisor

Jason Jia

Approved by: Alex Wang / Manager

Sporton International (Kunshan) Inc.

No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300 People's Republic of China

## **TABLE OF CONTENTS**

RE	VISIO	N HISTORY	3
SUI	MMAR	Y OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Product Feature of Equipment Under Test	5
	1.3	Product Specification of Equipment Under Test	5
	1.4	Modification of EUT	5
	1.5	Testing Location	6
	1.6	Test Software	6
	1.7	Applicable Standards	6
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	7
	2.1	Carrier Frequency Channel	7
	2.2	Test Mode	8
	2.3	Connection Diagram of Test System	9
	2.4	Support Unit used in test configuration and system	10
	2.5	EUT Operation Test Setup	10
	2.6	Measurement Results Explanation Example	10
3	TEST	RESULT	11
	3.1	Number of Channel Measurement	
	3.2	Hopping Channel Separation Measurement	13
	3.3	Dwell Time Measurement	19
	3.4	20dB and 99% Bandwidth Measurement	21
	3.5	Output Power Measurement	32
	3.6	Conducted Band Edges Measurement	33
	3.7	Conducted Spurious Emission Measurement	40
	3.8	Radiated Band Edges and Spurious Emission Measurement	
	3.9	AC Conducted Emission Measurement	54
	3.10	Antenna Requirements	56
4	LIST	OF MEASURING EQUIPMENT	57
5	UNCE	ERTAINTY OF EVALUATION	58
API	PENDI	X A. CONDUCTED TEST RESULTS	
API	PENDI	X B. AC CONDUCTED EMISSION TEST RESULT	
API	PENDI	X C. RADIATED SPURIOUS EMISSION	
API	PENDI	X D. RADIATED SPURIOUS EMISSION PLOTS	
API	PENDI	X E. DUTY CYCLE PLOTS	

Report No. : FR082617-01A

Report Version : Rev. 02
Report Template No.: BU5-FR15CBT Version 2.0

## **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR082617-01A	Rev. 01	Initial issue of report	Jun. 09, 2021
FR082617-01A	Rev. 02	Revised report based on TCB comment	Jun. 30, 2021

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 3 of 58

Report Issued Date : Jun. 30, 2021

Report Version : Rev. 02

Report No. : FR082617-01A

#### SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass
3.4	15.247(a)(1)	20dB Bandwidth	N/A	N/A
3.4	-	99% Bandwidth	-	N/A
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass
3.7	15.247(d)	Conducted Spurious Emission	≤ 20dBc	Pass
3.8	15.247(d)	Radiated Band Edges and 15.247(d) Radiated Spurious 15.209(a) & 15.247(d)  Emission		Pass
3.9	15.207	AC Conducted Emission	15.207(a)	Pass
3.10	15.203 & 15.247(b)	Antenna Requirement	N/A	N/A

#### **Declaration of Conformity:**

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

#### **Comments and Explanations:**

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 4 of 58

Report Issued Date : Jun. 30, 2021

Report Version : Rev. 02

Report No.: FR082617-01A

## 1 General Description

## 1.1 Applicant

Amazon.com Services, LLC 410 Terry Ave N Seattle, WA 98109

## 1.2 Product Feature of Equipment Under Test

Product Feature				
Equipment Digital Media Receiver				
FCC ID	2AZ5B21A01			
	Bluetooth BR/EDR/LE			
FLIT cumports Padios application	WLAN 2.4GHz 802.11b/g/n HT20			
EUT supports Radios application	WLAN 5GHz 802.11a/n HT20/HT40			
	WLAN 5GHz 802.11ac VHT20/VHT40/VHT80			

## 1.3 Product Specification of Equipment Under Test

Standards-related Product Specification				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	Bluetooth BR(1Mbps) : 5.35 dBm (0.0034 W) Bluetooth EDR (2Mbps) : 5.35 dBm (0.0034 W) Bluetooth EDR (3Mbps) : 5.48 dBm (0.0035 W)			
99% Occupied Bandwidth	Bluetooth BR(1Mbps) : 0.877MHz Bluetooth EDR (2Mbps) : 1.135MHz Bluetooth EDR (3Mbps) : 1.126MHz			
Antenna Type / Gain	Fixed internal Antenna with gain 3.20 dBi			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) :π/4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

## 1.4 Modification of EUT

No modifications are made to the EUT during all test items.

Sporton International (Kunshan) Inc. TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 5 of 58

Report Issued Date : Jun. 30, 2021

Report Version : Rev. 02

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR082617-01A

## 1.5 Testing Location

Sporton International (Kunshan) Inc. is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

Test Firm	Sporton International (Kunshan) Inc.				
	No. 1098, Pengxi North Road, Kunshan Economic Development Zone				
Test Site Location	Jiangsu Province 215300 People's Republic of China				
rest Site Location	TEL: +86-512-57900158				
	FAX: +86-512-57900958				
	Sporton Site No.	FCC Designation No.	FCC Test Firm		
Test Site No.	Sporton Site No.	rcc besignation No.	Registration No.		
rest one NO.	CO01-KS 03CH06-KS TH01-KS	CN1257	314309		

#### 1.6 Test Software

Item Site		Manufacturer	Name	Version
1.	03CH06-KS	AUDIX	E3	6.2009-8-24al
2.	CO01-KS	Rohde&Schwarz	EMC32	10.60.0.0

## 1.7 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

**Remark:** All test items were verified and recorded according to the standards and without any deviation during the test.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 6 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

## 2 Test Configuration of Equipment Under Test

## 2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 7 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR082617-01A

#### 2.2 Test Mode

a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Y plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report.

Report No.: FR082617-01A

b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases							
	Data Rate / Modulation							
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps					
	GFSK	π/4-DQPSK	8-DPSK					
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz					
Conducted	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz					
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz					
	В	luetooth EDR 3Mbps 8-DPS	K					
	Mode 1: CH00_2402 MHz							
Radiated		Mode 1: CH00_2402 MHz						
Radiated Test Cases		Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz						
		_						
		Mode 2: CH39_2441 MHz						
Test Cases	Mode 1 : BT Link + WLAN (2	Mode 2: CH39_2441 MHz	lay + Power From Adaptor					

#### Remark:


- 1. For radiated test cases, the worst mode data rate 3Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter.

Sporton International (Kunshan) Inc.Page Number: 8 of 58TEL: +86-512-57900158Report Issued Date: Jun. 30, 2021


FAX: +86-512-57900958 Report Version : Rev. 02
FCC ID: 2AZ5B21A01 Report Template No.: BU5-FR15CBT Version 2.0

## 2.3 Connection Diagram of Test System

#### For Conducted Emission

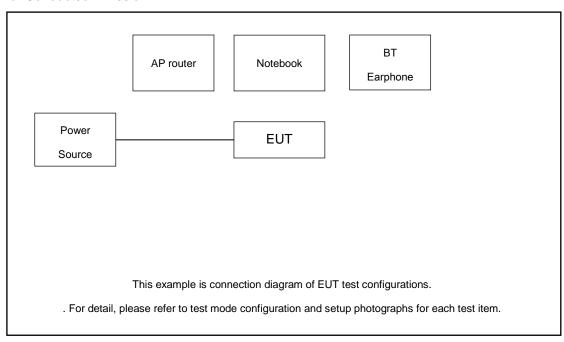

#### For Radiated Emission

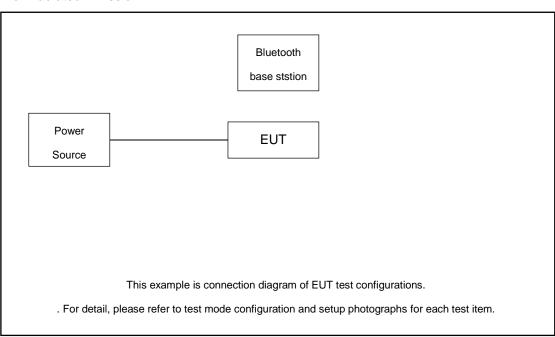

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 9 of 58

Report Issued Date : Jun. 30, 2021

Report Version : Rev. 02

Report No.: FR082617-01A

## 2.4 Support Unit used in test configuration and system

Item	Equipment	Model Name	FCC ID	Data Cable	Power Cord
1.	Notebook	G480	QDS-BRCM1050I	N/A	shielded cable DC O/P 1.8m , Unshielded AC I/P cable 1.8m
2.	Bluetooth Earphone	LBH308	N/A	N/A	N/A
3.	Bluetooth base station	СВТ	N/A	N/A	Unshielded,1.8m
4.	WLAN AP	DIR-655	KA21R655B1	N/A	Unshielded,1.8m

## 2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit.

For AC power line conducted emissions, the EUT was set to connect with the Bluetooth Earphone and WLAN AP under large package sizes transmission.

### 2.6 Measurement Results Explanation Example

#### For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

#### Example:

The spectrum analyzer offset is derived from RF cable loss.

 $Offset = RF \ cable \ loss.$ 

Following shows an offset computation example with cable loss 6.0 dB.

 $Offset(dB) = RF \ cable \ loss(dB) \ .$ = 6.0 (dB) Report No.: FR082617-01A

### 3 Test Result

#### 3.1 Number of Channel Measurement

#### 3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.


#### 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

#### 3.1.4 Test Setup

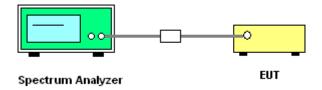

#### 3.1.5 Test Result of Number of Hopping Frequency


Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 11 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02


Report No.: FR082617-01A

# FCC RF Test Report

#### Number of Hopping Channel Plot on Channel 00 - 78

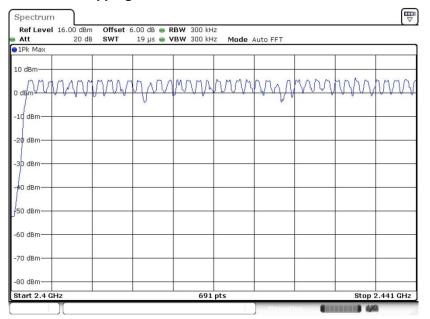

Date: 31.MAY.2021 13:00:49

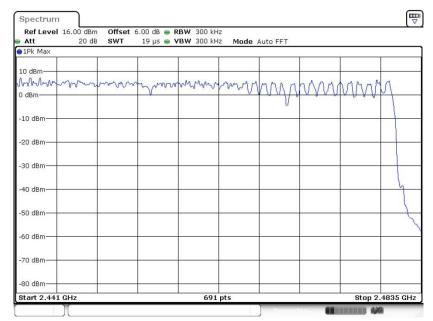

Date: 31.MAY.2021 13:03:33

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01

Page Number : 12 of 58 Report Issued Date: Jun. 30, 2021 Report Version : Rev. 02

Report No.: FR082617-01A

## 3.2 Hopping Channel Separation Measurement

#### 3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.


#### 3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings:
   Span = wide enough to capture the peaks of two adjacent channels;
   RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.2.4 Test Setup



#### 3.2.5 Test Result of Hopping Channel Separation


Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 13 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A


## <1Mbps>

#### Channel Separation Plot on Channel 00 - 01

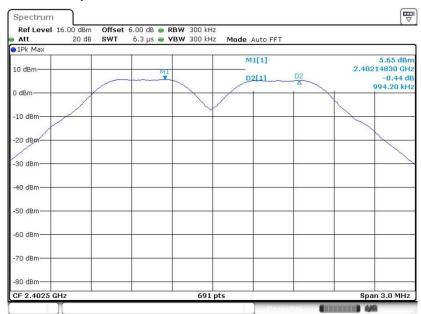

Date: 31.MAY.2021 10:47:00

#### **Channel Separation Plot on Channel 39 - 40**

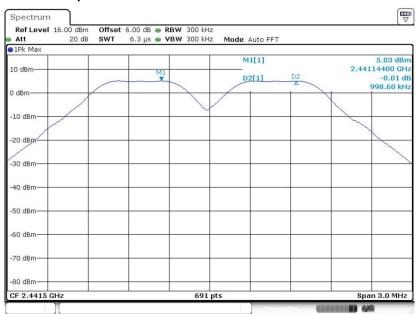

Date: 31.MAY.2021 11:11:16


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 14 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A




#### Channel Separation Plot on Channel 77 - 78

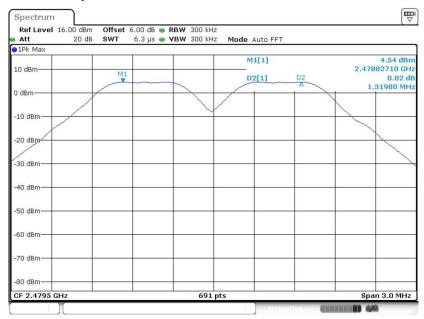

Date: 31.MAY.2021 11:19:02

#### <2Mbps>

#### Channel Separation Plot on Channel 00 - 01

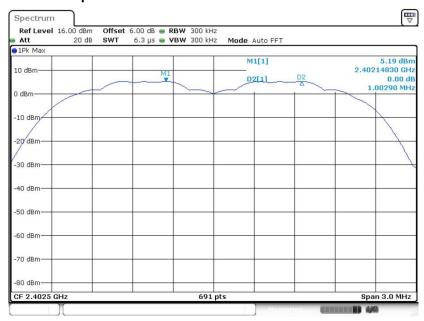

Date: 31.MAY.2021 11:39:45


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 15 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A


# FCC RF Test Report

#### Channel Separation Plot on Channel 39 - 40

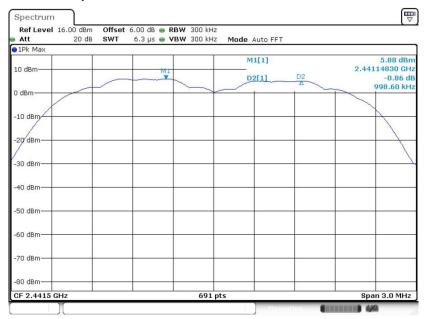

Date: 31.MAY.2021 11:49:20

#### Channel Separation Plot on Channel 77 - 78

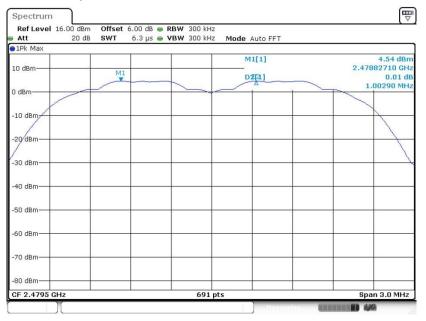

Date: 31.MAY.2021 11:59:22

Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01

Page Number : 16 of 58 Report Issued Date: Jun. 30, 2021 Report Version : Rev. 02

Report No.: FR082617-01A


#### <3Mbps>

#### Channel Separation Plot on Channel 00 - 01

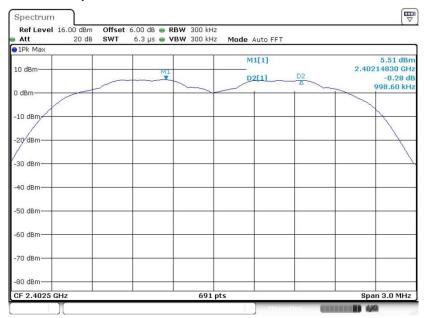

Date: 31.MAY.2021 12:05:21

#### Channel Separation Plot on Channel 39 - 40

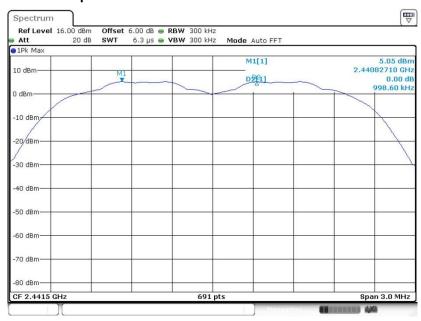

Date: 31.MAY.2021 12:18:15

Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 17 of 58

Report Issued Date : Jun. 30, 2021

Report Version : Rev. 02

Report No.: FR082617-01A

#### **Channel Separation Plot on Channel 77 - 78**

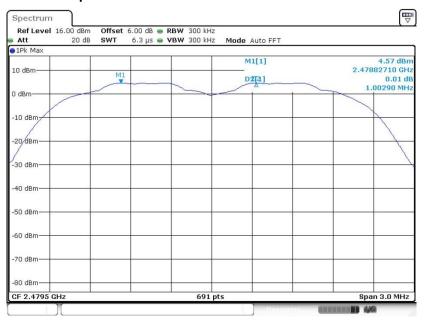

Date: 31.MAY.2021 12:34:18

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 18 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No. : FR082617-01A

#### 3.3 Dwell Time Measurement

#### 3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.

#### 3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
   The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

#### 3.3.4 Test Setup



TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 19 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

#### 3.3.5 Test Result of Dwell Time

Please refer to Appendix A.

#### **Package Transfer Time Plot** Spectrum Ref Level 26.00 dBm Offset 6.00 dB @ RBW 1 MHz Att 30 dB . SWT 10 ms VBW 1 MHz ●1Pk Max D3[1] -0.13 d 20 dB 5.0000 m 5.21 dBn M1[1] 963.8 μ 0 dBm -10 dBm -30 dBm -4∩ dBm white the popular white Muhaputabla -50 dBm -60 dBm -70 dBm CF 2.441 GHz 1.0 ms/ 691 pts Type | Ref | Trc **Y-value** 5.21 dBr **Function Result** 2.8841 ms 5.0 ms -1.79 dB -0.13 dB

#### Remark:

Date: 29.APR.2021 09:17:30

In normal mode, hopping rate is 1600 hops/s with 6 slots (5 Transmit and 1 Receive slot)
in 79 hopping channels.

With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit  $(0.4 \times 79)$  (s), Hops Over Occupancy Time comes to  $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$  hops.

- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels.
  With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4 x 20) (s),
  Hops Over Occupancy Time comes to (800 / 6 / 20) x (0.4 x 20) = 53.33 hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 20 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

#### 3.4 20dB and 99% Bandwidth Measurement

#### 3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

### 3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.

Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;

The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = peak;

Trace = max hold.

5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.

Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;


The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = sample;

Trace = max hold.

6. Measure and record the results in the test report.

#### 3.4.4 Test Setup

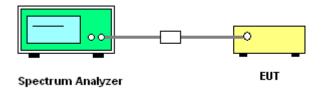

#### 3.4.5 Test Result of 20dB Bandwidth

Please refer to Appendix A.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 21 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

## <1Mbps>

#### 20 dB Bandwidth Plot on Channel 00



Date: 31.MAY.2021 10:31:08

#### 20 dB Bandwidth Plot on Channel 39



Date: 31.MAY.2021 11:06:40

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 22 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A



#### 20 dB Bandwidth Plot on Channel 78



Date: 31.MAY.2021 11:15:22

#### <2Mbps>

#### 20 dB Bandwidth Plot on Channel 00



Date: 31.MAY.2021 11:20:56

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01

Page Number : 23 of 58 Report Issued Date: Jun. 30, 2021 Report Version : Rev. 02

Report No.: FR082617-01A

#### 20 dB Bandwidth Plot on Channel 39



Date: 31.MAY.2021 11:42:03

#### 20 dB Bandwidth Plot on Channel 78



Date: 31.MAY.2021 11:51:16

Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01

Page Number : 24 of 58 Report Issued Date: Jun. 30, 2021 Report Version : Rev. 02

Report No.: FR082617-01A

#### <3Mbps>

#### 20 dB Bandwidth Plot on Channel 00

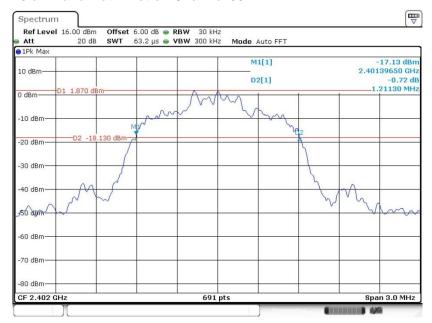

Date: 31.MAY.2021 12:01:01

#### 20 dB Bandwidth Plot on Channel 39




Date: 31.MAY.2021 12:15:34

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 25 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

#### 20 dB Bandwidth Plot on Channel 78

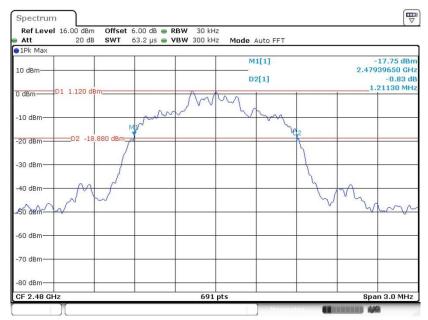

Date: 31.MAY.2021 12:19:33

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 26 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

## 3.4.6 Test Result of 99% Occupied Bandwidth

Please refer to Appendix A.

#### <1Mbps>

#### 99% Occupied Bandwidth Plot on Channel 00



Date: 31.MAY.2021 10:34:35

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 27 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

#### 99% Occupied Bandwidth Plot on Channel 39



Date: 31.MAY.2021 11:08:54

#### 99% Occupied Bandwidth Plot on Channel 78



Date: 31.MAY.2021 11:16:54

Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01

Page Number : 28 of 58 Report Issued Date: Jun. 30, 2021 Report Version : Rev. 02

Report No.: FR082617-01A

#### <2Mbps>

#### 99% Occupied Bandwidth Plot on Channel 00

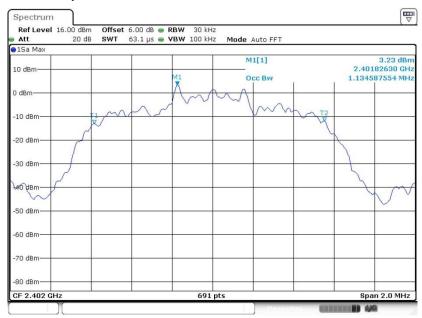

Date: 31.MAY.2021 11:22:52

#### 99% Occupied Bandwidth Plot on Channel 39



Date: 31.MAY.2021 11:42:45

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 29 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A



#### 99% Occupied Bandwidth Plot on Channel 78



Date: 31.MAY.2021 11:52;42

#### <3Mbps>

#### 99% Occupied Bandwidth Plot on Channel 00




Date: 31.MAY.2021 12:02:46

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 30 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02


Report No.: FR082617-01A

#### 99% Occupied Bandwidth Plot on Channel 39

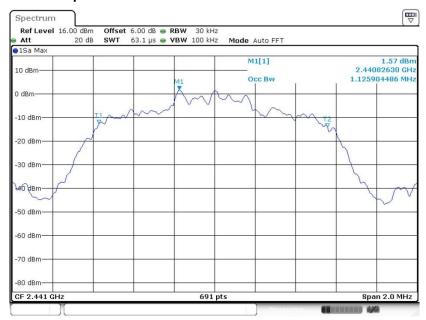

Date: 31.MAY.2021 12:16:16

#### 99% Occupied Bandwidth Plot on Channel 78

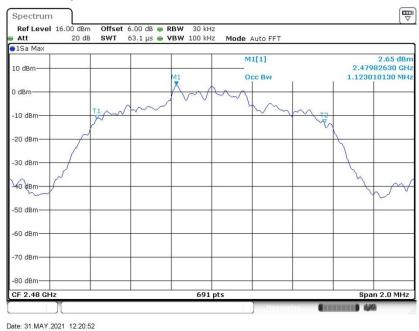

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 31 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

### 3.5 Output Power Measurement

#### 3.5.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following:

(1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts.


#### 3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

#### 3.5.4 Test Setup

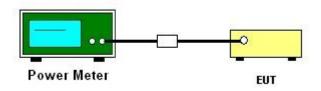

#### 3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 32 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR082617-01A

## 3.6 Conducted Band Edges Measurement

#### 3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


#### 3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

#### 3.6.4 Test Setup




TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 33 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

## 3.6.5 Test Result of Conducted Band Edges


#### <1Mbps>

#### Low Band Edge Plot on Channel 00

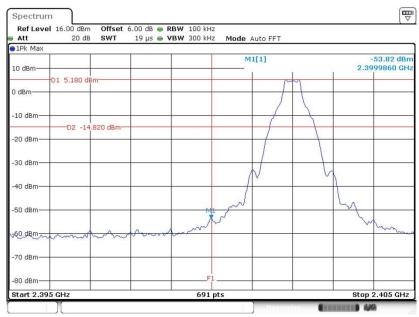

Date: 31.MAY.2021 10:32:54

#### **High Band Edge Plot on Channel 78**

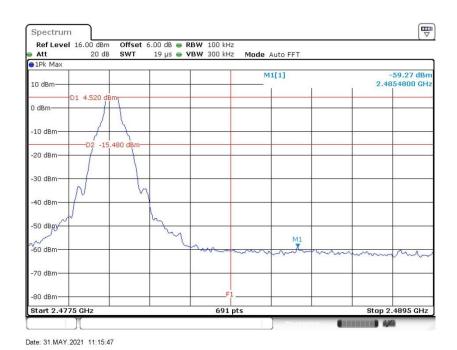


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 34 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A


#### <2Mbps>

#### Low Band Edge Plot on Channel 00

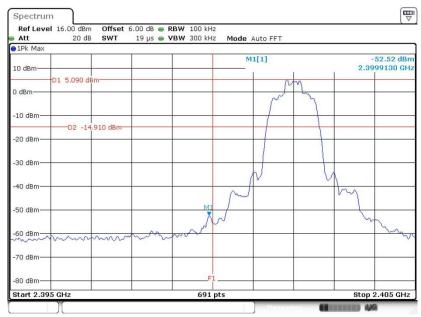

Date: 31.MAY.2021 11:21:22

#### **High Band Edge Plot on Channel 78**

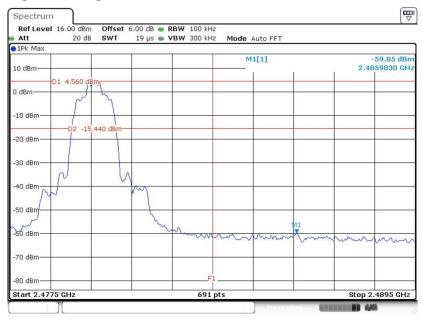

Date: 31.MAY.2021 11:51:42


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 35 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A


#### <3Mbps>

#### Low Band Edge Plot on Channel 00

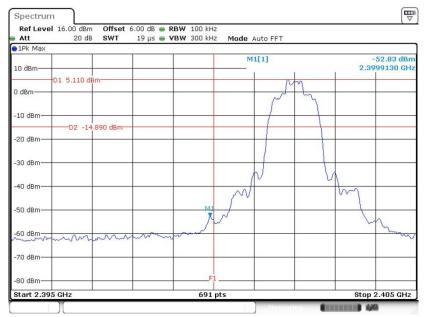

Date: 31.MAY.2021 12:01:21

#### **High Band Edge Plot on Channel 78**

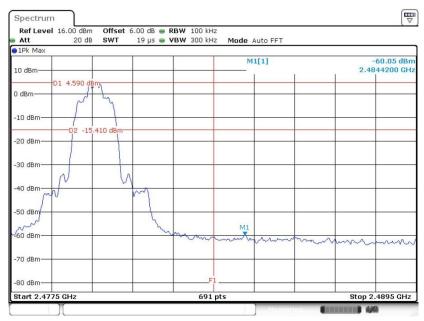

Date: 31.MAY.2021 12:19:53

Sporton International (Kunshan) Inc.


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 36 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A

## 3.6.6 Test Result of Conducted Hopping Mode Band Edges


#### <1Mbps>

#### **Hopping Mode Low Band Edge Plot**

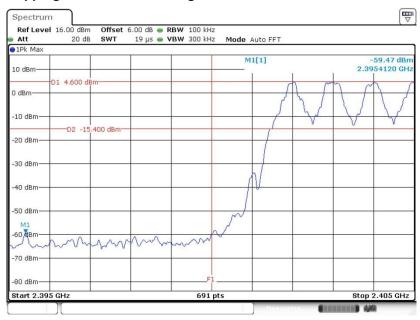

Date: 31.MAY.2021 10:33:40

#### **Hopping Mode High Band Edge Plot**

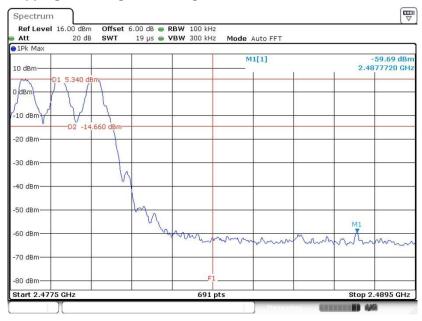

Date: 31.MAY.2021 11:16:09


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 37 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A


#### <2Mbps>

#### **Hopping Mode Low Band Edge Plot**

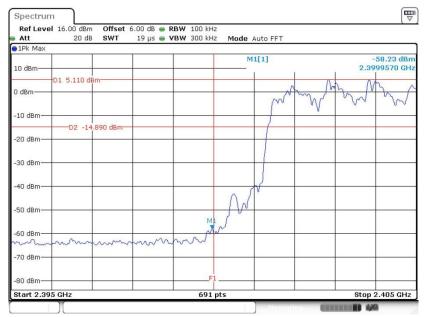

Date: 31.MAY.2021 11:21:48

#### **Hopping Mode High Band Edge Plot**

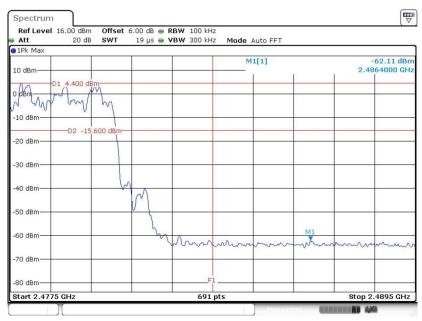

Date: 31.MAY.2021 11:52:02


Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 38 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A


#### <3Mbps>

#### **Hopping Mode Low Band Edge Plot**

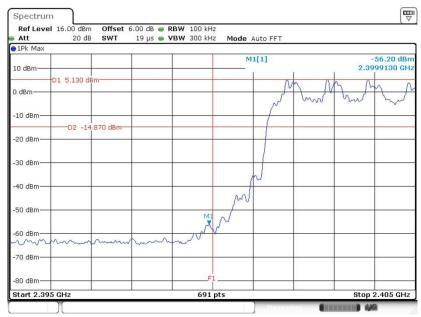

Date: 31.MAY.2021 12:02:02

#### **Hopping Mode High Band Edge Plot**

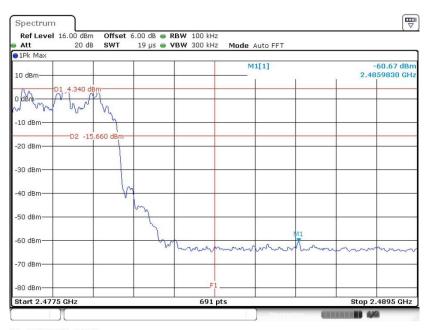

Date: 31.MAY.2021 12:20:13

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: 2AZ5B21A01 Page Number : 39 of 58
Report Issued Date : Jun. 30, 2021
Report Version : Rev. 02

Report No.: FR082617-01A