




Band26-3MHz-QPSK-27025-1RB#14



Band26-3MHz-QPSK-27025-15RB#0

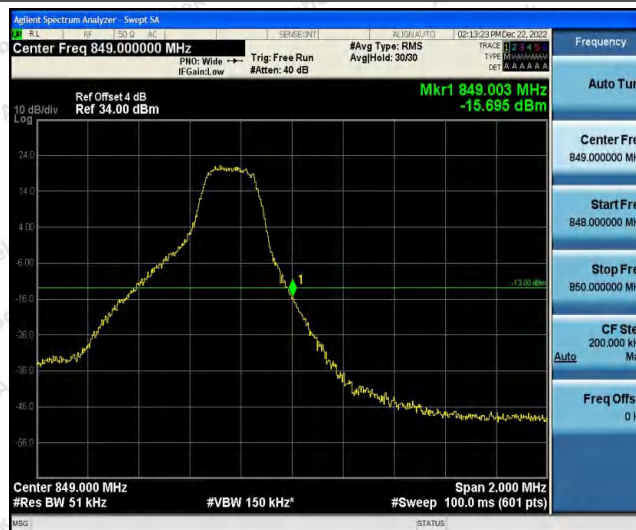

Band26-3MHz-16QAM-26705-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-3MHz-16QAM-26705-1RB#14



Band26-3MHz-16QAM-26705-15RB#0



Band26-3MHz-16QAM-26775-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-3MHz-16QAM-26775-1RB#14



Band26-3MHz-16QAM-26775-15RB#0



Band26-3MHz-16QAM-26805-1RB#0


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



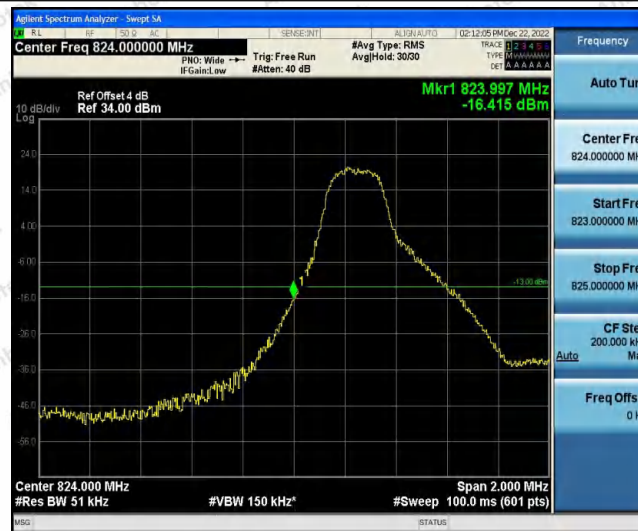

Band26-3MHz-16QAM-26805-1RB#14



Band26-3MHz-16QAM-26805-15RB#0



Band26-3MHz-16QAM-27025-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-3MHz-16QAM-27025-1RB#14

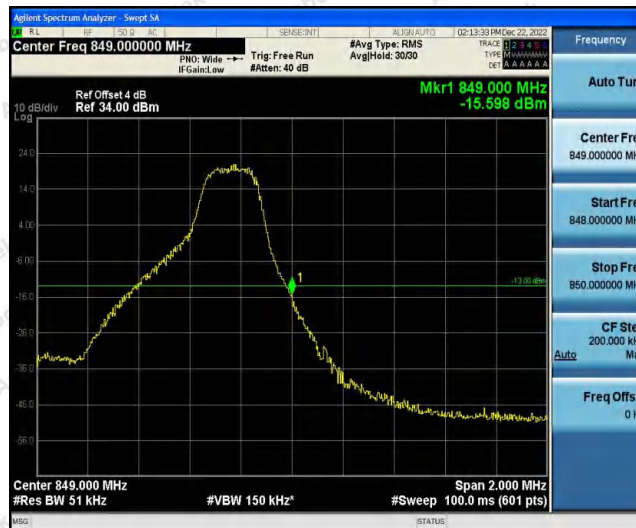

Band26-3MHz-16QAM-27025-15RB#0



Band26-5MHz-QPSK-26715-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-5MHz-QPSK-26715-1RB#24



Band26-5MHz-QPSK-26715-25RB#0



Band26-5MHz-QPSK-26815-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-5MHz-QPSK-26815-1RB#24

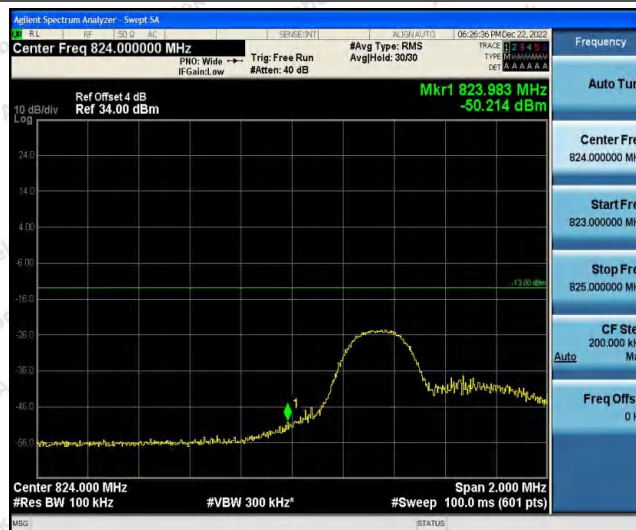

Band26-5MHz-QPSK-26815-25RB#0



Band26-5MHz-QPSK-27015-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-5MHz-QPSK-27015-1RB#24



Band26-5MHz-QPSK-27015-25RB#0



Band26-5MHz-16QAM-26715-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-5MHz-16QAM-26715-1RB#24



Band26-5MHz-16QAM-26715-25RB#0



Band26-5MHz-16QAM-26815-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-5MHz-16QAM-26815-1RB#24



Band26-5MHz-16QAM-26815-25RB#0



Band26-5MHz-16QAM-27015-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-5MHz-16QAM-27015-1RB#24

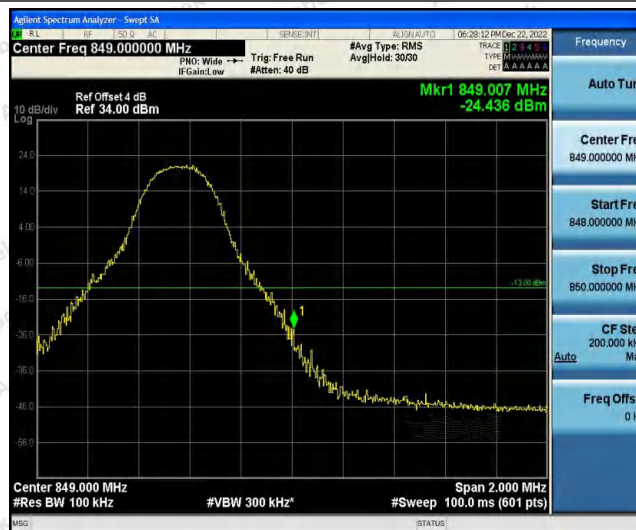

Band26-5MHz-16QAM-27015-25RB#0



Band26-10MHz-QPSK-26740-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-10MHz-QPSK-26740-1RB#49

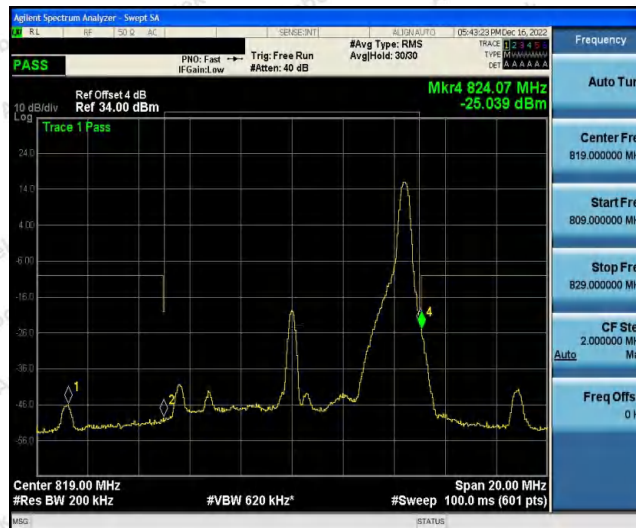

Band26-10MHz-QPSK-26740-50RB#0



Band26-10MHz-QPSK-26840-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-10MHz-QPSK-26840-1RB#49



Band26-10MHz-QPSK-26840-50RB#0



Band26-10MHz-QPSK-26990-1RB#0


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



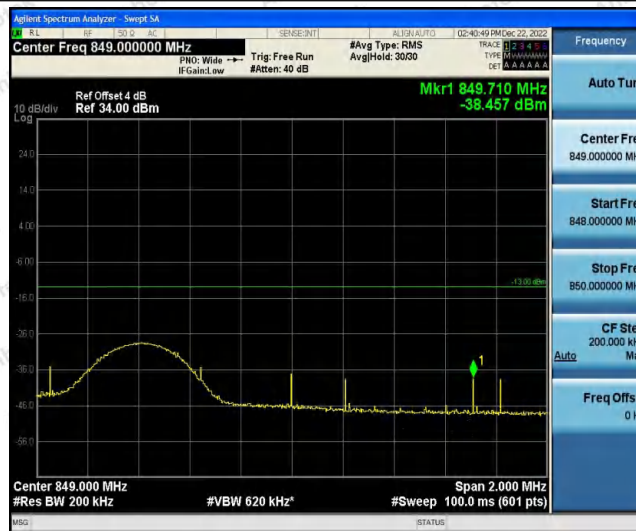

Band26-10MHz-QPSK-26990-1RB#49



Band26-10MHz-QPSK-26990-50RB#0



Band26-10MHz-16QAM-26740-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-10MHz-16QAM-26740-1RB#49



Band26-10MHz-16QAM-26740-50RB#0



Band26-10MHz-16QAM-26840-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-10MHz-16QAM-26840-1RB#49



Band26-10MHz-16QAM-26840-50RB#0



Band26-10MHz-16QAM-26990-1RB#0


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



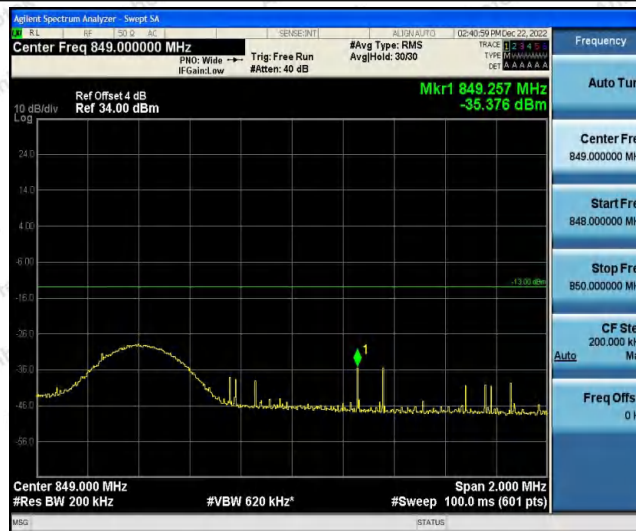

Band26-10MHz-16QAM-26990-1RB#49



Band26-10MHz-16QAM-26990-50RB#0



Band26-15MHz-QPSK-26865-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-15MHz-QPSK-26865-1RB#74



Band26-15MHz-QPSK-26865-75RB#0



Band26-15MHz-QPSK-26965-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-15MHz-QPSK-26965-1RB#74



Band26-15MHz-QPSK-26965-75RB#0



Band26-15MHz-16QAM-26865-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn





Band26-15MHz-16QAM-26865-1RB#74



Band26-15MHz-16QAM-26865-75RB#0



Band26-15MHz-16QAM-26965-1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn





Band26-15MHz-16QAM-26965-1RB#74



Band26-15MHz-16QAM-26965-75RB#0



## Appendix E: Conducted Spurious Emission

### Test Result

| Band   | Bandwidth | Modulation | Channel | RB Configuration | Frequency Range      | Result (dBm) | Verdict |
|--------|-----------|------------|---------|------------------|----------------------|--------------|---------|
| Band26 | 1.4MHz    | QPSK       | 26697   | 1RB#0            | Range1:30~1000MHz    | -51.8        | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26697   | 1RB#0            | Range2:1000~10000MHz | -19.93       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26740   | 1RB#0            | Range1:30~1000MHz    | -51.17       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26740   | 1RB#0            | Range2:1000~10000MHz | -21.36       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26783   | 1RB#0            | Range1:30~1000MHz    | -51.07       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26783   | 1RB#0            | Range2:1000~10000MHz | -22.71       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26797   | 1RB#0            | Range1:30~1000MHz    | -51.79       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26797   | 1RB#0            | Range2:1000~10000MHz | -25.61       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26915   | 1RB#0            | Range1:30~1000MHz    | -51.76       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 26915   | 1RB#0            | Range2:1000~10000MHz | -19.5        | PASS    |
| Band26 | 1.4MHz    | QPSK       | 27033   | 1RB#0            | Range1:30~1000MHz    | -51.83       | PASS    |
| Band26 | 1.4MHz    | QPSK       | 27033   | 1RB#0            | Range2:1000~10000MHz | -25          | PASS    |
| Band26 | 1.4MHz    | 16QAM      | 26697   | 1RB#0            | Range1:30~1000MHz    | -51.17       | PASS    |
| Band26 | 1.4MHz    | 16QAM      | 26697   | 1RB#0            | Range2:1000~10000MHz | -19.02       | PASS    |
| Band26 | 1.4MHz    | 16QAM      | 26740   | 1RB#0            | Range1:30~1000MHz    | -51.1        | PASS    |
| Band26 | 1.4MHz    | 16QAM      | 26740   | 1RB#0            | Range2:1000~10000MHz | -16.42       | PASS    |
| Band26 | 1.4MHz    | 16QAM      | 26783   | 1RB#0            | Range1:30~1000MHz    | -51.46       | PASS    |
| Band26 | 1.4MHz    | 16QAM      | 26783   | 1RB#0            | Range2:1000~10000MHz | -23.02       | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|        |        |       |       |       |                      |        |      |
|--------|--------|-------|-------|-------|----------------------|--------|------|
| Band26 | 1.4MHz | 16QAM | 26797 | 1RB#0 | Range1:30~1000MHz    | -50.81 | PASS |
| Band26 | 1.4MHz | 16QAM | 26797 | 1RB#0 | Range2:1000~10000MHz | -21.17 | PASS |
| Band26 | 1.4MHz | 16QAM | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.33 | PASS |
| Band26 | 1.4MHz | 16QAM | 26915 | 1RB#0 | Range2:1000~10000MHz | -23.08 | PASS |
| Band26 | 1.4MHz | 16QAM | 27033 | 1RB#0 | Range1:30~1000MHz    | -51.49 | PASS |
| Band26 | 1.4MHz | 16QAM | 27033 | 1RB#0 | Range2:1000~10000MHz | -24.13 | PASS |
| Band26 | 3MHz   | QPSK  | 26705 | 1RB#0 | Range1:30~1000MHz    | -50.95 | PASS |
| Band26 | 3MHz   | QPSK  | 26705 | 1RB#0 | Range2:1000~10000MHz | -21.76 | PASS |
| Band26 | 3MHz   | QPSK  | 26740 | 1RB#0 | Range1:30~1000MHz    | -50.36 | PASS |
| Band26 | 3MHz   | QPSK  | 26740 | 1RB#0 | Range2:1000~10000MHz | -22.92 | PASS |
| Band26 | 3MHz   | QPSK  | 26775 | 1RB#0 | Range1:30~1000MHz    | -51.39 | PASS |
| Band26 | 3MHz   | QPSK  | 26775 | 1RB#0 | Range2:1000~10000MHz | -20.77 | PASS |
| Band26 | 3MHz   | QPSK  | 26805 | 1RB#0 | Range1:30~1000MHz    | -51.32 | PASS |
| Band26 | 3MHz   | QPSK  | 26805 | 1RB#0 | Range2:1000~10000MHz | -14.44 | PASS |
| Band26 | 3MHz   | QPSK  | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.02 | PASS |
| Band26 | 3MHz   | QPSK  | 26915 | 1RB#0 | Range2:1000~10000MHz | -21.19 | PASS |
| Band26 | 3MHz   | QPSK  | 27025 | 1RB#0 | Range1:30~1000MHz    | -51.57 | PASS |
| Band26 | 3MHz   | QPSK  | 27025 | 1RB#0 | Range2:1000~10000MHz | -17.98 | PASS |
| Band26 | 3MHz   | 16QAM | 26705 | 1RB#0 | Range1:30~1000MHz    | -51.84 | PASS |
| Band26 | 3MHz   | 16QAM | 26705 | 1RB#0 | Range2:1000~10000MHz | -25.62 | PASS |
| Band26 | 3MHz   | 16QAM | 26740 | 1RB#0 | Range1:30~1000MHz    | -51.91 | PASS |
| Band26 | 3MHz   | 16QAM | 26740 | 1RB#0 | Range2:1000~10000MHz | -24.56 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|        |      |       |       |       |                      |        |      |
|--------|------|-------|-------|-------|----------------------|--------|------|
| Band26 | 3MHz | 16QAM | 26775 | 1RB#0 | Range1:30~1000MHz    | -50.4  | PASS |
| Band26 | 3MHz | 16QAM | 26775 | 1RB#0 | Range2:1000~10000MHz | -18.17 | PASS |
| Band26 | 3MHz | 16QAM | 26805 | 1RB#0 | Range1:30~1000MHz    | -51.35 | PASS |
| Band26 | 3MHz | 16QAM | 26805 | 1RB#0 | Range2:1000~10000MHz | -23.5  | PASS |
| Band26 | 3MHz | 16QAM | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.48 | PASS |
| Band26 | 3MHz | 16QAM | 26915 | 1RB#0 | Range2:1000~10000MHz | -25.53 | PASS |
| Band26 | 3MHz | 16QAM | 27025 | 1RB#0 | Range1:30~1000MHz    | -51.77 | PASS |
| Band26 | 3MHz | 16QAM | 27025 | 1RB#0 | Range2:1000~10000MHz | -24.46 | PASS |
| Band26 | 5MHz | QPSK  | 26715 | 1RB#0 | Range1:30~1000MHz    | -50.76 | PASS |
| Band26 | 5MHz | QPSK  | 26715 | 1RB#0 | Range2:1000~10000MHz | -20.87 | PASS |
| Band26 | 5MHz | QPSK  | 26740 | 1RB#0 | Range1:30~1000MHz    | -51.8  | PASS |
| Band26 | 5MHz | QPSK  | 26740 | 1RB#0 | Range2:1000~10000MHz | -20.62 | PASS |
| Band26 | 5MHz | QPSK  | 26815 | 1RB#0 | Range1:30~1000MHz    | -50.94 | PASS |
| Band26 | 5MHz | QPSK  | 26815 | 1RB#0 | Range2:1000~10000MHz | -21.18 | PASS |
| Band26 | 5MHz | QPSK  | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.68 | PASS |
| Band26 | 5MHz | QPSK  | 26915 | 1RB#0 | Range2:1000~10000MHz | -18.13 | PASS |
| Band26 | 5MHz | QPSK  | 27015 | 1RB#0 | Range1:30~1000MHz    | -51.84 | PASS |
| Band26 | 5MHz | QPSK  | 27015 | 1RB#0 | Range2:1000~10000MHz | -20.75 | PASS |
| Band26 | 5MHz | 16QAM | 26715 | 1RB#0 | Range1:30~1000MHz    | -51.3  | PASS |
| Band26 | 5MHz | 16QAM | 26715 | 1RB#0 | Range2:1000~10000MHz | -28.53 | PASS |
| Band26 | 5MHz | 16QAM | 26740 | 1RB#0 | Range1:30~1000MHz    | -51.32 | PASS |
| Band26 | 5MHz | 16QAM | 26740 | 1RB#0 | Range2:1000~10000MHz | -18.75 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|        |       |       |       |       |                      |        |      |
|--------|-------|-------|-------|-------|----------------------|--------|------|
| Band26 | 5MHz  | 16QAM | 26815 | 1RB#0 | Range1:30~1000MHz    | -51.08 | PASS |
| Band26 | 5MHz  | 16QAM | 26815 | 1RB#0 | Range2:1000~10000MHz | -18.1  | PASS |
| Band26 | 5MHz  | 16QAM | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.8  | PASS |
| Band26 | 5MHz  | 16QAM | 26915 | 1RB#0 | Range2:1000~10000MHz | -20.31 | PASS |
| Band26 | 5MHz  | 16QAM | 27015 | 1RB#0 | Range1:30~1000MHz    | -51.49 | PASS |
| Band26 | 5MHz  | 16QAM | 27015 | 1RB#0 | Range2:1000~10000MHz | -25.09 | PASS |
| Band26 | 10MHz | QPSK  | 26740 | 1RB#0 | Range1:30~1000MHz    | -51.1  | PASS |
| Band26 | 10MHz | QPSK  | 26740 | 1RB#0 | Range2:1000~10000MHz | -17.86 | PASS |
| Band26 | 10MHz | QPSK  | 26840 | 1RB#0 | Range1:30~1000MHz    | -51.58 | PASS |
| Band26 | 10MHz | QPSK  | 26840 | 1RB#0 | Range2:1000~10000MHz | -20.5  | PASS |
| Band26 | 10MHz | QPSK  | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.49 | PASS |
| Band26 | 10MHz | QPSK  | 26915 | 1RB#0 | Range2:1000~10000MHz | -20.73 | PASS |
| Band26 | 10MHz | QPSK  | 26990 | 1RB#0 | Range1:30~1000MHz    | -51.66 | PASS |
| Band26 | 10MHz | QPSK  | 26990 | 1RB#0 | Range2:1000~10000MHz | -23.45 | PASS |
| Band26 | 10MHz | 16QAM | 26740 | 1RB#0 | Range1:30~1000MHz    | -51.88 | PASS |
| Band26 | 10MHz | 16QAM | 26740 | 1RB#0 | Range2:1000~10000MHz | -19.32 | PASS |
| Band26 | 10MHz | 16QAM | 26840 | 1RB#0 | Range1:30~1000MHz    | -51.65 | PASS |
| Band26 | 10MHz | 16QAM | 26840 | 1RB#0 | Range2:1000~10000MHz | -24.41 | PASS |
| Band26 | 10MHz | 16QAM | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.38 | PASS |
| Band26 | 10MHz | 16QAM | 26915 | 1RB#0 | Range2:1000~10000MHz | -21.99 | PASS |
| Band26 | 10MHz | 16QAM | 26990 | 1RB#0 | Range1:30~1000MHz    | -51.52 | PASS |
| Band26 | 10MHz | 16QAM | 26990 | 1RB#0 | Range2:1000~10000MHz | -22.36 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|        |       |       |       |       |                      |        |      |
|--------|-------|-------|-------|-------|----------------------|--------|------|
| Band26 | 15MHz | QPSK  | 26865 | 1RB#0 | Range1:30~1000MHz    | -51.61 | PASS |
| Band26 | 15MHz | QPSK  | 26865 | 1RB#0 | Range2:1000~10000MHz | -21.87 | PASS |
| Band26 | 15MHz | QPSK  | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.85 | PASS |
| Band26 | 15MHz | QPSK  | 26915 | 1RB#0 | Range2:1000~10000MHz | -20.58 | PASS |
| Band26 | 15MHz | QPSK  | 26965 | 1RB#0 | Range1:30~1000MHz    | -51.46 | PASS |
| Band26 | 15MHz | QPSK  | 26965 | 1RB#0 | Range2:1000~10000MHz | -23.83 | PASS |
| Band26 | 15MHz | 16QAM | 26865 | 1RB#0 | Range1:30~1000MHz    | -52.12 | PASS |
| Band26 | 15MHz | 16QAM | 26865 | 1RB#0 | Range2:1000~10000MHz | -23.66 | PASS |
| Band26 | 15MHz | 16QAM | 26915 | 1RB#0 | Range1:30~1000MHz    | -51.25 | PASS |
| Band26 | 15MHz | 16QAM | 26915 | 1RB#0 | Range2:1000~10000MHz | -19.92 | PASS |
| Band26 | 15MHz | 16QAM | 26965 | 1RB#0 | Range1:30~1000MHz    | -52.16 | PASS |
| Band26 | 15MHz | 16QAM | 26965 | 1RB#0 | Range2:1000~10000MHz | -25.09 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
 400-003-0500  
 www.anbotek.com.cn




## Test Graphs


Band26-1.4MHz-QPSK-26697-1RB#0-Range1:30~1000MHz

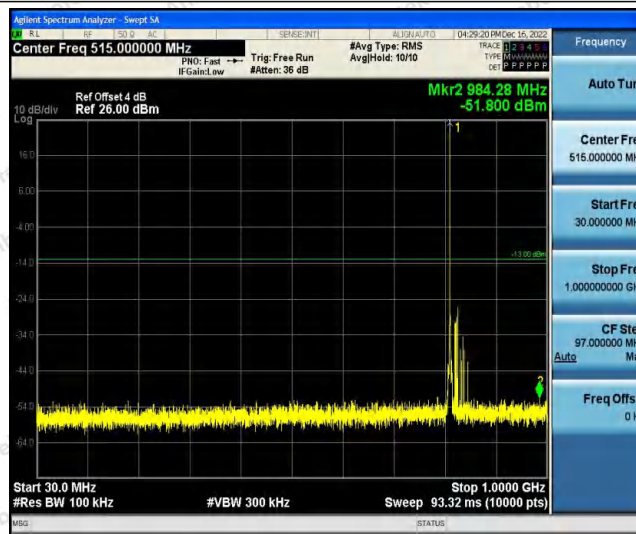

Band26-1.4MHz-QPSK-26697-1RB#0-Range2:1000~10000MHz

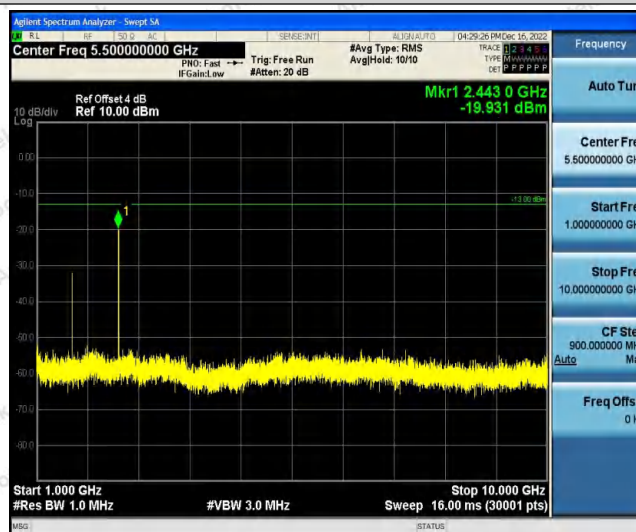

Band26-1.4MHz-QPSK-26740-1RB#0-Range1:30~1000MHz

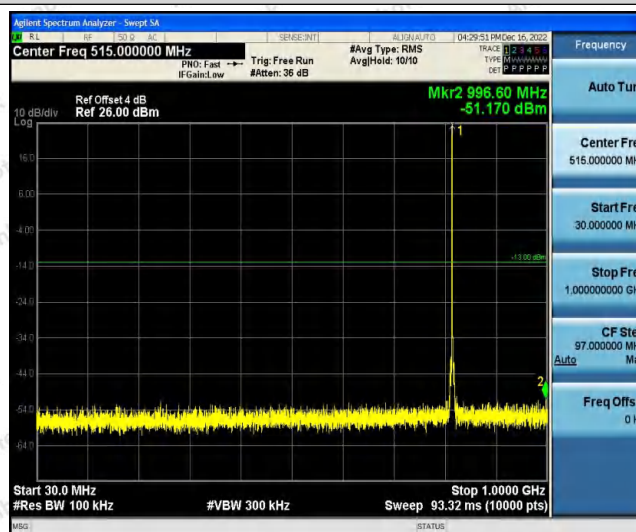

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




## Band26-1.4MHz-QPSK-26740-1RB#0-Range2:1000~10000MHz

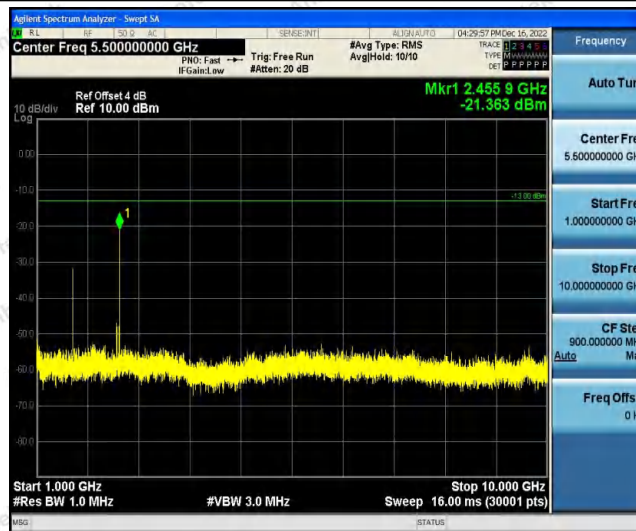

## Band26-1.4MHz-QPSK-26783-1RB#0-Range1:30~1000MHz

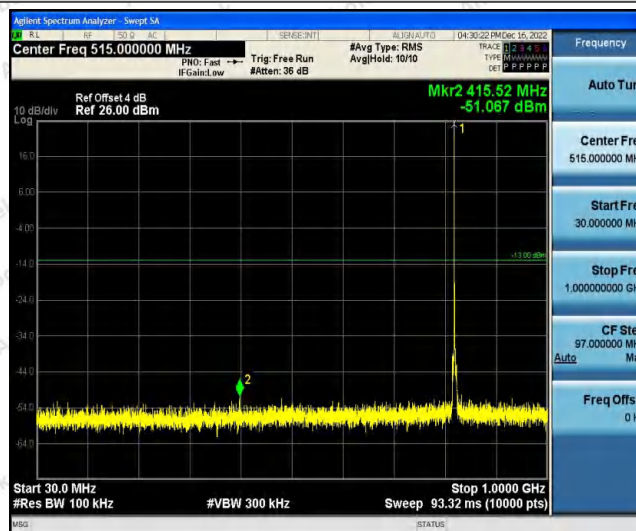

## Band26-1.4MHz-QPSK-26783-1RB#0-Range2:1000~10000MHz

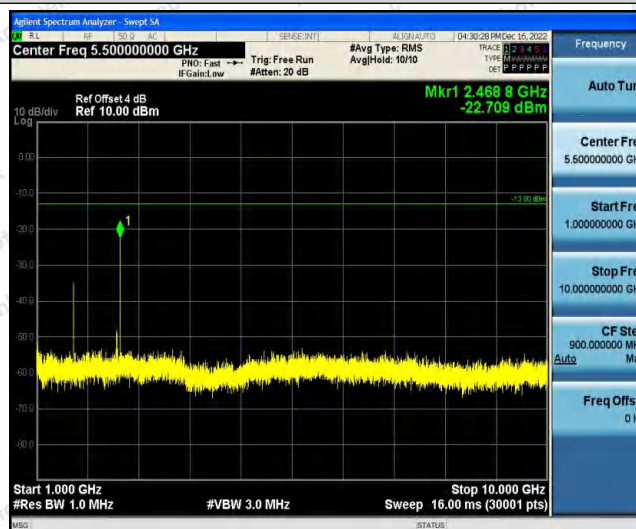

## Band26-1.4MHz-QPSK-26797-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




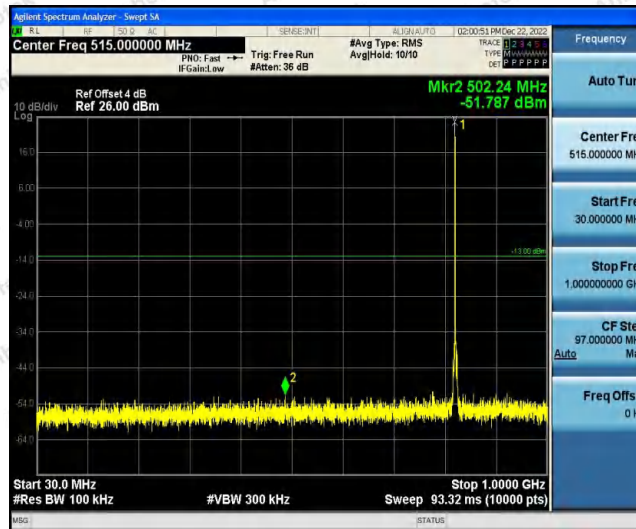

Band26-1.4MHz-QPSK-26797-1RB#0-Range2:1000~10000MHz

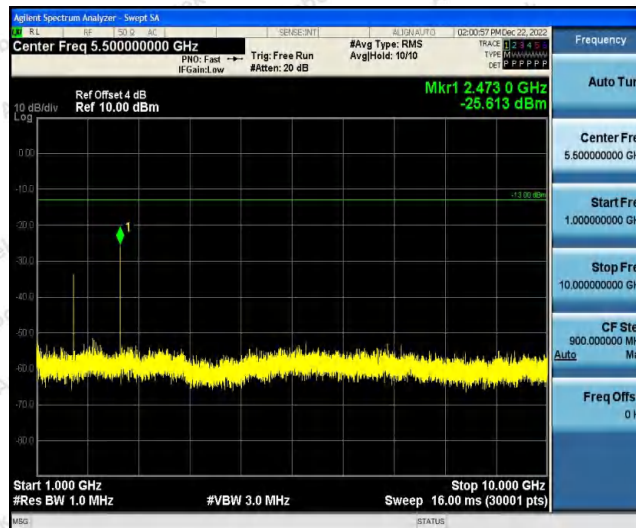


Band26-1.4MHz-QPSK-26915-1RB#0-Range1:30~1000MHz

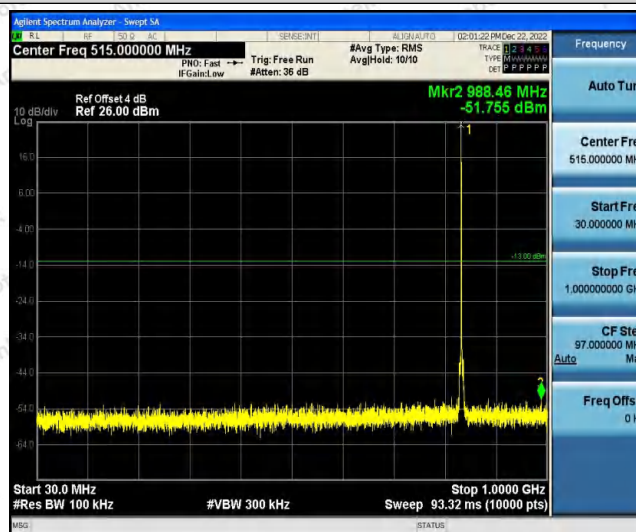


Band26-1.4MHz-QPSK-26915-1RB#0-Range2:1000~10000MHz




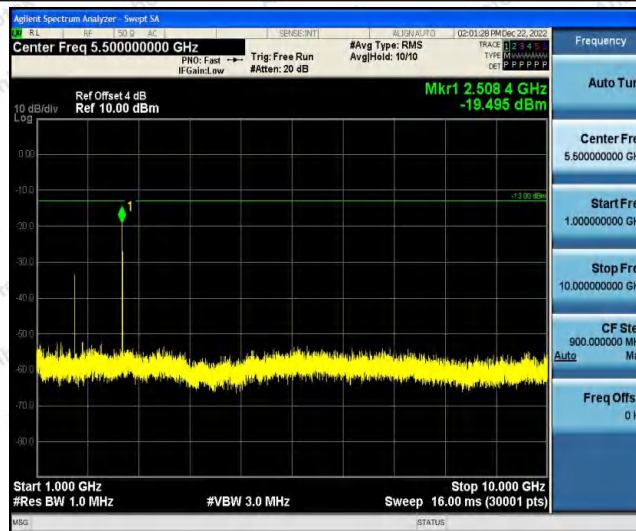

Band26-1.4MHz-QPSK-27033-1RB#0-Range1:30~1000MHz

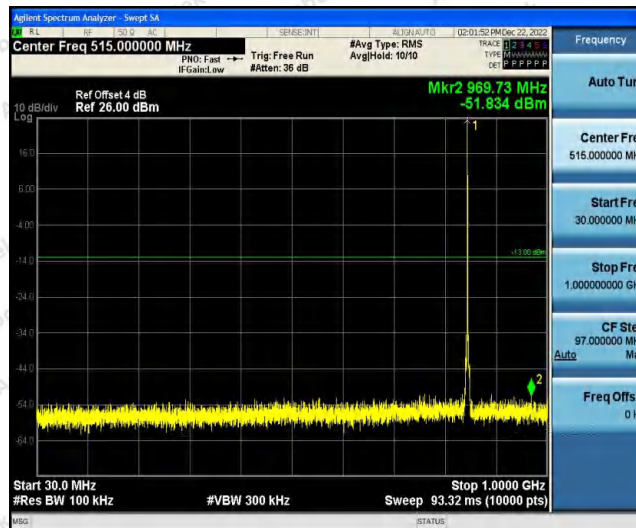

Band26-1.4MHz-QPSK-27033-1RB#0-Range2:1000~10000MHz

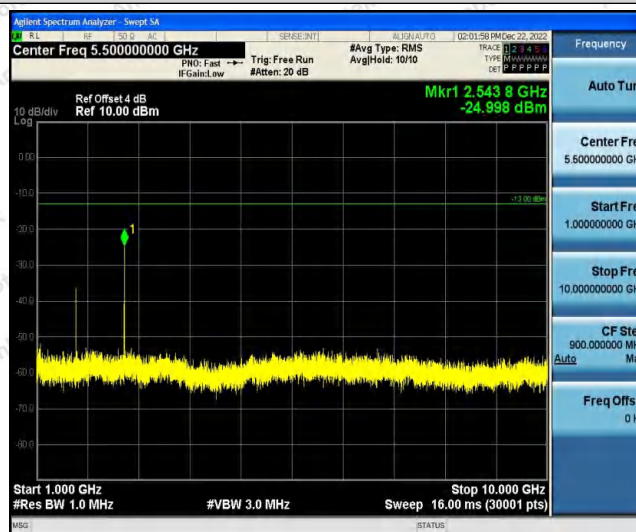

Band26-1.4MHz-16QAM-26697-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




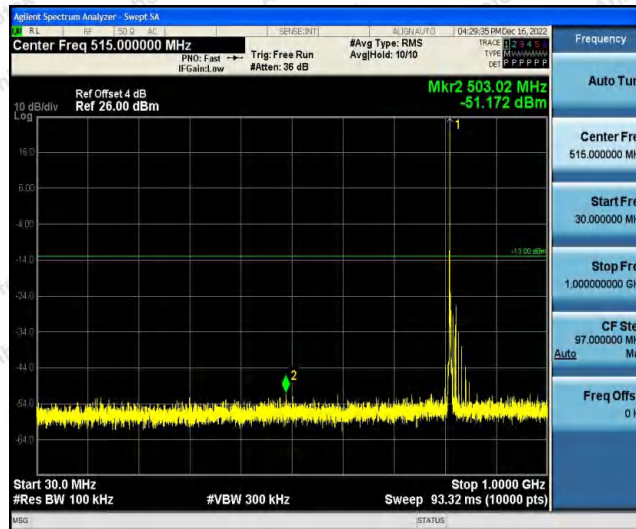

Band26-1.4MHz-16QAM-26697-1RB#0-Range2:1000~10000MHz

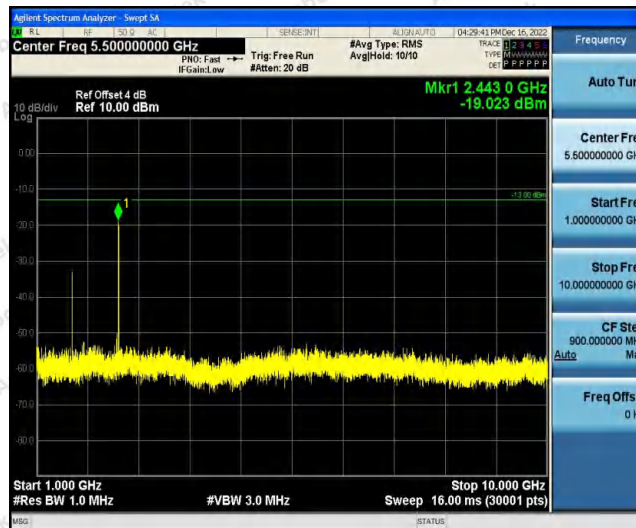


Band26-1.4MHz-16QAM-26740-1RB#0-Range1:30~1000MHz

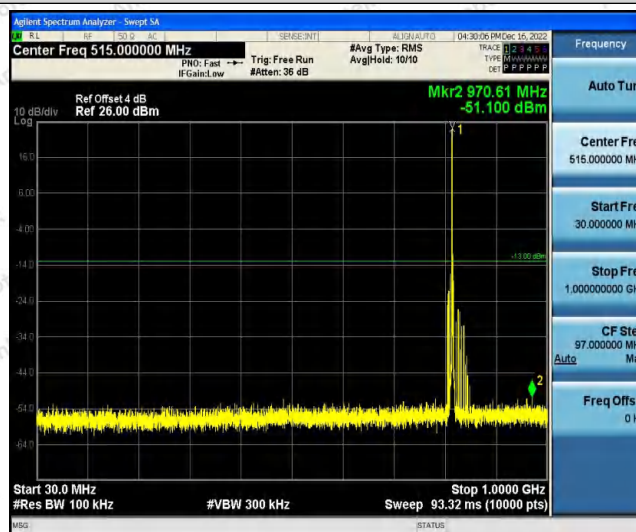


Band26-1.4MHz-16QAM-26740-1RB#0-Range2:1000~10000MHz




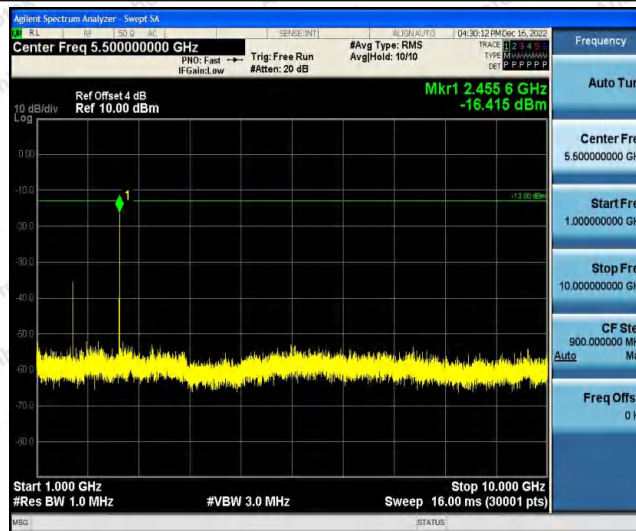

Band26-1.4MHz-16QAM-26783-1RB#0-Range1:30~1000MHz

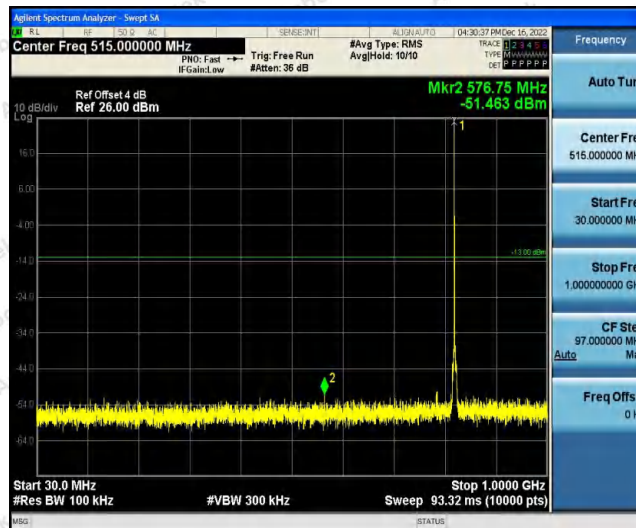

Band26-1.4MHz-16QAM-26783-1RB#0-Range2:1000~10000MHz

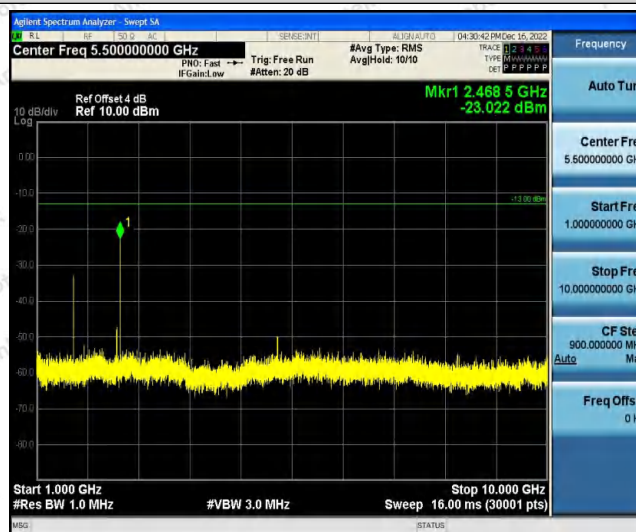

Band26-1.4MHz-16QAM-26797-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




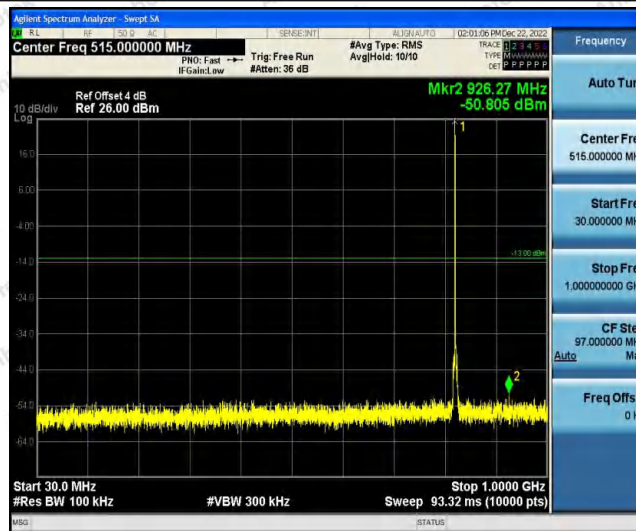

Band26-1.4MHz-16QAM-26797-1RB#0-Range2:1000~10000MHz

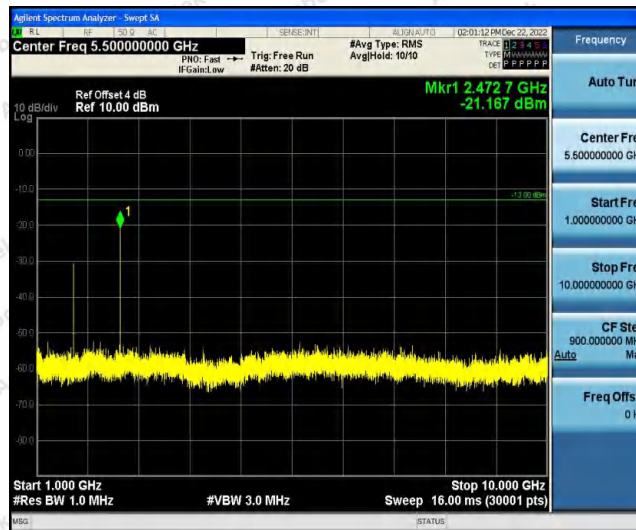

Band26-1.4MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

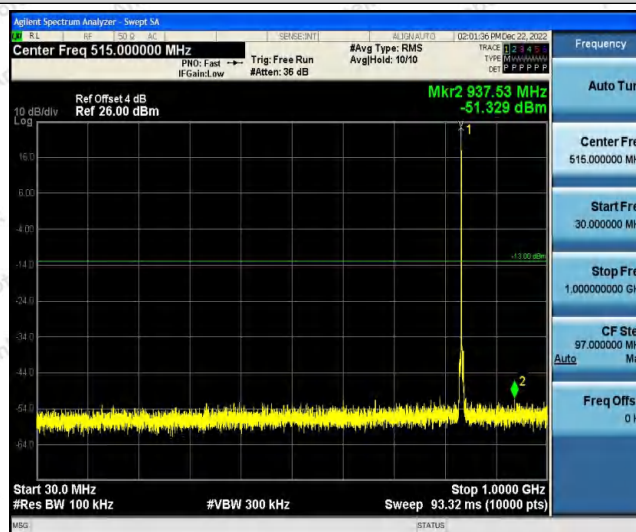

Band26-1.4MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




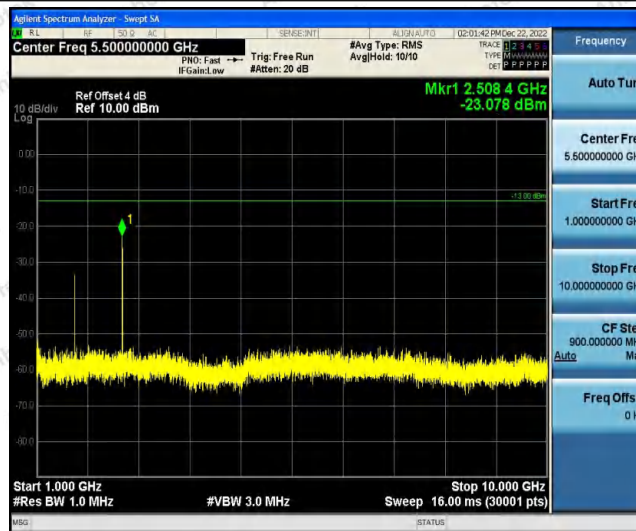

Band26-1.4MHz-16QAM-27033-1RB#0-Range1:30~1000MHz

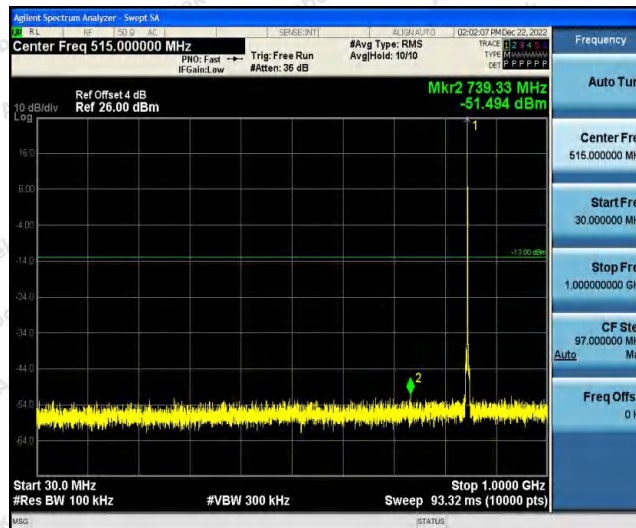


Band26-1.4MHz-16QAM-27033-1RB#0-Range2:1000~10000MHz

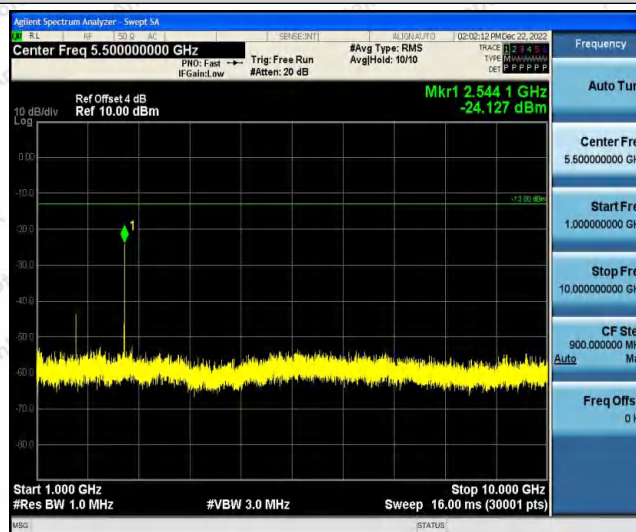


Band26-3MHz-QPSK-26705-1RB#0-Range1:30~1000MHz




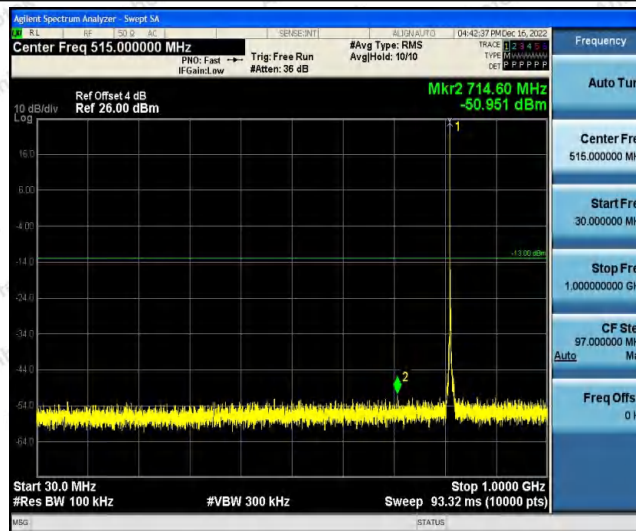

Band26-3MHz-QPSK-26705-1RB#0-Range2:1000~10000MHz

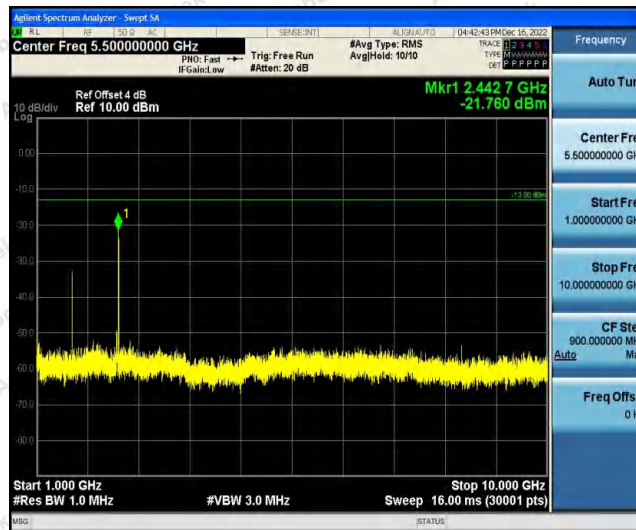

Band26-3MHz-QPSK-26740-1RB#0-Range1:30~1000MHz

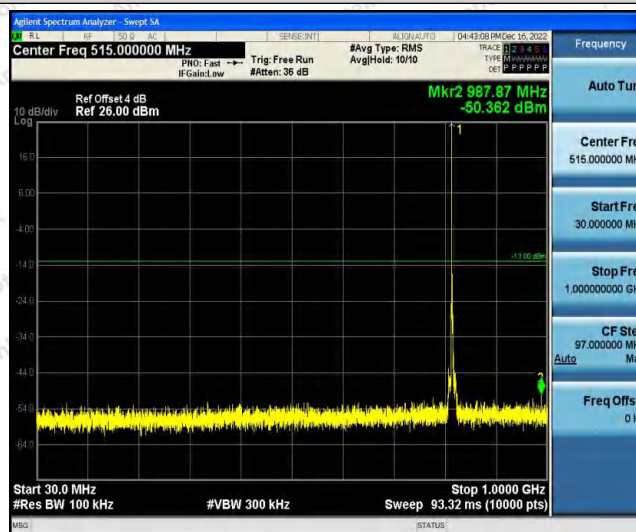

Band26-3MHz-QPSK-26740-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




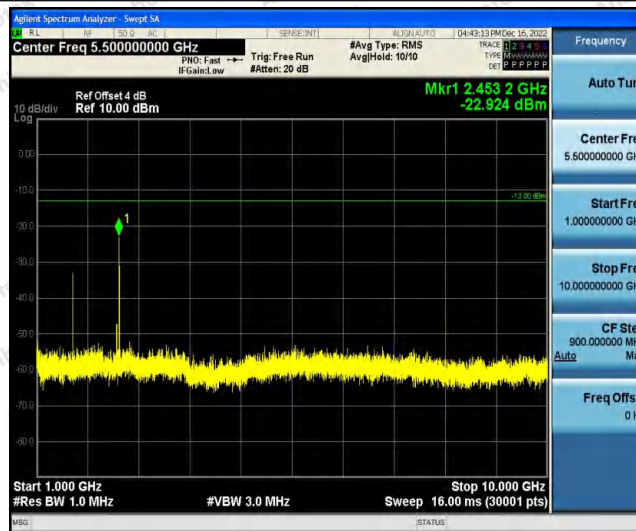

Band26-3MHz-QPSK-26775-1RB#0-Range1:30~1000MHz

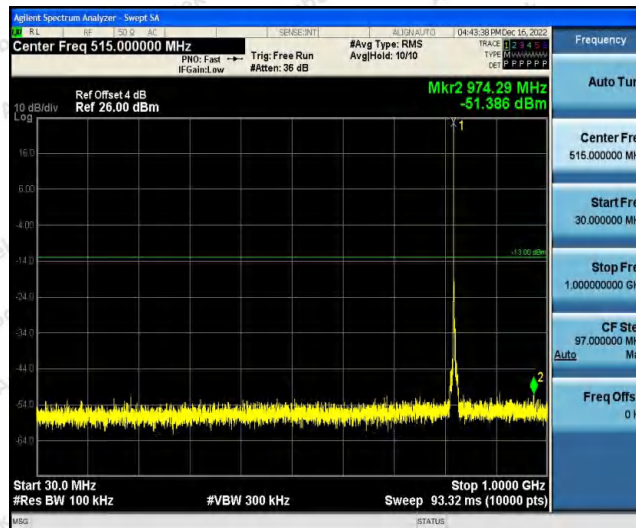

Band26-3MHz-QPSK-26775-1RB#0-Range2:1000~10000MHz

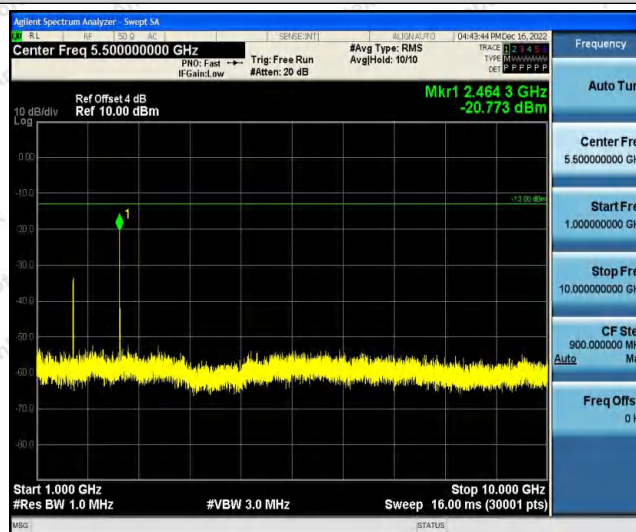

Band26-3MHz-QPSK-26805-1RB#0-Range1:30~1000MHz

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn








Band26-3MHz-QPSK-27025-1RB#0-Range1:30~1000MHz

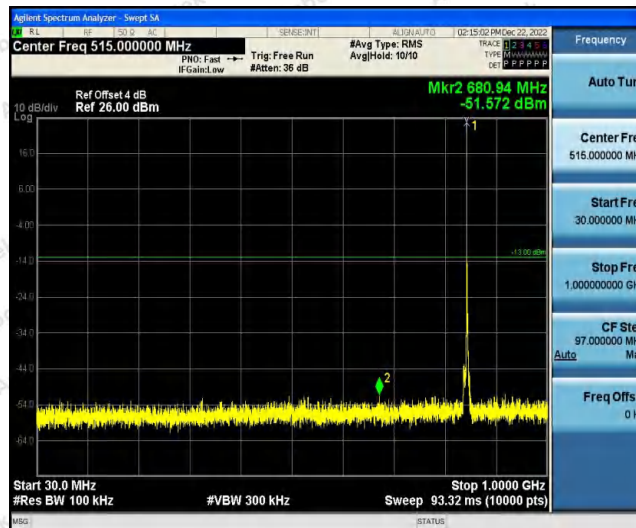

Band26-3MHz-QPSK-27025-1RB#0-Range2:1000~10000MHz

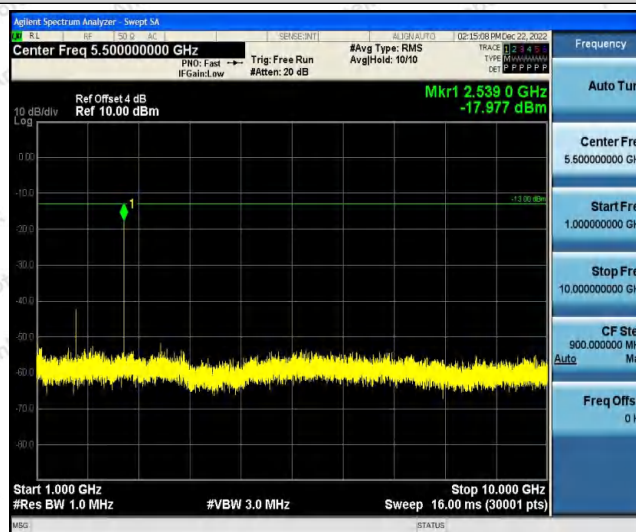

Band26-3MHz-16QAM-26705-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




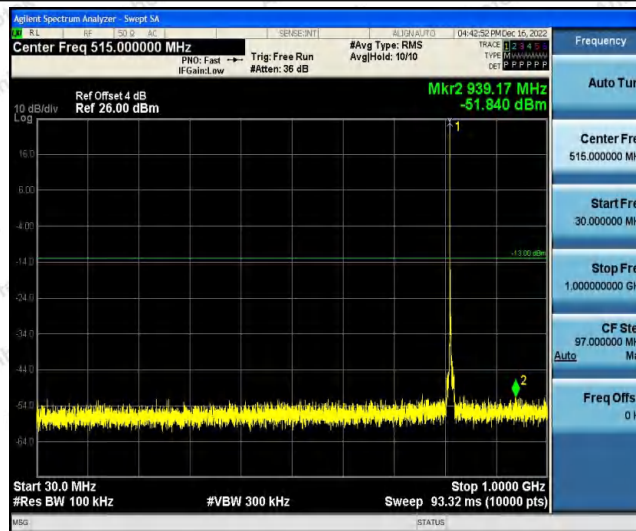

Band26-3MHz-16QAM-26705-1RB#0-Range2:1000~10000MHz

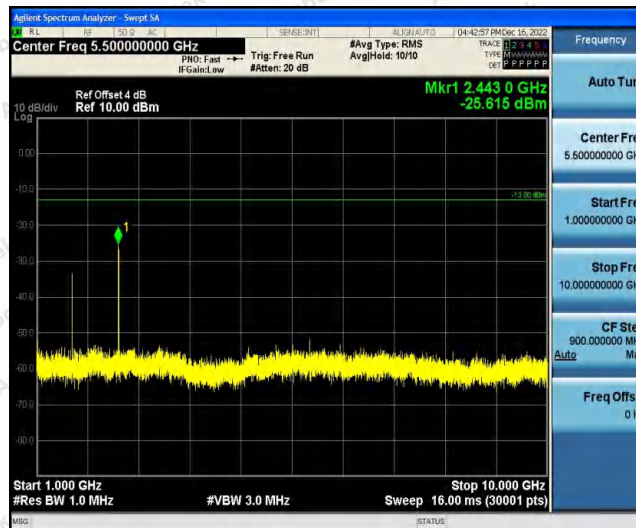

Band26-3MHz-16QAM-26740-1RB#0-Range1:30~1000MHz

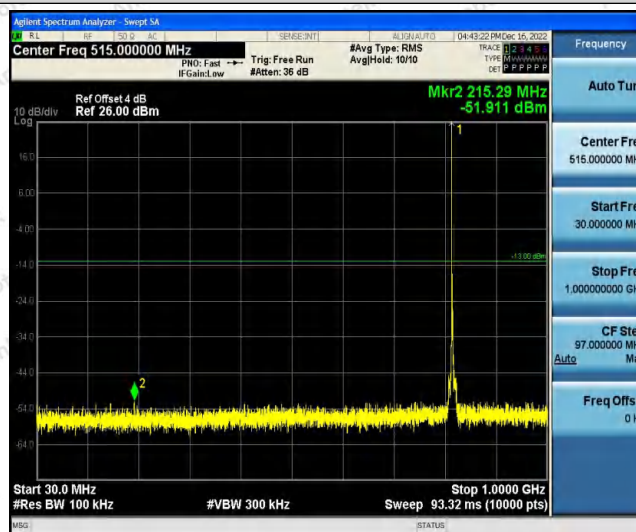

Band26-3MHz-16QAM-26740-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




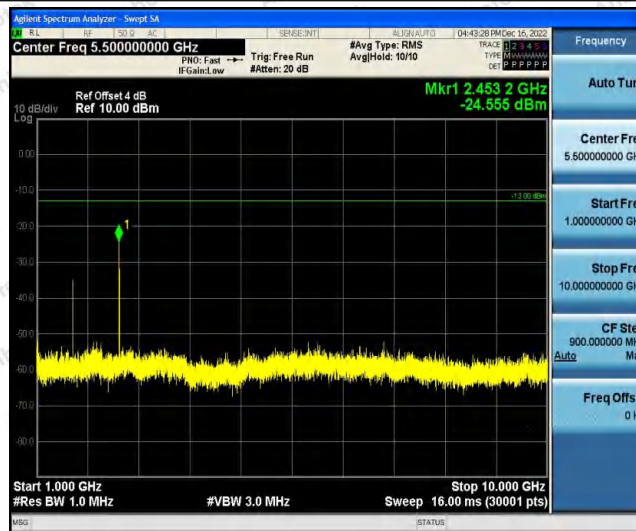

Band26-3MHz-16QAM-26775-1RB#0-Range1:30~1000MHz

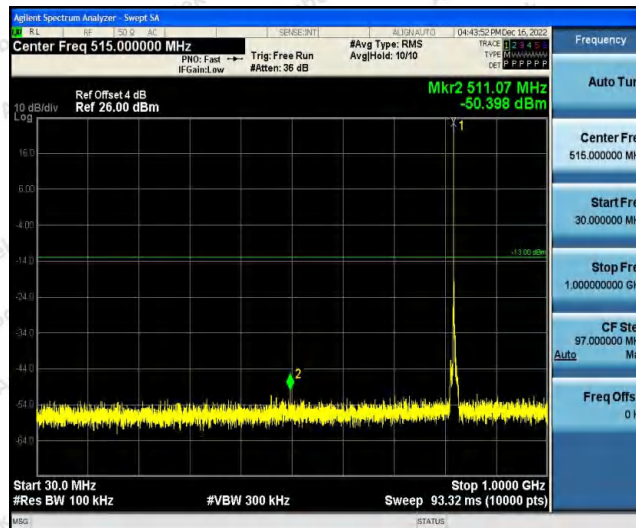

Band26-3MHz-16QAM-26775-1RB#0-Range2:1000~10000MHz

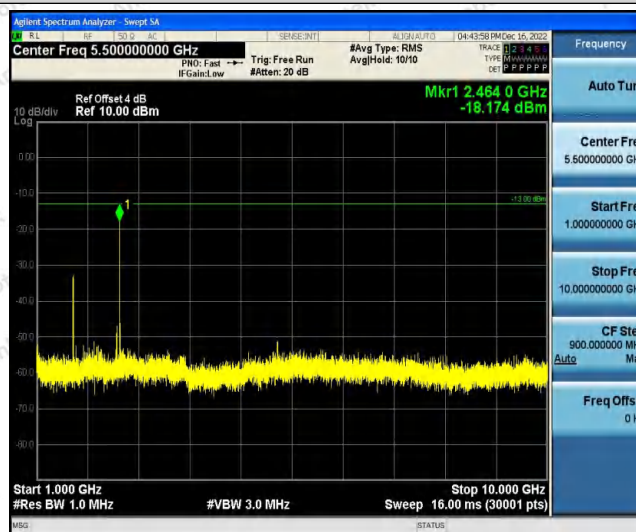

Band26-3MHz-16QAM-26805-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




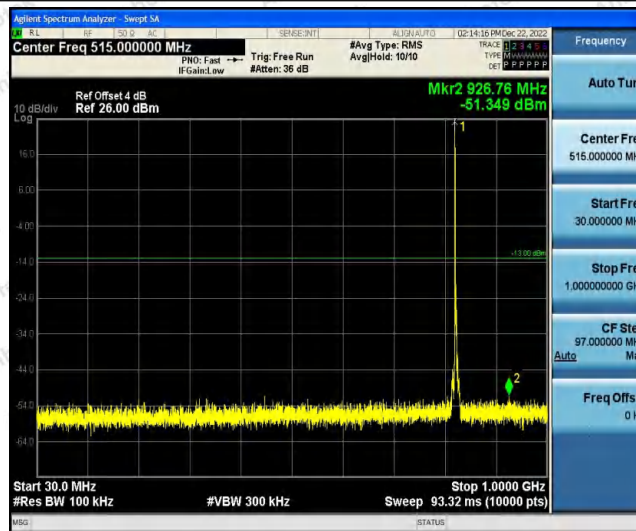

Band26-3MHz-16QAM-26805-1RB#0-Range2:1000~10000MHz

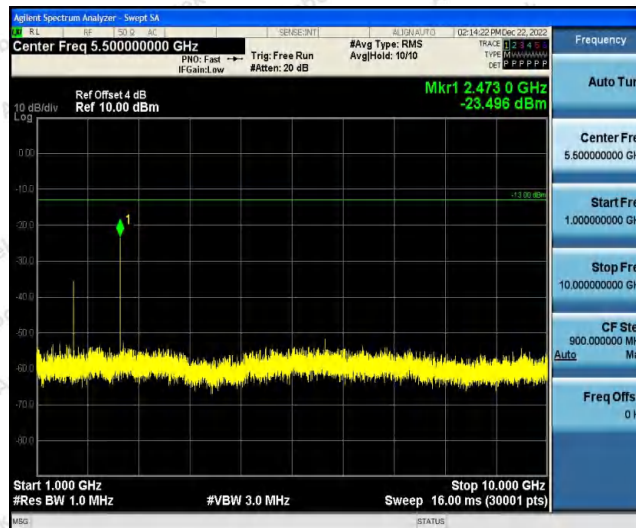

Band26-3MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

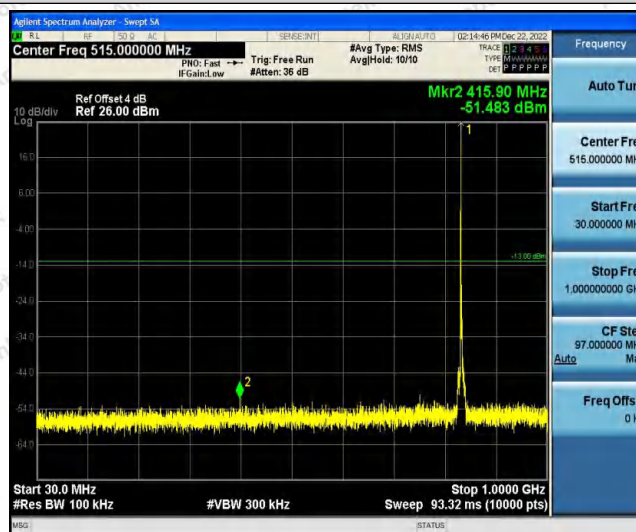

Band26-3MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




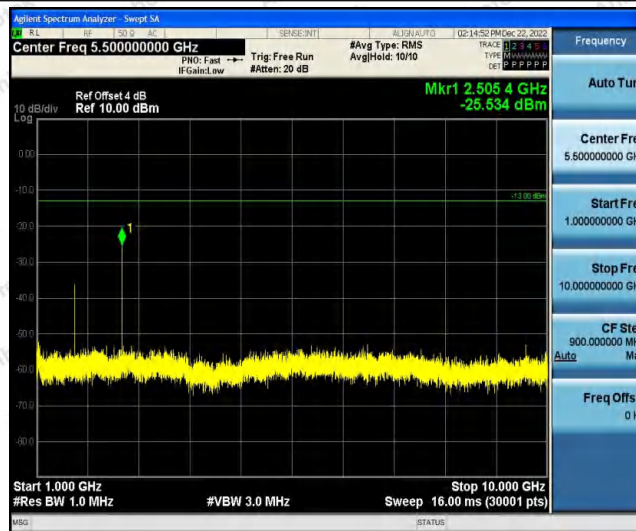

Band26-3MHz-16QAM-27025-1RB#0-Range1:30~1000MHz

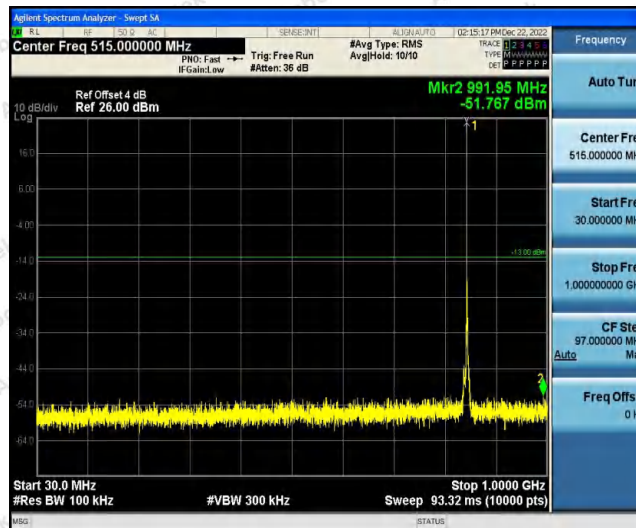

Band26-3MHz-16QAM-27025-1RB#0-Range2:1000~10000MHz

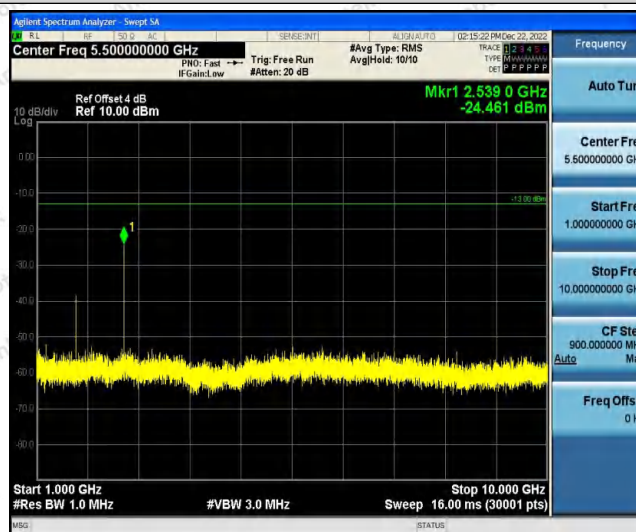

Band26-5MHz-QPSK-26715-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




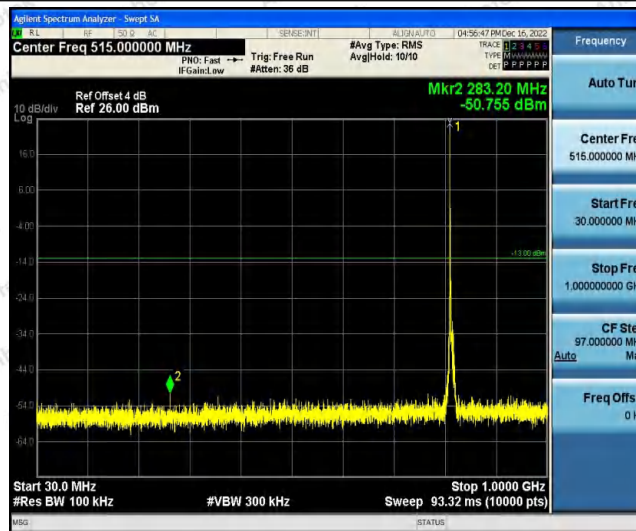

Band26-5MHz-QPSK-26715-1RB#0-Range2:1000~10000MHz

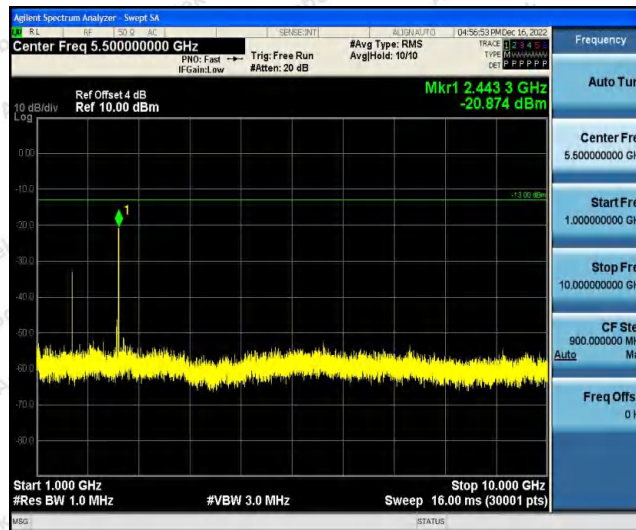

Band26-5MHz-QPSK-26740-1RB#0-Range1:30~1000MHz

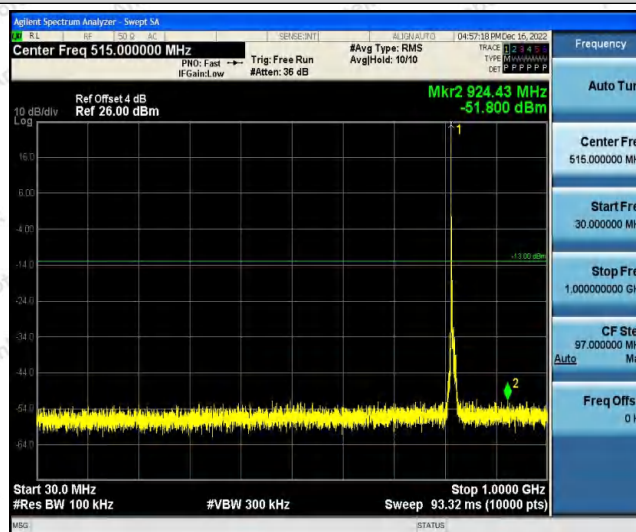

Band26-5MHz-QPSK-26740-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




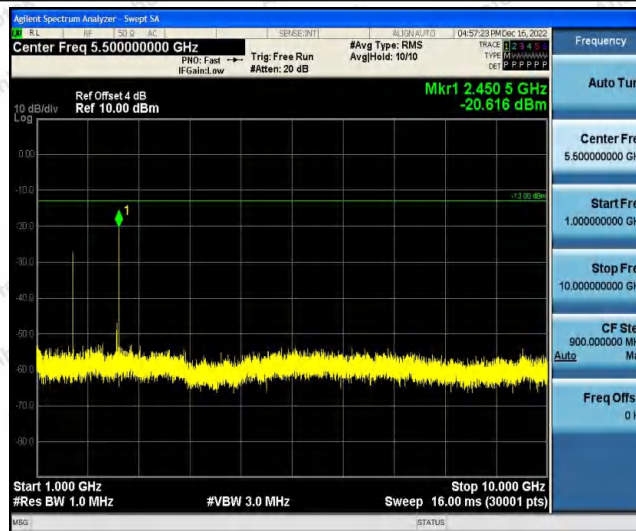

Band26-5MHz-QPSK-26815-1RB#0-Range1:30~1000MHz

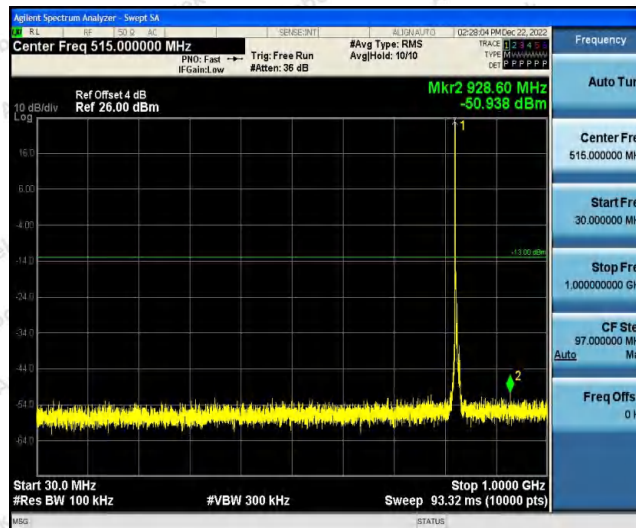

Band26-5MHz-QPSK-26815-1RB#0-Range2:1000~10000MHz

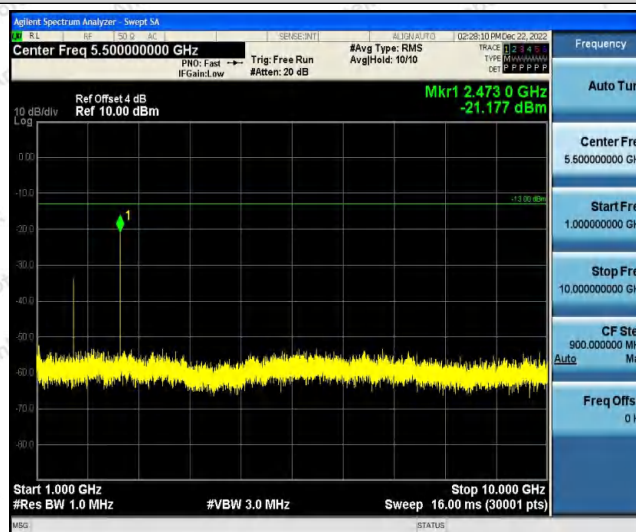

Band26-5MHz-QPSK-26915-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




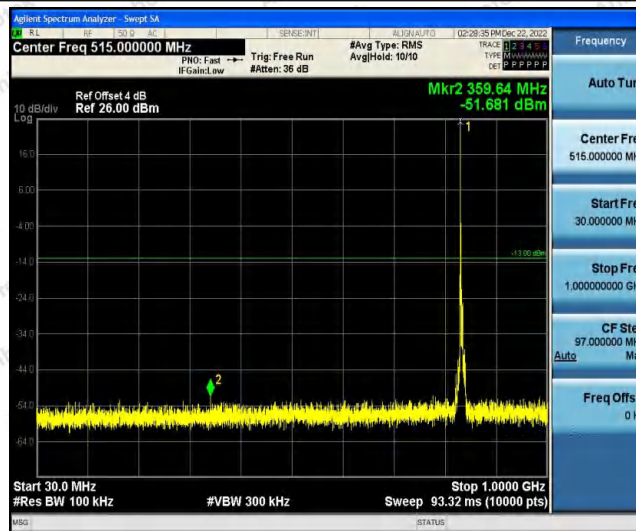

Band26-5MHz-QPSK-26915-1RB#0-Range2:1000~10000MHz

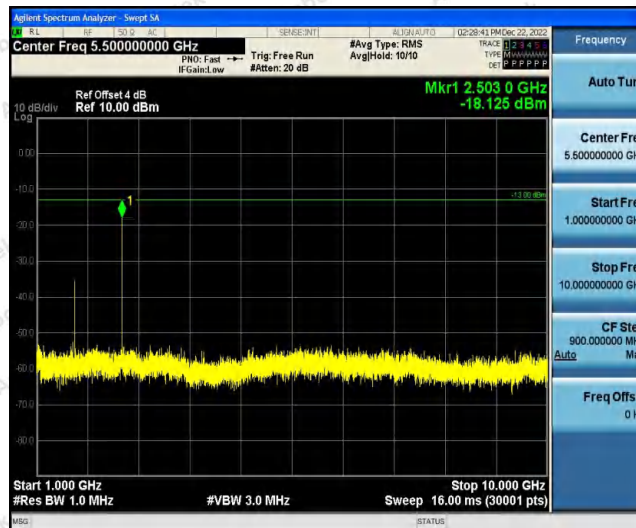

Band26-5MHz-QPSK-27015-1RB#0-Range1:30~1000MHz

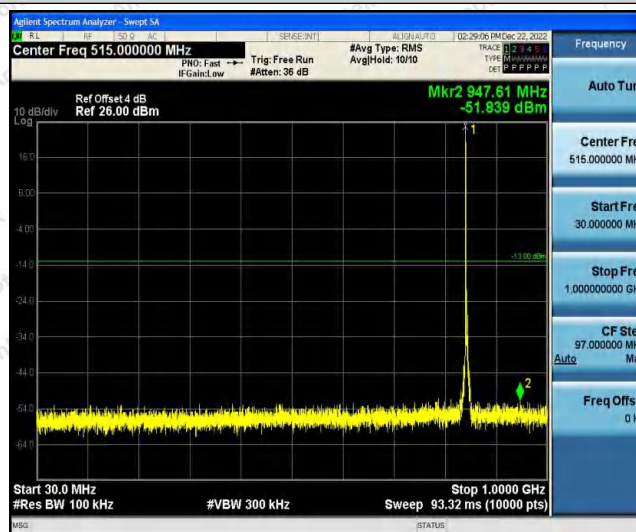

Band26-5MHz-QPSK-27015-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




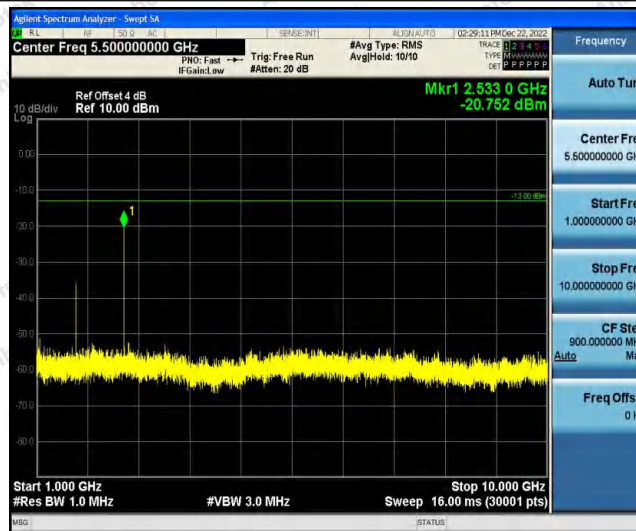

Band26-5MHz-16QAM-26715-1RB#0-Range1:30~1000MHz

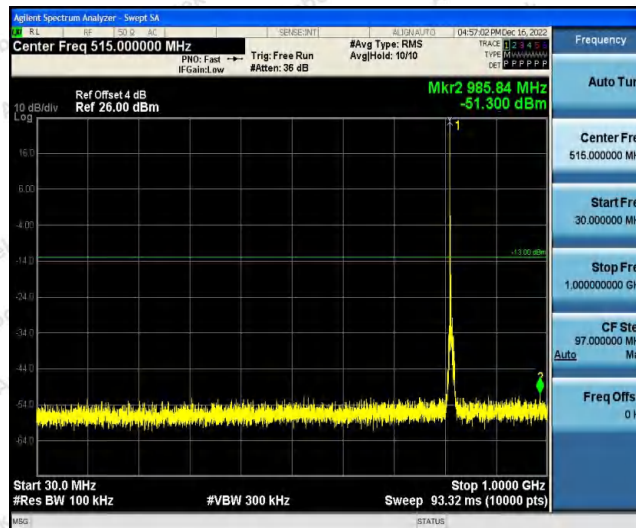

Band26-5MHz-16QAM-26715-1RB#0-Range2:1000~10000MHz

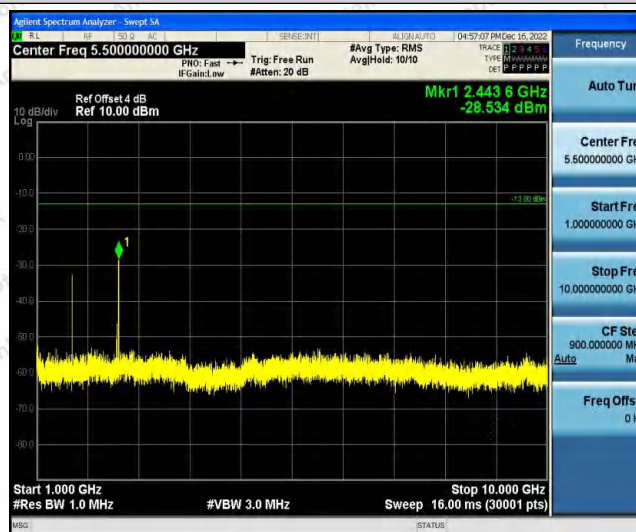

Band26-5MHz-16QAM-26740-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




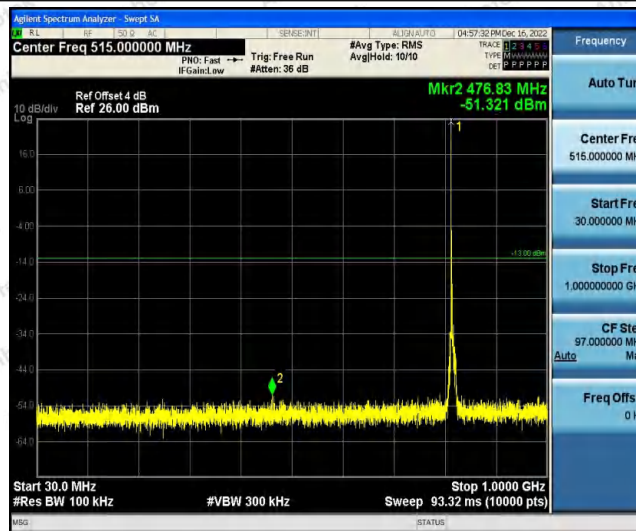

Band26-5MHz-16QAM-26740-1RB#0-Range2:1000~10000MHz

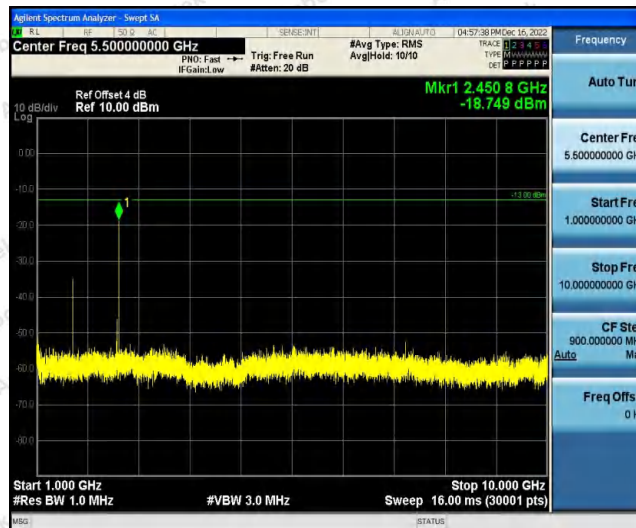

Band26-5MHz-16QAM-26815-1RB#0-Range1:30~1000MHz

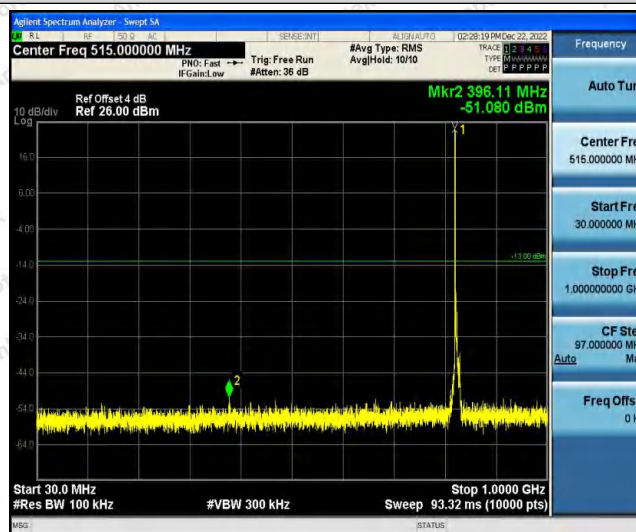

Band26-5MHz-16QAM-26815-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




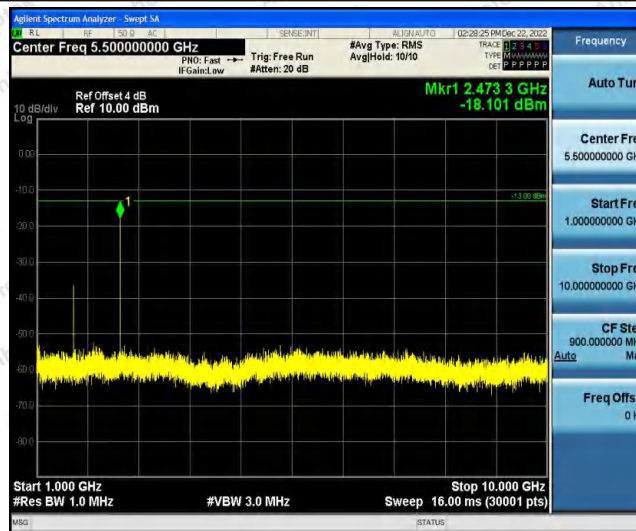

Band26-5MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

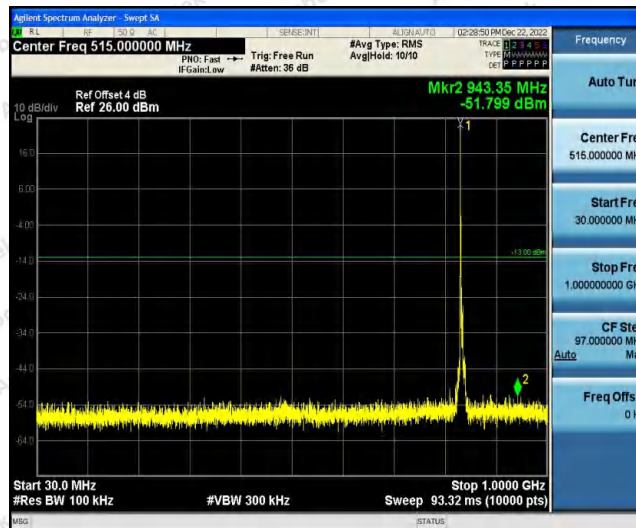

Band26-5MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz

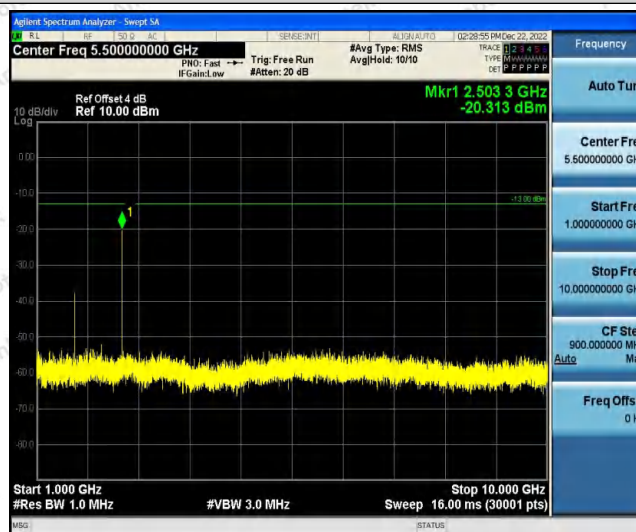

Band26-5MHz-16QAM-27015-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




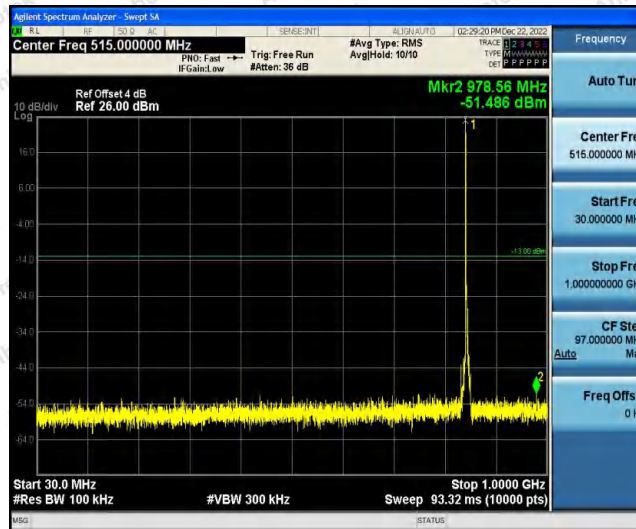

Band26-5MHz-16QAM-27015-1RB#0-Range2:1000~10000MHz

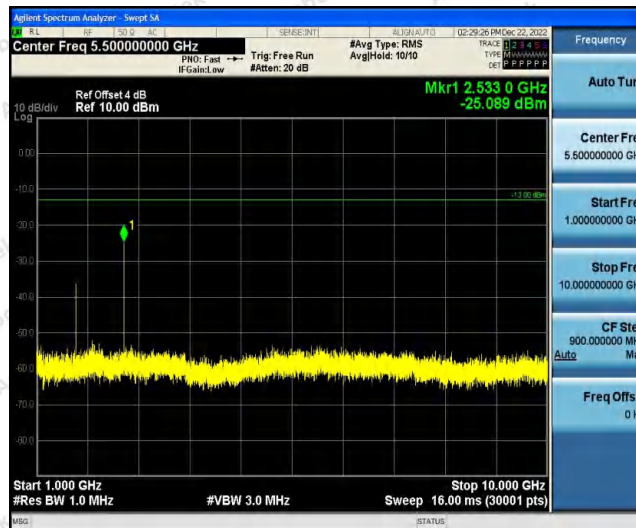

Band26-10MHz-QPSK-26740-1RB#0-Range1:30~1000MHz

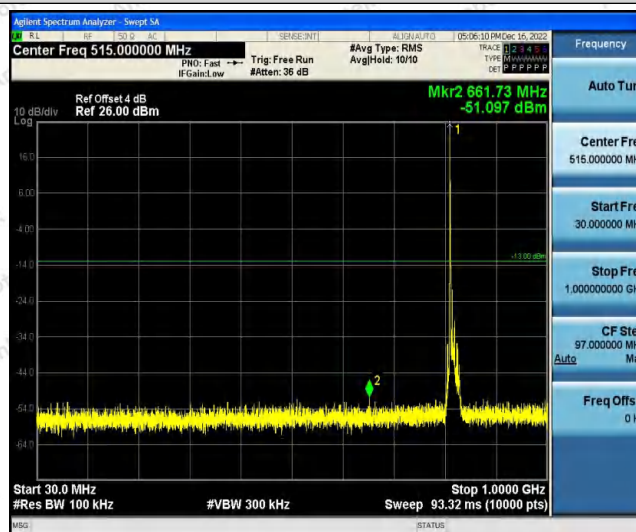

Band26-10MHz-QPSK-26740-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




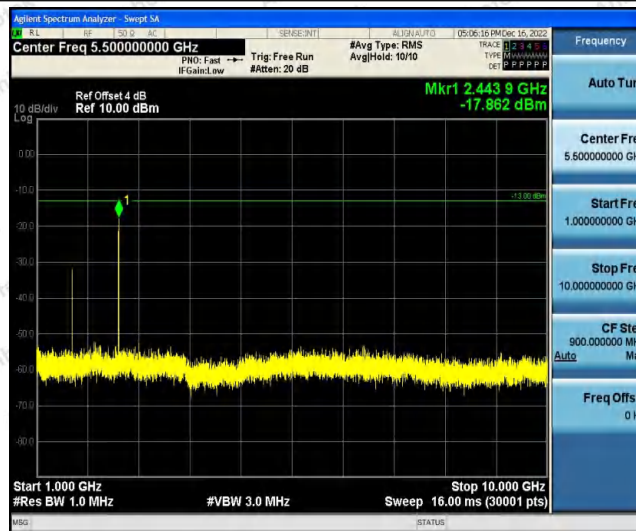

Band26-10MHz-QPSK-26840-1RB#0-Range1:30~1000MHz

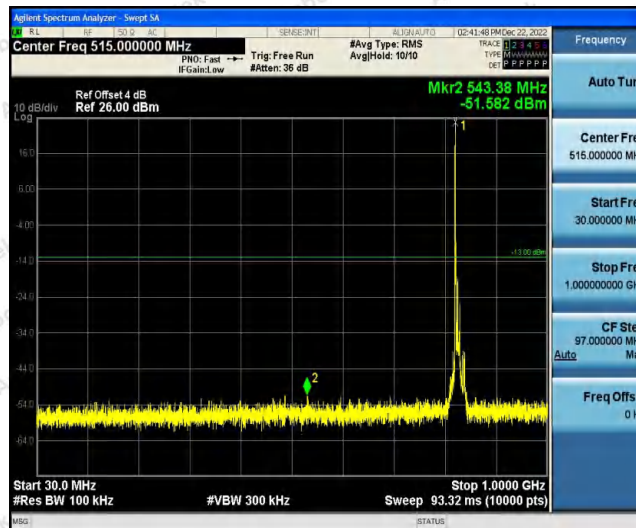

Band26-10MHz-QPSK-26840-1RB#0-Range2:1000~10000MHz

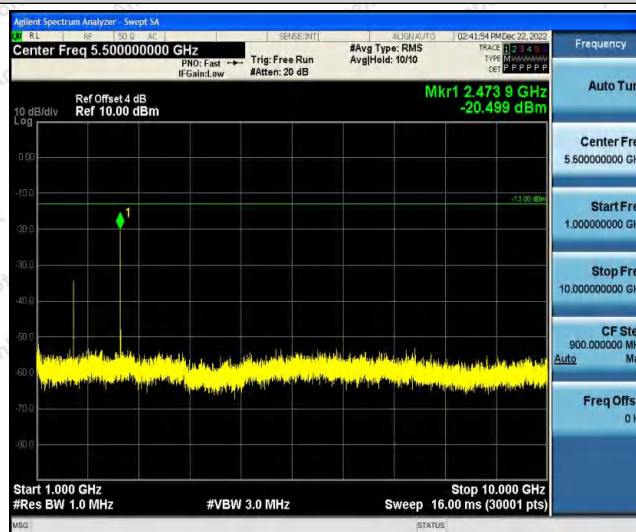

Band26-10MHz-QPSK-26915-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




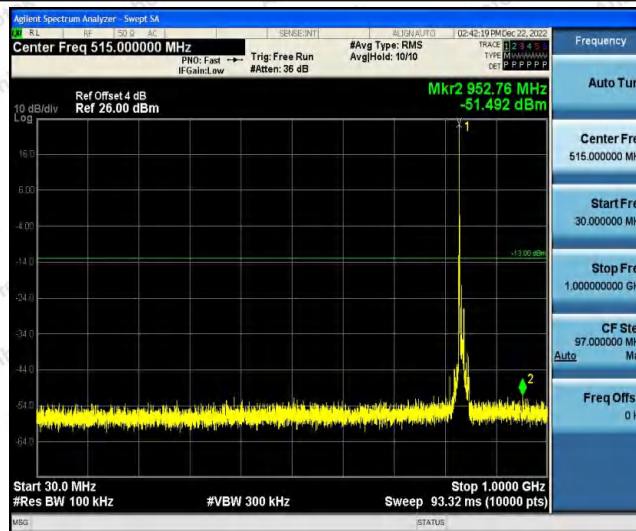

Band26-10MHz-QPSK-26915-1RB#0-Range2:1000~10000MHz

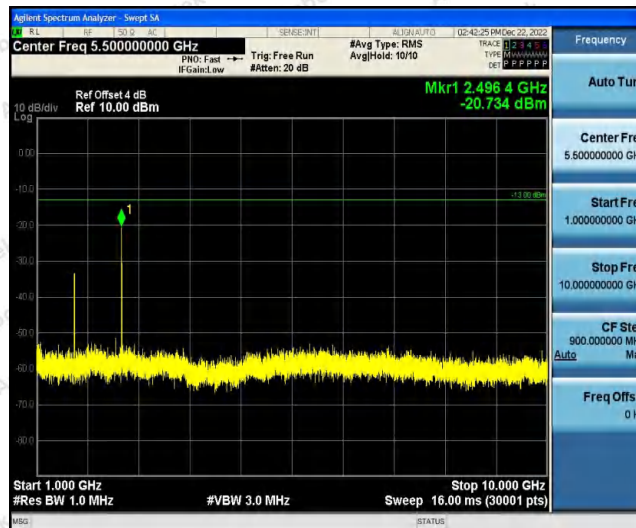

Band26-10MHz-QPSK-26990-1RB#0-Range1:30~1000MHz

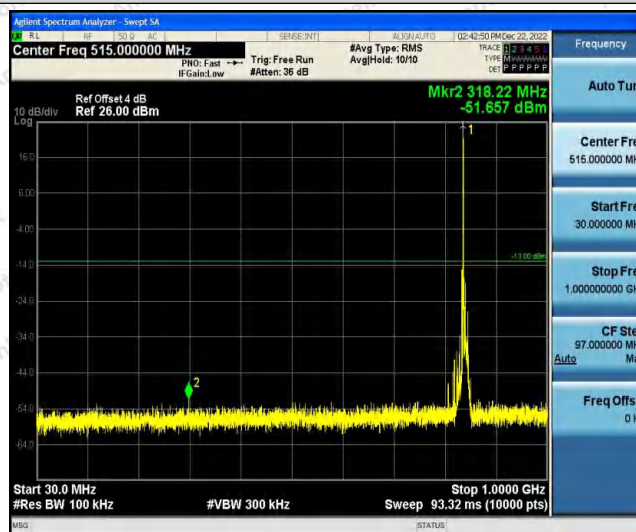

Band26-10MHz-QPSK-26990-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




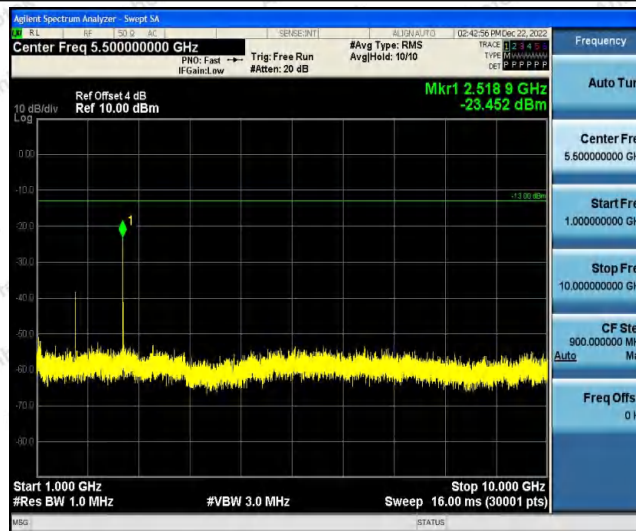

Band26-10MHz-16QAM-26740-1RB#0-Range1:30~1000MHz

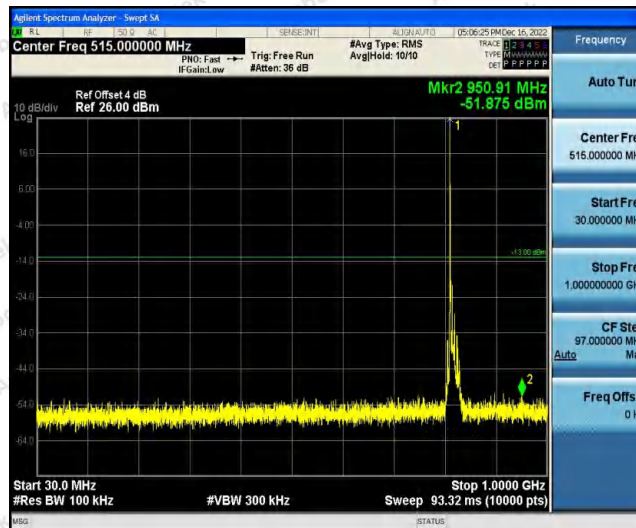

Band26-10MHz-16QAM-26740-1RB#0-Range2:1000~10000MHz

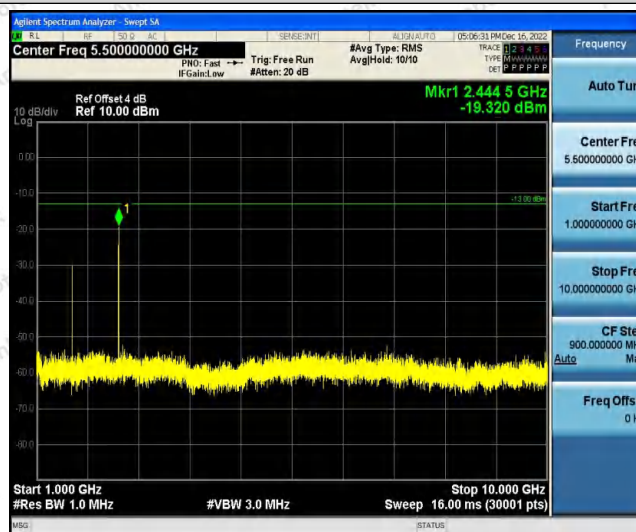

Band26-10MHz-16QAM-26840-1RB#0-Range1:30~1000MHz

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn






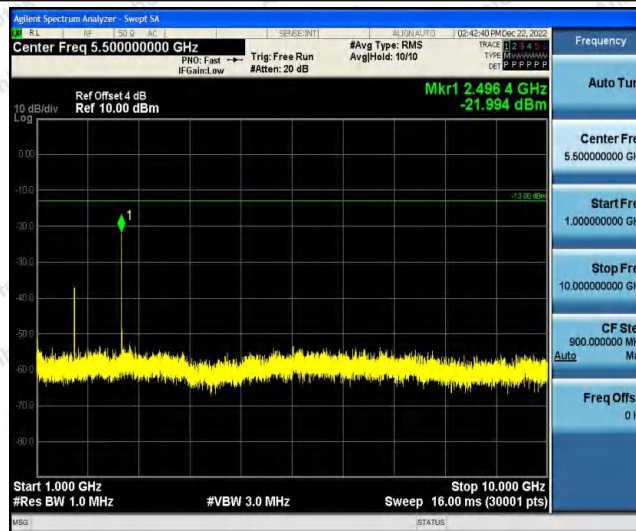

Band26-10MHz-16QAM-26990-1RB#0-Range1:30~1000MHz

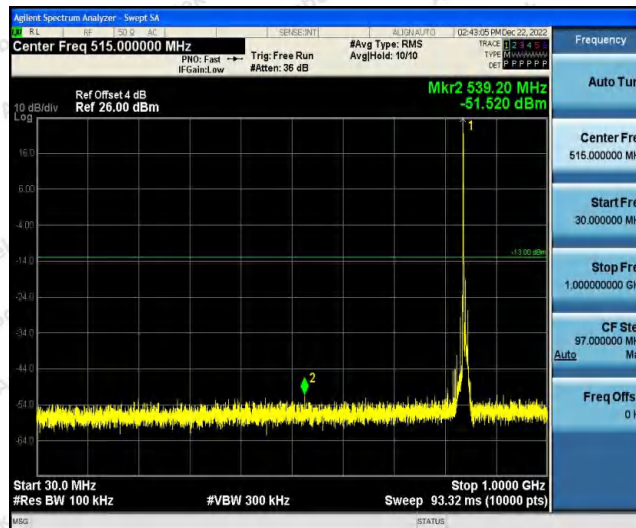

Band26-10MHz-16QAM-26990-1RB#0-Range2:1000~10000MHz

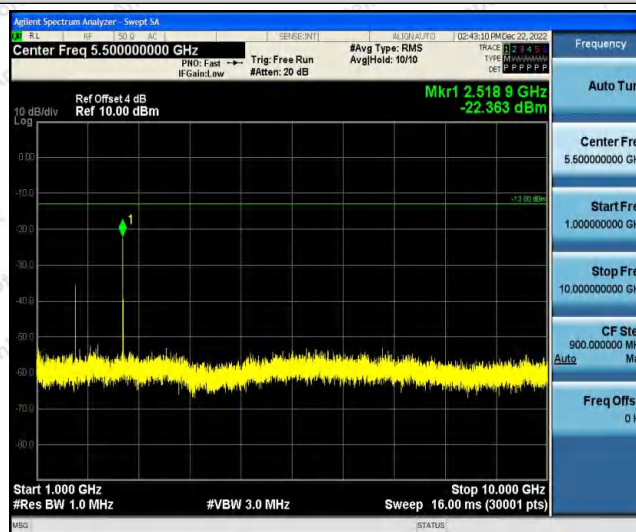

Band26-15MHz-QPSK-26865-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




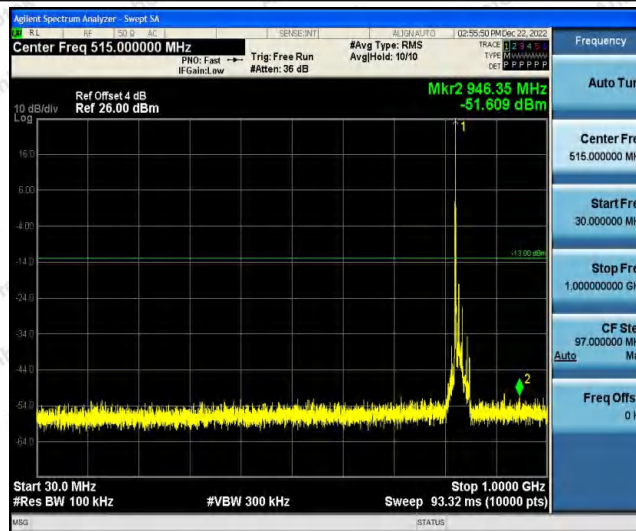

Band26-15MHz-QPSK-26865-1RB#0-Range2:1000~10000MHz

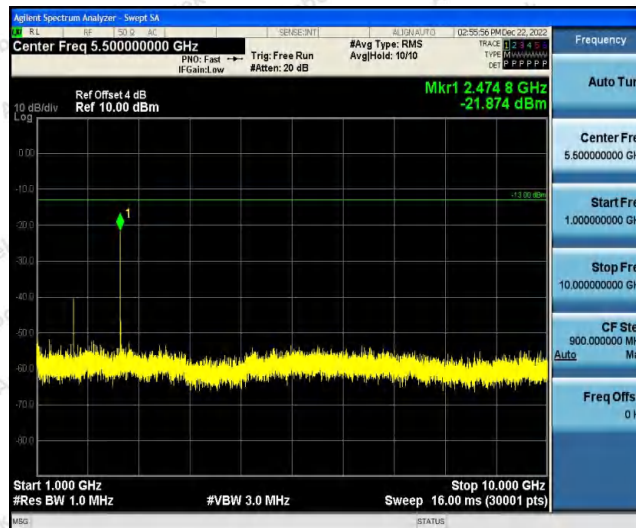

Band26-15MHz-QPSK-26915-1RB#0-Range1:30~1000MHz

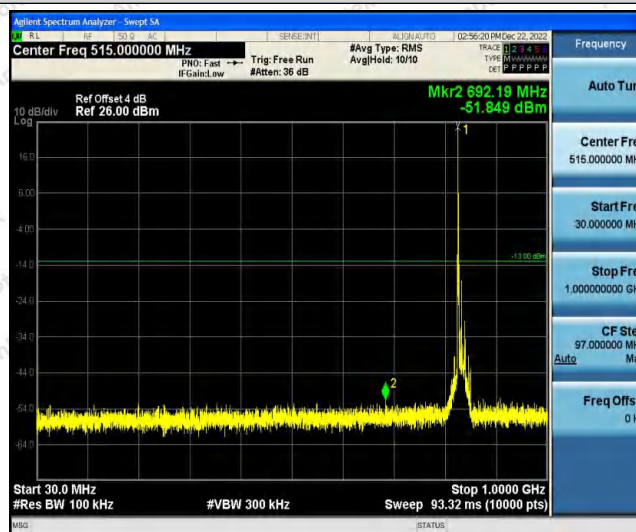

Band26-15MHz-QPSK-26915-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




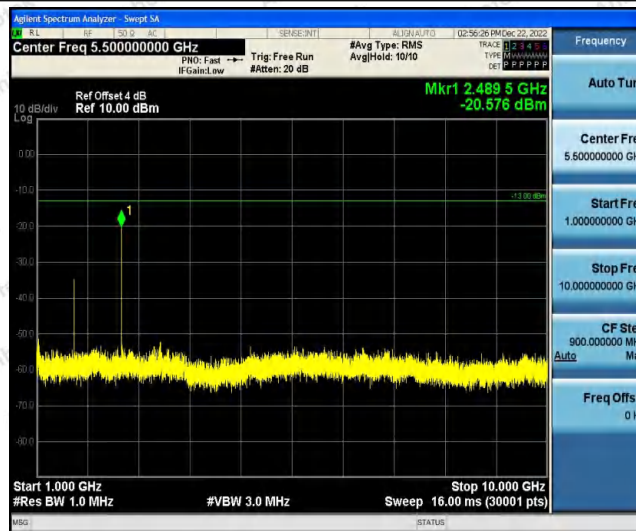

Band26-15MHz-QPSK-26965-1RB#0-Range1:30~1000MHz

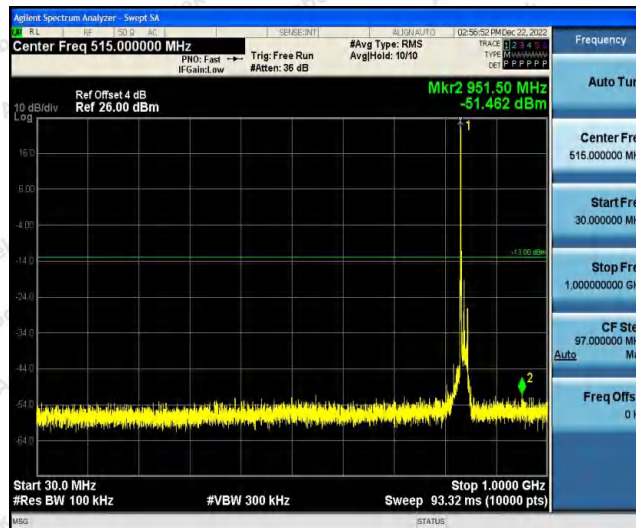

Band26-15MHz-QPSK-26965-1RB#0-Range2:1000~10000MHz

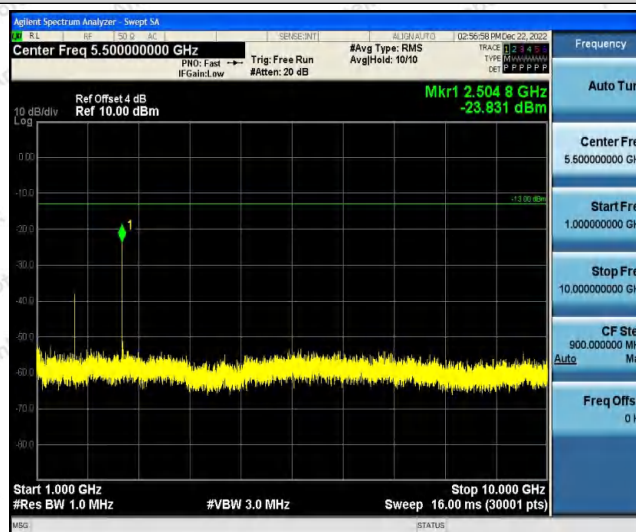

Band26-15MHz-16QAM-26865-1RB#0-Range1:30~1000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




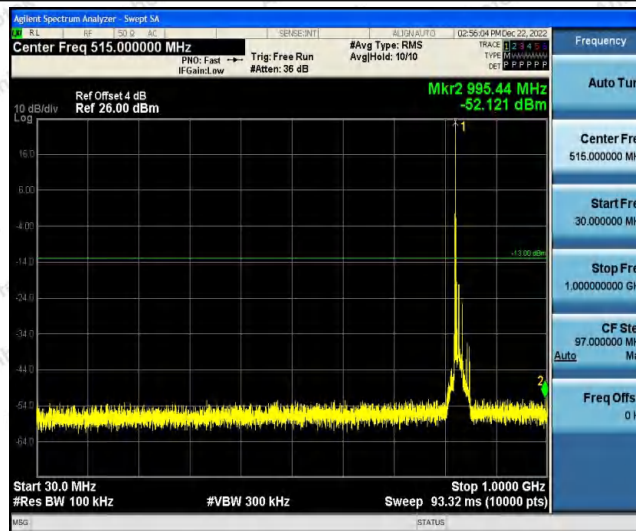

Band26-15MHz-16QAM-26865-1RB#0-Range2:1000~10000MHz

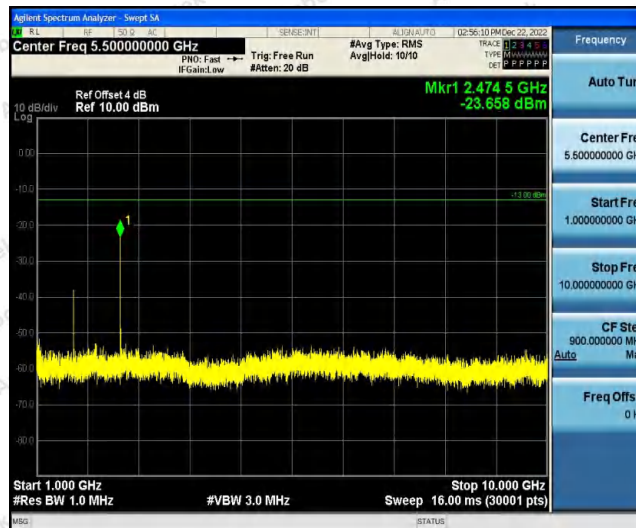

Band26-15MHz-16QAM-26915-1RB#0-Range1:30~1000MHz

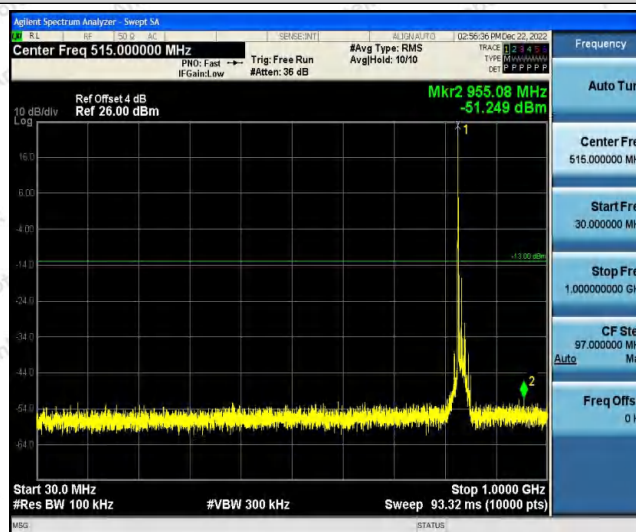

Band26-15MHz-16QAM-26915-1RB#0-Range2:1000~10000MHz


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
400-003-0500  
www.anbotek.com.cn




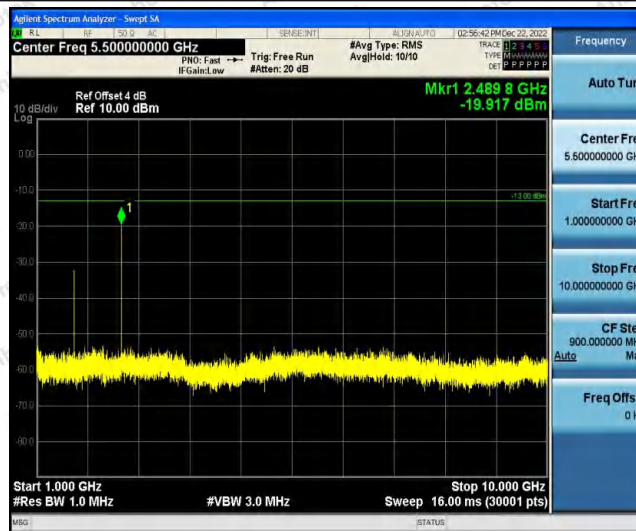

Band26-15MHz-16QAM-26965-1RB#0-Range1:30~1000MHz

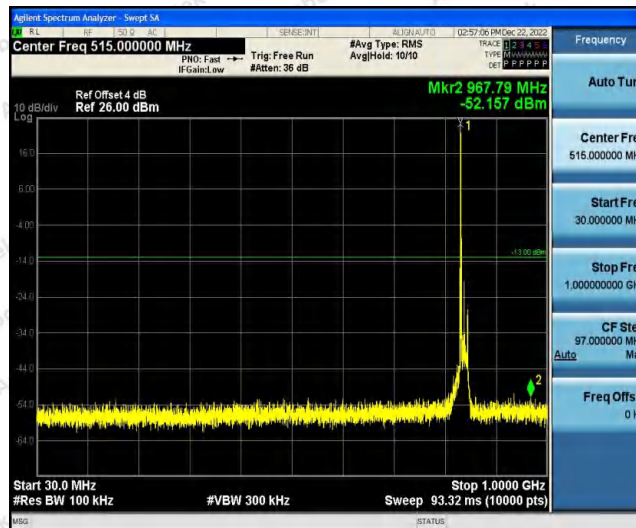

Band26-15MHz-16QAM-26965-1RB#0-Range2:1000~10000MHz

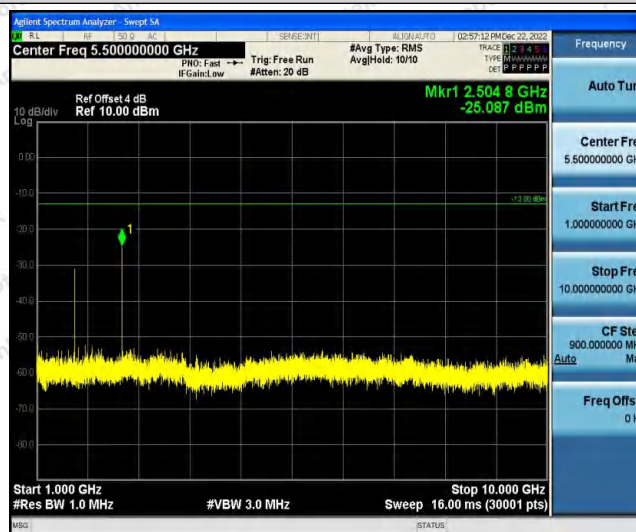

## Appendix F: Frequency stability VS Voltage measurement

### Test Result

| Band    | Bandwidth | Modulation | Channel | RB Configure | Voltage       |                  | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|---------|-----------|------------|---------|--------------|---------------|------------------|----------------|-----------------|-------------|---------|
|         |           |            |         |              | Voltage [Vdc] | Temperature (°C) |                |                 |             |         |
| Band2_6 | 1.4MHz    | QPSK       | 26697   | 6RB#0        | VL            | NT               | -16.49         | -0.020241       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26697   | 6RB#0        | VN            | NT               | -8.64          | -0.010605       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26697   | 6RB#0        | VH            | NT               | -10.84         | -0.013306       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26740   | 6RB#0        | VL            | NT               | -16.41         | -0.020037       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26740   | 6RB#0        | VN            | NT               | 2.27           | 0.002772        | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26740   | 6RB#0        | VH            | NT               | -11.66         | -0.014237       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26783   | 6RB#0        | VL            | NT               | -15.15         | -0.018402       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26783   | 6RB#0        | VN            | NT               | 7.34           | 0.008915        | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26783   | 6RB#0        | VH            | NT               | -5.41          | -0.006571       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26797   | 6RB#0        | VL            | NT               | -13.80         | -0.016733       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26797   | 6RB#0        | VN            | NT               | -5.76          | -0.006984       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26797   | 6RB#0        | VH            | NT               | -13.55         | -0.016430       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26915   | 6RB#0        | VL            | NT               | -13.23         | -0.015816       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26915   | 6RB#0        | VN            | NT               | 8.03           | 0.009600        | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 26915   | 6RB#0        | VH            | NT               | -12.07         | -0.014429       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 27033   | 6RB#0        | VL            | NT               | -14.08         | -0.016598       | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 27033   | 6RB#0        | VN            | NT               | 6.15           | 0.007250        | ±2.5        | PASS    |
| Band2_6 | 1.4MHz    | QPSK       | 27033   | 6RB#0        | VH            | NT               | -14.96         | -0.017635       | ±2.5        | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|            |        |       |       |        |    |    |        |           |      |      |
|------------|--------|-------|-------|--------|----|----|--------|-----------|------|------|
| 6          |        |       |       |        |    |    |        |           |      |      |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0  | VL | NT | -13.07 | -0.016043 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0  | VN | NT | -10.97 | -0.013465 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0  | VH | NT | -4.59  | -0.005634 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0  | VL | NT | -4.43  | -0.005409 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0  | VN | NT | -8.11  | -0.009902 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0  | VH | NT | -13.93 | -0.017009 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | VL | NT | -9.54  | -0.011588 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | VN | NT | -8.94  | -0.010859 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | VH | NT | -13.79 | -0.016750 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | VL | NT | 3.19   | 0.003868  | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | VN | NT | -14.42 | -0.017485 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | VH | NT | -14.43 | -0.017497 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | VL | NT | -8.54  | -0.010209 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | VN | NT | -8.43  | -0.010078 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | VH | NT | -1.69  | -0.002020 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | VL | NT | 4.99   | 0.005882  | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | VN | NT | -13.52 | -0.015938 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | VH | NT | -17.05 | -0.020099 | ±2.5 | PASS |
| Band2<br>6 | 3MHz   | QPSK  | 26705 | 15RB#0 | VL | NT | -7.87  | -0.009651 | ±2.5 | PASS |
| Band2<br>6 | 3MHz   | QPSK  | 26705 | 15RB#0 | VN | NT | 6.65   | 0.008155  | ±2.5 | PASS |
| Band2<br>6 | 3MHz   | QPSK  | 26705 | 15RB#0 | VH | NT | -1.65  | -0.002023 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |      |       |       |        |    |    |        |           |      |      |
|------------|------|-------|-------|--------|----|----|--------|-----------|------|------|
| Band2<br>6 | 3MHz | QPSK  | 26740 | 15RB#0 | VL | NT | -10.74 | -0.013114 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26740 | 15RB#0 | VN | NT | -8.45  | -0.010317 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26740 | 15RB#0 | VH | NT | -6.18  | -0.007546 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26775 | 15RB#0 | VL | NT | -6.31  | -0.007672 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26775 | 15RB#0 | VN | NT | -9.91  | -0.012049 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26775 | 15RB#0 | VH | NT | -12.04 | -0.014638 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26805 | 15RB#0 | VL | NT | -12.02 | -0.014561 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26805 | 15RB#0 | VN | NT | 7.05   | 0.008540  | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26805 | 15RB#0 | VH | NT | -6.27  | -0.007595 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26915 | 15RB#0 | VL | NT | -11.22 | -0.013413 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26915 | 15RB#0 | VN | NT | 7.84   | 0.009372  | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26915 | 15RB#0 | VH | NT | -14.72 | -0.017597 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | VL | NT | -11.49 | -0.013558 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | VN | NT | -3.83  | -0.004519 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | VH | NT | -13.83 | -0.016319 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | VL | NT | -9.71  | -0.011907 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | VN | NT | -11.70 | -0.014347 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | VH | NT | -4.95  | -0.006070 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | VL | NT | -11.70 | -0.014286 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | VN | NT | -9.24  | -0.011282 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | VH | NT | -4.01  | -0.004896 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | VL | NT | -9.00  | -0.010942 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|            |      |       |       |        |    |    |        |           |      |      |
|------------|------|-------|-------|--------|----|----|--------|-----------|------|------|
| 6          |      |       |       |        |    |    |        |           |      |      |
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | VN | NT | -11.56 | -0.014055 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | VH | NT | -9.44  | -0.011477 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | VL | NT | -13.98 | -0.016935 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | VN | NT | -8.93  | -0.010818 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | VH | NT | -7.44  | -0.009013 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | VL | NT | -11.49 | -0.013736 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | VN | NT | -15.03 | -0.017968 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | VH | NT | -3.75  | -0.004483 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | VL | NT | -11.40 | -0.013451 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | VN | NT | -14.83 | -0.017499 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | VH | NT | -3.79  | -0.004472 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | VL | NT | -7.01  | -0.008585 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | VN | NT | -12.12 | -0.014844 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | VH | NT | -10.21 | -0.012505 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26740 | 25RB#0 | VL | NT | -10.59 | -0.012930 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26740 | 25RB#0 | VN | NT | -6.65  | -0.008120 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26740 | 25RB#0 | VH | NT | -8.10  | -0.009890 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | VL | NT | -7.84  | -0.009486 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | VN | NT | -11.17 | -0.013515 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | VH | NT | -10.79 | -0.013055 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26915 | 25RB#0 | VL | NT | -6.37  | -0.007615 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |       |       |       |        |    |    |        |           |      |      |
|------------|-------|-------|-------|--------|----|----|--------|-----------|------|------|
| Band2<br>6 | 5MHz  | QPSK  | 26915 | 25RB#0 | VN | NT | -14.08 | -0.016832 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | QPSK  | 26915 | 25RB#0 | VH | NT | -16.59 | -0.019833 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | QPSK  | 27015 | 25RB#0 | VL | NT | -11.74 | -0.013869 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | QPSK  | 27015 | 25RB#0 | VN | NT | -8.68  | -0.010254 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | QPSK  | 27015 | 25RB#0 | VH | NT | -5.92  | -0.006994 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26715 | 25RB#0 | VL | NT | -11.53 | -0.014121 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26715 | 25RB#0 | VN | NT | -10.56 | -0.012933 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26715 | 25RB#0 | VH | NT | -10.70 | -0.013105 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26740 | 25RB#0 | VL | NT | -6.09  | -0.007436 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26740 | 25RB#0 | VN | NT | -8.67  | -0.010586 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26740 | 25RB#0 | VH | NT | -4.85  | -0.005922 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26815 | 25RB#0 | VL | NT | -9.77  | -0.011821 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26815 | 25RB#0 | VN | NT | -11.33 | -0.013708 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26815 | 25RB#0 | VH | NT | -11.62 | -0.014059 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26915 | 25RB#0 | VL | NT | -14.22 | -0.016999 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26915 | 25RB#0 | VN | NT | -8.61  | -0.010293 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 26915 | 25RB#0 | VH | NT | -4.25  | -0.005081 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 27015 | 25RB#0 | VL | NT | -11.73 | -0.013857 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 27015 | 25RB#0 | VN | NT | -8.60  | -0.010159 | ±2.5 | PASS |
| Band2<br>6 | 5MHz  | 16QAM | 27015 | 25RB#0 | VH | NT | -9.08  | -0.010727 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | VL | NT | -11.39 | -0.013907 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | VN | NT | -10.00 | -0.012210 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|            |       |       |       |        |    |    |        |           |      |      |
|------------|-------|-------|-------|--------|----|----|--------|-----------|------|------|
| 6          |       |       |       |        |    |    |        |           |      |      |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | VH | NT | -4.36  | -0.005324 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | VL | NT | -13.39 | -0.016152 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | VN | NT | -12.19 | -0.014704 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | VH | NT | -9.63  | -0.011616 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | VL | NT | -11.87 | -0.014190 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | VN | NT | -11.04 | -0.013198 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | VH | NT | -11.29 | -0.013497 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | VL | NT | -12.02 | -0.014242 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | VN | NT | -3.00  | -0.003555 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | VH | NT | -4.63  | -0.005486 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | VL | NT | -7.52  | -0.009182 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | VN | NT | -10.89 | -0.013297 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | VH | NT | -13.30 | -0.016239 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | VL | NT | -11.04 | -0.013317 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | VN | NT | -5.28  | -0.006369 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | VH | NT | -12.20 | -0.014717 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | VL | NT | -11.96 | -0.014298 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | VN | NT | -11.07 | -0.013234 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | VH | NT | -9.86  | -0.011787 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | VL | NT | -10.94 | -0.012962 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | VN | NT | -13.55 | -0.016055 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |       |       |       |        |    |    |        |           |      |      |
|------------|-------|-------|-------|--------|----|----|--------|-----------|------|------|
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | VH | NT | -18.34 | -0.021730 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26865 | 75RB#0 | VL | NT | -10.66 | -0.012820 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26865 | 75RB#0 | VN | NT | -11.14 | -0.013397 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26865 | 75RB#0 | VH | NT | -12.92 | -0.015538 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | VL | NT | -13.95 | -0.016677 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | VN | NT | -9.23  | -0.011034 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | VH | NT | -7.78  | -0.009301 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | VL | NT | -7.97  | -0.009471 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | VN | NT | -13.95 | -0.016578 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | VH | NT | -9.24  | -0.010980 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | VL | NT | -6.01  | -0.007228 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | VN | NT | -9.71  | -0.011678 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | VH | NT | -9.87  | -0.011870 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | VL | NT | -12.47 | -0.014907 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | VN | NT | -11.47 | -0.013712 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | VH | NT | -12.47 | -0.014907 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | VL | NT | -11.83 | -0.014058 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | VN | NT | -16.79 | -0.019952 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | VH | NT | -1.79  | -0.002127 | ±2.5 | PASS |



## Appendix G: Frequency stability VS Temperature measurement

### Test Result

| Temperature |           |            |         |                  |               |                  |                |                 |             |         |
|-------------|-----------|------------|---------|------------------|---------------|------------------|----------------|-----------------|-------------|---------|
| Band        | Bandwidth | Modulation | Channel | RB Configuration | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| Band2<br>6  | 1.4MHz    | QPSK       | 26697   | 6RB#0            | NV            | -30              | -14.33         | -0.017589       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26697   | 6RB#0            | NV            | -20              | -15.22         | -0.018682       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26697   | 6RB#0            | NV            | 0                | -13.29         | -0.016313       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26697   | 6RB#0            | NV            | 10               | -11.30         | -0.013870       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26697   | 6RB#0            | NV            | 20               | -12.06         | -0.014803       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26740   | 6RB#0            | NV            | -30              | -8.01          | -0.009780       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26740   | 6RB#0            | NV            | -20              | -2.98          | -0.003639       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26740   | 6RB#0            | NV            | 0                | -5.82          | -0.007106       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26740   | 6RB#0            | NV            | 10               | -6.29          | -0.007680       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26740   | 6RB#0            | NV            | 20               | -6.37          | -0.007778       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26783   | 6RB#0            | NV            | -30              | -8.74          | -0.010616       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26783   | 6RB#0            | NV            | -20              | -5.32          | -0.006462       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26783   | 6RB#0            | NV            | 0                | -10.37         | -0.012596       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26783   | 6RB#0            | NV            | 10               | -11.01         | -0.013373       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26783   | 6RB#0            | NV            | 20               | -10.17         | -0.012353       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26797   | 6RB#0            | NV            | -30              | -7.37          | -0.008937       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26797   | 6RB#0            | NV            | -20              | -14.29         | -0.017328       | ±2.5        | PASS    |
| Band2<br>6  | 1.4MHz    | QPSK       | 26797   | 6RB#0            | NV            | 0                | -9.33          | -0.011313       | ±2.5        | PASS    |

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



|            |        |       |       |       |    |     |        |           |      |      |
|------------|--------|-------|-------|-------|----|-----|--------|-----------|------|------|
| Band2<br>6 | 1.4MHz | QPSK  | 26797 | 6RB#0 | NV | 10  | -5.56  | -0.006742 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 26797 | 6RB#0 | NV | 20  | -6.15  | -0.007457 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 26915 | 6RB#0 | NV | -30 | -14.33 | -0.017131 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 26915 | 6RB#0 | NV | -20 | -12.06 | -0.014417 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 26915 | 6RB#0 | NV | 0   | -11.47 | -0.013712 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 26915 | 6RB#0 | NV | 10  | -13.12 | -0.015684 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 26915 | 6RB#0 | NV | 20  | 2.45   | 0.002929  | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 27033 | 6RB#0 | NV | -30 | -12.99 | -0.015313 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 27033 | 6RB#0 | NV | -20 | -15.35 | -0.018095 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 27033 | 6RB#0 | NV | 0   | -4.53  | -0.005340 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 27033 | 6RB#0 | NV | 10  | -6.59  | -0.007768 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | QPSK  | 27033 | 6RB#0 | NV | 20  | -12.80 | -0.015089 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0 | NV | -30 | -5.54  | -0.006800 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0 | NV | -20 | -2.76  | -0.003388 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0 | NV | 0   | -4.35  | -0.005339 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0 | NV | 10  | 1.59   | 0.001952  | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26697 | 6RB#0 | NV | 20  | -6.04  | -0.007414 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0 | NV | -30 | -12.57 | -0.015348 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0 | NV | -20 | -11.84 | -0.014457 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0 | NV | 0   | -8.88  | -0.010842 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0 | NV | 10  | -5.46  | -0.006667 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26740 | 6RB#0 | NV | 20  | -5.34  | -0.006520 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |        |       |       |        |    |     |        |           |      |      |
|------------|--------|-------|-------|--------|----|-----|--------|-----------|------|------|
| 6          |        |       |       |        |    |     |        |           |      |      |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | NV | -30 | -3.52  | -0.004275 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | NV | -20 | -13.80 | -0.016762 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | NV | 0   | -6.65  | -0.008077 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | NV | 10  | -10.97 | -0.013324 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26783 | 6RB#0  | NV | 20  | -11.17 | -0.013567 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | NV | -30 | -13.50 | -0.016370 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | NV | -20 | -2.26  | -0.002740 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | NV | 0   | -10.50 | -0.012732 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | NV | 10  | -13.02 | -0.015788 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26797 | 6RB#0  | NV | 20  | -8.77  | -0.010634 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | NV | -30 | -10.09 | -0.012062 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | NV | -20 | -2.76  | -0.003299 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | NV | 0   | -7.27  | -0.008691 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | NV | 10  | -9.03  | -0.010795 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 26915 | 6RB#0  | NV | 20  | -11.96 | -0.014298 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | NV | -30 | -13.78 | -0.016244 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | NV | -20 | -15.72 | -0.018531 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | NV | 0   | -7.07  | -0.008334 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | NV | 10  | -9.78  | -0.011529 | ±2.5 | PASS |
| Band2<br>6 | 1.4MHz | 16QAM | 27033 | 6RB#0  | NV | 20  | -13.00 | -0.015325 | ±2.5 | PASS |
| Band2<br>6 | 3MHz   | QPSK  | 26705 | 15RB#0 | NV | -30 | -6.88  | -0.008437 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |      |      |       |        |    |     |        |           |      |      |
|------------|------|------|-------|--------|----|-----|--------|-----------|------|------|
| Band2<br>6 | 3MHz | QPSK | 26705 | 15RB#0 | NV | -20 | -10.76 | -0.013194 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26705 | 15RB#0 | NV | 0   | -9.20  | -0.011281 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26705 | 15RB#0 | NV | 10  | -10.24 | -0.012557 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26705 | 15RB#0 | NV | 20  | -8.31  | -0.010190 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26740 | 15RB#0 | NV | -30 | -10.97 | -0.013394 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26740 | 15RB#0 | NV | -20 | -14.02 | -0.017118 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26740 | 15RB#0 | NV | 0   | -8.04  | -0.009817 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26740 | 15RB#0 | NV | 10  | -10.00 | -0.012210 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26740 | 15RB#0 | NV | 20  | -7.11  | -0.008681 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26775 | 15RB#0 | NV | -30 | -11.13 | -0.013532 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26775 | 15RB#0 | NV | -20 | -15.05 | -0.018298 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26775 | 15RB#0 | NV | 0   | -12.33 | -0.014991 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26775 | 15RB#0 | NV | 10  | -9.34  | -0.011356 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26775 | 15RB#0 | NV | 20  | -13.62 | -0.016559 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26805 | 15RB#0 | NV | -30 | -13.00 | -0.015748 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26805 | 15RB#0 | NV | -20 | -11.44 | -0.013858 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26805 | 15RB#0 | NV | 0   | -16.49 | -0.019976 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26805 | 15RB#0 | NV | 10  | -9.48  | -0.011484 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26805 | 15RB#0 | NV | 20  | -10.13 | -0.012271 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26915 | 15RB#0 | NV | -30 | -2.06  | -0.002463 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26915 | 15RB#0 | NV | -20 | -12.32 | -0.014728 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK | 26915 | 15RB#0 | NV | 0   | -4.56  | -0.005451 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |      |       |       |        |    |     |        |           |      |      |
|------------|------|-------|-------|--------|----|-----|--------|-----------|------|------|
| 6          |      |       |       |        |    |     |        |           |      |      |
| Band2<br>6 | 3MHz | QPSK  | 26915 | 15RB#0 | NV | 10  | -16.39 | -0.019594 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 26915 | 15RB#0 | NV | 20  | -8.30  | -0.009922 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | NV | -30 | -3.85  | -0.004543 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | NV | -20 | -10.84 | -0.012791 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | NV | 0   | -7.01  | -0.008271 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | NV | 10  | -11.10 | -0.013097 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | QPSK  | 27025 | 15RB#0 | NV | 20  | -13.18 | -0.015552 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | NV | -30 | -11.64 | -0.014273 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | NV | -20 | -10.87 | -0.013329 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | NV | 0   | -11.42 | -0.014004 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | NV | 10  | -8.70  | -0.010668 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26705 | 15RB#0 | NV | 20  | -14.23 | -0.017449 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | NV | -30 | -10.81 | -0.013199 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | NV | -20 | -8.50  | -0.010379 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | NV | 0   | -0.74  | -0.000904 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | NV | 10  | -13.19 | -0.016105 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26740 | 15RB#0 | NV | 20  | -9.68  | -0.011819 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | NV | -30 | -11.06 | -0.013447 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | NV | -20 | -12.99 | -0.015793 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | NV | 0   | -11.79 | -0.014334 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | NV | 10  | -6.71  | -0.008158 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |      |       |       |        |    |     |        |           |      |      |
|------------|------|-------|-------|--------|----|-----|--------|-----------|------|------|
| Band2<br>6 | 3MHz | 16QAM | 26775 | 15RB#0 | NV | 20  | -10.74 | -0.013058 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | NV | -30 | -14.26 | -0.017274 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | NV | -20 | -9.70  | -0.011750 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | NV | 0   | -12.10 | -0.014658 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | NV | 10  | -13.45 | -0.016293 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26805 | 15RB#0 | NV | 20  | -11.49 | -0.013919 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | NV | -30 | -11.07 | -0.013234 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | NV | -20 | -12.30 | -0.014704 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | NV | 0   | -13.33 | -0.015935 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | NV | 10  | -14.51 | -0.017346 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 26915 | 15RB#0 | NV | 20  | -12.95 | -0.015481 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | NV | -30 | -2.70  | -0.003186 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | NV | -20 | -10.06 | -0.011870 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | NV | 0   | -13.03 | -0.015375 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | NV | 10  | -5.16  | -0.006088 | ±2.5 | PASS |
| Band2<br>6 | 3MHz | 16QAM | 27025 | 15RB#0 | NV | 20  | -10.11 | -0.011929 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | NV | -30 | -13.59 | -0.016644 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | NV | -20 | 2.05   | 0.002511  | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | NV | 0   | -4.68  | -0.005732 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | NV | 10  | -4.86  | -0.005952 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26715 | 25RB#0 | NV | 20  | -10.39 | -0.012725 | ±2.5 | PASS |
| Band2      | 5MHz | QPSK  | 26740 | 25RB#0 | NV | -30 | -6.27  | -0.007656 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |      |       |       |        |    |     |        |           |      |      |
|------------|------|-------|-------|--------|----|-----|--------|-----------|------|------|
| 6          |      |       |       |        |    |     |        |           |      |      |
| Band2<br>6 | 5MHz | QPSK  | 26740 | 25RB#0 | NV | -20 | -5.11  | -0.006239 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26740 | 25RB#0 | NV | 0   | -14.16 | -0.017289 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26740 | 25RB#0 | NV | 10  | -9.70  | -0.011844 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26740 | 25RB#0 | NV | 20  | -7.74  | -0.009451 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | NV | -30 | -12.87 | -0.015572 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | NV | -20 | -13.40 | -0.016213 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | NV | 0   | -4.81  | -0.005820 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | NV | 10  | -13.75 | -0.016636 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26815 | 25RB#0 | NV | 20  | -13.25 | -0.016031 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26915 | 25RB#0 | NV | -30 | -7.98  | -0.009540 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26915 | 25RB#0 | NV | -20 | -15.08 | -0.018027 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26915 | 25RB#0 | NV | 0   | -4.01  | -0.004794 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26915 | 25RB#0 | NV | 10  | 5.75   | 0.006874  | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 26915 | 25RB#0 | NV | 20  | -12.60 | -0.015063 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 27015 | 25RB#0 | NV | -30 | -13.35 | -0.015771 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 27015 | 25RB#0 | NV | -20 | -12.72 | -0.015027 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 27015 | 25RB#0 | NV | 0   | -12.60 | -0.014885 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 27015 | 25RB#0 | NV | 10  | -12.76 | -0.015074 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | QPSK  | 27015 | 25RB#0 | NV | 20  | -10.60 | -0.012522 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26715 | 25RB#0 | NV | -30 | -2.80  | -0.003429 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26715 | 25RB#0 | NV | -20 | -13.49 | -0.016522 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |      |       |       |        |    |     |        |           |      |      |
|------------|------|-------|-------|--------|----|-----|--------|-----------|------|------|
| Band2<br>6 | 5MHz | 16QAM | 26715 | 25RB#0 | NV | 0   | -10.89 | -0.013337 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26715 | 25RB#0 | NV | 10  | -4.43  | -0.005426 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26715 | 25RB#0 | NV | 20  | -5.61  | -0.006871 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26740 | 25RB#0 | NV | -30 | -4.33  | -0.005287 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26740 | 25RB#0 | NV | -20 | -3.23  | -0.003944 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26740 | 25RB#0 | NV | 0   | -10.74 | -0.013114 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26740 | 25RB#0 | NV | 10  | -13.15 | -0.016056 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26740 | 25RB#0 | NV | 20  | -14.46 | -0.017656 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26815 | 25RB#0 | NV | -30 | -16.26 | -0.019673 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26815 | 25RB#0 | NV | -20 | -1.87  | -0.002263 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26815 | 25RB#0 | NV | 0   | -13.73 | -0.016612 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26815 | 25RB#0 | NV | 10  | -8.94  | -0.010817 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26815 | 25RB#0 | NV | 20  | -13.18 | -0.015947 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26915 | 25RB#0 | NV | -30 | -12.89 | -0.015409 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26915 | 25RB#0 | NV | -20 | -13.73 | -0.016414 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26915 | 25RB#0 | NV | 0   | -13.39 | -0.016007 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26915 | 25RB#0 | NV | 10  | -9.78  | -0.011692 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 26915 | 25RB#0 | NV | 20  | -9.48  | -0.011333 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 27015 | 25RB#0 | NV | -30 | -11.76 | -0.013892 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 27015 | 25RB#0 | NV | -20 | -10.53 | -0.012439 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 27015 | 25RB#0 | NV | 0   | -8.18  | -0.009663 | ±2.5 | PASS |
| Band2<br>6 | 5MHz | 16QAM | 27015 | 25RB#0 | NV | 10  | -14.59 | -0.017236 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |       |       |       |        |    |     |        |           |      |      |
|------------|-------|-------|-------|--------|----|-----|--------|-----------|------|------|
| 6          |       |       |       |        |    |     |        |           |      |      |
| Band2<br>6 | 5MHz  | 16QAM | 27015 | 25RB#0 | NV | 20  | -11.01 | -0.013006 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | NV | -30 | -9.81  | -0.011978 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | NV | -20 | -10.93 | -0.013346 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | NV | 0   | -10.90 | -0.013309 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | NV | 10  | -10.41 | -0.012711 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26740 | 50RB#0 | NV | 20  | -9.73  | -0.011880 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | NV | -30 | -11.13 | -0.013426 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | NV | -20 | -10.67 | -0.012871 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | NV | 0   | -14.05 | -0.016948 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | NV | 10  | -9.01  | -0.010869 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26840 | 50RB#0 | NV | 20  | -12.17 | -0.014680 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | NV | -30 | -5.92  | -0.007077 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | NV | -20 | -13.05 | -0.015601 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | NV | 0   | -13.35 | -0.015959 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | NV | 10  | -11.34 | -0.013556 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26915 | 50RB#0 | NV | 20  | -11.01 | -0.013162 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | NV | -30 | -10.49 | -0.012429 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | NV | -20 | -12.25 | -0.014514 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | NV | 0   | -12.19 | -0.014443 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | NV | 10  | -10.49 | -0.012429 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | QPSK  | 26990 | 50RB#0 | NV | 20  | -12.50 | -0.014810 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |       |       |       |        |    |     |        |           |      |      |
|------------|-------|-------|-------|--------|----|-----|--------|-----------|------|------|
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | NV | -30 | -8.81  | -0.010757 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | NV | -20 | -6.29  | -0.007680 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | NV | 0   | -13.07 | -0.015958 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | NV | 10  | -11.99 | -0.014640 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26740 | 50RB#0 | NV | 20  | -5.25  | -0.006410 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | NV | -30 | -3.15  | -0.003800 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | NV | -20 | -5.81  | -0.007008 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | NV | 0   | -11.33 | -0.013667 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | NV | 10  | -5.69  | -0.006864 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26840 | 50RB#0 | NV | 20  | -10.31 | -0.012437 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | NV | -30 | -12.00 | -0.014345 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | NV | -20 | -10.94 | -0.013078 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | NV | 0   | -12.63 | -0.015099 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | NV | 10  | -8.94  | -0.010687 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26915 | 50RB#0 | NV | 20  | -10.64 | -0.012720 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | NV | -30 | -8.37  | -0.009917 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | NV | -20 | -8.27  | -0.009799 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | NV | 0   | -2.33  | -0.002761 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | NV | 10  | -7.55  | -0.008945 | ±2.5 | PASS |
| Band2<br>6 | 10MHz | 16QAM | 26990 | 50RB#0 | NV | 20  | -14.13 | -0.016742 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26865 | 75RB#0 | NV | -30 | -5.02  | -0.006037 | ±2.5 | PASS |
| Band2      | 15MHz | QPSK  | 26865 | 75RB#0 | NV | -20 | -14.75 | -0.017739 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
 400-003-0500  
 www.anbotek.com.cn



|            |       |       |       |        |    |     |        |           |      |      |
|------------|-------|-------|-------|--------|----|-----|--------|-----------|------|------|
| 6          |       |       |       |        |    |     |        |           |      |      |
| Band2<br>6 | 15MHz | QPSK  | 26865 | 75RB#0 | NV | 0   | -10.80 | -0.012989 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26865 | 75RB#0 | NV | 10  | -12.53 | -0.015069 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26865 | 75RB#0 | NV | 20  | -11.49 | -0.013818 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | NV | -30 | -11.14 | -0.013317 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | NV | -20 | -14.03 | -0.016772 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | NV | 0   | -12.95 | -0.015481 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | NV | 10  | -18.24 | -0.021805 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26915 | 75RB#0 | NV | 20  | -3.72  | -0.004447 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | NV | -30 | -8.13  | -0.009661 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | NV | -20 | -13.70 | -0.016280 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | NV | 0   | -12.20 | -0.014498 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | NV | 10  | -9.43  | -0.011206 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | QPSK  | 26965 | 75RB#0 | NV | 20  | -11.23 | -0.013345 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | NV | -30 | -8.38  | -0.010078 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | NV | -20 | -12.25 | -0.014732 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | NV | 0   | -14.26 | -0.017150 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | NV | 10  | -11.30 | -0.013590 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26865 | 75RB#0 | NV | 20  | -14.53 | -0.017474 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | NV | -30 | -11.74 | -0.014035 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | NV | -20 | -11.83 | -0.014142 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | NV | 0   | -9.63  | -0.011512 | ±2.5 | PASS |

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



|            |       |       |       |        |    |     |        |           |      |      |
|------------|-------|-------|-------|--------|----|-----|--------|-----------|------|------|
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | NV | 10  | -15.96 | -0.019079 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26915 | 75RB#0 | NV | 20  | -11.33 | -0.013545 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | NV | -30 | -7.88  | -0.009364 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | NV | -20 | -12.13 | -0.014415 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | NV | 0   | -11.37 | -0.013512 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | NV | 10  | -11.37 | -0.013512 | ±2.5 | PASS |
| Band2<br>6 | 15MHz | 16QAM | 26965 | 75RB#0 | NV | 20  | -5.48  | -0.006512 | ±2.5 | PASS |

---End---

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,  
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn

