

|      |      |      |      |        |      |        |    |      |
|------|------|------|------|--------|------|--------|----|------|
| NVNT | ax40 | 6165 | Sum  | -14.44 | 9.52 | -4.92  | -1 | Pass |
| NVNT | ax40 | 6405 | Ant1 | -25.29 | 3.17 | -21.99 | -1 | Pass |
| NVNT | ax40 | 6405 | Ant2 | -19.59 | 4.5  | -14.96 | -1 | Pass |
| NVNT | ax40 | 6405 | Ant3 | -20.42 | 2.78 | -17.51 | -1 | Pass |
| NVNT | ax40 | 6405 | Ant4 | -18.89 | 3.46 | -15.3  | -1 | Pass |
| NVNT | ax40 | 6405 | Sum  | -14.44 | 9.52 | -4.92  | -1 | Pass |
| NVNT | ax40 | 6445 | Ant1 | -23.86 | 3.17 | -20.6  | -1 | Pass |
| NVNT | ax40 | 6445 | Ant2 | -19.93 | 4.5  | -15.34 | -1 | Pass |
| NVNT | ax40 | 6445 | Ant3 | -20.38 | 2.78 | -17.51 | -1 | Pass |
| NVNT | ax40 | 6445 | Ant4 | -17.97 | 3.46 | -14.42 | -1 | Pass |
| NVNT | ax40 | 6445 | Sum  | -14.05 | 9.52 | -4.53  | -1 | Pass |
| NVNT | ax40 | 6485 | Ant1 | -23.37 | 3.17 | -20.07 | -1 | Pass |
| NVNT | ax40 | 6485 | Ant2 | -20.95 | 4.5  | -16.32 | -1 | Pass |
| NVNT | ax40 | 6485 | Ant3 | -21.39 | 2.78 | -18.48 | -1 | Pass |
| NVNT | ax40 | 6485 | Ant4 | -18.61 | 3.46 | -15.02 | -1 | Pass |
| NVNT | ax40 | 6485 | Sum  | -14.73 | 9.52 | -5.21  | -1 | Pass |
| NVNT | ax40 | 6525 | Ant1 | -22.66 | 3.17 | -19.49 | -1 | Pass |
| NVNT | ax40 | 6525 | Ant2 | -20.64 | 4.5  | -16.14 | -1 | Pass |
| NVNT | ax40 | 6525 | Ant3 | -21.07 | 2.78 | -18.29 | -1 | Pass |
| NVNT | ax40 | 6525 | Ant4 | -18.55 | 3.46 | -15.09 | -1 | Pass |
| NVNT | ax40 | 6525 | Sum  | -14.46 | 9.52 | -4.94  | -1 | Pass |
| NVNT | ax40 | 6565 | Ant1 | -23.54 | 3.17 | -20.37 | -1 | Pass |
| NVNT | ax40 | 6565 | Ant2 | -19.4  | 4.5  | -14.9  | -1 | Pass |
| NVNT | ax40 | 6565 | Ant3 | -21.66 | 2.78 | -18.88 | -1 | Pass |
| NVNT | ax40 | 6565 | Ant4 | -19.17 | 3.46 | -15.71 | -1 | Pass |
| NVNT | ax40 | 6565 | Sum  | -14.58 | 9.52 | -5.06  | -1 | Pass |
| NVNT | ax40 | 6685 | Ant1 | -29.47 | 3.17 | -26.3  | -1 | Pass |
| NVNT | ax40 | 6685 | Ant2 | -18.57 | 4.5  | -14.07 | -1 | Pass |
| NVNT | ax40 | 6685 | Ant3 | -21.36 | 2.78 | -18.58 | -1 | Pass |
| NVNT | ax40 | 6685 | Ant4 | -20.29 | 3.46 | -16.83 | -1 | Pass |
| NVNT | ax40 | 6685 | Sum  | -14.99 | 9.52 | -5.47  | -1 | Pass |
| NVNT | ax40 | 6845 | Ant1 | -26.76 | 3.17 | -23.59 | -1 | Pass |
| NVNT | ax40 | 6845 | Ant2 | -18.8  | 4.5  | -14.3  | -1 | Pass |
| NVNT | ax40 | 6845 | Ant3 | -19.42 | 2.78 | -16.64 | -1 | Pass |
| NVNT | ax40 | 6845 | Ant4 | -19.28 | 3.46 | -15.82 | -1 | Pass |
| NVNT | ax40 | 6845 | Sum  | -14.14 | 9.52 | -4.62  | -1 | Pass |
| NVNT | ax40 | 6885 | Ant1 | -28.47 | 3.17 | -25.3  | -1 | Pass |
| NVNT | ax40 | 6885 | Ant2 | -20.43 | 4.5  | -15.93 | -1 | Pass |
| NVNT | ax40 | 6885 | Ant3 | -20.76 | 2.78 | -17.98 | -1 | Pass |
| NVNT | ax40 | 6885 | Ant4 | -19.22 | 3.46 | -15.76 | -1 | Pass |
| NVNT | ax40 | 6885 | Sum  | -15.11 | 9.52 | -5.59  | -1 | Pass |
| NVNT | ax40 | 6925 | Ant1 | -27.33 | 3.17 | -24.16 | -1 | Pass |
| NVNT | ax40 | 6925 | Ant2 | -21.03 | 4.5  | -16.53 | -1 | Pass |
| NVNT | ax40 | 6925 | Ant3 | -20.34 | 2.78 | -17.56 | -1 | Pass |

|      |      |      |      |        |      |        |    |      |
|------|------|------|------|--------|------|--------|----|------|
| NVNT | ax40 | 6925 | Ant4 | -19.54 | 3.46 | -16.08 | -1 | Pass |
| NVNT | ax40 | 6925 | Sum  | -15.21 | 9.52 | -5.69  | -1 | Pass |
| NVNT | ax40 | 6965 | Ant1 | -28.83 | 3.17 | -25.52 | -1 | Pass |
| NVNT | ax40 | 6965 | Ant2 | -22.32 | 4.5  | -17.68 | -1 | Pass |
| NVNT | ax40 | 6965 | Ant3 | -21.64 | 2.78 | -18.72 | -1 | Pass |
| NVNT | ax40 | 6965 | Ant4 | -19.19 | 3.46 | -15.59 | -1 | Pass |
| NVNT | ax40 | 6965 | Sum  | -15.84 | 9.52 | -6.32  | -1 | Pass |
| NVNT | ax40 | 7085 | Ant1 | -23.89 | 3.17 | -20.72 | -1 | Pass |
| NVNT | ax40 | 7085 | Ant2 | -19.55 | 4.5  | -15.05 | -1 | Pass |
| NVNT | ax40 | 7085 | Ant3 | -20.05 | 2.78 | -17.27 | -1 | Pass |
| NVNT | ax40 | 7085 | Ant4 | -19.11 | 3.46 | -15.65 | -1 | Pass |
| NVNT | ax40 | 7085 | Sum  | -14.28 | 9.52 | -4.76  | -1 | Pass |
| NVNT | ax40 | 5965 | Ant1 | -7.75  | 3.17 | -4.58  | -1 | Pass |
| NVNT | ax40 | 6165 | Ant1 | -11.06 | 3.17 | -7.75  | -1 | Pass |
| NVNT | ax40 | 6405 | Ant1 | -9.82  | 3.17 | -6.55  | -1 | Pass |
| NVNT | ax40 | 6445 | Ant1 | -8.29  | 3.17 | -5.02  | -1 | Pass |
| NVNT | ax40 | 6485 | Ant1 | -7.78  | 3.17 | -4.48  | -1 | Pass |
| NVNT | ax40 | 6525 | Ant1 | -6.48  | 3.17 | -3.31  | -1 | Pass |
| NVNT | ax40 | 6565 | Ant1 | -6.02  | 3.17 | -2.72  | -1 | Pass |
| NVNT | ax40 | 6685 | Ant1 | -5.69  | 3.17 | -2.38  | -1 | Pass |
| NVNT | ax40 | 6845 | Ant1 | -7.03  | 3.17 | -3.86  | -1 | Pass |
| NVNT | ax40 | 6885 | Ant1 | -8.47  | 3.17 | -5.3   | -1 | Pass |
| NVNT | ax40 | 6925 | Ant1 | -9.26  | 3.17 | -5.96  | -1 | Pass |
| NVNT | ax40 | 6965 | Ant1 | -8.63  | 3.17 | -5.33  | -1 | Pass |
| NVNT | ax40 | 7085 | Ant1 | -6.54  | 3.17 | -3.37  | -1 | Pass |
| NVNT | ax40 | 5965 | Ant2 | -5.68  | 4.5  | -1.04  | -1 | Pass |
| NVNT | ax40 | 6165 | Ant2 | -6.45  | 4.5  | -1.86  | -1 | Pass |
| NVNT | ax40 | 6405 | Ant2 | -7.23  | 4.5  | -2.63  | -1 | Pass |
| NVNT | ax40 | 6445 | Ant2 | -5.75  | 4.5  | -1.13  | -1 | Pass |
| NVNT | ax40 | 6485 | Ant2 | -6.02  | 4.5  | -1.52  | -1 | Pass |
| NVNT | ax40 | 6525 | Ant2 | -5.65  | 4.5  | -1.01  | -1 | Pass |
| NVNT | ax40 | 6565 | Ant2 | -6.51  | 4.5  | -2.01  | -1 | Pass |
| NVNT | ax40 | 6685 | Ant2 | -8.45  | 4.5  | -3.95  | -1 | Pass |
| NVNT | ax40 | 6845 | Ant2 | -6.09  | 4.5  | -1.49  | -1 | Pass |
| NVNT | ax40 | 6885 | Ant2 | -5.71  | 4.5  | -1.11  | -1 | Pass |
| NVNT | ax40 | 6925 | Ant2 | -7.26  | 4.5  | -2.76  | -1 | Pass |
| NVNT | ax40 | 6965 | Ant2 | -5.67  | 4.5  | -1.03  | -1 | Pass |
| NVNT | ax40 | 7085 | Ant2 | -6.92  | 4.5  | -2.42  | -1 | Pass |
| NVNT | ax40 | 5965 | Ant3 | -9.1   | 2.78 | -6.18  | -1 | Pass |
| NVNT | ax40 | 6165 | Ant3 | -6.89  | 2.78 | -4     | -1 | Pass |
| NVNT | ax40 | 6405 | Ant3 | -8.71  | 2.78 | -5.83  | -1 | Pass |
| NVNT | ax40 | 6445 | Ant3 | -8.11  | 2.78 | -5.33  | -1 | Pass |
| NVNT | ax40 | 6485 | Ant3 | -8.62  | 2.78 | -5.84  | -1 | Pass |
| NVNT | ax40 | 6525 | Ant3 | -8.73  | 2.78 | -5.86  | -1 | Pass |

|      |      |      |      |        |      |        |    |      |
|------|------|------|------|--------|------|--------|----|------|
| NVNT | ax40 | 6565 | Ant3 | -6.09  | 2.78 | -3.22  | -1 | Pass |
| NVNT | ax40 | 6685 | Ant3 | -4.73  | 2.78 | -1.95  | -1 | Pass |
| NVNT | ax40 | 6845 | Ant3 | -8.93  | 2.78 | -6.04  | -1 | Pass |
| NVNT | ax40 | 6885 | Ant3 | -8.81  | 2.78 | -5.89  | -1 | Pass |
| NVNT | ax40 | 6925 | Ant3 | -8.24  | 2.78 | -5.46  | -1 | Pass |
| NVNT | ax40 | 6965 | Ant3 | -7.89  | 2.78 | -5.11  | -1 | Pass |
| NVNT | ax40 | 7085 | Ant3 | -4.74  | 2.78 | -1.82  | -1 | Pass |
| NVNT | ax40 | 5965 | Ant4 | -8.81  | 3.46 | -5.35  | -1 | Pass |
| NVNT | ax40 | 6165 | Ant4 | -5.41  | 3.46 | -1.84  | -1 | Pass |
| NVNT | ax40 | 6405 | Ant4 | -7.91  | 3.46 | -4.45  | -1 | Pass |
| NVNT | ax40 | 6445 | Ant4 | -7.07  | 3.46 | -3.47  | -1 | Pass |
| NVNT | ax40 | 6485 | Ant4 | -7.4   | 3.46 | -3.94  | -1 | Pass |
| NVNT | ax40 | 6525 | Ant4 | -7.38  | 3.46 | -3.92  | -1 | Pass |
| NVNT | ax40 | 6565 | Ant4 | -6.39  | 3.46 | -2.84  | -1 | Pass |
| NVNT | ax40 | 6685 | Ant4 | -5.16  | 3.46 | -1.6   | -1 | Pass |
| NVNT | ax40 | 6845 | Ant4 | -6.36  | 3.46 | -2.78  | -1 | Pass |
| NVNT | ax40 | 6885 | Ant4 | -7.16  | 3.46 | -3.56  | -1 | Pass |
| NVNT | ax40 | 6925 | Ant4 | -7.89  | 3.46 | -4.43  | -1 | Pass |
| NVNT | ax40 | 6965 | Ant4 | -6.56  | 3.46 | -2.98  | -1 | Pass |
| NVNT | ax40 | 7085 | Ant4 | -5.11  | 3.46 | -1.51  | -1 | Pass |
| NVNT | ax80 | 5985 | Ant1 | -27.84 | 3.17 | -24.67 | -1 | Pass |
| NVNT | ax80 | 5985 | Ant2 | -23.52 | 4.5  | -19.02 | -1 | Pass |
| NVNT | ax80 | 5985 | Ant3 | -24.83 | 2.78 | -22.05 | -1 | Pass |
| NVNT | ax80 | 5985 | Ant4 | -19.7  | 3.46 | -16.24 | -1 | Pass |
| NVNT | ax80 | 5985 | Sum  | -16.97 | 9.52 | -7.45  | -1 | Pass |
| NVNT | ax80 | 6145 | Ant1 | -29.36 | 3.17 | -26.19 | -1 | Pass |
| NVNT | ax80 | 6145 | Ant2 | -19.09 | 4.5  | -14.59 | -1 | Pass |
| NVNT | ax80 | 6145 | Ant3 | -19.74 | 2.78 | -16.96 | -1 | Pass |
| NVNT | ax80 | 6145 | Ant4 | -19.22 | 3.46 | -15.76 | -1 | Pass |
| NVNT | ax80 | 6145 | Sum  | -14.43 | 9.52 | -4.91  | -1 | Pass |
| NVNT | ax80 | 6385 | Ant1 | -25.27 | 3.17 | -22.1  | -1 | Pass |
| NVNT | ax80 | 6385 | Ant2 | -19.92 | 4.5  | -15.42 | -1 | Pass |
| NVNT | ax80 | 6385 | Ant3 | -19.89 | 2.78 | -17.11 | -1 | Pass |
| NVNT | ax80 | 6385 | Ant4 | -18.1  | 3.46 | -14.64 | -1 | Pass |
| NVNT | ax80 | 6385 | Sum  | -14.10 | 9.52 | -4.58  | -1 | Pass |
| NVNT | ax80 | 6465 | Ant1 | -23.61 | 3.17 | -20.33 | -1 | Pass |
| NVNT | ax80 | 6465 | Ant2 | -20.23 | 4.5  | -15.62 | -1 | Pass |
| NVNT | ax80 | 6465 | Ant3 | -21.07 | 2.78 | -18.18 | -1 | Pass |
| NVNT | ax80 | 6465 | Ant4 | -17.92 | 3.46 | -14.35 | -1 | Pass |
| NVNT | ax80 | 6465 | Sum  | -14.23 | 9.52 | -4.71  | -1 | Pass |
| NVNT | ax80 | 6545 | Ant1 | -22.85 | 3.17 | -19.68 | -1 | Pass |
| NVNT | ax80 | 6545 | Ant2 | -20.2  | 4.5  | -15.7  | -1 | Pass |
| NVNT | ax80 | 6545 | Ant3 | -20.98 | 2.78 | -18.2  | -1 | Pass |
| NVNT | ax80 | 6545 | Ant4 | -18.56 | 3.46 | -15.1  | -1 | Pass |

|      |      |      |      |        |      |        |    |      |
|------|------|------|------|--------|------|--------|----|------|
| NVNT | ax80 | 6545 | Sum  | -14.36 | 9.52 | -4.84  | -1 | Pass |
| NVNT | ax80 | 6625 | Ant1 | -25.68 | 3.17 | -22.51 | -1 | Pass |
| NVNT | ax80 | 6625 | Ant2 | -18.49 | 4.5  | -13.99 | -1 | Pass |
| NVNT | ax80 | 6625 | Ant3 | -21.34 | 2.78 | -18.56 | -1 | Pass |
| NVNT | ax80 | 6625 | Ant4 | -19.48 | 3.46 | -16.02 | -1 | Pass |
| NVNT | ax80 | 6625 | Sum  | -14.50 | 9.52 | -4.98  | -1 | Pass |
| NVNT | ax80 | 6705 | Ant1 | -29.25 | 3.17 | -26.08 | -1 | Pass |
| NVNT | ax80 | 6705 | Ant2 | -18.05 | 4.5  | -13.55 | -1 | Pass |
| NVNT | ax80 | 6705 | Ant3 | -20.94 | 2.78 | -18.16 | -1 | Pass |
| NVNT | ax80 | 6705 | Ant4 | -20.55 | 3.46 | -17.09 | -1 | Pass |
| NVNT | ax80 | 6705 | Sum  | -14.72 | 9.52 | -5.2   | -1 | Pass |
| NVNT | ax80 | 6785 | Ant1 | -29.65 | 3.17 | -26.48 | -1 | Pass |
| NVNT | ax80 | 6785 | Ant2 | -18.7  | 4.5  | -14.2  | -1 | Pass |
| NVNT | ax80 | 6785 | Ant3 | -21.2  | 2.78 | -18.42 | -1 | Pass |
| NVNT | ax80 | 6785 | Ant4 | -20.7  | 3.46 | -17.24 | -1 | Pass |
| NVNT | ax80 | 6785 | Sum  | -15.13 | 9.52 | -5.61  | -1 | Pass |
| NVNT | ax80 | 6865 | Ant1 | -26.24 | 3.17 | -23.07 | -1 | Pass |
| NVNT | ax80 | 6865 | Ant2 | -18.28 | 4.5  | -13.78 | -1 | Pass |
| NVNT | ax80 | 6865 | Ant3 | -19.97 | 2.78 | -17.19 | -1 | Pass |
| NVNT | ax80 | 6865 | Ant4 | -18.77 | 3.46 | -15.31 | -1 | Pass |
| NVNT | ax80 | 6865 | Sum  | -13.92 | 9.52 | -4.4   | -1 | Pass |
| NVNT | ax80 | 6945 | Ant1 | -27.32 | 3.17 | -24.01 | -1 | Pass |
| NVNT | ax80 | 6945 | Ant2 | -20.84 | 4.5  | -16.2  | -1 | Pass |
| NVNT | ax80 | 6945 | Ant3 | -21.03 | 2.78 | -18.11 | -1 | Pass |
| NVNT | ax80 | 6945 | Ant4 | -20.13 | 3.46 | -16.53 | -1 | Pass |
| NVNT | ax80 | 6945 | Sum  | -15.58 | 9.52 | -6.06  | -1 | Pass |
| NVNT | ax80 | 7025 | Ant1 | -26.16 | 3.17 | -22.99 | -1 | Pass |
| NVNT | ax80 | 7025 | Ant2 | -21.46 | 4.5  | -16.96 | -1 | Pass |
| NVNT | ax80 | 7025 | Ant3 | -20.26 | 2.78 | -17.48 | -1 | Pass |
| NVNT | ax80 | 7025 | Ant4 | -18.34 | 3.46 | -14.88 | -1 | Pass |
| NVNT | ax80 | 7025 | Sum  | -14.73 | 9.52 | -5.21  | -1 | Pass |
| NVNT | ax80 | 5985 | Ant1 | -8.73  | 3.17 | -5.56  | -1 | Pass |
| NVNT | ax80 | 6145 | Ant1 | -11.23 | 3.17 | -8.06  | -1 | Pass |
| NVNT | ax80 | 6385 | Ant1 | -11.59 | 3.17 | -8.42  | -1 | Pass |
| NVNT | ax80 | 6465 | Ant1 | -8.92  | 3.17 | -5.75  | -1 | Pass |
| NVNT | ax80 | 6545 | Ant1 | -7.44  | 3.17 | -4.13  | -1 | Pass |
| NVNT | ax80 | 6625 | Ant1 | -6.94  | 3.17 | -3.64  | -1 | Pass |
| NVNT | ax80 | 6705 | Ant1 | -7.17  | 3.17 | -3.88  | -1 | Pass |
| NVNT | ax80 | 6785 | Ant1 | -8.42  | 3.17 | -5.15  | -1 | Pass |
| NVNT | ax80 | 6865 | Ant1 | -8.48  | 3.17 | -5.21  | -1 | Pass |
| NVNT | ax80 | 6945 | Ant1 | -9.94  | 3.17 | -6.65  | -1 | Pass |
| NVNT | ax80 | 7025 | Ant1 | -8.83  | 3.17 | -5.66  | -1 | Pass |
| NVNT | ax80 | 5985 | Ant2 | -5.91  | 4.5  | -1.41  | -1 | Pass |
| NVNT | ax80 | 6145 | Ant2 | -6.44  | 4.5  | -1.94  | -1 | Pass |


|      |       |      |      |        |      |        |    |      |
|------|-------|------|------|--------|------|--------|----|------|
| NVNT | ax80  | 6385 | Ant2 | -6.91  | 4.5  | -2.41  | -1 | Pass |
| NVNT | ax80  | 6465 | Ant2 | -5.53  | 4.5  | -1.03  | -1 | Pass |
| NVNT | ax80  | 6545 | Ant2 | -6.07  | 4.5  | -1.47  | -1 | Pass |
| NVNT | ax80  | 6625 | Ant2 | -6.2   | 4.5  | -1.56  | -1 | Pass |
| NVNT | ax80  | 6705 | Ant2 | -5.84  | 4.5  | -1.34  | -1 | Pass |
| NVNT | ax80  | 6785 | Ant2 | -5.9   | 4.5  | -1.4   | -1 | Pass |
| NVNT | ax80  | 6865 | Ant2 | -6.27  | 4.5  | -1.77  | -1 | Pass |
| NVNT | ax80  | 6945 | Ant2 | -6.27  | 4.5  | -1.77  | -1 | Pass |
| NVNT | ax80  | 7025 | Ant2 | -5.99  | 4.5  | -1.49  | -1 | Pass |
| NVNT | ax80  | 5985 | Ant3 | -8.06  | 2.78 | -5.15  | -1 | Pass |
| NVNT | ax80  | 6145 | Ant3 | -5.69  | 2.78 | -2.78  | -1 | Pass |
| NVNT | ax80  | 6385 | Ant3 | -8.11  | 2.78 | -5.33  | -1 | Pass |
| NVNT | ax80  | 6465 | Ant3 | -8.63  | 2.78 | -5.85  | -1 | Pass |
| NVNT | ax80  | 6545 | Ant3 | -7.73  | 2.78 | -4.95  | -1 | Pass |
| NVNT | ax80  | 6625 | Ant3 | -4.61  | 2.78 | -1.83  | -1 | Pass |
| NVNT | ax80  | 6705 | Ant3 | -4.89  | 2.78 | -2.01  | -1 | Pass |
| NVNT | ax80  | 6785 | Ant3 | -6.74  | 2.78 | -3.96  | -1 | Pass |
| NVNT | ax80  | 6865 | Ant3 | -8.44  | 2.78 | -5.66  | -1 | Pass |
| NVNT | ax80  | 6945 | Ant3 | -8.73  | 2.78 | -5.85  | -1 | Pass |
| NVNT | ax80  | 7025 | Ant3 | -6.39  | 2.78 | -3.48  | -1 | Pass |
| NVNT | ax80  | 5985 | Ant4 | -8.34  | 3.46 | -4.75  | -1 | Pass |
| NVNT | ax80  | 6145 | Ant4 | -5.42  | 3.46 | -1.83  | -1 | Pass |
| NVNT | ax80  | 6385 | Ant4 | -8.01  | 3.46 | -4.55  | -1 | Pass |
| NVNT | ax80  | 6465 | Ant4 | -7.32  | 3.46 | -3.86  | -1 | Pass |
| NVNT | ax80  | 6545 | Ant4 | -6.83  | 3.46 | -3.24  | -1 | Pass |
| NVNT | ax80  | 6625 | Ant4 | -5.65  | 3.46 | -2.19  | -1 | Pass |
| NVNT | ax80  | 6705 | Ant4 | -5.17  | 3.46 | -1.71  | -1 | Pass |
| NVNT | ax80  | 6785 | Ant4 | -5.69  | 3.46 | -2.23  | -1 | Pass |
| NVNT | ax80  | 6865 | Ant4 | -6.52  | 3.46 | -3.06  | -1 | Pass |
| NVNT | ax80  | 6945 | Ant4 | -7.27  | 3.46 | -3.69  | -1 | Pass |
| NVNT | ax80  | 7025 | Ant4 | -5.78  | 3.46 | -2.32  | -1 | Pass |
| NVNT | ax160 | 6025 | Ant1 | -27.28 | 3.17 | -23.98 | -1 | Pass |
| NVNT | ax160 | 6025 | Ant2 | -21.89 | 4.5  | -17.26 | -1 | Pass |
| NVNT | ax160 | 6025 | Ant3 | -22.64 | 2.78 | -19.73 | -1 | Pass |
| NVNT | ax160 | 6025 | Ant4 | -18.34 | 3.46 | -14.75 | -1 | Pass |
| NVNT | ax160 | 6025 | Sum  | -15.46 | 9.52 | -5.94  | -1 | Pass |
| NVNT | ax160 | 6185 | Ant1 | -29.8  | 3.17 | -26.49 | -1 | Pass |
| NVNT | ax160 | 6185 | Ant2 | -18.84 | 4.5  | -14.2  | -1 | Pass |
| NVNT | ax160 | 6185 | Ant3 | -19.93 | 2.78 | -17.01 | -1 | Pass |
| NVNT | ax160 | 6185 | Ant4 | -19.27 | 3.46 | -15.67 | -1 | Pass |
| NVNT | ax160 | 6185 | Sum  | -14.42 | 9.52 | -4.9   | -1 | Pass |
| NVNT | ax160 | 6345 | Ant1 | -28.97 | 3.17 | -25.8  | -1 | Pass |
| NVNT | ax160 | 6345 | Ant2 | -20.81 | 4.5  | -16.31 | -1 | Pass |
| NVNT | ax160 | 6345 | Ant3 | -21.23 | 2.78 | -18.45 | -1 | Pass |

|      |       |      |      |        |      |        |    |      |
|------|-------|------|------|--------|------|--------|----|------|
| NVNT | ax160 | 6345 | Ant4 | -19.93 | 3.46 | -16.47 | -1 | Pass |
| NVNT | ax160 | 6345 | Sum  | -15.64 | 9.52 | -6.12  | -1 | Pass |
| NVNT | ax160 | 6505 | Ant1 | -22.15 | 3.17 | -18.98 | -1 | Pass |
| NVNT | ax160 | 6505 | Ant2 | -19.67 | 4.5  | -15.17 | -1 | Pass |
| NVNT | ax160 | 6505 | Ant3 | -21.95 | 2.78 | -19.17 | -1 | Pass |
| NVNT | ax160 | 6505 | Ant4 | -18.92 | 3.46 | -15.46 | -1 | Pass |
| NVNT | ax160 | 6505 | Sum  | -14.43 | 9.52 | -4.91  | -1 | Pass |
| NVNT | ax160 | 6665 | Ant1 | -26.92 | 3.17 | -23.75 | -1 | Pass |
| NVNT | ax160 | 6665 | Ant2 | -18.82 | 4.5  | -14.32 | -1 | Pass |
| NVNT | ax160 | 6665 | Ant3 | -22.28 | 2.78 | -19.5  | -1 | Pass |
| NVNT | ax160 | 6665 | Ant4 | -20.34 | 3.46 | -16.88 | -1 | Pass |
| NVNT | ax160 | 6665 | Sum  | -14.64 | 9.52 | -5.12  | -1 | Pass |
| NVNT | ax160 | 6825 | Ant1 | -27.22 | 3.17 | -24.05 | -1 | Pass |
| NVNT | ax160 | 6825 | Ant2 | -18.93 | 4.5  | -14.43 | -1 | Pass |
| NVNT | ax160 | 6825 | Ant3 | -20.14 | 2.78 | -17.36 | -1 | Pass |
| NVNT | ax160 | 6825 | Ant4 | -18.95 | 3.46 | -15.49 | -1 | Pass |
| NVNT | ax160 | 6825 | Sum  | -14.31 | 9.52 | -4.79  | -1 | Pass |
| NVNT | ax160 | 6985 | Ant1 | -28.89 | 3.17 | -25.6  | -1 | Pass |
| NVNT | ax160 | 6985 | Ant2 | -24.42 | 4.5  | -19.8  | -1 | Pass |
| NVNT | ax160 | 6985 | Ant3 | -22.8  | 2.78 | -19.9  | -1 | Pass |
| NVNT | ax160 | 6985 | Ant4 | -20.62 | 3.46 | -17.04 | -1 | Pass |
| NVNT | ax160 | 6985 | Sum  | -17.25 | 9.52 | -7.73  | -1 | Pass |
| NVNT | ax160 | 6025 | Ant1 | -10.12 | 3.17 | -6.78  | -1 | Pass |
| NVNT | ax160 | 6185 | Ant1 | -12.22 | 3.17 | -8.89  | -1 | Pass |
| NVNT | ax160 | 6345 | Ant1 | -11.62 | 3.17 | -8.45  | -1 | Pass |
| NVNT | ax160 | 6505 | Ant1 | -9.03  | 3.17 | -5.86  | -1 | Pass |
| NVNT | ax160 | 6665 | Ant1 | -7.19  | 3.17 | -3.87  | -1 | Pass |
| NVNT | ax160 | 6825 | Ant1 | -10.76 | 3.17 | -7.47  | -1 | Pass |
| NVNT | ax160 | 6985 | Ant1 | -10.39 | 3.17 | -7.22  | -1 | Pass |
| NVNT | ax160 | 6025 | Ant2 | -6.22  | 4.5  | -1.72  | -1 | Pass |
| NVNT | ax160 | 6185 | Ant2 | -6.03  | 4.5  | -1.43  | -1 | Pass |
| NVNT | ax160 | 6345 | Ant2 | -6.93  | 4.5  | -2.3   | -1 | Pass |
| NVNT | ax160 | 6505 | Ant2 | -6.07  | 4.5  | -1.41  | -1 | Pass |
| NVNT | ax160 | 6665 | Ant2 | -5.92  | 4.5  | -1.31  | -1 | Pass |
| NVNT | ax160 | 6825 | Ant2 | -5.86  | 4.5  | -1.26  | -1 | Pass |
| NVNT | ax160 | 6985 | Ant2 | -6.64  | 4.5  | -1.98  | -1 | Pass |
| NVNT | ax160 | 6025 | Ant3 | -7.73  | 2.78 | -4.78  | -1 | Pass |
| NVNT | ax160 | 6185 | Ant3 | -7.5   | 2.78 | -4.72  | -1 | Pass |
| NVNT | ax160 | 6345 | Ant3 | -8.45  | 2.78 | -5.67  | -1 | Pass |
| NVNT | ax160 | 6505 | Ant3 | -8.94  | 2.78 | -6.04  | -1 | Pass |
| NVNT | ax160 | 6665 | Ant3 | -4.73  | 2.78 | -1.95  | -1 | Pass |
| NVNT | ax160 | 6825 | Ant3 | -7.68  | 2.78 | -4.9   | -1 | Pass |
| NVNT | ax160 | 6985 | Ant3 | -8.36  | 2.78 | -5.58  | -1 | Pass |
| NVNT | ax160 | 6025 | Ant4 | -7.98  | 3.46 | -4.52  | -1 | Pass |

|      |       |      |      |       |      |       |    |      |
|------|-------|------|------|-------|------|-------|----|------|
| NVNT | ax160 | 6185 | Ant4 | -6.18 | 3.46 | -2.72 | -1 | Pass |
| NVNT | ax160 | 6345 | Ant4 | -6.89 | 3.46 | -3.3  | -1 | Pass |
| NVNT | ax160 | 6505 | Ant4 | -7.6  | 3.46 | -4.14 | -1 | Pass |
| NVNT | ax160 | 6665 | Ant4 | -5.37 | 3.46 | -1.91 | -1 | Pass |
| NVNT | ax160 | 6825 | Ant4 | -5.59 | 3.46 | -2.03 | -1 | Pass |
| NVNT | ax160 | 6985 | Ant4 | -6.59 | 3.46 | -3.01 | -1 | Pass |

# Test Graphs


PSD NVNT ax20 5955MHz Ant1

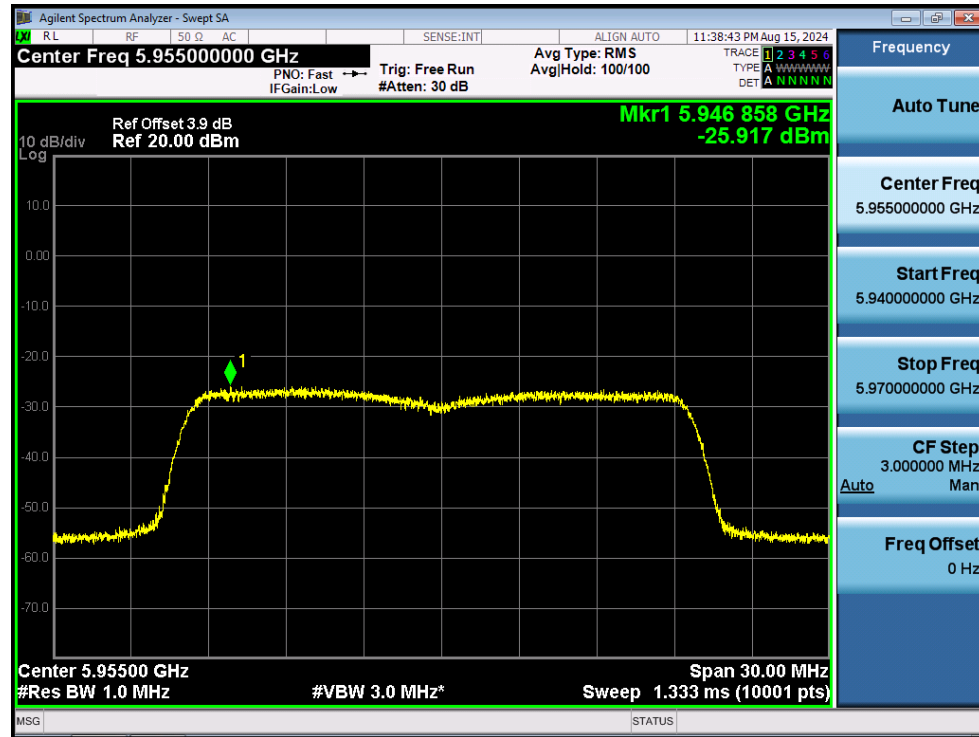


PSD NVNT ax20 5955MHz Ant2




PSD NVNT ax20 5955MHz Ant3

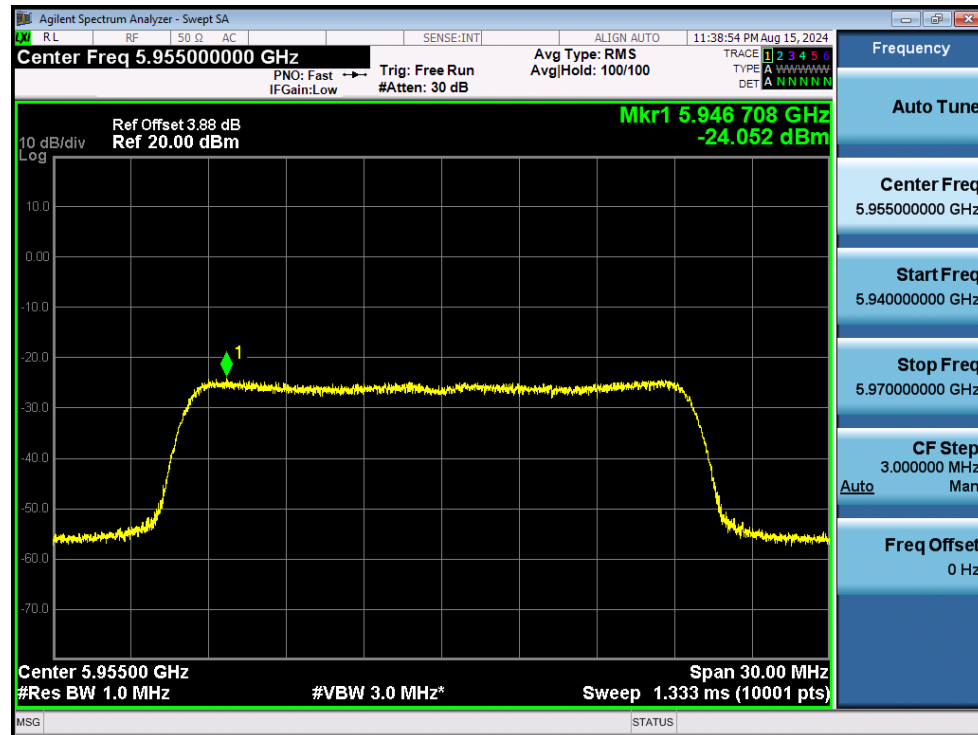


PSD NVNT ax20 5955MHz Ant4

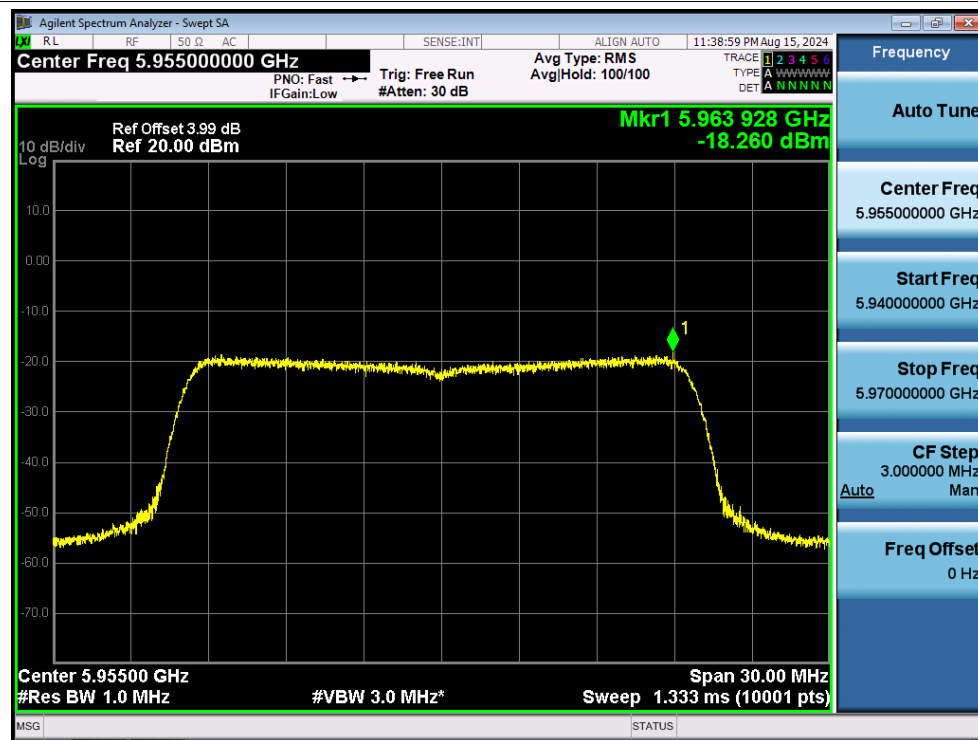


PSD NVNT ax20 6175MHz Ant1

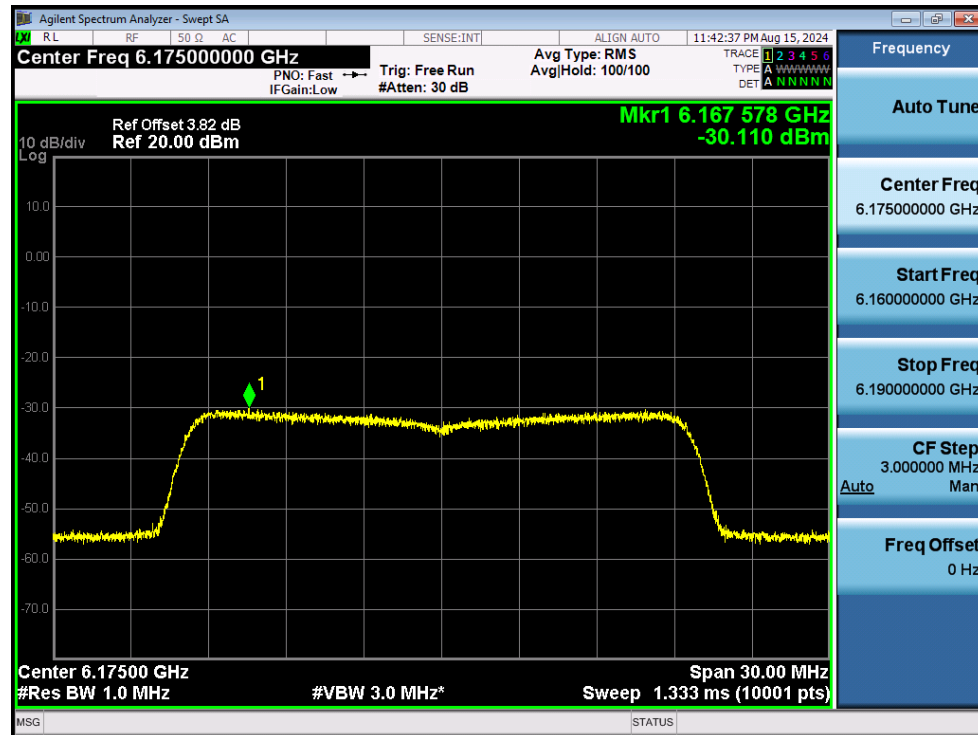


PSD NVNT ax20 6175MHz Ant2

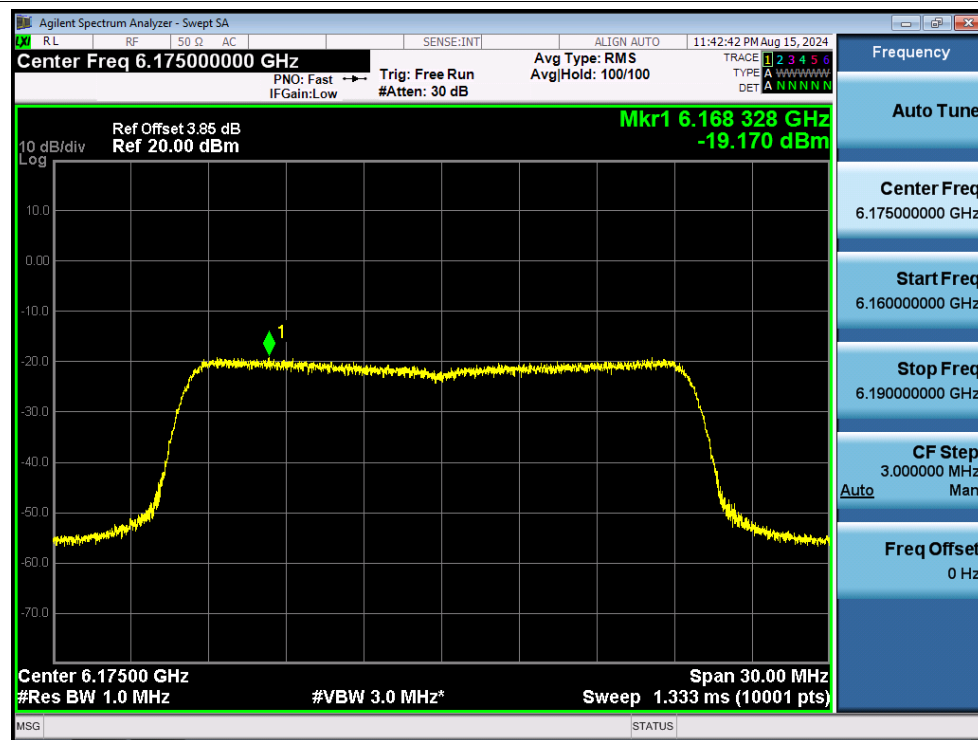


# PSD NVNT ax20 6175MHz Ant3

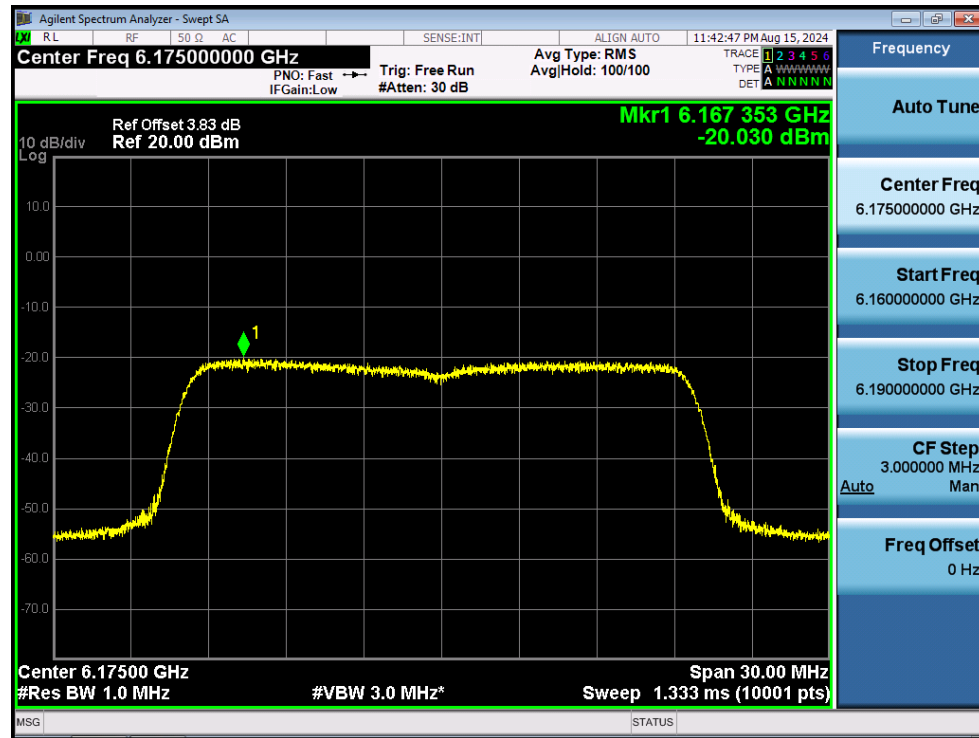


# PSD NVNT ax20 6175MHz Ant4

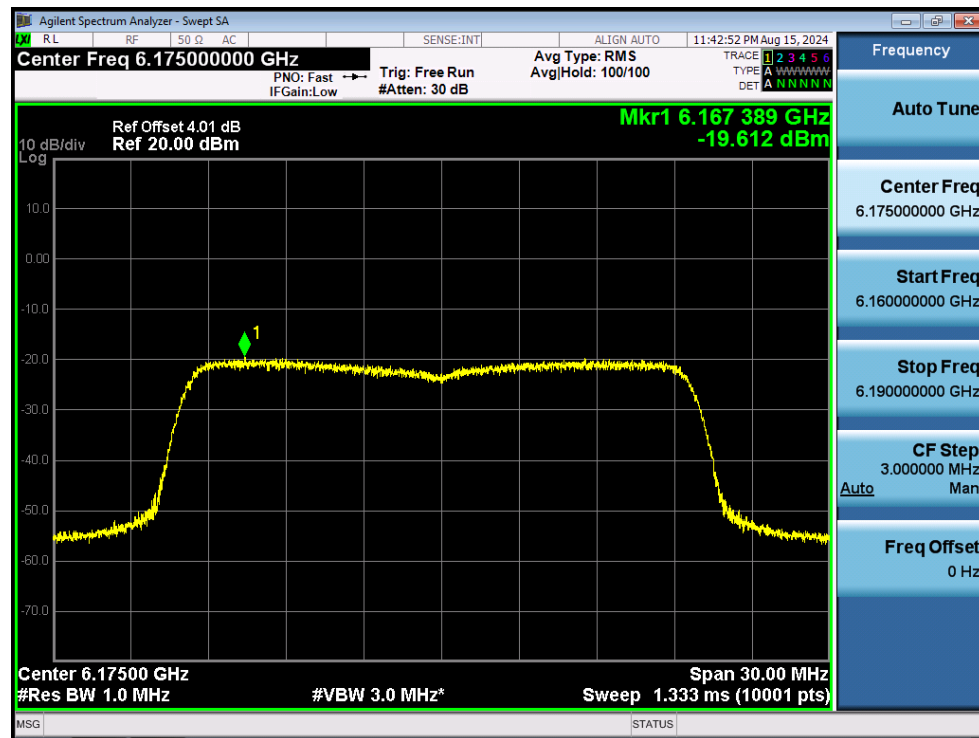


PSD NVNT ax20 6415MHz Ant1

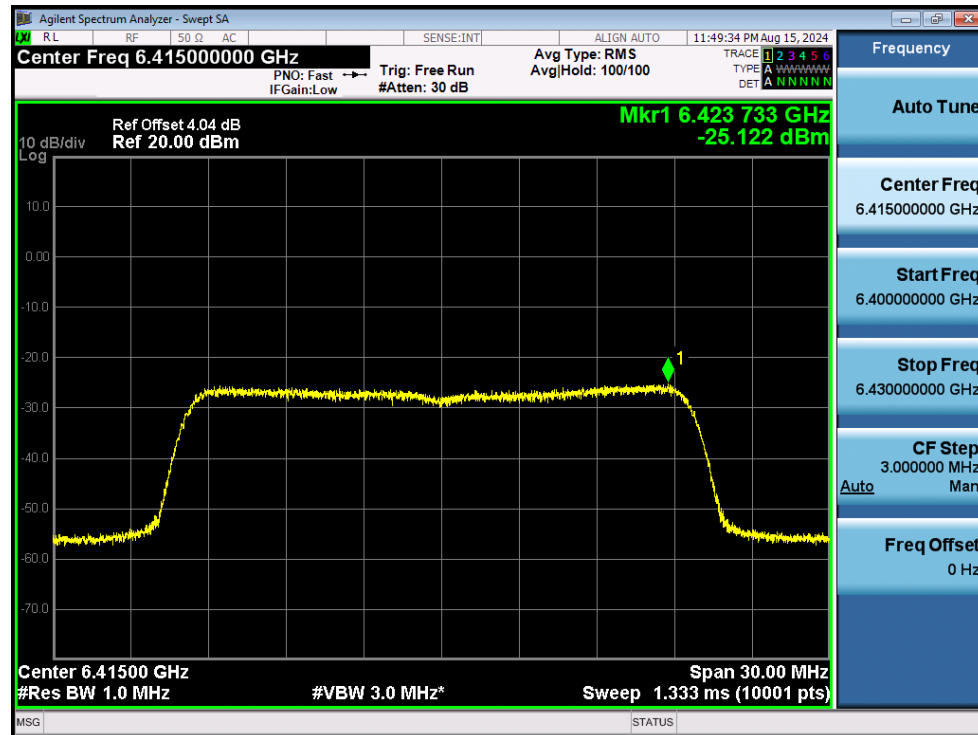


PSD NVNT ax20 6415MHz Ant2

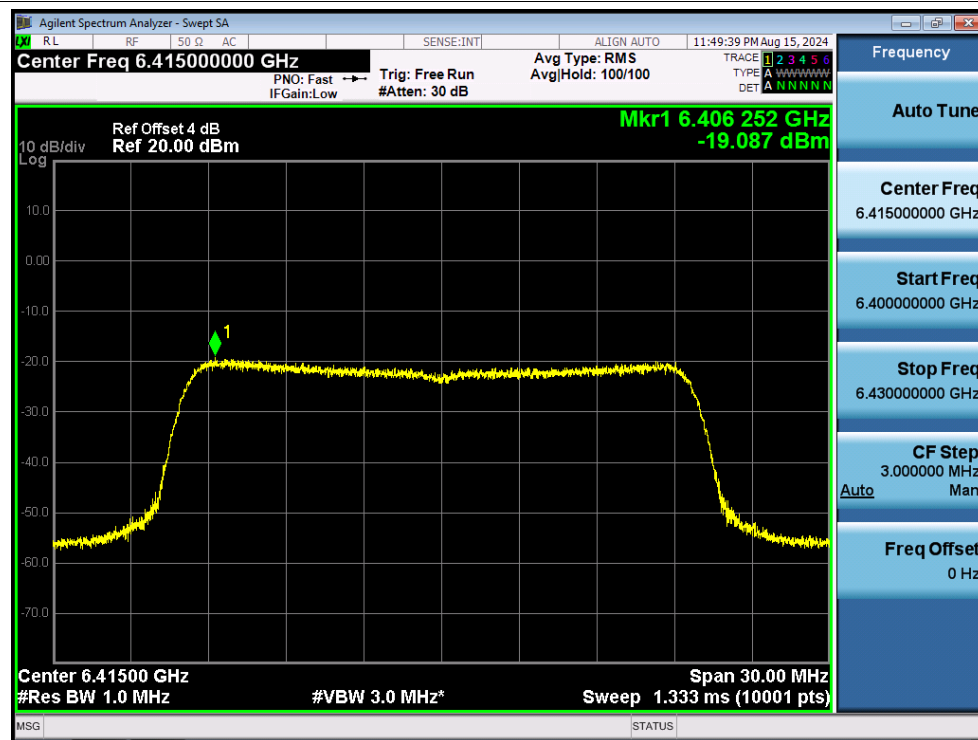


PSD NVNT ax20 6415MHz Ant3

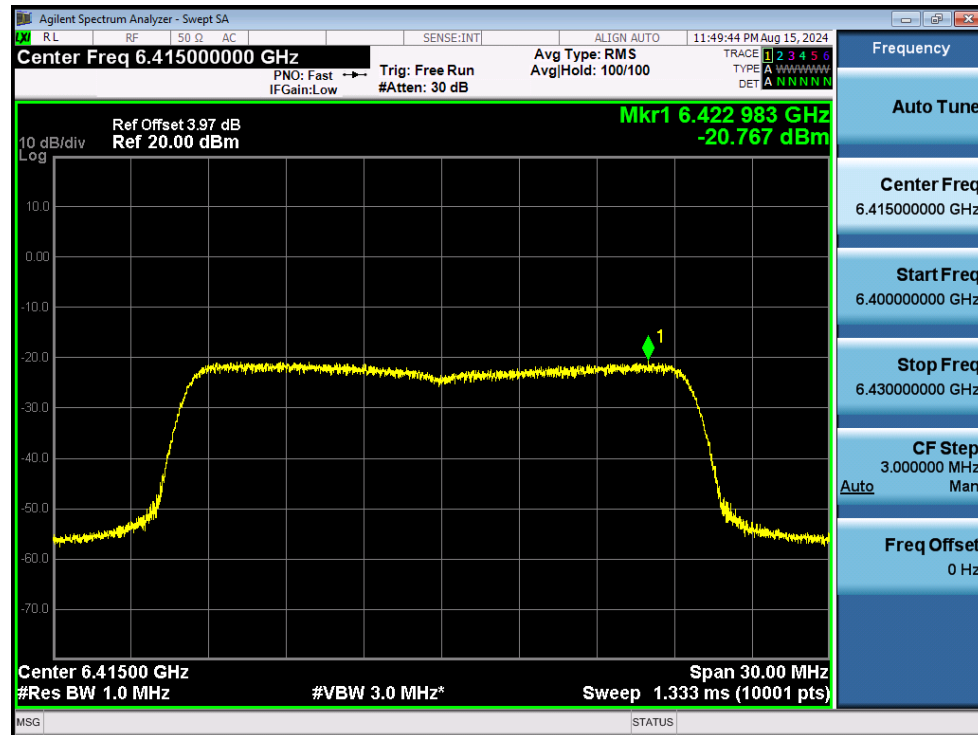


PSD NVNT ax20 6415MHz Ant4

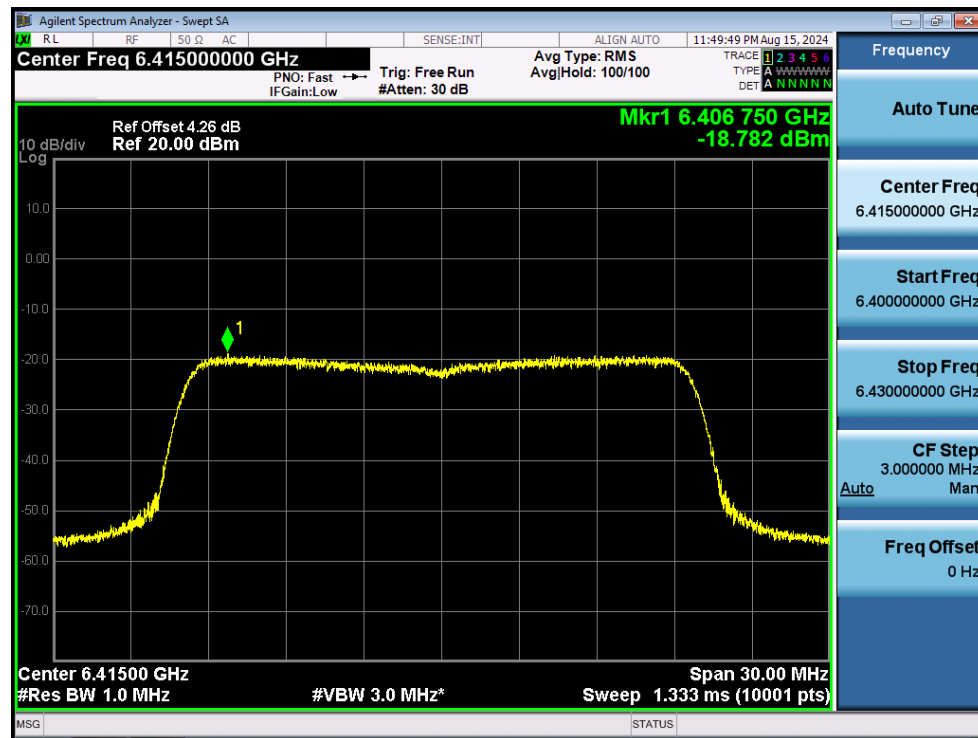


PSD NVNT ax20 6435MHz Ant1

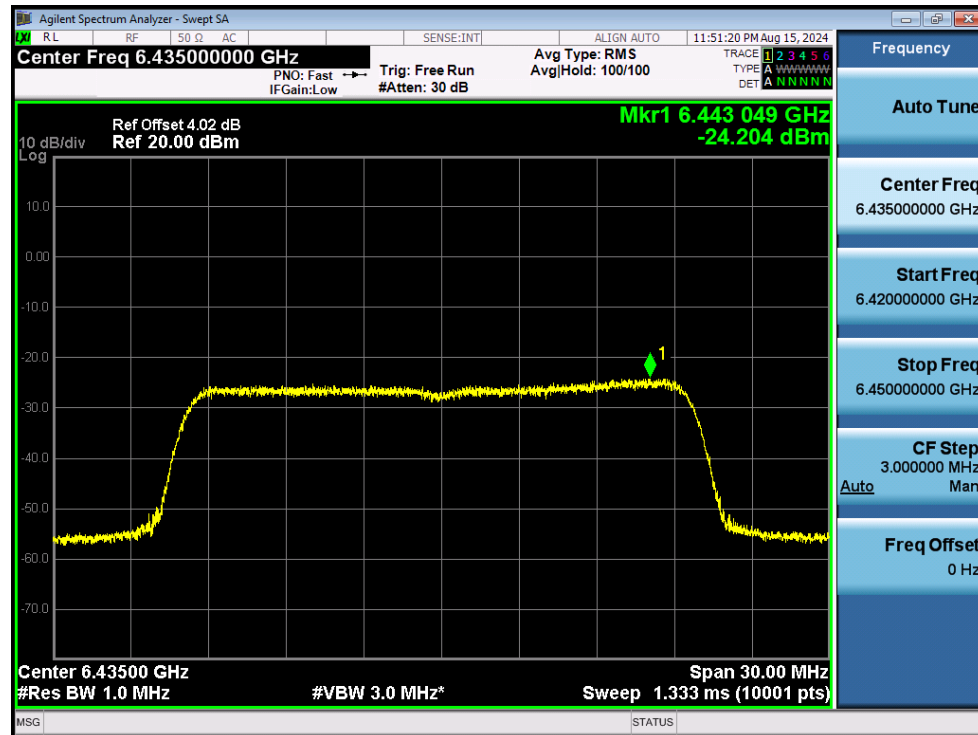


PSD NVNT ax20 6435MHz Ant2

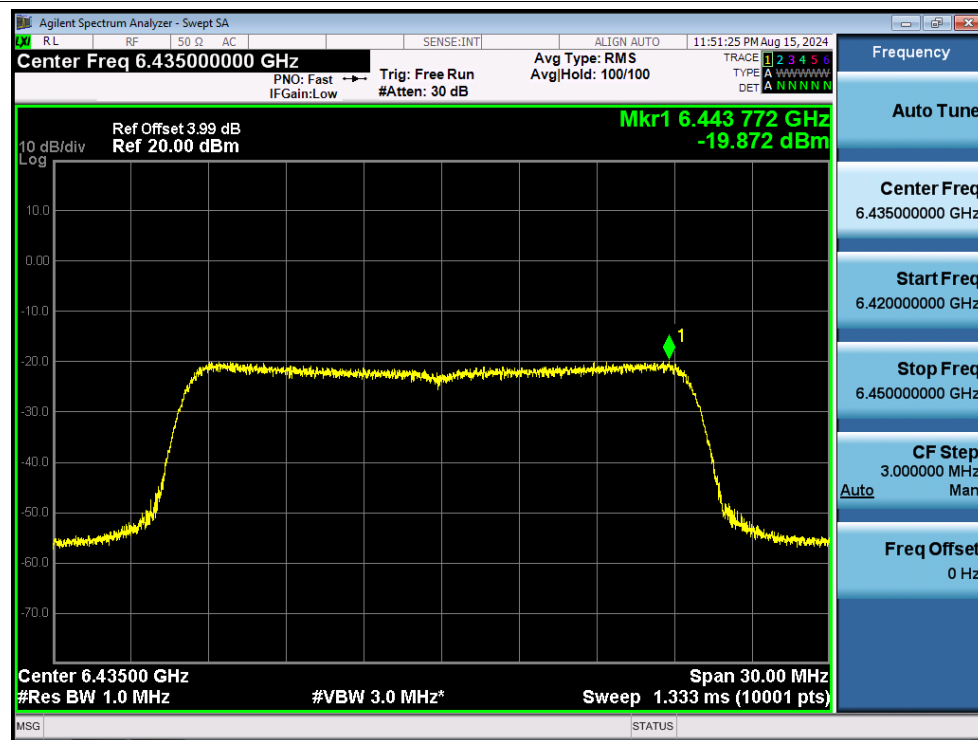


PSD NVNT ax20 6435MHz Ant3

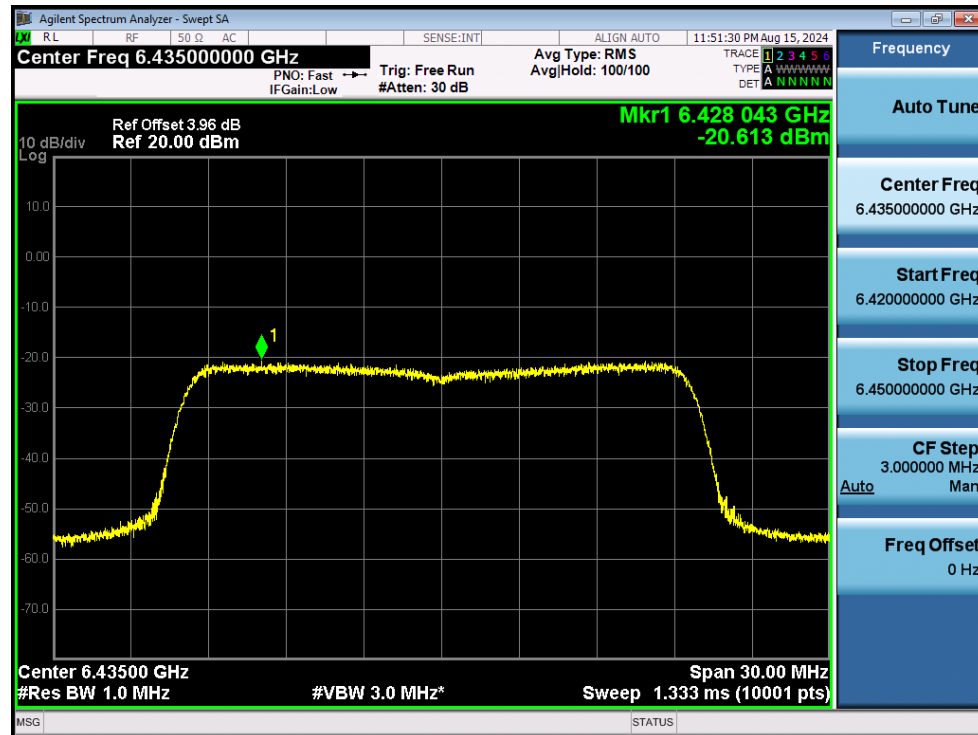


PSD NVNT ax20 6435MHz Ant4

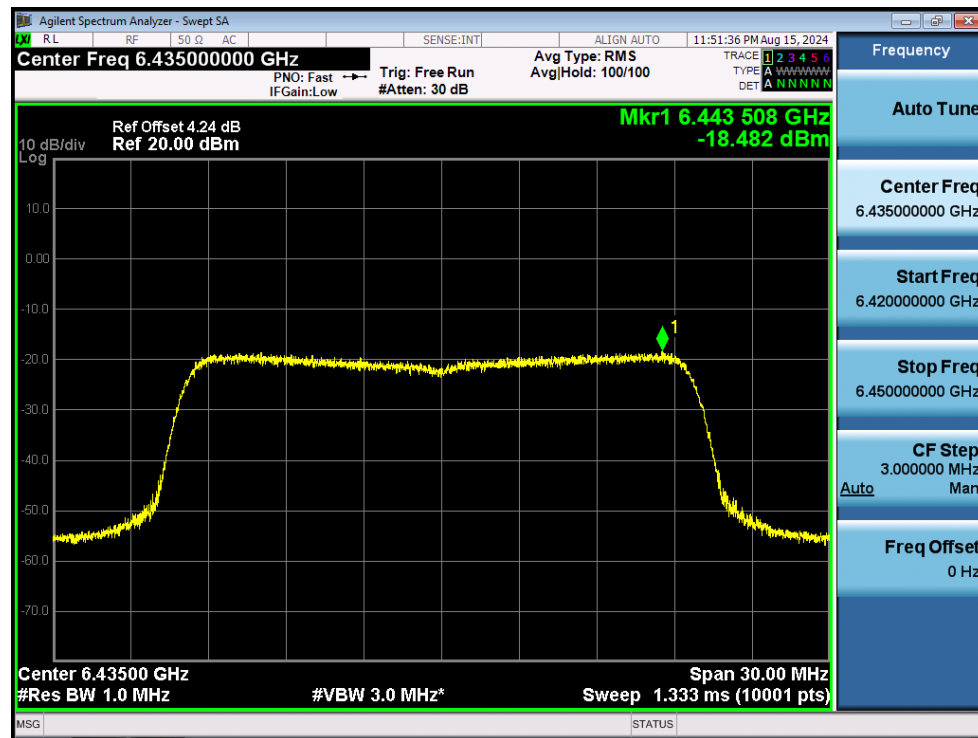


PSD NVNT ax20 6475MHz Ant1

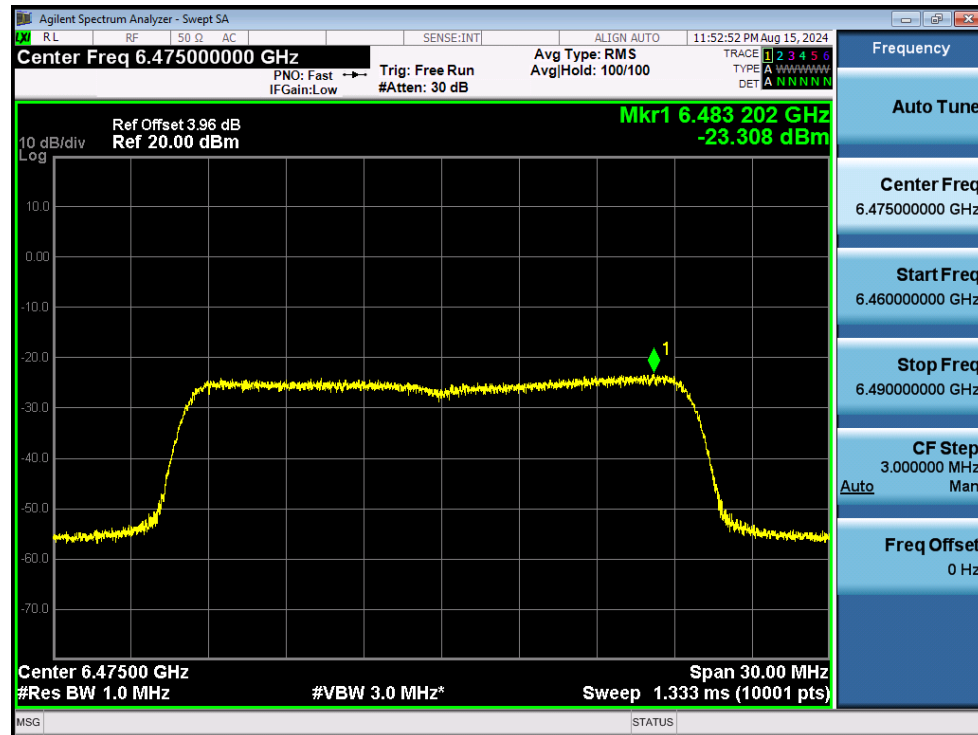


PSD NVNT ax20 6475MHz Ant2

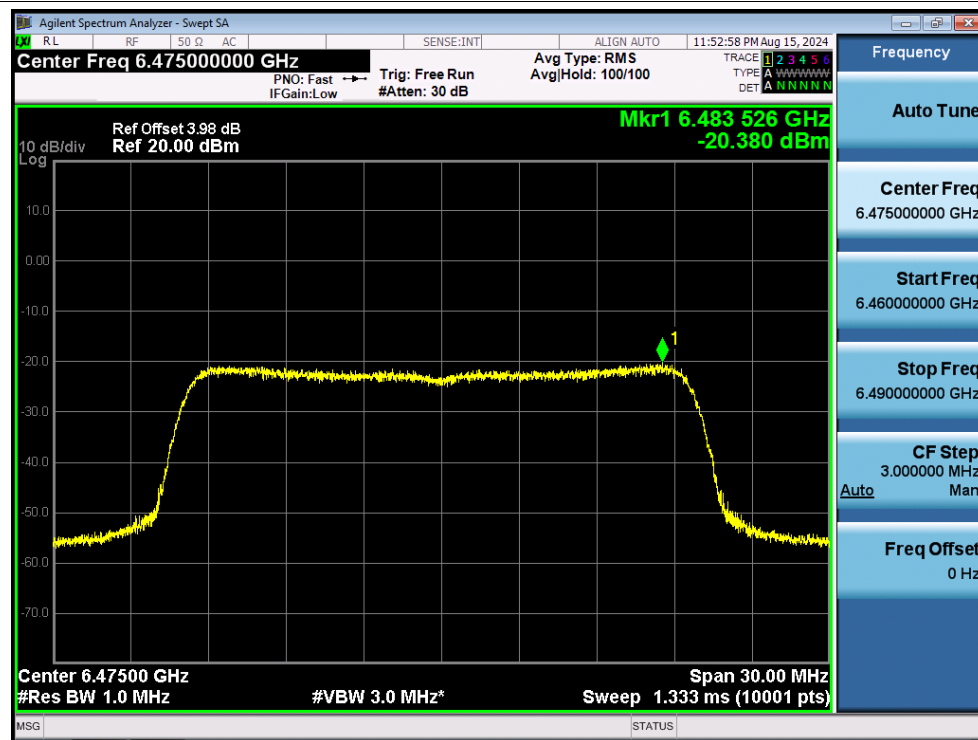


PSD NVNT ax20 6475MHz Ant3

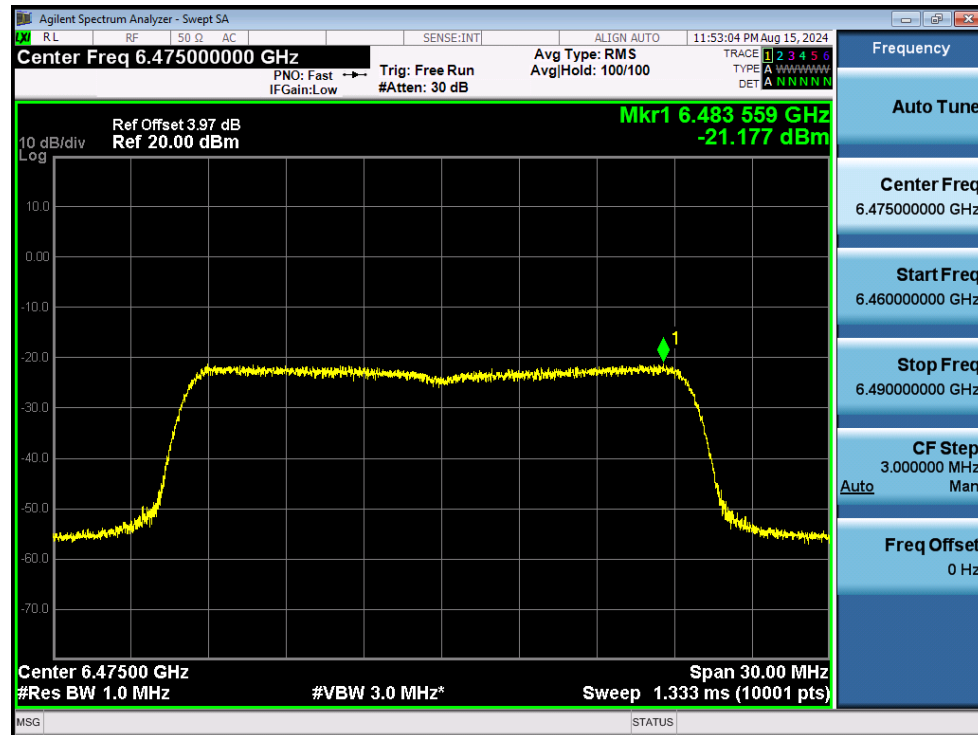


PSD NVNT ax20 6475MHz Ant4

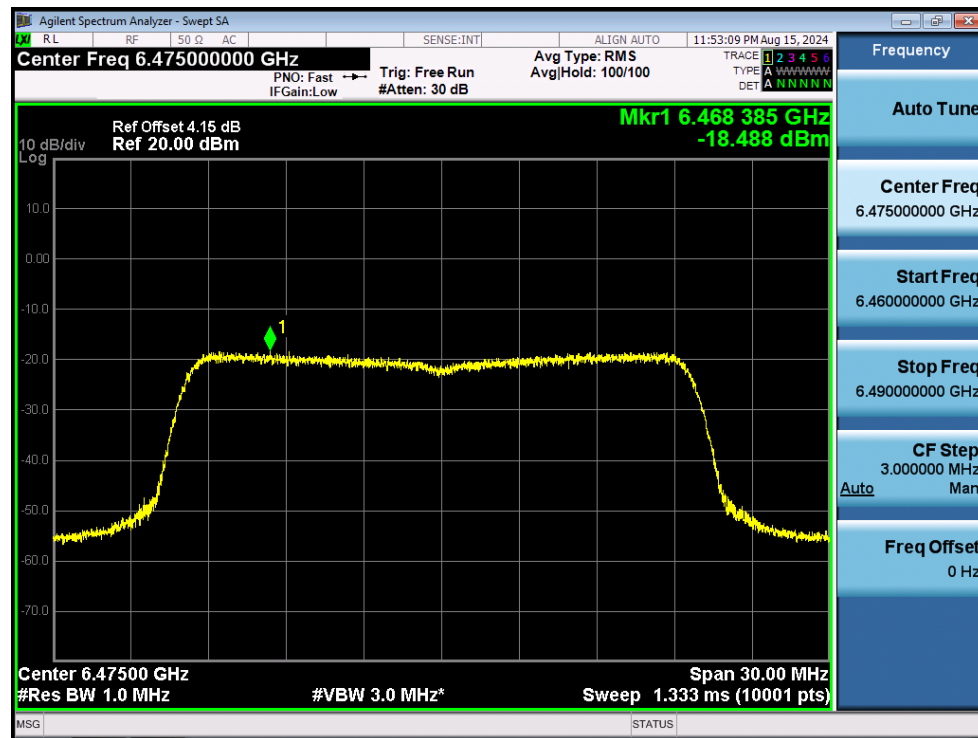


PSD NVNT ax20 6515MHz Ant1

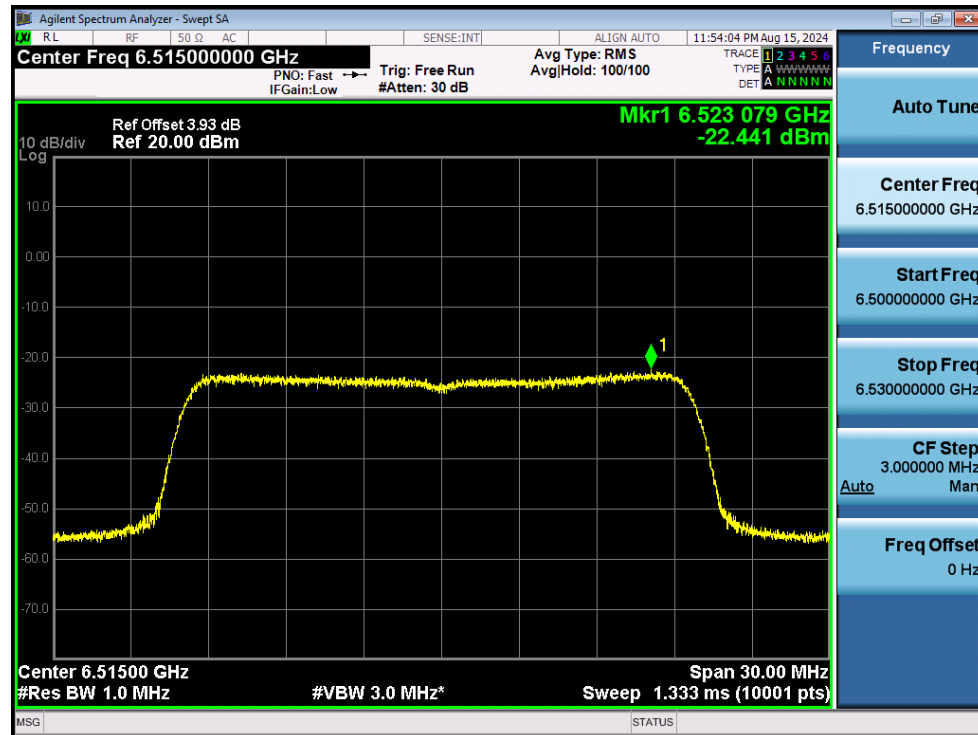


PSD NVNT ax20 6515MHz Ant2

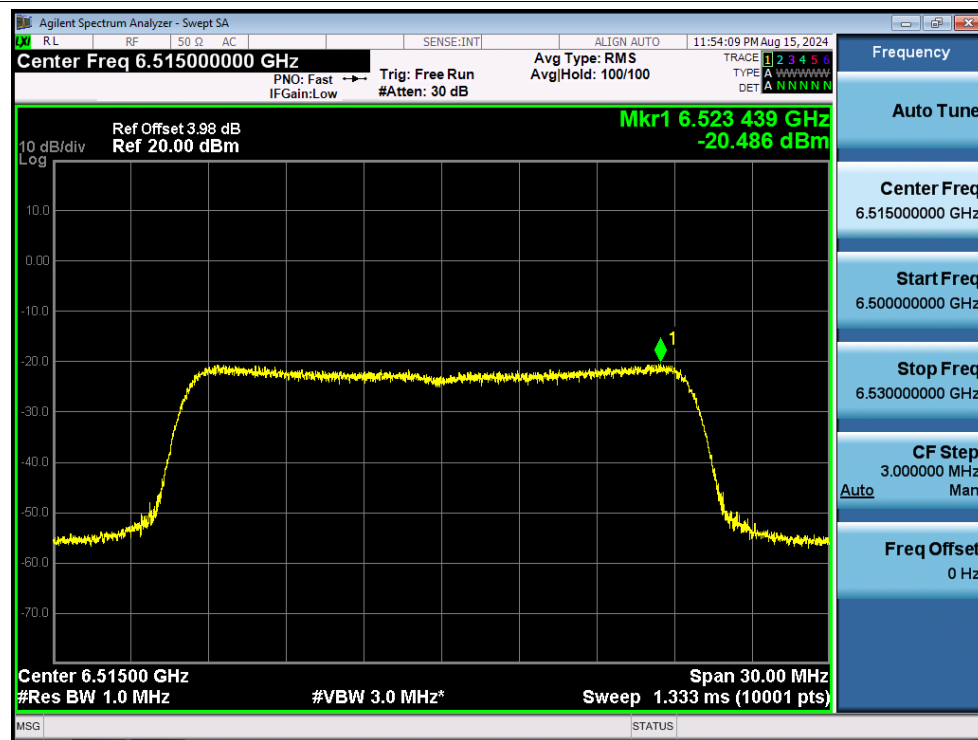


PSD NVNT ax20 6515MHz Ant3

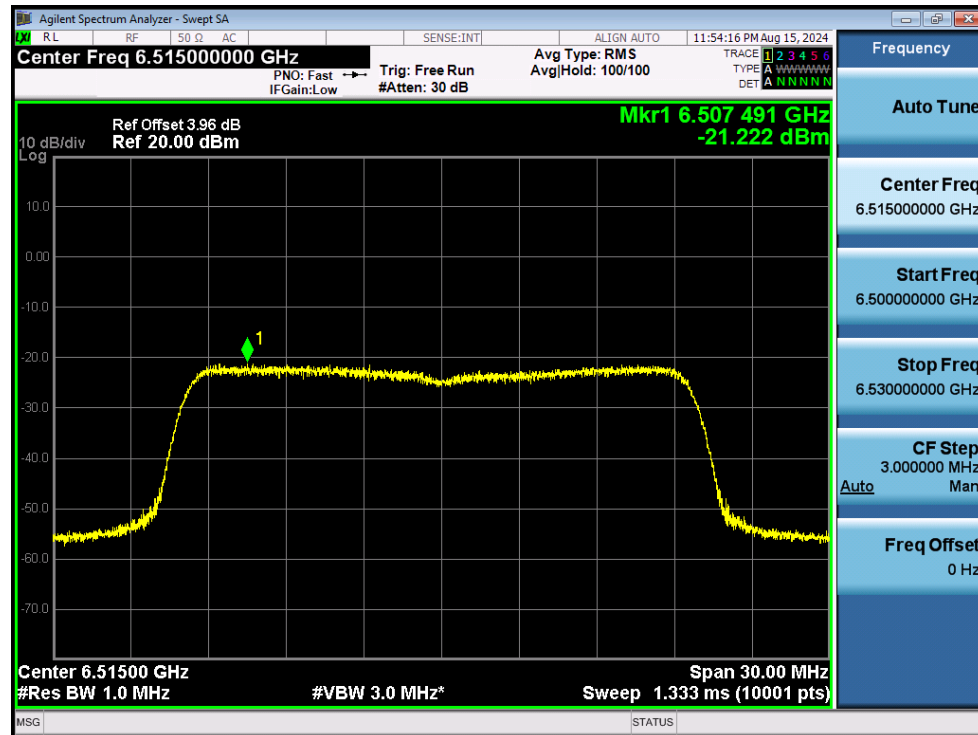


PSD NVNT ax20 6515MHz Ant4

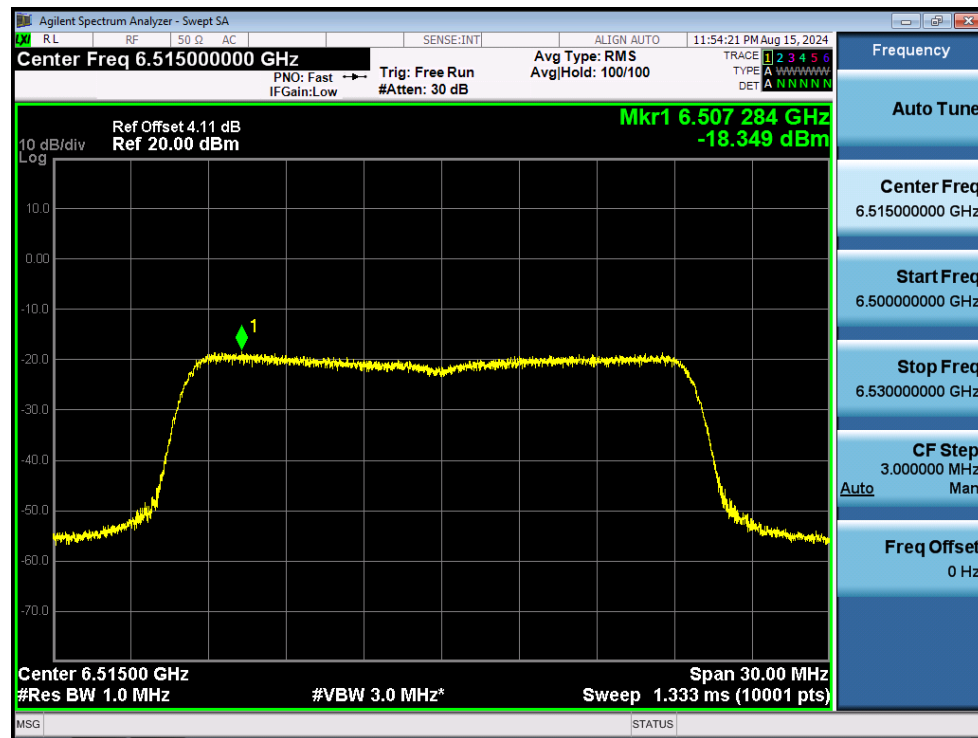


PSD NVNT ax20 6535MHz Ant1

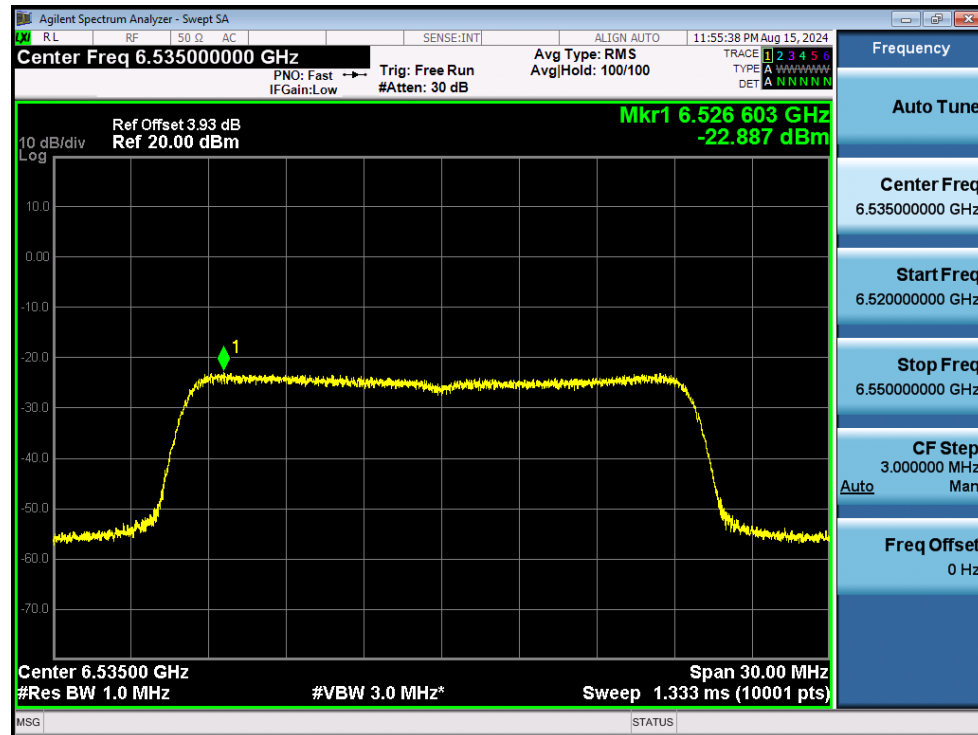


PSD NVNT ax20 6535MHz Ant2

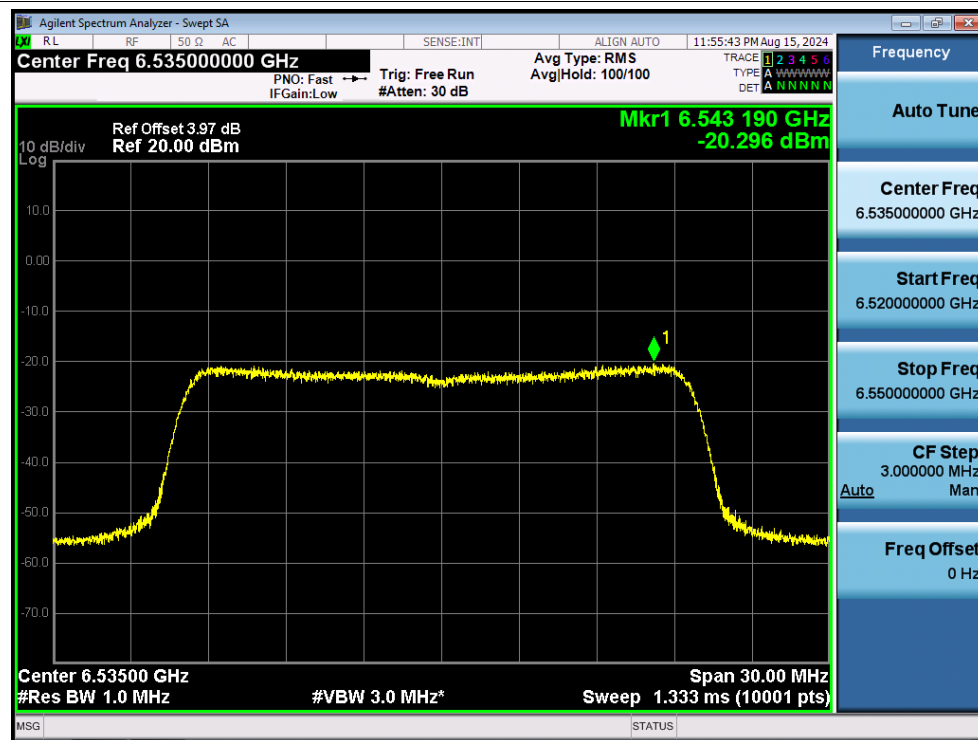


# PSD NVNT ax20 6535MHz Ant3

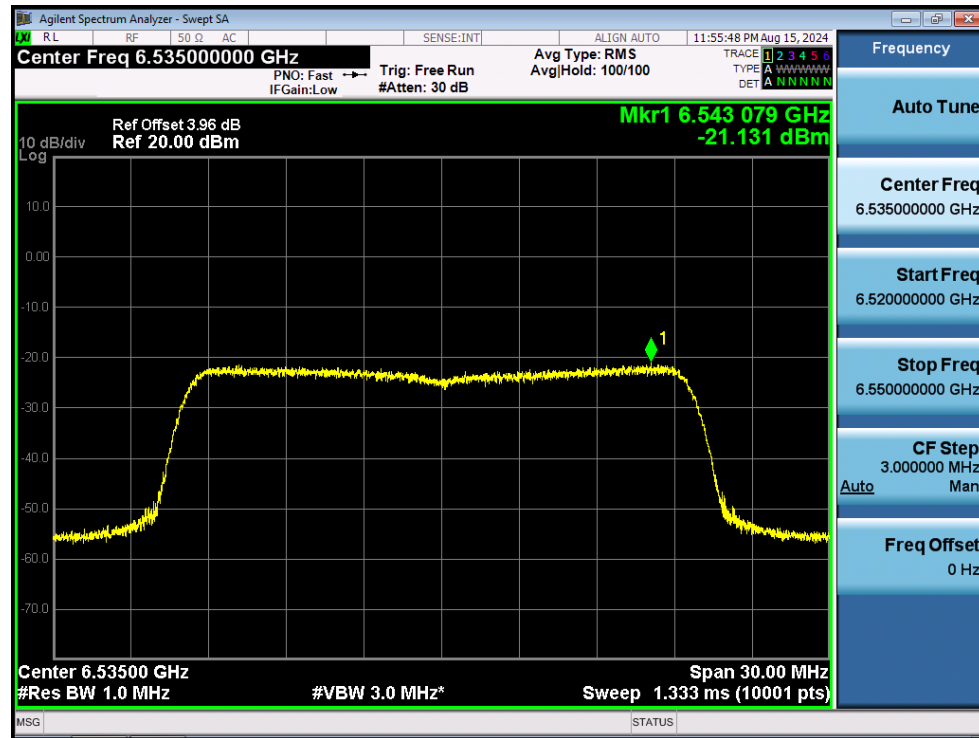


# PSD NVNT ax20 6535MHz Ant4

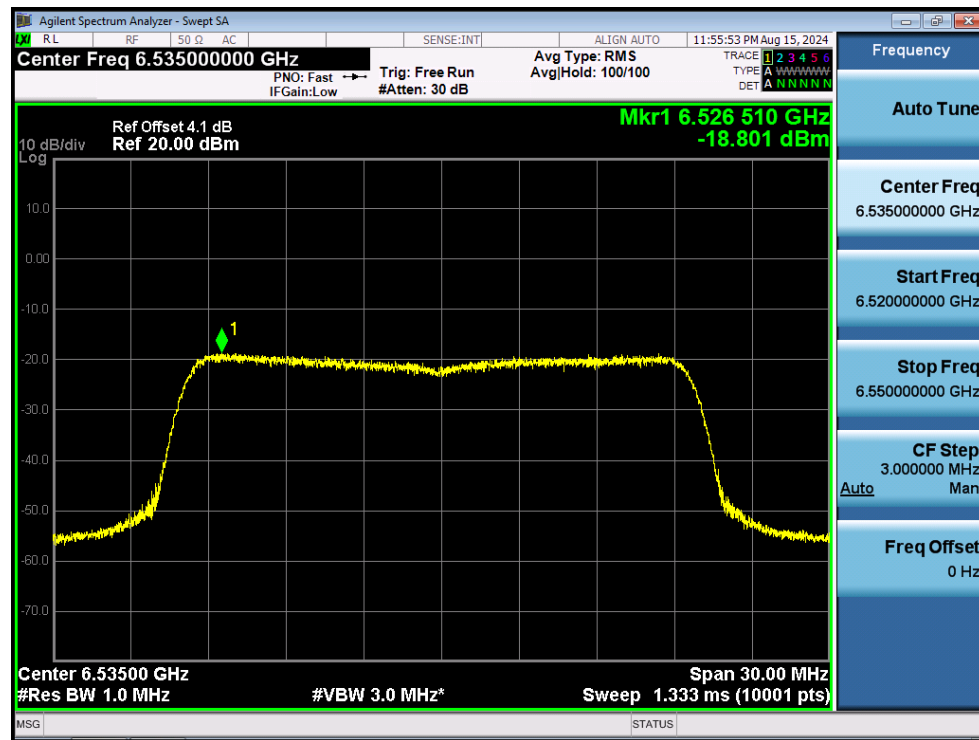


PSD NVNT ax20 6695MHz Ant1

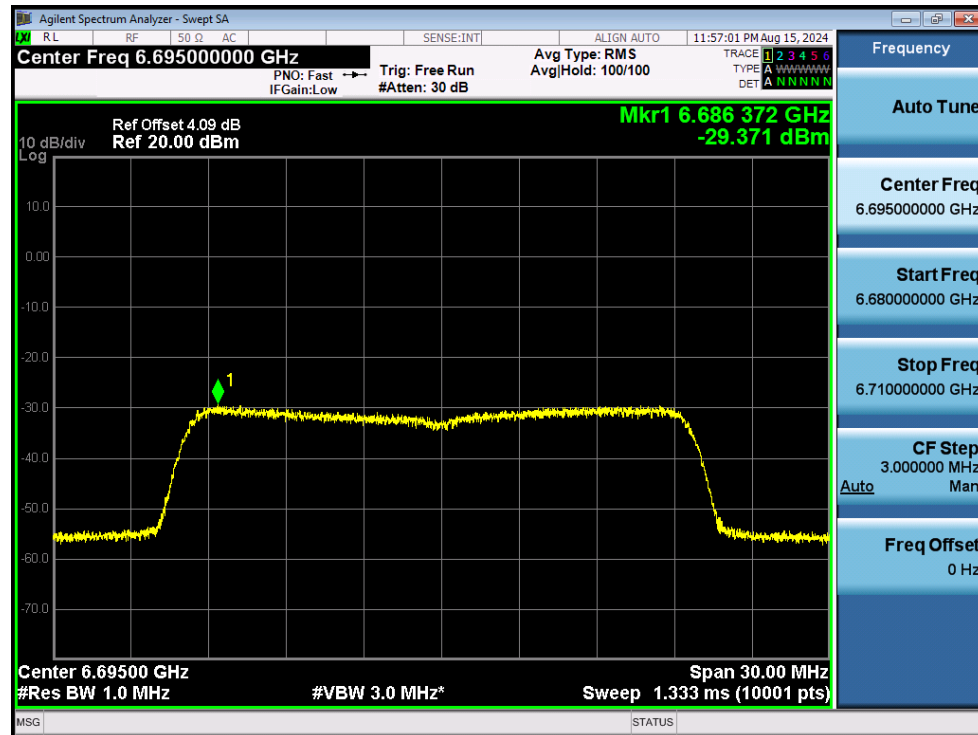


PSD NVNT ax20 6695MHz Ant2

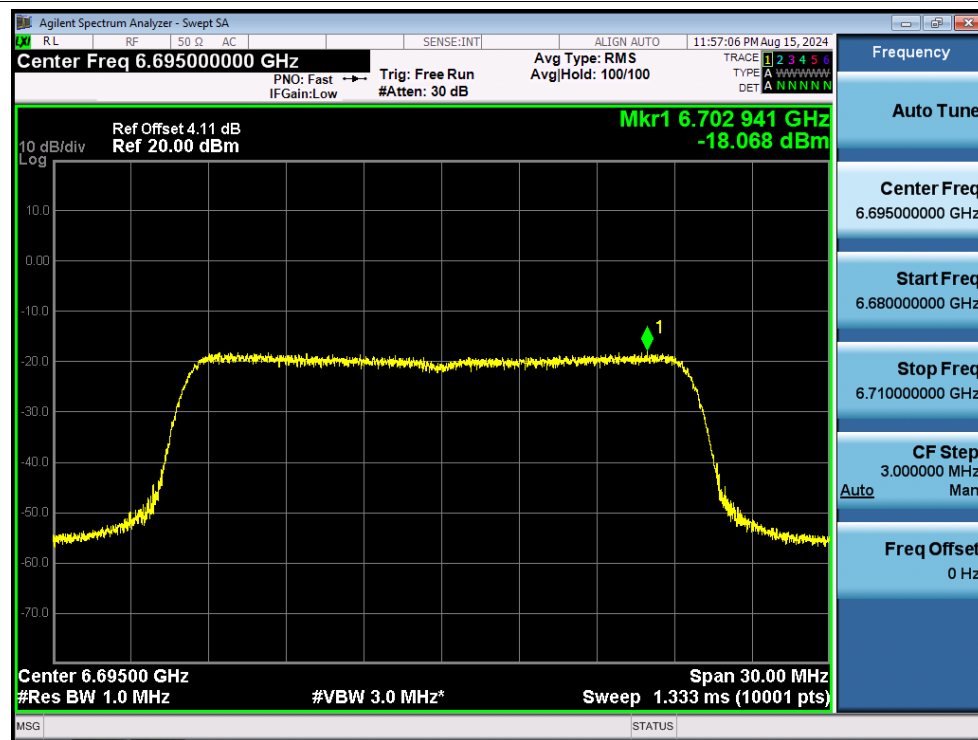


PSD NVNT ax20 6695MHz Ant3

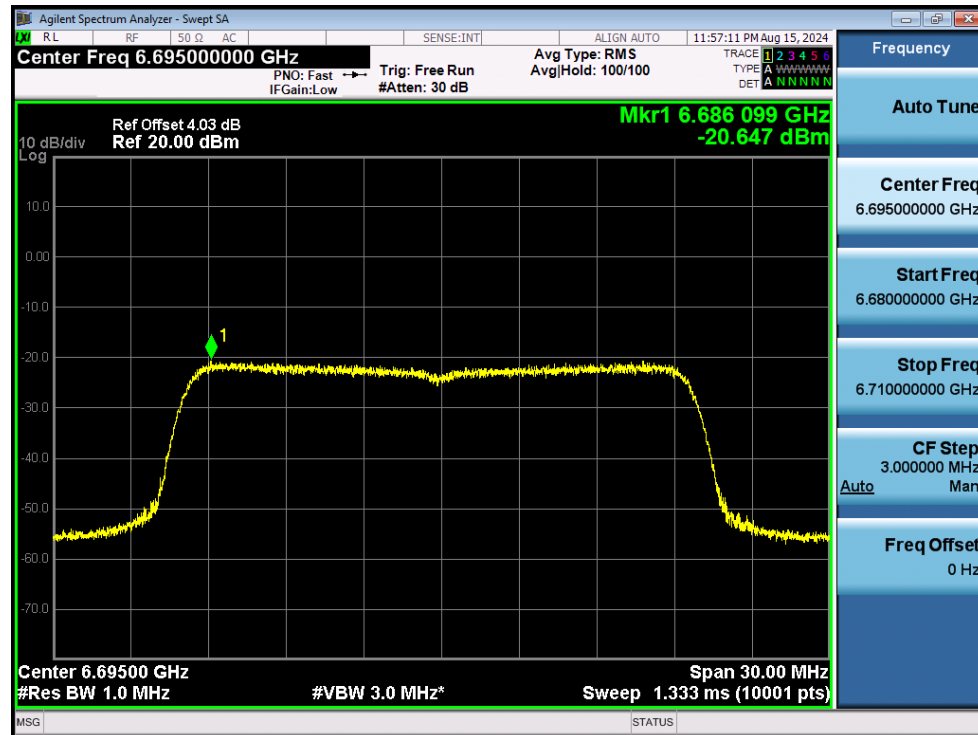


PSD NVNT ax20 6695MHz Ant4

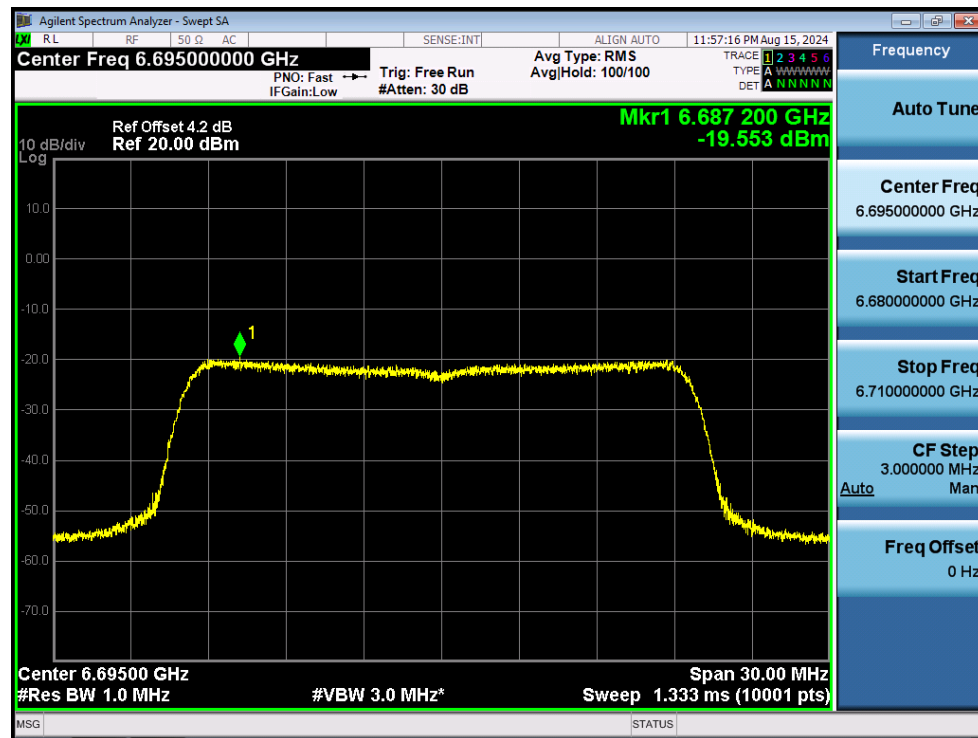


PSD NVNT ax20 6855MHz Ant1

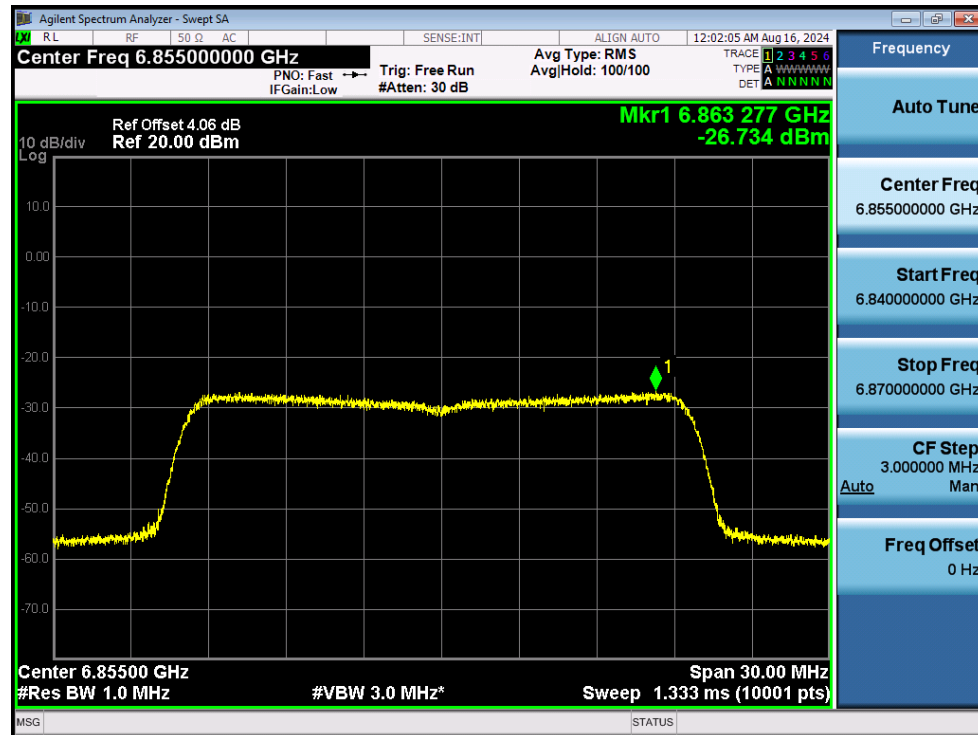


PSD NVNT ax20 6855MHz Ant2

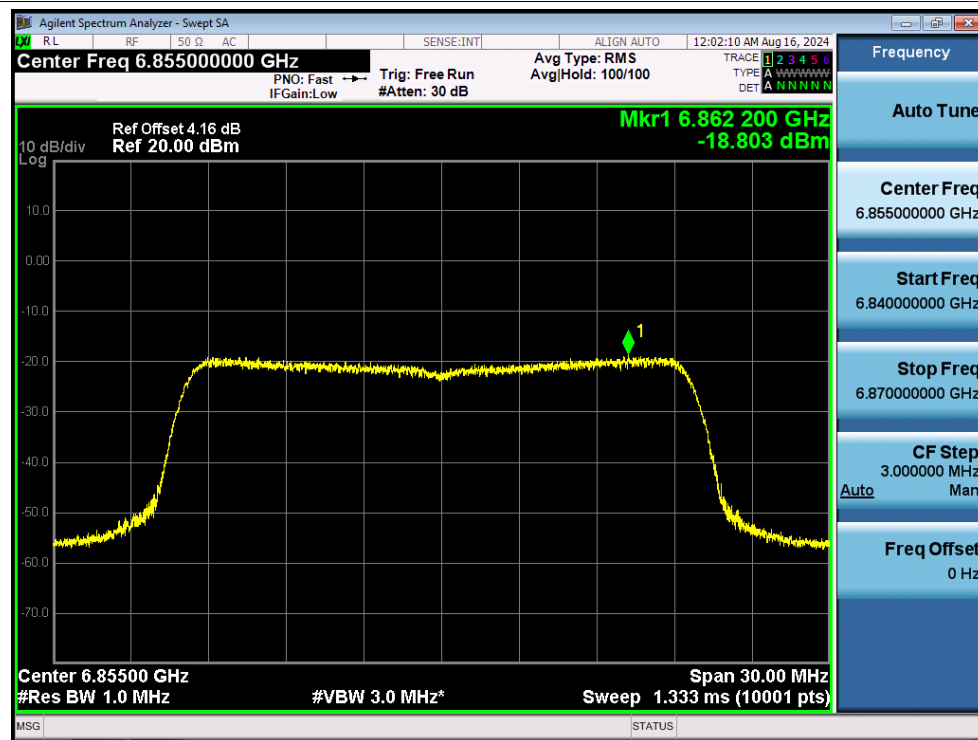


PSD NVNT ax20 6855MHz Ant3

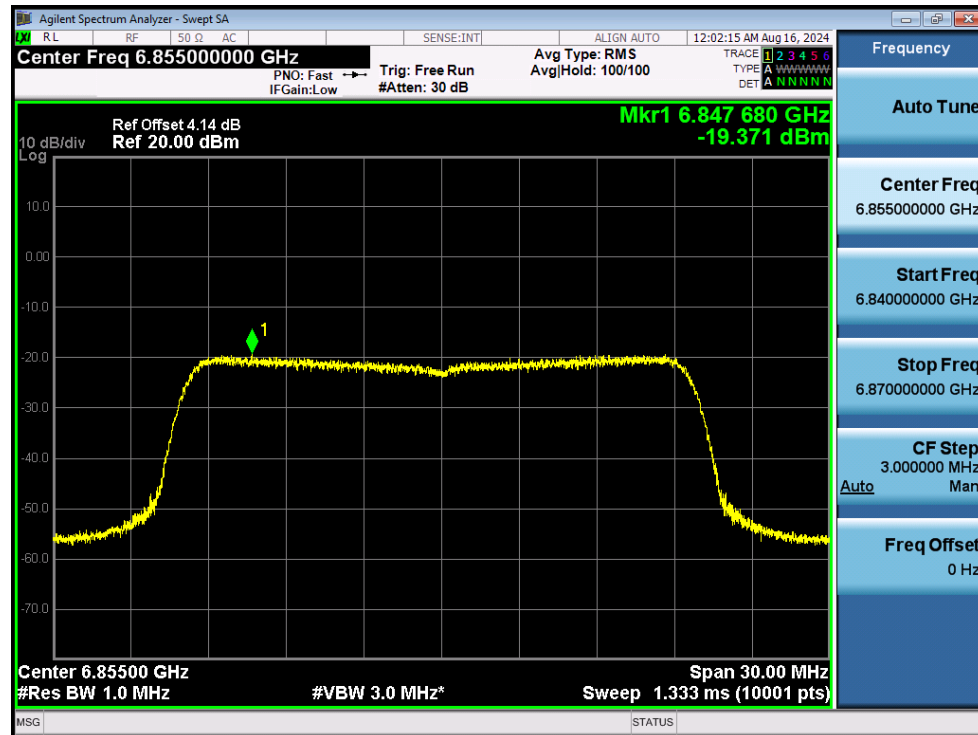


PSD NVNT ax20 6855MHz Ant4

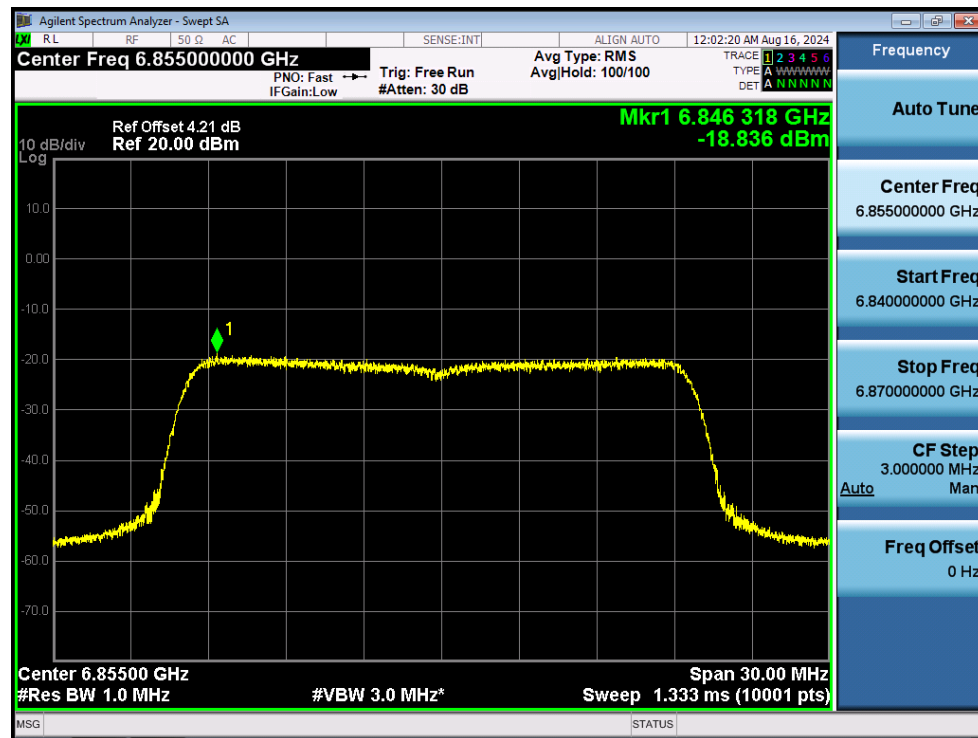


PSD NVNT ax20 6875MHz Ant1

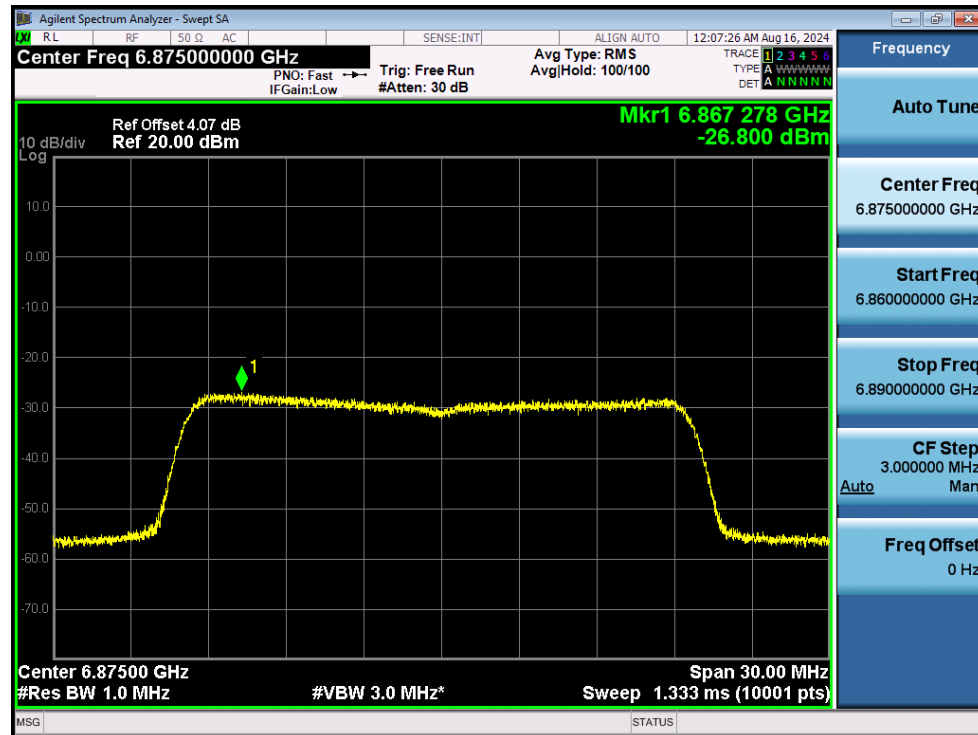


PSD NVNT ax20 6875MHz Ant2

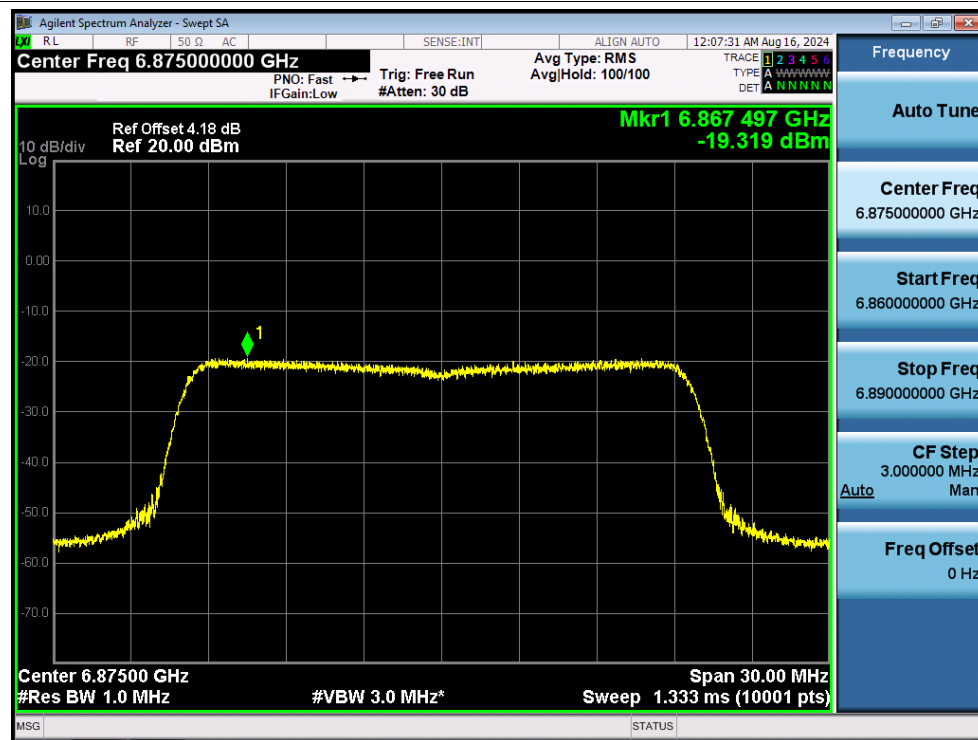


PSD NVNT ax20 6875MHz Ant3

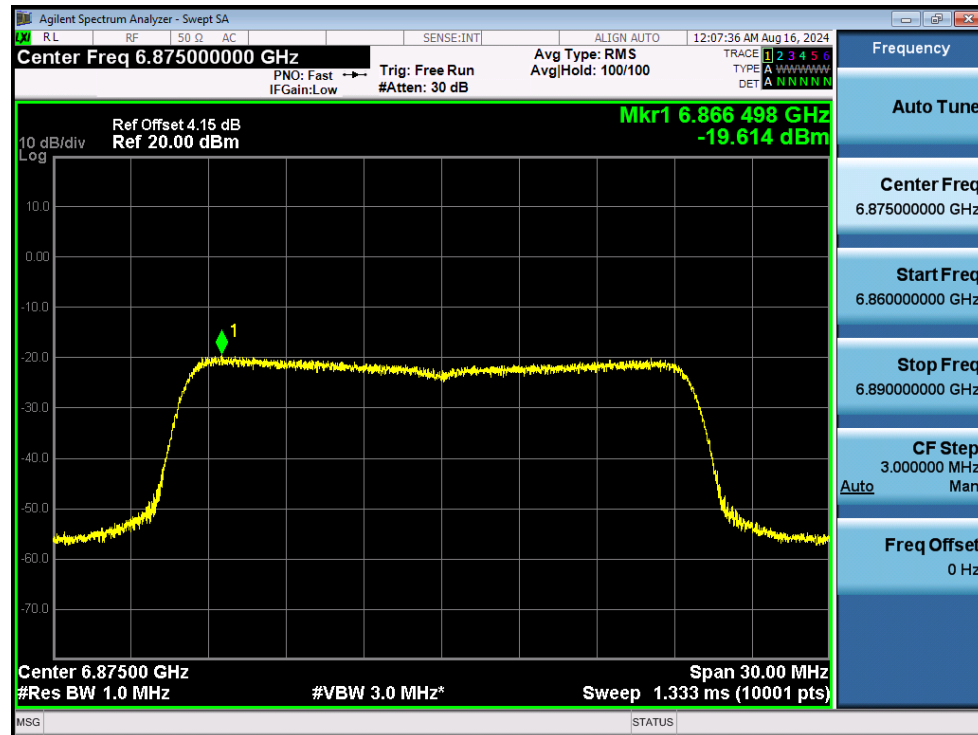


PSD NVNT ax20 6875MHz Ant4

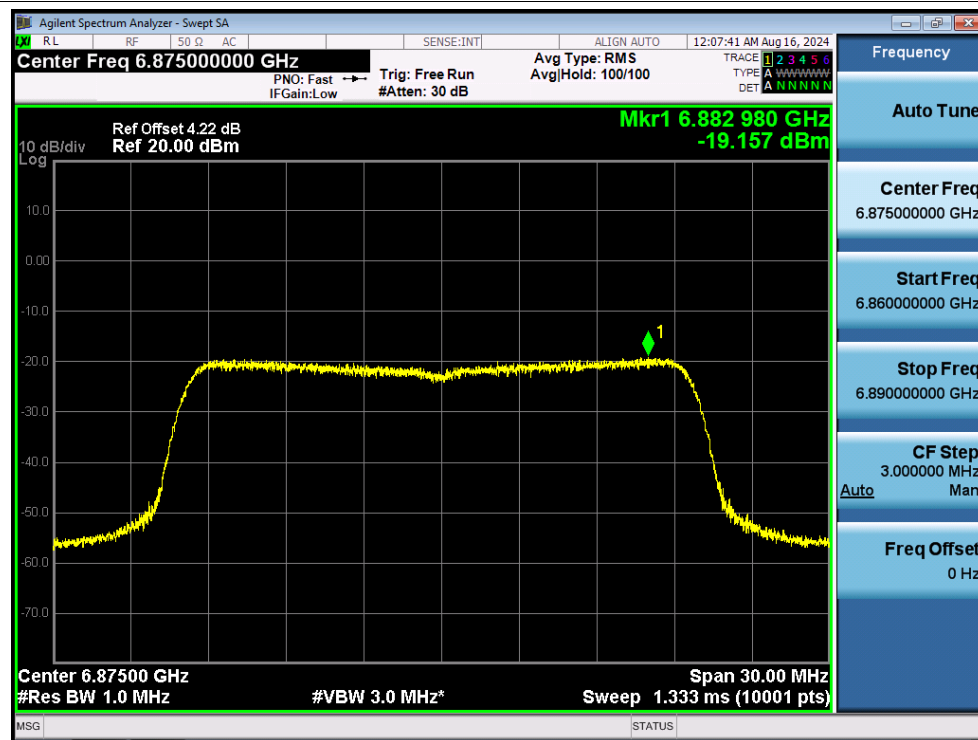


PSD NVNT ax20 6895MHz Ant1

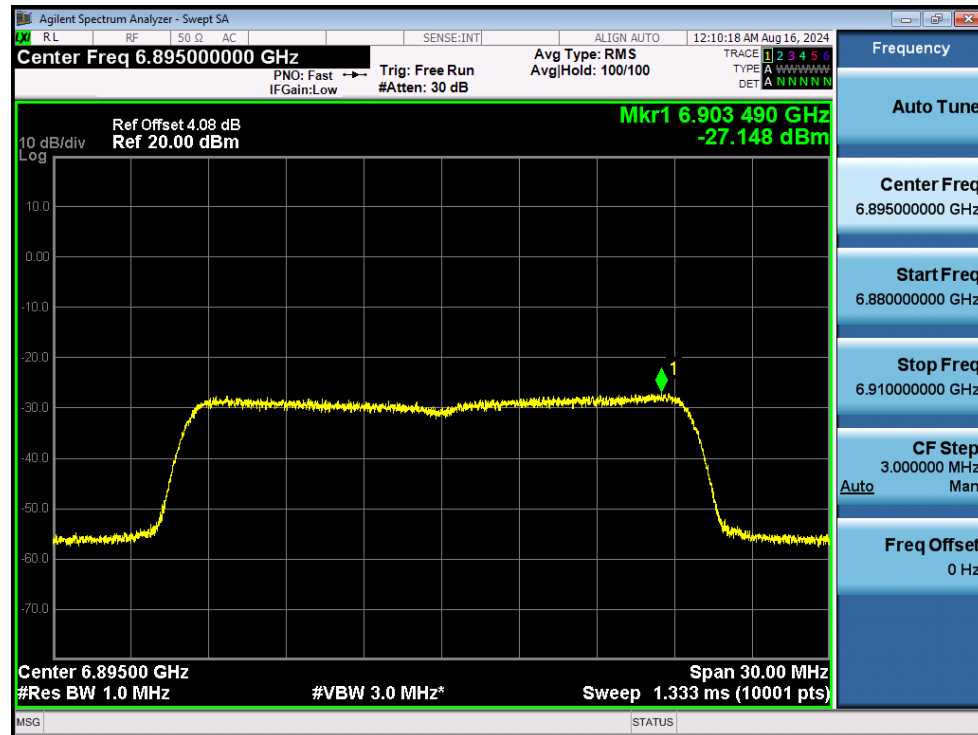


PSD NVNT ax20 6895MHz Ant2

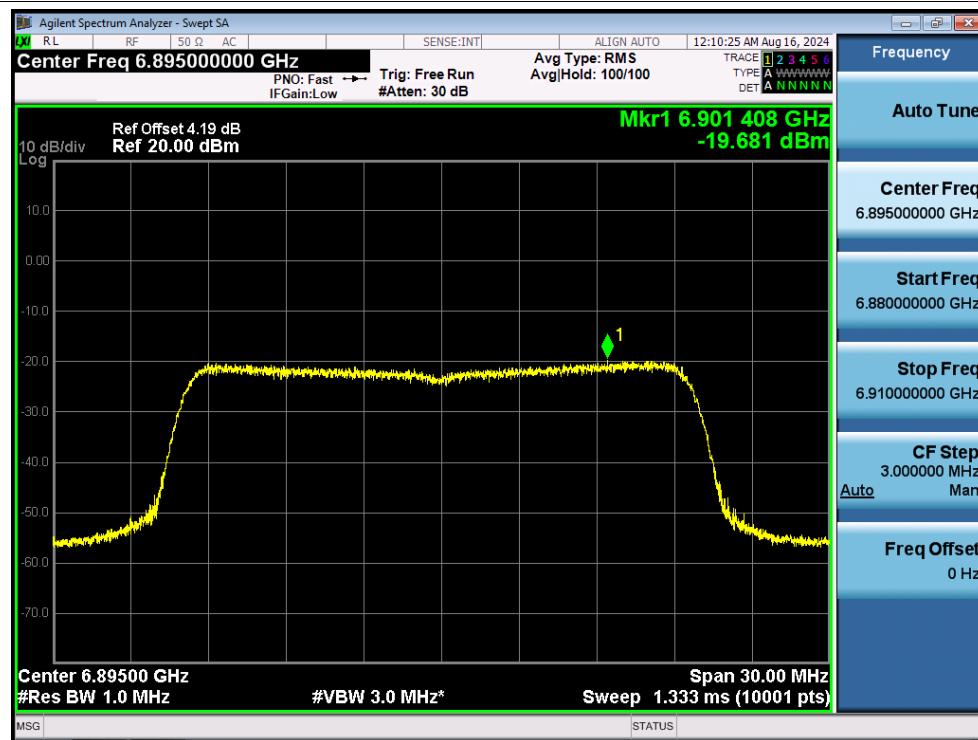


PSD NVNT ax20 6895MHz Ant3

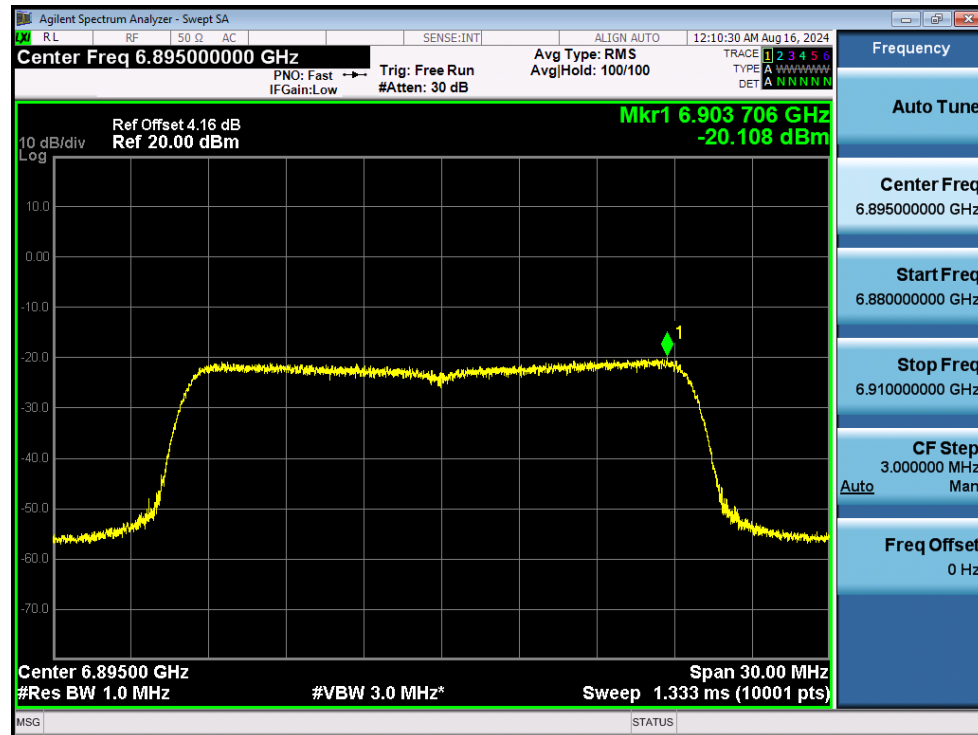


PSD NVNT ax20 6895MHz Ant4

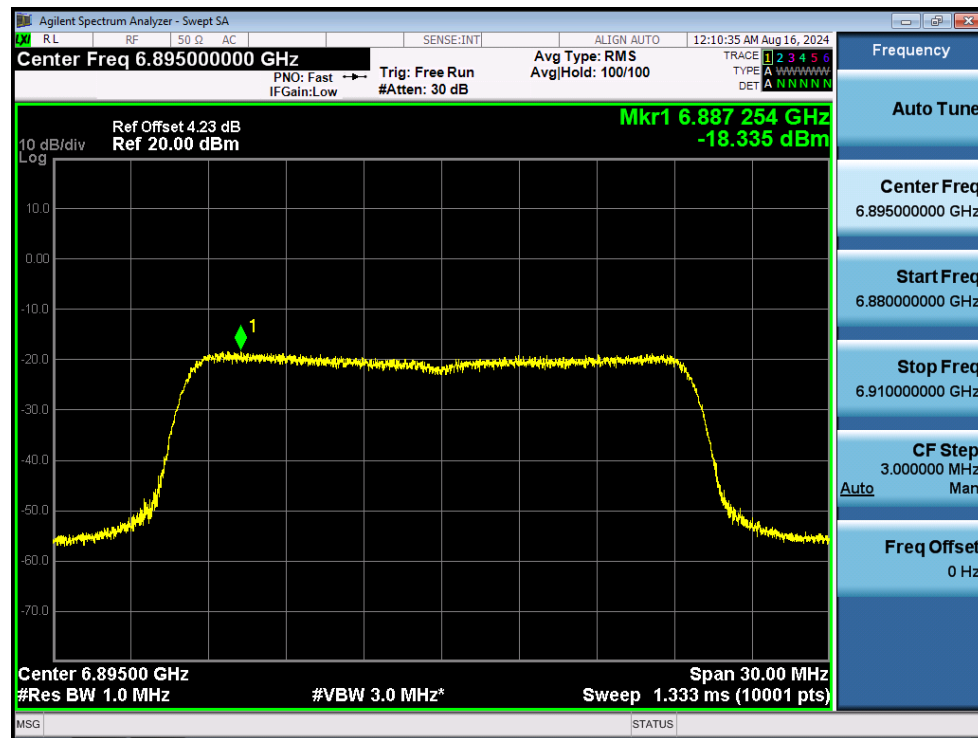


PSD NVNT ax20 6995MHz Ant1

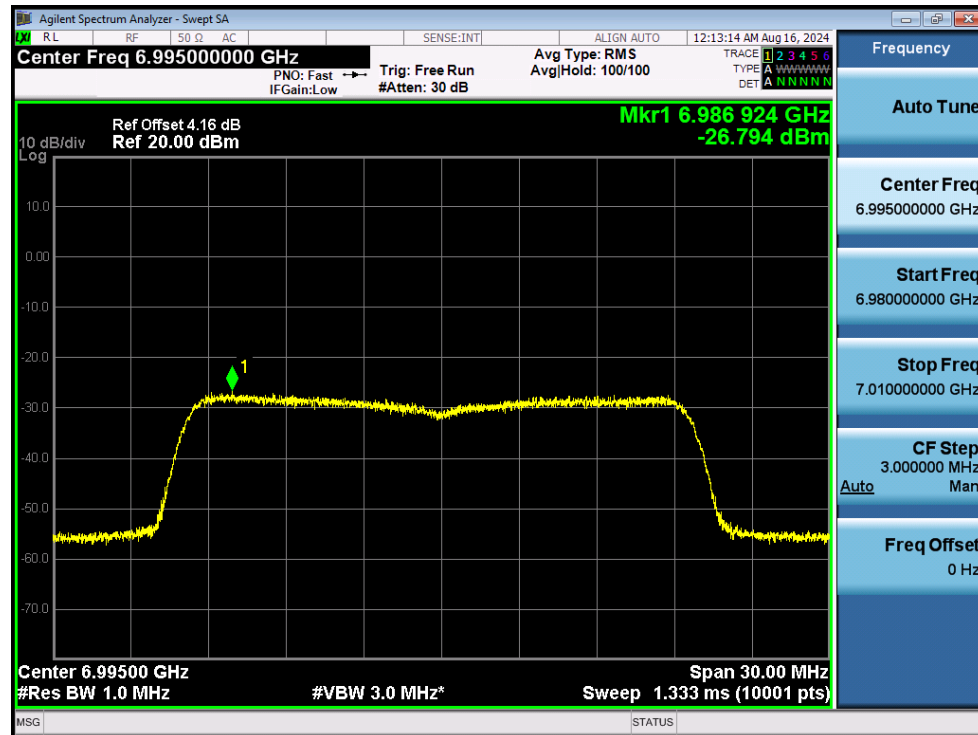


PSD NVNT ax20 6995MHz Ant2

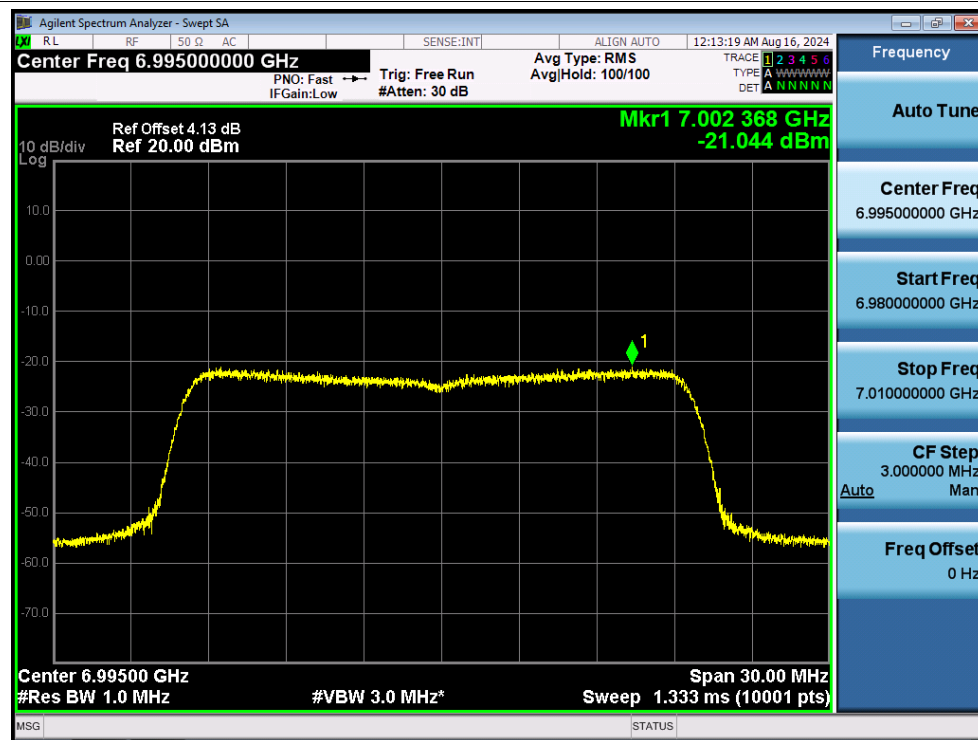


PSD NVNT ax20 6995MHz Ant3

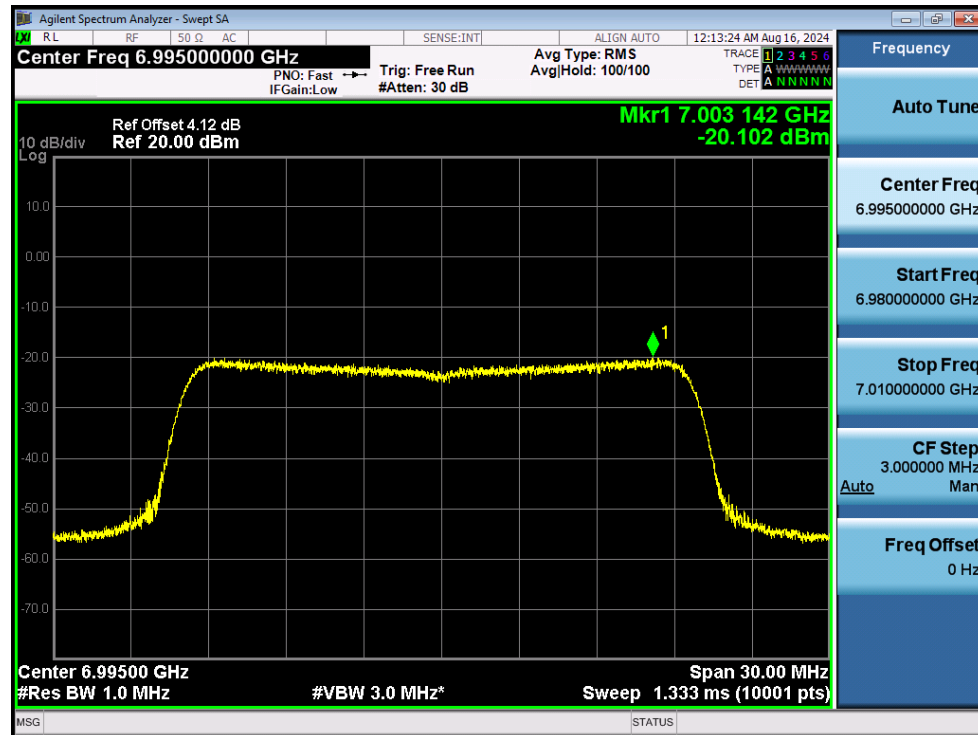


PSD NVNT ax20 6995MHz Ant4

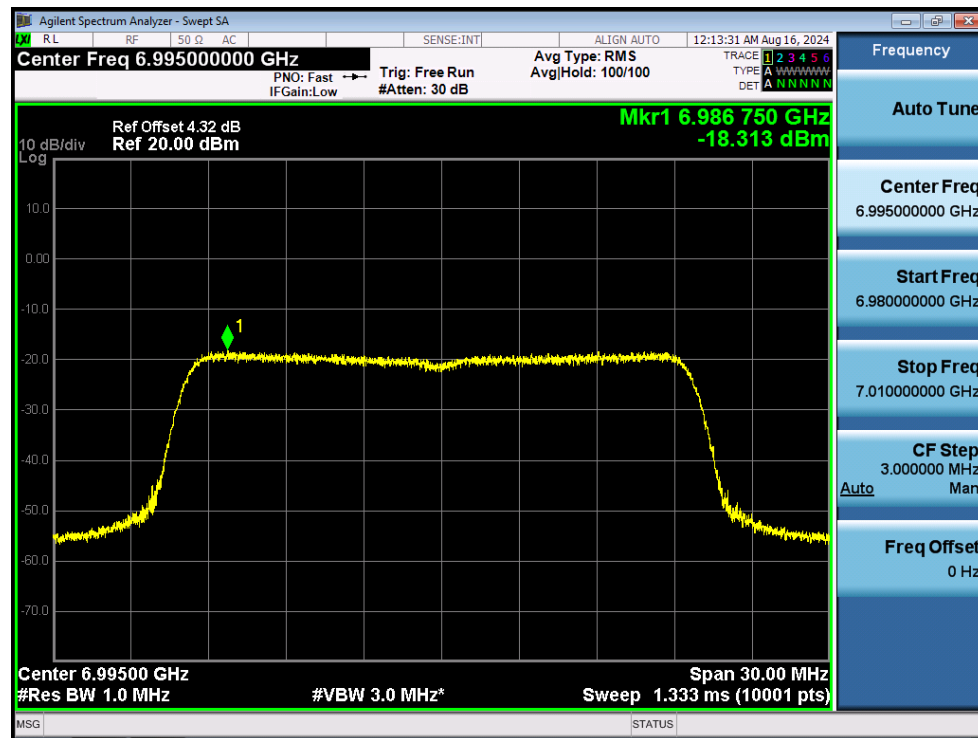


PSD NVNT ax20 7115MHz Ant1

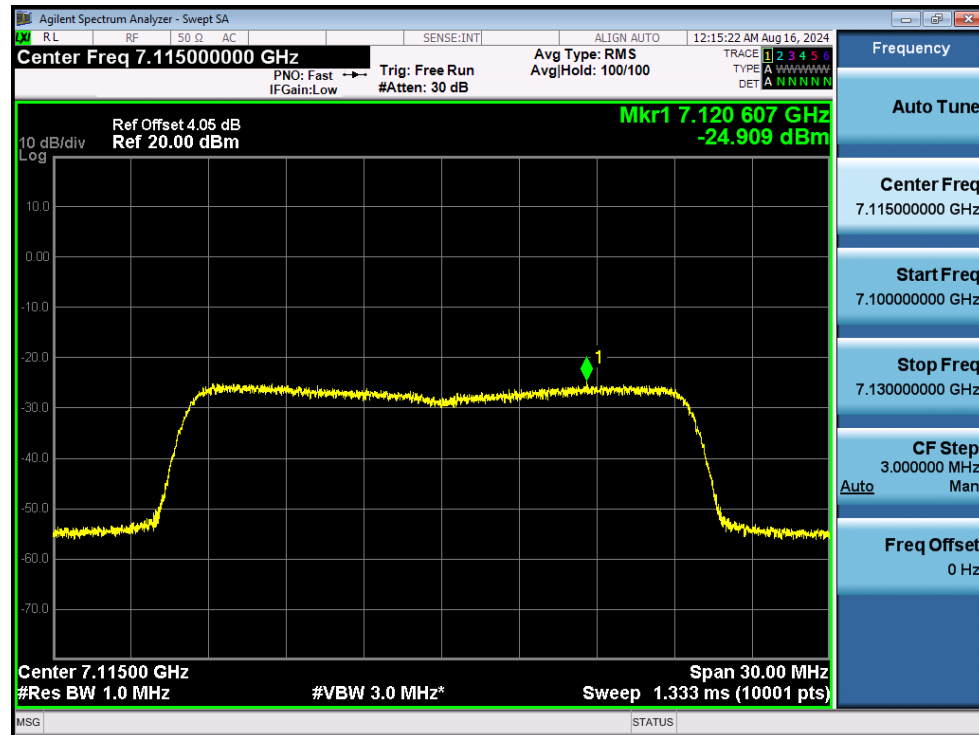


PSD NVNT ax20 7115MHz Ant2

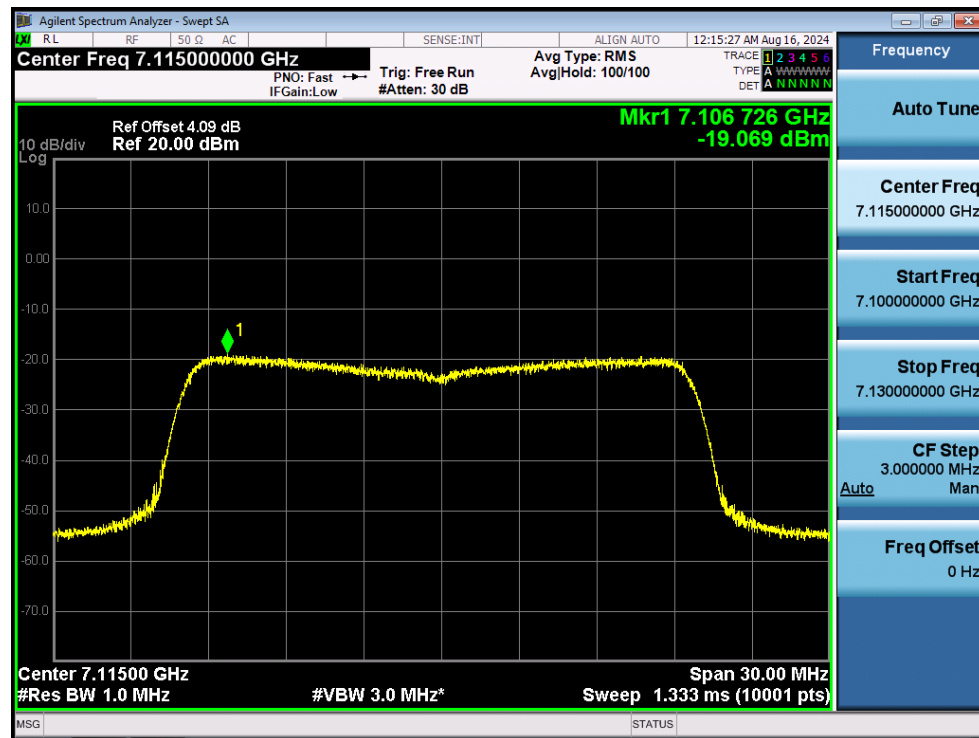


PSD NVNT ax20 7115MHz Ant3

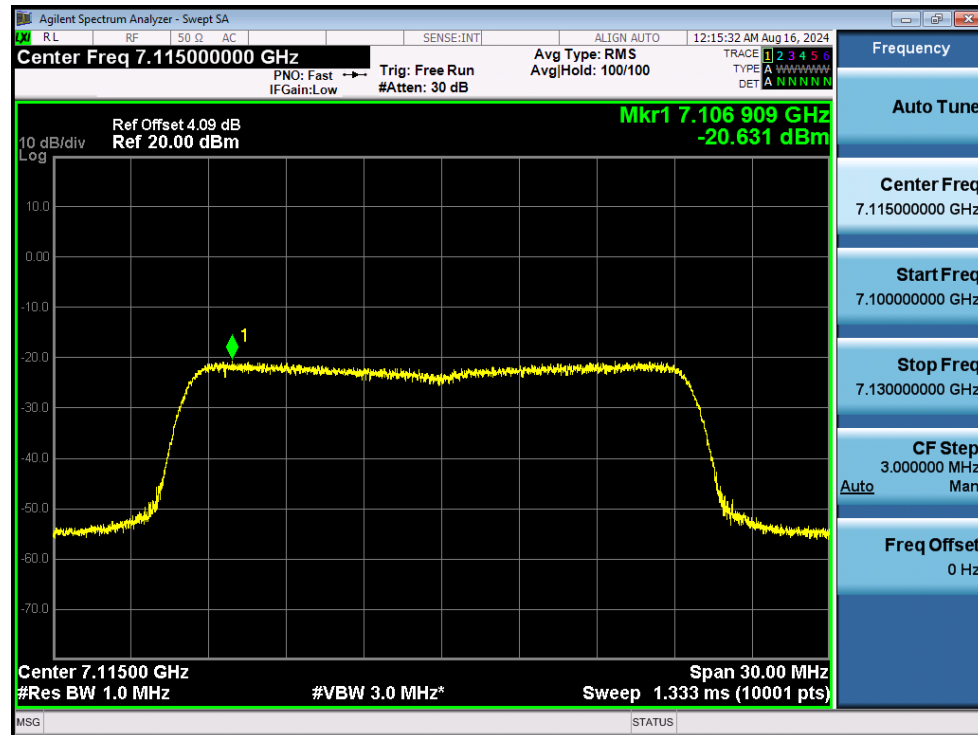


PSD NVNT ax20 7115MHz Ant4

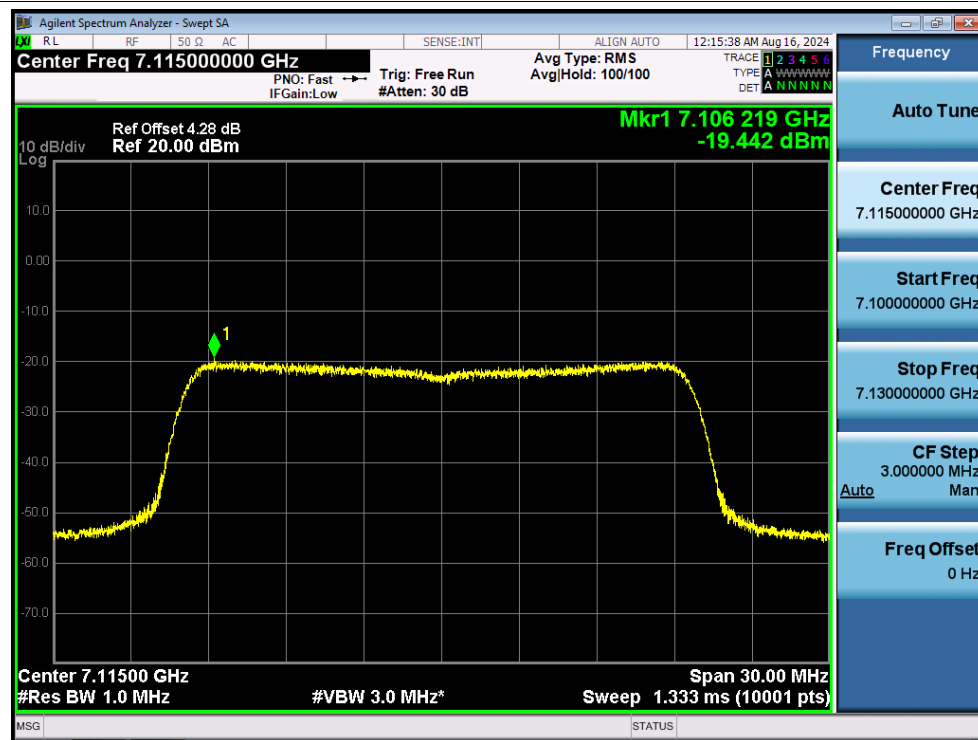


PSD NVNT ax20 5955MHz Ant1

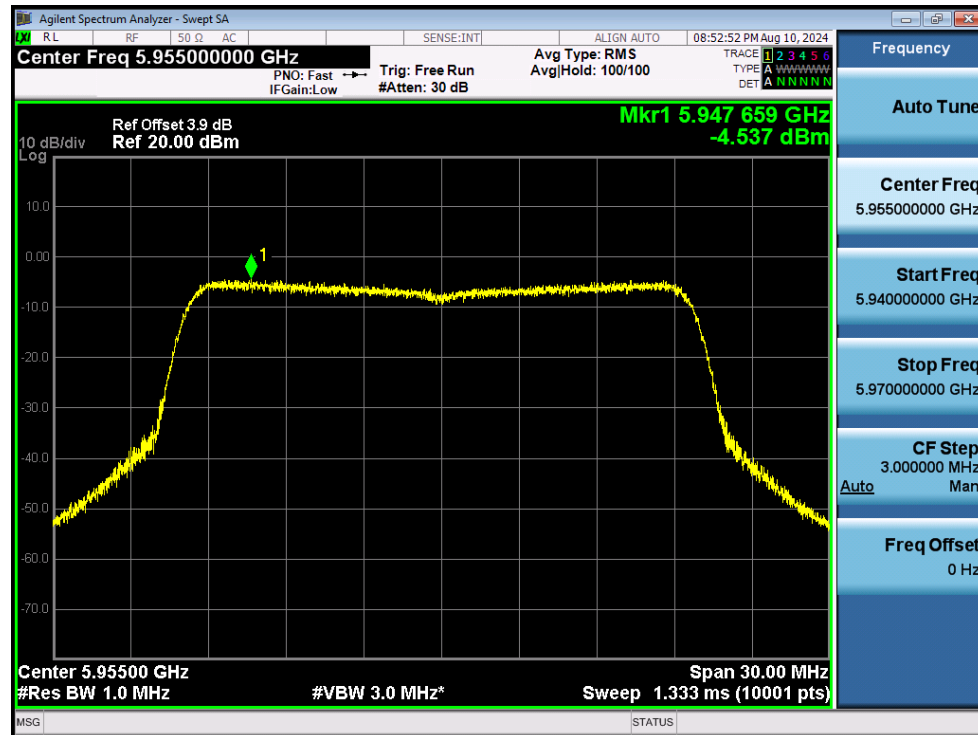


PSD NVNT ax20 6175MHz Ant1

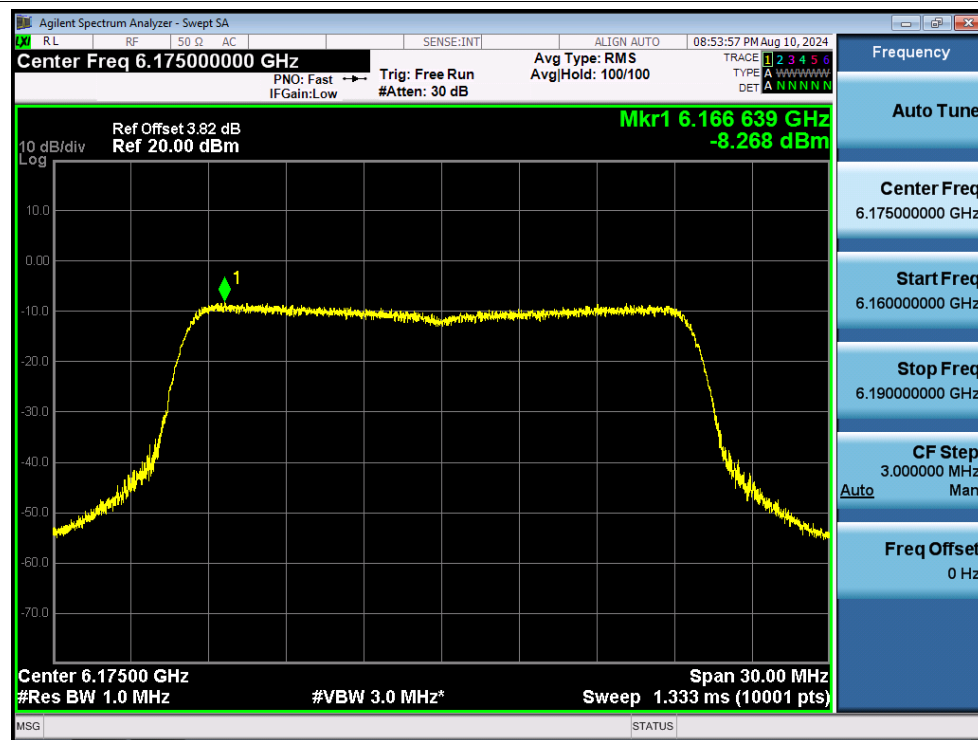


PSD NVNT ax20 6415MHz Ant1

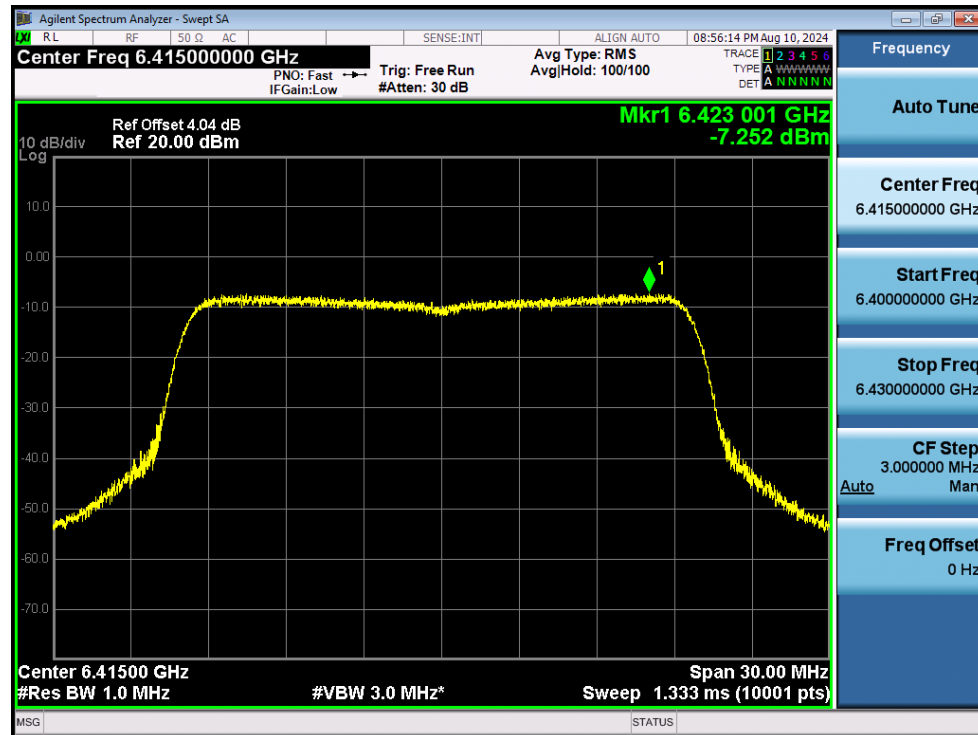


PSD NVNT ax20 6435MHz Ant1

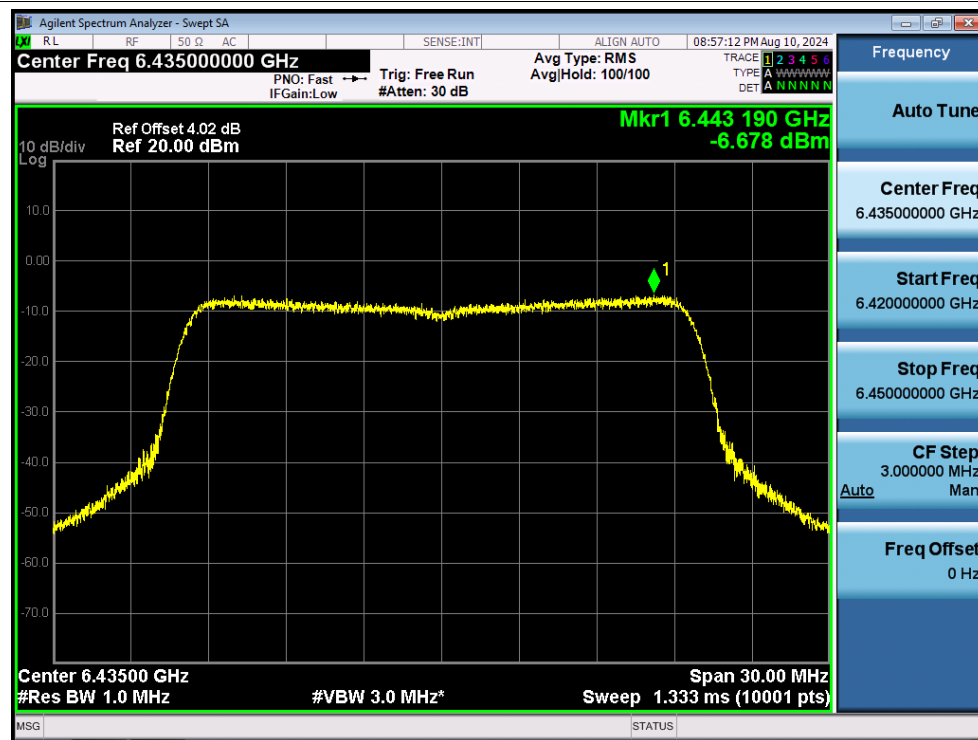


PSD NVNT ax20 6475MHz Ant1

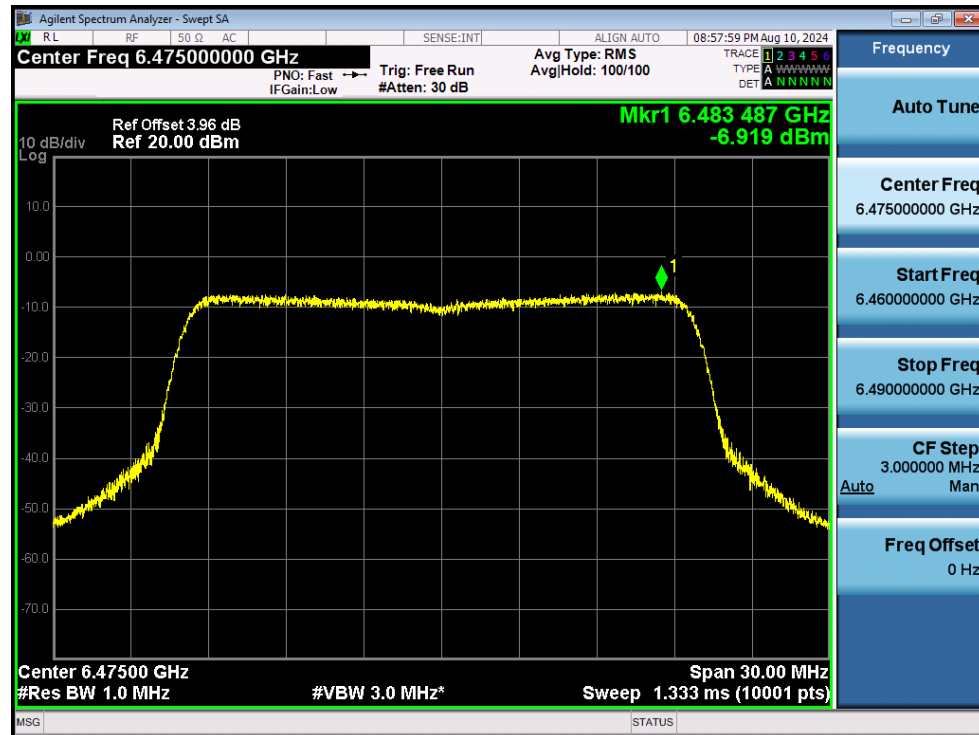


PSD NVNT ax20 6515MHz Ant1

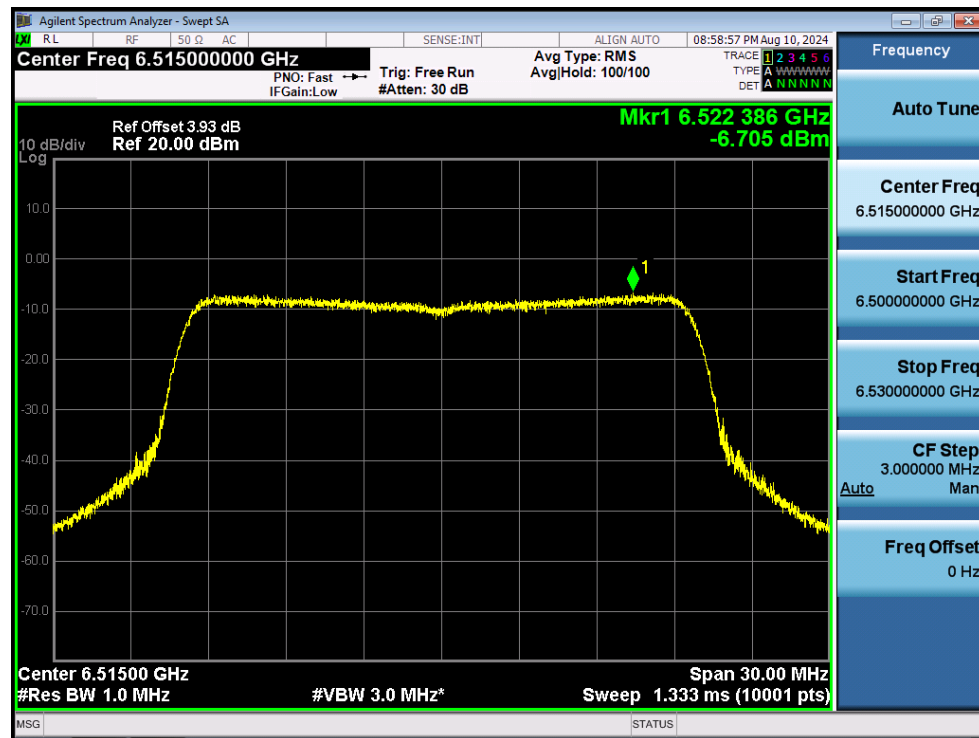


PSD NVNT ax20 6535MHz Ant1

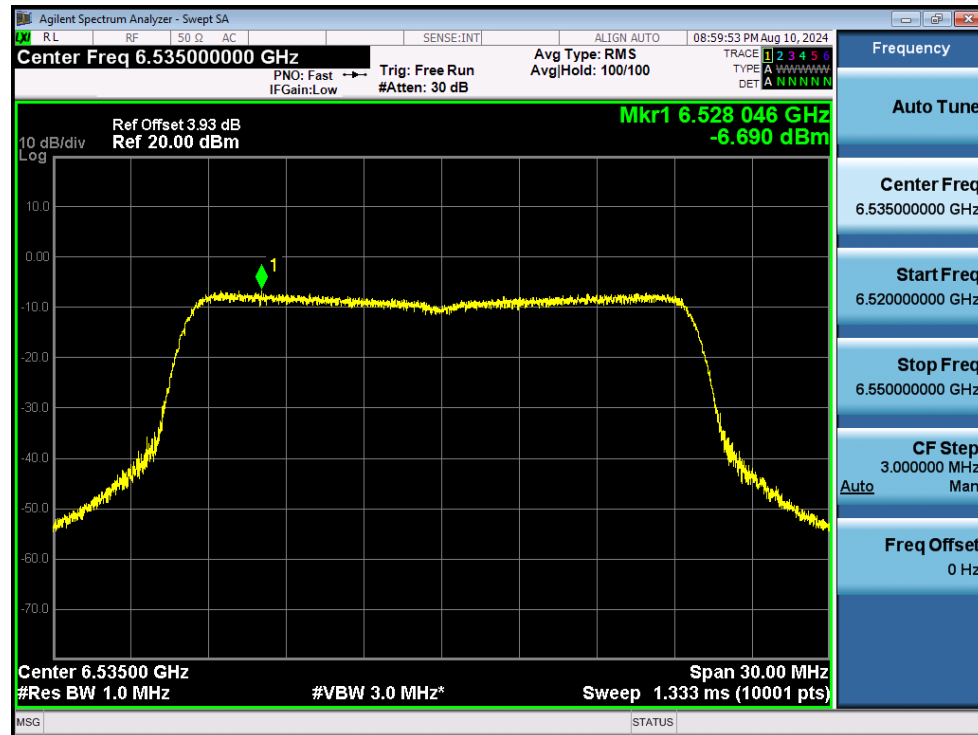

PSD NVNT ax20 6695MHz Ant1

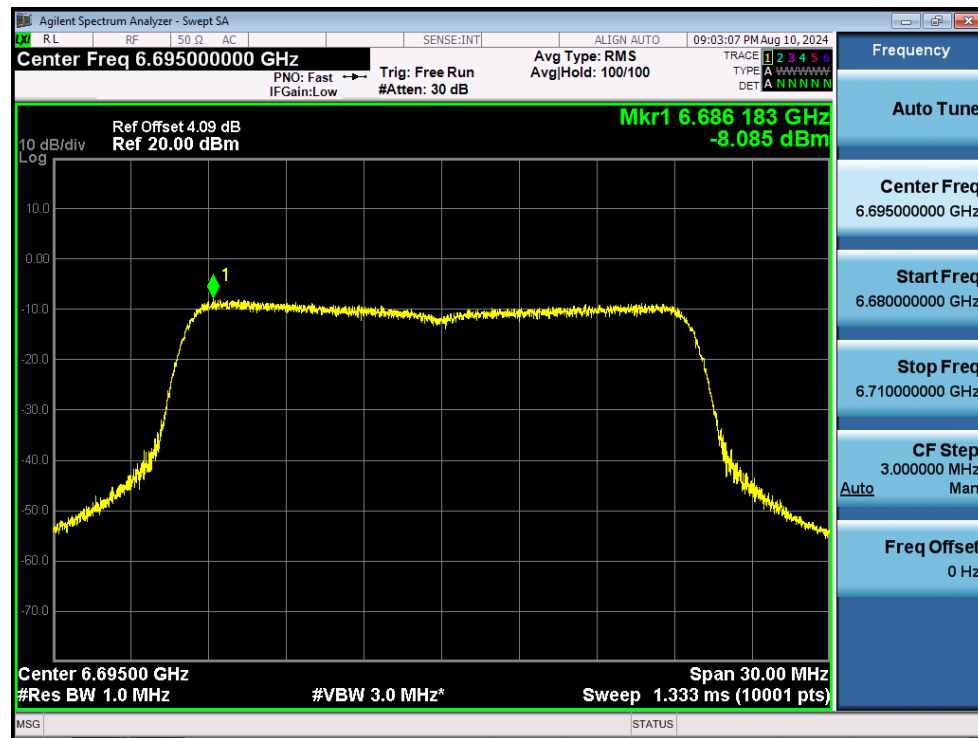


# PSD NVNT ax20 6855MHz Ant1

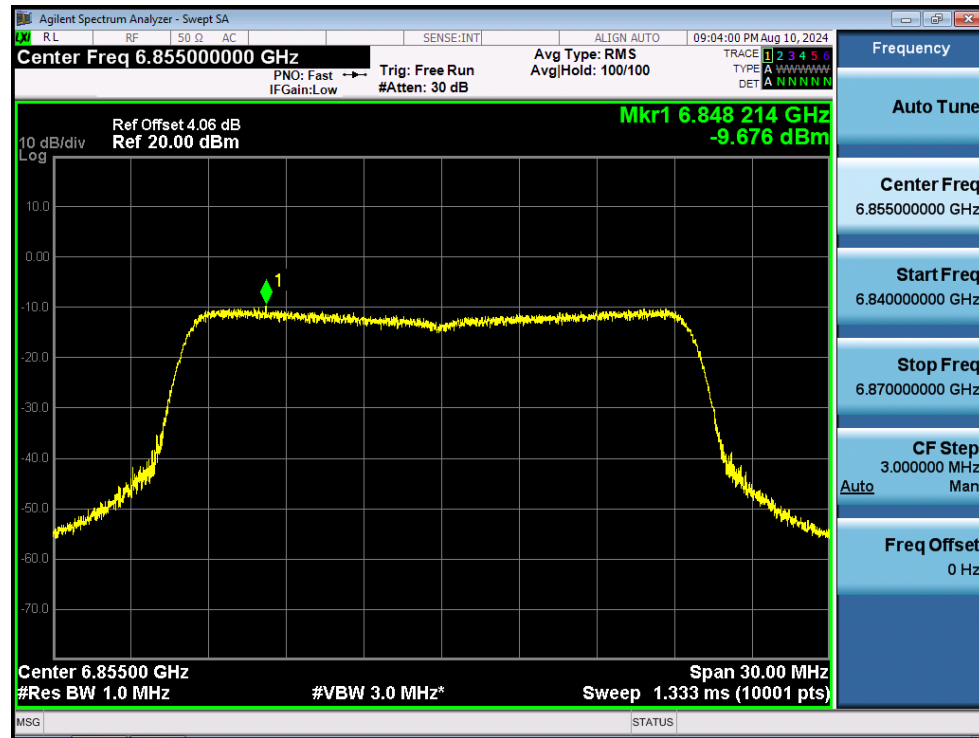


# PSD NVNT ax20 6875MHz Ant1




PSD NVNT ax20 6895MHz Ant1

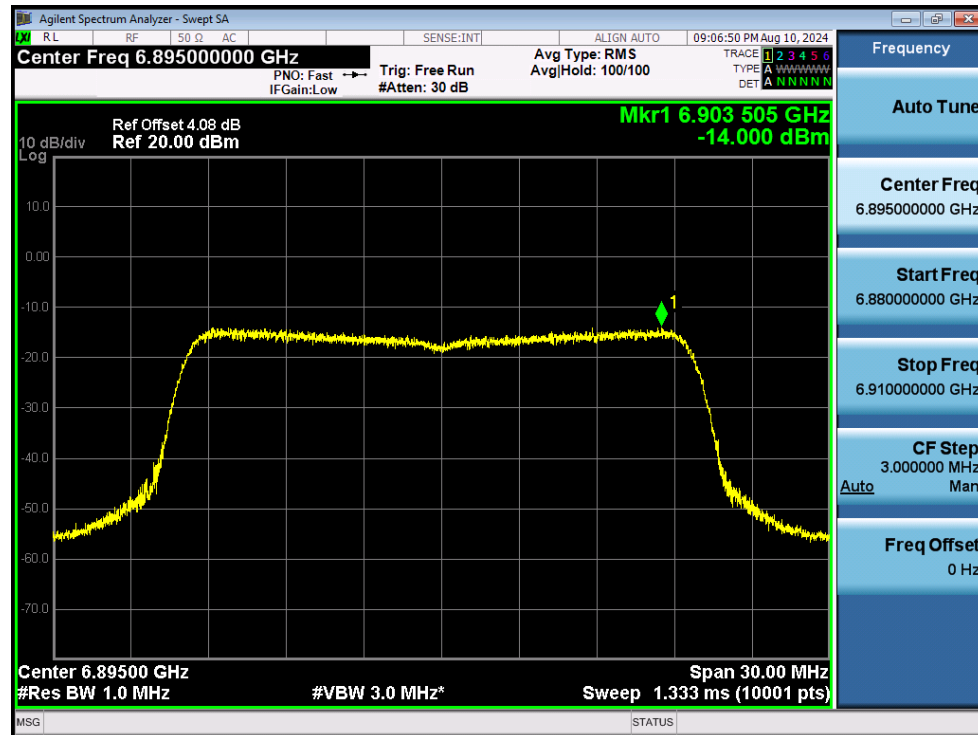

PSD NVNT ax20 6995MHz Ant1

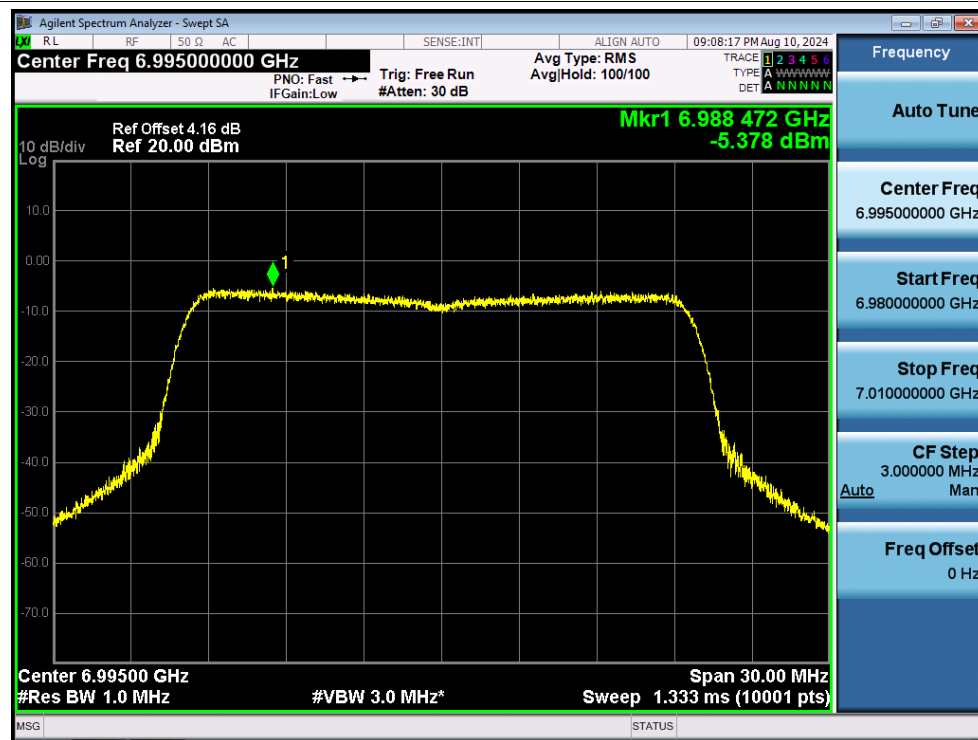


PSD NVNT ax20 7115MHz Ant1

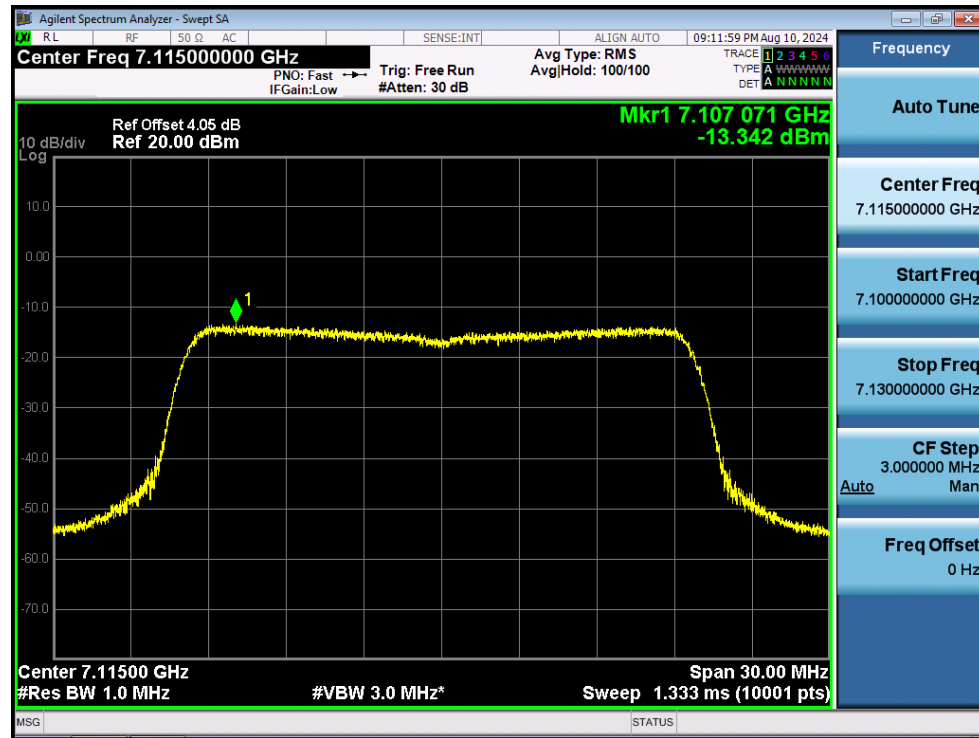


PSD NVNT ax20 5955MHz Ant2



# PSD NVNT ax20 6175MHz Ant2

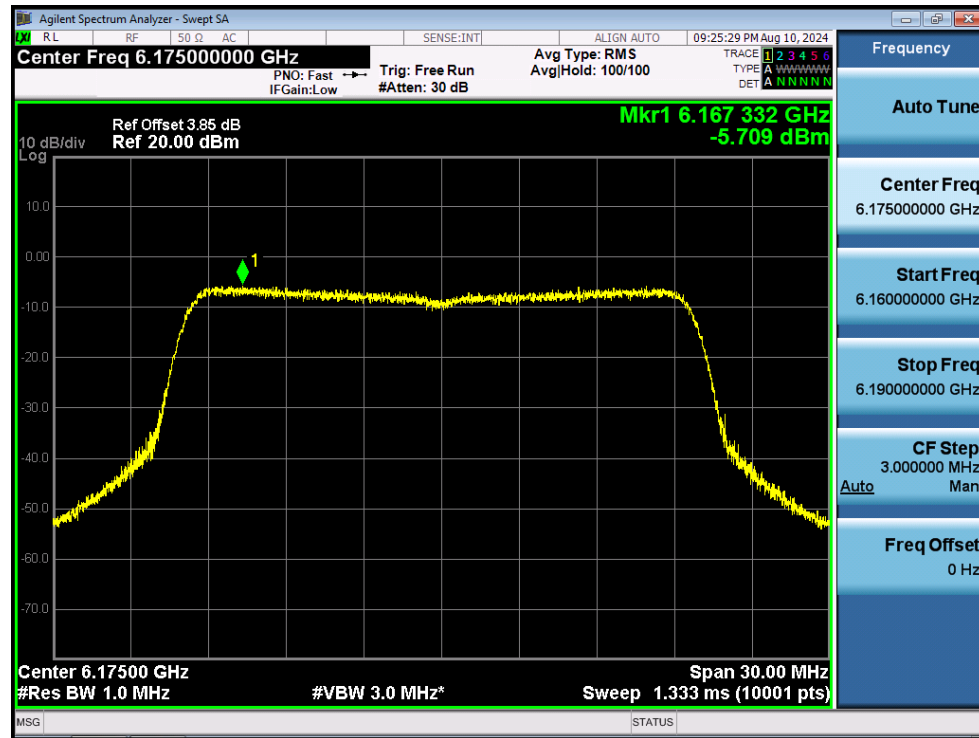


# PSD NVNT ax20 6415MHz Ant2

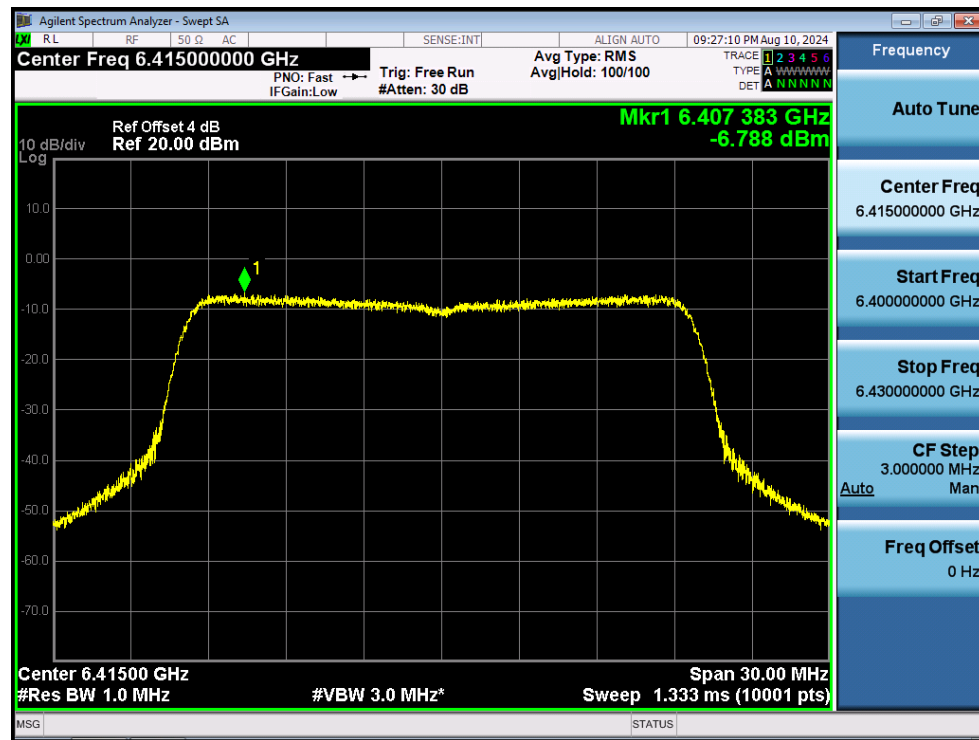


# PSD NVNT ax20 6435MHz Ant2




# PSD NVNT ax20 6475MHz Ant2

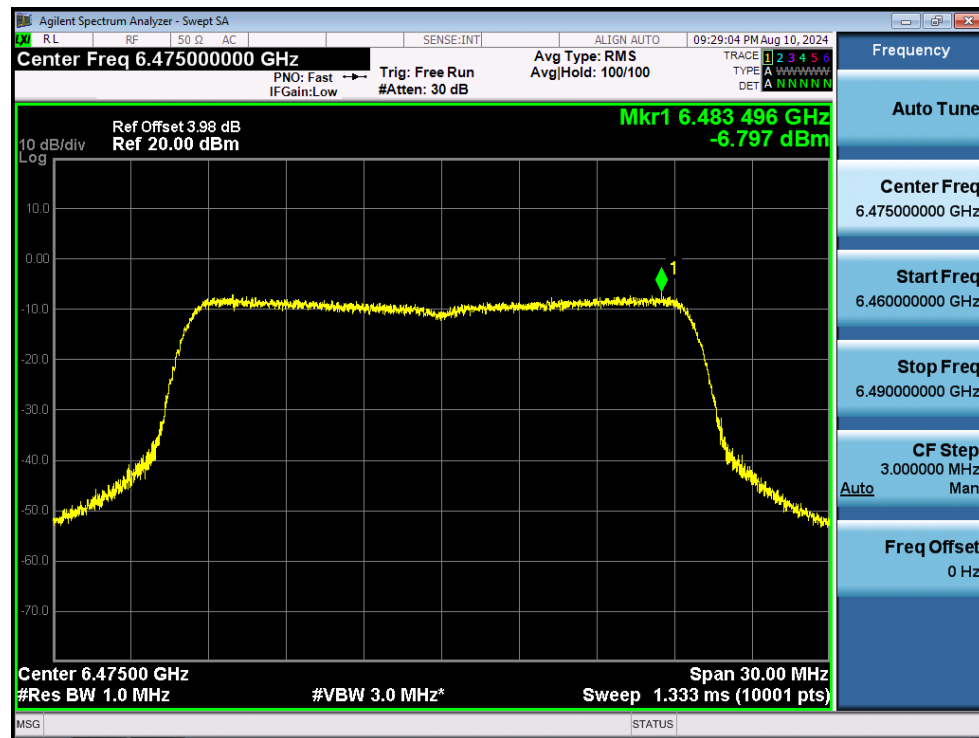

PSD NVNT ax20 6515MHz Ant2

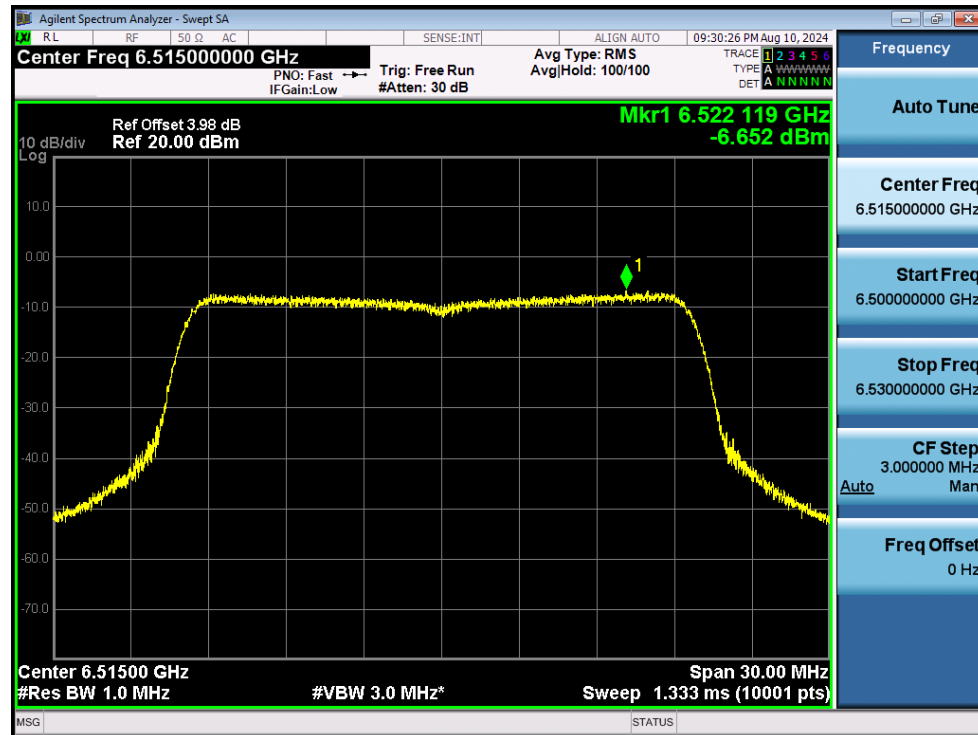


PSD NVNT ax20 6535MHz Ant2

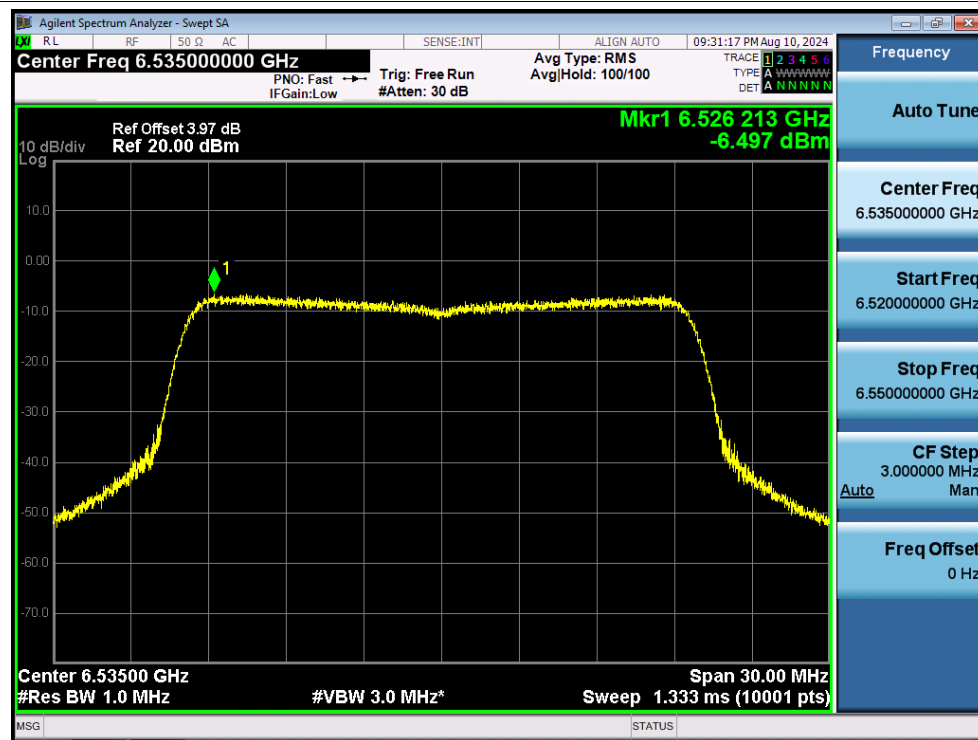


# PSD NVNT ax20 6695MHz Ant2




# PSD NVNT ax20 6855MHz Ant2

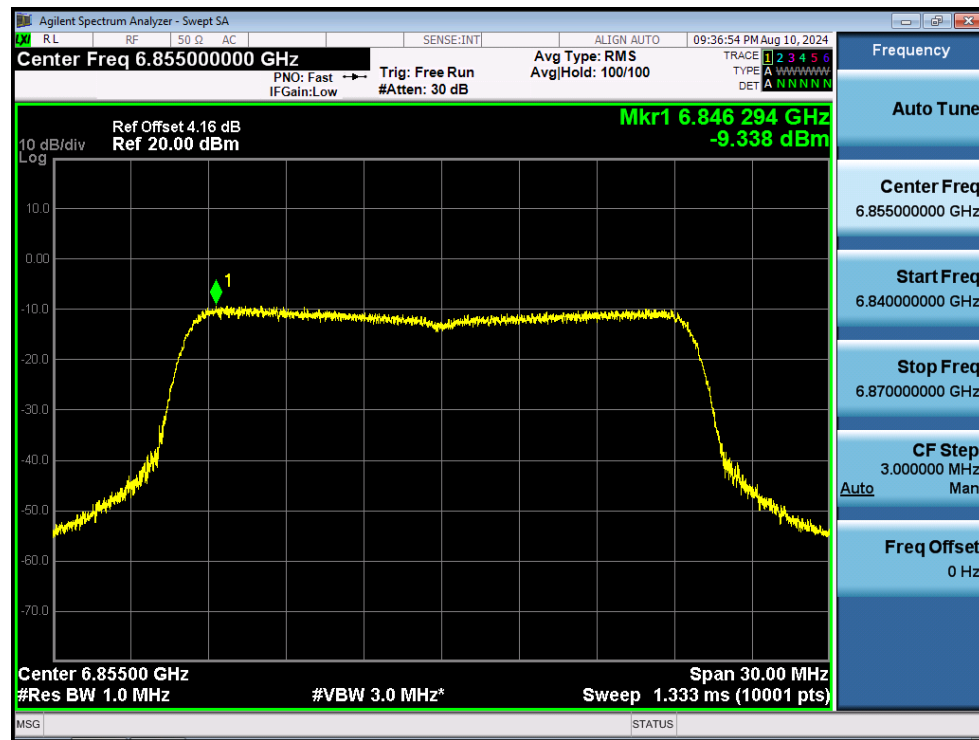


PSD NVNT ax20 6875MHz Ant2

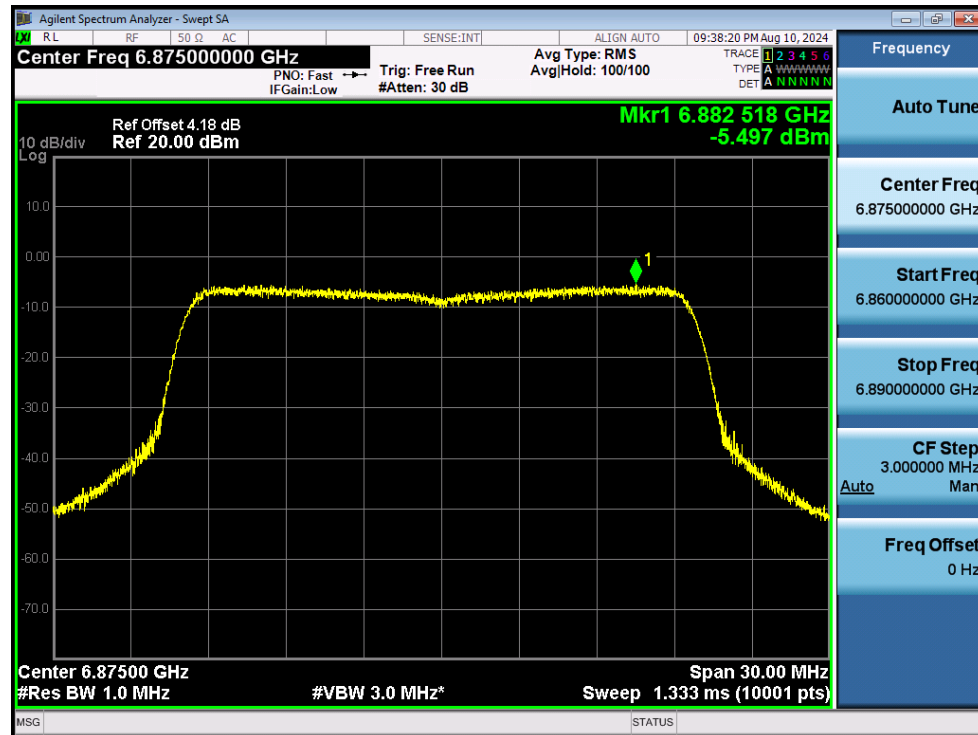

PSD NVNT ax20 6895MHz Ant2

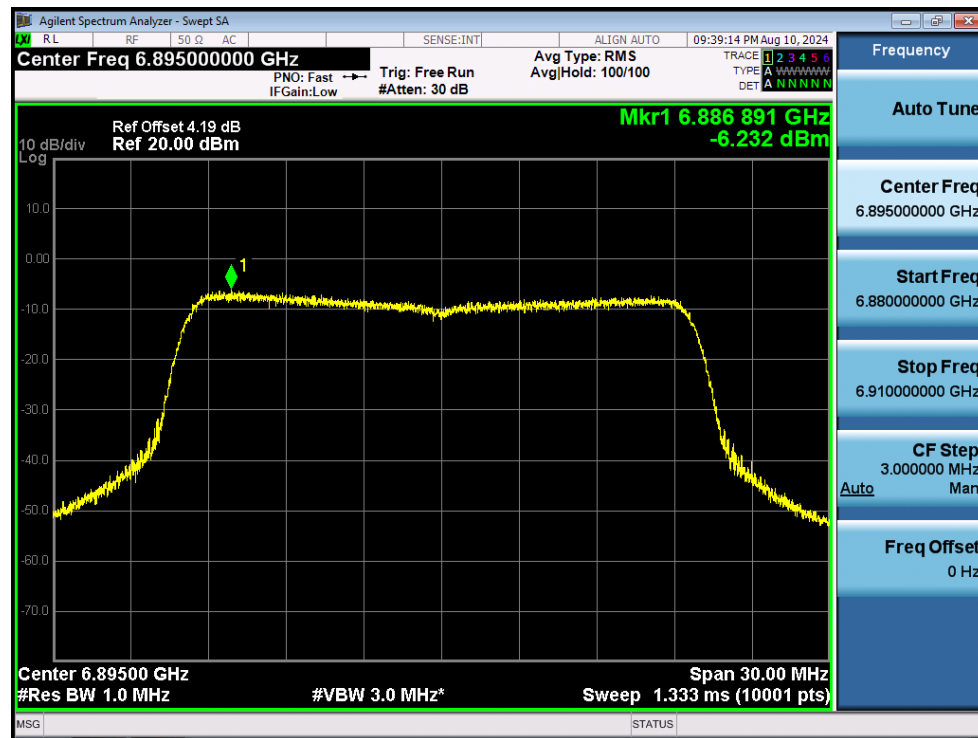


# PSD NVNT ax20 6995MHz Ant2

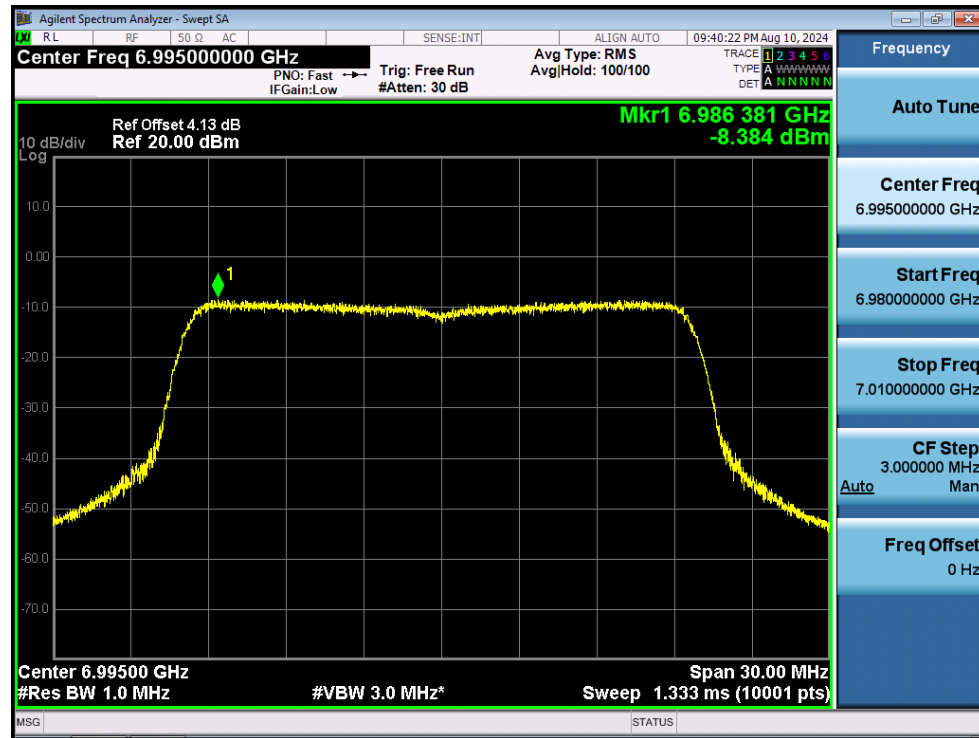


# PSD NVNT ax20 7115MHz Ant2




# PSD NVNT ax20 5955MHz Ant3

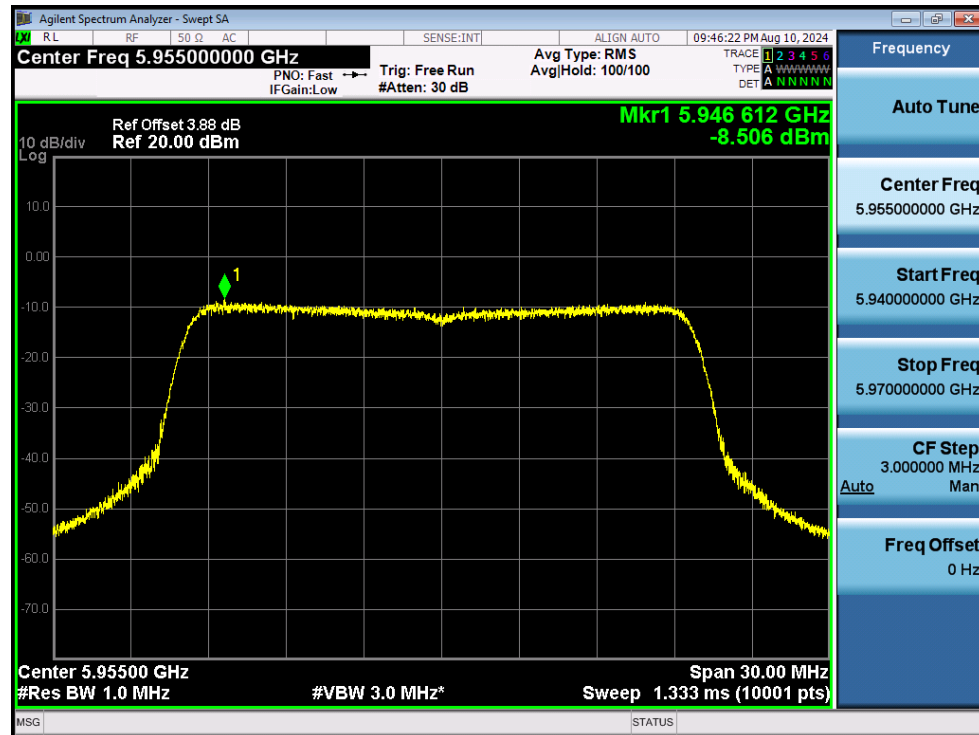


# PSD NVNT ax20 6175MHz Ant3

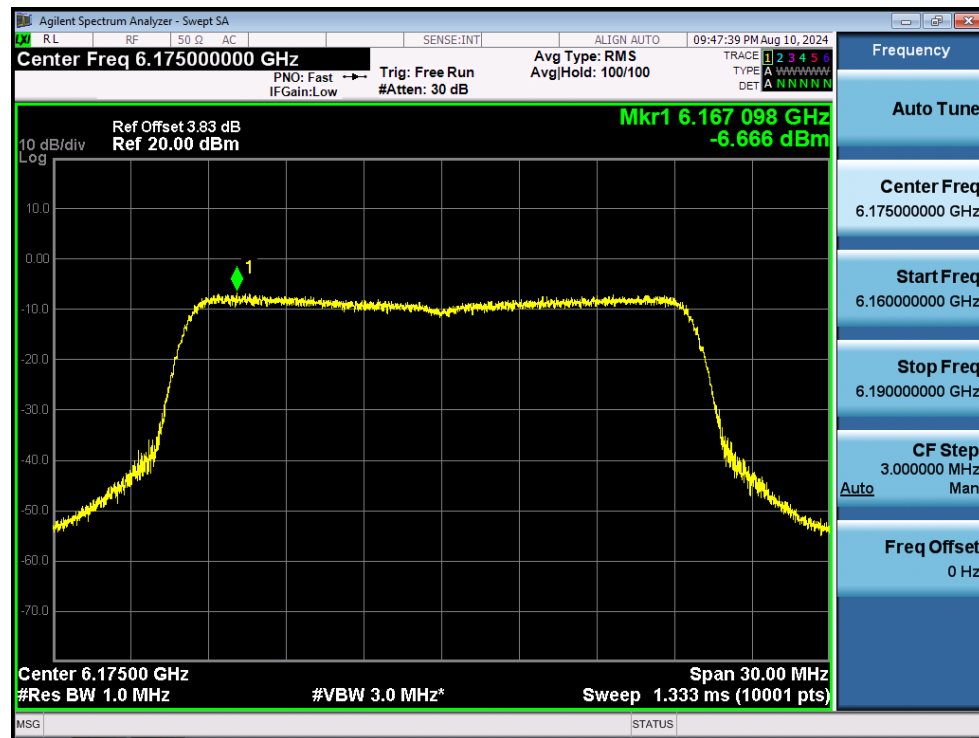


# PSD NVNT ax20 6415MHz Ant3

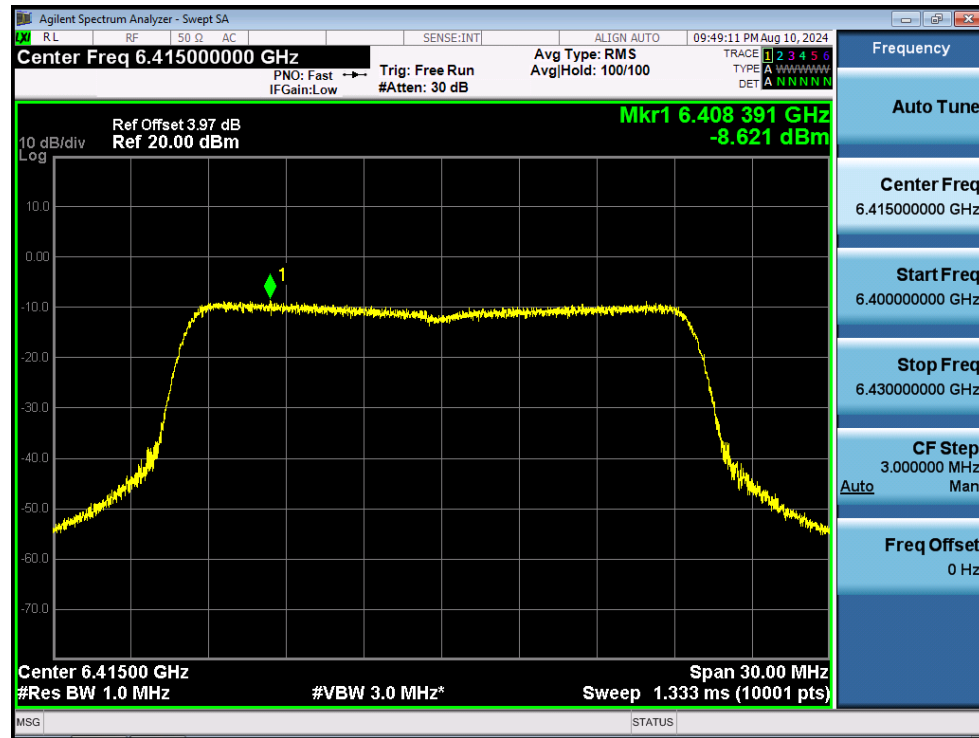


# PSD NVNT ax20 6435MHz Ant3

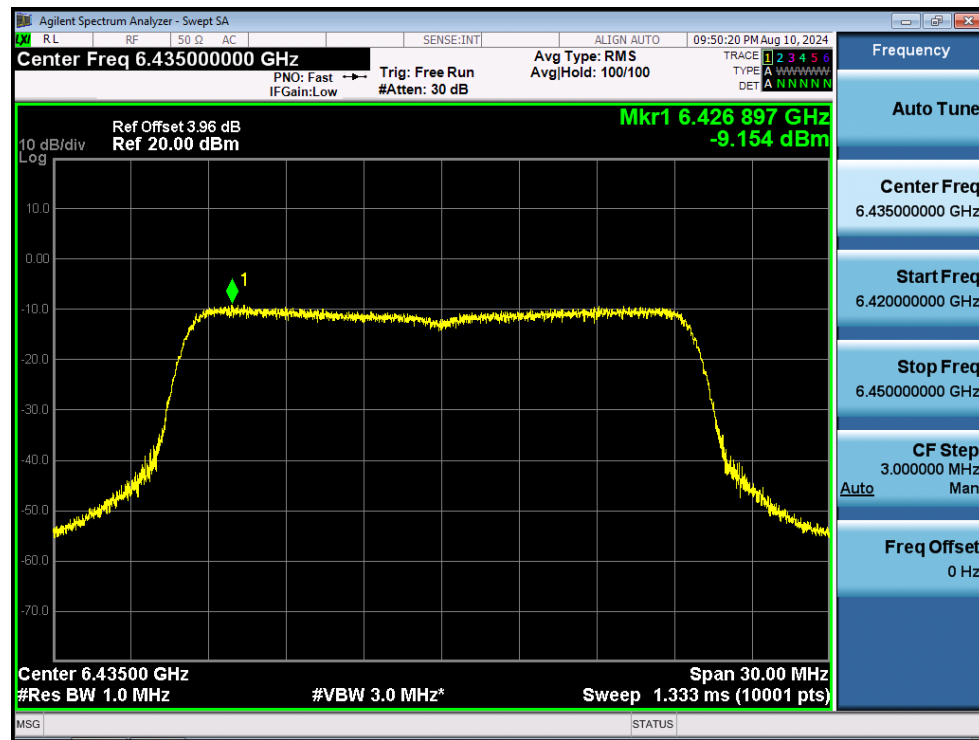

# PSD NVNT ax20 6475MHz Ant3

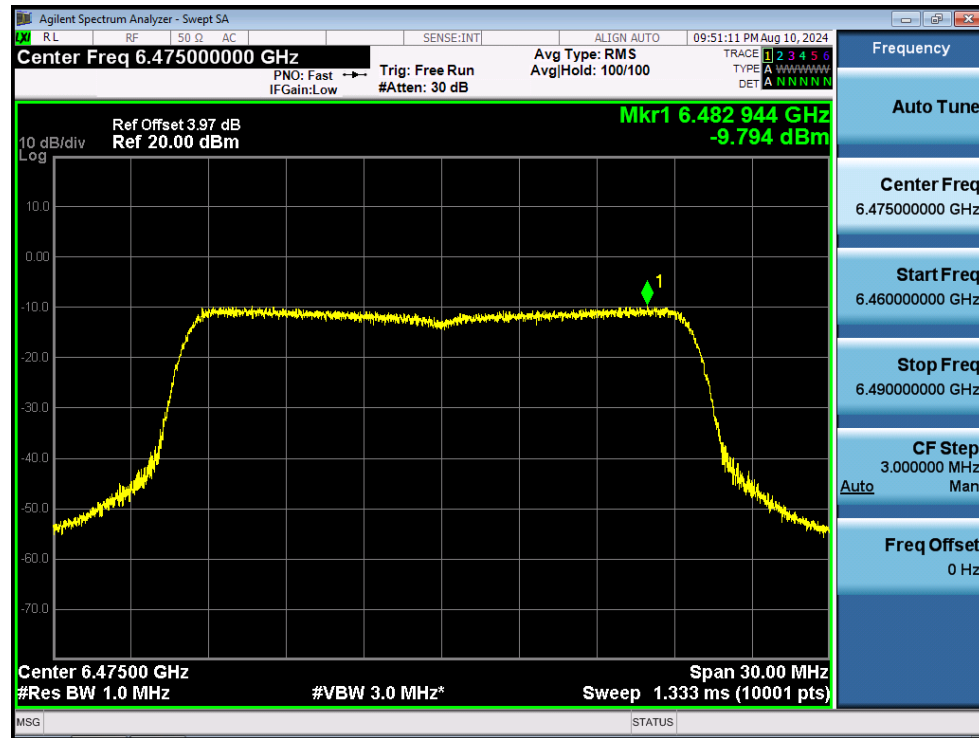

# PSD NVNT ax20 6515MHz Ant3

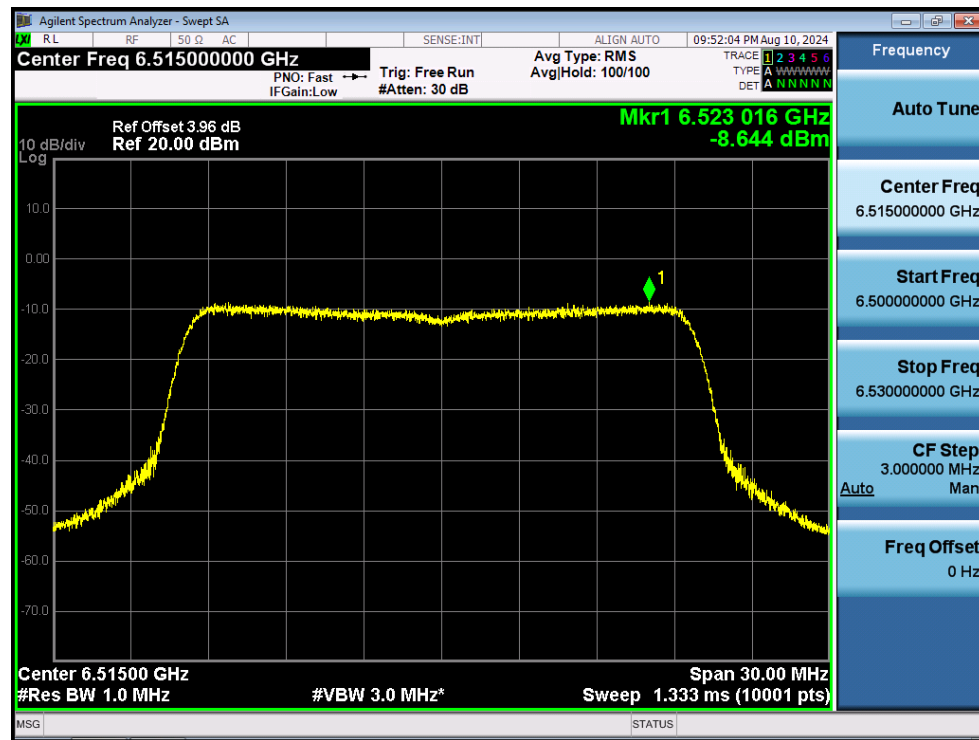

# PSD NVNT ax20 6535MHz Ant3



# PSD NVNT ax20 6695MHz Ant3

