

Appendix Test Data

Report No.:	18220WC40031207	Test Sample No.:	1-2-2
Start Test Date:	2024.2.29	Finish Test Date:	2024.3.13
Test Engineer:	Hayman Chen	Auditor:	Justin Feng
Temperature:	24.3°C	Relative Humidity:	57 %
Pressure:	101 kPa		

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.43	PASS
Band41	5MHz	16QAM	39675	1RB#0	20.95	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.38	PASS
Band41	5MHz	16QAM	39675	1RB#12	21.04	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.44	PASS
Band41	5MHz	16QAM	39675	1RB#24	20.81	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.58	PASS
Band41	5MHz	16QAM	39675	12RB#0	19.60	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.59	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.61	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.63	PASS
Band41	5MHz	16QAM	39675	12RB#13	19.61	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.67	PASS
Band41	5MHz	16QAM	39675	25RB#0	19.70	PASS
Band41	5MHz	QPSK	40620	1RB#0	21.03	PASS
Band41	5MHz	16QAM	40620	1RB#0	20.24	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.09	PASS
Band41	5MHz	16QAM	40620	1RB#12	20.28	PASS
Band41	5MHz	QPSK	40620	1RB#24	20.91	PASS
Band41	5MHz	16QAM	40620	1RB#24	20.38	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.34	PASS
Band41	5MHz	16QAM	40620	12RB#0	19.28	PASS
Band41	5MHz	QPSK	40620	12RB#6	20.31	PASS
Band41	5MHz	16QAM	40620	12RB#6	19.28	PASS
Band41	5MHz	QPSK	40620	12RB#13	20.26	PASS
Band41	5MHz	16QAM	40620	12RB#13	19.26	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	5MHz	QPSK	40620	25RB#0	20.27	PASS
Band41	5MHz	16QAM	40620	25RB#0	19.33	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.86	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.39	PASS
Band41	5MHz	QPSK	41565	1RB#12	22.07	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.52	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.89	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.32	PASS
Band41	5MHz	QPSK	41565	12RB#0	21.07	PASS
Band41	5MHz	16QAM	41565	12RB#0	19.89	PASS
Band41	5MHz	QPSK	41565	12RB#6	21.08	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.91	PASS
Band41	5MHz	QPSK	41565	12RB#13	21.09	PASS
Band41	5MHz	16QAM	41565	12RB#13	20.07	PASS
Band41	5MHz	QPSK	41565	25RB#0	21.14	PASS
Band41	5MHz	16QAM	41565	25RB#0	20.17	PASS
Band41	10MHz	QPSK	39700	1RB#0	21.39	PASS
Band41	10MHz	16QAM	39700	1RB#0	20.72	PASS
Band41	10MHz	QPSK	39700	1RB#24	21.37	PASS
Band41	10MHz	16QAM	39700	1RB#24	20.85	PASS
Band41	10MHz	QPSK	39700	1RB#49	21.41	PASS
Band41	10MHz	16QAM	39700	1RB#49	20.79	PASS
Band41	10MHz	QPSK	39700	25RB#0	20.71	PASS
Band41	10MHz	16QAM	39700	25RB#0	19.58	PASS
Band41	10MHz	QPSK	39700	25RB#12	20.72	PASS
Band41	10MHz	16QAM	39700	25RB#12	19.59	PASS
Band41	10MHz	QPSK	39700	25RB#25	20.65	PASS
Band41	10MHz	16QAM	39700	25RB#25	19.60	PASS
Band41	10MHz	QPSK	39700	50RB#0	20.71	PASS
Band41	10MHz	16QAM	39700	50RB#0	19.81	PASS
Band41	10MHz	QPSK	40620	1RB#0	21.12	PASS
Band41	10MHz	16QAM	40620	1RB#0	20.59	PASS
Band41	10MHz	QPSK	40620	1RB#24	21.18	PASS
Band41	10MHz	16QAM	40620	1RB#24	20.42	PASS
Band41	10MHz	QPSK	40620	1RB#49	21.01	PASS
Band41	10MHz	16QAM	40620	1RB#49	20.66	PASS
Band41	10MHz	QPSK	40620	25RB#0	20.38	PASS
Band41	10MHz	16QAM	40620	25RB#0	19.48	PASS
Band41	10MHz	QPSK	40620	25RB#12	20.34	PASS
Band41	10MHz	16QAM	40620	25RB#12	19.37	PASS
Band41	10MHz	QPSK	40620	25RB#25	20.26	PASS
Band41	10MHz	16QAM	40620	25RB#25	19.31	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	10MHz	QPSK	40620	50RB#0	20.26	PASS
Band41	10MHz	16QAM	40620	50RB#0	19.41	PASS
Band41	10MHz	QPSK	41540	1RB#0	22.19	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.69	PASS
Band41	10MHz	QPSK	41540	1RB#24	22.11	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.84	PASS
Band41	10MHz	QPSK	41540	1RB#49	22.11	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.77	PASS
Band41	10MHz	QPSK	41540	25RB#0	21.19	PASS
Band41	10MHz	16QAM	41540	25RB#0	20.15	PASS
Band41	10MHz	QPSK	41540	25RB#12	21.19	PASS
Band41	10MHz	16QAM	41540	25RB#12	20.16	PASS
Band41	10MHz	QPSK	41540	25RB#25	21.12	PASS
Band41	10MHz	16QAM	41540	25RB#25	20.08	PASS
Band41	10MHz	QPSK	41540	50RB#0	21.12	PASS
Band41	10MHz	16QAM	41540	50RB#0	20.13	PASS
Band41	15MHz	QPSK	39725	1RB#0	21.23	PASS
Band41	15MHz	16QAM	39725	1RB#0	20.58	PASS
Band41	15MHz	QPSK	39725	1RB#38	21.28	PASS
Band41	15MHz	16QAM	39725	1RB#38	20.55	PASS
Band41	15MHz	QPSK	39725	1RB#74	21.22	PASS
Band41	15MHz	16QAM	39725	1RB#74	20.62	PASS
Band41	15MHz	QPSK	39725	38RB#0	20.42	PASS
Band41	15MHz	16QAM	39725	38RB#0	20.42	PASS
Band41	15MHz	QPSK	39725	38RB#18	20.51	PASS
Band41	15MHz	16QAM	39725	38RB#18	20.51	PASS
Band41	15MHz	QPSK	39725	38RB#37	20.42	PASS
Band41	15MHz	16QAM	39725	38RB#37	20.42	PASS
Band41	15MHz	QPSK	39725	75RB#0	20.42	PASS
Band41	15MHz	16QAM	39725	75RB#0	19.55	PASS
Band41	15MHz	QPSK	40620	1RB#0	21.04	PASS
Band41	15MHz	16QAM	40620	1RB#0	20.11	PASS
Band41	15MHz	QPSK	40620	1RB#38	21.09	PASS
Band41	15MHz	16QAM	40620	1RB#38	20.04	PASS
Band41	15MHz	QPSK	40620	1RB#74	20.94	PASS
Band41	15MHz	16QAM	40620	1RB#74	19.98	PASS
Band41	15MHz	QPSK	40620	38RB#0	20.31	PASS
Band41	15MHz	16QAM	40620	38RB#0	20.31	PASS
Band41	15MHz	QPSK	40620	38RB#18	20.31	PASS
Band41	15MHz	16QAM	40620	38RB#18	20.31	PASS
Band41	15MHz	QPSK	40620	38RB#37	20.31	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.31	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	15MHz	QPSK	40620	75RB#0	20.31	PASS
Band41	15MHz	16QAM	40620	75RB#0	19.36	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.97	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.56	PASS
Band41	15MHz	QPSK	41515	1RB#38	22.03	PASS
Band41	15MHz	16QAM	41515	1RB#38	21.68	PASS
Band41	15MHz	QPSK	41515	1RB#74	22.18	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.64	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.17	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.17	PASS
Band41	15MHz	QPSK	41515	38RB#18	21.19	PASS
Band41	15MHz	16QAM	41515	38RB#18	21.19	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.19	PASS
Band41	15MHz	16QAM	41515	38RB#37	21.17	PASS
Band41	15MHz	QPSK	41515	75RB#0	21.17	PASS
Band41	15MHz	16QAM	41515	75RB#0	20.24	PASS
Band41	20MHz	QPSK	39750	1RB#0	21.05	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.01	PASS
Band41	20MHz	QPSK	39750	1RB#49	21.31	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.52	PASS
Band41	20MHz	QPSK	39750	1RB#99	21.09	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.02	PASS
Band41	20MHz	QPSK	39750	50RB#0	20.53	PASS
Band41	20MHz	16QAM	39750	50RB#0	19.68	PASS
Band41	20MHz	QPSK	39750	50RB#25	20.52	PASS
Band41	20MHz	16QAM	39750	50RB#25	19.66	PASS
Band41	20MHz	QPSK	39750	50RB#50	20.42	PASS
Band41	20MHz	16QAM	39750	50RB#50	19.59	PASS
Band41	20MHz	QPSK	39750	100RB#0	20.50	PASS
Band41	20MHz	16QAM	39750	100RB#0	19.60	PASS
Band41	20MHz	QPSK	40620	1RB#0	21.04	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.02	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.07	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.29	PASS
Band41	20MHz	QPSK	40620	1RB#99	20.91	PASS
Band41	20MHz	16QAM	40620	1RB#99	20.78	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.08	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.21	PASS
Band41	20MHz	QPSK	41490	50RB#0	20.94	PASS
Band41	20MHz	16QAM	41490	50RB#0	20.14	PASS
Band41	20MHz	QPSK	41490	50RB#25	20.94	PASS
Band41	20MHz	16QAM	41490	50RB#25	20.15	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	20MHz	QPSK	41490	50RB#50	21.05	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.09	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.98	PASS
Band41	20MHz	16QAM	41490	100RB#0	20.13	PASS
Band41	20MHz	QPSK	40620	50RB#0	20.22	PASS
Band41	20MHz	16QAM	40620	50RB#0	19.40	PASS
Band41	20MHz	QPSK	40620	50RB#25	20.27	PASS
Band41	20MHz	16QAM	40620	50RB#25	19.43	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.22	PASS
Band41	20MHz	16QAM	40620	50RB#50	19.37	PASS
Band41	20MHz	QPSK	40620	100RB#0	20.29	PASS
Band41	20MHz	16QAM	40620	100RB#0	19.41	PASS
Band41	20MHz	QPSK	41490	1RB#0	22.10	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.18	PASS
Band41	20MHz	QPSK	41490	1RB#49	22.23	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.39	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com.cn



Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	9.15	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	9.14	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	9.34	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.70	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	9.22	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	10.43	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.33	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	10.32	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.32	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	9.82	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	9.41	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.68	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	8.47	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	9.63	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	10.02	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	10.21	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	9.24	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	10.32	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.77	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	10.10	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	9.12	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	9.39	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.93	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.83	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	9.16	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	10.19	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.41	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	10.63	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	9.94	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	10.61	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.92	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	10.13	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	9.30	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	10.25	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	9.70	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	10.18	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	8.84	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	20MHz	16QAM	39750	1RB#0	9.29	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.45	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	10.27	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.55	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	9.49	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	9.45	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	10.59	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.74	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	9.68	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	9.35	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.75	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



Test Graphs

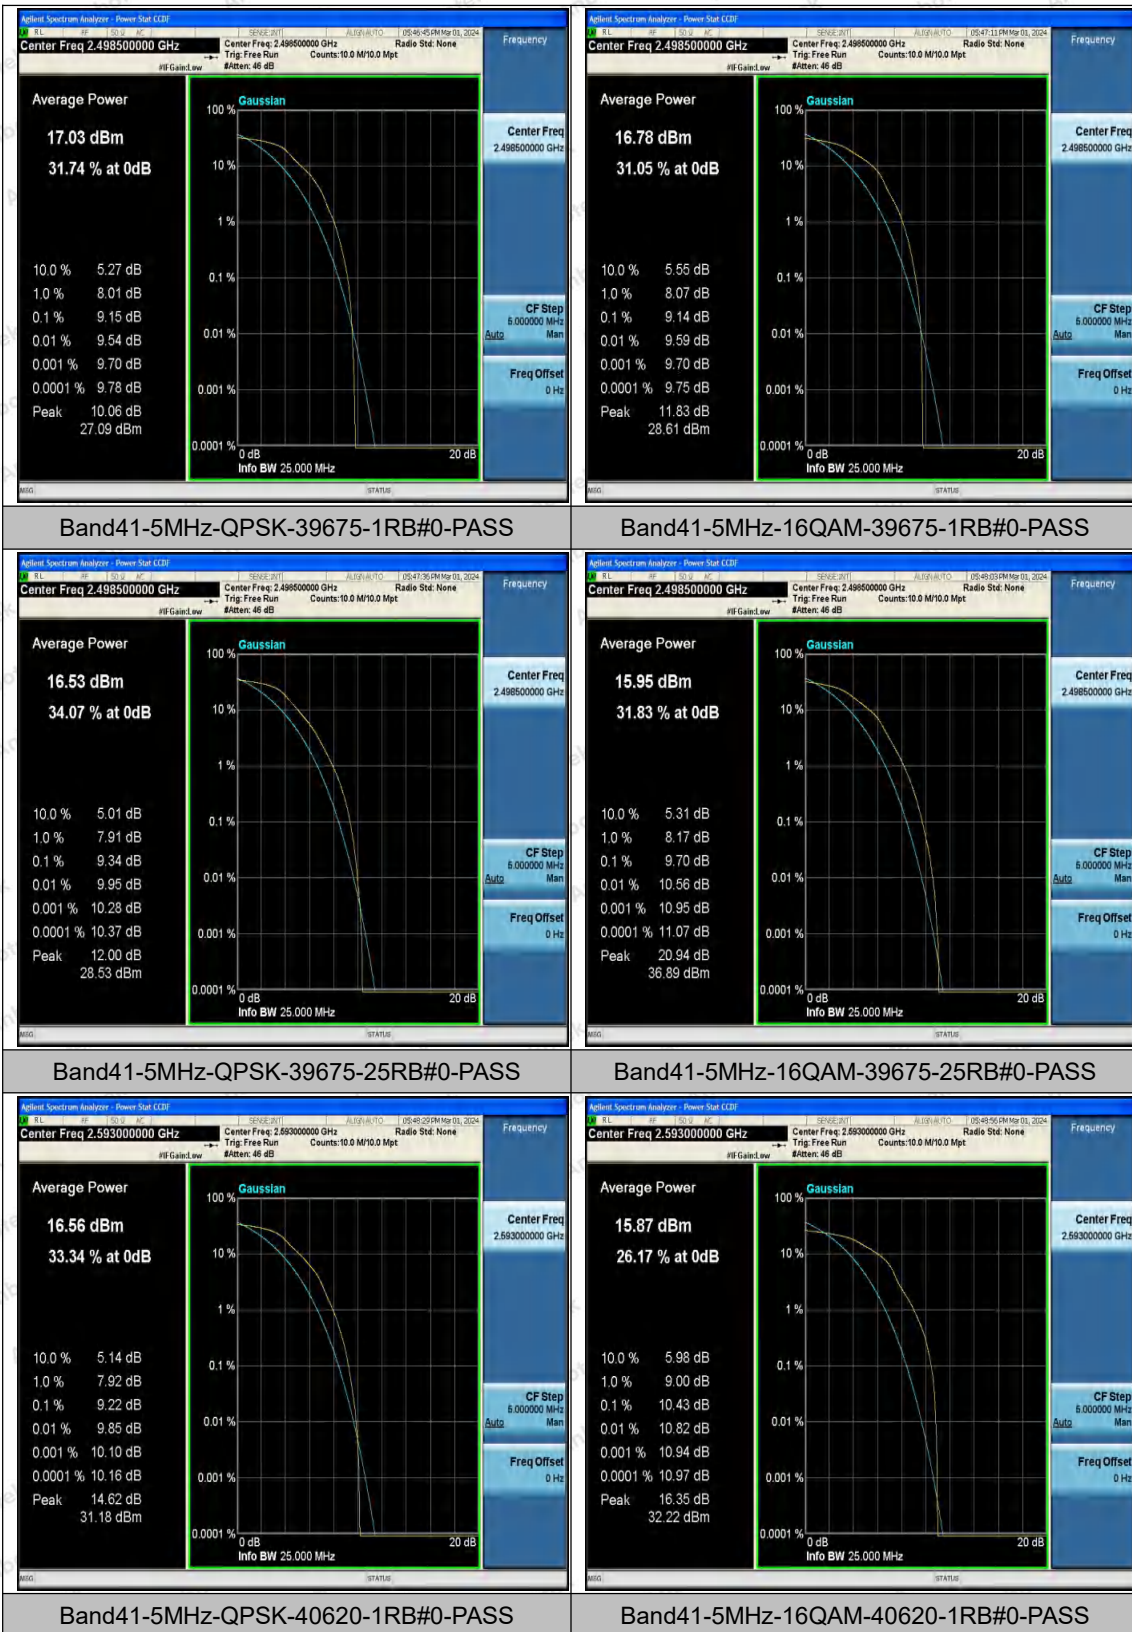

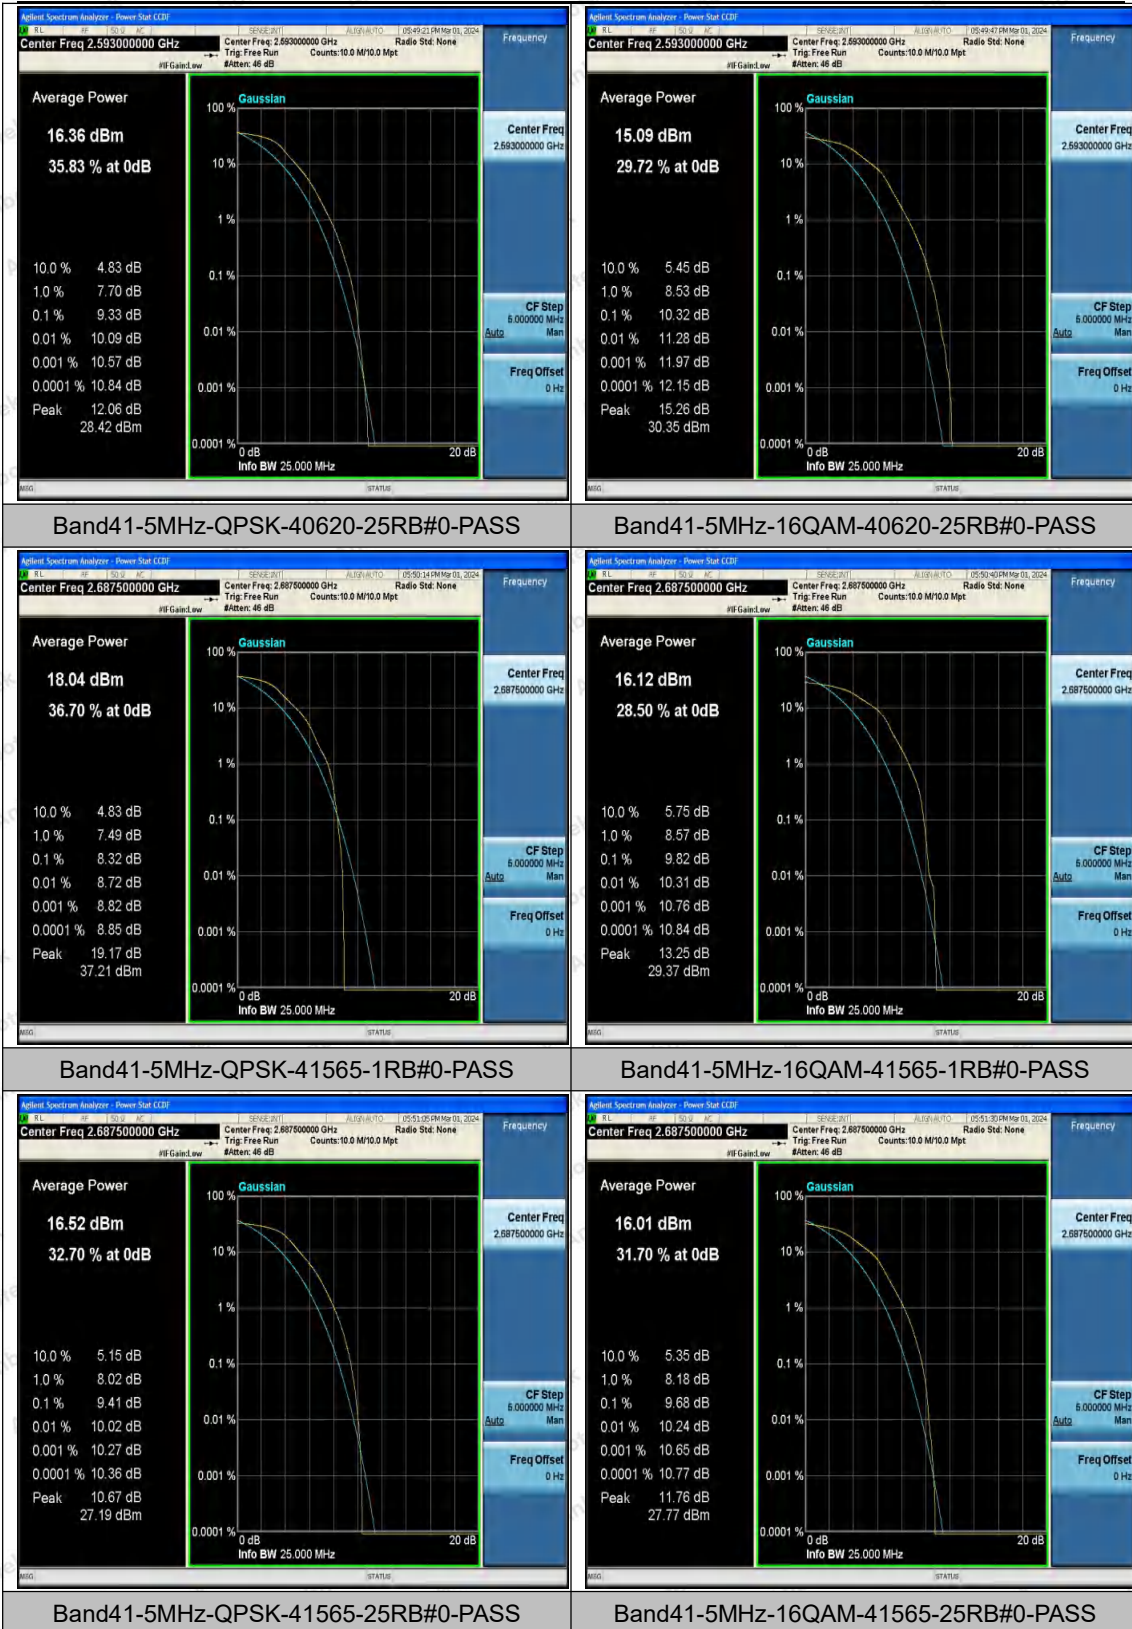


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com.cn



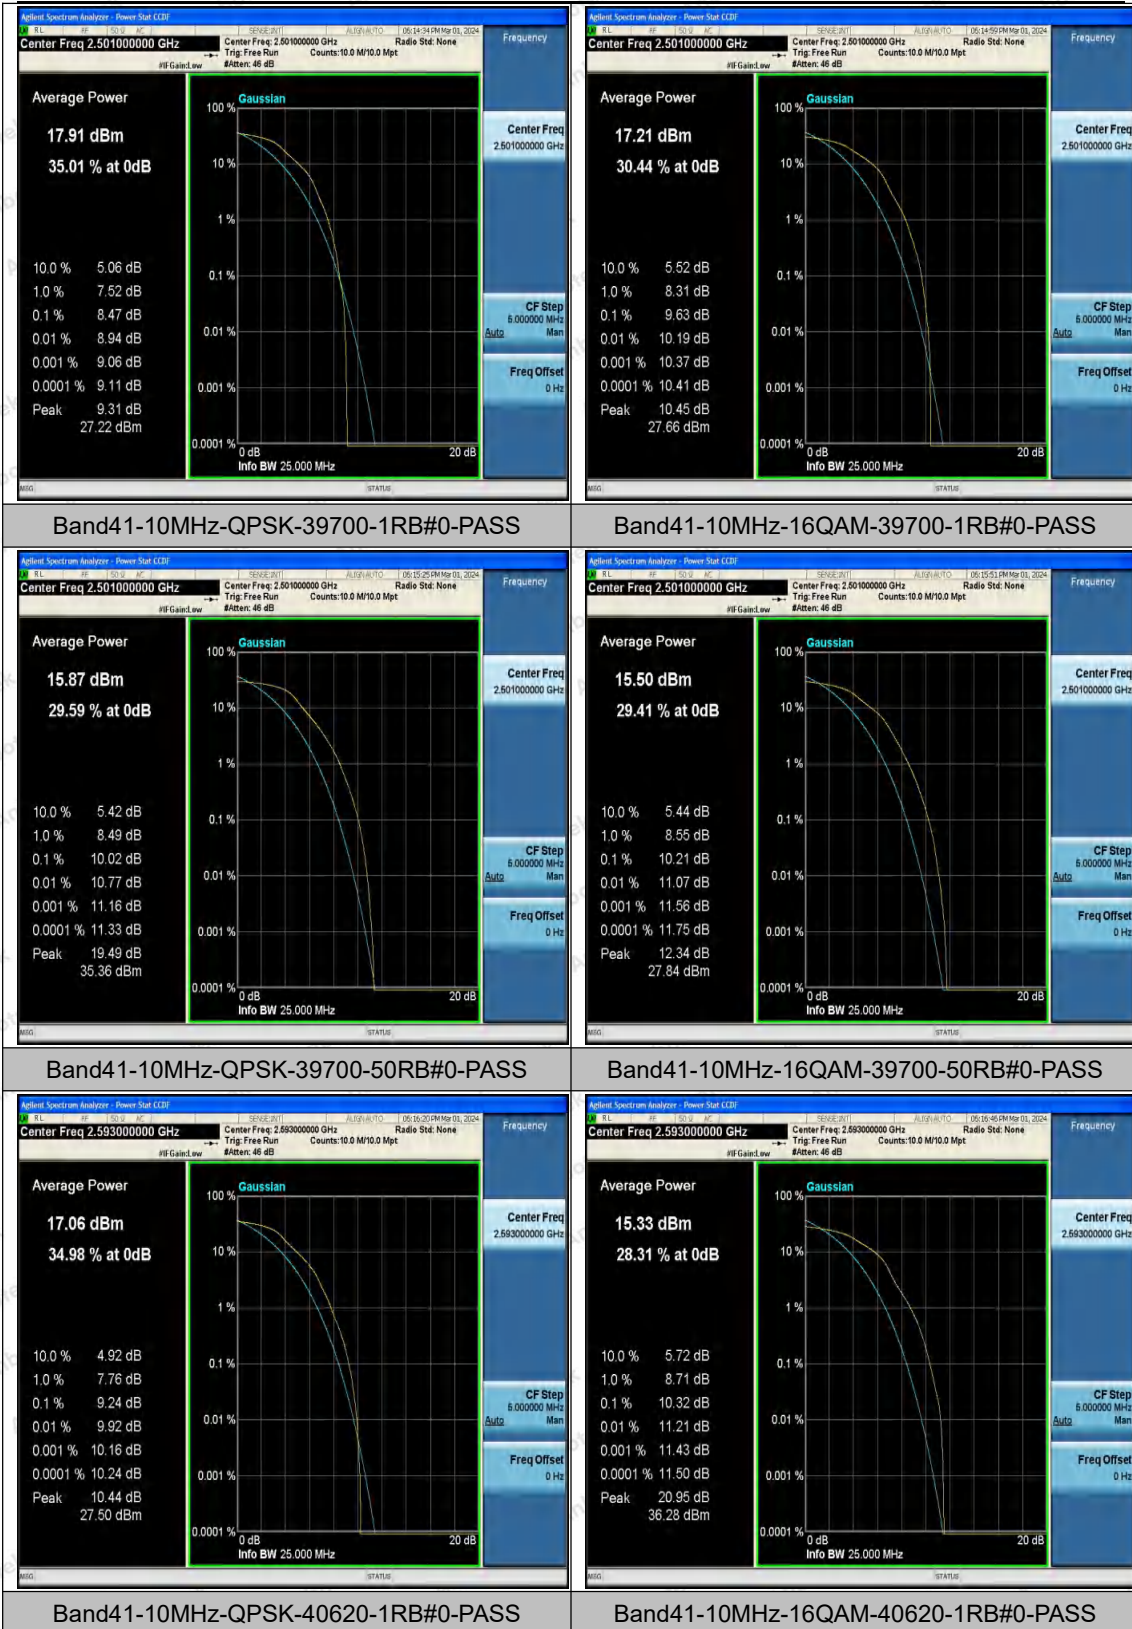


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com.cn



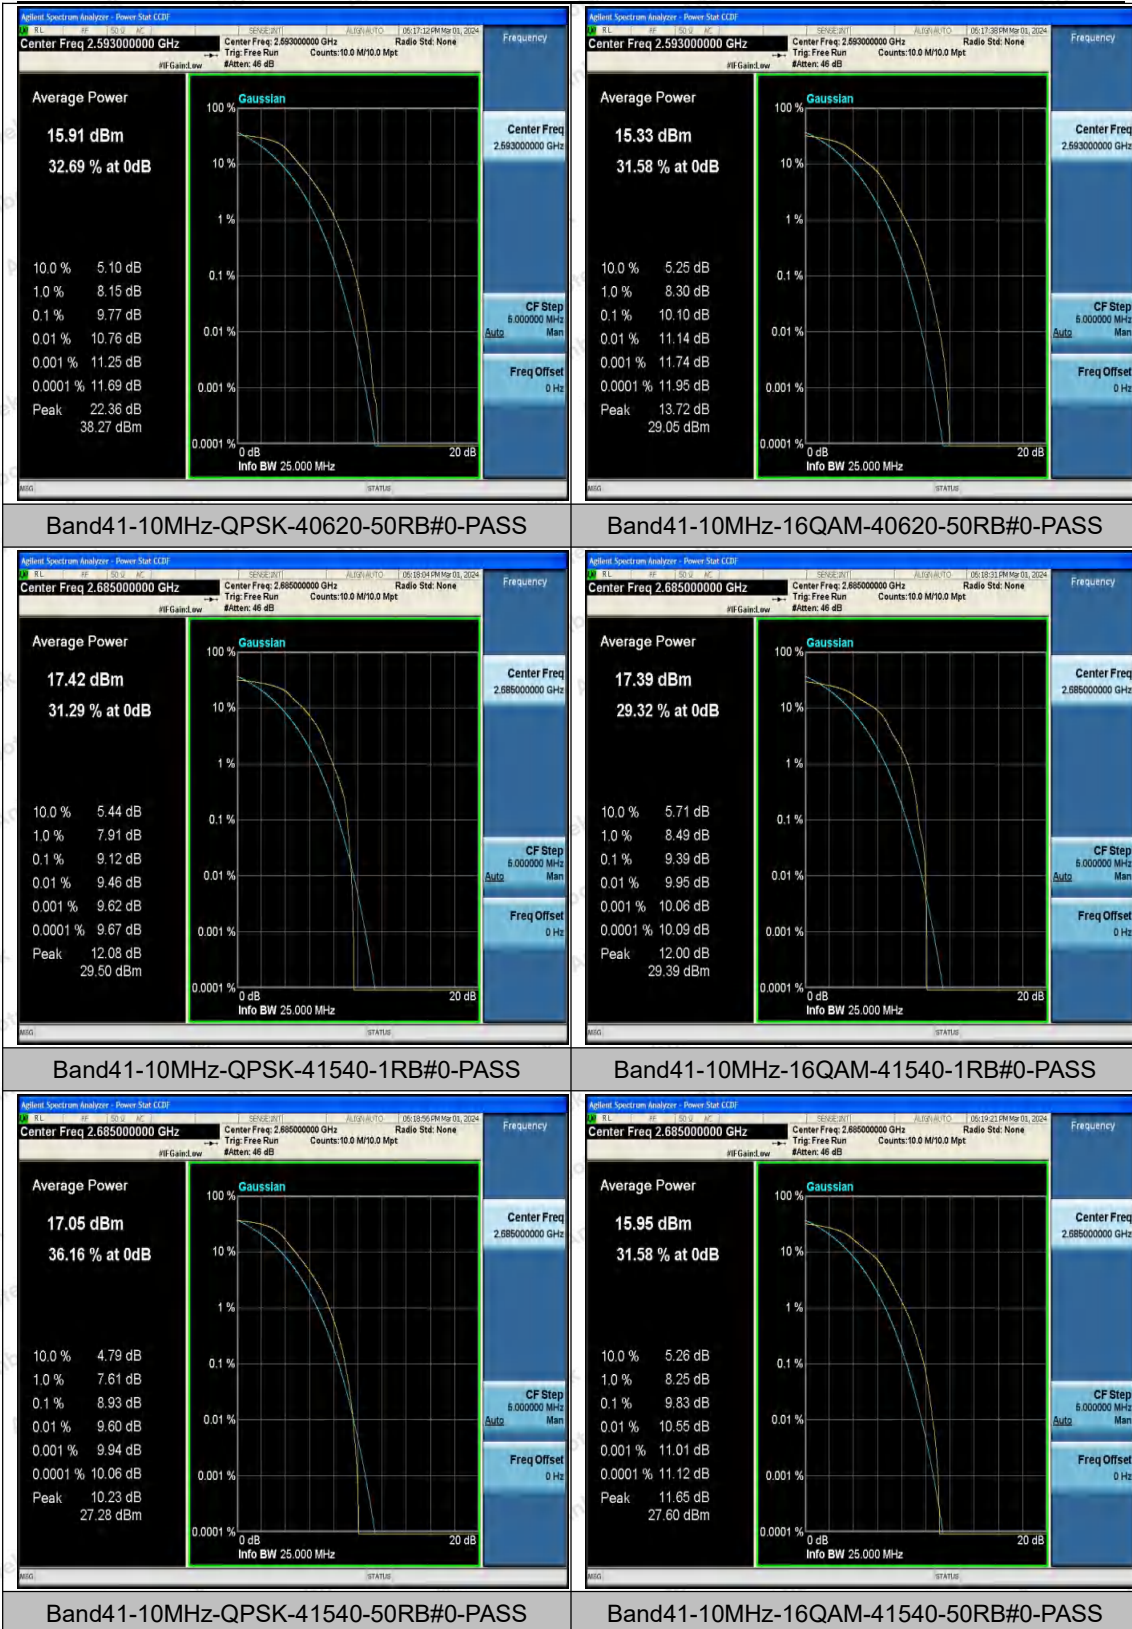


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com.cn



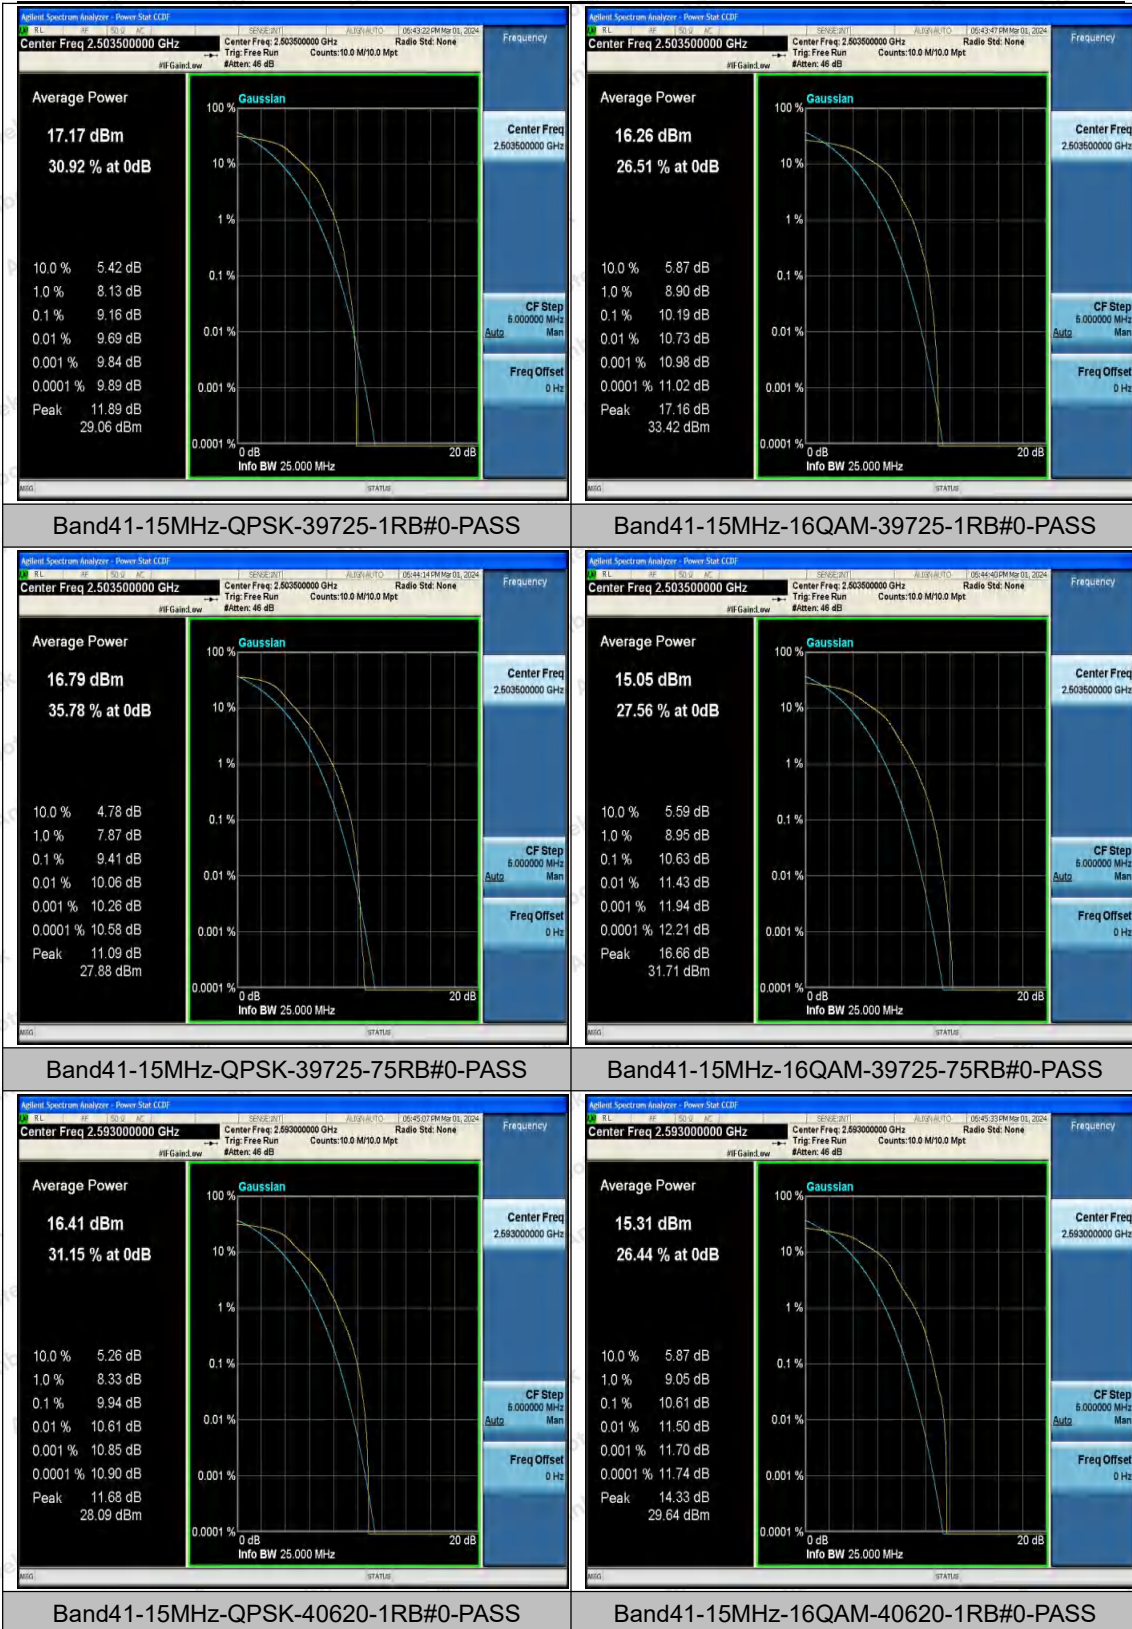


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com.cn



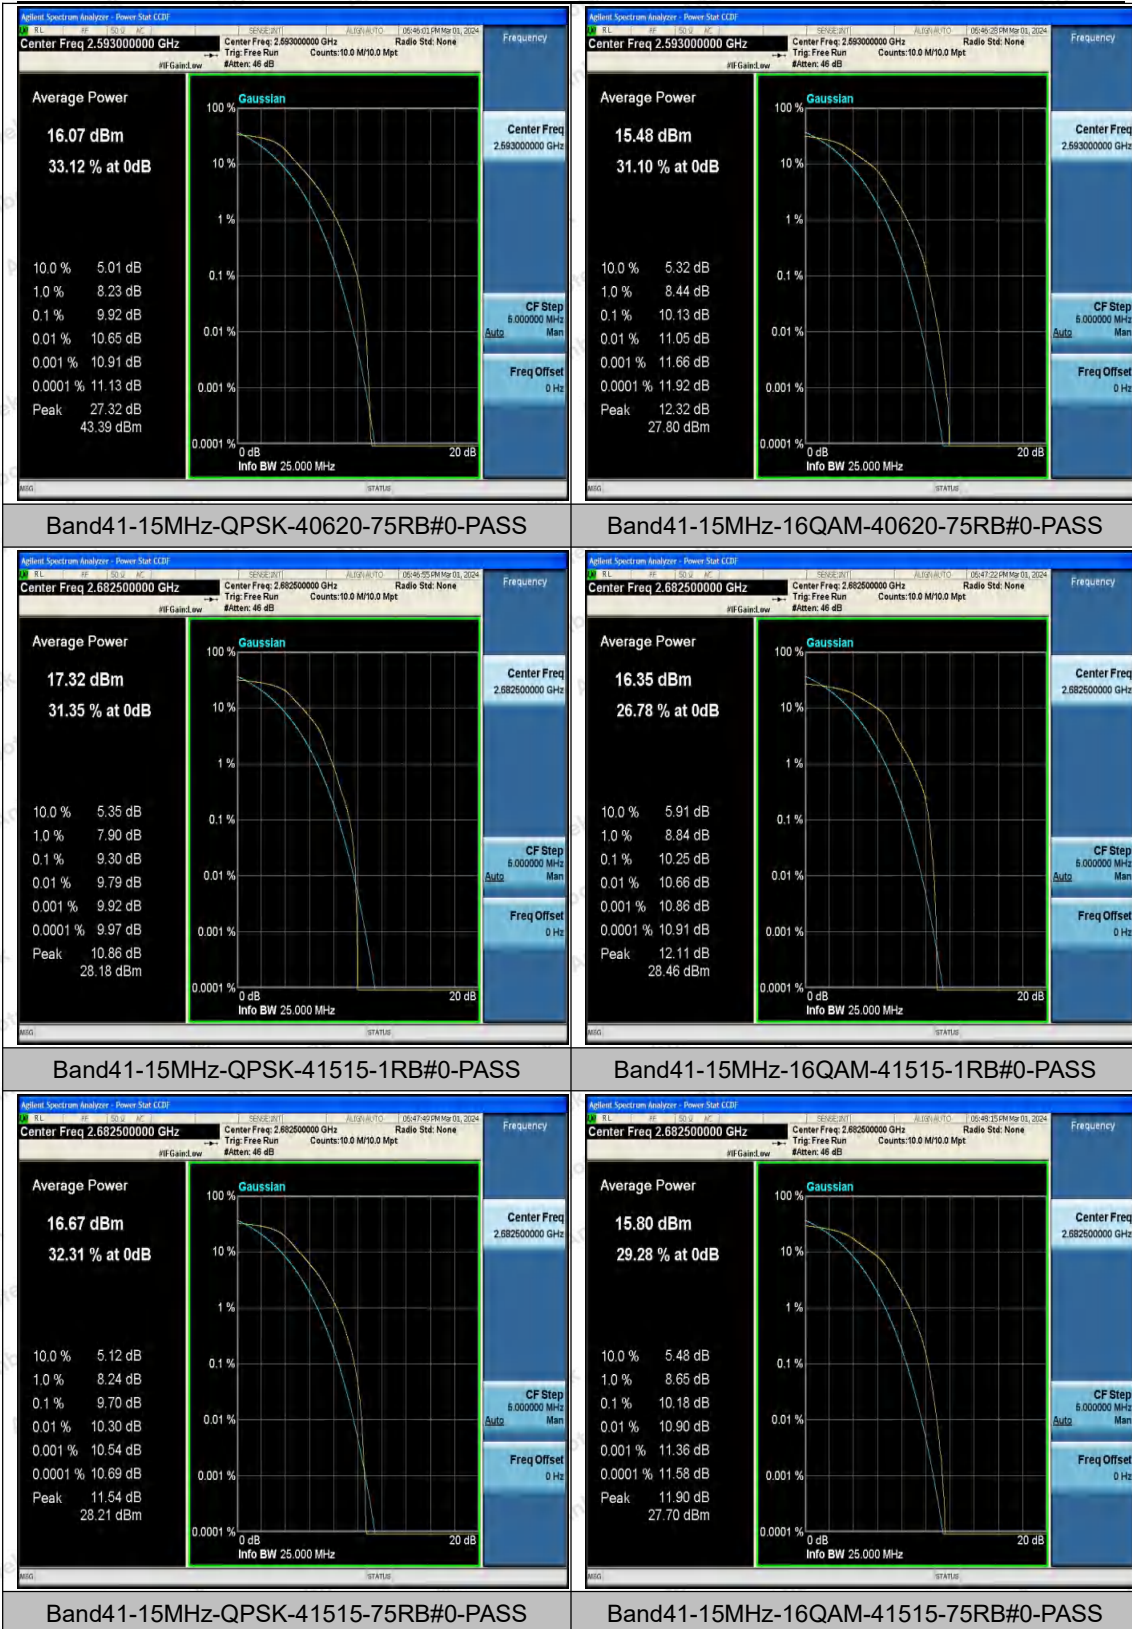


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



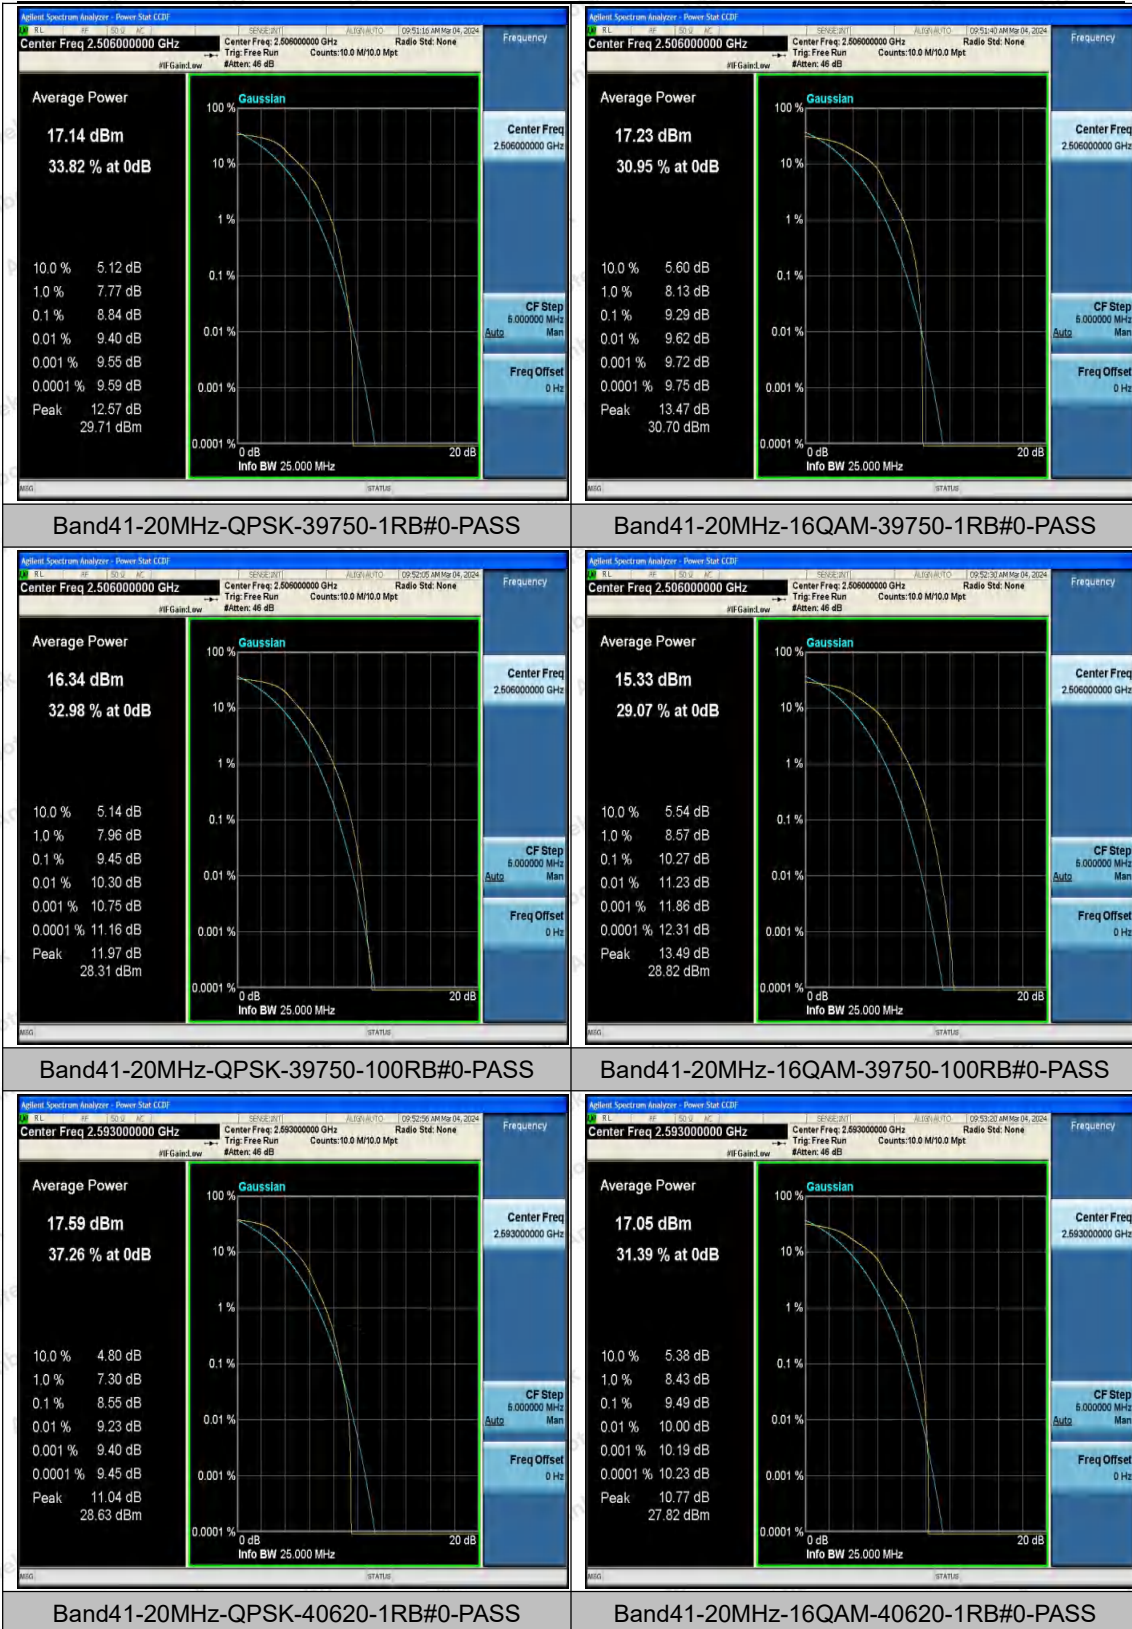


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



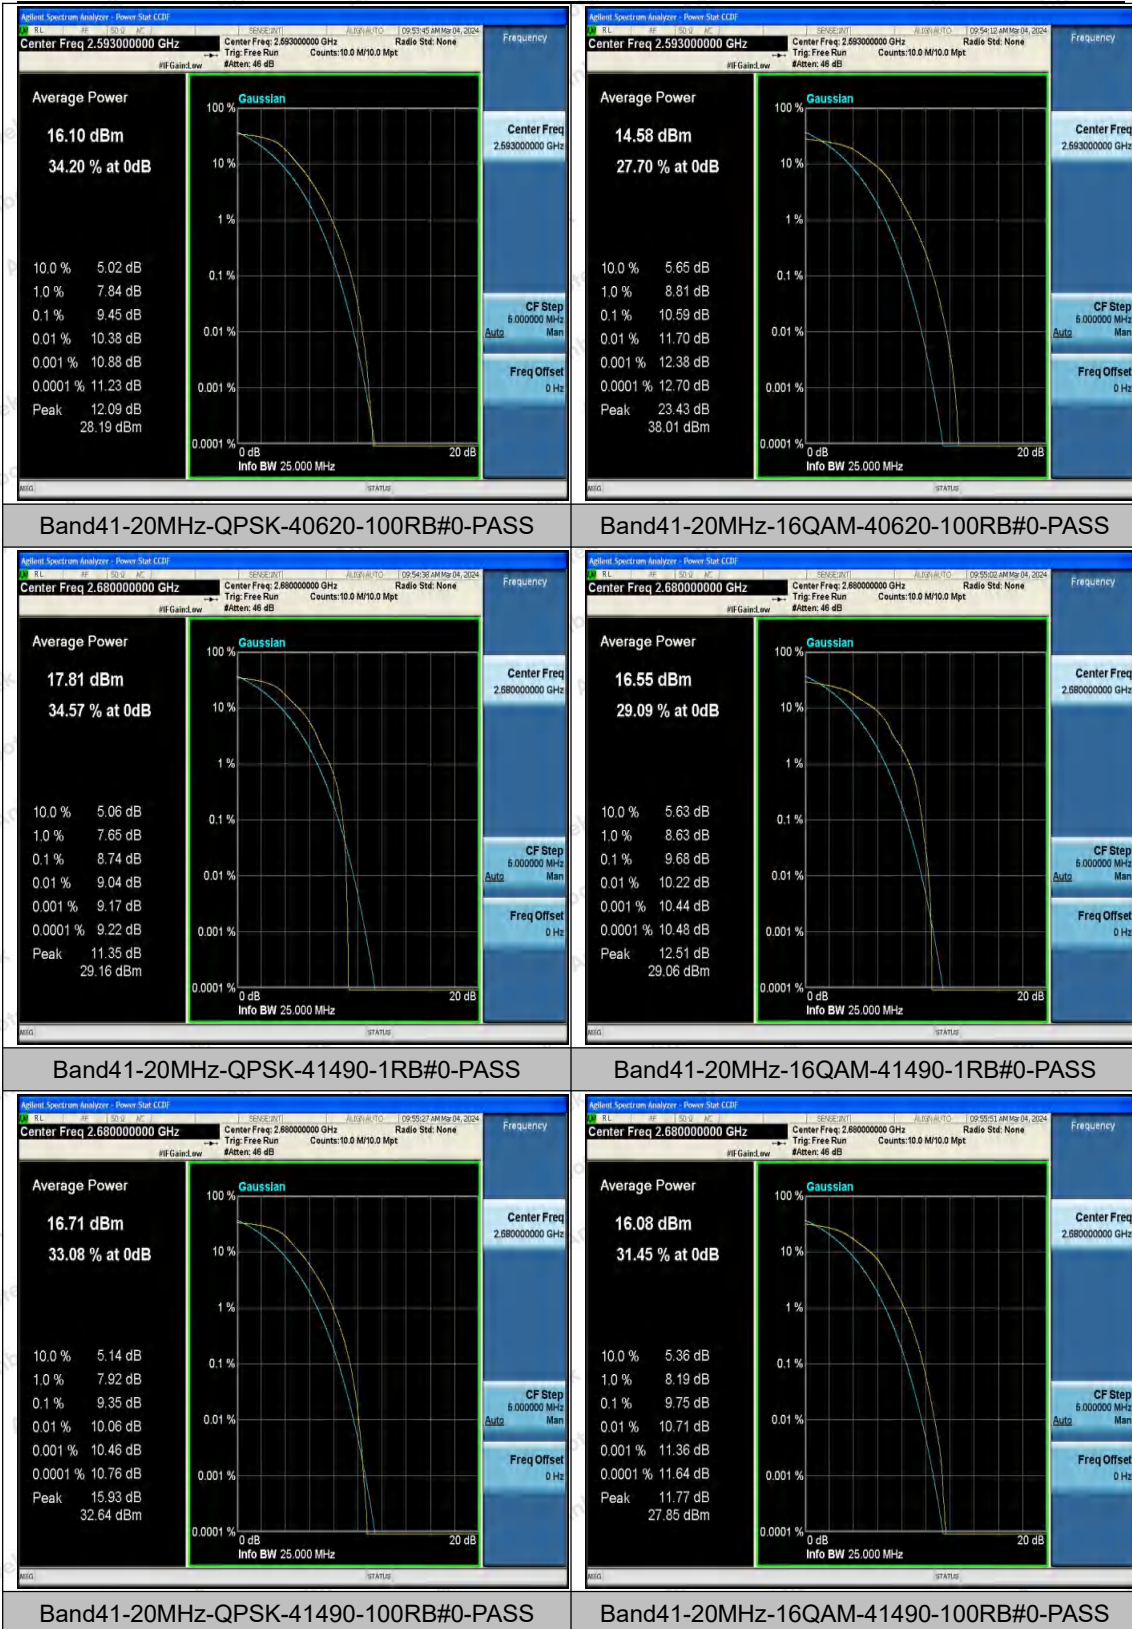

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn




Appendix C: 26dB Bandwidth and Occupied Bandwidth


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.4900	4.935	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.4820	4.961	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.4940	5.001	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.4987	4.971	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4975	4.977	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.4922	4.970	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9790	9.887	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9600	9.748	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9692	9.801	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9496	9.889	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.9320	9.982	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.9604	9.747	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.455	14.78	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.454	14.98	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.387	14.85	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.430	14.51	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.409	14.53	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.427	14.64	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.928	19.73	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.860	19.43	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.910	19.61	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.779	19.38	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.889	19.33	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.847	20.30	PASS



Test Graphs

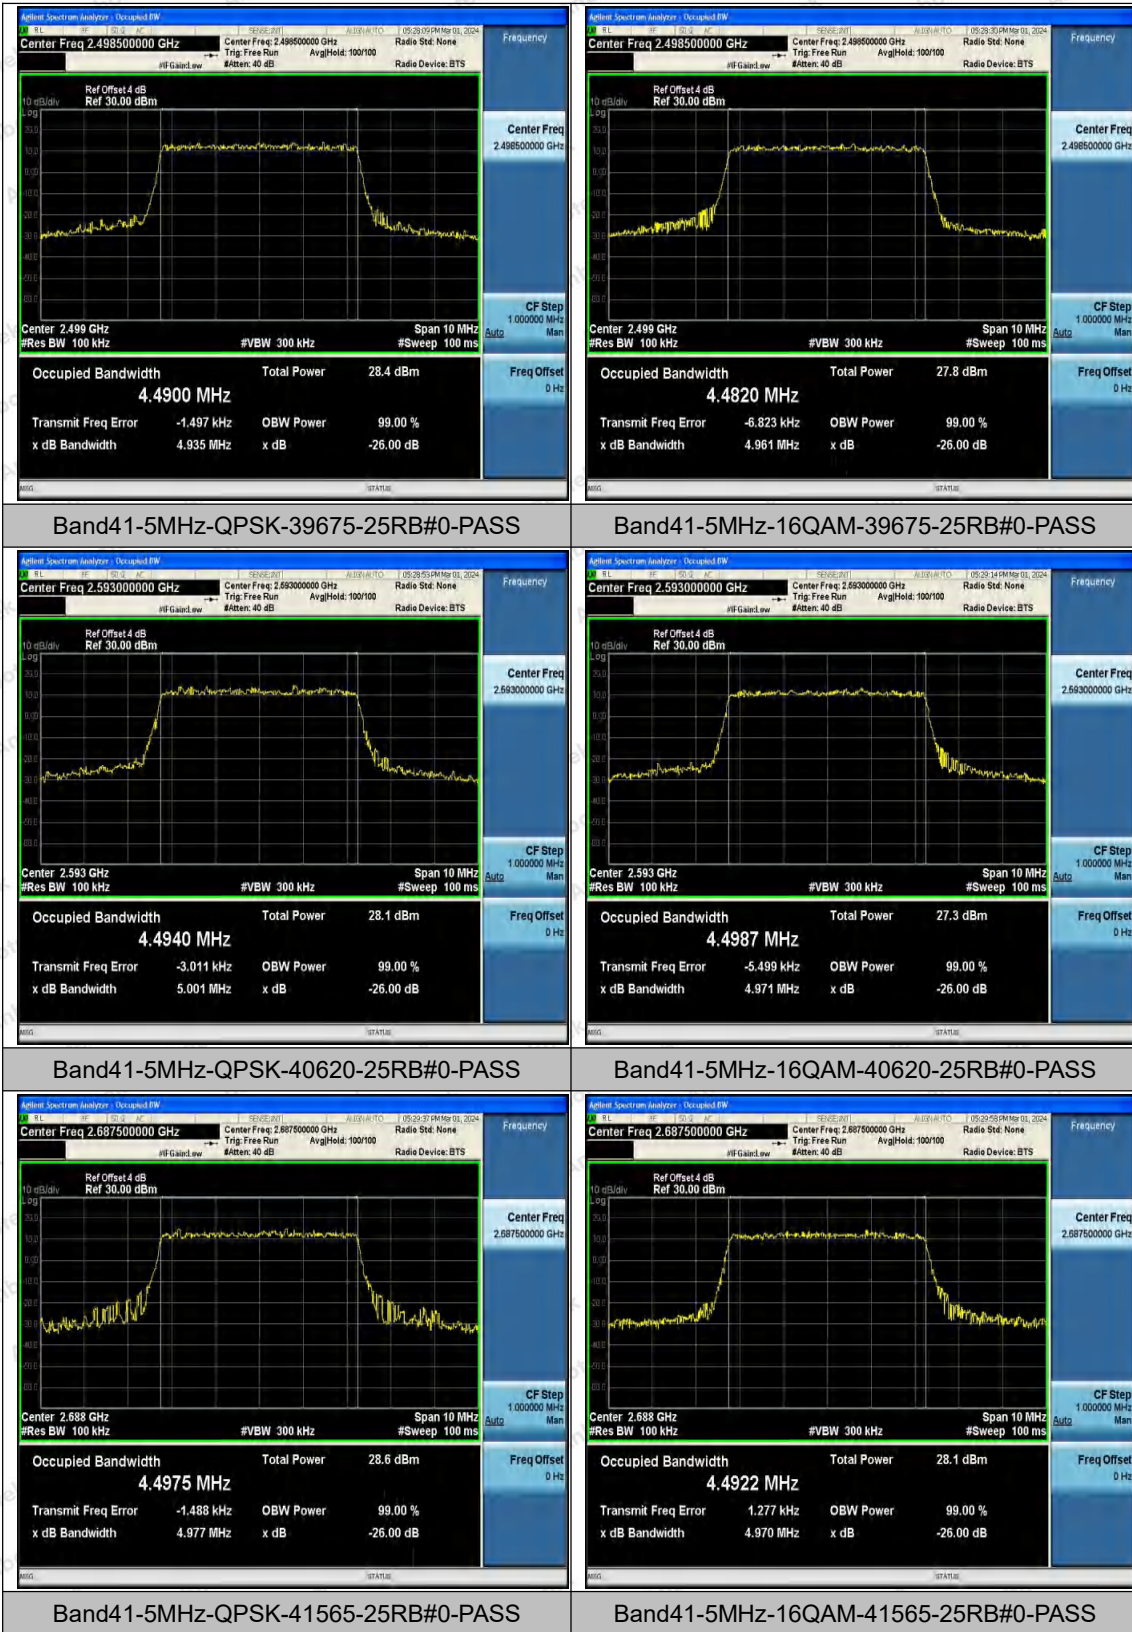

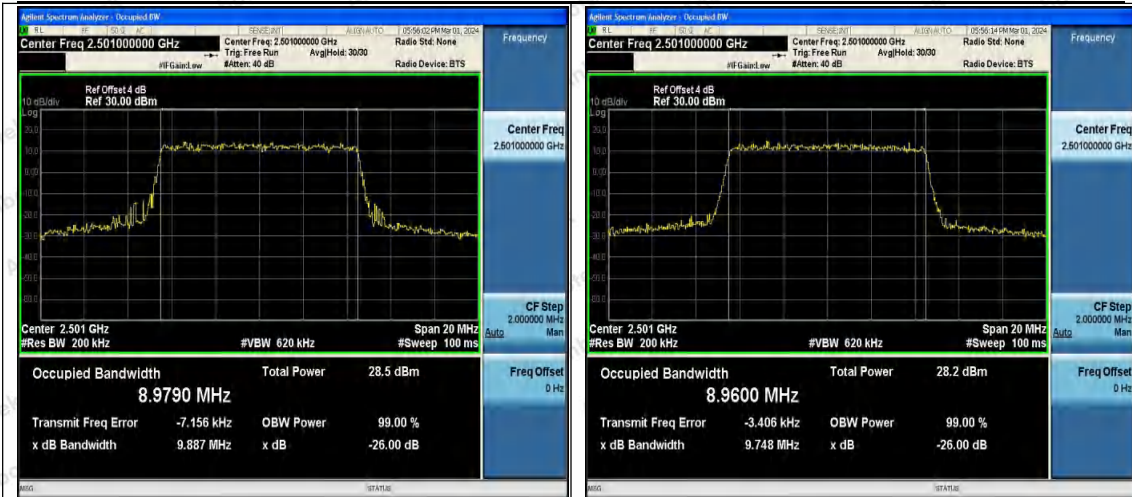

Band41-10MHz-QPSK-39700-50RB#0-PASS

Band41-10MHz-16QAM-39700-50RB#0-PASS



Band41-10MHz-QPSK-40620-50RB#0-PASS

Band41-10MHz-16QAM-40620-50RB#0-PASS



Band41-10MHz-QPSK-41540-50RB#0-PASS

Band41-10MHz-16QAM-41540-50RB#0-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500
 www.anbotek.com.cn






Band41-15MHz-QPSK-39725-75RB#0-PASS

Band41-15MHz-16QAM-39725-75RB#0-PASS

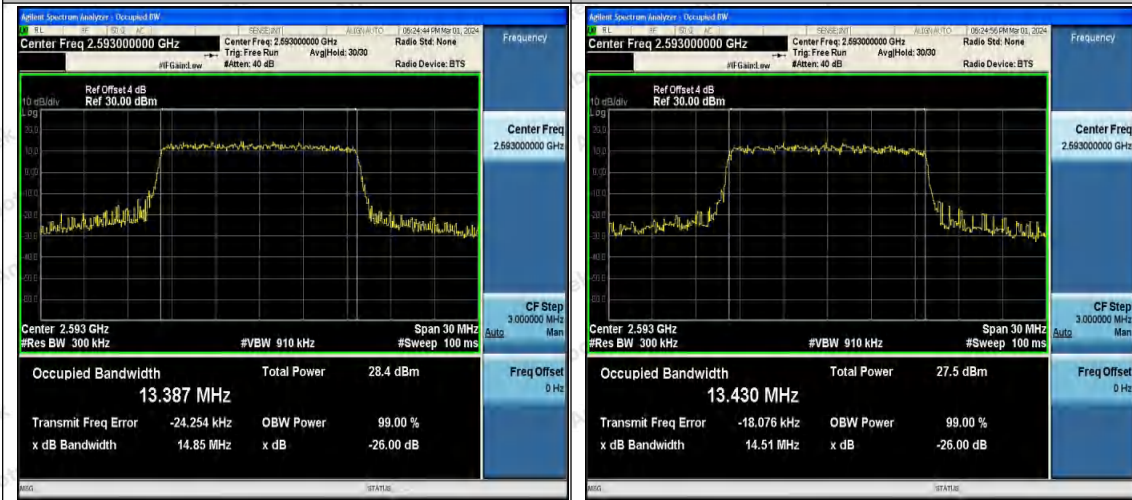

Band41-15MHz-QPSK-40620-75RB#0-PASS

Band41-15MHz-16QAM-40620-75RB#0-PASS

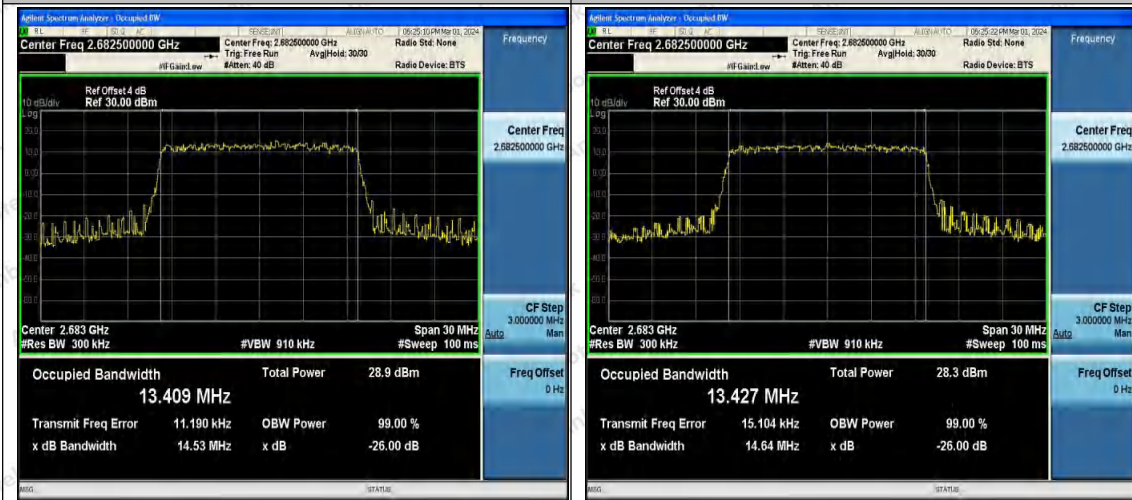

Band41-15MHz-QPSK-41515-75RB#0-PASS

Band41-15MHz-16QAM-41515-75RB#0-PASS





Band41-20MHz-QPSK-39750-100RB#0-PASS

Band41-20MHz-16QAM-39750-100RB#0-PASS



Band41-20MHz-QPSK-40620-100RB#0-PASS

Band41-20MHz-16QAM-40620-100RB#0-PASS



Band41-20MHz-QPSK-41490-100RB#0-PASS

Band41-20MHz-16QAM-41490-100RB#0-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	-24.39	PASS
Band41	5MHz	16QAM	39675	1RB#0	-22.46	PASS
Band41	5MHz	QPSK	39675	1RB#24	-58.34	PASS
Band41	5MHz	16QAM	39675	1RB#24	-58.16	PASS
Band41	5MHz	QPSK	39675	25RB#0	-45.98	PASS
Band41	5MHz	16QAM	39675	25RB#0	-46.59	PASS
Band41	5MHz	QPSK	41565	1RB#0	-39.42	PASS
Band41	5MHz	16QAM	41565	1RB#0	-55.33	PASS
Band41	5MHz	QPSK	41565	1RB#24	-18.99	PASS
Band41	5MHz	16QAM	41565	1RB#24	-20.72	PASS
Band41	5MHz	QPSK	41565	25RB#0	-44.51	PASS
Band41	5MHz	16QAM	41565	25RB#0	-45.92	PASS
Band41	10MHz	QPSK	39700	1RB#0	-46.50	PASS
Band41	10MHz	16QAM	39700	1RB#0	-49.78	PASS
Band41	10MHz	QPSK	39700	1RB#49	-47.53	PASS
Band41	10MHz	16QAM	39700	1RB#49	-49.64	PASS
Band41	10MHz	QPSK	39700	50RB#0	-40.94	PASS
Band41	10MHz	16QAM	39700	50RB#0	-41.69	PASS
Band41	10MHz	QPSK	41540	1RB#0	-52.55	PASS
Band41	10MHz	16QAM	41540	1RB#0	-52.26	PASS
Band41	10MHz	QPSK	41540	1RB#49	-24.74	PASS
Band41	10MHz	16QAM	41540	1RB#49	-25.15	PASS
Band41	10MHz	QPSK	41540	50RB#0	-42.68	PASS
Band41	10MHz	16QAM	41540	50RB#0	-44.35	PASS
Band41	15MHz	QPSK	39725	1RB#0	-41.35	PASS
Band41	15MHz	16QAM	39725	1RB#0	-42.21	PASS
Band41	15MHz	QPSK	39725	1RB#74	-45.37	PASS
Band41	15MHz	16QAM	39725	1RB#74	-46.36	PASS
Band41	15MHz	QPSK	39725	75RB#0	-37.46	PASS
Band41	15MHz	16QAM	39725	75RB#0	-38.14	PASS
Band41	15MHz	QPSK	41515	1RB#0	-38.87	PASS
Band41	15MHz	16QAM	41515	1RB#0	-51.00	PASS
Band41	15MHz	QPSK	41515	1RB#74	-25.24	PASS
Band41	15MHz	16QAM	41515	1RB#74	-27.29	PASS
Band41	15MHz	QPSK	41515	75RB#0	-40.84	PASS
Band41	15MHz	16QAM	41515	75RB#0	-42.53	PASS
Band41	20MHz	QPSK	39750	1RB#0	-41.31	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



Band41	20MHz	16QAM	39750	1RB#0	-41.81	PASS
Band41	20MHz	QPSK	39750	1RB#99	-45.27	PASS
Band41	20MHz	16QAM	39750	1RB#99	-45.44	PASS
Band41	20MHz	QPSK	39750	100RB#0	-35.94	PASS
Band41	20MHz	16QAM	39750	100RB#0	-36.75	PASS
Band41	20MHz	QPSK	41490	1RB#0	-50.09	PASS
Band41	20MHz	16QAM	41490	1RB#0	-50.18	PASS
Band41	20MHz	QPSK	41490	1RB#99	-34.13	PASS
Band41	20MHz	16QAM	41490	1RB#99	-29.24	PASS
Band41	20MHz	QPSK	41490	100RB#0	-42.93	PASS
Band41	20MHz	16QAM	41490	100RB#0	-43.63	PASS


Test Graphs

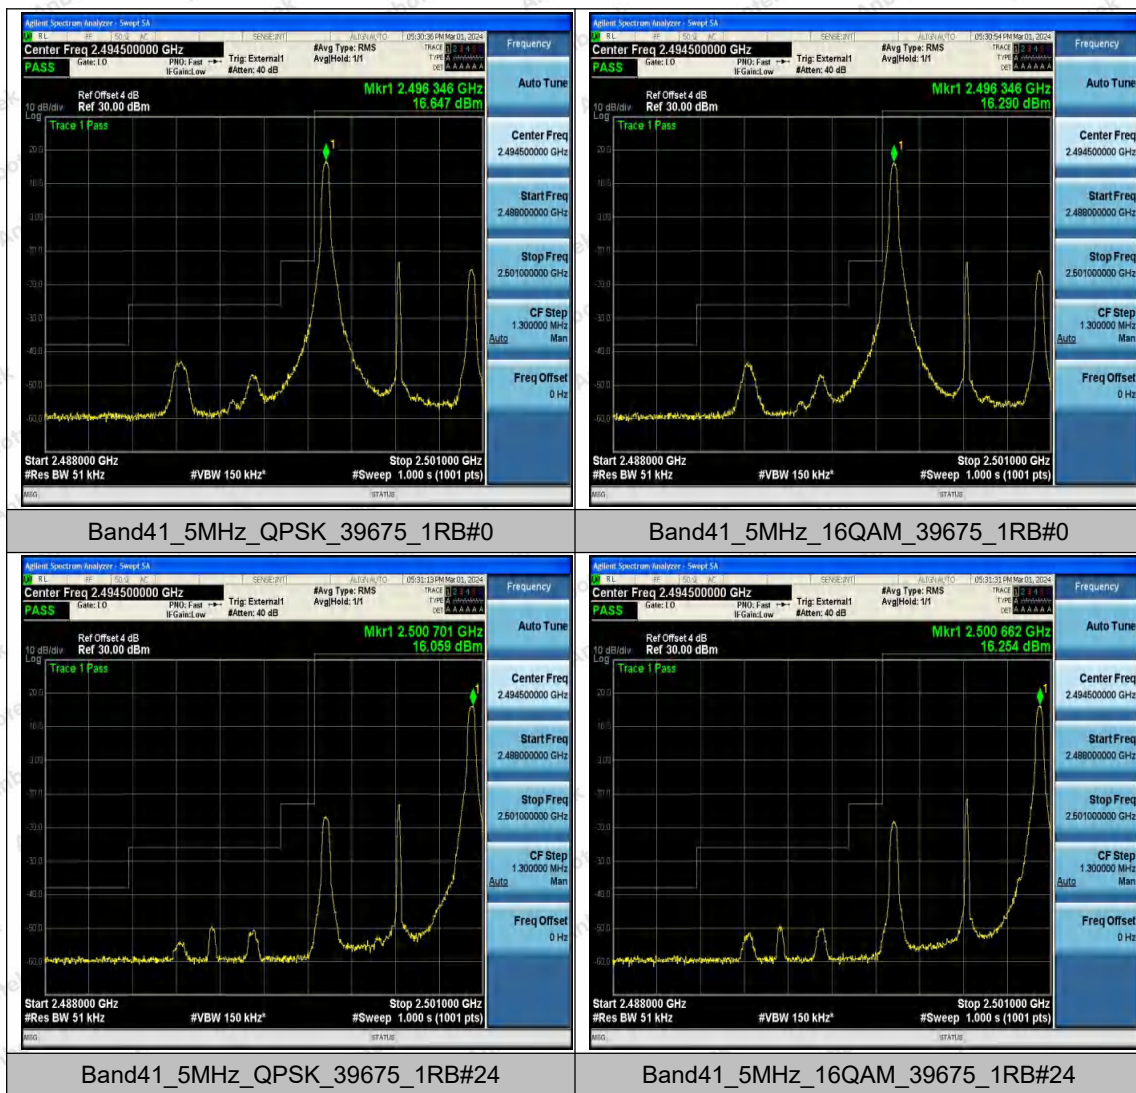




Band41_5MHz_QPSK_39675_25RB#0

Band41_5MHz_16QAM_39675_25RB#0

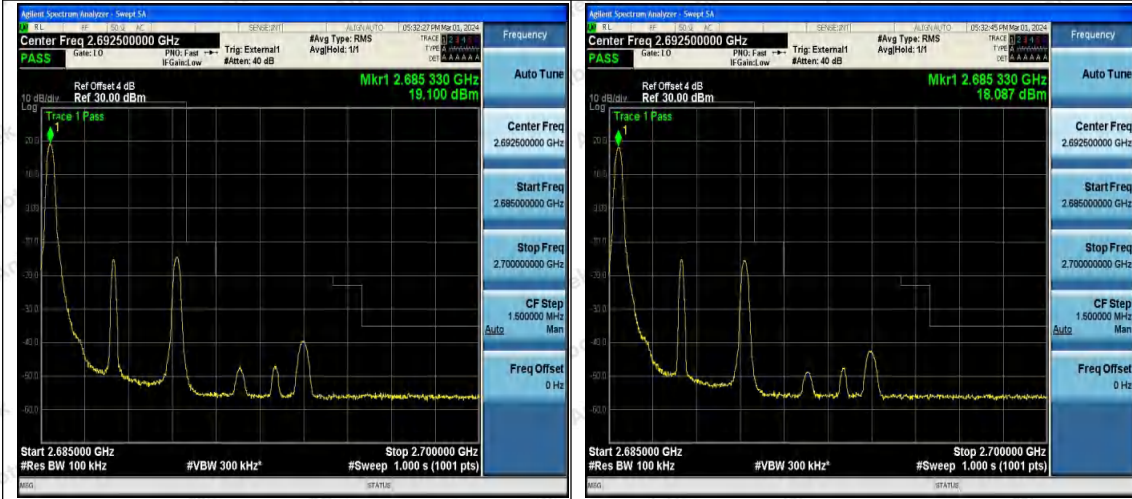

Band41_5MHz_QPSK_41565_1RB#0

Band41_5MHz_16QAM_41565_1RB#0

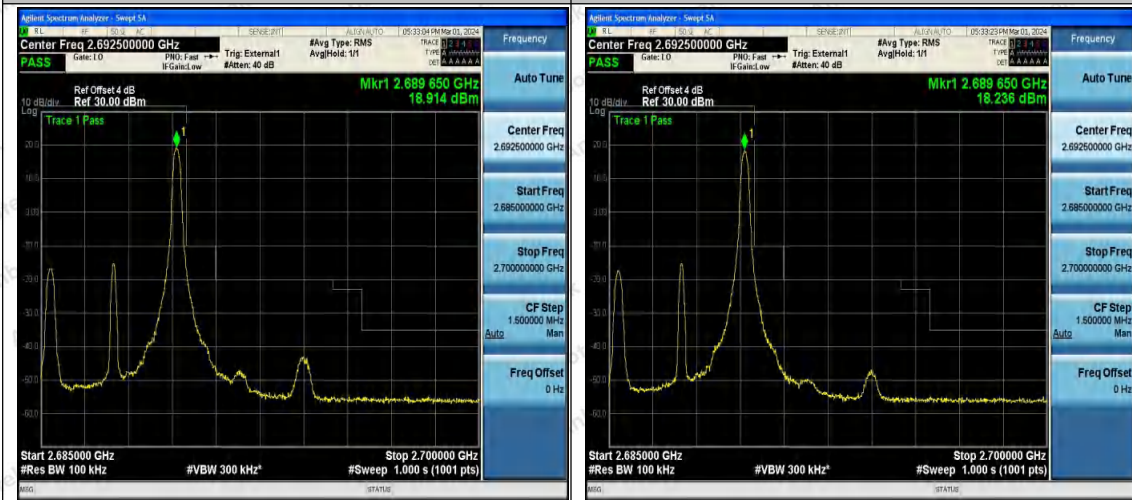

Band41_5MHz_QPSK_41565_1RB#24

Band41_5MHz_16QAM_41565_1RB#24

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500
 www.anbotek.com.cn





Band41_5MHz_QPSK_41565_25RB#0

Band41_5MHz_16QAM_41565_25RB#0

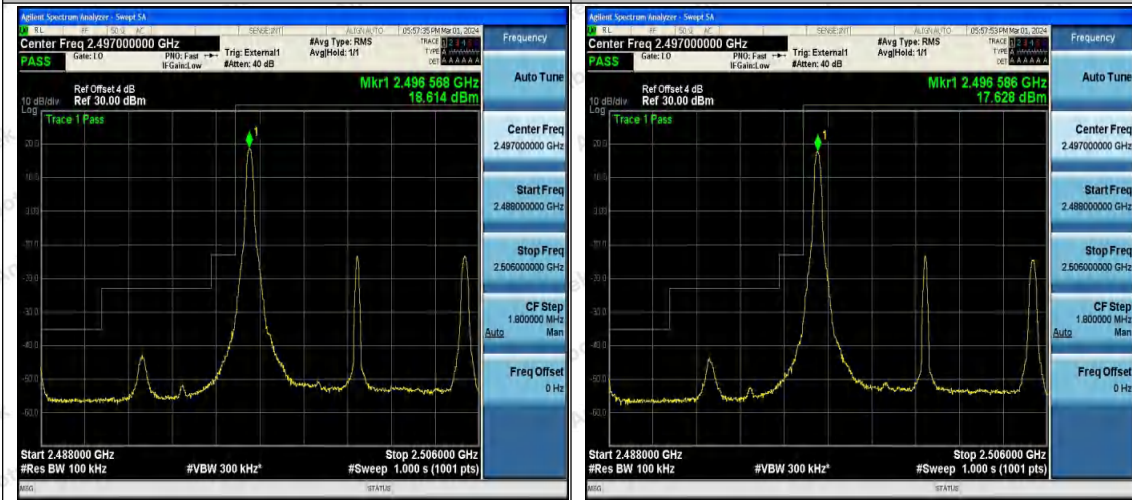

Band41_10MHz_QPSK_39700_1RB#0

Band41_10MHz_16QAM_39700_1RB#0



Band41_10MHz_QPSK_39700_1RB#49

Band41_10MHz_16QAM_39700_1RB#49

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline
 400-003-0500
 www.anbotek.com.cn






Band41_10MHz_QPSK_39700_50RB#0


Band41_10MHz_16QAM_39700_50RB#0

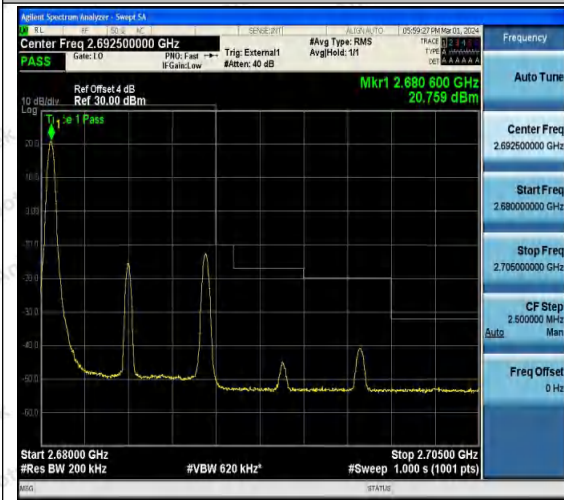


Band41_10MHz_QPSK_41540_1RB#0

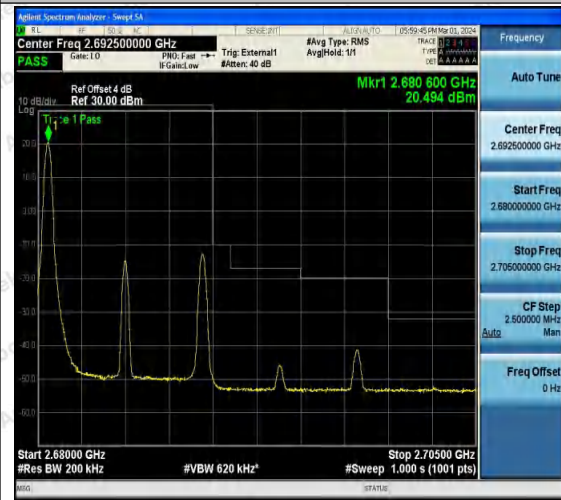

Band41_10MHz_16QAM_41540_1RB#0

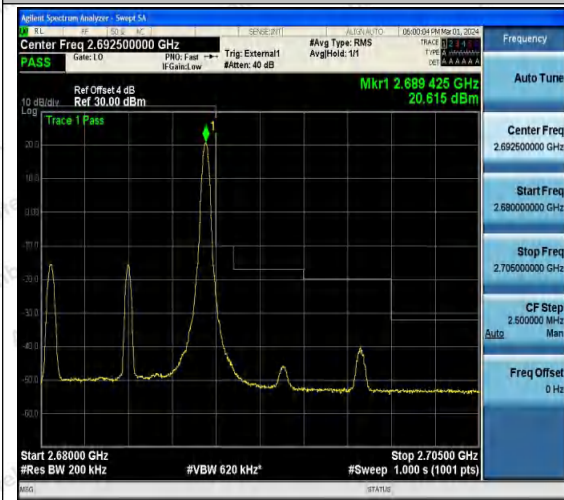

Band41_10MHz_QPSK_41540_1RB#49

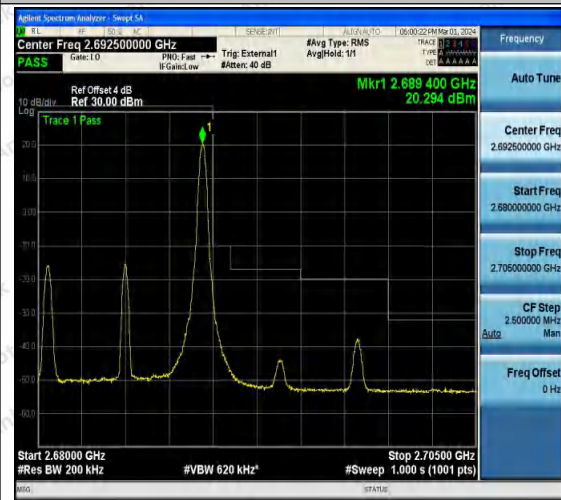


Band41_10MHz_16QAM_41540_1RB#49






Band41_10MHz_QPSK_41540_50RB#0

Band41_10MHz_16QAM_41540_50RB#0

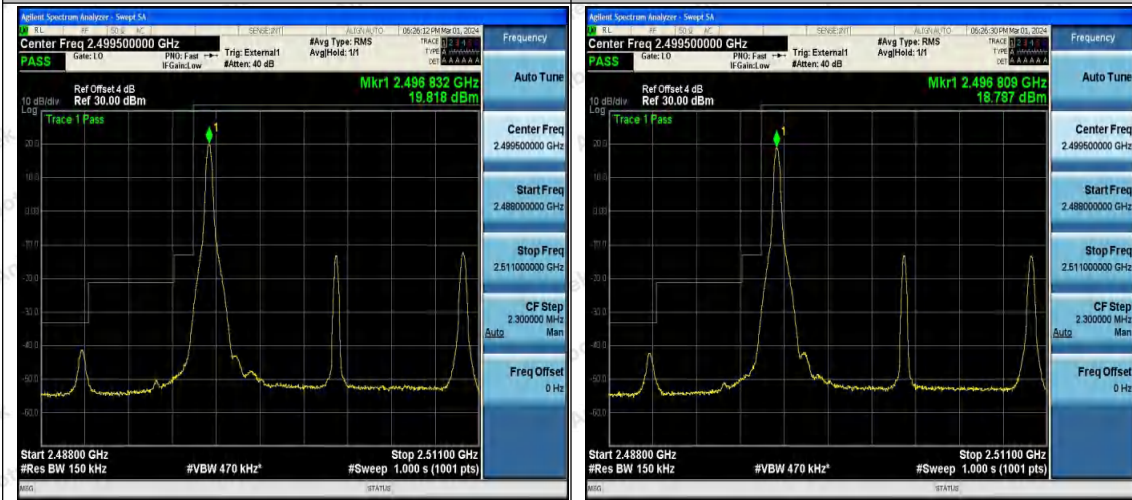

Band41_15MHz_QPSK_39725_1RB#0

Band41_15MHz_16QAM_39725_1RB#0

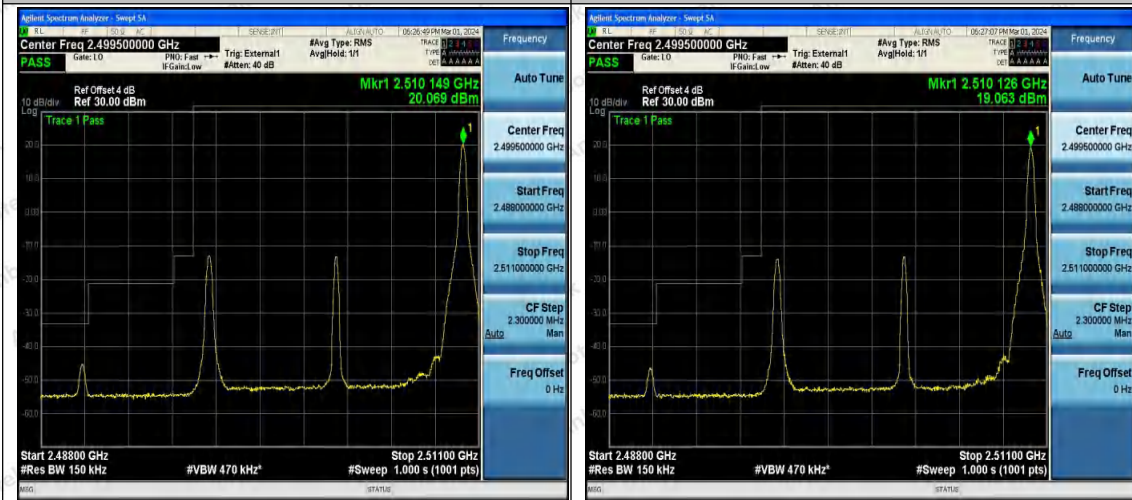

Band41_15MHz_QPSK_39725_1RB#74

Band41_15MHz_16QAM_39725_1RB#74

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline: 400-003-0500
 www.anbotek.com.cn






Band41_15MHz_QPSK_39725_75RB#0

Band41_15MHz_16QAM_39725_75RB#0

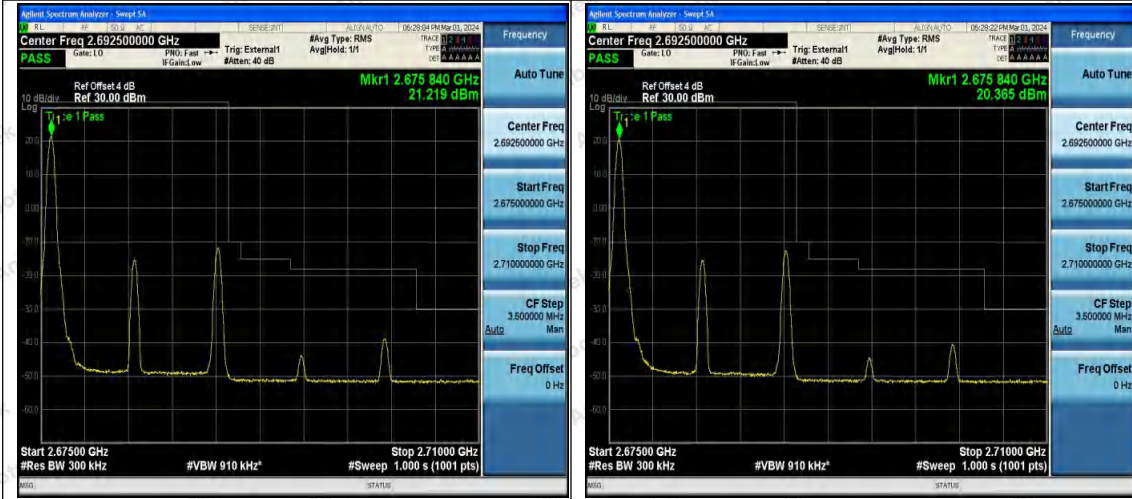

Band41_15MHz_QPSK_41515_1RB#0

Band41_15MHz_16QAM_41515_1RB#0

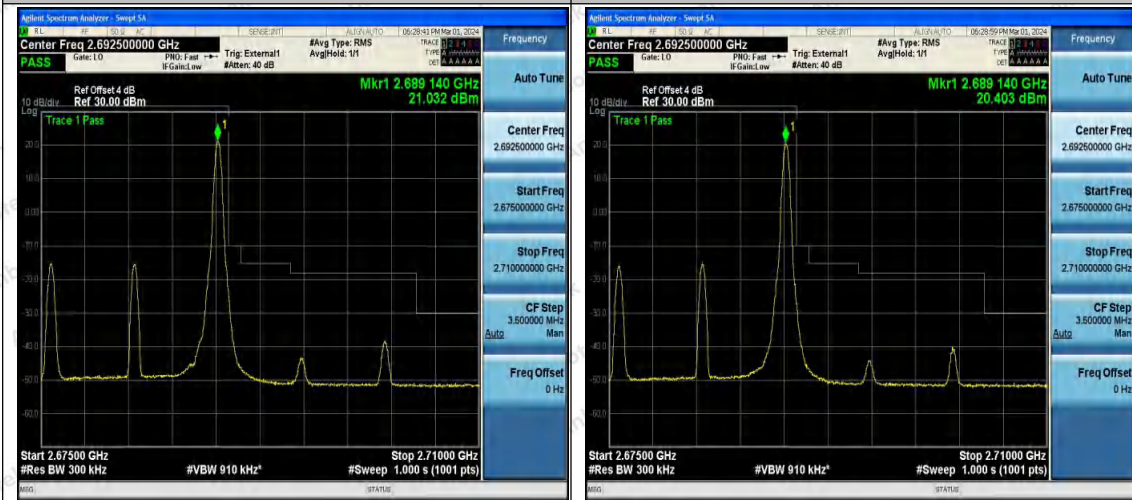

Band41_15MHz_QPSK_41515_1RB#74

Band41_15MHz_16QAM_41515_1RB#74

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline: 400-003-0500
 www.anbotek.com.cn






Band41_15MHz_QPSK_41515_75RB#0

Band41_15MHz_16QAM_41515_75RB#0

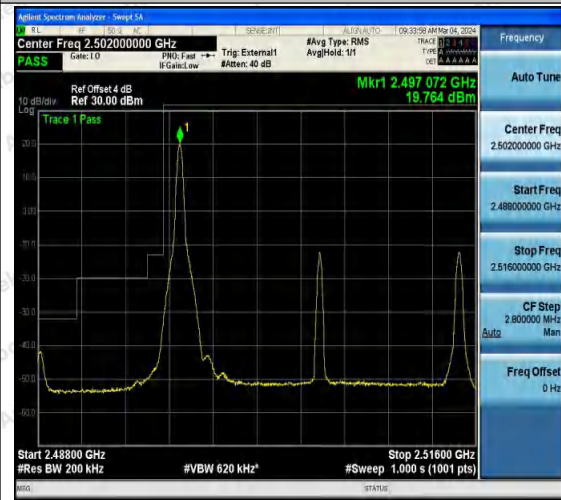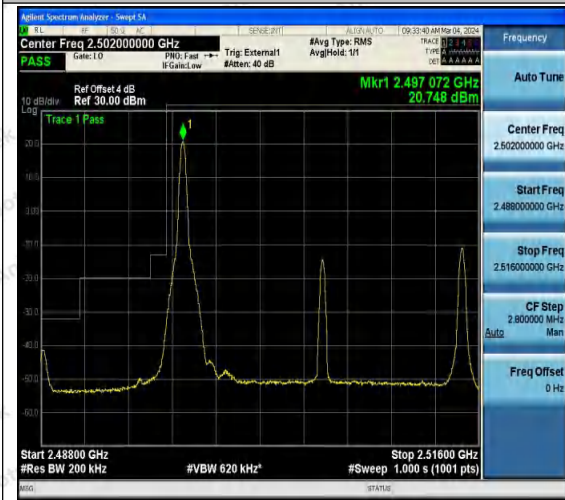

Band41_20MHz_QPSK_39750_1RB#0

Band41_20MHz_16QAM_39750_1RB#0

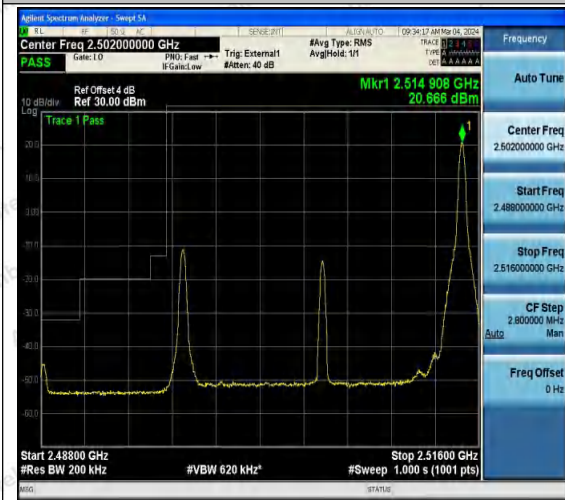

Band41_20MHz_QPSK_39750_1RB#99


Band41_20MHz_16QAM_39750_1RB#99

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



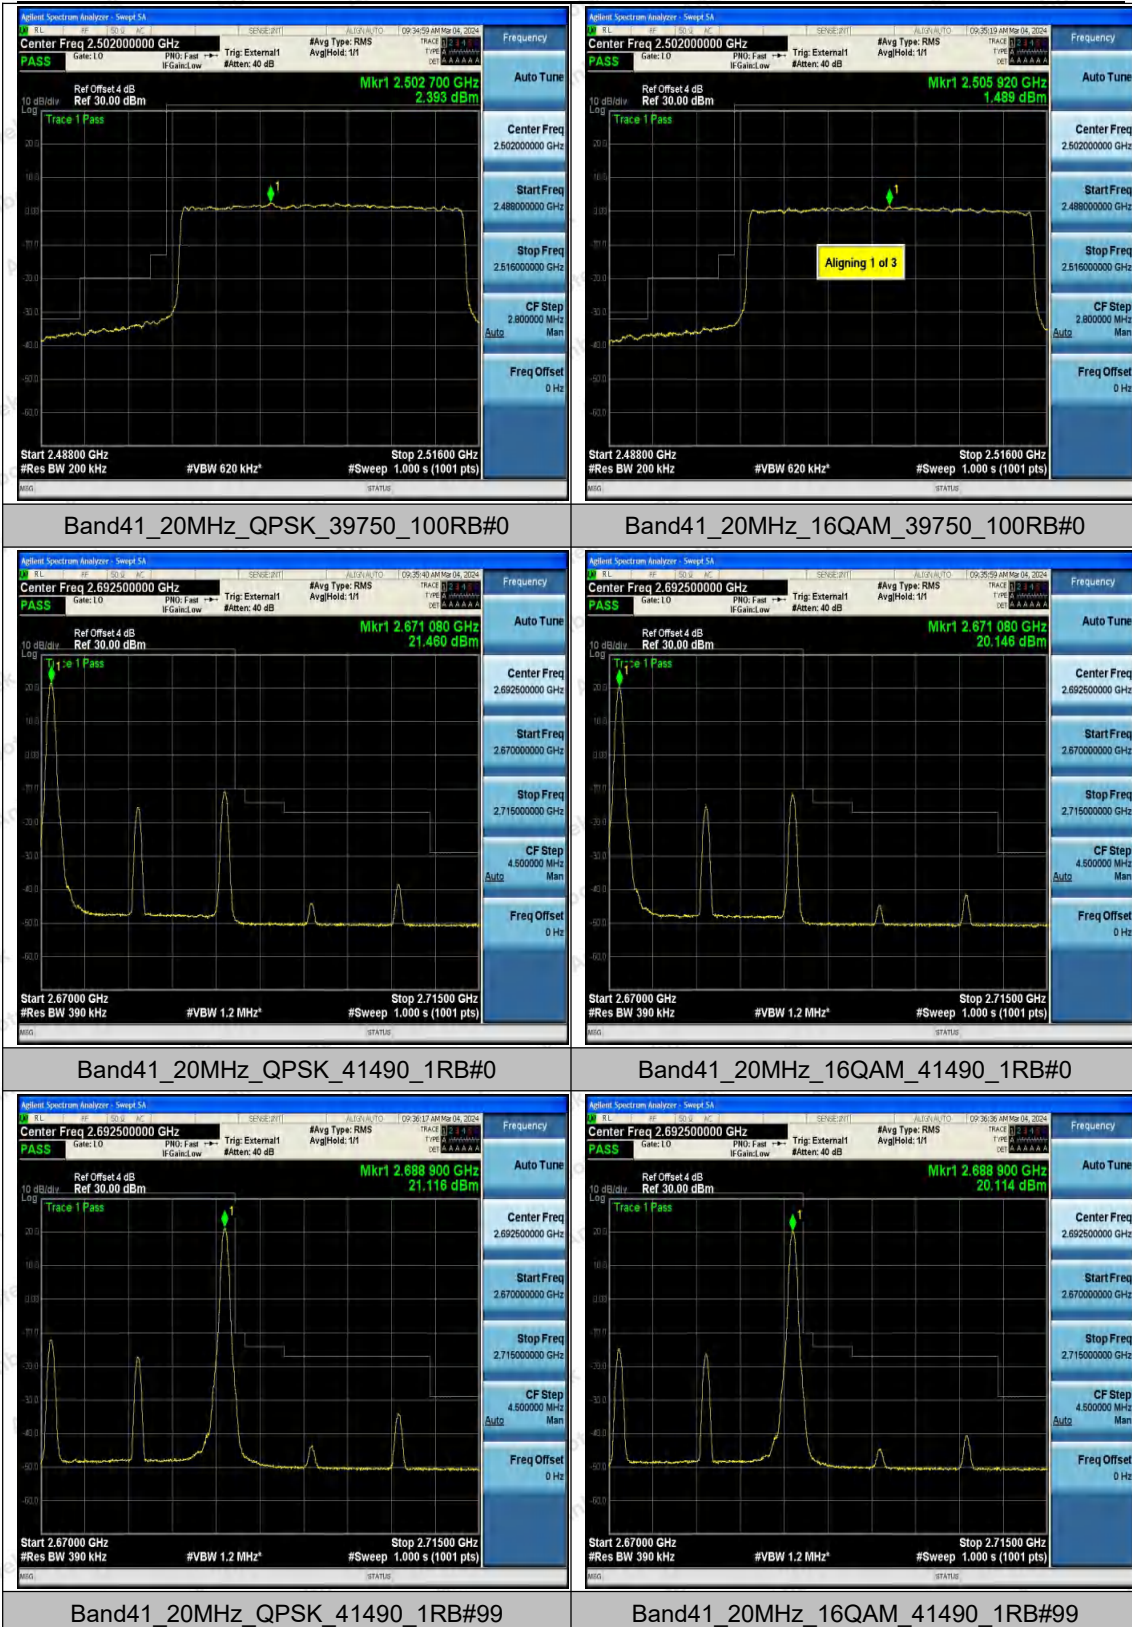

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com.cn





Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-70.81	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-67.55	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-66.92	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-42.15	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-71.40	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-70.24	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-66.68	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-42.28	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-72.19	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-60.61	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-66.59	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-42.13	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-71.85	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-60.68	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-66.70	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-41.96	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-67.68	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-67.86	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-64.59	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-42.01	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-69.23	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-68.59	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-65.25	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-41.98	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-70.53	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-69.46	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-66.66	PASS
Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-41.80	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-71.51	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-68.73	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-66.88	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-42.25	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-71.46	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-61.26	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-66.61	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-41.91	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-69.84	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-62.89	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-66.93	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-41.93	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-68.78	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-66.07	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-63.53	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-42.02	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-69.14	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-68.94	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-65.92	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-41.46	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-70.99	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-72.83	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-66.85	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-41.93	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-71.02	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-70.28	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-66.90	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-42.09	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-72.92	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-61.75	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-66.60	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-42.03	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-71.10	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-65.02	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-66.87	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-42.01	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-69.25	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-69.37	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-64.44	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-42.05	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-69.01	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-68.79	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-66.00	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-41.66	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-71.97	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-69.72	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-67.13	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-42.59	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-71.02	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-69.30	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-66.62	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-42.30	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-69.11	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-59.69	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-66.46	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-42.30	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-69.68	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-60.02	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-66.96	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-42.63	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-68.85	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-68.88	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-63.92	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-42.76	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-69.56	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-68.40	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-66.46	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-42.26	PASS



Test Graphs

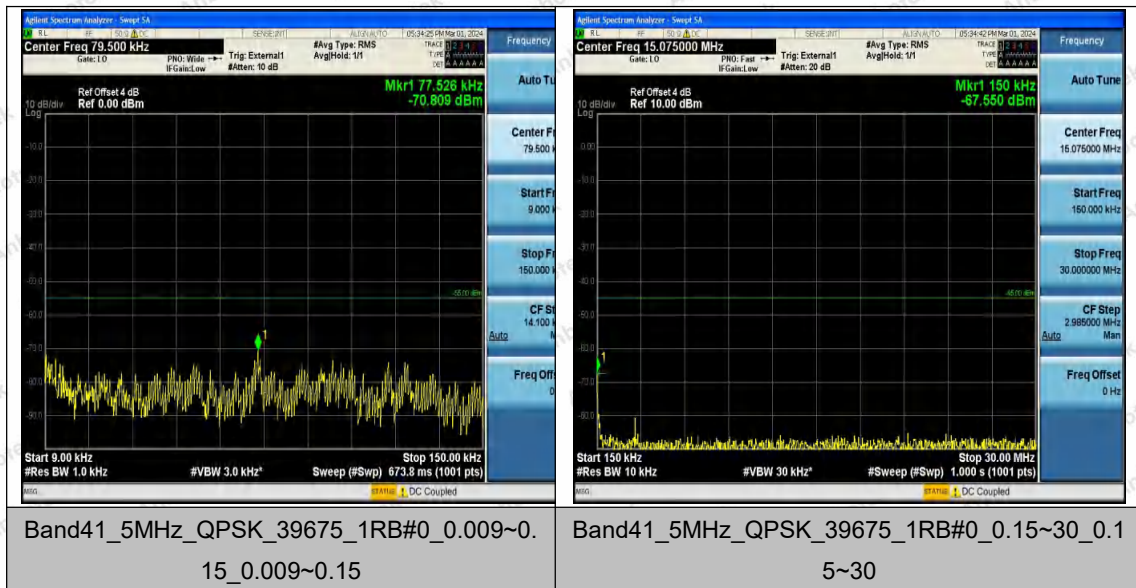





Band41_5MHz_QPSK_39675_1RB#0_30~1000_30~1000

Band41_5MHz_QPSK_39675_1RB#0_2000~2700_0_20000~27000

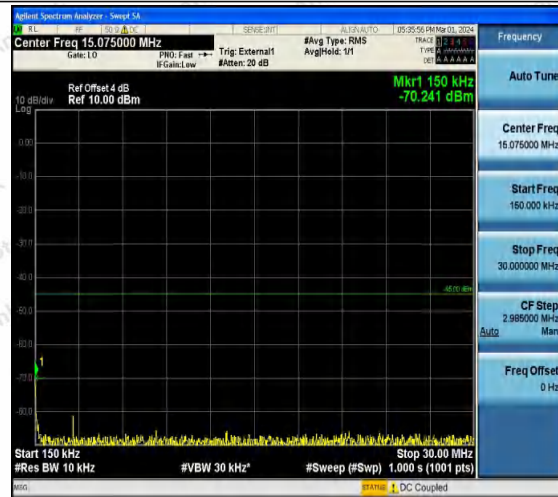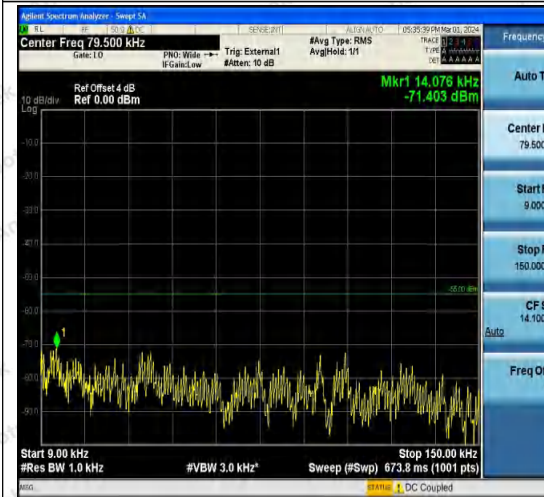

Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15

Band41_5MHz_16QAM_39675_1RB#0_0.15~30_0.15~30

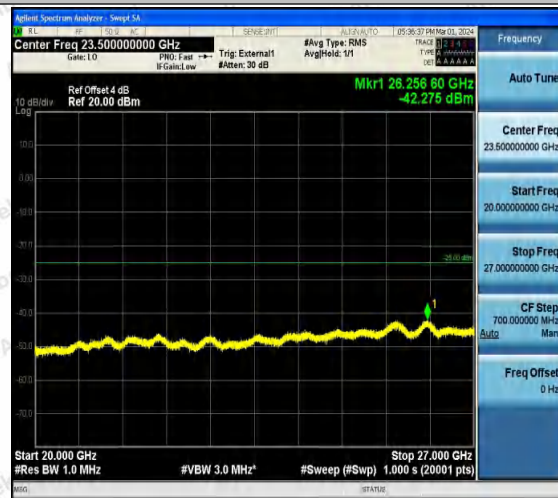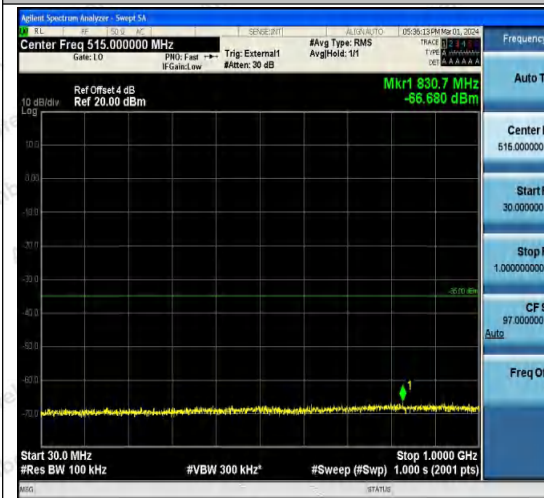

Band41_5MHz_16QAM_39675_1RB#0_30~1000_0_30~1000


Band41_5MHz_16QAM_39675_1RB#0_2000~2700_00_20000~27000

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500
 www.anbotek.com.cn



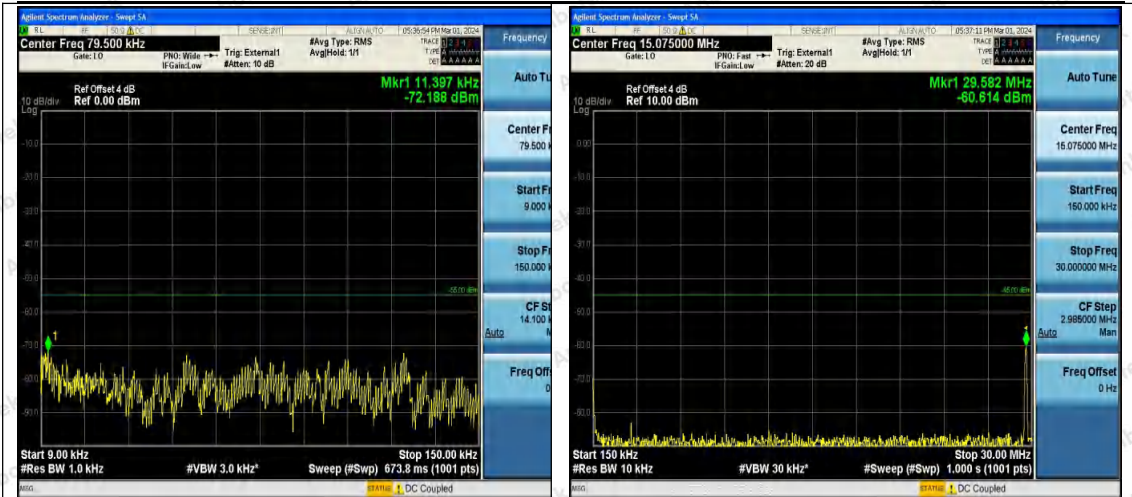

Band41_5MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15


Band41_5MHz_QPSK_40620_1RB#0_0.15~30_0.15~30

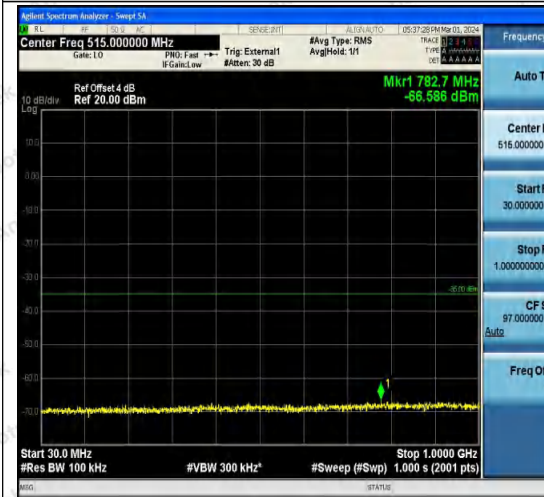

Band41_5MHz_QPSK_40620_1RB#0_30~1000_30~1000



Band41_5MHz_QPSK_40620_1RB#0_20000~27000_0_20000~27000

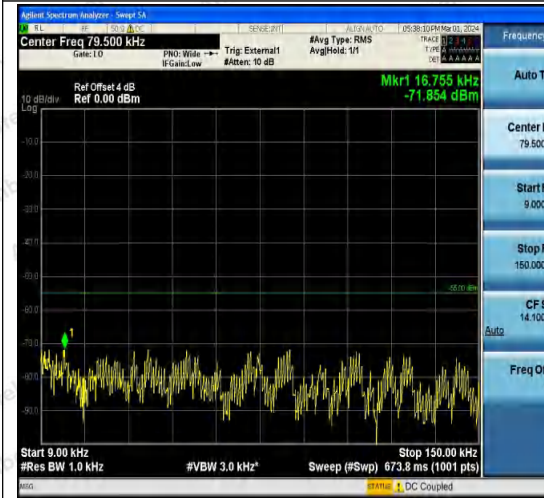


Band41_5MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15




Band41_5MHz_16QAM_40620_1RB#0_0.15~30_0.15~30



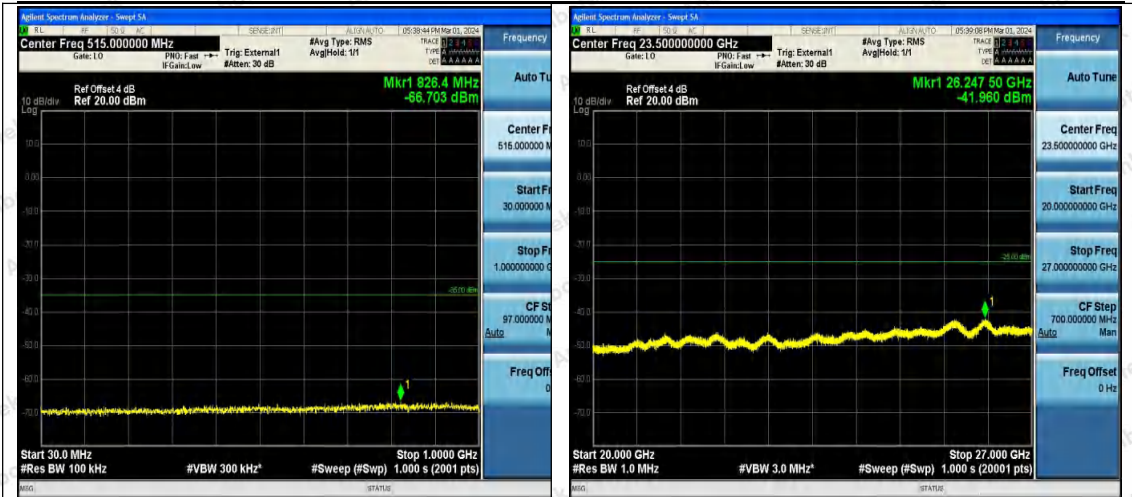


Band41_5MHz_16QAM_40620_1RB#0_30~100
0_30~1000


Band41_5MHz_16QAM_40620_1RB#0_2000~270
00_20000~27000

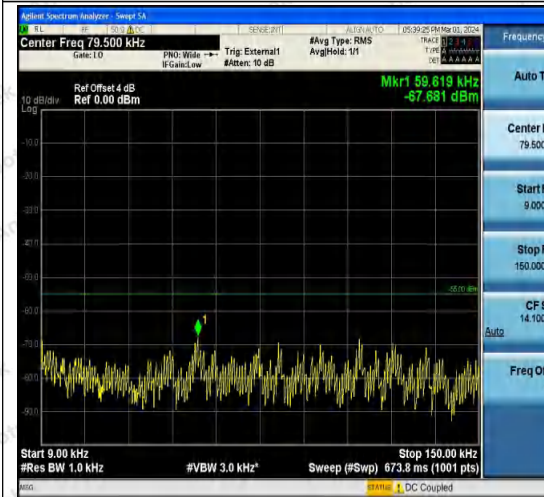


Band41_5MHz_QPSK_41565_1RB#0_0.009~0.
15_0.009~0.15

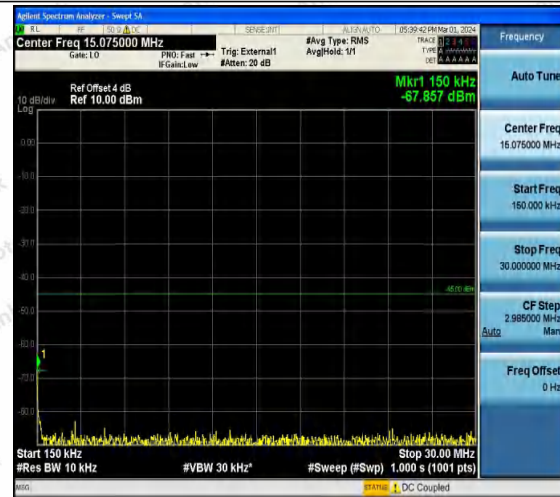

Band41_5MHz_QPSK_41565_1RB#0_0.15~30_0.1
5~30

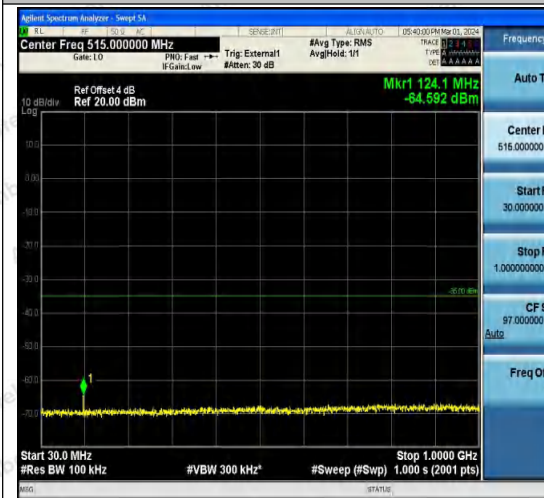


Band41_5MHz_QPSK_41565_1RB#0_30~1000
_30~1000

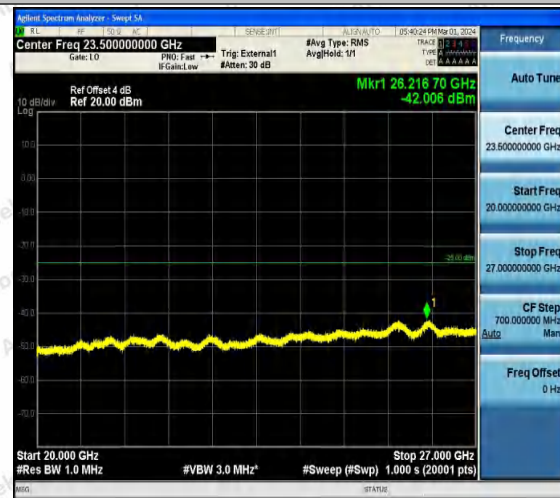


Band41_5MHz_QPSK_41565_1RB#0_2000~2700
0_20000~27000



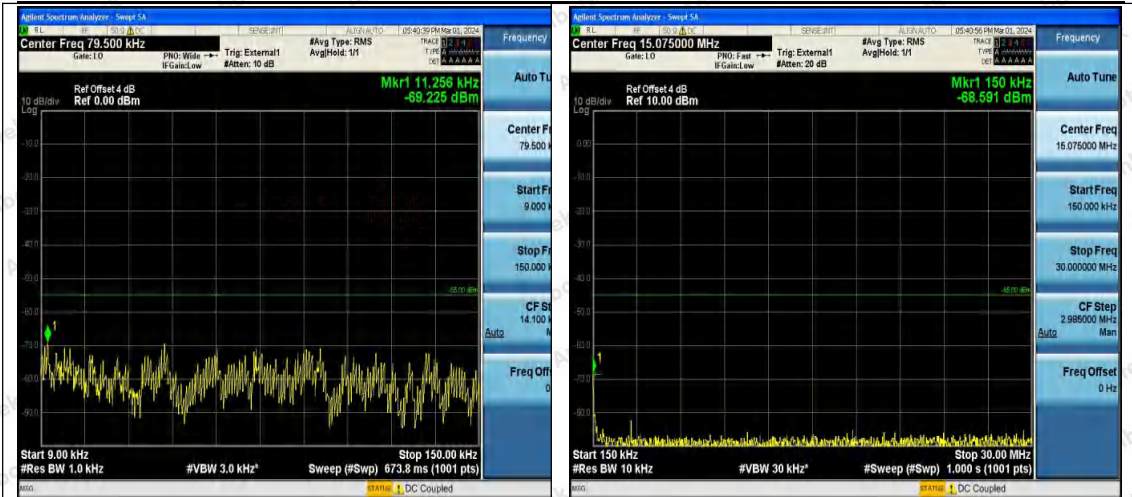


Band41_5MHz_16QAM_41565_1RB#0_0.009~0.15_0.009~0.15

Band41_5MHz_16QAM_41565_1RB#0_0.15~30_0.15~30

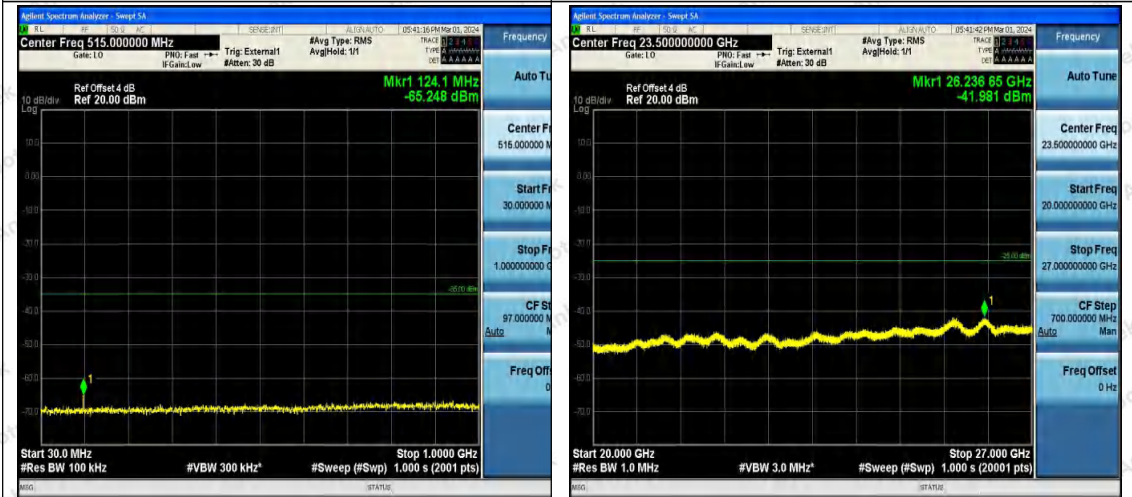

Band41_5MHz_16QAM_41565_1RB#0_30~100_0_30~1000

Band41_5MHz_16QAM_41565_1RB#0_2000~27000_00_20000~27000

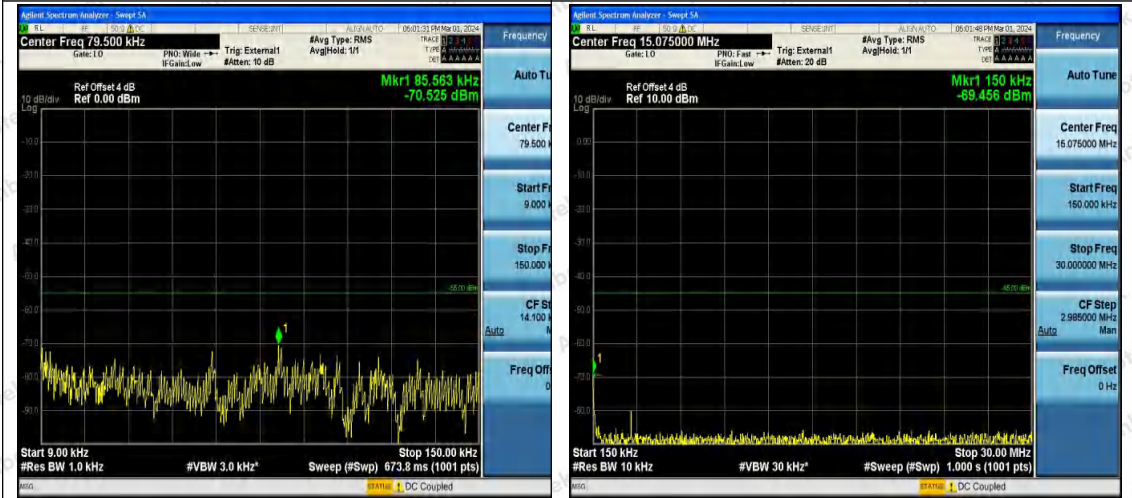

Band41_10MHz_QPSK_39700_1RB#0_0.009~0.15_0.009~0.15

Band41_10MHz_QPSK_39700_1RB#0_0.15~30_0.15~30

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500
www.anbotek.com.cn






Band41_10MHz_QPSK_39700_1RB#0_30~100
0_30~1000

Band41_10MHz_QPSK_39700_1RB#0_2000~270
00_20000~27000

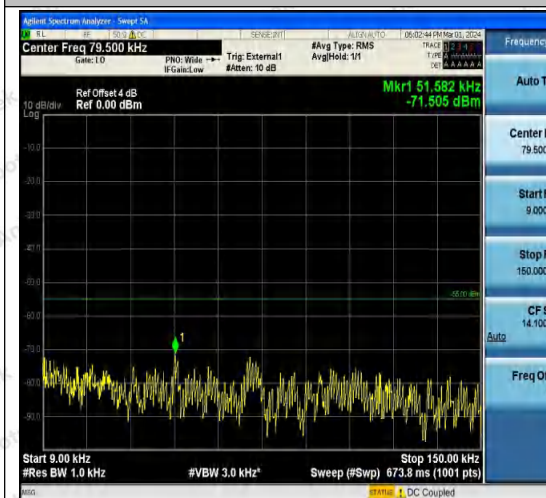

Band41_10MHz_16QAM_39700_1RB#0_0.009
~0.15_0.009~0.15

Band41_10MHz_16QAM_39700_1RB#0_0.15~30
0.15~30

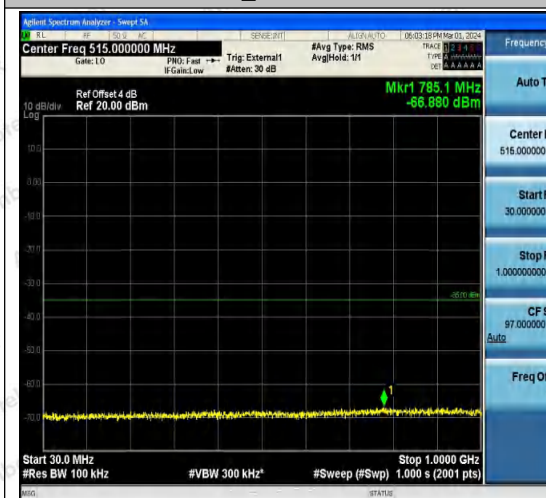

Band41_10MHz_16QAM_39700_1RB#0_30~10
00_30~1000

Band41_10MHz_16QAM_39700_1RB#0_2000~27
000_20000~27000

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com.cn





Band41_10MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

Band41_10MHz_QPSK_40620_1RB#0_0.15~30_0.15~30

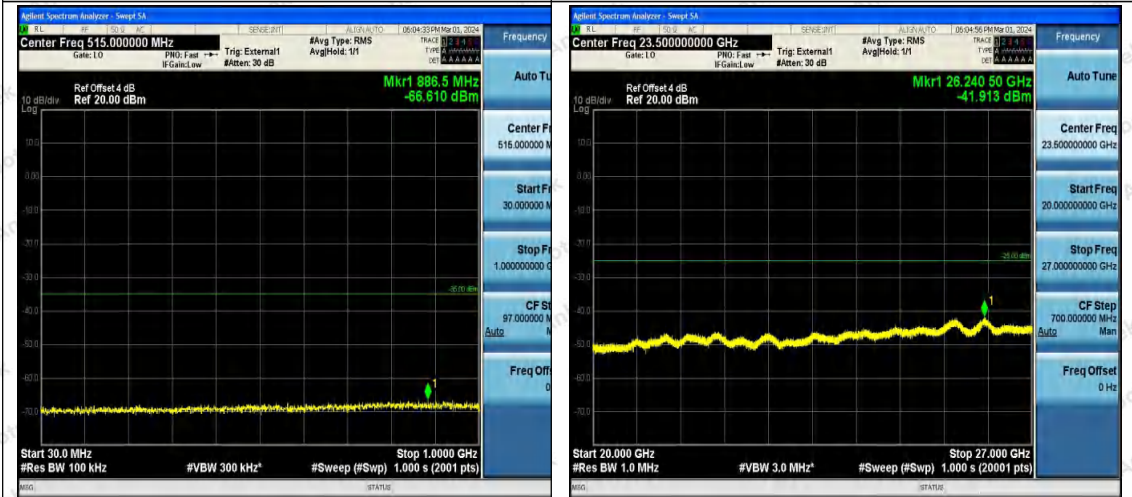

Band41_10MHz_QPSK_40620_1RB#0_30~100_0_30~1000

Band41_10MHz_QPSK_40620_1RB#0_20000~27000_00_20000~27000



Band41_10MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15


Band41_10MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500
www.anbotek.com.cn



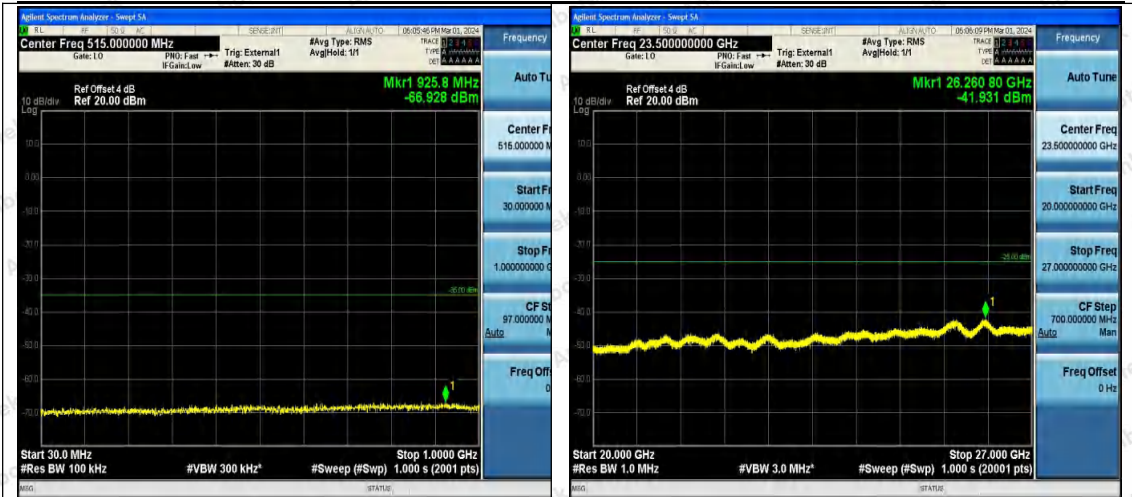


Band41_10MHz_16QAM_40620_1RB#0_30~10000_30~1000


Band41_10MHz_16QAM_40620_1RB#0_20000~27000_000_20000~27000

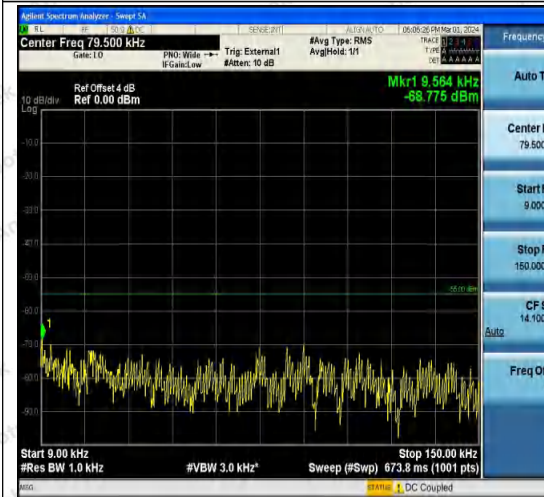


Band41_10MHz_QPSK_41540_1RB#0_0.009~0.15_0.009~0.15

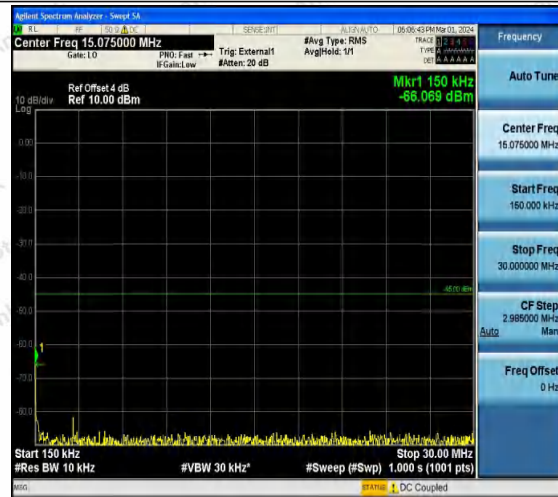

Band41_10MHz_QPSK_41540_1RB#0_0.15~30_0.15~30

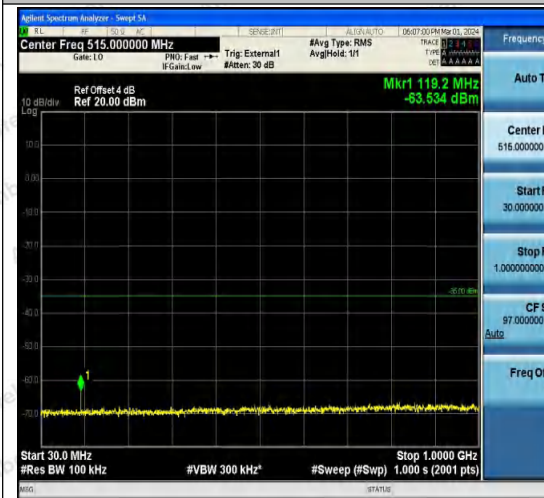

Band41_10MHz_QPSK_41540_1RB#0_30~10000_0_30~1000

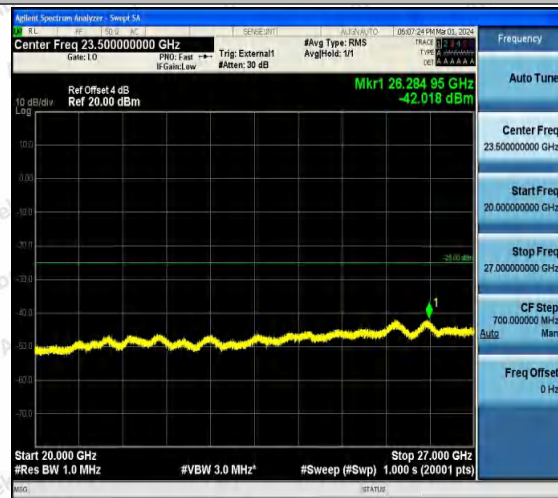

Band41_10MHz_QPSK_41540_1RB#0_20000~27000_000_20000~27000

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com.cn






Band41_10MHz_16QAM_41540_1RB#0_0.009~0.15_0.009~0.15

Band41_10MHz_16QAM_41540_1RB#0_0.15~30_0.15~30

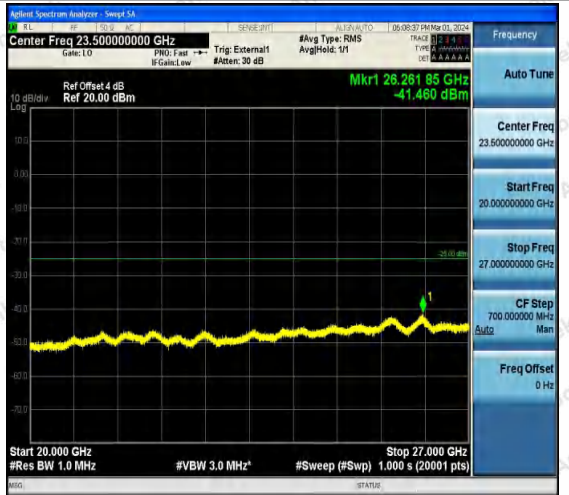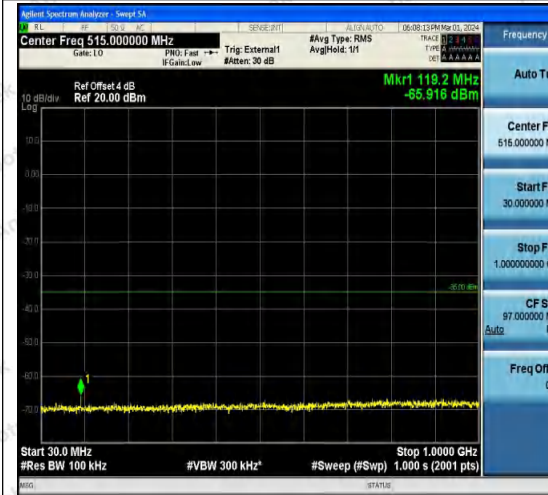

Band41_10MHz_16QAM_41540_1RB#0_30~1000_00_30~1000

Band41_10MHz_16QAM_41540_1RB#0_20000~27000_000_20000~27000

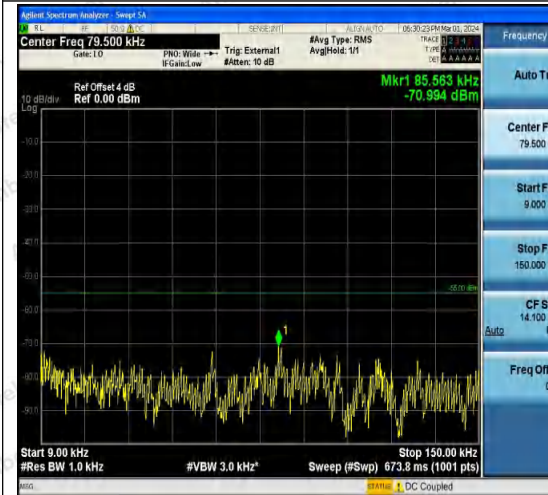

Band41_15MHz_QPSK_39725_1RB#0_0.009~0.15_0.009~0.15

Band41_15MHz_QPSK_39725_1RB#0_0.15~30_0.15~30

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline 400-003-0500
 www.anbotek.com.cn







Band41_15MHz_QPSK_39725_1RB#0_30~100
0_30~1000

Band41_15MHz_QPSK_39725_1RB#0_2000~270
00_20000~27000

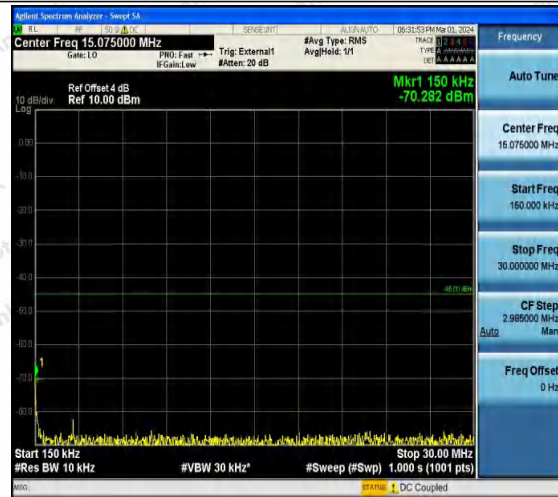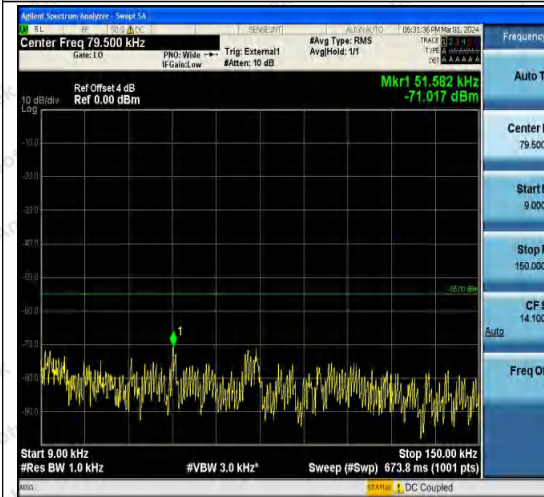

Band41_15MHz_16QAM_39725_1RB#0_0.009
~0.15_0.009~0.15

Band41_15MHz_16QAM_39725_1RB#0_0.15~30
0.15~30

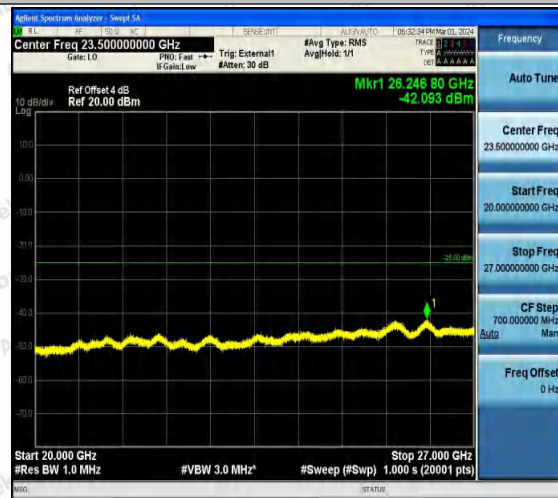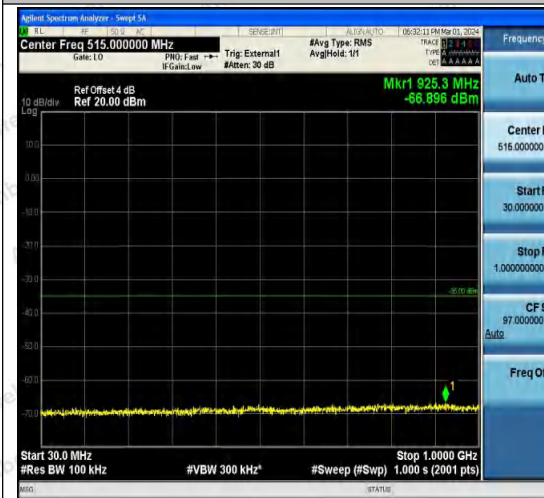

Band41_15MHz_16QAM_39725_1RB#0_30~10
00_30~1000

Band41_15MHz_16QAM_39725_1RB#0_2000~27
000_20000~27000

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com.cn






Band41_15MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

Band41_15MHz_QPSK_40620_1RB#0_0.15~30_0.15~30

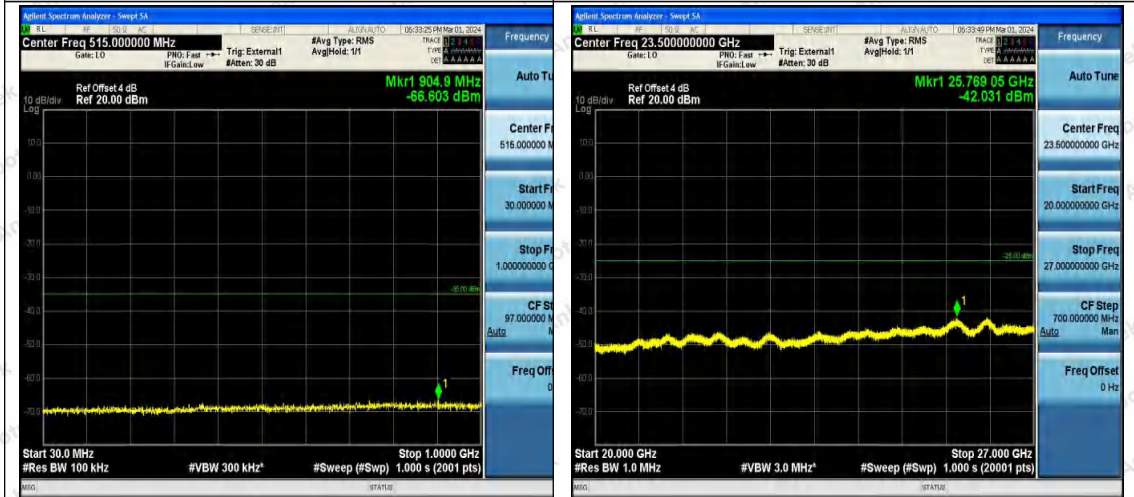

Band41_15MHz_QPSK_40620_1RB#0_30~100_0_30~1000

Band41_15MHz_QPSK_40620_1RB#0_20000~27000_00_20000~27000

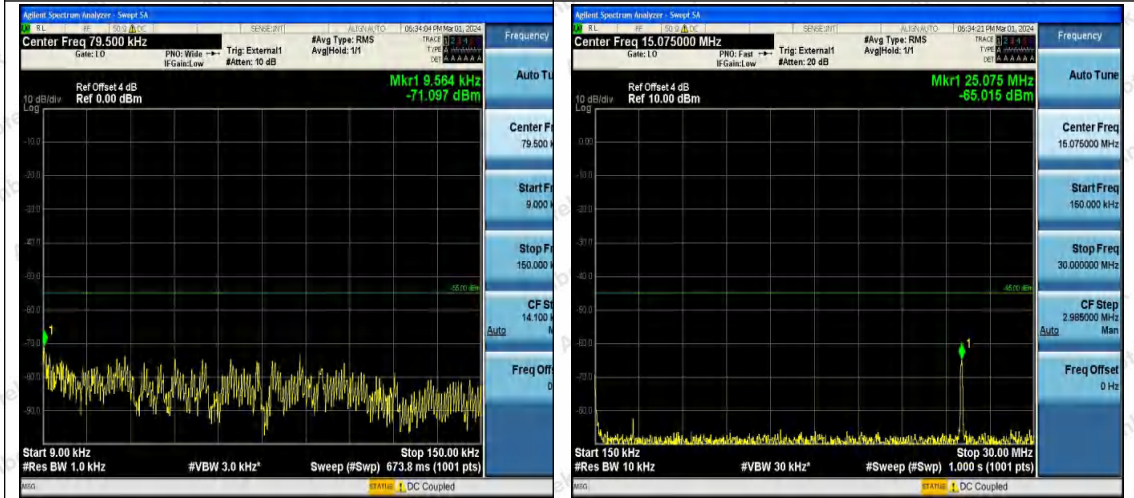

Band41_15MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15

Band41_15MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500
www.anbotek.com.cn






Band41_15MHz_16QAM_40620_1RB#0_30~10000_30~1000


Band41_15MHz_16QAM_40620_1RB#0_20000~27000_20000~27000

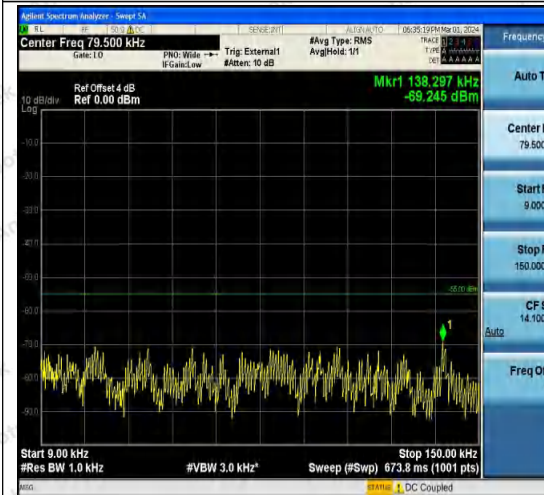


Band41_15MHz_QPSK_41515_1RB#0_0.009~0.15_0.009~0.15

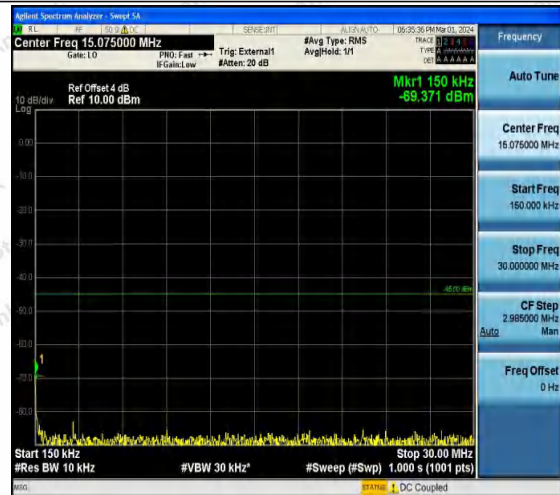

Band41_15MHz_QPSK_41515_1RB#0_0.15~30_0.15~30

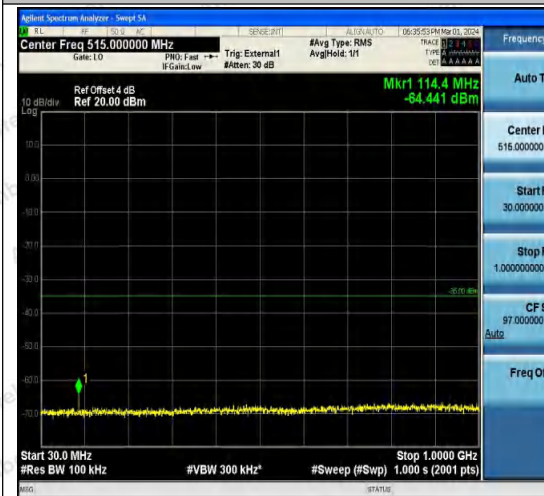


Band41_15MHz_QPSK_41515_1RB#0_30~10000_30~1000

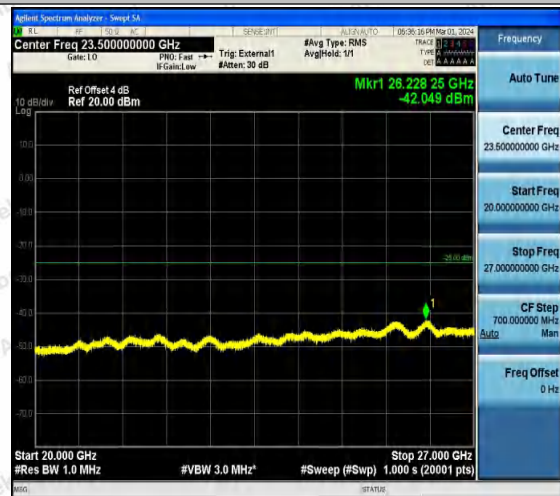


Band41_15MHz_QPSK_41515_1RB#0_20000~27000_20000~27000



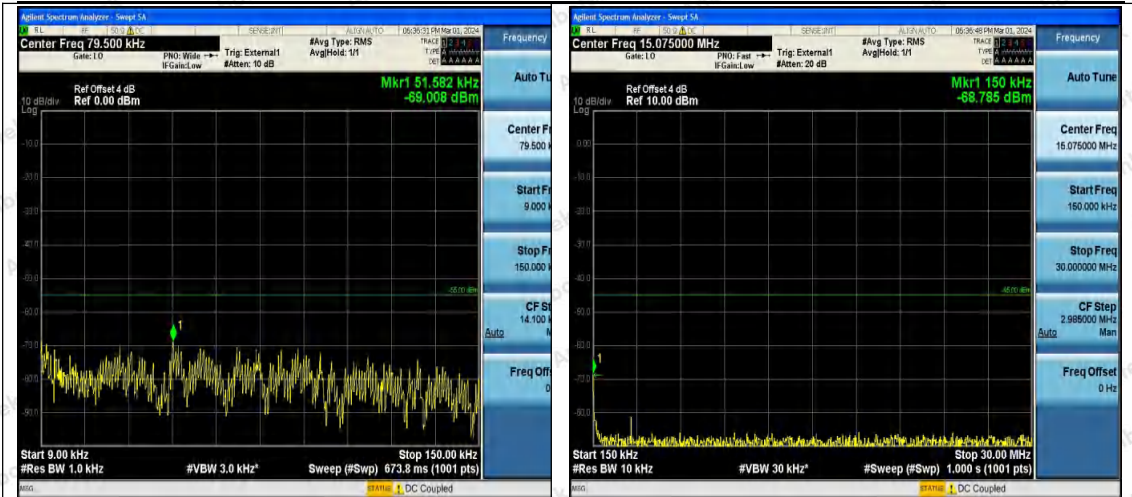


Band41_15MHz_16QAM_41515_1RB#0_0.009
~0.15_0.009~0.15


Band41_15MHz_16QAM_41515_1RB#0_0.15~30_
0.15~30

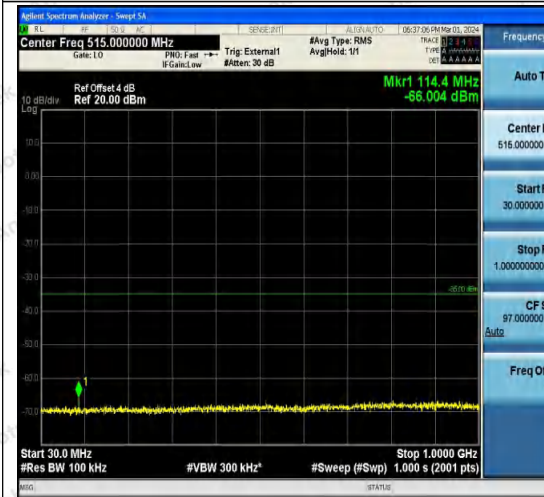

Band41_15MHz_16QAM_41515_1RB#0_30~10
00_30~1000

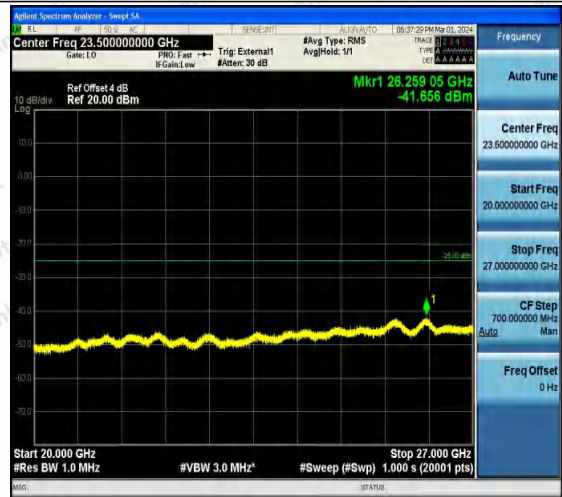

Band41_15MHz_16QAM_41515_1RB#0_20000~27
000_20000~27000

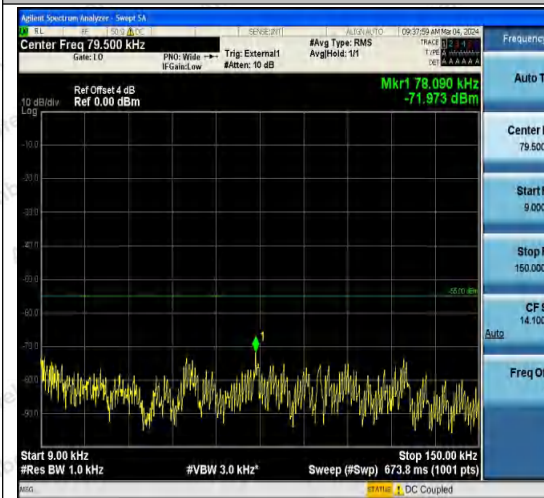

Band41_20MHz_QPSK_39750_1RB#0_0.009~
0.15_0.009~0.15



Band41_20MHz_QPSK_39750_1RB#0_0.15~30_0.
15~30

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com.cn






Band41_20MHz_QPSK_39750_1RB#0_30~100
0_30~1000

Band41_20MHz_QPSK_39750_1RB#0_2000~270
00_20000~27000

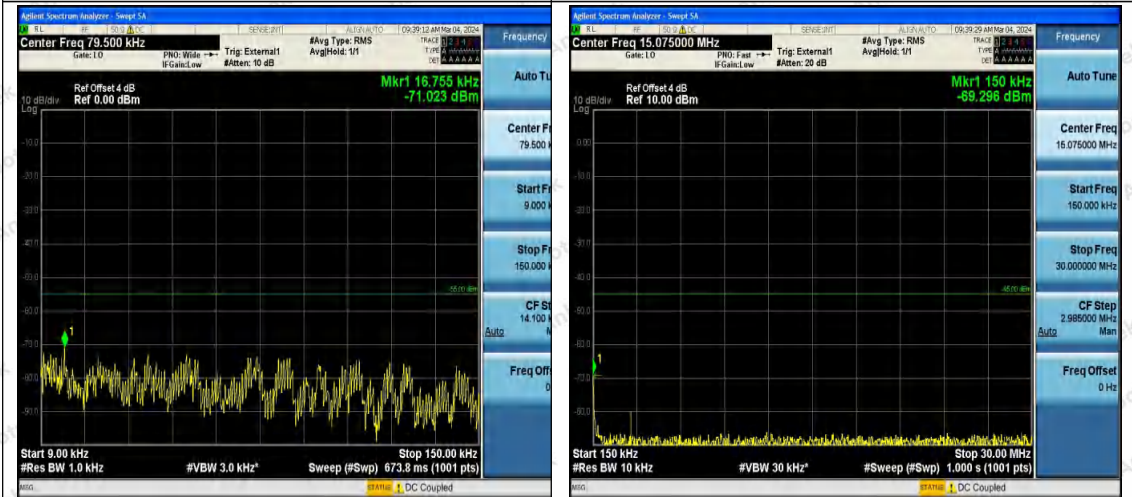

Band41_20MHz_16QAM_39750_1RB#0_0.009
~0.15_0.009~0.15

Band41_20MHz_16QAM_39750_1RB#0_0.15~30
0.15~30

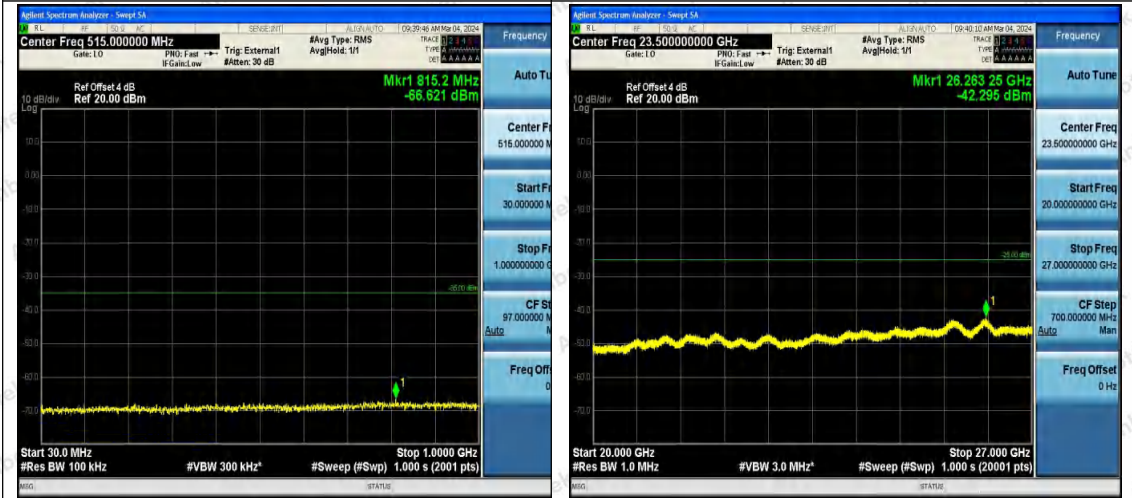

Band41_20MHz_16QAM_39750_1RB#0_30~10
00_30~1000


Band41_20MHz_16QAM_39750_1RB#0_2000~27
000_20000~27000

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com.cn



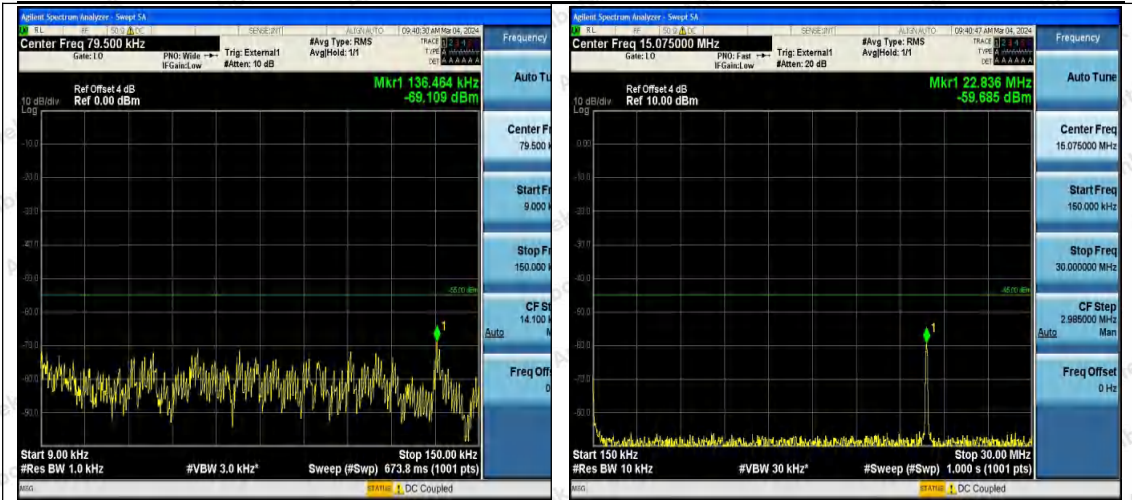

Band41_20MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

Band41_20MHz_QPSK_40620_1RB#0_0.15~30_0.15~30



Band41_20MHz_QPSK_40620_1RB#0_30~100_0_30~1000

Band41_20MHz_QPSK_40620_1RB#0_20000~27000_00_20000~27000



Band41_20MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15


Band41_20MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com


Hotline 400-003-0500
www.anbotek.com.cn



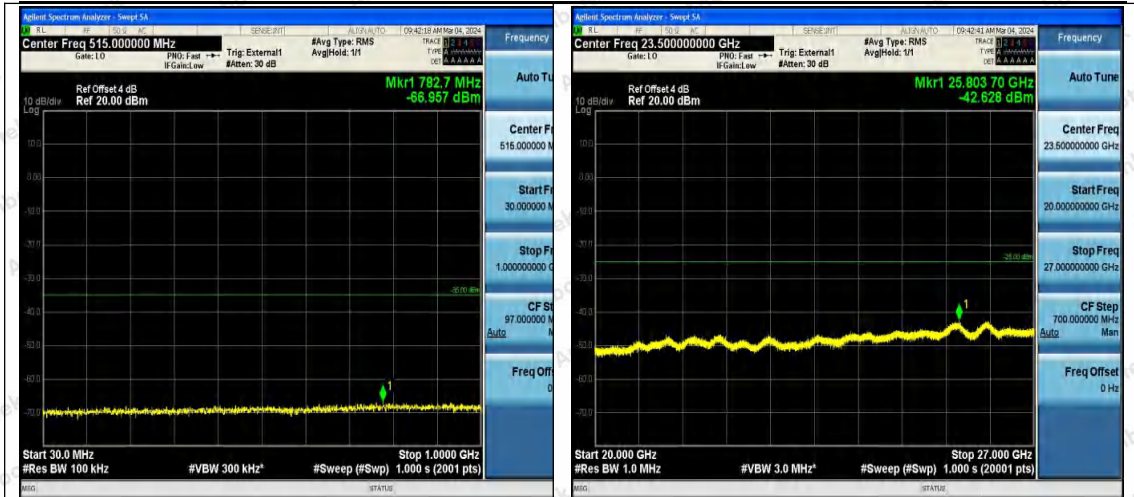


Band41_20MHz_16QAM_40620_1RB#0_30~10000_30~1000


Band41_20MHz_16QAM_40620_1RB#0_20000~27000_000_20000~27000

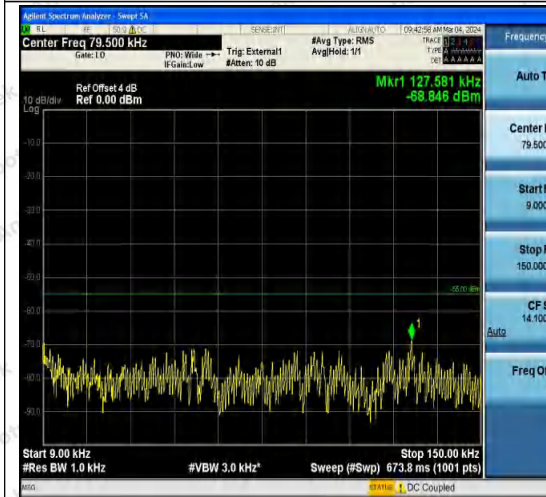

Band41_20MHz_QPSK_41490_1RB#0_0.009~0.15_0.009~0.15

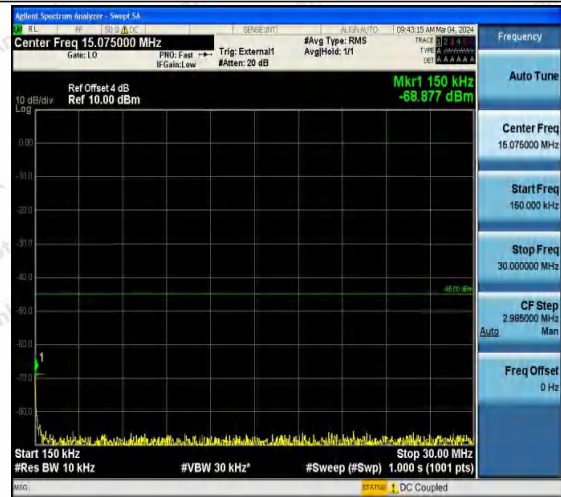

Band41_20MHz_QPSK_41490_1RB#0_0.15~30_0.15~30

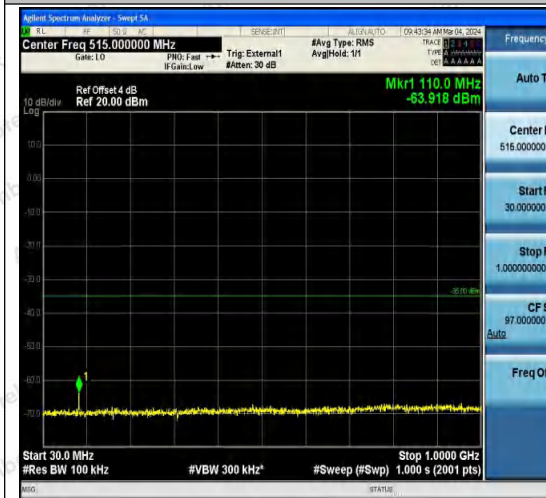


Band41_20MHz_QPSK_41490_1RB#0_30~10000_0_30~1000



Band41_20MHz_QPSK_41490_1RB#0_20000~27000_000_20000~27000



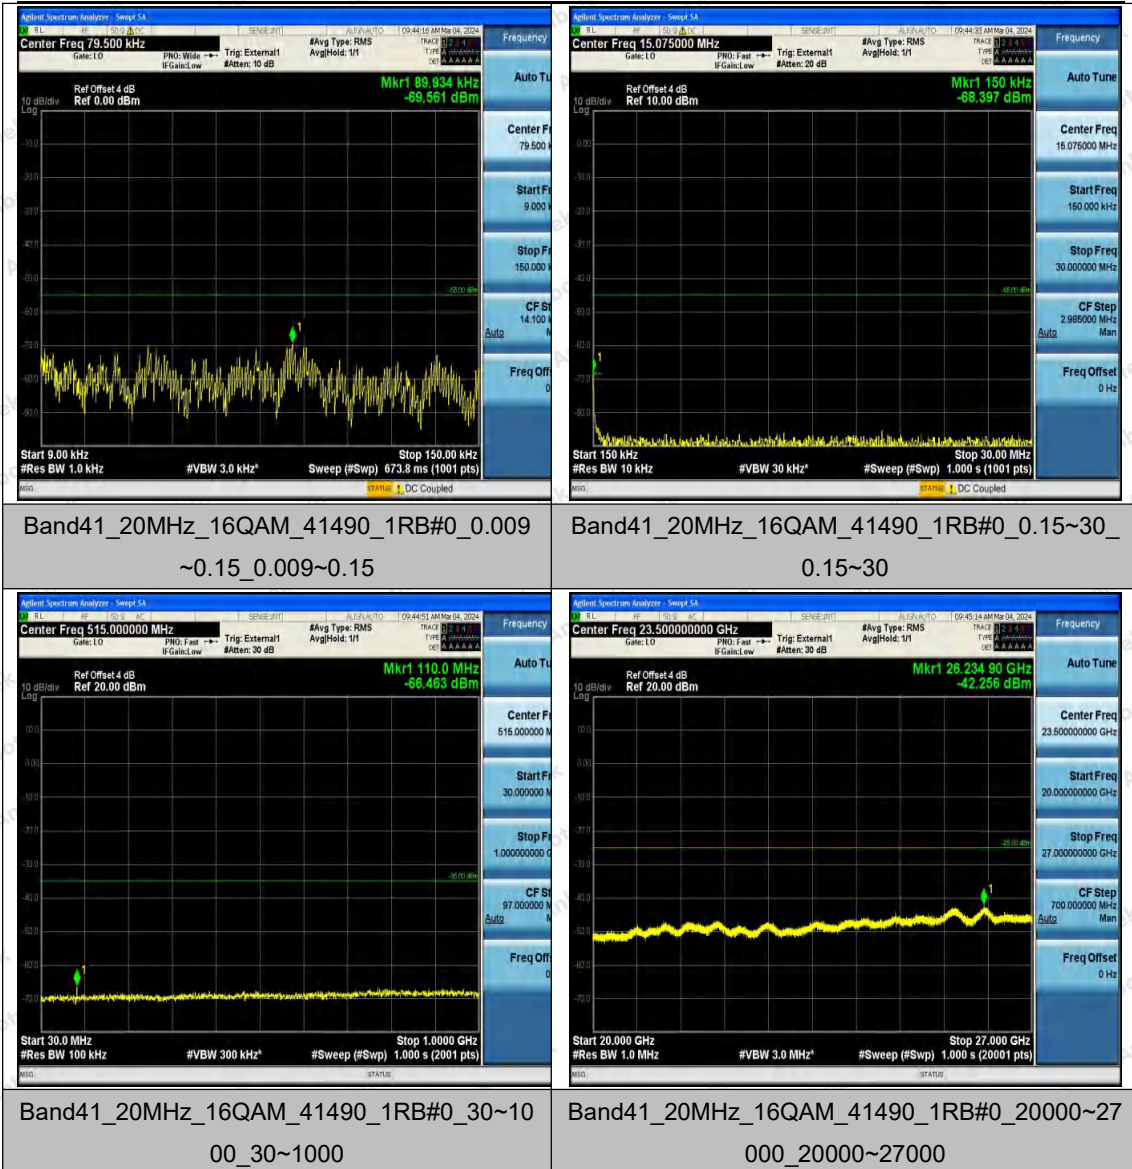

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band41	5MHz	QPSK	39675	25RB#0	VN	NT	9.50	0.003802	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	VL	NT	6.17	0.002469	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	VH	NT	8.17	0.003270	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	VN	NT	13.05	0.005223	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	VL	NT	7.93	0.003174	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	VH	NT	8.17	0.003270	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VN	NT	8.01	0.003089	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VL	NT	9.03	0.003482	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VH	NT	14.72	0.005677	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	VN	NT	5.01	0.001932	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	VL	NT	8.45	0.003259	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	VH	NT	10.91	0.004207	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	VN	NT	12.50	0.004651	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	VL	NT	5.65	0.002102	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	VH	NT	9.94	0.003699	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	VN	NT	8.01	0.002980	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	VL	NT	-7.22	-0.002687	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	VH	NT	10.10	0.003758	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	VN	NT	-7.40	-0.002959	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	VL	NT	10.20	0.004078	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	VH	NT	8.48	0.003391	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	VN	NT	-4.39	-0.001755	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	VL	NT	-6.25	-0.002499	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	VH	NT	6.21	0.002483	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VN	NT	7.40	0.002854	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VL	NT	-6.78	-0.002615	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VH	NT	8.37	0.003228	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	VN	NT	9.64	0.003718	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	VL	NT	9.54	0.003679	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	VH	NT	11.36	0.004381	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	VN	NT	-8.98	-0.003345	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	VL	NT	-11.84	-0.004410	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	VH	NT	-11.37	-0.004235	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	VN	NT	-10.54	-0.003926	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	VL	NT	-10.66	-0.003970	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	10MHz	16QAM	41540	50RB#0	VH	NT	9.14	0.003404	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	VN	NT	-13.43	-0.005364	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	VL	NT	-13.15	-0.005253	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	VH	NT	-4.98	-0.001989	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	VN	NT	-9.31	-0.003719	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	VL	NT	-9.37	-0.003743	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	VH	NT	-8.85	-0.003535	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VN	NT	8.71	0.003359	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VL	NT	7.04	0.002715	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VH	NT	-6.42	-0.002476	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	VN	NT	5.82	0.002245	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	VL	NT	-5.25	-0.002025	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	VH	NT	5.76	0.002221	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	VN	NT	9.88	0.003683	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	VL	NT	7.61	0.002837	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	VH	NT	-4.21	-0.001569	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	VN	NT	12.35	0.004604	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	VL	NT	15.01	0.005596	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	VH	NT	8.48	0.003161	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	VN	NT	-6.98	-0.002785	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	VL	NT	-9.94	-0.003966	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	VH	NT	10.10	0.004030	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	VN	NT	3.50	0.001397	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	VL	NT	6.71	0.002678	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	VH	NT	8.10	0.003232	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VN	NT	-5.55	-0.002140	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VL	NT	5.22	0.002013	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VH	NT	5.21	0.002009	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	VN	NT	9.54	0.003679	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	VL	NT	12.57	0.004848	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	VH	NT	8.81	0.003398	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	VN	NT	10.61	0.003959	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	VL	NT	7.04	0.002627	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	VH	NT	9.37	0.003496	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	VN	NT	8.30	0.003097	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	VL	NT	11.14	0.004157	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	VH	NT	-5.29	-0.001974	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



Band41	5MHz	QPSK	39675	25RB#0	NV	-30	6.51	0.002606	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	-20	8.05	0.003222	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	-10	8.15	0.003262	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	0	8.17	0.003270	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	10	10.51	0.004207	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	20	12.43	0.004975	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	30	12.42	0.004971	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	40	9.20	0.003682	±2.5	PASS
Band41	5MHz	QPSK	39675	25RB#0	NV	50	8.41	0.003366	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	-30	7.68	0.003074	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	-20	7.94	0.003178	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	-10	9.47	0.003790	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	0	7.14	0.002858	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	10	8.55	0.003422	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	20	5.72	0.002289	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	30	9.97	0.003990	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	40	6.84	0.002738	±2.5	PASS
Band41	5MHz	16QAM	39675	25RB#0	NV	50	8.35	0.003342	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	-30	7.24	0.002792	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	-20	7.64	0.002946	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	-10	8.48	0.003270	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	0	8.96	0.003455	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	10	12.33	0.004755	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	20	10.30	0.003972	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	30	8.43	0.003251	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	40	10.69	0.004123	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	50	11.76	0.004535	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	-30	9.10	0.003509	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	-20	6.82	0.002630	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	-10	9.74	0.003756	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	0	8.25	0.003182	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	10	-8.94	-0.003448	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	20	11.20	0.004319	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	30	7.37	0.002842	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	40	8.93	0.003444	±2.5	PASS
Band41	5MHz	16QAM	40620	25RB#0	NV	50	11.69	0.004508	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	-30	6.49	0.002415	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	-20	10.11	0.003762	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	-10	10.00	0.003721	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	0	5.65	0.002102	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	10	7.20	0.002679	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	5MHz	QPSK	41565	25RB#0	NV	20	7.61	0.002832	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	30	6.19	0.002303	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	40	14.45	0.005377	±2.5	PASS
Band41	5MHz	QPSK	41565	25RB#0	NV	50	5.84	0.002173	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	-30	7.00	0.002605	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	-20	10.89	0.004052	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	-10	9.91	0.003687	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	0	7.70	0.002865	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	10	-5.44	-0.002024	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	20	9.11	0.003390	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	30	-6.25	-0.002326	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	40	8.90	0.003312	±2.5	PASS
Band41	5MHz	16QAM	41565	25RB#0	NV	50	6.07	0.002259	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	-30	-6.94	-0.002775	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	-20	5.59	0.002235	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	-10	10.46	0.004182	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	0	-6.75	-0.002699	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	10	6.35	0.002539	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	20	6.74	0.002695	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	30	-7.62	-0.003047	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	40	8.64	0.003455	±2.5	PASS
Band41	10MHz	QPSK	39700	50RB#0	NV	50	6.34	0.002535	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	-30	7.67	0.003067	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	-20	6.27	0.002507	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	-10	7.80	0.003119	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	0	7.52	0.003007	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	10	10.73	0.004290	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	20	7.07	0.002827	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	30	6.79	0.002715	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	40	-8.90	-0.003559	±2.5	PASS
Band41	10MHz	16QAM	39700	50RB#0	NV	50	5.97	0.002387	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	-30	5.97	0.002302	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	-20	6.74	0.002599	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	-10	3.29	0.001269	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	0	-4.81	-0.001855	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	10	6.19	0.002387	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	20	-6.97	-0.002688	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	30	7.25	0.002796	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	40	10.60	0.004088	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	50	6.14	0.002368	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	-30	-4.79	-0.001847	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
 www.anbotek.com.cn



Band41	10MHz	16QAM	40620	50RB#0	NV	-20	5.18	0.001998	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	-10	6.54	0.002522	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	0	7.15	0.002757	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	10	6.02	0.002322	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	20	9.11	0.003513	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	30	8.25	0.003182	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	40	7.08	0.002730	±2.5	PASS
Band41	10MHz	16QAM	40620	50RB#0	NV	50	-5.49	-0.002117	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	-30	-10.69	-0.003981	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	-20	-11.39	-0.004242	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	-10	-10.30	-0.003836	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	0	-16.68	-0.006212	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	10	-9.91	-0.003691	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	20	-8.57	-0.003192	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	30	-11.72	-0.004365	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	40	-12.03	-0.004480	±2.5	PASS
Band41	10MHz	QPSK	41540	50RB#0	NV	50	-10.90	-0.004060	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	-30	-6.12	-0.002279	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	-20	-5.42	-0.002019	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	-10	-11.47	-0.004272	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	0	-11.69	-0.004354	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	10	-10.71	-0.003989	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	20	-10.71	-0.003989	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	30	-10.70	-0.003985	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	40	-10.79	-0.004019	±2.5	PASS
Band41	10MHz	16QAM	41540	50RB#0	NV	50	-10.04	-0.003739	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	-30	-6.58	-0.002628	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	-20	-10.59	-0.004230	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	-10	-15.05	-0.006012	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	0	-8.35	-0.003335	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	10	-13.99	-0.005588	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	20	-10.90	-0.004354	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	30	-11.87	-0.004741	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	40	-14.79	-0.005908	±2.5	PASS
Band41	15MHz	QPSK	39725	75RB#0	NV	50	-7.38	-0.002948	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	-30	-9.87	-0.003942	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	-20	6.68	0.002668	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	-10	-10.50	-0.004194	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	0	-6.79	-0.002712	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	10	-5.56	-0.002221	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	20	-8.27	-0.003303	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500
www.anbotek.com.cn



Band41	15MHz	16QAM	39725	75RB#0	NV	30	-8.10	-0.003235	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	40	-7.70	-0.003076	±2.5	PASS
Band41	15MHz	16QAM	39725	75RB#0	NV	50	-7.98	-0.003188	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	-30	3.81	0.001469	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	-20	4.62	0.001782	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	-10	8.04	0.003101	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	0	9.28	0.003579	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	10	10.51	0.004053	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	20	7.75	0.002989	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	30	7.34	0.002831	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	40	5.97	0.002302	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	50	8.67	0.003344	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	-30	7.80	0.003008	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	-20	9.41	0.003629	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	-10	5.41	0.002086	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	0	8.94	0.003448	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	10	-6.38	-0.002460	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	20	9.00	0.003471	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	30	6.44	0.002484	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	40	7.60	0.002931	±2.5	PASS
Band41	15MHz	16QAM	40620	75RB#0	NV	50	7.00	0.002700	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	-30	9.00	0.003355	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	-20	5.36	0.001998	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	-10	11.83	0.004410	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	0	11.10	0.004138	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	10	7.48	0.002788	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	20	10.91	0.004067	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	30	13.16	0.004906	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	40	10.99	0.004097	±2.5	PASS
Band41	15MHz	QPSK	41515	75RB#0	NV	50	10.00	0.003728	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	-30	8.87	0.003307	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	-20	8.70	0.003243	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	-10	9.70	0.003616	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	0	12.50	0.004660	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	10	8.54	0.003184	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	20	-8.70	-0.003243	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	30	12.62	0.004705	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	40	7.74	0.002885	±2.5	PASS
Band41	15MHz	16QAM	41515	75RB#0	NV	50	13.73	0.005118	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	-30	6.92	0.002761	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	-20	10.23	0.004082	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	20MHz	QPSK	39750	100RB#0	NV	-10	7.18	0.002865	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	0	5.64	0.002251	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	10	7.61	0.003037	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	20	9.43	0.003763	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	30	-10.19	-0.004066	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	40	7.61	0.003037	±2.5	PASS
Band41	20MHz	QPSK	39750	100RB#0	NV	50	-2.68	-0.001069	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	-30	-10.89	-0.004346	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	-20	7.82	0.003121	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	-10	-7.38	-0.002945	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	0	-6.81	-0.002717	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	10	7.31	0.002917	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	20	7.27	0.002901	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	30	7.88	0.003144	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	40	-9.78	-0.003903	±2.5	PASS
Band41	20MHz	16QAM	39750	100RB#0	NV	50	7.57	0.003021	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	-30	-6.45	-0.002487	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	-20	5.04	0.001944	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	-10	-8.60	-0.003317	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	0	10.56	0.004073	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	10	5.71	0.002202	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	20	4.59	0.001770	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	30	-5.18	-0.001998	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	40	9.17	0.003536	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	50	10.23	0.003945	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	-30	7.67	0.002958	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	-20	10.33	0.003984	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	-10	12.32	0.004751	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	0	-4.11	-0.001585	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	10	6.84	0.002638	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	20	10.56	0.004073	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	30	8.83	0.003405	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	40	13.79	0.005318	±2.5	PASS
Band41	20MHz	16QAM	40620	100RB#0	NV	50	5.98	0.002306	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	-30	10.31	0.003847	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	-20	7.74	0.002888	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	-10	8.53	0.003183	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	0	11.73	0.004377	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	10	5.76	0.002149	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	20	5.64	0.002104	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	30	8.28	0.003090	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band41	20MHz	QPSK	41490	100RB#0	NV	40	7.17	0.002675	±2.5	PASS
Band41	20MHz	QPSK	41490	100RB#0	NV	50	7.77	0.002899	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	-30	7.41	0.002765	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	-20	9.57	0.003571	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	-10	10.26	0.003828	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	0	-6.45	-0.002407	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	10	9.00	0.003358	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	20	10.57	0.003944	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	30	9.57	0.003571	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	40	8.13	0.003034	±2.5	PASS
Band41	20MHz	16QAM	41490	100RB#0	NV	50	9.90	0.003694	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com.cn

