



**Test Graphs**

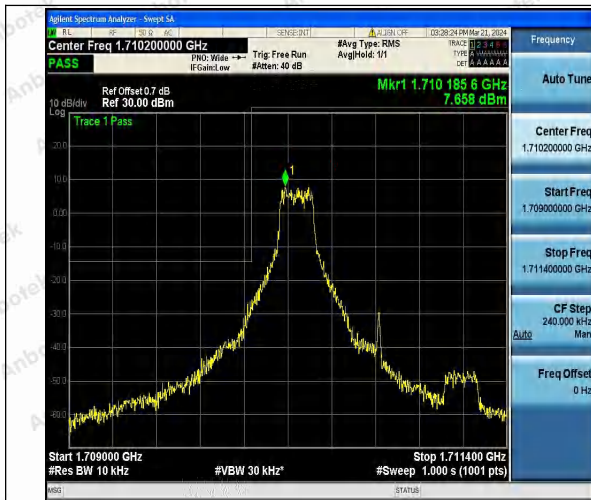

Band66\_1.4MHz\_QPSK\_131979\_1RB#0

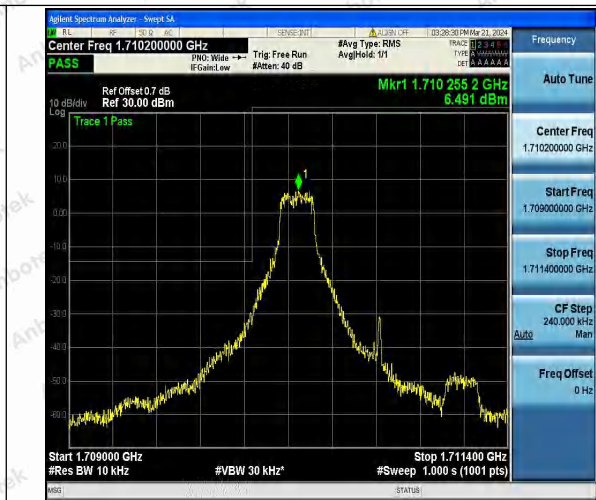


Band66\_1.4MHz\_16QAM\_131979\_1RB#0



Band66\_1.4MHz\_QPSK\_131979\_1RB#5



Band66\_1.4MHz\_16QAM\_131979\_1RB#5

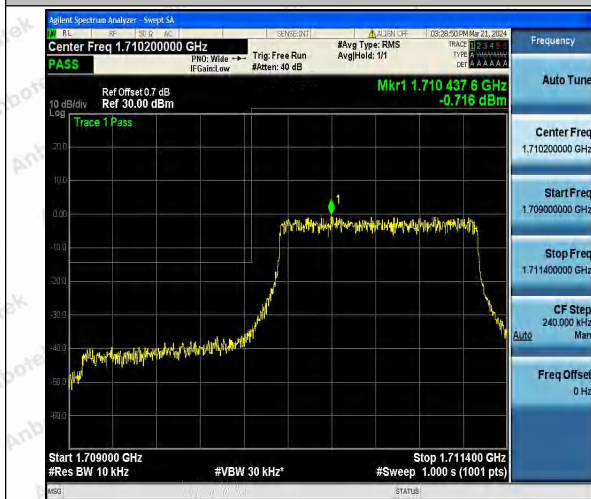

Band66\_1.4MHz\_QPSK\_131979\_6RB#0



Band66\_1.4MHz\_16QAM\_131979\_6RB#0






Band66\_1.4MHz\_QPSK\_132665\_1RB#0




Band66\_1.4MHz\_16QAM\_132665\_1RB#0




Band66\_1.4MHz\_QPSK\_132665\_1RB#5

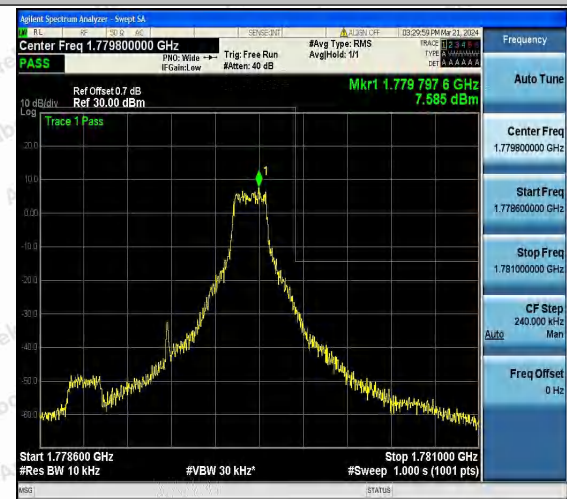

Band66\_1.4MHz\_16QAM\_132665\_1RB#5

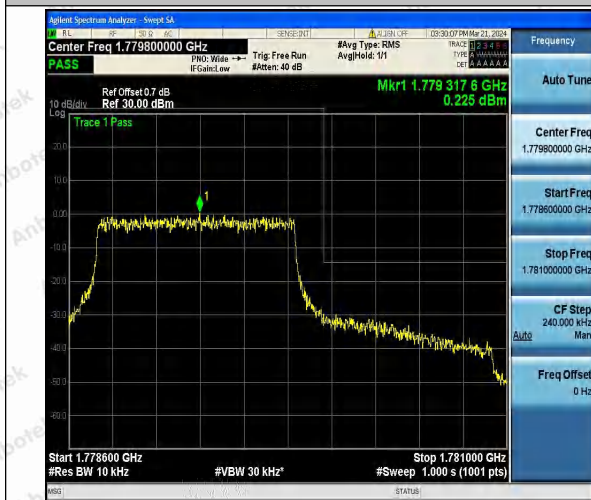

Band66\_1.4MHz\_QPSK\_132665\_6RB#0

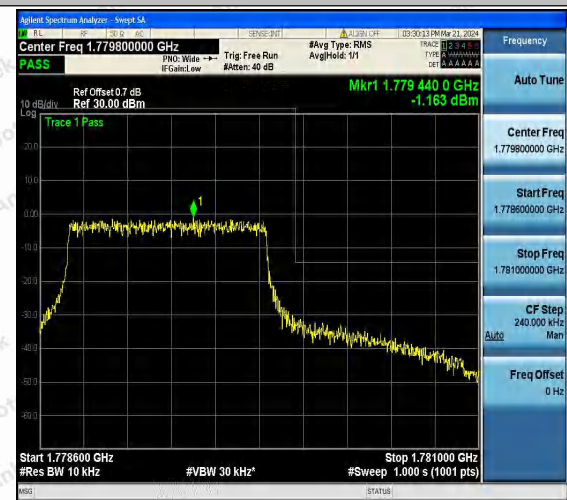

Band66\_1.4MHz\_16QAM\_132665\_6RB#0





Band66\_3MHz\_QPSK\_131987\_1RB#0



Band66\_3MHz\_16QAM\_131987\_1RB#0



Band66\_3MHz\_QPSK\_131987\_1RB#14



Band66\_3MHz\_16QAM\_131987\_1RB#14



Band66\_3MHz\_QPSK\_131987\_15RB#0



Band66\_3MHz\_16QAM\_131987\_15RB#0






Band66\_3MHz\_QPSK\_132657\_1RB#0



Band66\_3MHz\_16QAM\_132657\_1RB#0

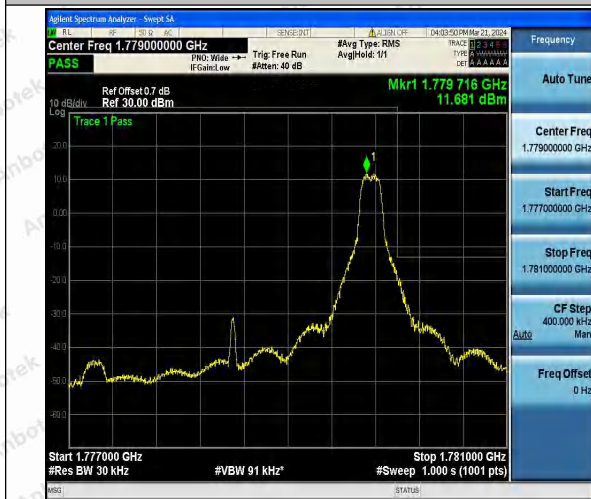

Band66\_3MHz\_QPSK\_132657\_1RB#14



Band66\_3MHz\_16QAM\_132657\_1RB#14



Band66\_3MHz\_QPSK\_132657\_15RB#0



Band66\_3MHz\_16QAM\_132657\_15RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn





Band66\_5MHz\_QPSK\_131997\_1RB#0



Band66\_5MHz\_16QAM\_131997\_1RB#0



Band66\_5MHz\_QPSK\_131997\_1RB#24



Band66\_5MHz\_16QAM\_131997\_1RB#24



Band66\_5MHz\_QPSK\_131997\_25RB#0



Band66\_5MHz\_16QAM\_131997\_25RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn





Band66\_5MHz\_QPSK\_132647\_1RB#0




Band66\_5MHz\_16QAM\_132647\_1RB#0



Band66\_5MHz\_QPSK\_132647\_1RB#24



Band66\_5MHz\_16QAM\_132647\_1RB#24

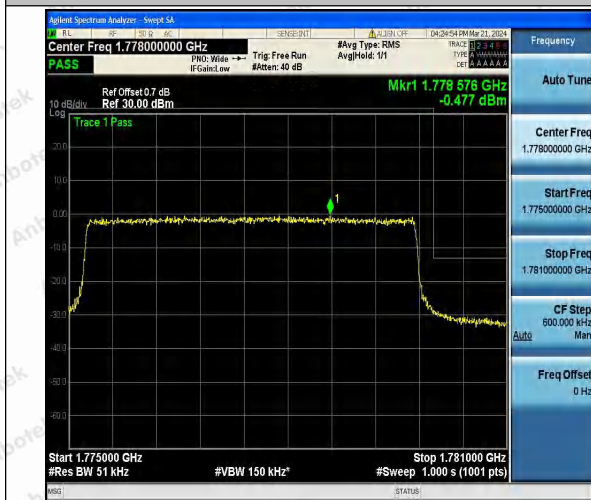

Band66\_5MHz\_QPSK\_132647\_25RB#0



Band66\_5MHz\_16QAM\_132647\_25RB#0

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com.cn





Band66\_10MHz\_QPSK\_132022\_1RB#0

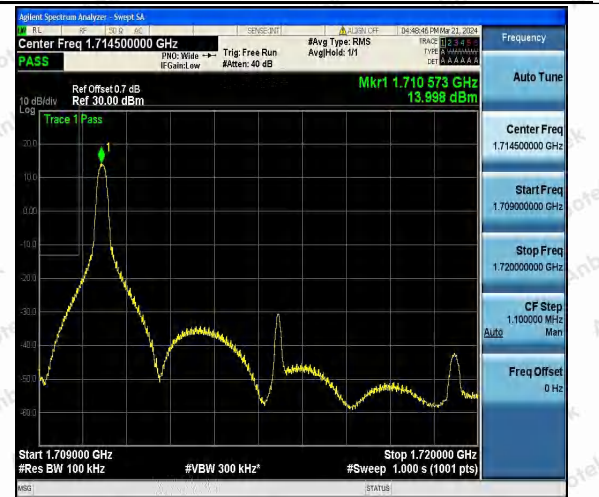

Band66\_10MHz\_16QAM\_132022\_1RB#0



Band66\_10MHz\_QPSK\_132022\_1RB#49



Band66\_10MHz\_16QAM\_132022\_1RB#49



Band66\_10MHz\_QPSK\_132622\_1RB#0



Band66\_10MHz\_16QAM\_132622\_1RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn





Band66\_10MHz\_QPSK\_132622\_1RB#49



Band66\_10MHz\_16QAM\_132622\_1RB#49



Band66\_10MHz\_QPSK\_132022\_50RB#0



Band66\_10MHz\_QPSK\_132622\_50RB#0



Band66\_15MHz\_QPSK\_132047\_1RB#0



Band66\_15MHz\_16QAM\_132047\_1RB#0




## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com.cn





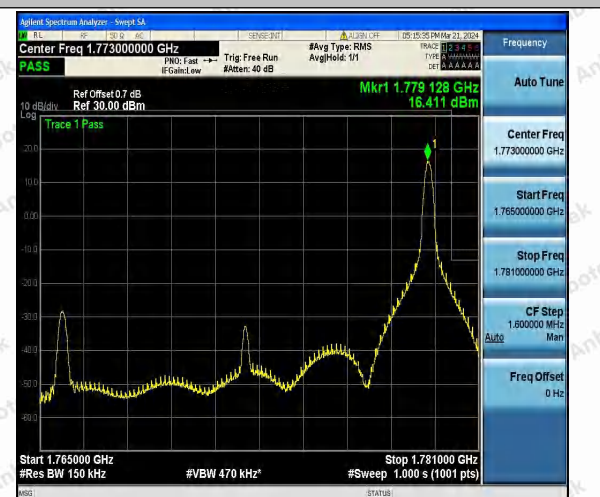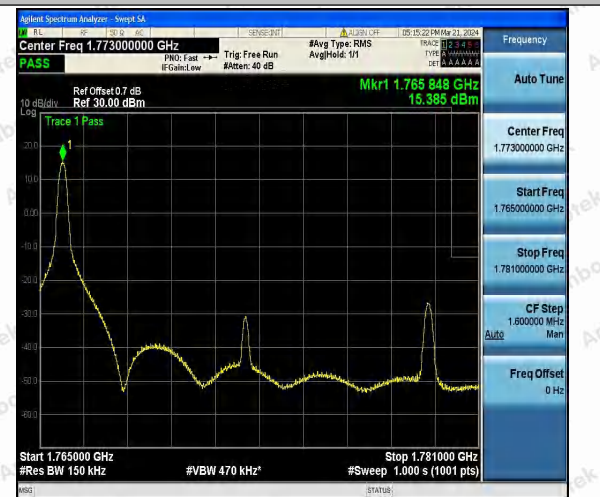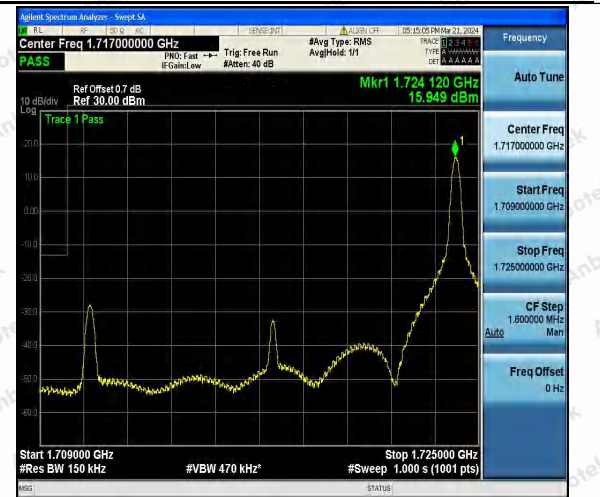

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com.cn







Band66\_15MHz\_QPSK\_132047\_75RB#0



Band66\_15MHz\_QPSK\_132597\_75RB#0

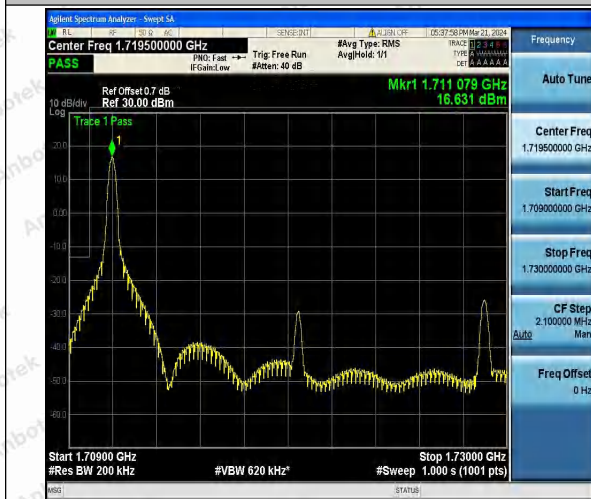


Band66\_20MHz\_QPSK\_132072\_1RB#0

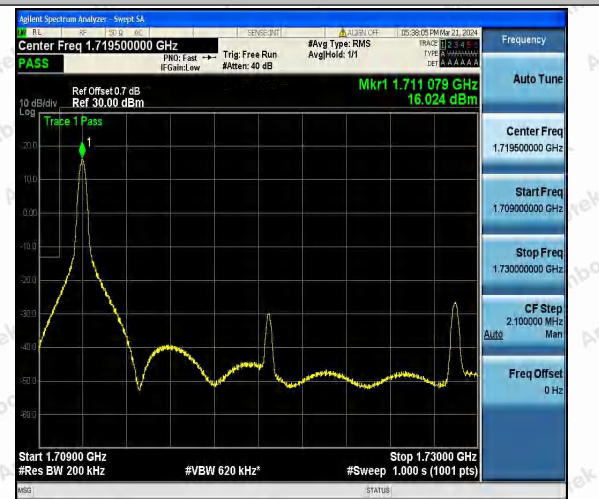

Band66\_20MHz\_16QAM\_132072\_1RB#0



Band66\_20MHz\_QPSK\_132072\_1RB#99

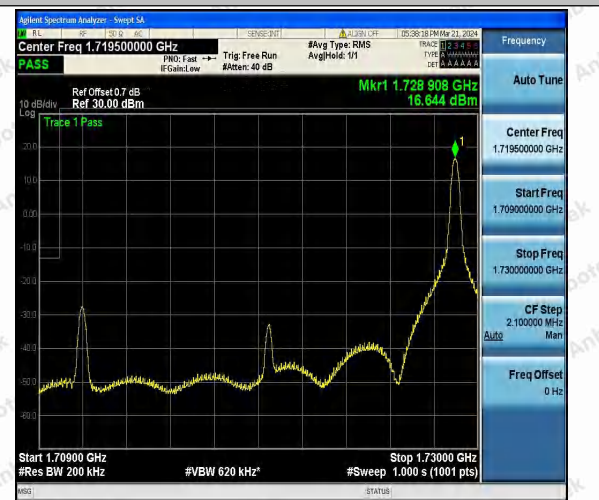

Band66\_20MHz\_16QAM\_132072\_1RB#99

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com.cn






Band66\_20MHz\_QPSK\_132572\_1RB#0



Band66\_20MHz\_16QAM\_132572\_1RB#0



Band66\_20MHz\_QPSK\_132572\_1RB#99

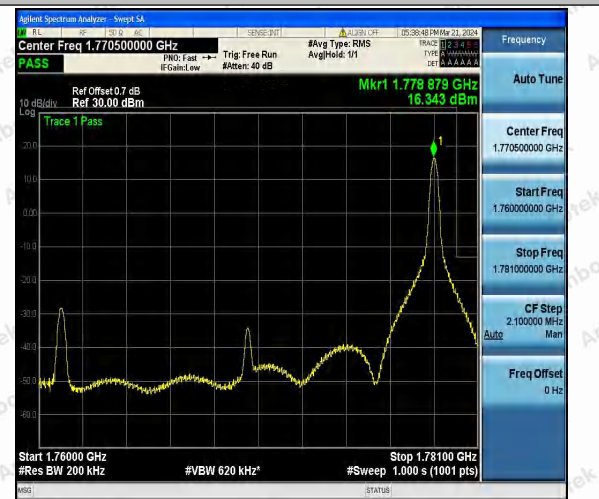

Band66\_20MHz\_16QAM\_132572\_1RB#99



Band66\_20MHz\_QPSK\_132072\_100RB#0



Band66\_20MHz\_QPSK\_132572\_100RB#0

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn



## Appendix E: Conducted Spurious Emission

### Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	0.009~0.15	-65.99	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	0.15~30	-65.40	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	30~1000	-70.44	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	1000~3000	-46.38	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	3000~20000	-51.00	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	0.009~0.15	-65.48	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	0.15~30	-64.90	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	30~1000	-70.30	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	1000~3000	-47.85	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	3000~20000	-49.60	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	0.009~0.15	-67.37	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	0.15~30	-65.65	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	30~1000	-70.33	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	1000~3000	-45.10	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	3000~20000	-51.90	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	0.009~0.15	-68.24	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	0.15~30	-66.72	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	30~1000	-70.15	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	1000~3000	-45.12	PASS
Band66	1.4MHz	16QAM	132322	1RB#0	3000~20000	-52.42	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	0.009~0.15	-65.57	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	0.15~30	-63.38	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	30~1000	-70.49	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	1000~3000	-46.33	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	3000~20000	-51.56	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	0.009~0.15	-67.03	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	0.15~30	-66.35	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	30~1000	-70.55	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	1000~3000	-46.18	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	3000~20000	-52.05	PASS
Band66	3MHz	QPSK	131987	1RB#0	0.009~0.15	-66.18	PASS
Band66	3MHz	QPSK	131987	1RB#0	0.15~30	-65.80	PASS
Band66	3MHz	QPSK	131987	1RB#0	30~1000	-70.45	PASS
Band66	3MHz	QPSK	131987	1RB#0	1000~3000	-47.94	PASS
Band66	3MHz	QPSK	131987	1RB#0	3000~20000	-51.28	PASS
Band66	3MHz	16QAM	131987	1RB#0	0.009~0.15	-66.32	PASS
Band66	3MHz	16QAM	131987	1RB#0	0.15~30	-64.72	PASS

### Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



Band66	3MHz	16QAM	131987	1RB#0	30~1000	-70.55	PASS
Band66	3MHz	16QAM	131987	1RB#0	1000~3000	-53.01	PASS
Band66	3MHz	16QAM	131987	1RB#0	3000~20000	-52.47	PASS
Band66	3MHz	QPSK	132322	1RB#0	0.009~0.15	-69.07	PASS
Band66	3MHz	QPSK	132322	1RB#0	0.15~30	-63.31	PASS
Band66	3MHz	QPSK	132322	1RB#0	30~1000	-70.58	PASS
Band66	3MHz	QPSK	132322	1RB#0	1000~3000	-51.53	PASS
Band66	3MHz	QPSK	132322	1RB#0	3000~20000	-52.26	PASS
Band66	3MHz	16QAM	132322	1RB#0	0.009~0.15	-70.94	PASS
Band66	3MHz	16QAM	132322	1RB#0	0.15~30	-64.72	PASS
Band66	3MHz	16QAM	132322	1RB#0	30~1000	-70.30	PASS
Band66	3MHz	16QAM	132322	1RB#0	1000~3000	-54.01	PASS
Band66	3MHz	16QAM	132322	1RB#0	3000~20000	-52.28	PASS
Band66	3MHz	QPSK	132657	1RB#0	0.009~0.15	-68.69	PASS
Band66	3MHz	QPSK	132657	1RB#0	0.15~30	-66.43	PASS
Band66	3MHz	QPSK	132657	1RB#0	30~1000	-70.45	PASS
Band66	3MHz	QPSK	132657	1RB#0	1000~3000	-46.39	PASS
Band66	3MHz	QPSK	132657	1RB#0	3000~20000	-50.43	PASS
Band66	3MHz	16QAM	132657	1RB#0	0.009~0.15	-66.42	PASS
Band66	3MHz	16QAM	132657	1RB#0	0.15~30	-64.88	PASS
Band66	3MHz	16QAM	132657	1RB#0	30~1000	-70.39	PASS
Band66	3MHz	16QAM	132657	1RB#0	1000~3000	-52.44	PASS
Band66	3MHz	16QAM	132657	1RB#0	3000~20000	-52.32	PASS
Band66	5MHz	QPSK	131997	1RB#0	0.009~0.15	-68.94	PASS
Band66	5MHz	QPSK	131997	1RB#0	0.15~30	-64.85	PASS
Band66	5MHz	QPSK	131997	1RB#0	30~1000	-70.22	PASS
Band66	5MHz	QPSK	131997	1RB#0	1000~3000	-56.33	PASS
Band66	5MHz	QPSK	131997	1RB#0	3000~20000	-51.59	PASS
Band66	5MHz	16QAM	131997	1RB#0	0.009~0.15	-66.79	PASS
Band66	5MHz	16QAM	131997	1RB#0	0.15~30	-64.66	PASS
Band66	5MHz	16QAM	131997	1RB#0	30~1000	-70.49	PASS
Band66	5MHz	16QAM	131997	1RB#0	1000~3000	-56.91	PASS
Band66	5MHz	16QAM	131997	1RB#0	3000~20000	-51.98	PASS
Band66	5MHz	QPSK	132322	1RB#0	0.009~0.15	-67.37	PASS
Band66	5MHz	QPSK	132322	1RB#0	0.15~30	-65.89	PASS
Band66	5MHz	QPSK	132322	1RB#0	30~1000	-70.27	PASS
Band66	5MHz	QPSK	132322	1RB#0	1000~3000	-56.53	PASS
Band66	5MHz	QPSK	132322	1RB#0	3000~20000	-52.41	PASS
Band66	5MHz	16QAM	132322	1RB#0	0.009~0.15	-66.64	PASS
Band66	5MHz	16QAM	132322	1RB#0	0.15~30	-65.38	PASS
Band66	5MHz	16QAM	132322	1RB#0	30~1000	-70.45	PASS
Band66	5MHz	16QAM	132322	1RB#0	1000~3000	-56.66	PASS

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



Band66	5MHz	16QAM	132322	1RB#0	3000~20000	-52.25	PASS
Band66	5MHz	QPSK	132647	1RB#0	0.009~0.15	-68.20	PASS
Band66	5MHz	QPSK	132647	1RB#0	0.15~30	-65.66	PASS
Band66	5MHz	QPSK	132647	1RB#0	30~1000	-70.59	PASS
Band66	5MHz	QPSK	132647	1RB#0	1000~3000	-56.37	PASS
Band66	5MHz	QPSK	132647	1RB#0	3000~20000	-51.51	PASS
Band66	5MHz	16QAM	132647	1RB#0	0.009~0.15	-64.60	PASS
Band66	5MHz	16QAM	132647	1RB#0	0.15~30	-65.50	PASS
Band66	5MHz	16QAM	132647	1RB#0	30~1000	-70.57	PASS
Band66	5MHz	16QAM	132647	1RB#0	1000~3000	-56.08	PASS
Band66	5MHz	16QAM	132647	1RB#0	3000~20000	-50.73	PASS
Band66	10MHz	QPSK	132022	1RB#0	0.009~0.15	-69.13	PASS
Band66	10MHz	QPSK	132022	1RB#0	0.15~30	-65.30	PASS
Band66	10MHz	QPSK	132022	1RB#0	30~1000	-70.07	PASS
Band66	10MHz	QPSK	132022	1RB#0	1000~3000	-56.56	PASS
Band66	10MHz	QPSK	132022	1RB#0	3000~20000	-52.42	PASS
Band66	10MHz	16QAM	132022	1RB#0	0.009~0.15	-68.49	PASS
Band66	10MHz	16QAM	132022	1RB#0	0.15~30	-65.62	PASS
Band66	10MHz	16QAM	132022	1RB#0	30~1000	-70.56	PASS
Band66	10MHz	16QAM	132022	1RB#0	1000~3000	-56.61	PASS
Band66	10MHz	16QAM	132022	1RB#0	3000~20000	-51.40	PASS
Band66	10MHz	QPSK	132322	1RB#0	0.009~0.15	-66.84	PASS
Band66	10MHz	QPSK	132322	1RB#0	0.15~30	-65.16	PASS
Band66	10MHz	QPSK	132322	1RB#0	30~1000	-70.73	PASS
Band66	10MHz	QPSK	132322	1RB#0	1000~3000	-56.57	PASS
Band66	10MHz	QPSK	132322	1RB#0	3000~20000	-51.79	PASS
Band66	10MHz	16QAM	132322	1RB#0	0.009~0.15	-65.38	PASS
Band66	10MHz	16QAM	132322	1RB#0	0.15~30	-65.30	PASS
Band66	10MHz	16QAM	132322	1RB#0	30~1000	-70.61	PASS
Band66	10MHz	16QAM	132322	1RB#0	1000~3000	-56.41	PASS
Band66	10MHz	16QAM	132322	1RB#0	3000~20000	-52.50	PASS
Band66	10MHz	QPSK	132622	1RB#0	0.009~0.15	-66.28	PASS
Band66	10MHz	QPSK	132622	1RB#0	0.15~30	-65.45	PASS
Band66	10MHz	QPSK	132622	1RB#0	30~1000	-70.36	PASS
Band66	10MHz	QPSK	132622	1RB#0	1000~3000	-56.26	PASS
Band66	10MHz	QPSK	132622	1RB#0	3000~20000	-51.64	PASS
Band66	10MHz	16QAM	132622	1RB#0	0.009~0.15	-66.09	PASS
Band66	10MHz	16QAM	132622	1RB#0	0.15~30	-64.03	PASS
Band66	10MHz	16QAM	132622	1RB#0	30~1000	-70.54	PASS
Band66	10MHz	16QAM	132622	1RB#0	1000~3000	-56.64	PASS
Band66	10MHz	16QAM	132622	1RB#0	3000~20000	-52.39	PASS
Band66	15MHz	QPSK	132047	1RB#0	0.009~0.15	-63.71	PASS

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline  
400-003-0500  
www.anbotek.com.cn



Band66	15MHz	QPSK	132047	1RB#0	0.15~30	-64.99	PASS
Band66	15MHz	QPSK	132047	1RB#0	30~1000	-70.25	PASS
Band66	15MHz	QPSK	132047	1RB#0	1000~3000	-56.48	PASS
Band66	15MHz	QPSK	132047	1RB#0	3000~20000	-49.93	PASS
Band66	15MHz	16QAM	132047	1RB#0	0.009~0.15	-64.32	PASS
Band66	15MHz	16QAM	132047	1RB#0	0.15~30	-65.51	PASS
Band66	15MHz	16QAM	132047	1RB#0	30~1000	-70.68	PASS
Band66	15MHz	16QAM	132047	1RB#0	1000~3000	-56.41	PASS
Band66	15MHz	16QAM	132047	1RB#0	3000~20000	-50.79	PASS
Band66	15MHz	QPSK	132322	1RB#0	0.009~0.15	-68.60	PASS
Band66	15MHz	QPSK	132322	1RB#0	0.15~30	-65.27	PASS
Band66	15MHz	QPSK	132322	1RB#0	30~1000	-70.68	PASS
Band66	15MHz	QPSK	132322	1RB#0	1000~3000	-56.15	PASS
Band66	15MHz	QPSK	132322	1RB#0	3000~20000	-52.37	PASS
Band66	15MHz	16QAM	132322	1RB#0	0.009~0.15	-66.12	PASS
Band66	15MHz	16QAM	132322	1RB#0	0.15~30	-64.50	PASS
Band66	15MHz	16QAM	132322	1RB#0	30~1000	-70.32	PASS
Band66	15MHz	16QAM	132322	1RB#0	1000~3000	-56.55	PASS
Band66	15MHz	16QAM	132322	1RB#0	3000~20000	-52.34	PASS
Band66	15MHz	QPSK	132597	1RB#0	0.009~0.15	-68.35	PASS
Band66	15MHz	QPSK	132597	1RB#0	0.15~30	-66.43	PASS
Band66	15MHz	QPSK	132597	1RB#0	30~1000	-70.37	PASS
Band66	15MHz	QPSK	132597	1RB#0	1000~3000	-56.60	PASS
Band66	15MHz	QPSK	132597	1RB#0	3000~20000	-52.25	PASS
Band66	15MHz	16QAM	132597	1RB#0	0.009~0.15	-64.89	PASS
Band66	15MHz	16QAM	132597	1RB#0	0.15~30	-64.75	PASS
Band66	15MHz	16QAM	132597	1RB#0	30~1000	-70.27	PASS
Band66	15MHz	16QAM	132597	1RB#0	1000~3000	-56.21	PASS
Band66	15MHz	16QAM	132597	1RB#0	3000~20000	-52.21	PASS
Band66	20MHz	QPSK	132072	1RB#0	0.009~0.15	-66.39	PASS
Band66	20MHz	QPSK	132072	1RB#0	0.15~30	-64.65	PASS
Band66	20MHz	QPSK	132072	1RB#0	30~1000	-70.50	PASS
Band66	20MHz	QPSK	132072	1RB#0	1000~3000	-56.50	PASS
Band66	20MHz	QPSK	132072	1RB#0	3000~20000	-50.81	PASS
Band66	20MHz	16QAM	132072	1RB#0	0.009~0.15	-68.39	PASS
Band66	20MHz	16QAM	132072	1RB#0	0.15~30	-65.99	PASS
Band66	20MHz	16QAM	132072	1RB#0	30~1000	-70.39	PASS
Band66	20MHz	16QAM	132072	1RB#0	1000~3000	-56.65	PASS
Band66	20MHz	16QAM	132072	1RB#0	3000~20000	-52.07	PASS
Band66	20MHz	QPSK	132322	1RB#0	0.009~0.15	-68.20	PASS
Band66	20MHz	QPSK	132322	1RB#0	0.15~30	-66.15	PASS
Band66	20MHz	QPSK	132322	1RB#0	30~1000	-70.44	PASS

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline  
400-003-0500  
www.anbotek.com.cn



Band66	20MHz	QPSK	132322	1RB#0	1000~3000	-56.73	PASS
Band66	20MHz	QPSK	132322	1RB#0	3000~20000	-50.25	PASS
Band66	20MHz	16QAM	132322	1RB#0	0.009~0.15	-66.22	PASS
Band66	20MHz	16QAM	132322	1RB#0	0.15~30	-64.33	PASS
Band66	20MHz	16QAM	132322	1RB#0	30~1000	-70.14	PASS
Band66	20MHz	16QAM	132322	1RB#0	1000~3000	-56.53	PASS
Band66	20MHz	16QAM	132322	1RB#0	3000~20000	-52.36	PASS
Band66	20MHz	QPSK	132572	1RB#0	0.009~0.15	-66.96	PASS
Band66	20MHz	QPSK	132572	1RB#0	0.15~30	-66.74	PASS
Band66	20MHz	QPSK	132572	1RB#0	30~1000	-70.59	PASS
Band66	20MHz	QPSK	132572	1RB#0	1000~3000	-56.55	PASS
Band66	20MHz	QPSK	132572	1RB#0	3000~20000	-52.05	PASS
Band66	20MHz	16QAM	132572	1RB#0	0.009~0.15	-65.03	PASS
Band66	20MHz	16QAM	132572	1RB#0	0.15~30	-66.27	PASS
Band66	20MHz	16QAM	132572	1RB#0	30~1000	-70.40	PASS
Band66	20MHz	16QAM	132572	1RB#0	1000~3000	-56.76	PASS
Band66	20MHz	16QAM	132572	1RB#0	3000~20000	-52.17	PASS

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline  
 400-003-0500  
 www.anbotek.com.cn







## Test Graphs

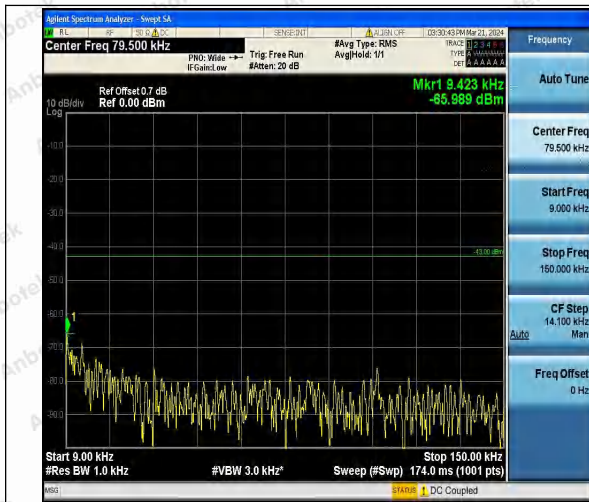


Band66\_1.4MHz\_QPSK\_131979\_1RB#0\_0.009~0.15\_0.009~0.15

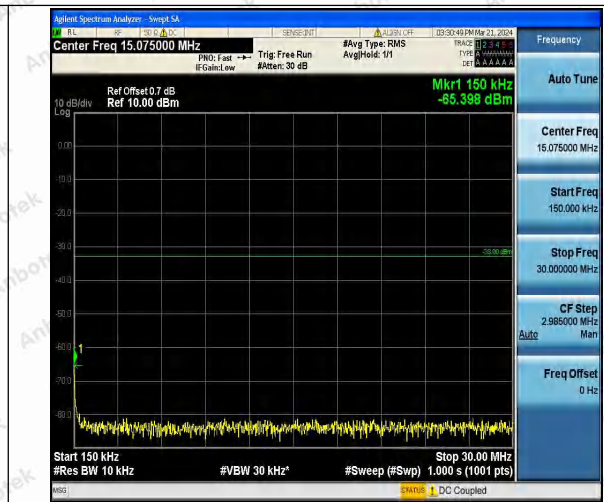


Band66\_1.4MHz\_QPSK\_131979\_1RB#0\_0.15~30\_0.15~30

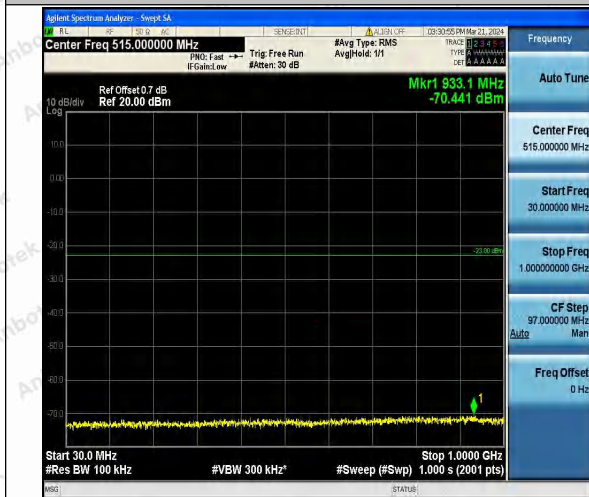


Band66\_1.4MHz\_QPSK\_131979\_1RB#0\_30~1000\_30~1000

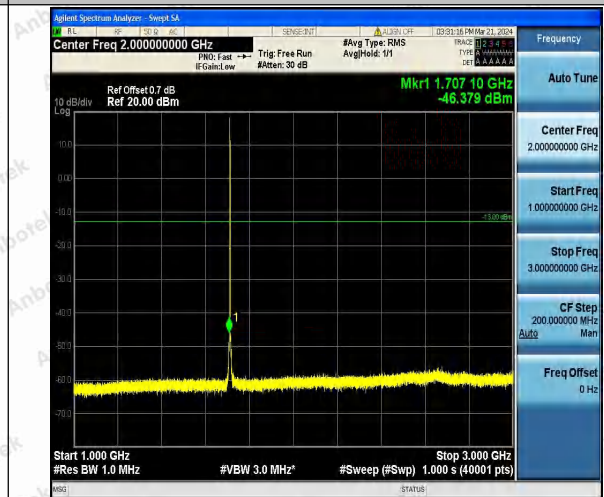

Band66\_1.4MHz\_QPSK\_131979\_1RB#0\_1000~3000\_1000~3000

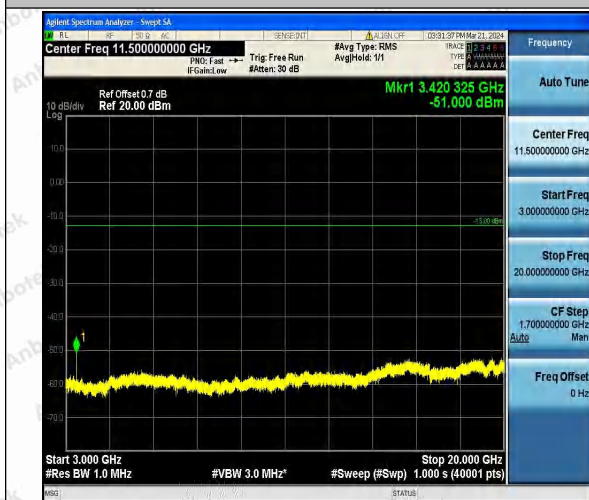

Band66\_1.4MHz\_QPSK\_131979\_1RB#0\_3000~20000\_3000~20000

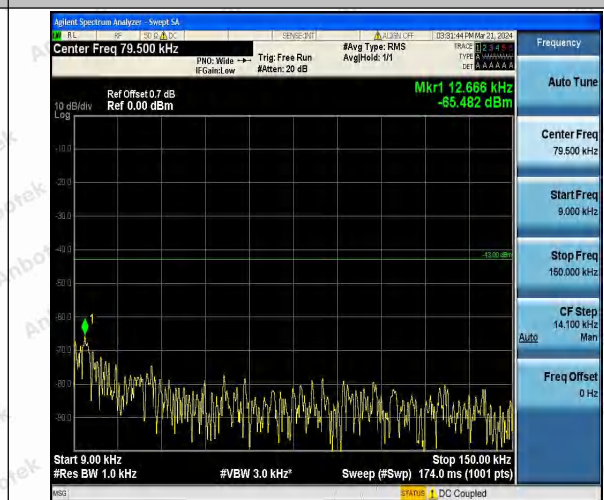

Band66\_1.4MHz\_16QAM\_131979\_1RB#0\_0.009~0.15\_0.009~0.15

### Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com.cn






Band66\_1.4MHz\_16QAM\_131979\_1RB#0\_0.15~30\_0.  
15~30

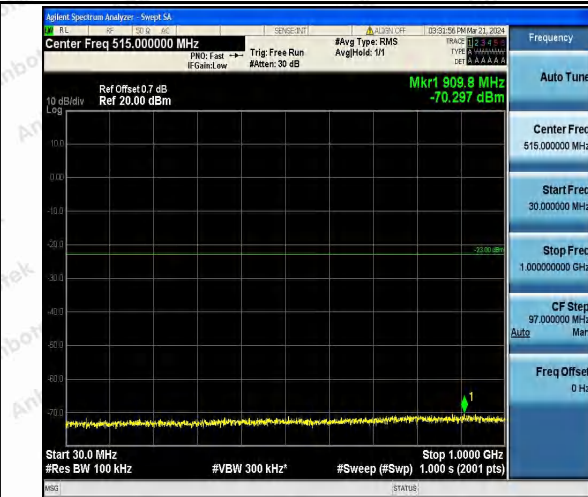

Band66\_1.4MHz\_16QAM\_131979\_1RB#0\_30~1000\_30  
~1000

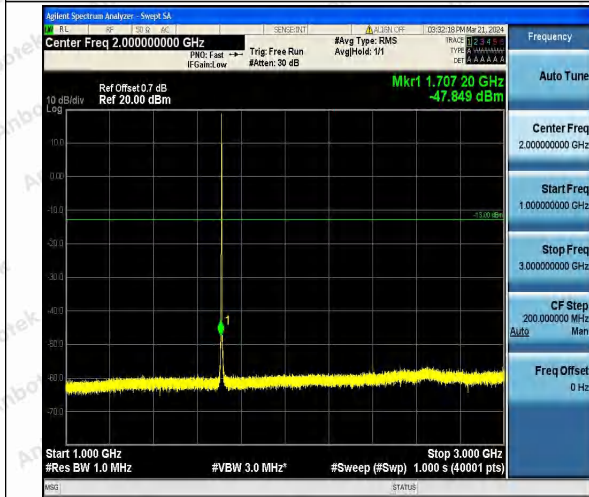


Band66\_1.4MHz\_16QAM\_131979\_1RB#0\_1000~3000  
\_1000~3000



Band66\_1.4MHz\_16QAM\_131979\_1RB#0\_3000~20000  
\_3000~20000



Band66\_1.4MHz\_QPSK\_132322\_1RB#0\_0.009~0.15  
0.009~0.15

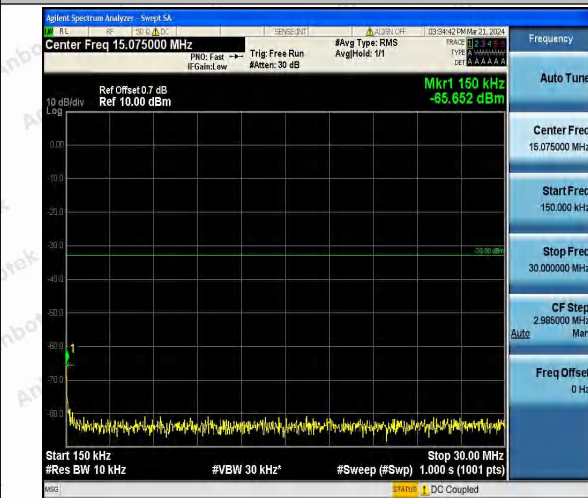

Band66\_1.4MHz\_QPSK\_132322\_1RB#0\_0.15~30\_0.15  
~30

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com.cn





Band66\_1.4MHz\_QPSK\_132322\_1RB#0\_30~1000\_30  
 ~1000

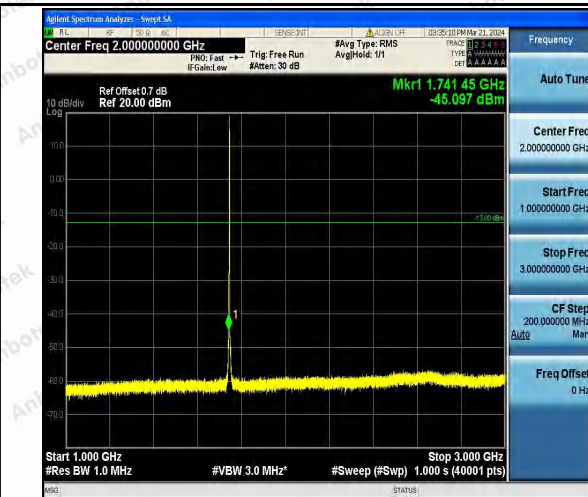

Band66\_1.4MHz\_QPSK\_132322\_1RB#0\_1000~3000\_1  
 000~3000



Band66\_1.4MHz\_QPSK\_132322\_1RB#0\_3000~20000  
 \_3000~20000



Band66\_1.4MHz\_16QAM\_132322\_1RB#0\_0.009~0.15  
 0.009~0.15




Band66\_1.4MHz\_16QAM\_132322\_1RB#0\_0.15~30\_0.  
 15~30



Band66\_1.4MHz\_16QAM\_132322\_1RB#0\_30~1000\_30  
 ~1000



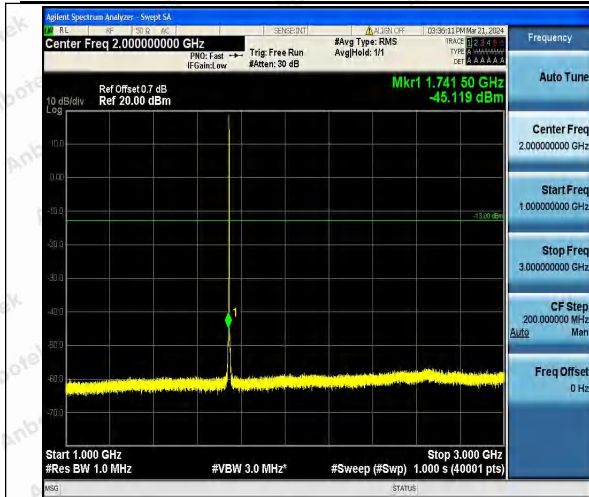

Band66\_1.4MHz\_16QAM\_132322\_1RB#0\_1000~3000  
 \_1000~3000




Band66\_1.4MHz\_16QAM\_132322\_1RB#0\_3000~20000  
 \_3000~20000




Band66\_1.4MHz\_QPSK\_132665\_1RB#0\_0.009~0.15  
 0.009~0.15



Band66\_1.4MHz\_QPSK\_132665\_1RB#0\_0.15~30\_0.15  
 ~30

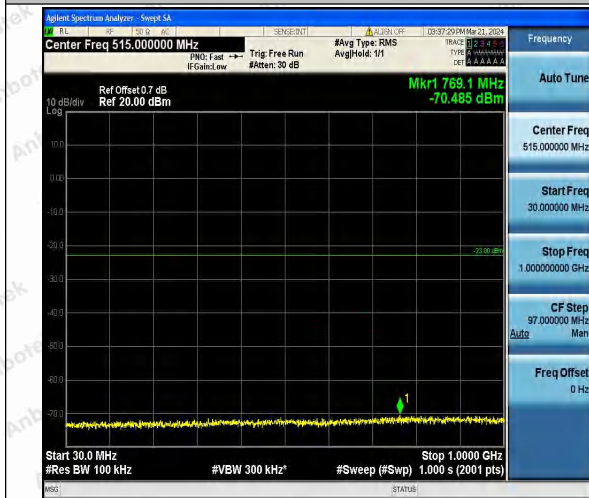

Band66\_1.4MHz\_QPSK\_132665\_1RB#0\_30~1000\_30  
 ~1000

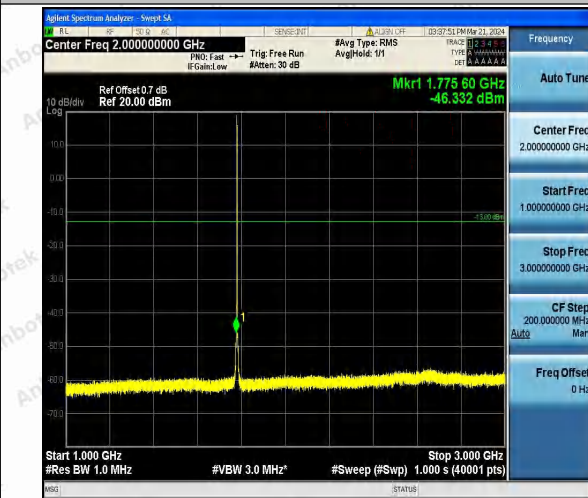

Band66\_1.4MHz\_QPSK\_132665\_1RB#0\_1000~3000\_1  
 000~3000

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com.cn





Band66\_1.4MHz\_QPSK\_132665\_1RB#0\_3000~20000\_3000~20000

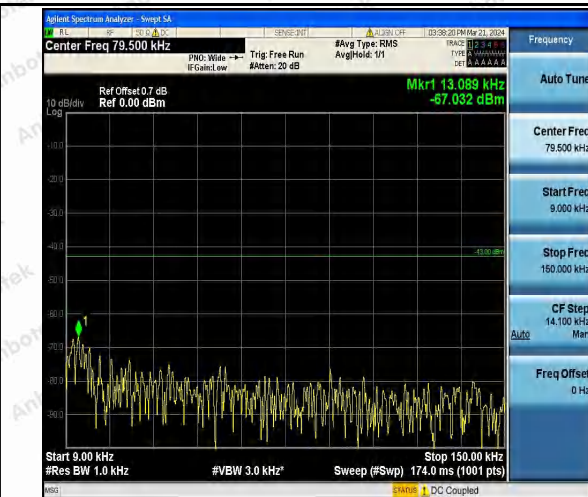


Band66\_1.4MHz\_16QAM\_132665\_1RB#0\_0.009~0.15\_0.009~0.15




Band66\_1.4MHz\_16QAM\_132665\_1RB#0\_0.15~30\_0.15~30



Band66\_1.4MHz\_16QAM\_132665\_1RB#0\_30~1000\_30~1000

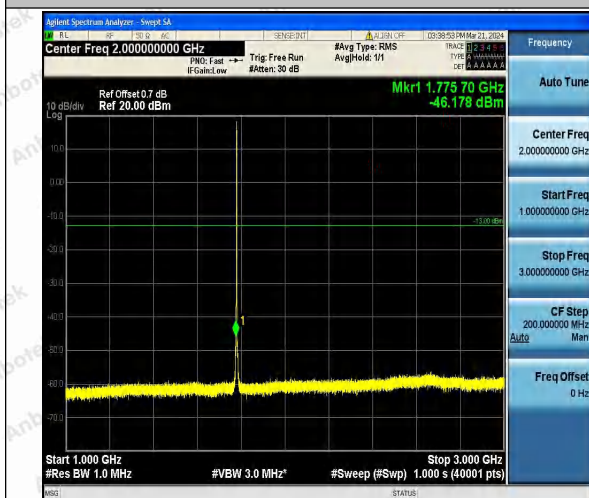

Band66\_1.4MHz\_16QAM\_132665\_1RB#0\_1000~3000\_1000~3000

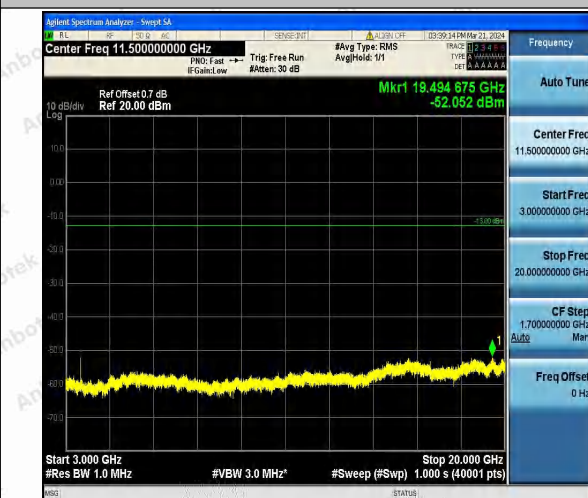


Band66\_1.4MHz\_16QAM\_132665\_1RB#0\_3000~20000\_3000~20000

## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn




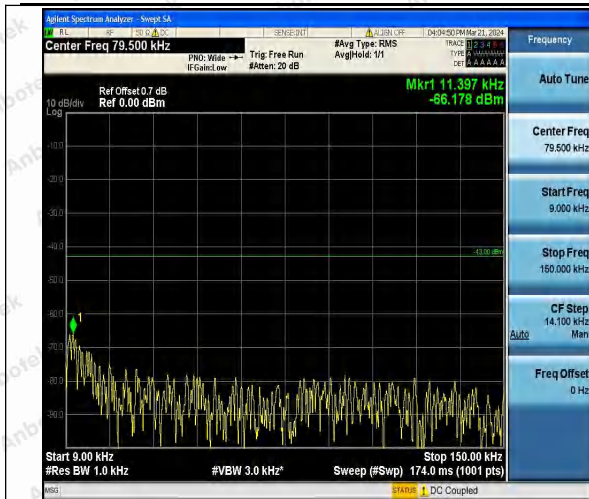


Band66\_3MHz\_QPSK\_131987\_1RB#0\_0.009~0.15\_0.09~0.15




Band66\_3MHz\_QPSK\_131987\_1RB#0\_0.15~30\_0.15~30

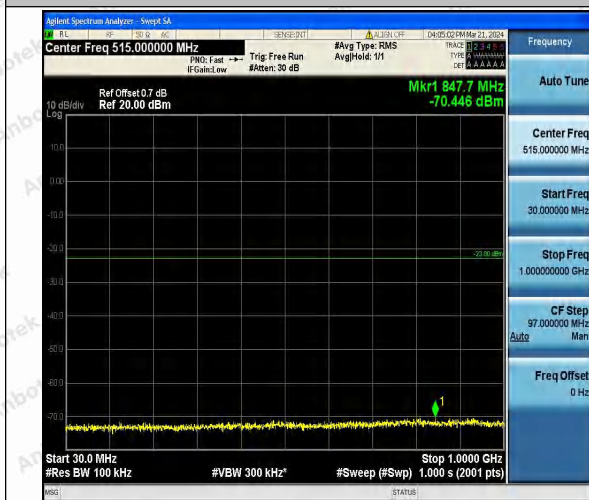


Band66\_3MHz\_QPSK\_131987\_1RB#0\_30~1000\_30~1000

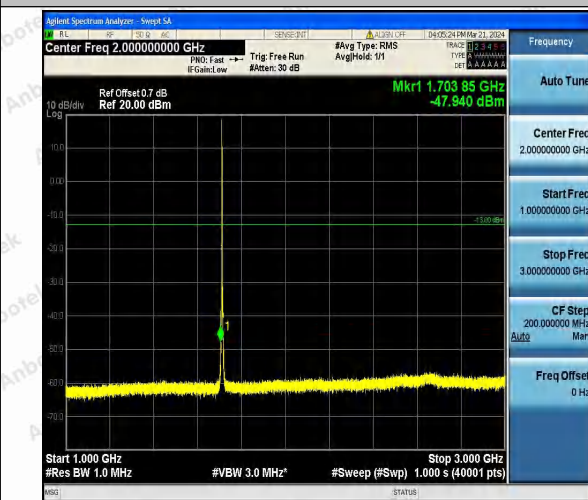

Band66\_3MHz\_QPSK\_131987\_1RB#0\_1000~3000\_1000~3000

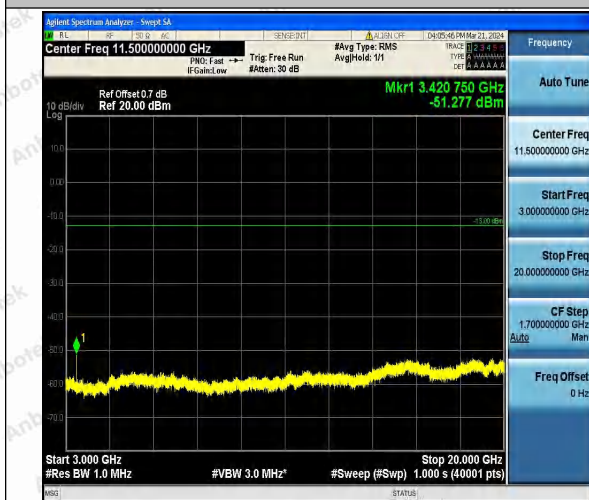

Band66\_3MHz\_QPSK\_131987\_1RB#0\_3000~20000\_3000~20000

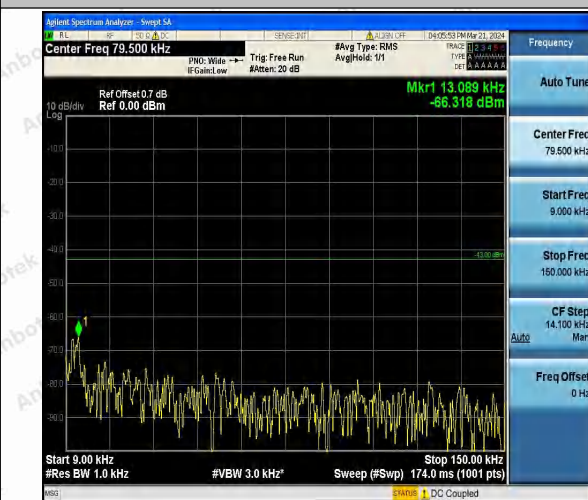

Band66\_3MHz\_16QAM\_131987\_1RB#0\_0.009~0.15\_0.09~0.15

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com.cn






Band66\_3MHz\_16QAM\_131987\_1RB#0\_0.15~30\_0.15  
 ~30

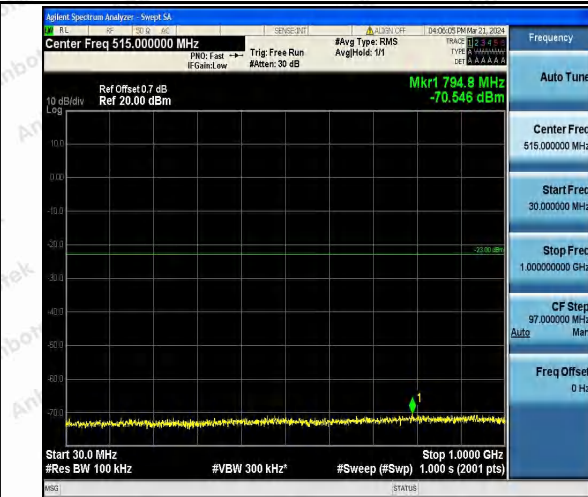


Band66\_3MHz\_16QAM\_131987\_1RB#0\_30~1000\_30~1000

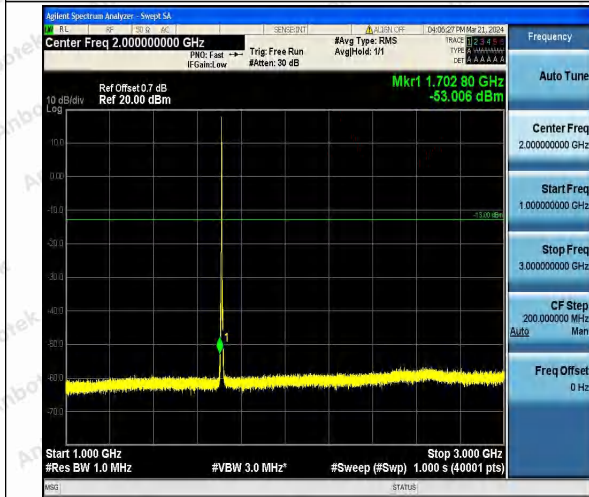

Band66\_3MHz\_16QAM\_131987\_1RB#0\_1000~3000\_1000~3000



Band66\_3MHz\_16QAM\_131987\_1RB#0\_3000~20000\_3000~20000

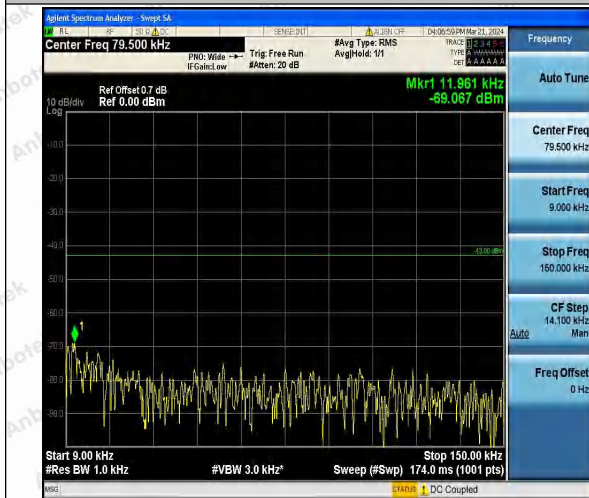

Band66\_3MHz\_QPSK\_132322\_1RB#0\_0.009~0.15\_0.009~0.15




Band66\_3MHz\_QPSK\_132322\_1RB#0\_0.15~30\_0.15~30





Band66\_3MHz\_QPSK\_132322\_1RB#0\_30~1000\_30~1000

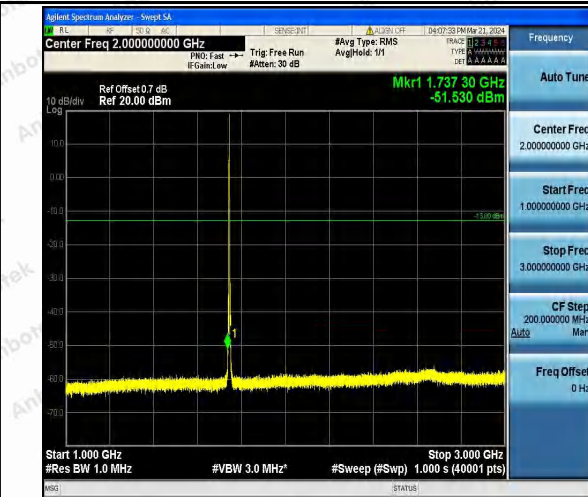

Band66\_3MHz\_QPSK\_132322\_1RB#0\_1000~3000\_1000~3000




Band66\_3MHz\_QPSK\_132322\_1RB#0\_3000~20000\_3000~20000



Band66\_3MHz\_16QAM\_132322\_1RB#0\_0.009~0.15\_0.009~0.15



Band66\_3MHz\_16QAM\_132322\_1RB#0\_0.15~30\_0.15~30

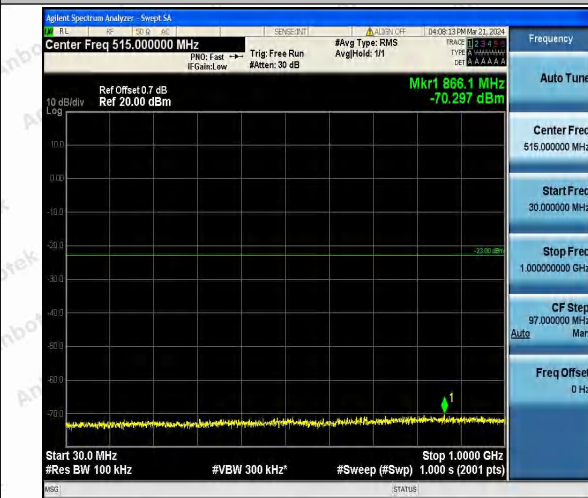

Band66\_3MHz\_16QAM\_132322\_1RB#0\_30~1000\_30~1000


## Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn





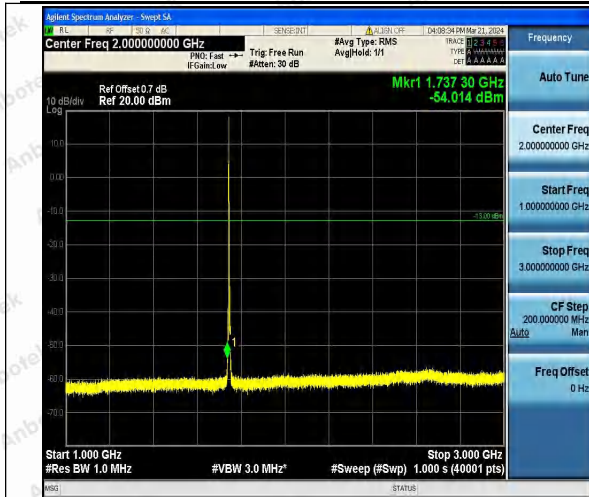


Band66\_3MHz\_16QAM\_132322\_1RB#0\_1000~3000\_1  
000~3000



Band66\_3MHz\_16QAM\_132322\_1RB#0\_3000~20000\_3000~20000




Band66\_3MHz\_QPSK\_132657\_1RB#0\_0.009~0.15\_0.009~0.15

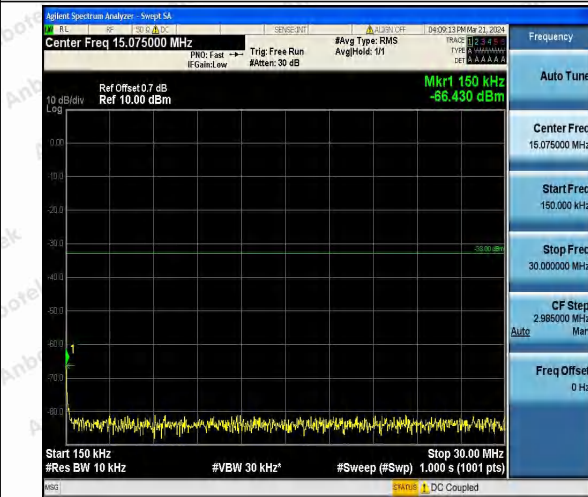

Band66\_3MHz\_QPSK\_132657\_1RB#0\_0.15~30\_0.15~30



Band66\_3MHz\_QPSK\_132657\_1RB#0\_30~1000\_30~1000

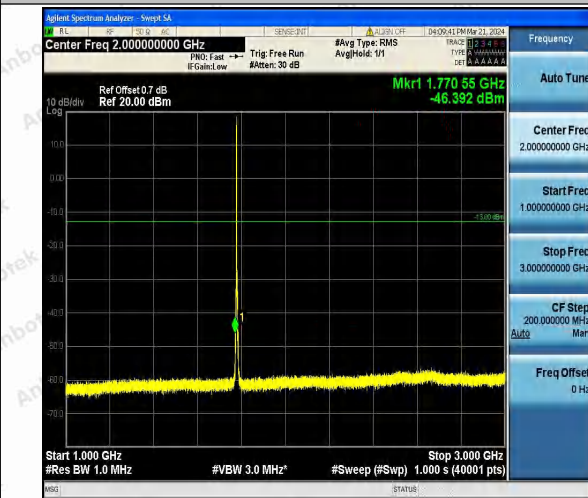

Band66\_3MHz\_QPSK\_132657\_1RB#0\_1000~3000\_1000~3000

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn





Band66\_3MHz\_QPSK\_132657\_1RB#0\_300~2000\_3000~20000

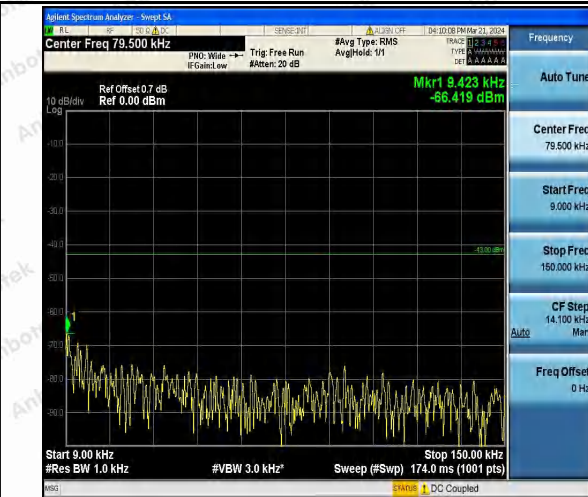


Band66\_3MHz\_16QAM\_132657\_1RB#0\_0.009~0.15\_0.009~0.15



Band66\_3MHz\_16QAM\_132657\_1RB#0\_0.15~30\_0.15~30



Band66\_3MHz\_16QAM\_132657\_1RB#0\_30~1000\_30~1000

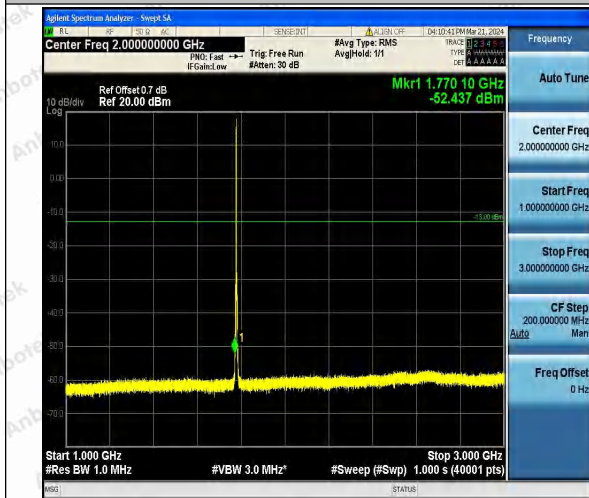

Band66\_3MHz\_16QAM\_132657\_1RB#0\_1000~3000\_1000~3000




Band66\_3MHz\_16QAM\_132657\_1RB#0\_3000~20000\_3000~20000

## Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
 www.anbotek.com.cn




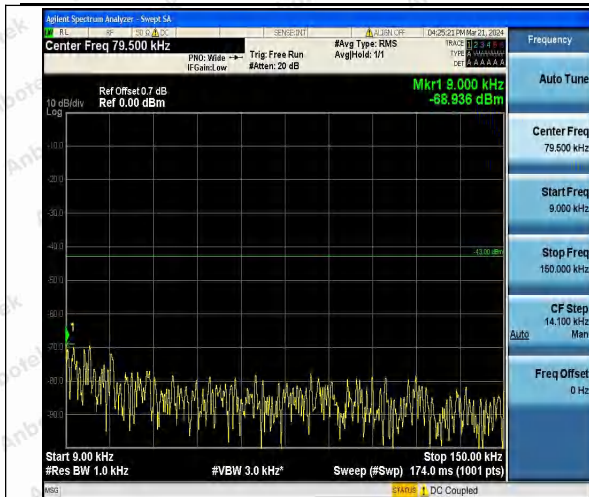


Band66\_5MHz\_QPSK\_131997\_1RB#0\_0.009~0.15\_0.009~0.15

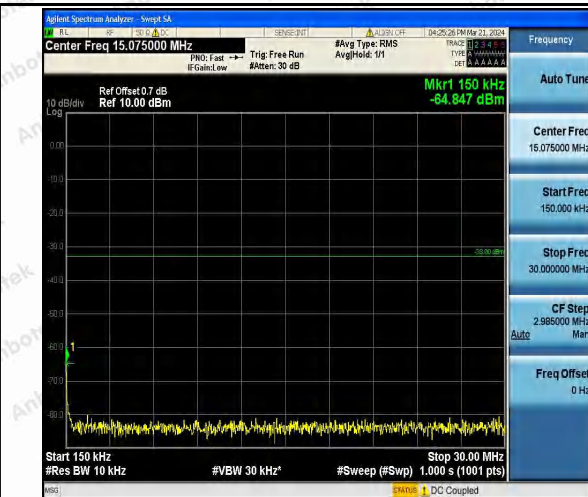

Band66\_5MHz\_QPSK\_131997\_1RB#0\_0.15~30\_0.15~30

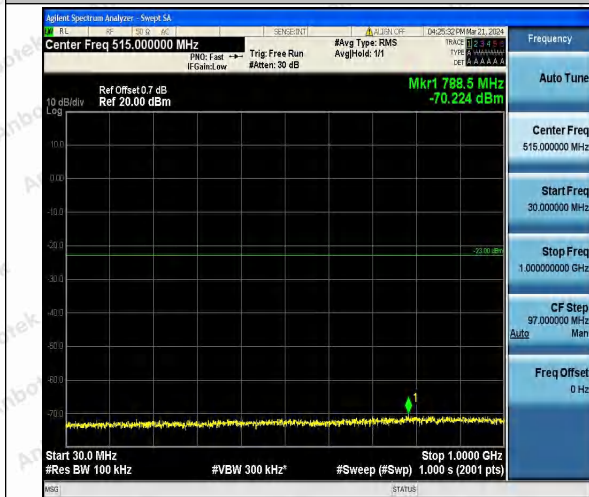


Band66\_5MHz\_QPSK\_131997\_1RB#0\_30~1000\_30~1000

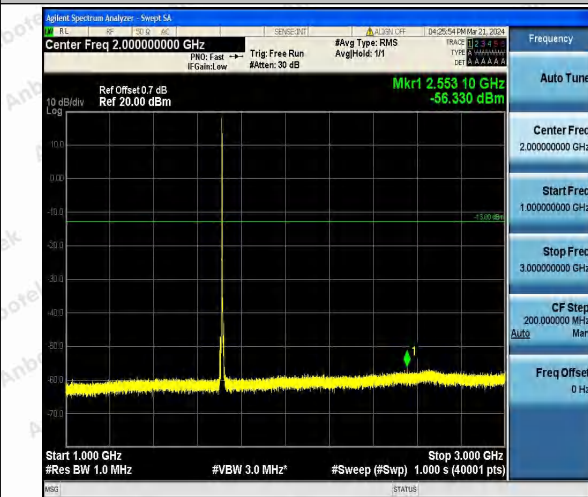

Band66\_5MHz\_QPSK\_131997\_1RB#0\_1000~3000\_1000~3000



Band66\_5MHz\_QPSK\_131997\_1RB#0\_3000~20000\_3000~20000

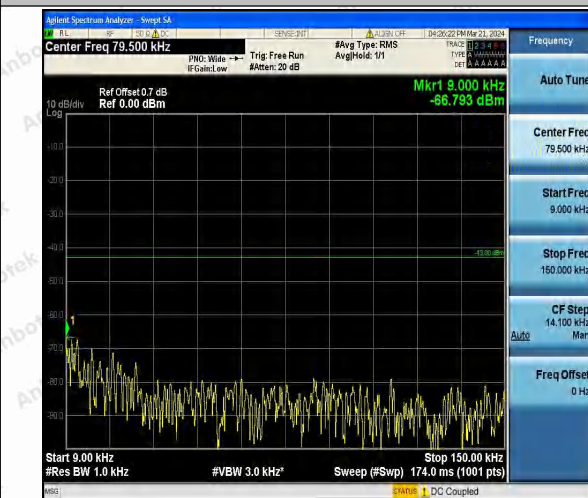

Band66\_5MHz\_16QAM\_131997\_1RB#0\_0.009~0.15\_0.009~0.15

### Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.  
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline 400-003-0500  
www.anbotek.com.cn






Band66\_5MHz\_16QAM\_131997\_1RB#0\_0.15~30\_0.15  
 ~30

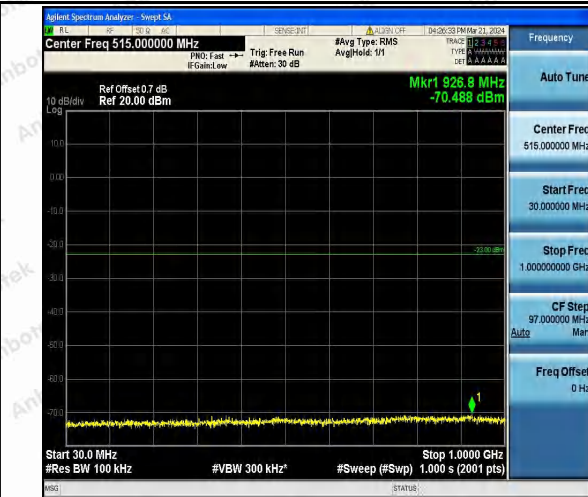


Band66\_5MHz\_16QAM\_131997\_1RB#0\_30~1000\_30~1000  
 1000

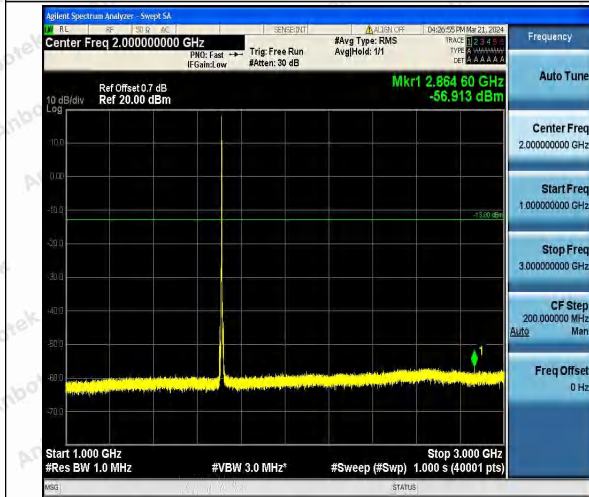

Band66\_5MHz\_16QAM\_131997\_1RB#0\_1000~3000\_1000~3000  
 000~3000



Band66\_5MHz\_16QAM\_131997\_1RB#0\_3000~20000\_3000~20000  
 3000~20000

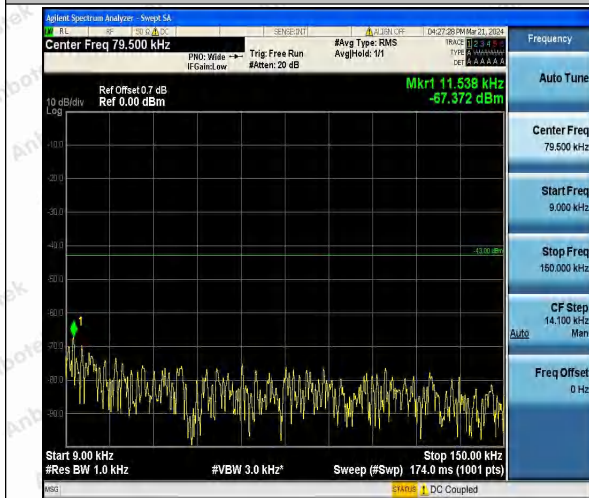

Band66\_5MHz\_QPSK\_132322\_1RB#0\_0.009~0.15\_0.009~0.15  
 009~0.15



Band66\_5MHz\_QPSK\_132322\_1RB#0\_0.15~30\_0.15~30  
 0

