

**赴**东莞市一佳电子通讯科技有限公司

Dongguan YiJia Electronics Communication Technology Co.,Ltd.

# 规格承认书

# SPECIFICATION FOR APPROVAL

		日期 Date	2024/05/13
		编 号 File No	24051302
		版本 Revision	1.0
客  户 customer:	道通		
客户料号 CUSTOMER NO:	501013894		
品名 PART NAME:	sub-G-2 Antenna		
供方料号 SUPPLIER NO:	YJI01.005.093.301A		
送样日期Date:	送样娄	枚量Q "T	Y:


客户确认CUSTOMER APPROVED BY		
APPROVAL	CHIEF	SUPERVISOR

供方	确认 SUPPLIER SIGNAT	URE
APPROVAL	CHECK	DESIGN
ChenGuoqianc	XieLi	ChenXingyi
A State of the second s		YJ-RD-F04-A



# 承认书项目表

NO	内容 (Contents)	页 数 (Number of Page)	页码 (Page Code)
1	承认书封面(Spec Cover)	1	1
2	承认书项目表(Spec Item)	1	2
3	工程成品图 (Drawing)	1	3
4	天线规格(Antenna Specification)	1	4
5	S参数测试 (S Parameter )	1	5
6	无源测试 (Passive Test)	1	6
7	方向图(Radiation Pattern)	3	7~9
8	天线装配图(Antenna Profile)	2	10 ~ 11
9	材质证明(Material Certificate)	40	12 ~ 51
10	RoHS报告( RoHS Test Report )	**	**
11	N/A	N/A	N/A
12	-	-	-
13	-	-	-

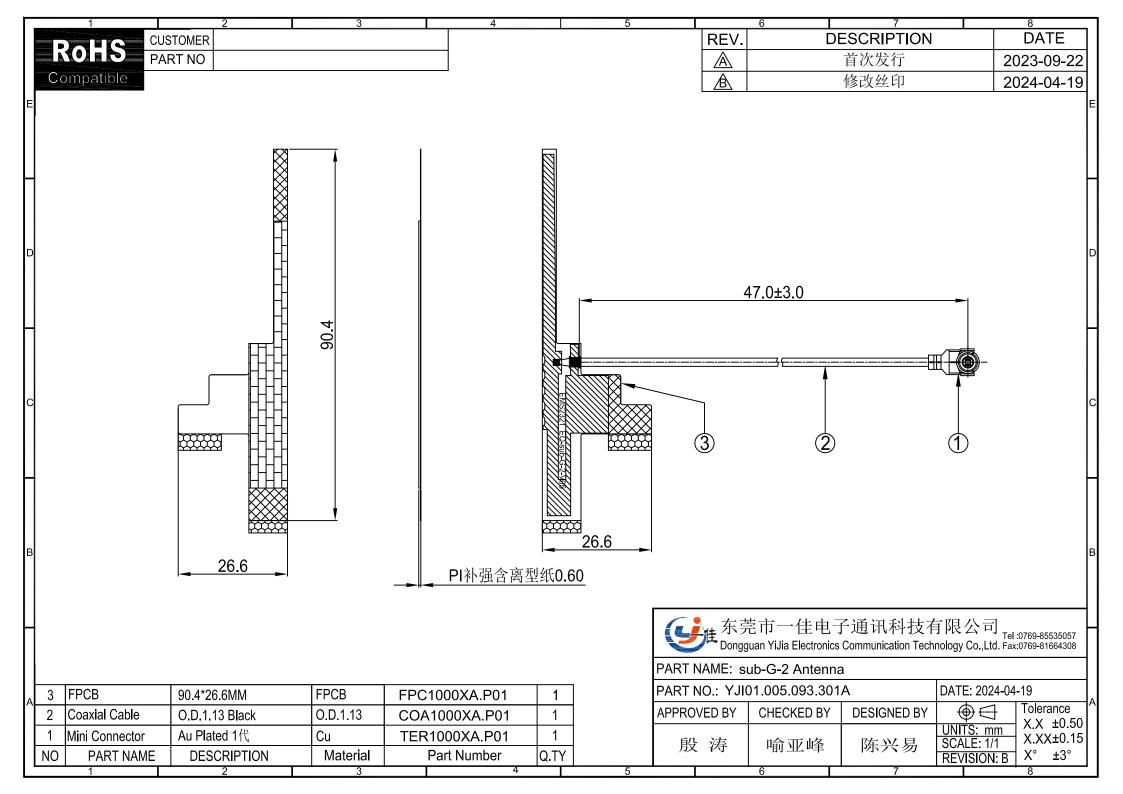




# 天线规格 Antenna Specification

# **Electrical Properties**

Frequency	866-928MHz
Impedance	50 Ohm Nominal
V.S.W.R	2.0 Max
Gain	1.0 dBi
Radiation	Omni-directional
Polarization	Linear
Physical	Properties
Connector	1代IPEX
Cable Type	O.D.1.13mm
Cable Length	47mm
Cable Color	Black
Operating Temp.	-40 ~ +85 °C
Storage Temp / Humidity	25±5°C / <70%




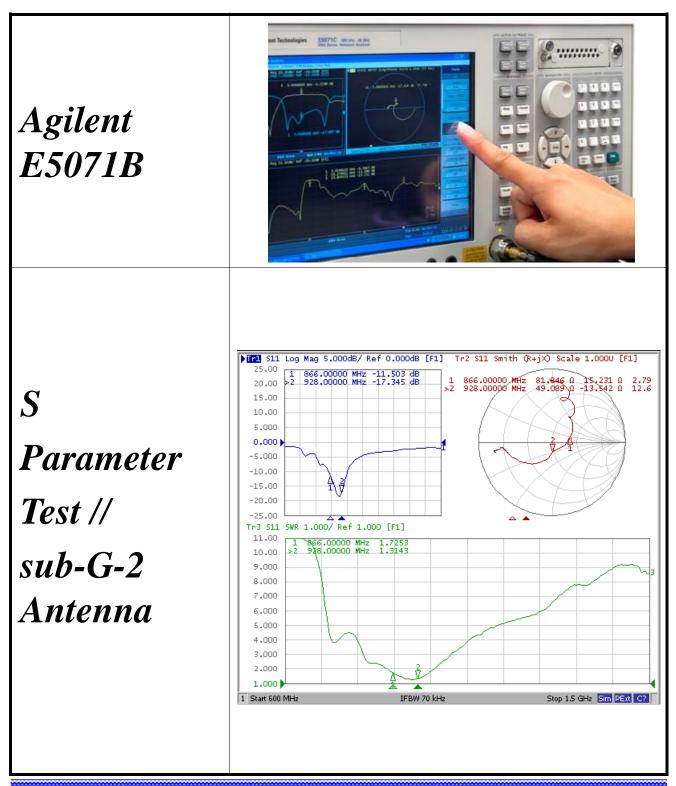




Passive Test For sub-G-2 Antenna			
Freq (MHz)	Effi (%)	Effi (dB)	Gain (dBi)
860	51.7	-2.9	1.0
870	53.2	-2.7	0.7
880	51.5	-2.9	0.1
890	47.6	-3.2	-0.1
900	45.5	-3.4	0.0
910	32.5	-4.9	-1.4
920	31.3	-5.1	-2.2
930	32.7	-4.7	-2.0




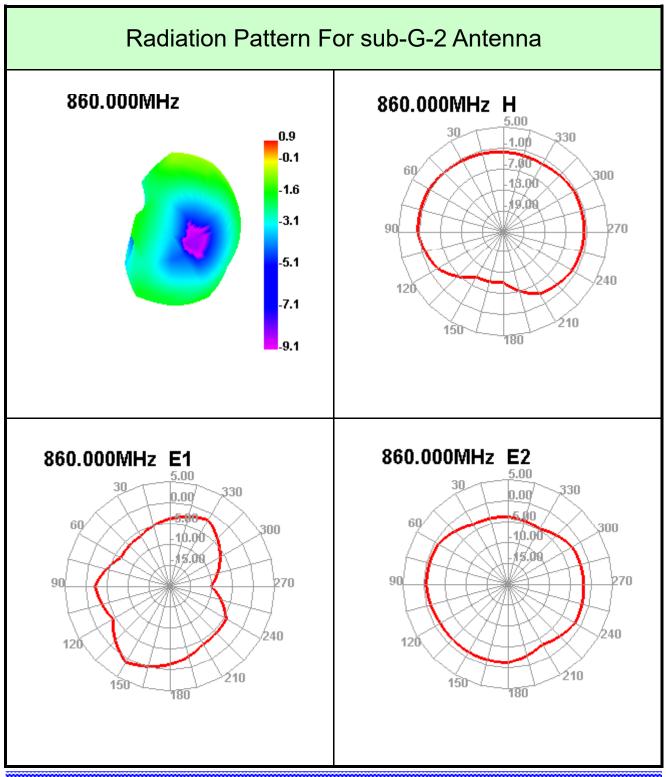



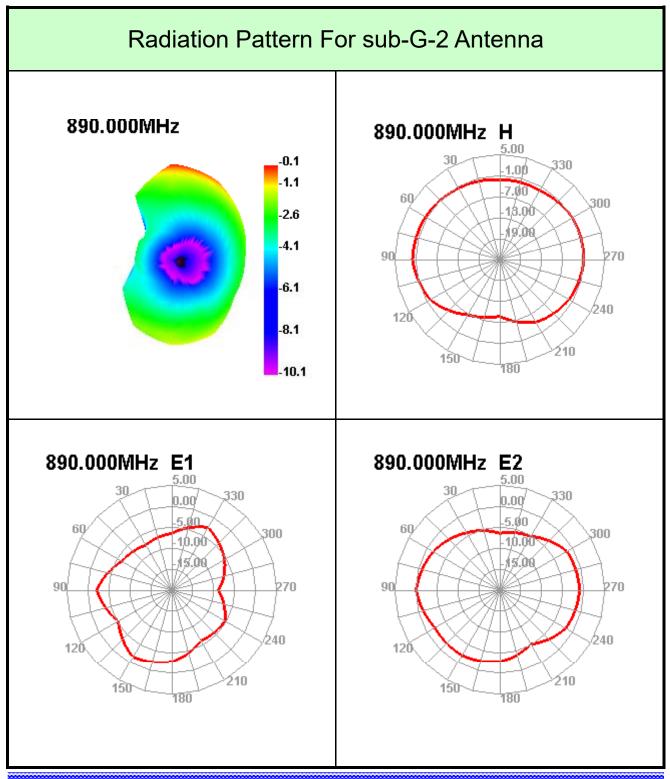



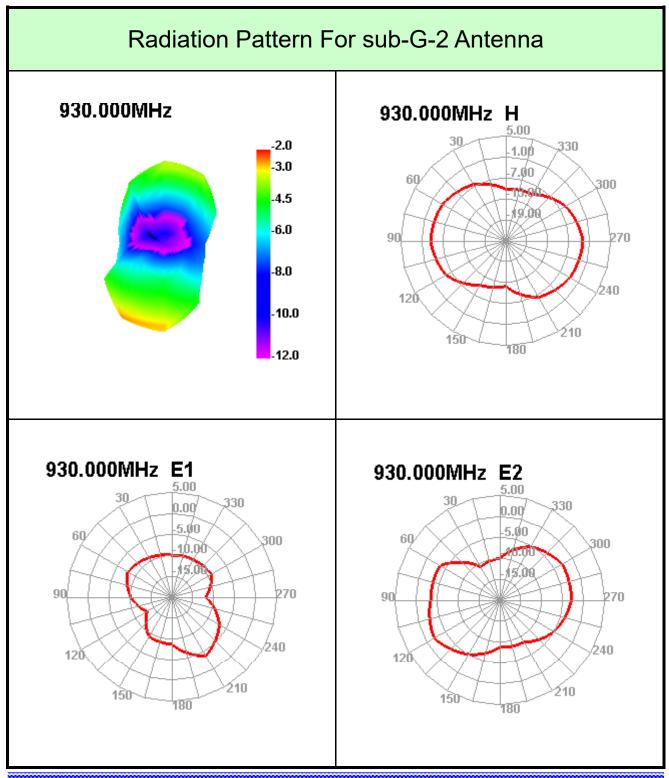









# Material safety data (MSDS)

1. Item and manufacturer information page: 1 / 2

Item name: FPC antenna electroplated nickel and gold (flexible printed circuit)

Other names: FPC nickel gold coating Recommended use and restricted use: communication products

Name of manufacturer or supplier: Dongguan Xiaoge Electronic Technology Co., Ltd

Address of manufacturer of supplicit. Donggaan Aladge Electronic Technology Co., Eta

Address of manufacturer or supplier: 1 / 2 / F, Sanxing Road, Fenghuang Middle Road, Shajiao community, Humen Town, Dongguan City Emergency contact / Fax:

2. Hazard identification data

Hazard classification: other dangerous substances, acute toxic substances, grade 4 (swallowing, skin, inhalation)



Symbols: other dangerous objects, exclamation marks

Warning: warning

Hazard warning message: harmful if swallowed, harmful if inhaled

Hazard prevention measures: put the container in a well ventilated place; avoid contact with skin and eyes; in case of accident or discomfort, consult medical treatment immediately

Other hazards:-

3. Component identification data

Chinese and English Name: nickel CAS no.7440-02-0 percentage 98.95%

Gold CAS no.7440-57-5 percentage 1%

Brightener CAS no.6155-57-3 percentage 0.05%

Synonymous Name: gold finger nickel gold layer

Case No

mixture

Composition of hazardous substances (percentage of components)

4. First aid measures

First aid methods for different exposure routes:

Inhalation: - irritates respiratory tract

Skin contact: wash the contact area with soap and water

Eye contact: flush with plenty of water for more than 15 minutes and seek medical assistance

Ingestion: drink plenty of water and seek medical assistance

The most important symptom and harmful effect: irritant.

Protection of first-aid personnel: wear class C protective equipment to implement first aid in safe area

Tips for doctors: patients should be given oxygen when inhaled. When swallowing, consider gastric lavage.

5. Fire fighting measures

Suitable extinguishing agent:

Carbon dioxide, chemical powder, water mist, alcohol foam. Special hazards that may be encountered during fire fighting:

When heated to dry, the salt will decompose to produce carbon monoxide and carbon dioxide.

Special fire fighting procedures:

1.Spray water mist to cool containers exposed to fire.2. Spray water to wash away the leakage to avoid exposure.

Special protective equipment for fire fighters:

If necessary, wear a full body chemical protective respirator

#### 6. Physical and chemical properties page: 2 / 2

	State of matter	colour	smell	proportion	melting point	boiling point
NI	solid state	silvery white	tasteless	8.9	1453Temperature	2732Temperature
AU	solid state	yellow	tasteless	19.3	1064Temperature	2807Temperature
Brightener	liquid state	Light brown	tasteless	1.1	NA	NA

7. Safe handling and storage methods

management:

Avoid contact with eyes, skin and clothing, wear personal protective equipment and do not inhale mist

Storage: Store in a cool, dry place

8、 Waste disposal methods

Waste disposal method:

1.According to the current laws and regulations.

2.According to the manufacturer's treatment, the waste to be treated should be treated first

3.In accordance with the relevant national and local government industrial wastewater discharge standards

9. Leakage treatment method

Personal precautions: wear appropriate personal protective equipment. Environmental precautions: ventilate the leakage area.

### 10. Exposure precautions

10. Exposure precautions			
Engineering control: 1. Local ex	xhaust device; 2. Overall air exc	change device; 3. The ventila	tion system should be made of
corrosion-resistant materials an	nd separated from other exhaust s	systems.	
	Control pa	arameters	
Eight hour daily average	Short time volume average	Maximum permissible	Biological indicators
Allowable concentration	Allowable concentration	concentration	BEIs
TWA	STEL	CEILING	
1mg/m3	2mg/m3	-	-
Personal protective equipment:			
Respiratory protection:-			
Hand protection: impervious glov	ves made of natural rubber, butyl	rubber and polyvinyl alcoho	ol.
Eye protection: chemical safety			
	neable clothes and work shoes mad	le of the above rubber materi	als
Health measures:	icabic cictures and torn shoes mad		
	as soon as possible after work	and wash them before wearing	g or discarding them. Moreover, the
laundry staff should be informed		and wash them before wearing	, or disedicing them, moreover, the
-	_	ash hands thoroughly after ha	andling.4. Keep the workplace clean
Z,Smoking of cating is strictly	prombited in the workplace. b. we	ish hands thorodynry arter he	maring. I. heep the "orkprace crean
11、 Stability and reactivity			
Stability:			
	tion. If bost of to the molting pe	vint sublimation and decompo	sition may easur
	tion. If heated to the melting po	fint, sublimation and decompo	Sition may occur.
Possible hazardous reactions und		dant (quah ag gadium ahlarita	, sodium hypochlorite): may produce
			(such as sodium or potassium): may
*	· ·		
			ct rapidly to form ferric oxalate.6.
	tly to form toxic fumigation.7. H	leating	
Conditions to avoid: heat			
Substances to avoid:			
1.Alkali.2. Oxidant 6. Acid			
Hazardous decomposition products	s: None		
12. Toxicity information			
Exposure route:-			
Symptoms:-			
Acute toxicity: none			
Inhalation: None			
Skin: no irritation			
Eyes: no irritation			
Ingestion: no burning sensation,	, abdominal pain, nausea, vomitin	ng in the mouth and throat	
Chronic toxicity or long-term to	oxicity:		
1.May cause kidney stone, dysuria	a and pain.2. It may cause weight	loss and chronic upper respin	ratory tract inflammation.3. It can
cause local skin pain, ulceratio	on or necrosis and nail discolora	ation.	
13、 Ecological information			
Biological toxicity: LC50 (FISH)	) —		
EC50 (aquatic invertebrates)-			
Bioconcentration coefficient:-			
Persistence and degradation:-			
	v to decompose in the body, and mo	ost of it will be discharged f	from the urine in the form of oxalic
	nsoluble salt will accumulate in	-	
	into soil, it may seep into grou		
Other adverse effects:-	into soir, it may seep into grou	indwatter and brodegrade.	
other auverse circuts.			
14、 Delivery information			
UN number: - un1760corrosive lit	le		
UN transport Name:-			
	: category 9 other hazardous subs	stances	
Packing category:-			
Marine pollutants (yes / no): no	)		
Special transportation methods a	and precautions:-		
15、 Regulatory information			
Applicable regulations:			
1.Rules for labor safety and hea			
2.General rules of dangerous and	harmful substances.		
3.The allowable concentration st	andard of harmful substances in t	the air of labor working env	ironment.
4.Road traffic safety rules.			
5.Methods and facilities standar	ds for storage, removal and dispo	osal of industrial wastes.	
16, Other data			

16、 Other data	
reference	MSDS database
Tabulator unit	Name: Dongguan Xiaoge Electronic Technology Co., Ltd

	Address / Tel: 1 / 2 / F, beside S City	Sanxing Road, Fenghuang Middle Road, Shajiao community, Humen Town, Dongguan
Tabulator	Title: quality controller	Name (seal): Huang Huanwen
Date of tabulation	2020-12-01	
remarks	The symbol "-" in the above data in	dicates that there is no relevant data at present, while the symbol / "indicates
	that this field is not applicable	e to the substance

# 化学品安全技术说明书

# MATERIAL SAFETY DATA SHEET

### 第一部分化学品及企业标识

化学品中文名称:导电布泡棉 化学品俗名或商品名:导电布泡棉 化学品英文名称:Conductive foam 生效日期:2014年08月20日 企业名称:深圳市恒昌胶贴制品有限公司 地址:广东省深圳市松岗红星南岸新区一巷6号 电话:86-755-27713054传真:86-755-27712558 国家应急电话:119 推荐用途:电脑,手机等各类电子电器产品,主要是在高频传输时遮蔽或隔离电磁波或无限 电波的干扰

### 第二部分 成分/组成信息

混合物: 涤纶纤维导电布/聚醚海绵/导电胶压克力胶 化学品名称: 导电布泡棉 成分: 涤纶纤维导电布/聚醚海绵/导电胶压克力胶 有害物成分: 不包含或在限量以内

### 第三部分 危险性概述

根据中华人民共和国2002年3月15日公布《危险化学品安全管理条例》和GB13690-92《常 用危险化学的分类及标志》,导电布泡棉不被归类为危险品。本品是一种工业导电泡棉。 侵入途径:吸入、食入、接触。

健康危害:无意义

环境危害:无意义

燃爆危害:无意义

#### 第四部分 急救措施

皮肤接触:本品为工业用电气屏蔽用海绵,不要当作创伤和医使用,但与皮肤接触一般不会 引明显的刺激。无必要急救。

眼睛接触:正常情况下,本品不会接触到眼睛,万一接触,可就医。

吸入:本品是固体,一般不会吸入。必要时请就医。

食入:正常情况下,不太可能发生,对于吞下而对健康造成的危害没有作预测,请就医。

### 第五部分 消防措施

危险特性:遇明火可引燃。

有害燃烧产物:本品在直接燃烧时,会放出刺激性气体,对人体健康有危害,对于在本品直 接燃烧时,可使用焚烧炉,要注意环境通风。必要时请就医。

灭火方法及灭火剂:可用泡沫、水枪、干粉、砂土扑救。

### 第六部分 泄露应急处理

应急处理:正常情况无泄露,根据本说明其它章节中关于对避免对身体和健康的危害。呼吸 保护,良好的通风设备和对个人保护的用品。

#### 第七部分操作处置与储存

页码:1/3

操作注意事项:本产品是一种固体,在一般的使用情况下,不会释放出有危险的化学物质。 储存注意事项:常温保存,使用前在20-25℃环境保存4 小时以上。

# 第八部分 接触控制/个体防护 最高容许浓度:无 监测方法:无 工程控制:无。 呼吸系统防护:不需要。 眼睛防护:在使用过程中,与眼睛接触是有可能的,所以避免与眼睛接触。除非在直接燃烧 时,建议戴化学安全防护眼镜及口罩。 身体防护:不需要。 手防护:不需要。 其他防护:工作现场禁止吸烟、进食。工作前避免饮用酒精性饮料。工作后,用清水和肥皂 洗手。 第九部分 理化特性 外观与性状: 银褐色泡棉 熔点(℃):无。 沸点(℃): 无 饱和蒸气压(kPa):无 临界温度(℃):无 临界压力(MPa):无 辛醇/水分配系数的对数值:无 闪点(℃):无 爆炸上限% (V/V):无 引燃温度(℃):≥180℃(明火) 爆炸下限% (V/V): 无 耐温性:达到UL510标准 溶解性:导电纤维布和海绵可溶于酮类溶剂;导电胶压克力胶可溶于汽油和苯类溶剂。 主要用途:用于电脑,手机等各类电子电器产品,主要是在高频传输时遮蔽或隔离电磁波或 无限电波的干扰。 第十部分 稳定性和反应活性 稳定性:稳定。 禁配物:无。 避免接触的条件:明火。 聚合危害:不能发生 分解产物:、本品在直接燃烧时,受热放出无机酸,成炭剂酯化,进而脱水炭化,反应生成 的水蒸气及二氧化碳等一些不燃性气体使炭层膨胀,最终形成一层多微孔的炭层。 第十一部分 毒理学资料 急性毒性:无 急性中毒:无。 慢性中毒:无。 刺激性:无。 亚急性和慢性毒性:无。 致突变性:无。 致畸性:无。 页码:2/3

致癌性:非致癌物。

### 第十二部分 生态学资料

生态毒理毒性:无 生物降解性:缓慢 非生物降解性:无数据 生物富集或生物积累性:无数据

### 第十三部分 废弃处置

废弃物性质:一般固体废物

废弃处置方法: 遵照相关国家和地区法规, 采用适当设备焚化或填埋。

### 第十四部分 运输信息

危险货物编号:非危险货物,无数据

UN 编号: 非危险货物, 无数据

包装标志: 防潮

包装类别:非危险货物,无数据

包装方法:纸箱。

运输注意事项:防止日光曝晒、防潮。

### 第十五部分 法规信息

GB16483-2000《化学品安全技术说明书编写规定》 中华人民共和国2002年3 月15日公布《危险化学品安全管理条例》 GB12268-90《危险货物品名表》

#### 第十六部分 其他信息

责任之否认声明:

我们无法预见或控制此份资料和我们的原料可能被使用的各种情况,我们不保证此份资料 之应用性和正确性,或是我们的原料在任何特定情况下之适用性,并认定对因使用此物质发 生任何损害不负有责任,决定此产品安全使用的状况为使用者的义务,此处出示之资料为与 我们目前所了解和相信的相符合,此处所给之资料为具有相当信心,但不保证,无论明说或 暗示,其为特定目的之适用性,并且此处无任何资料将被解释为违反有效专利之使用建议, 或延伸为有效专利下之执照,进一步的资讯可咨询我们的业务代表或技术服务部门。 参考文献:

化学危险品安全技术全书 填表时间:2015年8月20 日 填表部门:研发部 杨城 数据审核单位:质量控制中心

页码:3/3



# , 安 全 資 料 表

版權 2021-01-10

First, chemical products and materials for business
Chemical name: PSM-800FSDM-A/SMH-800 liquid solid plate ink
Other names:
Jse and restricted use of construction: flexible printed circuit board (PI/Cu), hand machine roof board
Name, address and address of the creator, entrant or supplier: Creator: Yueli Reachability Co., Ltd.
Address: No.22 Jingjian Fourth Road, Guanyin District, Taoyuan City: 886-3-
4836651
Jrgent/true: 886-3-4836651, true: 886-3-4837487
Second, the hazard identification of resources and materials
Hazard classification of chemical products:
Health and environmental hazards: Acute toxicity (swallowing) 4, rot/skin irritation 2, heavy weight/eye irritation 2, skin
Pass sensitive substance first, carcinogenic substance second, and hazardous substance second (acute toxicity).
ndication of content:
Symbol number:
Varning language:
Varing hered

Warning hazard warning interest:

> Harmful to swallow Cause skin irritation Causing severe eye irritation may cause skin hypersensitivity and suspected carcinogenesis Toxic to aquatic organisms

Hazard prevention	n measures:
	Put the container in a place with good ventilation far away from the high temperature
	Do not eat or drink when using
	Remove the blindfold/face
	mask immediately when
	your clothes are
	contaminated
	If you touch your eyes, wash them with plenty of
	water immediately, and then ask the mud to wear suitable gloves
	Do not inhale gas/gas/steam
	gas/gas before use
	Place it in the upper lock
	Do not place until you know all safety precautions
	Avoid releasing release in the environment
0.1 1 1	

Other hazards:-



# , 安 全 資 料 表

版權 2021-01-10

· 1 · · ·		瓜油 2021-01-10
capital mixture:		
Liquid solid plate ink PSM-800FSDM-A/SMH-800		
Chemical geology:		
Chinese and English names of hazardous	Register number of Chemical Digest	Degree or degree (percentage
components	Service (CAS No.)	of components)
Oxygen acrylate oligmer Epoxy acrylate	28064-14-4	50%
oligmer		
Silicon dioxide Fused silica	7631-86-9	13%
Aromatic solution	64742-94-5	4%



# 安全資料表

版權 2021-01-10

Methyl dipropylene glycol	34590-94-8	4%
Carbon black	1333-86-4	3.5%
BaSO4 sulfate	13462-86-7	24%
Photoinitiator and the others	5495-84-1	1.5%

Fourth, first aid measures

First aid methods for the same road:

Inhalation: 1. Take self-protection measures before rescue.

2. Remove pollution sources or move patients to new places.

- 3. If a patient stops breathing, artificial respiration should be given immediately by the person who has been adalmed. If the heart stops, cardiopulmonary resuscitation should be given. When the patient inhales and swallows toxic substances, mouth-to-mouth artificial respiration should be used directly, and pocket masks and other medical equipment should be used for artificial respiration.
- 4. Maintain the patient's safety and normal temperature. 6. Treat the cure quickly.

Pi Mo: Wash the contaminated area with harmonious water for at least 20 minutes, and remove contaminated

clothes, shoes and leather products before water. Eye touching: Immediately open the eyelids and wash the contaminated eyes with water for at least 20 minutes, and immediately take care of them.

Intake: 1. If the patient will be frustrated, or has been frustrated, he can feed anything.

2. It can induce vomiting and give 240-300ml of water.

3. If you vomit spontaneously, rinse your mouth and supply water repeatedly.

The most important diseases and harmful effects:-

Protection against first aid workers:-

Tips for doctors:-

V. Fire measures

Suitable for fire: chemical dry powder, wine foam, carbon dioxide, water, fire: water, water, foam water.

Special hazards that may be encountered during fire;

1. Its steam gas and decomposition products are burning and toxic.

2. Its steam gas is heavier than its empty gas, and it can spread to distant fire sources and give birth to tempering.

3. The combination of steam and big gas may lead to explosion.

4. When this object is indoors, outdoors or in sewers, it is in danger of steam explosion.

Special Fire Procedure:

1. In a safe distance from the place of fire, keep in the upwind position.

2. You can use water containers to disperse steam gas to wash the leakage and sparse the leakage, so as to protect the rescue staff.

3. Water in the flame of the container around, so that the container is cold, until the fire is cold. Keep the bottom of the container safe.

4. Poker or move all ignition sources.

Special protection of firefighters: Firefighters must wear air respirators, fire clothing and protection gloves.

### VI. Leakage and management methods

Things people should pay attention to:

1. Restrict personnel from entering until the spillover area is completely cleaned up.

2. The work of cleaning up by the person who is negated.

3. Wear appropriate civil air defense.

Attention to matters in the environment:

1. Remove the ignition source.

2. Maintain ventilation in the leakage area.

3. Be in the upper wind and avoid going into the lower place.

4. Remove or separate burning and combustible materials under conditions that endanger the safety of people.

5. At least 100 to 200 meters away from the pollution source.

Cleaning method:

1. You can touch the leaked materials.

PSM-800FSDM-A/SMH-800



# ・ 安 全 資 料 表

2. Avoid leakage entering sewers or dense spaces.

- 3. Where safety permits, prevent or reduce spills.
- 4. Block the leakage with soil, sand or similar and combustible objects that will respond to the leakage.
- 5. When there is a small amount of spill, it should be absorbed by the reaction with the leakage. Contaminated absorbed and discharged materials have the same model
- 6. Harmfulness must be placed in the appropriate container that is covered and indicated. Wash the spill area with water.
- 7. When there is a large amount of spill: fire fighting, emergency management and business response to seek help.

### VII. Safe Location and Storage Methods

#### Place:

- 1. It is stored in a place where it is dry and ventilated, and avoids direct light and ignition source.
- 2. Far away things such as strong oxides, strong acids and water.
- 3. Use grounding, use the device without spark, and ventilate the wind system.
- 4. Store a small amount in the refrigerator, and use the explosion-proof refrigerator.
- 5. Department of police reports leaked outside the city.
- 6. It is necessary to separate the storage area from the work area, restrict people from entering and leaving the storage area, and show warnings.
- 7. Avoid collision, and the nearest fire system.
- 8. You can work alone, and another person needs to be on standby for rescue.
- 9. In the work area, use the containers that can be used to burn the liquid body, and all the barrels and slots should be grounded, and the containers must be connected to each other.
- 10. Use the smallest possible amount, and use a suitable ventilation system in the designated area.
- 11. The target indication container should be covered when in use.

Storage:

- 1. It is stored in a place where it is dry and ventilated, and avoids direct light and ignition source.
- 2. Store a small amount in the refrigerator, and use the explosion-proof refrigerator.
- 3. It is necessary to separate the storage area from the work area, restrict people from entering and leaving the storage area, and show warnings.
- 4. The target indication container should be covered when in use.

Eight, the preventive measures

Engineering control:

- 1. The wind system of the single use of the step to generate sparks and grounding.
- 2. The discharge port leads directly to the outside, and the important measures for protection are taken.
- 3. When using this object in large quantities, it may be necessary to install local gas and process dense.
- 4. Supply fully new and fresh air gas to supplement the air gas drawn out by filling and discharging the air gas system.

Control number:-

Average capacitance of eight small hours/average capacitance of short hours/maximum capacitance:-

Biological fingerprint:-



# , 安全資料表

Civil air defense:
<ul> <li>Breathing protection: 1. Chemical materials containing machine vapor poison cans or self-made breathing protection equipment.</li> <li>Constant quantity type gas supply type breathing protection device, animation type breathing protection device containing machine steamed gas pot, mask containing machine steamed gas pot, comprehensive self-galvanizing breathing protection device, comprehensive gas supply type breathing protection device, and comprehensive chemical school poison breathing protection device containing machine steam poison pot. 3. Positive full-blown breathing protection equipment or positive full-blown gas-supplied breathing protection equipment with auxiliary positive self-blown breathing protection equipment.</li> </ul>
<ul> <li>4. There is a mask for steaming gas canister, and an escape type self-breathing protection tool.</li> <li>Hand protection: Butyl rubber is the best, chlorinated polyethylene, polyvinyl acid, fluorinated cortex, butyl rubber/chloroprene rubber, fluorinated rubber, chloroprene rubber/natural rubber galaxy cover, fluorinated cortex/chloroprene rubber are also good anti-scorching gloves.</li> </ul>
Eye protection: 1. Anti-chemical safety eye protection.
2. Full cover.
3. Don't wear shaped eyes.
1. Work shoes and body clothes.
2. There should be a bath/wash in the work area.
The measures for living:

1. Remove contaminated clothes quickly after work, and then wear them after washing them.



# 安全資料表

版權 2021-01-10

2. The work place is forbidden to smoke cigarettes or eat.

3. After taking care of this thing, you must wash your hands.

4. Keep the property clean.

IX. Physical and Chemical Geology

Outside (physical state, color, etc.): black cream	Gas flavor: bad smell
Olfactory value:-	Melting level:-25 °C
PH value:-	Boiling/boiling: 218-219 °C
Combustibility (solid and gas):-	Fire: > 75 °C
Decomposition temperature:-	The method of wearing a cup: () carrying a cup (V) wearing a cup
Spontaneous combustion temperature: spontaneous combustion	Explosion boundary:-
Steaming gas:-	Steaming density: 6.07
Density: 1.24 ~ 1.26 (water = 1)	Solubility: Slightly soluble in water
Octanol/water partition number (log Kow):-	Dispersion rate:-

X. Stability and Reaction

Stability: Stability under sealed dry container.

Possible hazard response under special conditions:-

Types to be avoided: leakage, flame and other ignition sources.

Things to avoid: acid, oxidation

Hazardous decomposition: carbon monoxide

XI. Toxic Materials

The road: leather, inhalation, eyes, food

Symptoms: irritation, drowsiness, dizziness, tiredness, pain, nausea, difficulty breathing and

Acute toxicity: Inhalation: 1. Steaming gas will irritate nose, throat and lungs.

Pi Fou: 1. Liquid body or solution will cause heavy irritation and burning pain.

2. Steaming gas can cause irritation.

3. After being picked up by the skin, the liquid

will be absorbed to the poisoned amount. Eyes: 1.

Steaming gas will irritate eyes and stimulate them.

2. Liquid body will cause heavy burning and injury to eyes.

Intake: 1. It will cause bright local irritation to the mouth and digestive tract.

Chronic toxicity or long-term toxicity:-

Twelve, raw materials

Raw toxicity:-

Persistence and degradation: Avoid entering the water source inlet and waterway, which is harmful to aquatic organisms.

Bioaccumulability:-

Reactionality in soil:-

Other good effects:-

XIII. Methods of abandoning and abandoning places

Discarding method:

1. Examining the principle of phase method.

2. According to the pieces of the store to be disposed of waste materials.

3. Specific incineration or burial can be used.

Fourteen, Dictate to send materials

Lian He Guo Bian No.:-



# , 安 全 資 料 表

版權 2021-01-10

The name of the joint country is:-

Classification of the hazards of Dirk: It is judged as ordinary goods according to Fujian Commercial Report 0128227

Packaging and fitting: It can be arranged according to ordinary goods

Marine pollutants (yes/no): no

Special delivery methods and precautions:-

#### XV. French Materials

### Suitable usage:

1. If you work safely, you will be able to apply it

2. Road traffic safety rules

3. Methods and standards for the storage and removal of waste materials

4. Harmful academic products and general knowledge

5. What you can do in your work, what you can do, and what you can do

### XVI. Other materials

Take part in the	1. RTECS Materials, TOMES PLUS CD-ROM, Vol. 41, 1999		
text	2. HSDB Materials, TOMES PLUS CD-ROM, Vol. 41, 1999		
Superficial site	Mingjia: Youli Lian Lian Co., Ltd.		
	Address/: No.22, Jingjian Fourth Road, Guanyin District, Taoyuan City: 886-3-4836651		
Table person	Calling for: the principle of	Name (Seal): Huang Zhihui	
	science and technology		
Table date	2021.01 1.10		
Per	Among the above-mentioned materials, "-" means that there is no related materials at present, while the symbol number		
	"/" means that this person is compatible with the material and is suitable for use		

The above-mentioned materials are provided by our company, which is correct for the above-mentioned materials, but it is still difficult to avoid them. The materials and materials of each project are only for reference, and users should judge their availability according to their corresponding needs.



# SECTION 1 PRODUCT AND COMPANY IDENTIFICATION

- 1.1 Material Name:
- 1.2 Part Number:
- 1.3 Use of Material:
- 1.4 Date of Prepared:
- 1.5 Company Identification:

Flexible Copper-Clad Polyimide Laminates

- LPI-HF
- Printed Circuit Boards

86-792-8358899

- April 22nd, 2021
  - Jiu Jiang Flex Co., Ltd.
    - 1210Qianjin Road (E) Jiujiang, Jiangxi, China 332006
- 1.6 Emergency Telephone Number:
- 1.7 Telephone Number for Information: 86-792-8358899, 8355813

# **SECTION 2 COMPOSITION/INFORMATION ON INGREDIENTS**

Composition / substance		CAS#	%
PI	polyimide	25038-81-7	2.93~28.11
	Epoxy resin	25036-25-3	2.42~6.81
Adhesive	Flame Retardant (additive type)	225789-38-8	0.49~1.36
	Rubber	9003-18-3	1.45~3.99
Copper foil	Copper	7440-50-8	92.66~59.72

# SECTION 3 HAZARDOUS IDENTIFICATION

Dust, soot, combustion gases produced when burning, of inhaled, ingested or absorbed through skin it will be harmful or irritating to the eyes, skin, mucous membrane, respiratory system, allergies can be caused to skin, flammable irritating and sensitive.

# **SECTION 4 FIRST-AID MEASURES (on Dust)**

Inhalation:

Remove to fresh air. Obtain medical attention if symptoms persist.

Eye Contact:

Flush immediately with large amounts of water. Do not rub eyes. Obtain medical attention if symptoms persist.

Skin Contact:

Wash area of contact thoroughly with soap and water. Do not rub or scratch. Obtain medical attention if symptoms persist.

Ingestion: Drinking water as much as possible, emetic, and see doctor.

MATERIAL SAFETY DATA SHEET



# MATERIAL SAFETY DATA SHEET

# SECTION 5 FIRE FIGHTING MEASURES

**Extinguishing Agents** 

Following extinguishing media can be used:

Carbon dioxide extinguisher

Dry powder fire extinguisher

Water Pump

Foam fire extinguisher

Hazards of Unusual burning and Explosion:

The material produces carbon monoxide, carbon dioxide, nitrogen, oxides of nitrogen, smoke and dust when extremely high temperature or burning.

Personal Protective Equipment

As in any burning, wear self-contained breathing apparatus and full protective gear. Upper limit of Flammability: not ascertained

# **SECTION 6 EMERGENCY HANDLING OF LEAKAGE**

Emergency handling:

Block the leakage area to avoid dust flying and wear protective equipment, use vacuum cleaner to clean the leakage.

# **SECTION 7 HANDLING AND STORAGE**

Handling: Wear cotton gloves to protect product damage and hand lacerated. Storage conditions

The material should be stored in dry, ambient temperature wrapped with PE film. Environment: Keep away from heat, ignition sources, and direct sunlight. Other conditions: Keep cartons tightly closed when not in use.

# **SECTION 8 EXPOSURE CONTROLS / PERSONAL PROTECTION**

Respiratory protection:

No general requirements. If the occurrence of dust, gas or smoke processing or processing, is stimulating to employees, to use NIOSH/MSHA approved respiratory protection measures. Engineering control should be excluded from the need for respiratory support. Ventilation:

Once air exhaust exposure exceeds limits, or visible smoke, dust, exhaust gas, the ventilation at site should be accompanied by all the heat process at the same time. Mechanical operations:

Optimize and follow good industrial operation as possible as you can.



# MATERIAL SAFETY DATA SHEET

### Eye Contact:

With eye-glasses on during all process

# **SECTION 9 PHYSICAL AND CHEMICAL PROPERTIES**

Appearance	PI film Copper-Clad Laminate with adhesing	ve
Physical State:	solid	
PH:	Not Applicable	
Melting point:	no data	
Relative density (water =1):	more than 1	
Boiling point:	no data	
The relative vapor density (air =1):	more than 1	
Saturated vapor pressure (kPa):	Not Applicable	
Heat of combustion (kJ/mol):	no data	
The critical temperature (c):	Not Applicable	
The critical pressure (MPa):	Not Applicable	
The octanol / water partition coefficient	ient of numerical: Not Applicable	
Flash point (°C):	Not Applicable	
Upper explosive limit% (V/V):	Not Applicable	
Ignition temperature (c):	no data	
The lower limit of explosion% (V/V):	: Not Applicable	
Solubility:	insoluble	
Application:	used for making printed circuit board	

# **SECTION 10 STABILITY AND REACTIVITY**

Stability:

Storage for one year at  $5\,^\circ\!\mathrm{C}$  to  $30\,^\circ\!\mathrm{C}$  and RH less than 75% Conditions to Avoid:

High Humidity, direct sunlight,

The copper side may have violent reaction with followings:

Acetylene, ammonium nitrate, bromide, chlorate, iodic acid, chlorine, CIF<sub>3</sub>, Pb (N<sub>3</sub>) <sub>2</sub>, (Cl<sub>2</sub>+OF<sub>2</sub>), ethylene oxide, fluoride, hydrogen peroxide, nitric acid hydrazide, hydrazoic acid, H<sub>2</sub>S, K<sub>2</sub>O<sub>2</sub>, NaN<sub>3</sub>, Na<sub>2</sub>O<sub>2</sub>.

# SECTION 11 TOXICOLOGICAL INFORMATION

Sensitization: Long time skin contact may cause dermatitis

Acute Poisoning: Inhalation of dust may cause thirst, fever, headache, weakness, symptom of respiratory disorders.



# MATERIAL SAFETY DATA SHEET

# **SECTION 12 ECOLOGICAL INFORMATION**

Normal condition: No big influence may caused to ecology. Waste Disposal Method

To dispose based on local, state or national laws.

Tank treatment: Not applicable.

# **SECTION 13 DISPOSAL CONSIDERATION**

Hazardous wastage: NO.

Waste Disposal Method

To bury or burn at specified place based on national laws.

# SECTION 14 TRANSPORTATION INFORMATION

No special regulation on this product for domestic or international transportation.

# **SECTION 15 REGULATORY INFORMATION**

Must be complied with domestic or local regulation

# SECTION 16 REGULATORY INFORMATION

14.1 INTERNATIONAL REGULATIONS: EU Directive 2011/65/EU (RoHS): Compliant

# **SECTION 17 OTHER INFORMATION**

Issued by: QC Department of Jiu Jiang Flex Co., Ltd Disclaimer:

The data sheet information is true and accurate, but all statements and recommendations do not contain any guarantee. The consequence of the material shall be from practice. This report does not include all the circumstances that the user may encounter during operation. Each aspect of the operation may be increased or decreased during operation. All health and safety information contained in this report shall be submitted to you employees and customers. Users are responsible to take appropriate measures in practical operations.

# CHUNG YU INDUSTRY CORPORATION

# **Material Safety Data Sheet**

## Section 1: Chemical Product and Company Identification

Product name	Thermal curable two-component marking ink
Other means of identification	ZSR-150 ZM-400WF
Recommended use of the chemical and restrictions	Use in PCB fabrication.
on use	
Manufacturer/Supplier identification	CHUNG YU INDUSTRY COPORATION
Manufacturer/Supplier address	618 Yen-Ping Rd., sec. 3, Ping-Jeng, Tao-Yuan, Taiwan
Emergency telephone No.	(886-3)4641205
FAX No.	(886-3)4644839

### Section 2: Hazards Identification Information

Hazard classifications	Inflammable liquids(II), Carcinogens, (II), Inhalation of hazardous substances (I)
of the product	
Label elements	
	Hazard symbols: Fire
	Caution catchwords: Danger
	Hazard massages: Inflammable liquids and vapor
	Harmful to swallow
	Skin irritation
	Eye irritation
Other hazards	-

# Section 3: Composition, Information on Ingredients

Mixture :

Chemical name	Concentration(% of contents)	CAS. NO.
Epoxy resin	50	25085-99-8
Barium sulfate	15	7727-43-7
Titanium dioxide	30	13463-67-7
Naphtha	5	8030-30-6

# Section 4 : First-aid Measures

The first-aid measures for different exposure routes:		
Eyes contact	Immediately flush eyes with plenty of water for at least 15 minutes, occasionally lifting the upper and	
	lower eyelids.	
Skin contact	Flush skin with plenty of soap and water for at least 15 minutes while removing contaminated clothing	
	and shoes.	
Swallow	Do not induce vomiting. If conscious and alert, rinse mouth and drink 2-4 cupfuls of milk or water.	
Inhalation	Remove from exposure to fresh air immediately.	
The most important	Headache, nausea	
symptoms and		
hazardous effects		
Notes to Physicians	Please provide the MSDS for physicians.	

# Section 5: Fire-fighting Measures

Suitable fire	Chemical dry powders, chemical foam, carbon dioxide	
extinguishing media		
General information	As in any fire, wear a self-contained breathing apparatus in pressure-demand, MSHA/NIOSH	
	(approved or equivalent), and full protective gear. During a fire, irritating and highly toxic gases	
	may be generated by thermal decomposition or combustion.	
Specific fire-fighting	It's not suitable to use water extinguish.	
methods		

# Section 6: Accidental Release Measures

Person-related precautionary measures	Do not inhale vapors / aerosols. Ensure supply of fresh air in enclosed rooms.	
Environmental-protection measures	Do not allow to enter sewerage system.	
Procedures for cleaning / absorption	Take up with liquid-absorbent material. Forward for disposal. Clean up affected	
	area	

# Section 7: Safe Handling and Storage Measures

Handling	Wash thoroughly after handling. Remove contaminated clothing and wash before reuse. Avoid contact with eyes,		
	skin, and clothing. Avoid ingestion and inhalation.		
Storage	Store in a cool( $15 \sim 25^{\circ}$ C), dry place. Keep container closed when not in use.		

# Section 8: Exposure Controls Measures

Engineering	Use adequate general or local exhaust ventilation to keep airborne concentrations below the permissible exposure				
controls	limits. Use process enclosure, local exhaust ventilation, or other engineering controls to control airborne levels.				
Control					
parameters	Term	8 hours time weighted	Short-term exposure limits	Maximum limits	Biological standards
		averagw exposure limits	STEL	CEILING	BEIs
		TWA			
	Solvent	100ppm	125ppm	—	_
Personal	Eye protection: Wear safety glasses and chemical goggles if splashing is possible.				
protective	Skin prot	tection: Wear appropriate	on: Wear appropriate protective gloves and clothing to prevent skin exposure.		
equipment	Clothing	: Wear appropriate	Wear appropriate protective clothing to minimize contact with skin.		
	Respirato	ors: Wear a NIOSH/M	Wear a NIOSH/MSHA or European Standard EN 149 approved full-facepiece		
		airline respirator i	airline respirator in the positive pressure mode with emergency escape		
		provisions.			

# Section 9: Physical and Chemical Properties

Physical state : paste	Color : white	
Odor threshold : –	Odor : slightly pungent	
pH value : –	Melting point : -	
Decomposition temperature : -	Boiling point : 110-190°C (solvent)	
Flammability(solid, gas) : -	Flash point : 38-43°C (solvent)	
Autoignition temperature : -	Test methods $:$ –	
Vapor pressure $: <5 \text{ mmHg} @ 25^{\circ}\text{C}$ (solvent)	Explosion limits : —	
Specific gravity/Density : 1.45~1.55 g/cm <sup>3</sup> (water=1)	Solubility in water : insoluble	

# Section 10: Stability and Reactivity

Chemical stability	Stable under normal temperatures and pressures.	
Conditions to avoid	Fire.	
Incompatibilities with other materials	Strong oxidants.	
Hazardous decomposition products	Irritating and toxic fumes and gases.	
Hazardous polymerization	Has not been reported.	

Information on the likely routes of exposure	Skins, swallow, inhale, eyes		
Symptoms	Nausea, vertigo, irritation		
Acute toxicity	Skins: Slight irritation		
	Swallow: Nausea, vomit, and the other symptoms same as inhale		
	Inhale: Cause the respiratory tract irritation, nausea, vomit, headache		
	Eyes: The vapor cause eyes irritation		
	LD50(solvent): >5000mg/kg (mouse, swallow)		
	LC50:-		
Further information	Further hazardous properties cannot be excluded. The product should be handled with		
	the usual when dealing with chemicals		

### Section 11: Toxicological Information

### Section 12: Ecological Information

Ecotoxic effect	Quantitative data on the ecologic effect of this product are not available.	
Further ecologic data	No ecological problems are to be expected when the product is handled and due care and	
	attention.	

### Section 13 - Disposal Considerations

Dispose of in a manner consistent with federal, state, and local regulations.

### **Section 14 - Transport Information**

- 1. United Nation number (UN No.): 1866
- 2. UN proper shipping name: -
- 3. Transport hazard classes: 3
- 4. Packing group: -
- 5. Marine pollutant (Yes/No): No
- 6. Specific transport measures and precautionary conditions: -

### **Section 15 - Regulatory Information**

- 1. European / International Regulations : European labeling in accordance with EC Directives.
- 2. Other using condition should follow local regulations.

### Section 16 - Additional Information

Organization that	Name: R&D	TEL: (886-3)4641205	
prepared the MSDS	Address: 618 Yen-Ping Rd., sec. 3, Ping-Jeng, Tao-Yuan, Taiwan		
Person who prepared the MSDS	Job: manager	Name: Wan-Hua Lee	
Date the MSDS was prepared	2018/12/20		

The information above is believed to be accurate and represents the best information currently available to us. However, we make no warranty of merchantability or any other warranty, express or implied, with respect to such information, and we assume no liability resulting from its use. Users should make their own investigations to determine the suitability of the information for their particular purposes. In no way shall the company be liable for any claims, losses, or damages of any third party or for lost profits or any special, indirect, incidental, consequential or exemplary damages, howsoever arising, even if the company has been advised of the possibility of such damages.



## **Material Safety Data Sheet**

Copyright, 2003, 3M Company. All rights reserved. Copying and/or downloading of this information for the purpose of properly utilizing 3M products is allowed provided that: (1) the information is copied in full with no changes unless prior written agreement is obtained from 3M, and (2) neither the copy nor the original is resold or otherwise distributed with the intention of earning a profit thereon.

This material safety data sheet (MSDS) is provided as a courtesy in response to a customer request. This product is not regulated under, and a MSDS is not required for this product by the OSHA Hazard Communication Standard (29 CFR 1910.1200) because, when used as recommended or under ordinary conditions, it should not present a health and safety hazard. However, use or processing of the product not in accordance with the product's recommendations or not under ordinary conditions may affect the performance of the product and may present potential health and safety hazards.

## SECTION 1: PRODUCT AND COMPANY IDENTIFICATION

**PRODUCT NAME:** 3M(TM) Laminating Adhesives 9471LE, 9472LE, 9671LE, 9672LE, 9653LE, 9453LE MANUFACTURER: 3M

DIVISION: Industrial Adhesives and Tapes ADDRESS: 3M Center St. Paul, MN 55144-1000

EMERGENCY PHONE: 1-800-364-3577 or (651) 737-6501 (24 hours)

**Issue Date:** 06/20/2003 **Supercedes Date:** 05/22/2001

Document Group: 08-9111-9

**Product Use:** 

Specific Use:

Laminating Adhesive

### **SECTION 2: INGREDIENTS**

Ingredient TACKIFIED ACRYLATE POLYMER <u>C.A.S. No.</u> None <u>% by Wt</u> 100

## **SECTION 3: HAZARDS IDENTIFICATION**

### **3.1 EMERGENCY OVERVIEW**

Specific Physical Form: Roll of Tape

Odor, Color, Grade: Tan, Acrylate odor when unrolled.

General Physical Form: Solid

**Immediate health, physical, and environmental hazards:** This product, when used under reasonable conditions and in accordance with the 3M directions for use, should not present a health hazard. However, use or processing of the product in a manner not in accordance with the product's directions for use may affect the performance of the product and may present potential health and safety hazards.

### **3.2 POTENTIAL HEALTH EFFECTS**

#### **Eye Contact:**

No health effects are expected.

#### Skin Contact:

No health effects are expected.

#### Inhalation:

No health effects are expected. This product may have a characteristic odor; however, no adverse health effects are anticipated.

#### **Ingestion:**

No health effects are expected.

## **SECTION 4: FIRST AID MEASURES**

### 4.1 FIRST AID PROCEDURES

The following first aid recommendations are based on an assumption that appropriate personal and industrial hygiene practices are followed.

Eye Contact: No need for first aid is anticipated.

Skin Contact: No need for first aid is anticipated.

Inhalation: No need for first aid is anticipated.

If Swallowed: No need for first aid is anticipated.

## **SECTION 5: FIRE FIGHTING MEASURES**

#### 5.1 FLAMMABLE PROPERTIES

Autoignition temperature Flash Point Flammable Limits - LEL Flammable Limits - UEL No Data Available Not Applicable Not Applicable Not Applicable

### 5.2 EXTINGUISHING MEDIA

Use fire extinguishers with class B extinguishing agents (e.g., dry chemical, carbon dioxide).

### 5.3 PROTECTION OF FIRE FIGHTERS

**Special Fire Fighting Procedures:** Wear full protective clothing, including helmet, self-contained, positive pressure or pressure demand breathing apparatus, bunker coat and pants, bands around arms, waist and legs, face mask, and protective covering for exposed areas of the head.

Unusual Fire and Explosion Hazards: No unusual fire or explosion hazards are anticipated.

Note: See STABILITY AND REACTIVITY (SECTION 10) for hazardous combustion and thermal decomposition information.

3M MATERIAL SAFETY DATA SHEET 3M(TM) Laminating Adhesives 9471LE, 9472LE, 9671LE, 9672LE, 9653LE, 9453LE 06/20/2003

## **SECTION 6: ACCIDENTAL RELEASE MEASURES**

Accidental Release Measures: Not applicable.

## **SECTION 7: HANDLING AND STORAGE**

### 7.1 HANDLING

Avoid prolonged or repeated skin contact. This product is considered to be an article which does not release or otherwise result in exposure to a hazardous chemical under normal use conditions.

### 7.2 STORAGE

Not applicable.

### SECTION 8: EXPOSURE CONTROLS/PERSONAL PROTECTION

### 8.1 ENGINEERING CONTROLS

Not applicable.

### 8.2 PERSONAL PROTECTIVE EQUIPMENT (PPE)

#### 8.2.1 Eye/Face Protection

Avoid eye contact.

#### 8.2.2 Skin Protection

Avoid prolonged or repeated skin contact. Gloves not normally required.

#### 8.2.3 Respiratory Protection

Under normal use conditions, airborne exposures are not expected to be significant enough to require respiratory protection.

#### 8.2.4 Prevention of Swallowing

Not applicable.

### 8.3 EXPOSURE GUIDELINES

None Established

### **SECTION 9: PHYSICAL AND CHEMICAL PROPERTIES**

Specific Physical Form: Odor, Color, Grade: General Physical Form: Autoignition temperature Flash Point Flammable Limits - LEL Flammable Limits - UEL Boiling point Roll of Tape Tan, Acrylate odor when unrolled. Solid *No Data Available Not Applicable Not Applicable Not Applicable Not Applicable* 

# 3M MATERIAL SAFETY DATA SHEET 3M(TM) Laminating Adhesives 9471LE, 9472LE, 9671LE, 9672LE, 9653LE, 9453LE 06/20/2003

Vapor Density Vapor Pressure Specific Gravity pH Melting point Solubility in Water Evaporation rate Volatile Organic Compounds Percent volatile VOC Less H2O & Exempt Solvents Viscosity Not Applicable Not Applicable Approximately 1.01 [Ref Std: WATER=1] Not Applicable No Data Available Nil Not Applicable No Data Available No Data Available No Data Available No Data Available Not Applicable

# **SECTION 10: STABILITY AND REACTIVITY**

Stability: Stable.

Materials and Conditions to Avoid: None known

Hazardous Polymerization: Hazardous polymerization will not occur.

### Hazardous Decomposition or By-Products

**Substance** 

**Condition** 

Hydrocarbons Carbon monoxide Carbon dioxide During Combustion During Combustion During Combustion

Hazardous Decomposition: Under recommended usage conditions, hazardous decomposition products are not expected. Hazardous decomposition products may occur as a result of oxidation, heating, or reaction with another material.

# SECTION 11: TOXICOLOGICAL INFORMATION

Please contact the address listed on the first page of the MSDS for Toxicological Information on this material and/or its components.

# **SECTION 12: ECOLOGICAL INFORMATION**

# ECOTOXICOLOGICAL INFORMATION

Not applicable.

# CHEMICAL FATE INFORMATION

Not applicable.

# SECTION 13: DISPOSAL CONSIDERATIONS

Waste Disposal Method: Dispose of waste product in a sanitary landfill. As a disposal alternative, incinerate in an industrial or

# 3M MATERIAL SAFETY DATA SHEET 3M(TM) Laminating Adhesives 9471LE, 9472LE, 9671LE, 9672LE, 9653LE, 9453LE 06/20/2003

commercial facility.

Since regulations vary, consult applicable regulations or authorities before disposal.

# **SECTION 14:TRANSPORT INFORMATION**

Please contact the emergency numbers listed on the first page of the MSDS for Transportation Information for this material.

# **SECTION 15: REGULATORY INFORMATION**

## **US FEDERAL REGULATIONS**

Contact 3M for more information.

**311/312 Hazard Categories:** Fire Hazard - No Pressure Hazard - No Reactivity Hazard - No Immediate Hazard - No Delayed Hazard - No

## STATE REGULATIONS

Contact 3M for more information.

### **CHEMICAL INVENTORIES**

This product is an article as defined by TSCA regulations, and is exempt from TSCA Inventory listing requirements.

Contact 3M for more information.

## INTERNATIONAL REGULATIONS

Contact 3M for more information.

This MSDS has been prepared to meet the U.S. OSHA Hazard Communication Standard, 29 CFR 1910.1200.

# **SECTION 16: OTHER INFORMATION**

#### NFPA Hazard Classification

Health: 0 Flammability: 1 Reactivity: 0 Special Hazards: None

National Fire Protection Association (NFPA) hazard ratings are designed for use by emergency response personnel to address the hazards that are presented by short-term, acute exposure to a material under conditions of fire, spill, or similar emergencies. Hazard ratings are primarily based on the inherent physical and toxic properties of the material but also include the toxic properties of combustion or decomposition products that are known to be generated in significant quantities.

**Reason for Reissue:** The MSDS has been revised because 3M has adopted the 16-section ANSI/ISO format. The potential hazards of the product have not changed. We encourage you to reread the MSDS and review the information.

# 3M MATERIAL SAFETY DATA SHEET 3M(TM) Laminating Adhesives 9471LE, 9472LE, 9671LE, 9672LE, 9653LE, 9453LE 06/20/2003

DISCLAIMER: The information in this Material Safety Data Sheet (MSDS) is believed to be correct as of the date issued. 3M MAKES NO WARRANTIES, EXPRESSED OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR COURSE OF PERFORMANCE OR USAGE OF TRADE. User is responsible for determining whether the 3M product is fit for a particular purpose and suitable for user's method of use or application. Given the variety of factors that can affect the use and application of a 3M product, some of which are uniquely within the user's knowledge and control, it is essential that the user evaluate the 3M product to determine whether it is fit for a particular purpose and suitable for user's method of use or application.

3M provides information in electronic form as a service to its customers. Due to the remote possibility that electronic transfer may have resulted in errors, omissions or alterations in this information, 3M makes no representations as to its completeness or accuracy. In addition, information obtained from a database may not be as current as the information in the MSDS available directly from 3M.

#### 3M MSDSs are available at www.3M.com

4. MSDS

# 江阴凯博通信科技有限公司 JIANGYIN KAIBO COMMUNICATION TECHNOLOGY CO.,LTD. Material Safety Data Sheet (物質安全資料表)

一、 物品与厂商资料

物品名称: 同轴高频线

物品编号: KB113 系列

制造商或供货商名称、地址: 江阴市凯博通信科技有限公司/江苏省江阴市澄江镇梅园大街 391号 紧急联络电话/传真电话: 0510-86070001/86070020

二、 成分辨识资料

纯物质:

中英文名称:聚全氟乙丙烯 FLUORINATED PROPYLENE ETHYLENE/镀银铜线 Cu-silver plated/镀锡线 TINNED COPPER

同义名称: FEP/SC/TX

危害物质成分(成分百分比):无

### 危害物质:

危害物质	浓度或浓度范围(单位: ppm)	
铅及其化合物 Pb	Pb ≤90	
镉及其化合物 Cd	≤75	
汞及其化合物 Hg	≤1000	
六价铬及化合物	1 ≤1000	
卤素	氯 C1≤900	氯 C1+溴 Br≤1500
凶杀	溴 Br≤900 氯 CI+溴 Br≤1300	
SVHC15 种物质	禁止使用	刊

. 15.

三、危害辨识数据

健康危害效应:在 260℃ 以上,可能会有吸入分解气体的危险.一定要安装排气装置.	]
环接影响 再拉萨奇物协理及递力注急注切处理 绝对不可燃烧	-
物理性及化学性危害:物理化学性能及其稳定,不易降解,不得擅自填埋.	
特殊危害: 无	]
	1
675	
要症状: 对人的神经系统产生损害	1
品危害分类: 大气和水源	]
	环境影响:要按废弃物处理及清扫法律法规处理,绝对不可燃烧. 物理性及化学性危害:物理化学性能及其稳定,不易降解,不得擅自填埋. 特殊危害:无 要症状:对人的神经系统产生损害

6 4;

四、急救措施

不同暴露途径之急救方法:

- ·吸入: 到空气流通处换气.
- ·皮肤接触:无
- ·眼睛接触:无
- ・食入: 不消化,排出.

最重要症状及危害效应:无

对急救人员之防护: 对流换气

对医师之提示: 吸氧

# 五、灭火措施

<u>五、</u> 火措施	8
适用灭火剂: 通用	
灭火时可能遭遇之特殊危害: 避免分解气体吸入	
特殊灭火程序:无	e
消防人员之特殊防护设备: 防毒面罩	

## 六、泄漏处理方法

个人应注意事项:粉状树脂	
环境注意事项: 不可填埋	
清理方法:要按废弃物处理及清扫法律法规处理,绝对不可燃烧.	

## 七、安全处置与储存方法

处置:	避免与高温和火源接触.	6	
储存:	通风干燥处.		

### 八、暴露预防措施

工程控制:无

控制参数:

·八小时日时量平均容许浓度/短时间时量平均容许浓度/最高容许浓度:

· 生物指标:

个人防护设备:

·呼吸防护:安装排气装置

·手部防护:无

·眼睛防护:无

·皮肤及身体防护:无

卫生措施: 应将衣服上附着的灰尘抖落, 手脸洗净, 不要让其附着于香烟上.

迎旧小

# 九、物理及化学性质

物质状态:固体	形状:透明颗粒
颜色:透明	气味: 无
pH值: 7	沸点/沸点范围: /
分解温度: 360℃	<u>****</u> 闪火点: /
自燃温度: /	爆炸界限: /
蒸气压: /	蒸气密度: /
密度: 2.2	溶解度: /

1.41

# 十、安定性及反应性

安定性: 很稳定	
特殊状况下可能之危害反应: 高温或燃烧分解气体对人体神经系统的损害.	
应避免之状况:绝对不可燃烧.	

# 应避免之物质:金属钠及其强酸的混合物. 危害分解物: 气体及粉尘.

十一、毒性资料

急毒性: /	
局部效应: /	
致敏感性: /	
慢毒性或长期毒性: /	
特殊效应: /	

# 十二、生态资料

可能之环境影响/环境流布:不降解,禁填埋

十三、废弃处置方法

废弃处置方法:按废弃物处理及清扫法律法规要求送专业资质处理公司处置.

十四、运送资料

国际运送规定: / 联合国编号: / 国内运送规定: 无 特殊运送方法及注意事项: 无

十五、法规资料

适用法规: 遵循欧盟 REACH 法规相关要求。

它数据

参考文献	杜邦产品说明/SONY 限用物资标准
制窗体位	名称: 江阴凱博通信科技有限公司
前团件业	地址/电话: 江阴市澄江街道梅园大街 391 号/0510-86070017
制表人	姓名(签章): 庄科洁。
制表日期	2011/11/3

14.

# MATERIAL SAFETY DATA SHEET (MSDS)

		Issued: Revised:	Dec 20,2007 Dec 20,2007
File No. 2302			
	Y : WinTech Polymer Ltd. EE : Quality Assurance Dept. 2-18-1 Konan, Minato-ku, Tokyo,10 ER : 03-6711-8605	FR4840 8-8280 Japan	
SUBSTANCE/PREP RATION	IATION ON INGREDIENTS A : Preparation		
COMMON CHEMICAL NAME	: Polybutyleneterephthalate		
SYNONYMS	: Polybutyleneterephthalate(PBT)		
INGREDIENTS AND COMPOSITION	: PBT≧80%, Phosphorus Flame retardant a	nd others ≦20%	6
CHEMICAL FORMURA	: { g-ᠿ-g-∘ (CH₂)₄-∘ } <sub>h</sub>		
SERIAL № IN OFFICIAL GAZETTE	: 7-1039 (base resin) (Law Concerning Examination and Regulati Chemical Substances)	on of Manufactu	ıre,etc.,of
CAS №	: 2 4 9 6 8 – 1 2 – 5 (base resin)		
3. HAZARDS IDENTIFICA	ION		
PHYSICAL AND CHEMICAL HAZARDS	: Not applicable		
HUMAN HEALTH EFFECTS	: Not applicable		
ENVIRONMENTAL EFFECTS	: Not applicable		
PHYSICAL AND CHEMICAL HAZARDS	: It is inflammable substance and combustible existent. Neither dangerous reaction, fire not under normal conditions.		
THE CLASSIFICATION	: Not applicable		
4. FIRST-AID MEASURES			
INGESTION	: Help to vomit as much as possible. If sick fe physician for advice.	eling continues,	and ask a
INHALATION	: When a gas generated from the molten poly generated during combustion or heat, has b air without delay and wait until the victim is continues,ask a physician for advice.	een inhaled,rem	nove fresh
SKIN CONTACT	: Cool the contacted skin with clean water with the polymer In a molten form. Do not force t the skin. If any burns are observed on the s advice.	o remove the so	olid resin on

EYE CONTACT	:	Cool and rinse the eye with clean water for at least 15 minutes when the eyes had contact with molten polymer. In case of wearing contact lenses,remove the lenses as soon as possible,and ask a physician for advice. When the eye had contact with the polymer in an ordinary solid form,rinse the eye with clean water without delay. If the discomfort persists,ask a physician for advice.
5. FIRE-FIGHTING MEASU	RE	S
EXTINGUISHING MEDIA	:	Water,form fire-extinguishing agent,powder fire-extinguishing agent,and carbon dioxide gas.
SPECIFIC METHODS	:	Extinguish the fire with water. A method of extinguishing an ordinary fire may be applied. Do not apply water directly to processing machines.
SPECIFIC HAZARDS	3 :	Incomplete combustion leads to generation of toxic gases such as carbon monoxide or tetrahydrofuran, in addition to carbonic acid gas and water.
SPECIAL EQUIPMENT FOR THE PROTECTION OF FIREFIGHTERS	:	In case the fire gained force, use a gas mask or other protective equipment.
6. ACCIDENTAL LEAKAGE	M	EASURES
PERSONAL PRECAUTIONS	:	When pellets were spilled on the road or floor,wipe them off with a besom or cleaner not to cause slipping.
ENVIRONMENTAL PRECAUSION	:	Handle the spillage in accordance with provisions given in the "Resin pellet spillage preventive manual", in order to prevent intakes by marine animals and birds.
7. HANDLING AND STORA	GE	
HANDLING	:	This resin in a pellet form will neither ignite nor explode at room temperatures.
HANDLING 2	:	For molding work, effective means for local exhaust are required to discharge gases generated by melt processing.
HANDLING 3	:	Avoid inhaling of gases generated in moulding work. Do not directly touch resin of high temperature.
HANDLING 4	:	Avoid retaining hot resin in the processing machines for many hours.
HANDLING 5	:	This pellets spilled on the floor are likely to cause slipping. Remove such spillage at any times.
STORAGE	:	Keep the substance away from any fire or heat sources for the sake of safe storage.
RECOMMENDED PACKAGING MATERIALS	:	No information.
8. EXPOSURE CONTROL		RSONAL PROTECTION
CONTROL CONCENTRATION	:	None at present
PERMISSIBLE CONCENTRATION	:	OSHA PEL/1985 Max. permissible concentration of inactive powder 15mg/m <sup>*</sup> - ditto - (Aspiration ) 5 mg/m <sup>*</sup> ACGIH TLV/1992 1993 Exposure limit of the powder TWA 10 mg/m <sup>*</sup>
ENGINEERING MEASURE	:	When handling dust: Use totally enclosed containers resisting dust explosion. When heat melted in molding: Effective local ventilation must be provided.

	PERSONAL PROTECTIVE EQUIPMENT	:	
	RESPIRATORY PROTECTION	:	Wear a dust-proof mask.
	EYE PROTECTION	:	Wear protective glases or goggles.
	HAND PROTECTION	:	Wear heat-resisting gloves against burns, when handling molten polymer.
	SKIN & BODY PROTECTION	:	Wear long sleeve clothes against burns, when handling molten polymer.
9. PH	YSICAL AND CHEMIC APPEARANCE etc.	AL :	
	BOILING POINT	:	Not applicable
	VAPOUR PRESSURE	:	Not applicable
	VOLATILITY	:	Not applicable
	SUBLIMATION	:	None
	MELTING POINT	:	228°C
	DENSITY	:	1.32g/cm
	SOLUBILITY	:	Insolube in water
	FLASH POINT	:	300°C or higher
	IGNITION POINT	:	300°C or higher
	EXPLOSION PROPERTY	:	Not applicable
	INFLAMMABILITY	:	None
	REACTIVITY WITH WATER	:	None
	OXIDIZABILITY	:	None
	SELF-REACTIVITY	:	None
	DUST EXPLOSIVENESS	:	Upper explosion limit : Not applicable. Lower explosion limit : 35g/m <sup>2</sup>

#### 10. STABILITY AND REACTIVITY : Stable for nomal storage or handling. STABILITY AND REACTIVITY

11. TOXICOLOGICAL INFORMATION								
SKIN CORROSIVE OROPERTIES	:	No finding.						
SENSITIZING & IRRITANT EFFECTS	:	Gas generated in drying or melting is irritating eyes and skins.						
ACUTE TOXICITY(INCLUDIN G LD50)		No finding.						
SUBACUTE TOXICITY	:	No finding.						
CHRONIC TOXICITY	:	No finding.						

	No finding.
:	No finding.
:	No finding.
:	No finding.
:	No finding in this report means that there will be no hazard in general, but no proving data available at the time of reporting.
:	With regard to dust, the maximum permissible concentration and limits are fixed by OSHA and ACGIH.
ATI	ION
′ :	No finding.
1:	No finding.
:	No finding.
٩TI	ON
:	This is designated as waste plastics among industrial wastes by the Wastes Disposal Law. Disposal waste pellets through licensed wastes handlers or local autonomous bodies if they are handling wastes disposal.
:	When disposed by incineration, use the well controlled incinerators in accordance with the Wastes Disposal Law, Air Pollution Control Law and Water Pollution Prevention Law.
RA	ATION
:	Not applicable
:	Handle with care so as not to give damages to containers or not to be subjected to wetting.
:	subjected to wetting.
: 1AT	subjected to wetting. Secure the containers firmly so as not to cause collapsing.
: 1AT	subjected to wetting. Secure the containers firmly so as not to cause collapsing.
	: : ATI : : ATI

### To I-PEX Co.,Ltd

#### MATERIAL SAFETY DATA SHEET MSDS FILE No. (KURAMI WORKS) : 05-1225 (based on Form OSHA-174) IDENTITY ( AS Used on Label and List ) Product Class : Phosphor Bronze Strip Trade Name : JIS H3130 C5210R (Equivalent to ASTM B103 C52100) CAS No. : Copper: 7440-50-8, Tin: 7440-31-5, Phosphor: 7723-14-0 Chemical Composition Content(wt-%) CAS No. Tin(Sn) 7.0~9.0 7440-31-5 0.03~0.35 7723-14-0 Phosphor(P)Copper(Cu) 7440-50-8 Balance 99. 7≦ Sn+P+Cu Section I Manufacturer's Name Date Prepared NIKKO METAL MANUFACTURING CO., LTD. May 24th, 2005 KURAMI WORKS Signature of Person in Charge Chihiro Izumi Address IZUMI, Chihiro 3 Kurami Samukawa-cho Kouza-gun Kanagawa prefecture Senior Technical Supervisor, Quality Assurance 253-0101 JAPAN Signature of Person Responsible Telephone Number for Information (Quality Assurance) Unook Watarate +81-467-75-7285 WATANABE, Hiroaki Facsimile Number for Information (Quality Assurance) +81-467-74-6971 Manager, Quality Assurance Section Section Π Hazardous Ingredients / Identity Information Hazardous Components (Specific Chemical Identity : Names OSHA Pel ACGIH TLV

## Nothing for ordinary service condition

	·····				
Section III		Characteristic			
Boiling Point	2630 °C for Copper	Specific Gravity	(H20 = 1)		
	<u>2275 °C</u> for Tin			8.80	
Vapor Pressure (mmHg)		Melting Point	1025 deg	. centi. for C521	0 Phosphor Bronze
	<u>N/A</u>			-	•
Vapor Density (Air = 1 )		Evaporation Rat	te (Butyl Ac	cetate = 1 )	
	N/A			N/A	
Solubility in Water					
	<u>N/A</u>				
Appearance and Odor					
	Brown -	Red (solid) :	<u>Odor –</u>	None	
Section IV	Fire_and Explosion Ha	izard Data			
Flash Point (Method Used	1)	Flammable Limit	ts	LEL	UEL
	N/A	N	I/A	N/A	N/A
Extinguishing Media					
	N/A ( stable , nonflam	imable substa	nce)		
Special Fire Fighting Proc	edures				
	Not specified				
Unusual Fire and Explosio	n Hazards				· · · · · · · · · ·
Metal proc	lucts do not present fi	re or explosio	n hazards	5	
under norr	<u>nal</u> conditions.				

Section	v	Reactivity Dat	a					
Stability	Unstable		Condi	tions to Avoid				
	Stable	×					· · · · · · · · · · · · ·	
Incompatibil	ity (Materials	to Avoid )	Noth	ing				
Hazardous [	Decompositio	n or Byproducts	Noth	ing				
Hazardous		May Occur		Conditions to	Avoid		-	
Polymerizati	on							
 Section	 VI	Will Not Occur Health Hazard	Nata	<u> </u>				<u>_</u>
Route(s) of			ation ?		Skin ?		Ingestion ?	
Health Haza	rdous (Acute	and Chronic)	N/A		<u>N//</u>	<u>A</u>	N/A	
<del>.,</del>	• • • • •		N/A					
Carcinogeni	citry :	NTP	? N/A	IARC I	Monographs N//		OSHA Regulated ' N/A	?
Signs and S	ymptoms of E	xposure	N/A					
Medical Con	ditions					···		
	gravated by		N/A					
Emergency	and First Aid	Procedures	<u>N/A</u>					
Section	VII	Precautions fo	r State	e Handling a	nd Use			
Steps to Be	Taken in Ca	se Material Is Relea			N/A			
Waste Dispo	sal Method							
		Coll	ect scr	ap for reme	lting.			
<u>For Har</u> ∙Put saf ∙Wear sa	<u>ndling</u> ety gloves afety glasse		our har owders	s or chips ar			ght cut your hand nerated in the wo	
For Sto			_	-				
		of stocking area ent from rusting			m acid, all	kali, chlorid	e, sulfide and oth	er corrosive
Other Preca	utions							
		No :	special	requirement	S			
Section	VIII	Control Measu	res				·	
Wearing		specify Type) recommended i	n the w	vork such as	abrasion	and buffing	g which generates	s metal
Ventilation		Local Exhaust		`	Special			
		Non				None		
		Mechanical (Gene Non			Other	None		
Protective C	loves	L	<u> </u>			Hono		
Put safety	gloves on	to protect your	hands	from edges	of coils w	hich might	cut your hands.	
Eye Protect Wear safe		when metal pow	der is d	expected to	be genera	ated in the	work.	
Other Prote	ctive Clothing	g or Equipment						
	enic Practice	<u>when handling h</u> s	eavy C	UIIŞ				
		Non	e					
Influence to	environment	Saln	nogaird		38 ~ 0.8	ppm		
			LIAS LA	tipes : 2.1	·~ 24pp	111		

# Material Safety Data Sheet

- 1. Manufacturer
- Company HARADA Metal Industry Co., Ltd.
- Address 10-18 Sasamekitamati, Toda, Saitama 335-0033, Japan
  - TEL 048-422-1588
  - FAX 048-449-6303
- Counter

The domestic business department business primary and second section

- TEL 048-441-5115
- FAX 048-444-9104

The domestic business department OSAKA service office

- TEL 06-531-8094
- FAX 06-531-8096

The domestic business department NAGOYA service office

- TEL 052-821-9778
- FAX 052-822-7500

The overseas business department export section

TEL 048-441-5115

FAX 048-444-9104

- Urgent place to contact

The quality assurance department

TEL 048-422-1588

FAX 048-449-6303

### 2. Products

- Phosphor bronze plates and strips for springs
- Phosphor bronze plates and strips

- 3. Specification of the material
- The division of mixture or single product : Single product
- · The chemical name : Copper alloy
- · Chemical composition and content rate( wt.%)

		CAS No.					
Element	C5210	C5212	C5191	C5102	C5111		
Copper	rem.	rem.	rem.	rem.	rem.	7440-50-8	
Tin	7.0~9.0	7.0~9.0	5.5~7.0	4.5~5.5	3.5~4.5	7440-31-5	
Phosphorus	0.03~0.35	0.03~0.35	0.03~0.35	0.03~0.35	0.03~0.35	7723-14-0	
Lead	0.05 max	7439-92-1					
Iron	0.1 max	7439-89-6					
Zinc	0.2 max	7440-66-6					

- 4. Classification of harmfulness
- The name of classification : Not classified into the dangerous harmfulness material.
- The danger : No knowledge
- The harmfulness : No knowledge
- The effect for the environment : No knowledge

### 5. First aid

- Eyes : Flush the water. Consult the doctor, when the simulation of the eye continues.
- · Skin : Flush the water.
- Inhalation : Consult the doctor, when it was large inhaled.

#### 6. The treatment in the fire

- Nonflammable.

7. Leakage

- Not applied (because of solid)
- 8. Attention in handling and storage
- Stored at the ordinary—temperature and usual humidity.
- Prohibition of the rapid temperature and humidity change.

- 9. Treatment on the exposure prevention
- · Standard control concentration : Not regulated.
- Allowable temperature : Not regulated.
- · Facility countermeasure : The whole ventilation is desirable.
- Protector : For lung ,the wear of protection mask is desirable for the power handling.

For hand ,the wear of protective glove is desirable.

For eyes ,the wear of safety goggles is desirable for the power handling.

For body , the wear of protective clothing is desirable.

#### 10. Physical and chemical characteristic

- Appearance and smell : The solid with the metallic luster. Odoless.
- · Boiling point : The indistinctness.
- · Solubility : Dissolves in the inorganic acid.

	C5210	C5212	C5191	C5102	C5111
Specific gravity	8.82	8.82	8.85	8.88	8.90
Melting point	1020°C	1020°C	1045°C	1050°C	1060°C

- 11. Information for danger
- Fire point : The indistinctness.
- · Stability : Show the stability at room temperature and in the air.

#### 12. Information for harmfulness

- The powder stimulates eyes , skin and bronchi.
- Produce the ulcer and the hepatic disorder rarely.
- 13. Information for environment
- No knowledge.

14. Attention for scrapping

· Possible to deal with ,as an industrial waste.

15. Attention for transportation

• No damage transportation is desirable.

16. Applying act

• —