

Date:

November 15, 2004

Federal Communications Commission Via: Electronic Filing

Attention:

Applicant: Equipment: FCC ID: FCC Rules: Kenwood USA Corporation TK-3170-K, TK-3170-K4 and TK-3173-K ALH34713110 22, 74, 90, 90.210, 95, Confidentiality

Authorization & Evaluation Division

Gentlemen:

On behalf of the Applicant, enclosed please find Application Form 731, Engineering Test Report and all pertinent documentation, the whole for approval of the referenced equipment as shown.

Filing fees are attached.

We trust the same is in order. Should you need any further information, kindly contact the writer who is authorized to act as agent.

Sincerely yours,

David E. Lee, Compliance Test Manager

enclosure(s) cc: Applicant DEL/ca





Chandler, AZ 85225

fax: (480) 926-3598

info@mflom.com

# Transmitter Certification

of

FCC ID: ALH34713110 Model: TK-3170-K, TK-3170-K4 and TK-3173-K

to

## **Federal Communications Commission**

Rule Parts 22, 74, 90, 90.210, 95, Confidentiality

Date of report: November 15, 2004

On the Behalf of the Applicant:

Kenwood USA Corporation

At the Request of:

P.O. UPS 9/10/2004

Kenwood USA Corporation **Communications Division** 3975 Johns Creek Court, Suite 300 Suwanee, GA 30024

Attention of:

Joel E. Berger, Research & Development JBerger@kenwoodusa.com (678) 474-4722; FAX: -4731

David E. Lee, Compliance Test Manager

Supervised by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

FCC ID: ALH34713110 MFA p0490010, d04b0032



# List of Exhibits

(FCC Certification (Transmitters) - Revised 9/28/98)

Kenwood USA Corporation

FCC ID:

ALH34713110

## By Applicant:

- 1. Letter of Authorization
- 2. Confidentiality Request: 0.457 And 0.459
- 3. Part 90.203(e) & (g) Attestation
- 4. Identification Drawings, 2.1033(c)(11) Label Location of Label Compliance Statement Location of Compliance Statement
- 5. Photographs, 2.1033(c)(12)
- 6. Documentation: 2.1033(c)
  - (3) User Manual
  - (9) Tune Up Info
  - (10) Schematic Diagram
  - (10) Circuit Description Block Diagram Parts List/Active Devices

7. SAR Report

By M.F.A. Inc.:

A. Testimonial & Statement of Certification



# The Applicant has been cautioned as to the following:

#### 15.21 Information to the User.

The users manual or instruction manual for an intentional radiator shall caution the user that changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

#### 15.27(a) Special Accessories.

Equipment marketed to a consumer must be capable of complying with the necessary regulations in the configuration in which the equipment is marketed. Where special accessories, such as shielded cables and/or special connectors are required to enable an unintentional or intentional radiator to comply with the emission limits in this part, the equipment must be marketed with, i.e. shipped and sold with, those special accessories. However, in lieu of shipping or packaging the special accessories with the unintentional or intentional radiator, the responsible party may employ other methods of ensuring that the special accessories are provided to the consumer, without additional charge.

Information detailing any alternative method used to supply the special accessories for a grant of equipment authorization or retained in the verification records, as appropriate. The party responsible for the equipment, as detailed in § 2.909 of this chapter, shall ensure that these special accessories are provided with the equipment. The instruction manual for such devices shall include appropriate instructions on the first page of text concerned with the installation of the device that these special accessories must be used with the device. It is the responsibility of the user to use the needed special accessories supplied with the equipment.



# **Table of Contents**

Rule	Description	Page
2.1033(c)(14)	Rule Summary	2
	Standard Test Conditions and Engineering Practices	3
2.1046(a)	Carrier Output Power (Conducted)	8
2.1046(a)	ERP Carrier Power (Radiated)	10
2.1051	Unwanted Emissions (Transmitter Conducted)	12
2.1053(a)	Field Strength of Spurious Radiation	14
2.1049(c)(1)	Emission Masks (Occupied Bandwidth)	18
90.214	Transient Frequency Behavior	25
2.1047(a)	Audio Low Pass Filter (Voice Input)	31
2.1047(a)	Audio Frequency Response	33
2.1047(b)	Modulation Limiting	35
2.1055(a)(1)	Frequency Stability (Temperature Variation)	38
2.1055(b)(1)	Frequency Stability (Voltage Variation)	40
2.202(g)	Necessary Bandwidth and Emission Bandwidth	42



Required information per ISO/IEC Guide 25-1990, paragraph 13.2:

a)	Test Report
b) Laboratory: (FCC: 31040/SIT)	M. Flom Associates, Inc. 3356 N. San Marcos Place, Suite 107 Chandler, AZ 85225
c) Report Number:	d04b0032
d) Client:	Kenwood USA Corporation Communications Division 3975 Johns Creek Court, Suite 300 Suwanee, GA 30024
e) Identification:	TK-3170-K, TK-3170-K4 and TK-3173-K FCC ID: ALH34713110
EUT Description:	UHF FM Handheld Transceiver
f) EUT Condition:	Not required unless specified in individual tests.
g) Report Date: EUT Received:	November 15, 2004 September 10, 2004
h, j, k):	As indicated in individual tests.
i) Sampling method:	No sampling procedure used.
I) Uncertainty:	In accordance with MFA internal quality manual.
m) Supervised by:	David E. Lee,

David E. Lee, Compliance Test Manager

n) Results:

o) Reproduction:

The results presented in this report relate only to the item tested.

This report must not be reproduced, except in full, without written permission from this laboratory.



Sub-part <u>2.1033(c)(14)</u>:

## **Test and Measurement Data**

All tests and measurement data shown were performed in accordance with FCC Rules and Regulations, Volume II; Part 2, Sub-part J, Sections 2.947, 2.1033(c), 2.1041, 2.1046, 2.1047, 2.1079, 2.1051, 2.1053, 2.1055, 2.1057 and the following individual Parts:

- 21 Domestic Public Fixed Radio Services
- X 22 Public Mobile Services
- 22 Subpart H Cellular Radiotelephone Service
- 22.901(d) Alternative technologies and auxiliary services
  - 23 International Fixed Public Radiocommunication services
- 24 Personal Communications Services
- X 74 Subpart H Low Power Auxiliary Stations
- 80 Stations in the Maritime Services
- 80 Subpart E General Technical Standards
- 80 Subpart F Equipment Authorization for Compulsory Ships
- 80 Subpart K Private Coast Stations and Marine Utility Stations
- 80 Subpart S Compulsory Radiotelephone Installations for Small Passenger Boats
- 80 Subpart T Radiotelephone Installation Required for Vessels on the Great Lakes
- 80 Subpart U Radiotelephone Installations Required by the Bridge-to-Bridge Act
- 80 Subpart V Emergency Position Indicating Radio Beacons (EPIRB'S)
- 80 Subpart W Global Maritime Distress and Safety System (GMDSS)
- 80 Subpart X Voluntary Radio Installations
- 87 Aviation Services
- X 90 Private Land Mobile Radio Services
- 94 Private Operational-Fixed Microwave Service
- X 95 Subpart A General Mobile Radio Service (GMRS)
- 95 Subpart C Radio Control (R/C) Radio Service
- 95 Subpart D Citizens Band (CB) Radio Service
- 95 Subpart E Family Radio Service
- 95 Subpart F Interactive Video and Data Service (IVDS)
- 97 Amateur Radio Service
- 101 Fixed Microwave Services



# Standard Test Conditions and Engineering Practices

Except as noted herein, the following conditions and procedures were observed during the testing:

In accordance with ANSI C63.4-1992/2001, section 6.1.9, and unless otherwise indicated in the specific measurement results, the ambient temperature of the actual EUT was maintained within the range of 10° to 40°C (50° to 104 °F) unless the particular equipment requirements specify testing over a different temperature range. Also, unless otherwise indicated, the humidity levels were in the range of 10% to 90% relative humidity.

Prior to testing, the EUT was tuned up in accordance with the manufacturer's alignment procedures. All external gain controls were maintained at the position of maximum and/or optimum gain throughout the testing.

Measurement results, unless otherwise noted, are worst-case measurements.







# A2LA

"A2LA has accredited M. Flom Associates, Inc. Chandler, AZ for technical competence in the field of Electrical Testing. The accreditation covers the specific tests and types of tests listed on the agreed scope of accreditation. This laboratory meets the requirements of ISO/IEC 17025 – 1999 'General Requirements for the Competence of Testing and Calibration Laboratories' and any additional program requirements in the identified field of testing."

Certificate Number: 2152-01

# NIST

I am pleased to inform you that your laboratory has been validated by the Chinese Taipei Bureau of Standards, Metrology and Inspection (BSMI) under the Asia Pacific Economic Cooperation Mutual Recognition Agreement (APEC MRA). Your laboratory is now formally designated to act as a Conformity Assessment Body (CAB) under Appendix B, Phase I Procedures, of the APEC MRA between the American Institute in Taiwan (AIT) and the Taipei Economic and Cultural Representative Office (TECRO) in the United States, covering equipment subject to Electro-Magnetic Compatibility (EMC) requirements. The names of all validated and nominated laboratories will be posted on the NIST website at http://ts.nist.gov/mra under the 'Asia' category."

BSMI Number: SL2-IN-E-041R

M. Flom Associates, Inc.
3356 North San Marcos Place, Suite 107
Chandler, Arizona 85225-7176
(480) 926-3100 phone, (480) 926-3598 fax

Page 4 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



# List of General Information Required for Certification

In Accordance with FCC Rules and Regulations, Volume II, Part 2 and to

22, 74, 90, 90.210, 95, Confidentiality

Sub-part 2.1033 (c)(1): Name and Address of Applicant:

> Kenwood USA Corporation Communications Division 3975 Johns Creek Court, Suite 300 Suwanee, GA 30024

#### Manufacturer:

Kenwood Electronics Technologies PTE Ltd. 1 Ang Mo Kio Street 63 Singapore 569110

ALH34713110

16K0F3E, 11K0F3E

450 to 490

Passes

TK-3170-K, TK-3170-K4 and TK-3173-K

Х

(c)(2): **FCC ID**:

Model Number:

(c)(3): Instruction Manual(s):

Please see attached exhibits

- (c)(4): Type of Emission:
- (c)(5): Frequency Range, MHz:

 (c)(6):
 Power Rating, Watts:
 1 to 4

 Switchable
 X
 Variable
 N/A

 (c)(7):
 Maximum Power Rating, Watts:
 300

DUT Results:

M. Flom Associates, Inc.
3356 North San Marcos Place, Suite 107
Chandler, Arizona 85225-7176
(480) 926-3100 phone, (480) 926-3598 fax

Fails



# Information for Push-To-Talk Devices

Type and number of antenna to be used for this device: Helical Whip Antenna, broadband and sub-band
Maximum antenna gain for antenna indicated above: OdBd
Can this device sustain continuous operation with respect to its hardware capabilities and allowable operating functions? No
Other hardware or operating restrictions that could limit a person's RF Exposure: Timeout timer
Source-based time-averaging (see 2.1093 of rules) applicable to reduce the average output power: No
If device has headset and belt-clip accessories that would allow body-worn operations, what is the minimum separation distance between the antenna and the user's body in this operating configuration? Yes
Can device access wire-line services to make phone calls, either directly or through an operator? No
Can specific operating instructions be given to users to eliminate any potential RF Exposure concerns for both front-of-the-face and body-worn operating configurations? Yes - In the User Manual
Other applicable information the applicant may provide that can serve as effective means for ensuring RF Exposure compliance:

osure compliance: Yes - Training as per Users Manual



#### Subpart 2.1033 (continued)

(c)(8): Voltages & currents in all elements in final RF stage, including final transistor or solid-state device:

Collector Current, A	=	1.7
Collector Voltage, Vdc	=	6.0
Supply Voltage, Vdc	=	7.5

#### (c)(9): **Tune-Up Procedure**:

Please see attached exhibits

#### (c)(10): Circuit Diagram/Circuit Description:

Including description of circuitry & devices provided for determining and stabilizing frequency, for suppression of spurious radiation, for limiting modulation and limiting power.

Please see attached exhibits

#### (c)(11): Label Information:

Please see attached exhibits

(c)(12): Photographs:

Please see attached exhibits

### (c)(13): Digital Modulation Description:

\_\_\_\_ Attached Exhibits \_X\_ N/A

(c)(14): Test and Measurement Data:

Follows




Name of Test:	Carrier Output Power (Conducted)
Specification:	47 CFR 2.1046(a)
Guide:	ANSI/TIA/EIA-603-1992, Paragraph 2.2.1

#### Measurement Procedure

A) The EUT was connected to a resistive coaxial attenuator of normal load impedance, and the unmodulated output power was measured by means of an RF Power Meter.

B) Measurement accuracy is ±3%.

#### Transmitter Test Set-Up: RF Power Output

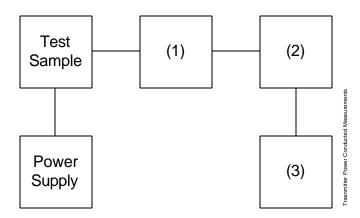

	Asset	Description	s/n	Cycle	Last Cal
(1) X	Coaxial i00231/2 i00122/3	Attenuator PASTERNACK PE7021-30 (30 dB) NARDA 766 (10 dB)	231 or 232 7802 or 7802A	NCR NCR	
(2) X	<b>Power M</b> i00020	Meters HP 8901A Power Mode	2105A01087	12 mo.	Apr-04
(3) X	Frequei	<b>ncy Counter</b> HP 8901A Frequency Mode	2105A01087	12 mo.	Apr-04



## Carrier Output Power (Conducted)

## Measurement Results

(Worst case)

Frequency of Car Ambient Tempera		= =	470.05, 450.05, 489.95 23°C ± 3°C
Power Setting	RF Power, dBm		RF Power, Watts
Low	30.0		1.000
High	36.4		4.365

Performed by:

M. Flom Associates, Inc.
3356 North San Marcos Place, Suite 107
Chandler, Arizona 85225-7176
(480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

> Page 9 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



Name of Test:	ERP Carrier Power (Radiated)
Specification:	TIA/EIA 603A (Substitution Method)


#### **Measurement Procedure**

#### Definition

The average radiated power of a licensed device is the equivalent power required, when delivered to a halfwave dipole or horn antenna, to produce at a distant point the same average received power as produced by the licensed device.

#### Method of Measurement:

A) Connect the equipment as illustrated. Place the transmitter to be tested on the turntable in the standard test site.

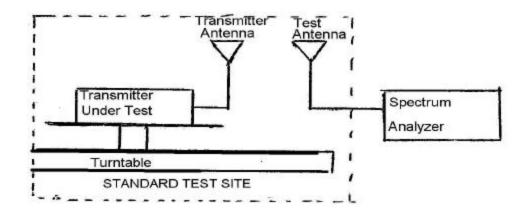

- B) Raise and lower the test antenna from 1m to 6 m with the transmitter facing the antenna and record the highest received signal in dB as LVL.
- C) Repeat step B) for seven additional readings at 45° interval positions of the turntable.
- D) Replace the transmitter under test with a half-wave or horn vertically polarized antenna. The center of the antenna should be at the same location as the transmitter under test. Connect the antenna to a signal generator with a known output power and record the path loss in dB or LOSS.
- E) Calculate the average radiated output power from the readings in step C) and D) by the following:

average radiated power =  $10 \log_{10} \acute{O} 10(LVL - LOSS)/10 (dBm)$ 



ERP Carrier Power (Radiated)

#### **Test Equipment**

	Asset	Description	s/n	Cycle	Last Cal
Tra	nsducer				
	i00088	EMCO 3109-B 25MHz-300MHz	2336	24 mo.	Sep-03
Х	i00089	Aprel 2001 200MHz-1GHz	001500	24 mo.	Sep-03
Х	i00103	EMCO 3115 1GHz-18GHz	9208-3925	24 mo.	Jan-04
Am	plifier				
Х	i00028	HP 8449A	2749A00121	12 mo.	May-04
Spe	ctrum Anal	yzer			
Х	i00029	HP 8563E	3213A00104	12 mo.	May-04
Х	i00033	HP 85462A	3625A00357	12 mo.	Jul-04
Sub	stitution Ge	enerator			
Х	i00067	HP 8920A Communication TS	3345U01242	12 mo.	Jun-04
	i00207	HP 8753D Network Analyzer	3410A08514	12 mo.	Jul-04

#### Measurement Results

	450.100000 MHz		470.100000 MHz		489.900000 MHz	
	LVL,	Path Loss, db	LVL,	Path Loss, db	LVL,	Path Loss, db
	dbm		dbm		dbm	
0°	38.7		38.4		39.1	
45°	38.3		38.8		38.5	
90°	38.7		39.0		38.2	
135°	38.2	Subtract 2.0	38.3	Subtract 1.5	38.9	Subtract 1.8
180°	39.0		38.4		38.7	
225°	38.7		39.0		38.0	
270°	37.8		39.2		37.5	
315°	38.1		38.7		37.5	
		450.10	00000 MHZ	470.100000 M	Hz	489.900000 MHz
Av.	Radiated Power	r: 36.	44dbm	37.23dbm		36.50dbm

Performed by:

Samir Mahmoud, Test Tehnician



Name of Test:	Unwanted Emissions (Transmitter Conducted)
Specification:	47 CFR 2.1051
Guide:	ANSI/TIA/EIA-603-1992, Paragraph 2.2.13

#### **Measurement Procedure**

- A) The emissions were measured for the worst case as follows:
  - 1). within a band of frequencies defined by the carrier frequency plus and minus one channel.
  - 2). from the lowest frequency generated in the EUT and to at least the 10th harmonic of the carrier frequency, or 40 GHz, whichever is lower.
- B) The magnitude of spurious emissions that are attenuated more than 20 dB below the permissible value need not be specified.

Test (1) (2)(3) Sample Emissi Spurious Power (4) Supply Description Asset s/n (1) Audio Oscillator/Generator i00017 Apr-04 HP 8903A Audio Analyzer 2216A01753 12 mo. i00002 HP 3336B Synthesizer / Level Gen. 1931A01465 12 mo. Apr-04 (2) Coaxial Attenuator NCR X i00231/2 PASTERNACK PE7021-30 (30 dB) 231 or 232 i0012/3 NARDA 766 (10 dB) 7802 or 7802A NCR (3) Filters; Notch, HP, LP, BP None required (4) Spectrum Analyzer i00048 HP 8566B Spectrum Analyzer Oct-04 2511A01467 12 mo. i00029 12 mo. May-04 3213A00104 HP 8563E Spectrum Analyzer

#### Transmitter Test Set-Up: Spurious Emission

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Х

Х



Unwanted Emissions (Transmitter Conducted)

#### Measurement Results (Worst Case)

#### Summary:

Frequency of carrier, MHz	=	470.05, 450.05, 489.95
Spectrum Searched, GHz	=	0 to 10 x $F_{C}$
Maximum Response, Hz	=	2820
Limit, Worst Case: 4W, 12.5kHz Channel (As applied to 1W, 12.5kHz Channel)		≥ 56.02 dBc ≥ 26.02 dBm

#### **Measurement Results**

All readings less than -46.02dBm for high and low power, narrow and wide band.

Samir Mahmoud, Test Technician

> Page 13 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032

Performed by:



Name of Test:	Field Strength of Spurious Radiation
Specification:	47 CFR 2.1053(a)
Guide:	ANSI/TIA/EIA-603-1992/2001, Paragraph 1.2.12 and Table 16, 47 CFR 22.917


#### **Measurement Procedure**

#### Definition:

Radiated spurious emissions are emissions from the equipment when transmitting into a non-radiating load on a frequency or frequencies, which are outside an occupied band sufficient to ensure transmission of information of required quality for the class of communications desired.

#### Method of Measurement:


- A) Connect the equipment as illustrated
- B) Adjust the spectrum analyzer for the following settings:
  - 1) Resolution Bandwidth 100 kHz (<1 GHZ), 1 MHZ (> 1GHz).
    - 2) Video Bandwidth = 3 times Resolution Bandwidth, or 30 kHz (22.917)
    - 3) Sweep Speed ≤2000 Hz/second
  - 4) Detector Mode = Mean or Average Power
  - C) Place the transmitter to be tested on the turntable in the standard test site. The transmitter is transmitting into a non-radiating load that is placed on the turntable. The RF cable to this load should be of minimum length.

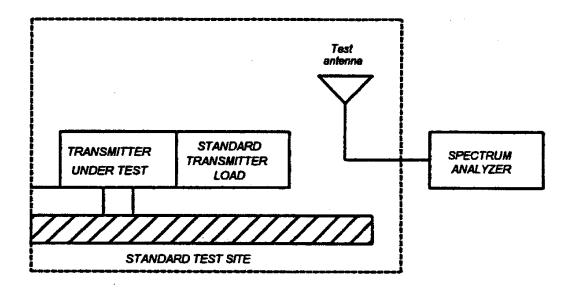



## Name of Test: Field Strength of Spurious Radiation (Cont.)

- D) For each spurious measurement the test antenna should be adjusted to the correct length for the frequency involved. This length may be determined from a calibration ruler supplied with the equipment. Measurements shall be made from the lowest radio frequency generated in the equipment to the tenth harmonic of the carrier, except for the region close to the carrier equal to  $\pm$  the test bandwidth (see section 1.3.4.4).
- E) For each spurious frequency, raise and lower the test antenna from 1 m to 4 m to obtain a maximum reading on the spectrum analyzer with the test antenna at horizontal polarity. Repeat this procedure to obtain the highest possible reading. Record this maximum reading.
- F) Repeat step E) for each spurious frequency with the test antenna polarized vertically.

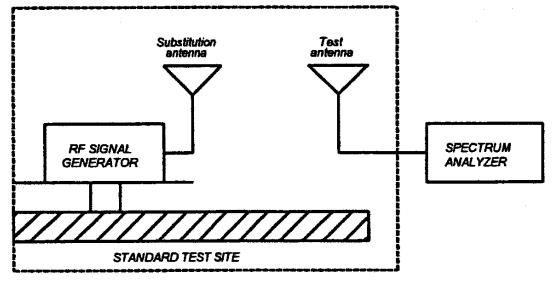

G) Reconnect the equipment as illustrated.

- H) Keep the spectrum analyzer adjusted as in step B).
- I) Remove the transmitter and replace it with a substitution antenna (the antenna should be halfwavelength for each frequency involved). The center of the substitution antenna should be approximately at the same location as the center of the transmitter. At lower frequencies, where the substitution antenna is very long, this will be impossible to achieve when the antenna is polarized vertically. In such case the lower end of the antenna should be 0.3 m above the ground.



#### Name of Test: Field Strength of Spurious Radiation (Cont.)

- J) Feed the substitution antenna at the transmitter end with a signal generator connected to the antenna by means of a non-radiating cable. With the antennas at both ends horizontally polarized and with the signal generator tuned to a particular spurious frequency, raise and lower the test antenna to obtain a maximum reading at the spectrum analyzer. Adjust the level of the signal generator output until the previously recorded maximum reading for this set of conditions is obtained. This should be done carefully repeating the adjustment of the test antenna and generator output.
- K) Repeat step J) with both antennas vertically polarized for each spurious frequency.
- L) Calculate power in dBm into a reference ideal half-wave dipole antenna by reducing the readings obtained in steps J) and K) by the power loss in the cable between the generator and the antenna and further corrected for the gain of the substitution antenna used relative to an ideal half-wave dipole antenna.
- M) The levels recorded in step L) are absolute levels of radiated spurious emissions in dBm. The radiated spurious emissions in dB can be calculated by the following:

Radiated spurious emissions dB =

#### 10log<sub>10</sub>(TX power in watts/0.001) - the levels in step I)

NOTE: It is permissible that other antennas provided can be referenced to a dipole.

#### **Test Equipment**

	Asset	Description s/n Cycle Las			
Tra	nsducer				
	i00088	EMCO 3109-B 25MHz-300MHz	2336	24 mo.	Sep-03
Х	i00089	Aprel 2001 200MHz-1GHz	001500	24 mo.	Sep-03
Х	i00103	EMCO 3115 1GHz-18GHz	9208-3925	24 mo.	Jan-04
Am	plifier				
Х	i00028	HP 8449A	2749A00121	12 mo.	May-04
Spe	ctrum Anal	lyzer			
Х	i00029	HP 8563E	3213A00104	12 mo.	May-04
Х	i00033	HP 85462A	3625A00357	12 mo.	Sep-04
Sub	stitution G	enerator			
Х	i00067	HP 8920A Communication TS	3345U01242	12 mo.	Jun-04
	i00207	HP 8753D Network Analyzer	3410A08514	12 mo.	Jul-04
N A : -		stores Dort and Cabling			
INIC	ropnone, A	Intenna Port, and Cabling			

Microphone	Yes	Cable Length 1.0	Meters
Antenna Port Terminated	Yes	Load 50 Ohm	Antenna Gain N/A
All Ports Terminated by Load	Yes	Peripheral No	



Field Strength of Spurious Radiation

#### **Measurement Results**

g0490029: 2004-Sep-29 Wed 15:38:00 STATE: 2:High Power / Narrowband

Ambient Temperature: 25°C ± 3°C

Frequency Tuned, MHz	Frequency Emission, MHz	ERP, dBm	ERP, dBc
450.100000	900.209500	-52.2	-88.6
450.100000	1350.300000	-45.6	-82.0
450.100000	1800.400300	-45.5	-81.9
450.100000	2250.500300	-39.8	-76.2
450.100000	2700.600300	-34.9	-71.3
450.100000	3150.700000	-31.5	-67.9
450.100000	3600.800000	-32.6	-69.0
450.100000	4050.900000	-25.0	-61.4
450.100000	4501.000000	-30.4	-66.8

M

Performed by:

Samir Mahmoud




Name of Test: Emission Masks (Occupied Bandwidth)

Specification: 47 CFR 2.1049(c)(1)

ANSI/TIA/EIA-603-1992, Paragraph 2.2.11 Guide:

#### **Measurement Procedure**

- A) The EUT and test equipment were set up as shown below
- B) For EUTs supporting audio modulation, the audio signal generator was adjusted to the frequency of maximum response and with output level set for  $\pm 2.5/\pm 1.25$  kHz deviation (or 50% modulation). With level constant, the signal level was increased 16 dB.
- C) For EUTs supporting digital modulation, the digital modulation mode was operated to its maximum extent.
- D) The Occupied Bandwidth was measured with the Spectrum Analyzer controls set as shown on the test results.

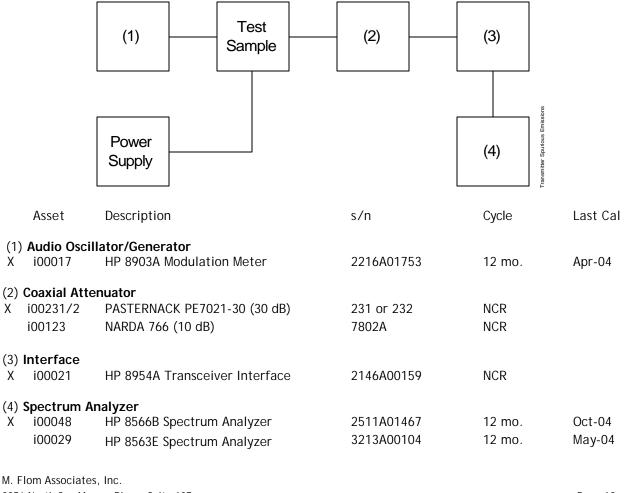

Transmitter Test Set-Up: Occupied Bandwidth

3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Х

Х

Х




Emission Masks (Occupied Bandwidth)

#### **Measurement Results**

g04a0204: 2004-Oct-07 Thu 09:55:00 State: 2:High Power

Ambient Temperature: 23°C ± 3°C

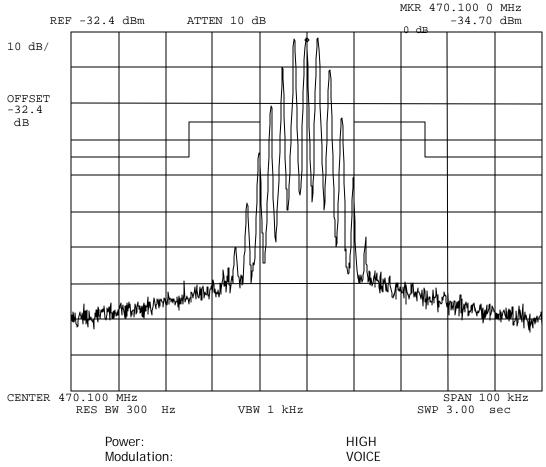

MASK: B, VHF/UHF 25kHz, w/LPF

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 19 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032




Emission Masks (Occupied Bandwidth)

#### **Measurement Results**

g04a0205: 2004-Oct-07 Thu 09:56:00 State: 2:High Power

Ambient Temperature: 23°C ± 3°C

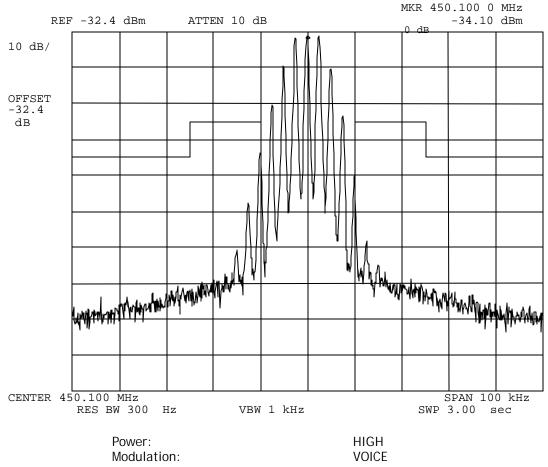

MASK: B, VHF/UHF 25kHz, w/LPF

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 20 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032




Emission Masks (Occupied Bandwidth)

#### **Measurement Results**

g04a0206: 2004-Oct-07 Thu 09:57:00 State: 2:High Power

Ambient Temperature: 23°C ± 3°C

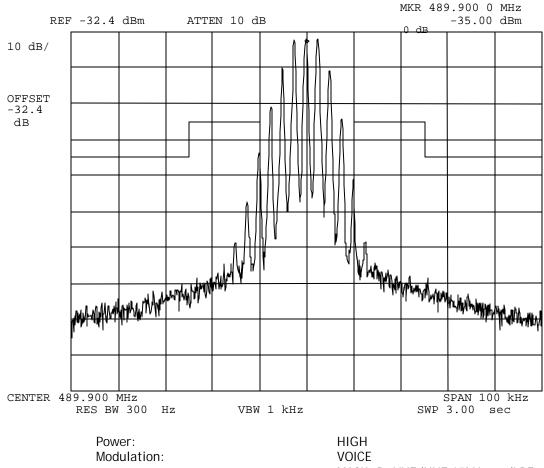

MASK: B, VHF/UHF 25kHz, w/LPF

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 21 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032




Emission Masks (Occupied Bandwidth)

#### **Measurement Results**

g04a0207: 2004-Oct-07 Thu 10:03:00 State: 2:High Power

Ambient Temperature: 23°C ± 3°C

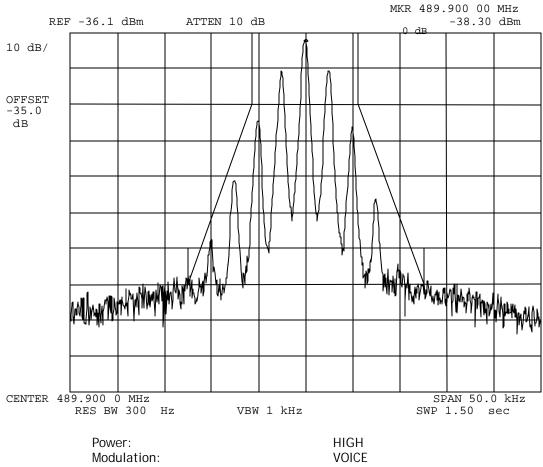

MASK: D, VHF/UHF 12.5kHz BW

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 22 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032




Emission Masks (Occupied Bandwidth)

#### **Measurement Results**

g04a0208: 2004-Oct-07 Thu 10:05:00 State: 2:High Power

Ambient Temperature: 23°C ± 3°C

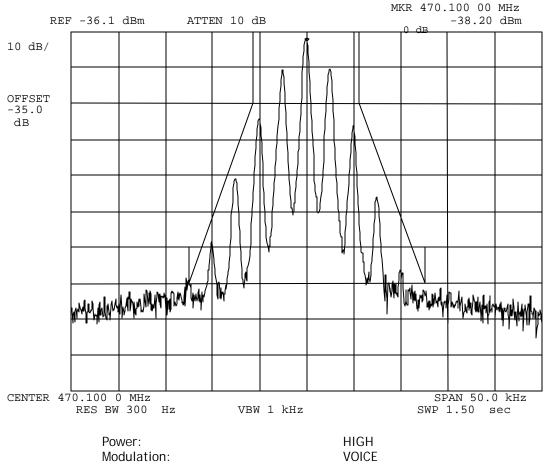

MASK: D, VHF/UHF 12.5kHz BW

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 23 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032




Emission Masks (Occupied Bandwidth)

#### **Measurement Results**

g04a0209: 2004-Oct-07 Thu 10:06:00 State: 2:High Power

Ambient Temperature: 23°C ± 3°C

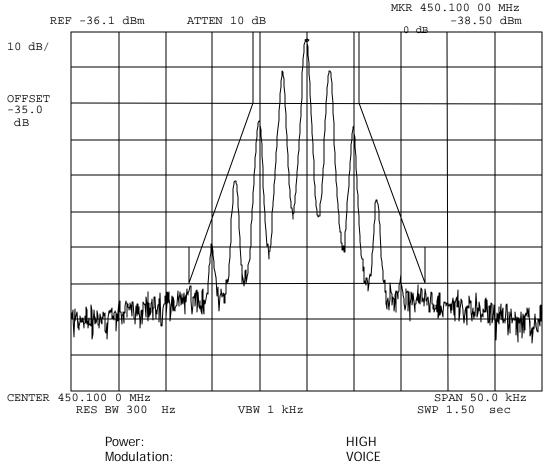

MASK: D, VHF/UHF 12.5kHz BW

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 24 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



Transient Frequency Behavior

Specification: 47 CFR 90.214

Guide: ANSI/TIA/EIA-603-1992, Paragraph 2.2.19

#### **Measurement Procedure**

- A) The EUT was setup as shown on the attached page, following TIA/EIA-603 steps a, b, and c as a *guide*.
- B) The transmitter was turned on.
- C) Sufficient attenuation was provided so that the transmitter carrier level measured at the output of the combiner was 40 dB below the maximum input level of the test receiver. This level was recorded.
- D) The transmitter was turned off.
- E) An RF signal generator (1) modulated with a 1 kHz tone at either 25, 12.5, or 6.25 kHz deviation, and set to the same frequency as the assigned transmitter frequency, (2) was adjusted to a level -20 dB below the level recorded for step C) above, measured at the output of the combiner. This level was then fixed for the remainder of the test.
- F) The oscilloscope was setup using TIA/EIA-603 steps j and k as a guide, and to either 10 ms/div (UHF) or 5 ms/div (VHF).
- G) The 30 dB attenuator was removed, the transmitter was turned on, and the level of the carrier at the output of the combiner was recorded.
- H) The <u>carrier on-time</u> as referenced in TIA/EIA-603 steps m, n, and o was captured and plotted. The <u>carrier off-time</u> as referenced in TIA/EIA-603 steps p, q, r, and s was captured and plotted.

Samir Mahmoud, Test Technician

Performed by:


M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Page 25 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



Transient Frequency Behavior



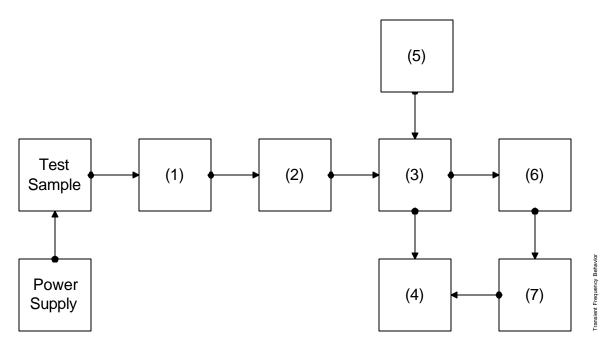


Asset	Description	s/n	Cycle	Last Cal
(1) <b>Attenuator</b> ( X i00231/2	Removed after 1st step) PASTERNACK PE7021-30 (30 dB)	231 or 232	NCR	
(2) Attenuator X i00231/2	PASTERNACK PE7021-30 (30 dB)	231 or 232	NCR	
(3) <b>Combiner</b> X i00154	4 x 25 $\Omega$ Combiner	154	NCR	
(4) Crystal Deco X i00159	der HP 8470B Crystal Detector	1822A10054	NCR	
(5) RF Signal Ge				
X i00067	HP 8920A Communication TS	3345U01242	12 mo.	Jun-04
(6) <b>Modulation /</b> X i00020	Analyzer HP 8901A Modulation Meter	2105A01087	12 mo.	Apr-04
(7) Oscilloscope X i00030	HP 54502A Digital Oscilloscope	2927A00209	12 mo.	Jan-04



**Transient Frequency Behavior** 

2004-Oct-04 Mon 11:56:00

Ambient Temperature: 23°C ± 3°C

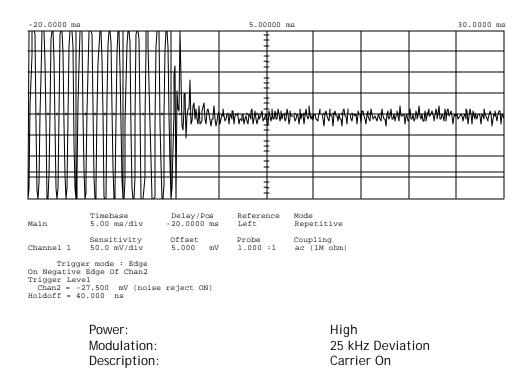

Performed by:

M. Flom Associates, Inc.
3356 North San Marcos Place, Suite 107
Chandler, Arizona 85225-7176
(480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician


> Page 27 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



**Transient Frequency Behavior** 

2004-Oct-04 Mon 12:14:00

Ambient Temperature: 23°C ± 3°C

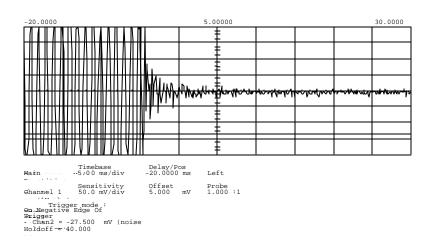

Power: Modulation: Description: High 12.5 kHz Deviation Carrier On

Samir Mahmoud, Test Technician

> Page 28 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032

Performed by:



**Transient Frequency Behavior** 

2004-Oct-04 Mon 14:28:00

Ambient Temperature: 23°C ± 3°C

-40.0000				-15.0	0000							1	0.0	000	00	
				-	-											
				-					Ĩ		T	Ī	Π	Π	Π	
				-							T	Π		Π	Γ	
									I	Π	Π	Ш	Π	T	Π	
Mamadarada	****	V V V V V VIV	d-damandar	www.~www	┇┍┲⋪┶╢┠╍┥ϻ ╴	and an and a second	- VOIMMAN	'M	Π	T	T	M	Π	Π	Π	
									Π		Π	M	Π	Π	Π	ľ
					-								Π	Π	T	
												$\mathbb{N}$	J	T	I	
Main Shannel 1	Timebase 5.00 ms Sensitiv 50.0 mV	/div -	Delay/Pos 40.0000 ms Offset 5.000 mV	Probe												
Trigg n Positive rigger Chan2 = - Coldoff = 4	-22.500 m	/ (noise r	eject													

Power: Modulation: Description: High 12.5 kHz Deviation Carrier Off

Sull 1

Samir Mahmoud, Test Technician

> Page 29 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032

Performed by:



Transient Frequency Behavior

2004-Oct-04 Mon 14:45:00

Ambient Temperature: 23°C ± 3°C

-40.000 ms -15.000 ms 10.000 ms

Power: Modulation: Description: High 25 kHz Deviation Carrier Off

Sud M

Samir Mahmoud, Test Technician

> Page 30 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032

Performed by:




Name of Test:	Audio Low Pass Filter (Voice Input)
Specification:	47 CFR 2.1047(a)
Guide:	ANSI/TIA/EIA-603-1992, Paragraph 2.2.15

#### **Measurement Procedure**

- A) The EUT and test equipment were set up such that the audio input was connected at the input to the modulation limiter, and the modulated stage.
- B) The audio output was connected at the output to the modulated stage.

#### Transmitter Test Set-Up: Response of Low Pass Filter

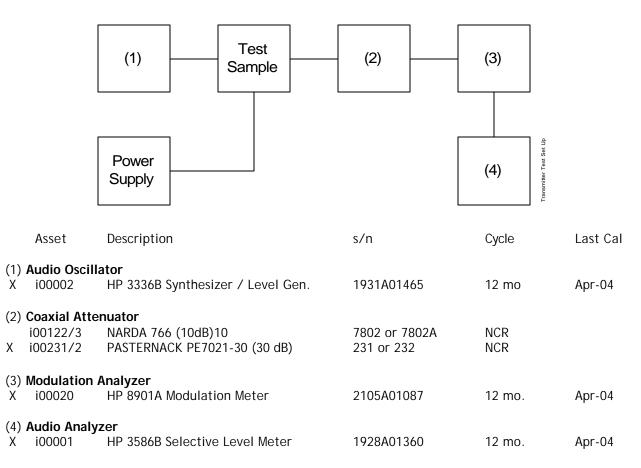




Audio Low Pass Filter (Voice Input)

## **Measurement Results**

g04a0107: 2004-Oct-07 Thu 09:31:00 State: 0:General

Ambient Temperature: 23°C ± 3°C

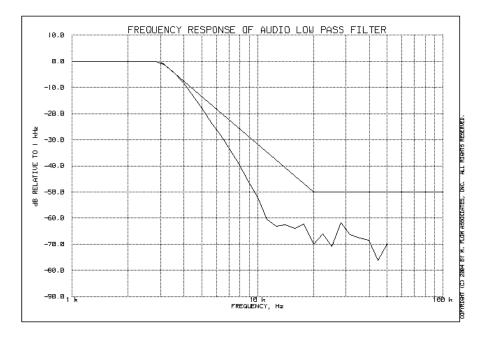

Performed by:

Samir Mahmoud, Test Technician

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Page 32 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



Specification: 47 CFR 2.1047(a)

Guide: ANSI/TIA/EIA-603-1992, Paragraph 2.2.6

#### **Measurement Procedure**

- A) The EUT and test equipment were set up as shown below.
- B) The audio signal generator was connected to the audio input circuit/microphone of the EUT.
- The audio signal input was adjusted to obtain 20% modulation at 1 kHz, and this point was taken as the C) 0 dB reference level.
- D) With input levels held constant and below limiting at all frequencies, the audio signal generator was varied from 100 Hz to 50 kHz.
- The response in dB relative to 1 kHz was measured, using the HP 8901A Modulation Meter. E)

	(1) Test Sample	(2)	(3)	
	Power Supply		(4) Transmitter Test Sat Up	
Asset	Description	s/n	Cycle	Last Cal
(1) Audio Oscill X i00017	ator HP 8903A Audio Analyzer	2216A01753	12 mo.	Apr-04
(2) <b>Coaxial Atte</b> i00122/3 X i00231/2	nuator NARDA 766-(10 dB) PASTERNACK PE7021-30 (30 dB)	7802 or 7802A 231 or 232	NCR NCR	
(3) Modulation X i00020	Analyzer HP 8901A Modulation Meter	2105A01087	12 mo.	Apr-04
(4) <b>Audio Analy</b> X i00017	zer HP 8903A Audio Analyzer	2216A01753	12 mo.	Apr-04

# Transmitter Test Set-Up: Audio Frequency Response

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax




Audio Frequency Response

### **Measurement Results**

g04a0106: 2004-Oct-07 Thu 09:27:00 State: 0:General

Ambient Temperature: 23°C ± 3°C

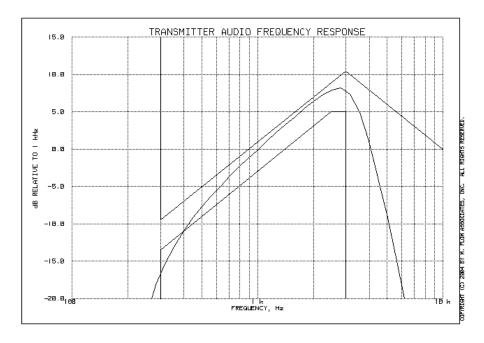

Frequency of Maximum Audio Response, Hz = 2820

# Additional points:

Frequency, Hz	Level, dB
300	-16.52
20000	-62.92
30000	-63.62
50000	-57.24

Samir Mahmoud, Test Technician

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax



Name of Test: Modulation Limiting

Specification: 47 CFR 2.1047(b)

Guide: ANSI/TIA/EIA-603-1992, Paragraph 2.2.3

#### **Measurement Procedure**

- A) The signal generator was connected to the input of the EUT as shown below.
- B) The modulation response was measured for each of three frequencies (one of which was the frequency of maximum response), and the input voltage was varied and was observed on an HP 8901A Modulation Analyzer.
- C) The input level was varied from 30% modulation (±1.5 kHz deviation) to at least 20 dB higher than the saturation point.
- D) Measurements were performed for both negative and positive modulation and the respective results were recorded.

	(1) Test Sample	(2)	(3)	
	Power Supply		(4) (4)	
Asset	Description	s/n		
Audio Oscill i00017	ator HP 8903A Audio Analyzer	2216A01753	12 mo.	Apr-04
Coaxial Atte	puator			
i0012/23 i00231/2	NARDA 766-(10 dB) PASTERNACK PE7021-30 (30 dB)	7802 or 7802A 231 or 232	NCR NCR	
Modulation	Analyzer			
i00020	HP 8901A Modulation Meter	2105A01087	12 mo.	Apr-04
Audio Analy	7er			
i00017	HP 8903A Audio Analyzer	2216A01753	12 mo.	Apr-04

# Transmitter Test Set-Up: Modulation Limiting

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

(1) X

(2)

Х

(3) X

(4) X




Modulation Limiting

# **Measurement Results**

g04a0103: 2004-Oct-07 Thu 09:11:00 State: 0:General 25kHz Channel

Ambient Temperature: 23°C ± 3°C

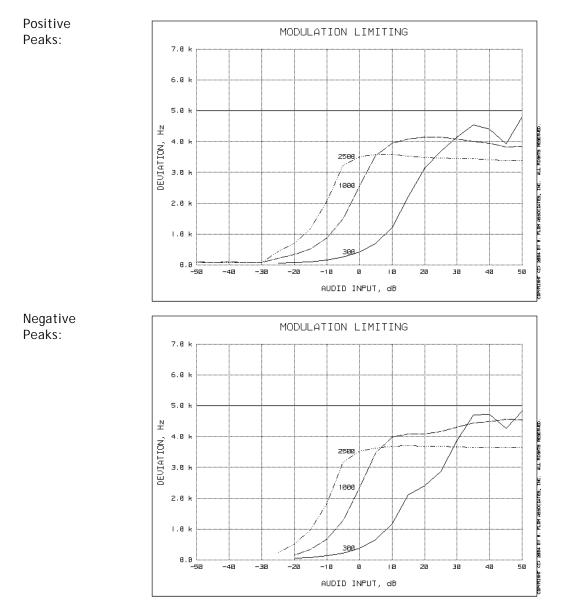

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 36 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032




Modulation Limiting

## **Measurement Results**

# g04a0105: 2004-Oct-07 Thu 09:18:00 State: 0:General 12.5 kHz Channel

#### Ambient Temperature: 23°C ± 3°C

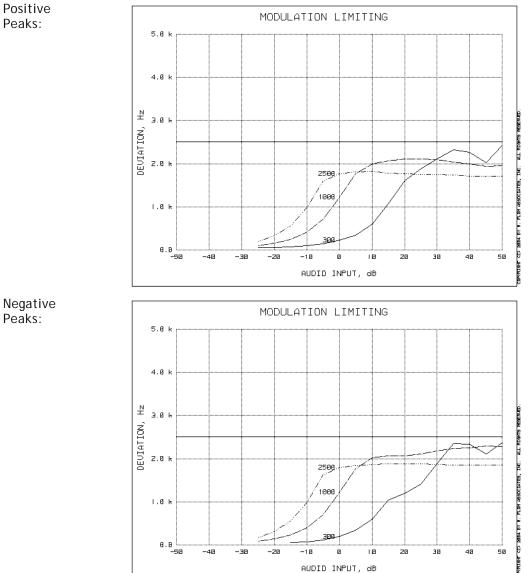

Peaks:

Samir Mahmoud, Test Technician

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Performed by:

Page 37 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



Name of Test:	Frequency Stability (Temperature Variation)
o 10 11	

**Specification**: 47 CFR 2.1055(a)(1)

Guide: ANSI/TIA/EIA-603-1992, Paragraph 2.2.2

#### **Measurement Procedure**

- A) The EUT and test equipment were set up as shown on the following page.
- B) With all power removed, the temperature was decreased to -30°C and permitted to stabilize for three hours. Power was applied and the maximum change in frequency was noted within one minute.
- C) With power OFF, the temperature was raised in 10°C steps. The sample was permitted to stabilize at each step for at least one-half hour. Power was applied and the maximum frequency change was noted within one minute.
- D) The temperature tests were performed for the worst case.

# Test Sample (2) (3) (1) Power Supply (4)

Transmitter Test Set-Up: Temperature Variation

	Power Supply	(4)	Transmiter Tes Set-Up	
Asset	Description	s/n	Cycle	Last Cal
(1) <b>Temperatu</b> X i00027	re, Humidity, Vibration Tenney Temp. Chamber	9083-765-234	NCR	
(2) <b>Coaxial Att</b> X i00231/2 i00122/3	enuator PASTERNACK PE7021-30 (30 dB) NARDA 766 (10 dB)	231 or 232 7802 or 7802A	NCR NCR	
(3) <b>RF Power</b> X i00067	HP 8920A Communications TS	3345U01242	12 mo.	Jun-04
(4) Frequency	Counter			

3345U01242

# X i00067 HP 8920A Communications TS

M. Flom Associates, Inc.
3356 North San Marcos Place, Suite 107
Chandler, Arizona 85225-7176
(480) 926-3100 phone, (480) 926-3598 fax

Jun-04

12 mo.



Frequency Stability (Temperature Variation)

# **Measurement Results**

470.1010 470.1005 470.1000 **X**30 40 -30 -20 -10 0 10 20 50 470.0995 470.0990

State:


Ambient Temperature: 23°C ± 3°C

Samir Mahmoud, Test Technician

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Page 39 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032

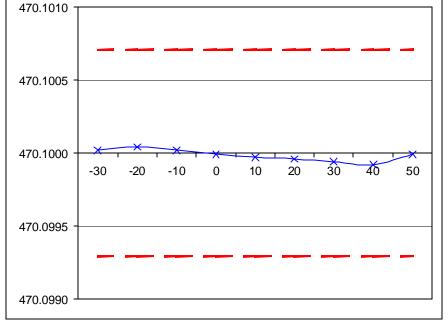




Name of Test:	Frequency Stability (Voltage Variation)
<b>Specification</b> :	47 CFR 2.1055(d)(1)

# Guide: ANSI/TIA/EIA-603-1992, Paragraph 2.2.2

#### **Measurement Procedure**

- A) The EUT was placed in a temperature chamber (if required) at 25±5°C and connected as shown below.
- B) The power supply voltage to the EUT was varied from 85% to 115% of the nominal value measured at the input to the EUT.
- C) The variation in frequency was measured for the worst case.

#### Transmitter Test Set-Up: Voltage Variation

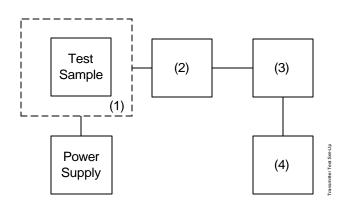

Asset	Description	s/n	Cycle	Last Cal
(1) <b>Temperatu</b> i00027	<b>re, Humidity, Vibration</b> Tenney Temp. Chamber	9083-765-234	NCR	
(2) Coaxial Att	enuator			
X i00231/2	PASTERNACK PE7021-30 (30 dB)	231 or 232	NCR	
i00122/3	NARDA 766 (10 dB)	7802 or 7802A	NCR	
(3) RF Power				
X i00020	HP 8901A Power Mode	2105A01087	12 mo.	Apr-04
(4) Frequency	Counter			
X i00020	HP 8901A Frequency Mode	2105A01087	12 mo.	Apr-04



# Frequency Stability (Voltage Variation)

g04a0210: 2004-Oct-11 Mon 14:50:55 State: 0:General

**Results**:

# Ambient Temperature: 23°C ± 3°C

Limit, ppm Limit, Hz Battery End Point (Voltage) = 1.5 = 705 = 6.3

% of STV	Voltage	Frequency, MHz	Change, Hz	Change, ppm
85	6.37	470.099970	-30	-0.55
100	7.50	470.099960	-40	-0.70
115	8.62	470.099960	-40	-0.70
84	6.30	470.099965	-35	-0.65

Performed by:

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

Samir Mahmoud, Test Technician

Page 41 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



Necessary Bandwidth and Emission Bandwidth

Specification:

47 CFR 2.202(g)

Modulation = 16K0F3E

Maximum Modulation (M), kHz	=	3
Maximum Deviation (D), kHz	=	5
Constant Factor (K)	=	1
Necessary Bandwidth (B <sub>N</sub> ), kHz	=	(2xM)+(2xDxK)
	=	16.0

Modulation = 11K0F3E

Necessary Bandwidth Calculation:
----------------------------------

Maximum Modulation (M), kHz Maximum Deviation (D), kHz Constant Factor (K) Necessary Bandwidth (B<sub>N</sub>), kHz = 3 = 2.5

- = 1
- = (2xM)+(2xDxK)

= 11.0

Performed by:

END OF TEST REPORT

M. Flom Associates, Inc. 3356 North San Marcos Place, Suite 107 Chandler, Arizona 85225-7176 (480) 926-3100 phone, (480) 926-3598 fax

91

Samir Mahmoud, Test Technician

> Page 42 of 42 FCC ID: ALH34713110 MFA p0490010, d04b0032



# Testimonial and Statement of Certification

This is to Certify:

- 1. **That** the application was prepared either by, or under the direct supervision of, the undersigned.
- 2. **That** the technical data supplied with the application was taken under my direction and supervision.
- 3. **That** the data was obtained on representative units, randomly selected.
- 4. **That**, to the best of my knowledge and belief, the facts set forth in the application and accompanying technical data are true and correct.

David E. Lee, Compliance Test Manager

Certifying Engineer:

M. Flom Associates, Inc.
3356 North San Marcos Place, Suite 107
Chandler, Arizona 85225-7176
(480) 926-3100 phone, fax (480) 926-3598