



Report No.: SZEM180500434405 Page: 481 of 641



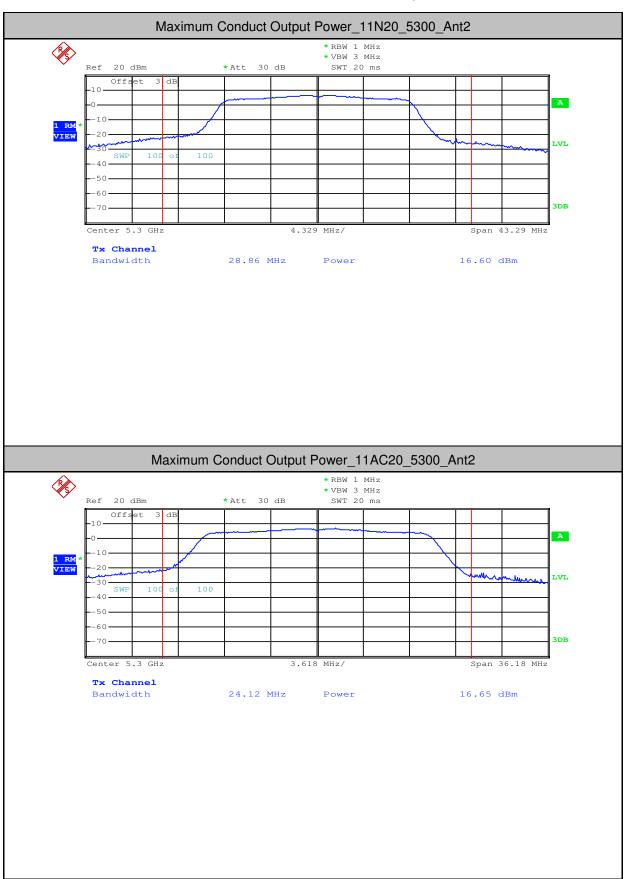


Report No.: SZEM180500434405 Page: 482 of 641

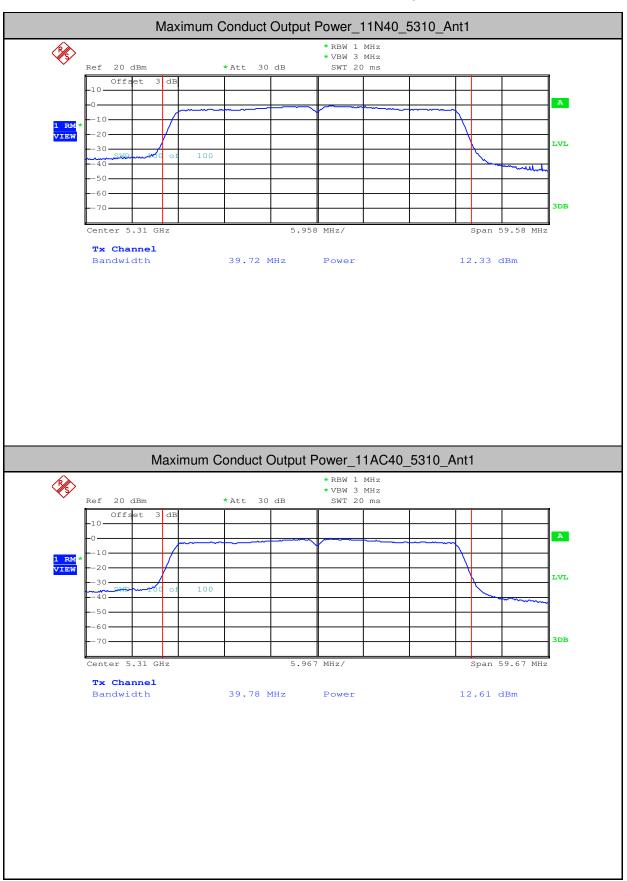




Report No.: SZEM180500434405 Page: 483 of 641

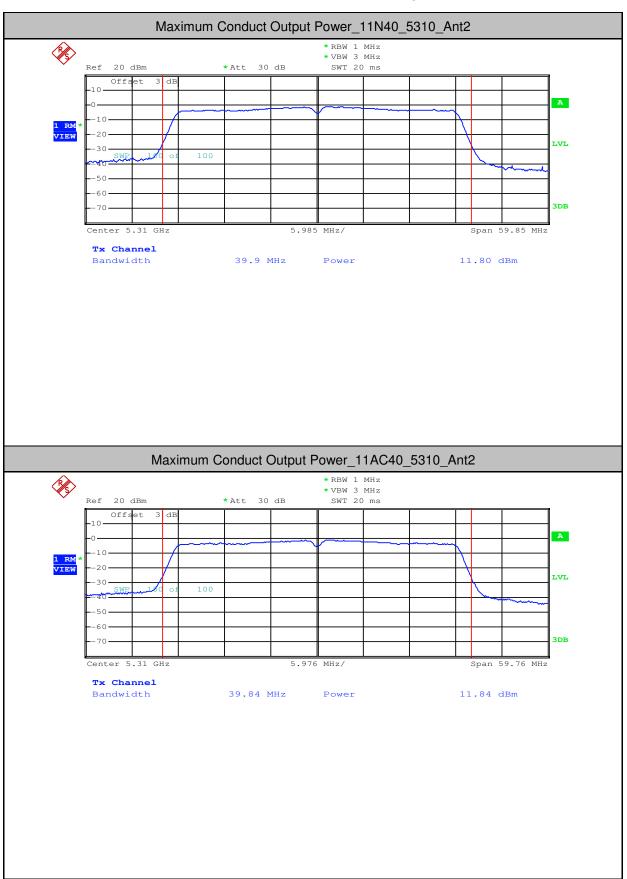




Report No.: SZEM180500434405 Page: 484 of 641

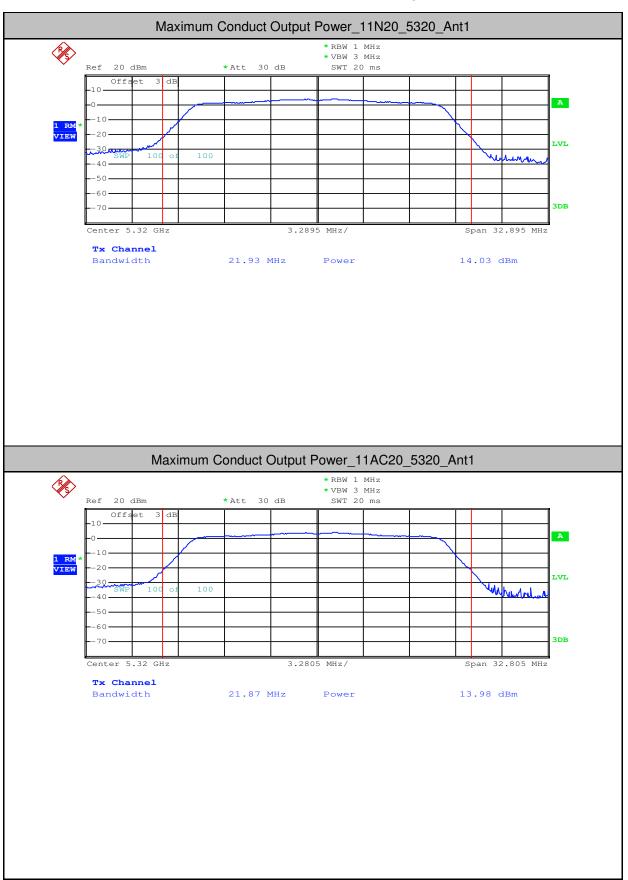




Report No.: SZEM180500434405 Page: 485 of 641

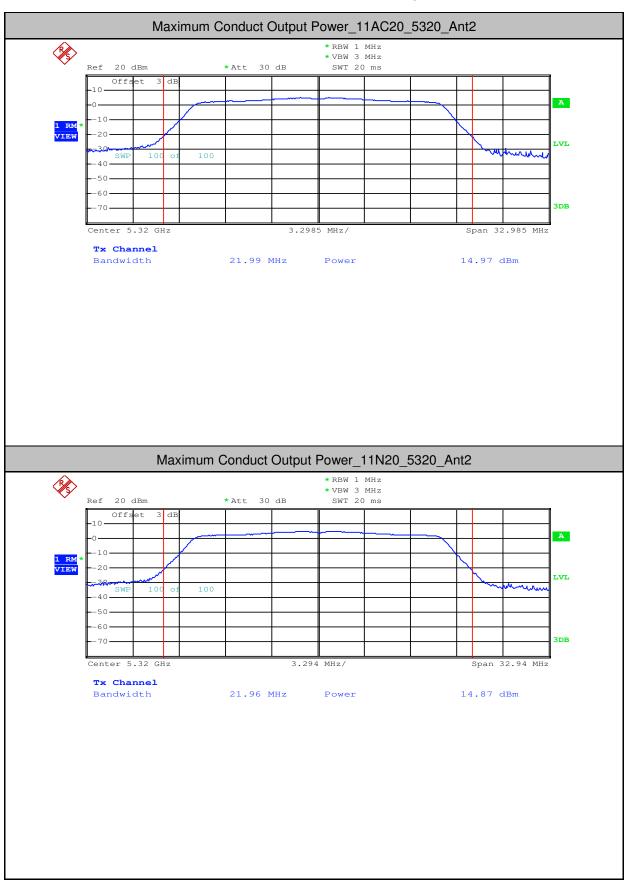




Report No.: SZEM180500434405 Page: 486 of 641

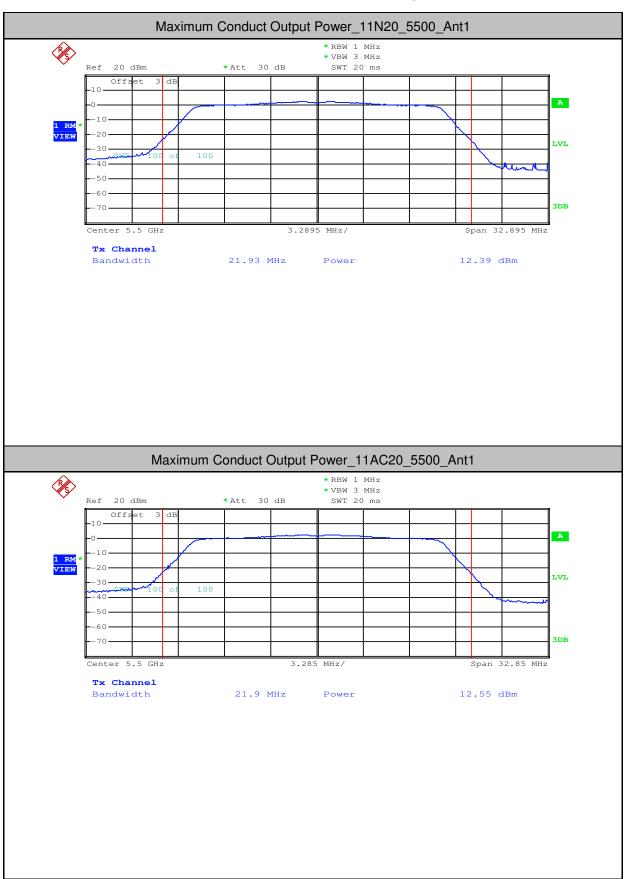




Report No.: SZEM180500434405 Page: 487 of 641

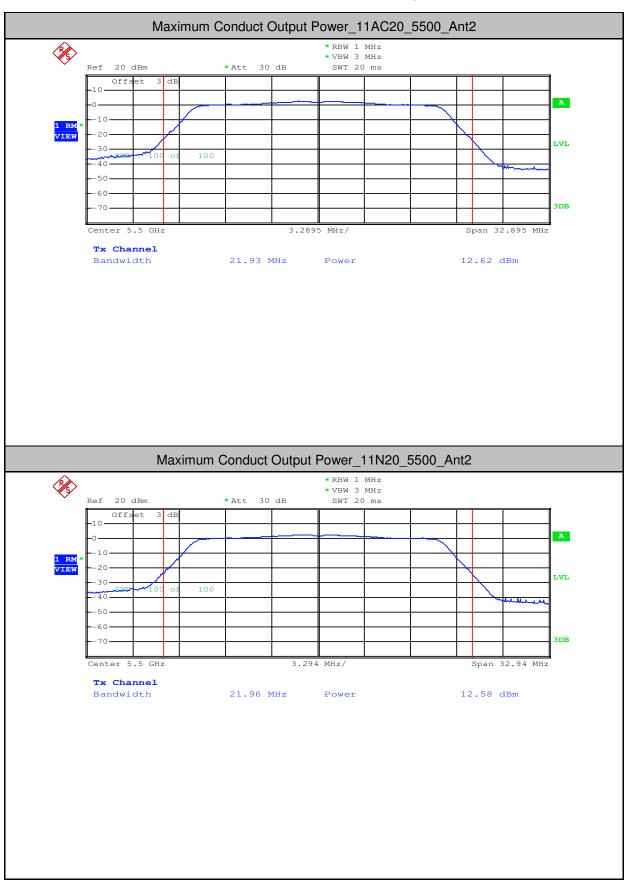




Report No.: SZEM180500434405 Page: 488 of 641

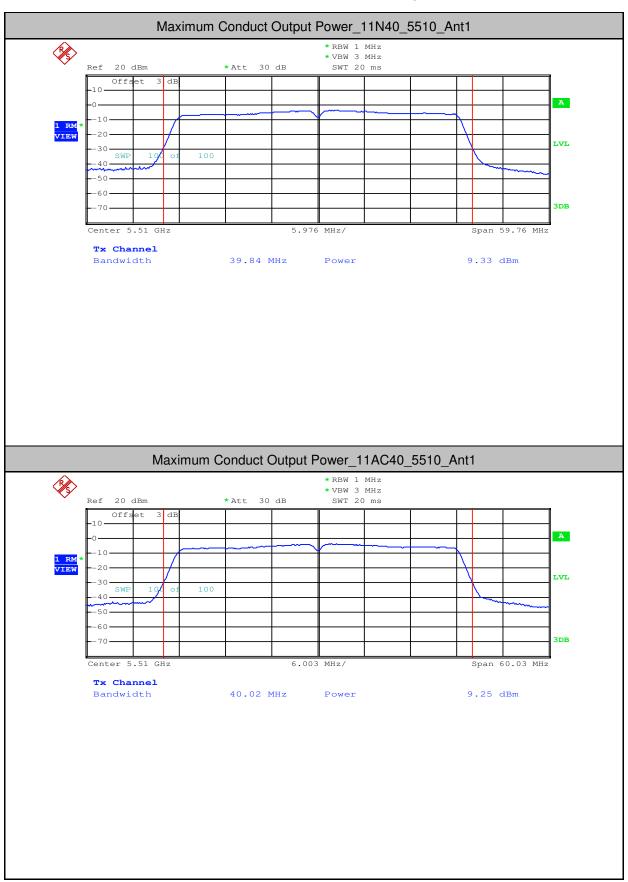




Report No.: SZEM180500434405 Page: 489 of 641

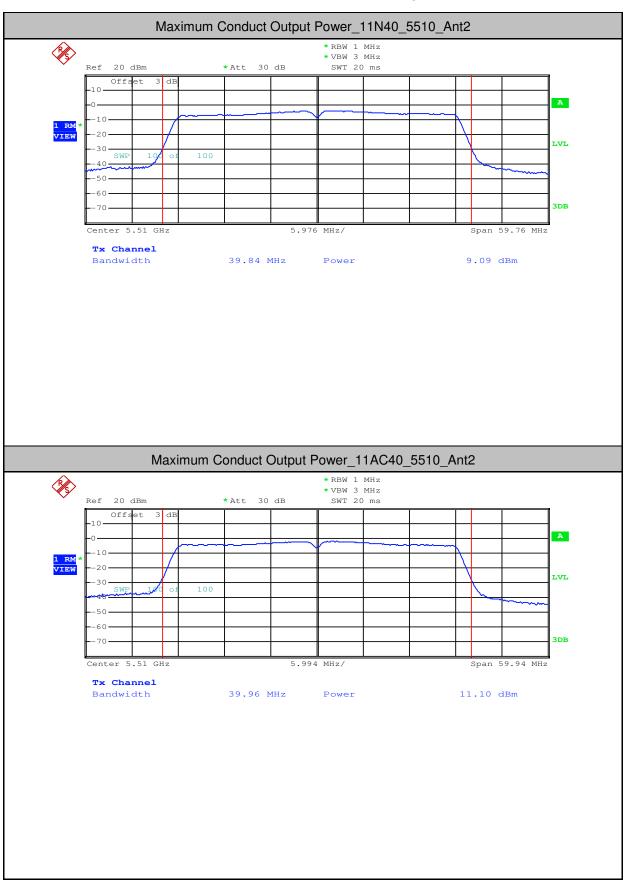




Report No.: SZEM180500434405 Page: 490 of 641

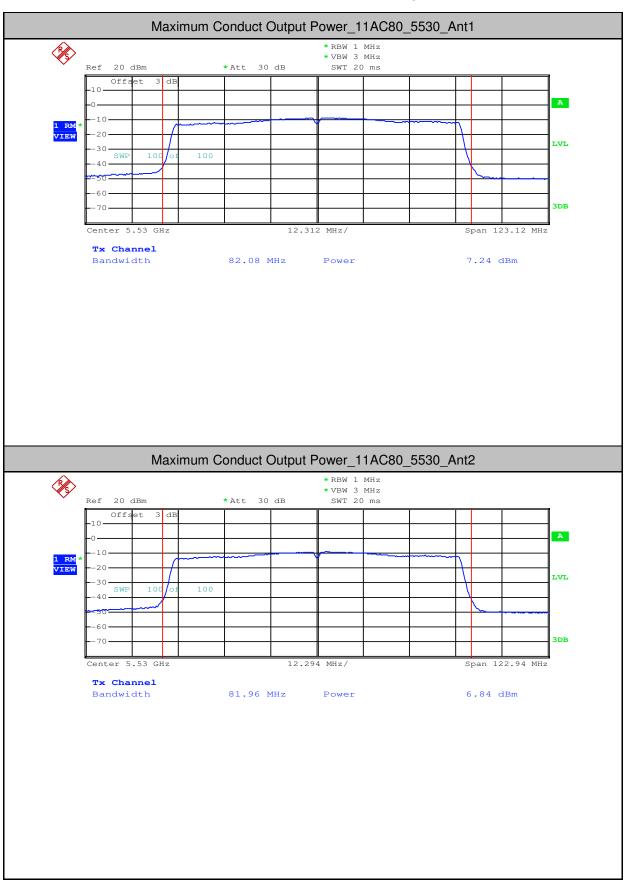




Report No.: SZEM180500434405 Page: 491 of 641

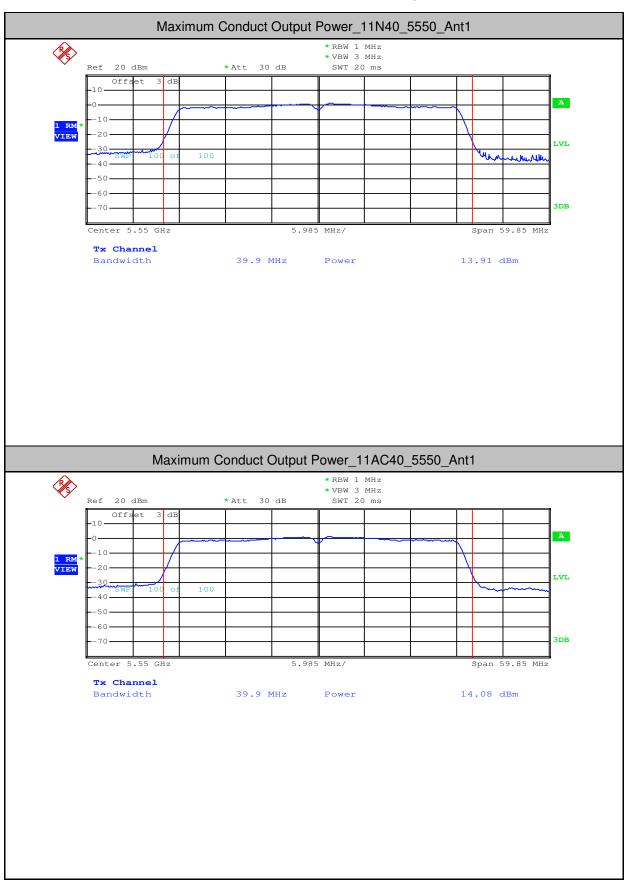




Report No.: SZEM180500434405 Page: 492 of 641

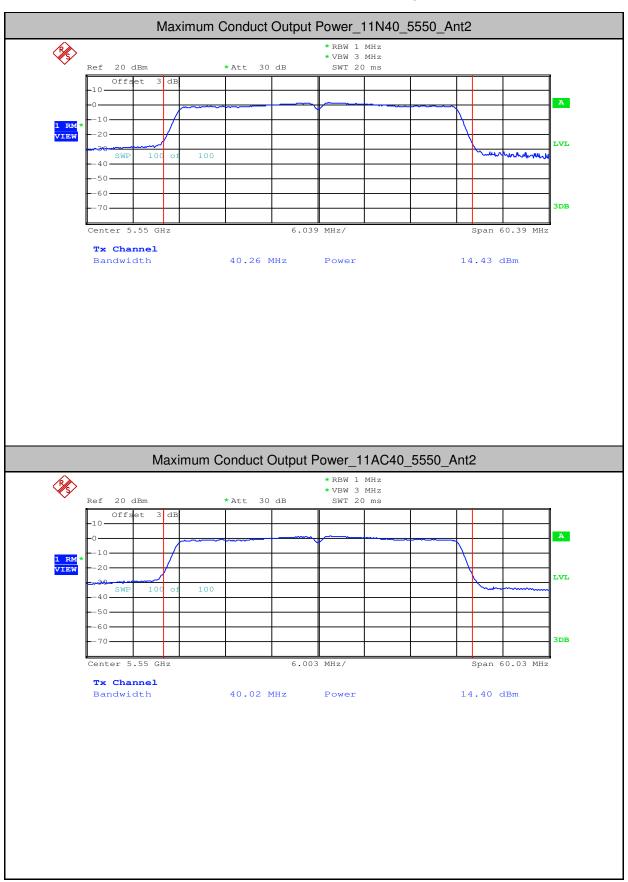




Report No.: SZEM180500434405 Page: 493 of 641

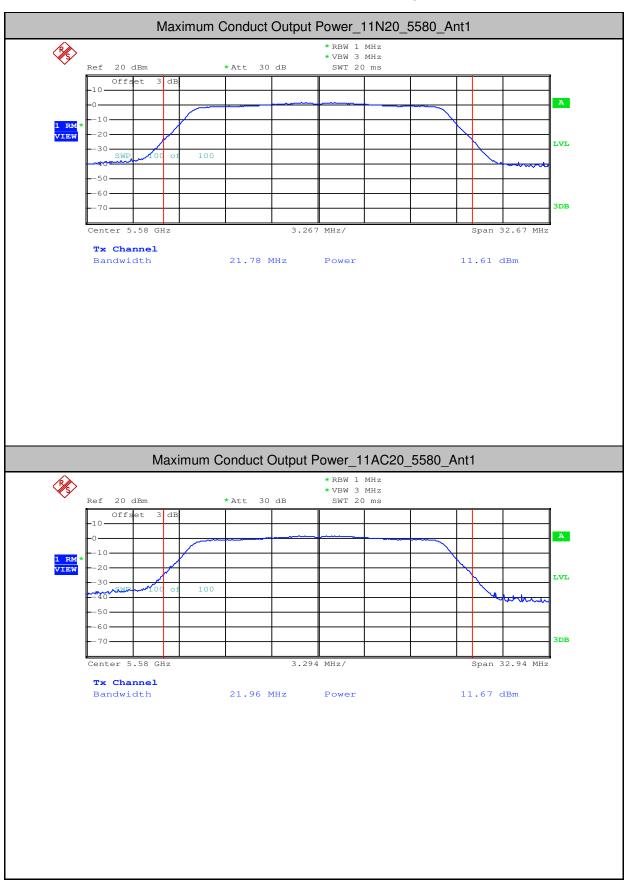




Report No.: SZEM180500434405 Page: 494 of 641

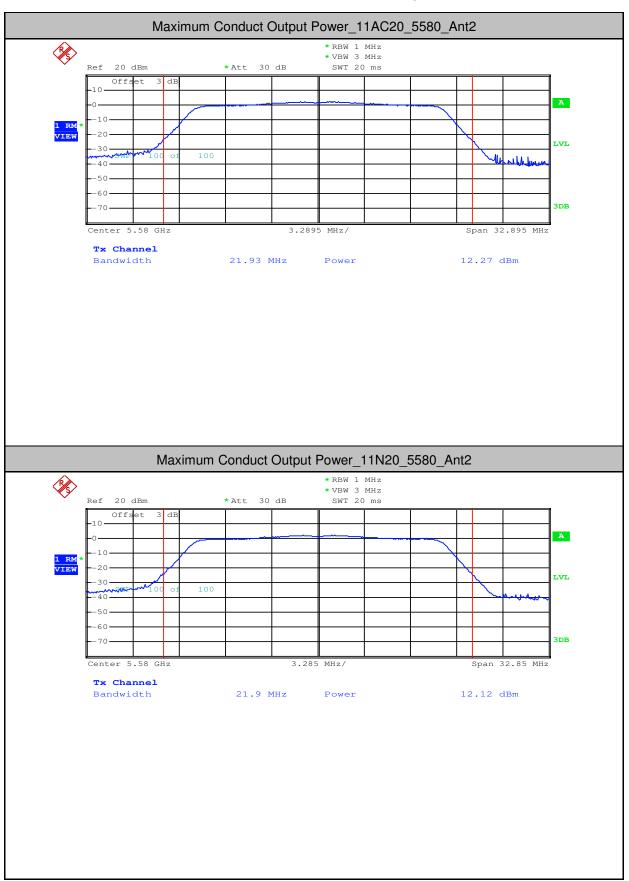




Report No.: SZEM180500434405 Page: 495 of 641

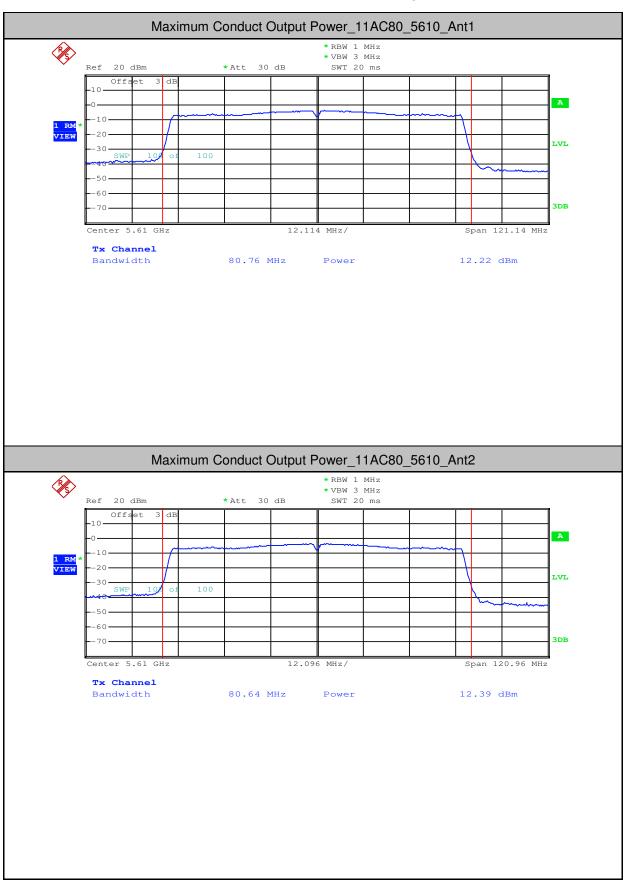




Report No.: SZEM180500434405 Page: 496 of 641

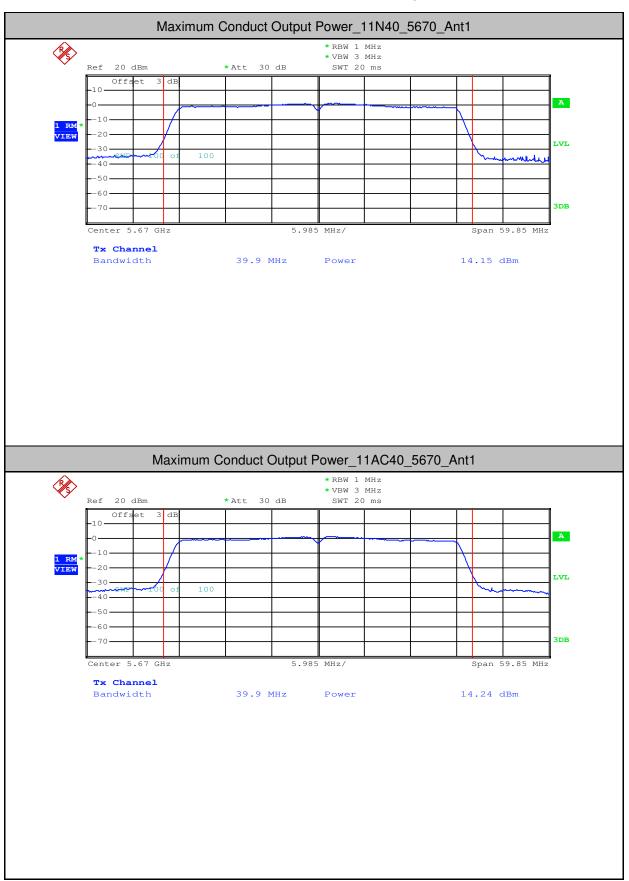




Report No.: SZEM180500434405 Page: 497 of 641

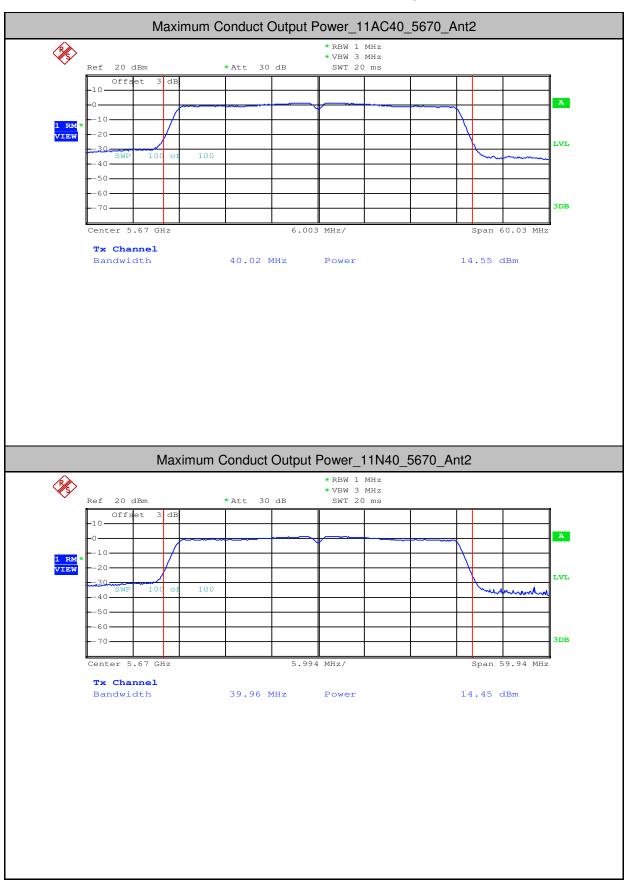




Report No.: SZEM180500434405 Page: 498 of 641

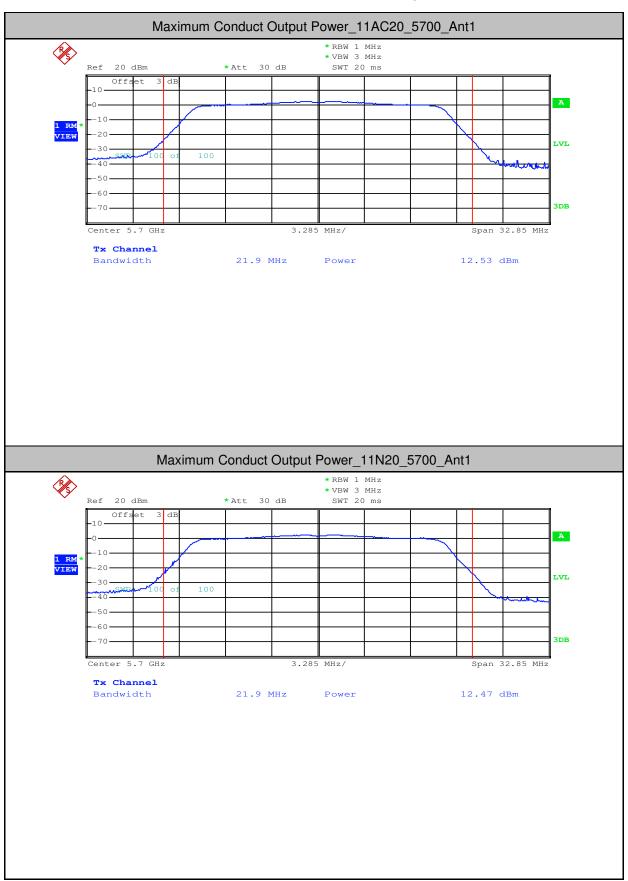




Report No.: SZEM180500434405 Page: 499 of 641

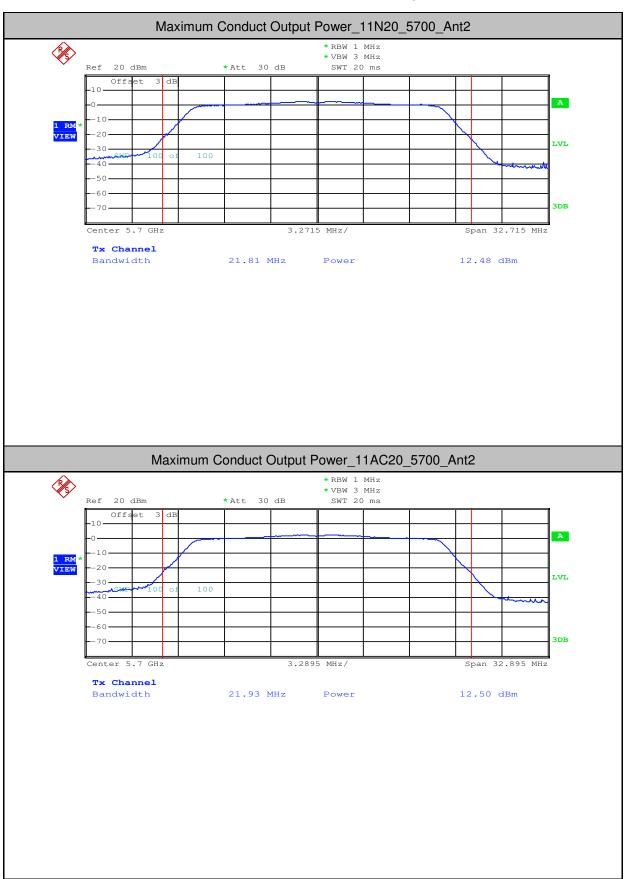




Report No.: SZEM180500434405 Page: 500 of 641

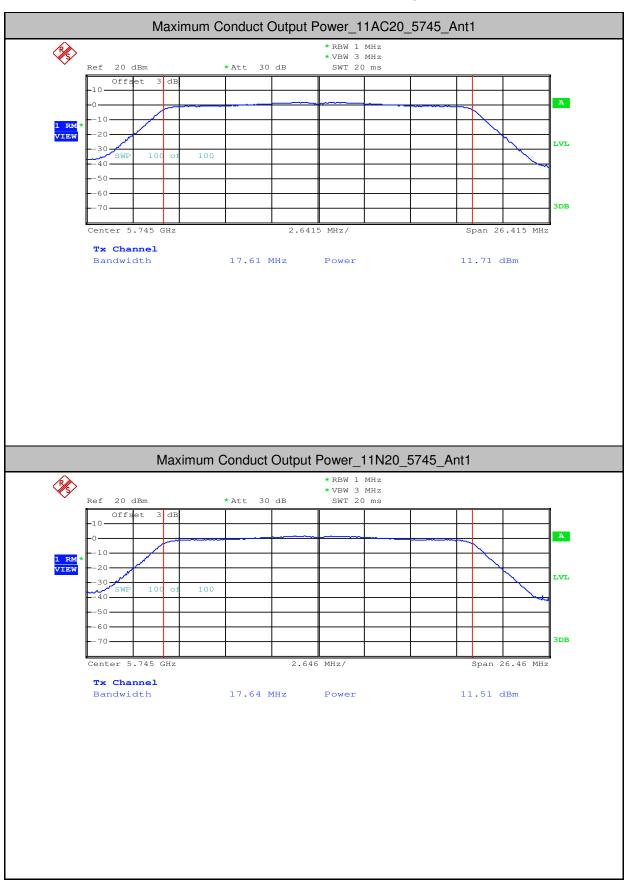




Report No.: SZEM180500434405 Page: 501 of 641

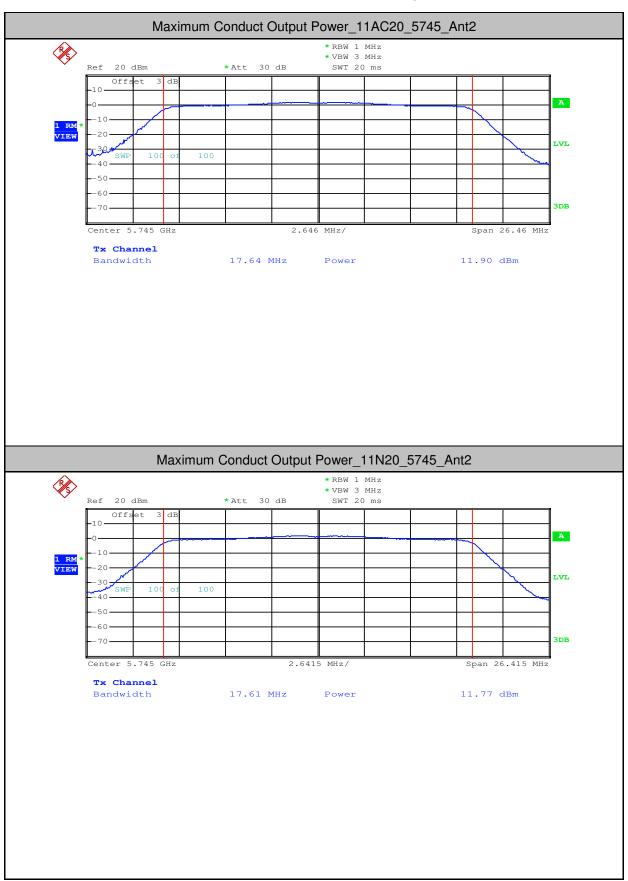




Report No.: SZEM180500434405 Page: 502 of 641

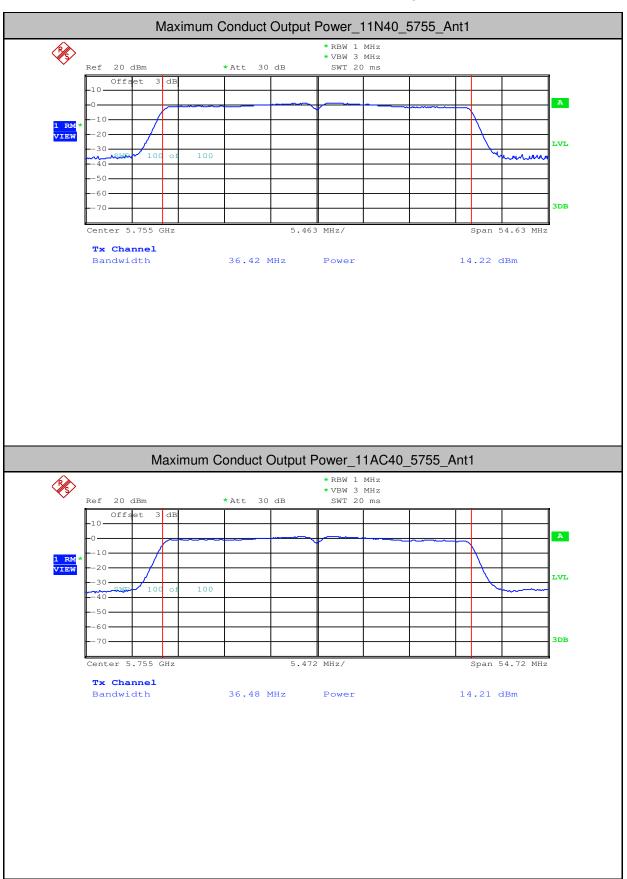




Report No.: SZEM180500434405 Page: 503 of 641

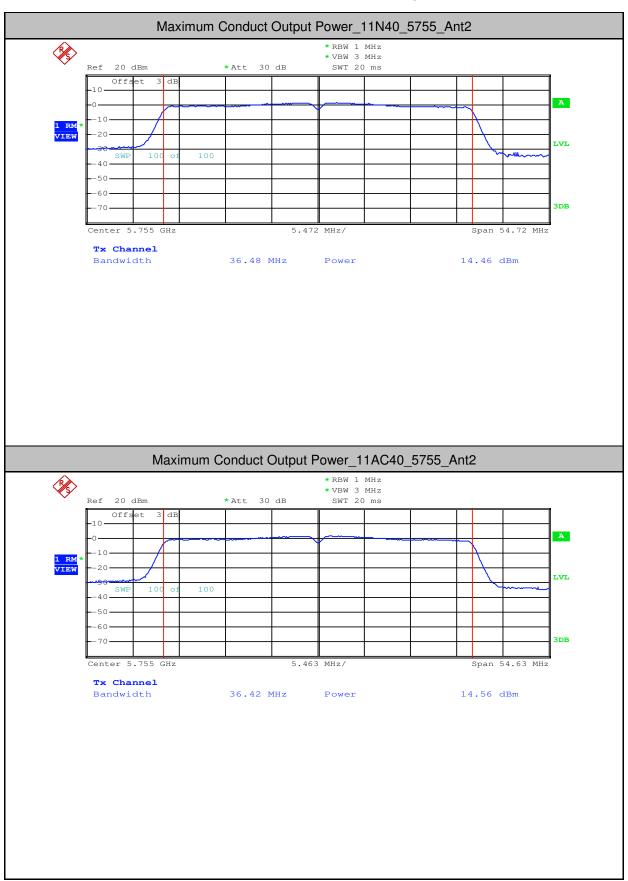




Report No.: SZEM180500434405 Page: 504 of 641

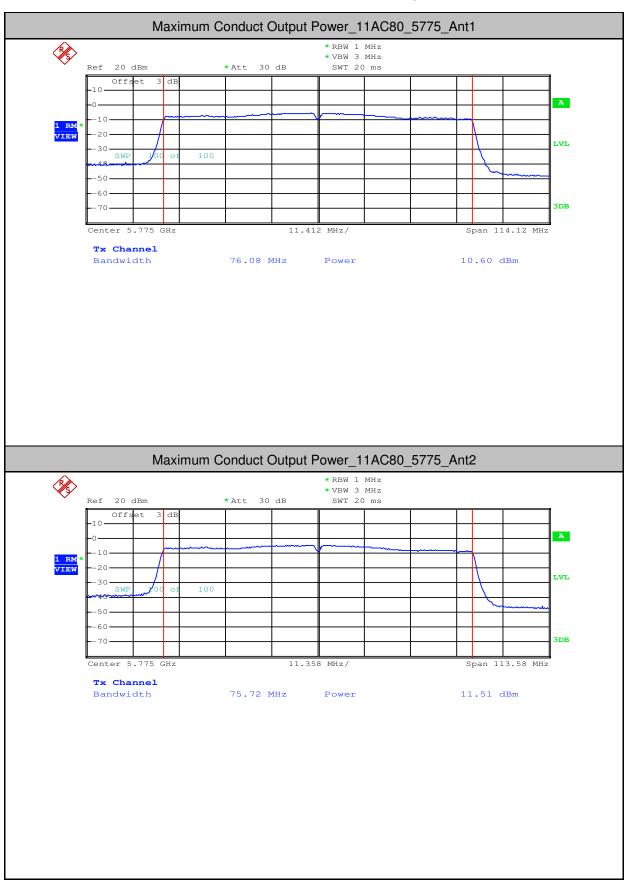




Report No.: SZEM180500434405 Page: 505 of 641

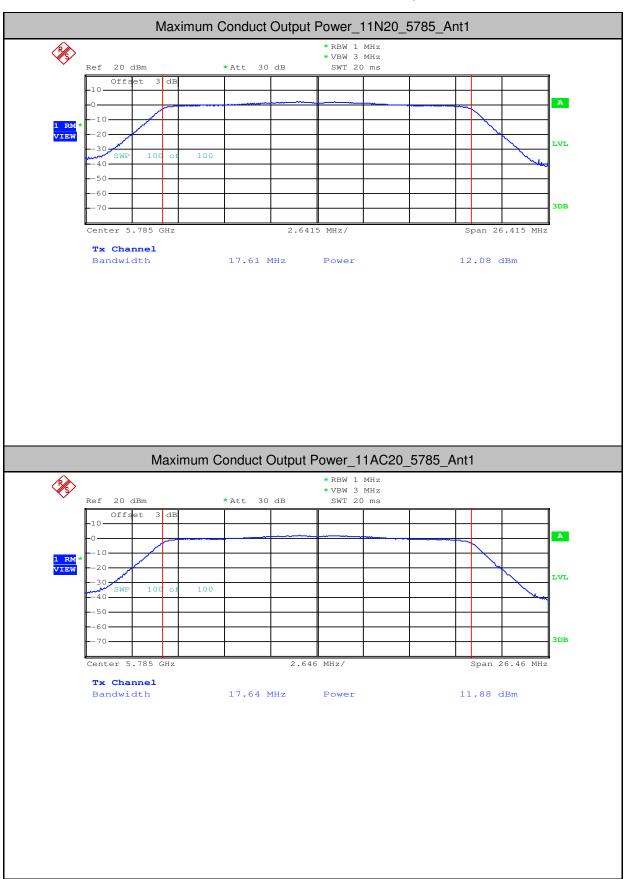




Report No.: SZEM180500434405 Page: 506 of 641

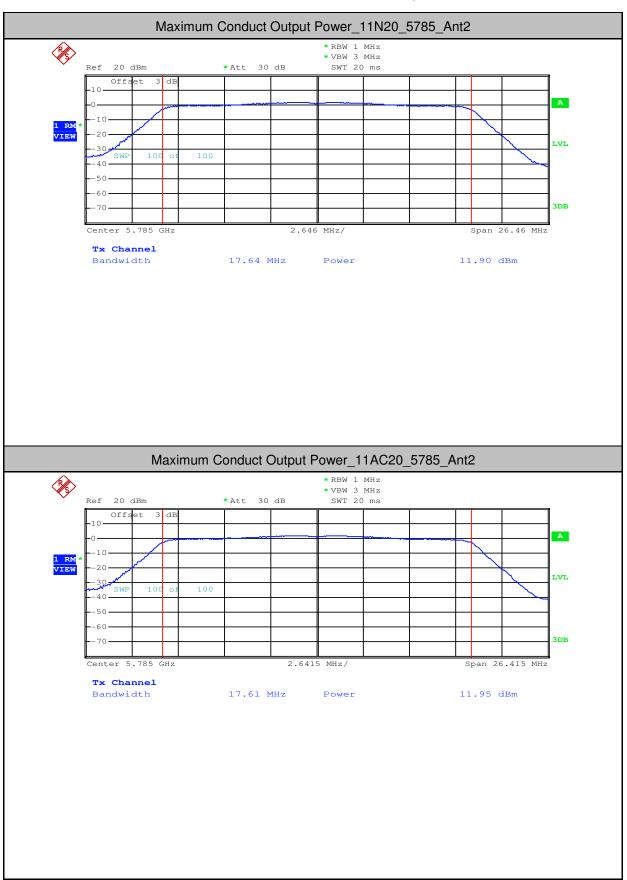




Report No.: SZEM180500434405 Page: 507 of 641

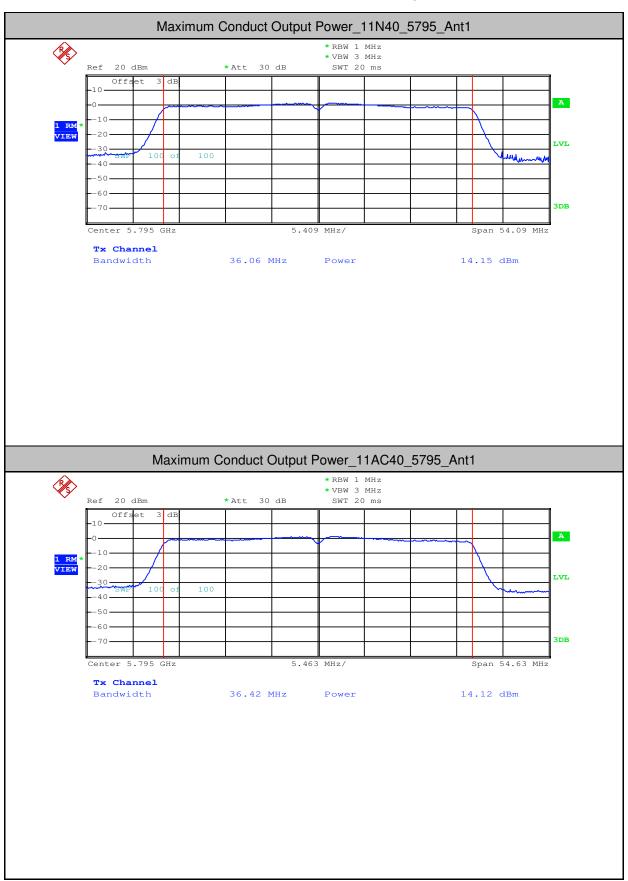




Report No.: SZEM180500434405 Page: 508 of 641

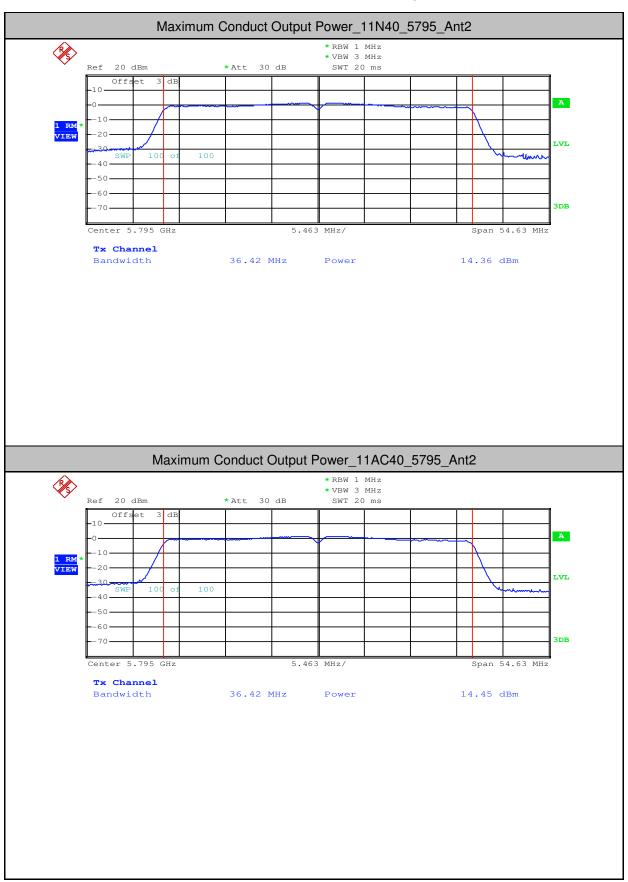




Report No.: SZEM180500434405 Page: 509 of 641

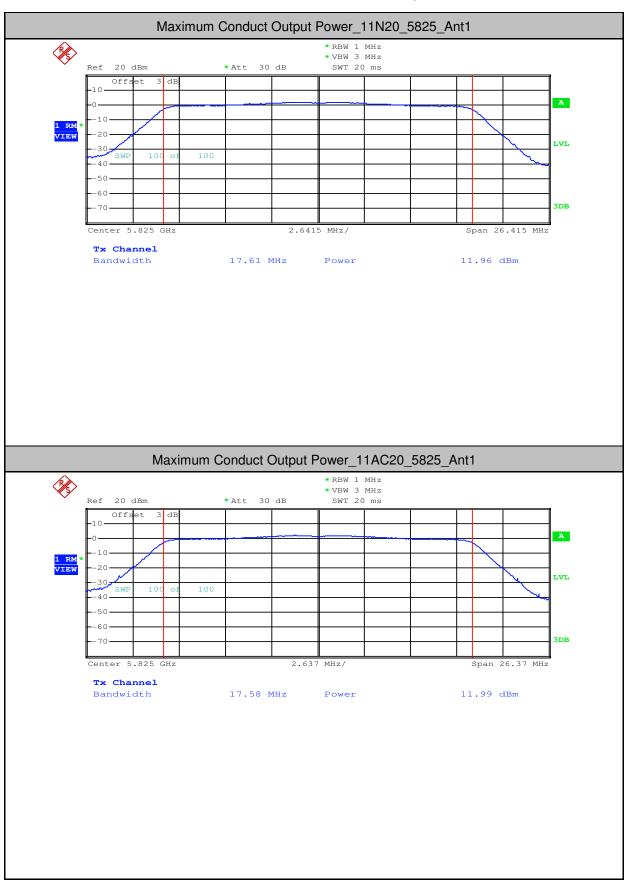



Report No.: SZEM180500434405 Page: 510 of 641

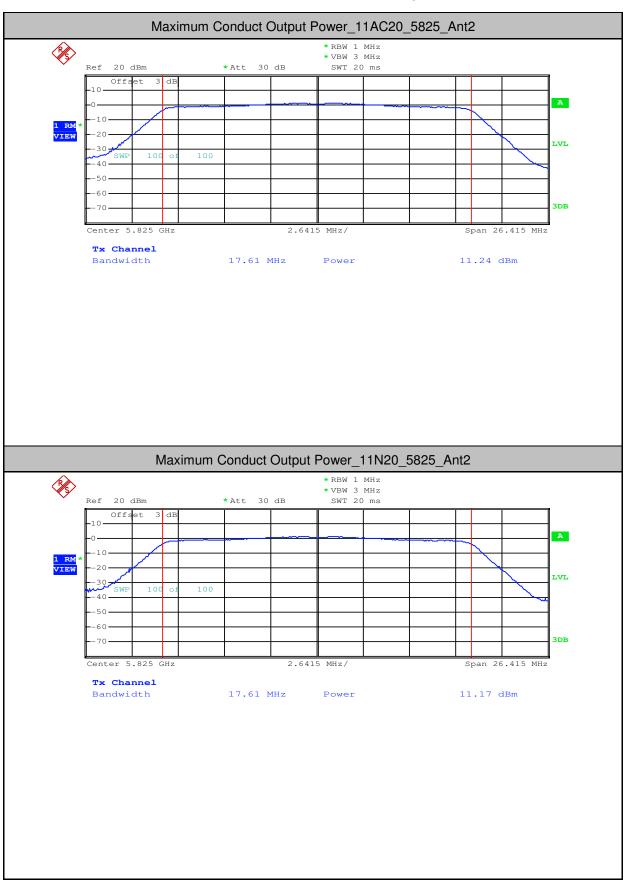



Report No.: SZEM180500434405 Page: 511 of 641

4.Maximum Power Spectral Density

Test Mode	Test Channel	Ant	Level [dBm/MHz]	10log(1/x) Factor [dB]	PSD [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	5180	Ant1	4.57	0.25	4.82	<11.00	PASS
11A	5180	Ant2	3.59	0.25	3.84	<11.00	PASS
11A	5220	Ant1	5.85	0.25	6.1	<11.00	PASS
11A	5220	Ant2	5.7	0.25	5.95	<11.00	PASS
11A	5240	Ant1	5.69	0.25	5.94	<11.00	PASS
11A	5240	Ant2	5.76	0.25	6.01	<11.00	PASS
11A	5260	Ant1	7.16	0.25	7.41	<11.00	PASS
11A	5260	Ant2	5.85	0.25	6.10	<11.00	PASS
11A	5300	Ant1	6.76	0.31	7.07	<11.00	PASS
11A	5300	Ant2	6.76	0.25	7.01	<11.00	PASS
11A	5320	Ant1	4.62	0.25	4.87	<11.00	PASS
11A	5320	Ant2	5.43	0.25	5.68	<11.00	PASS
11A	5500	Ant1	3.06	0.25	3.31	<11.00	PASS
11A	5500	Ant2	3.09	0.25	3.34	<11.00	PASS
11A	5580	Ant1	1.91	0.25	2.16	<11.00	PASS
11A	5580	Ant2	2.34	0.25	2.59	<11.00	PASS
11A	5700	Ant1	2.65	0.25	2.9	<11.00	PASS
11A	5700	Ant2	2.77	0.25	3.02	<11.00	PASS
11N20	5180	Ant1	3.98	0.26	4.24	<11.00	PASS
11AC20	5180	Ant1	4.11	0.26	4.37	<11.00	PASS
11N20	5180	Ant2	3.86	0.27	4.13	<11.00	PASS
11AC20	5180	Ant2	3.85	0.26	4.11	<11.00	PASS
11AC40	5190	Ant1	-3.39	0.1	-3.29	<11.00	PASS
11N40	5190	Ant1	-3.29	0.1	-3.19	<11.00	PASS
11AC40	5190	Ant2	-3.74	0.1	-3.64	<11.00	PASS
11N40	5190	Ant2	-3.68	0.1	-3.58	<11.00	PASS
11AC80	5210	Ant1	-7.32	0.22	-7.1	<11.00	PASS
11AC80	5210	Ant2	-7.39	0.22	-7.17	<11.00	PASS
11N20	5220	Ant1	5.13	0.27	5.4	<11.00	PASS
11AC20	5220	Ant1	5.65	0.26	5.91	<11.00	PASS
11N20	5220	Ant2	5.47	0.27	5.74	<11.00	PASS



Report No.: SZEM180500434405 Page: 512 of 641

11AC20	5220	Ant2	5.68	0.26	5.94	<11.00	PASS
11AC40	5230	Ant1	1.51	0.09	1.6	<11.00	PASS
11N40	5230	Ant1	1.86	0.12	1.98	<11.00	PASS
11N40	5230	Ant2	1.6	0.12	1.72	<11.00	PASS
11AC40	5230	Ant2	1.43	0.12	1.55	<11.00	PASS
11N20	5240	Ant1	5.45	0.26	5.71	<11.00	PASS
11AC20	5240	Ant1	5.5	0.26	5.76	<11.00	PASS
11N20	5240	Ant2	5.66	0.26	5.92	<11.00	PASS
11AC20	5240	Ant2	5.72	0.33	6.05	<11.00	PASS
11N20	5260	Ant1	5.98	0.27	6.25	<11.00	PASS
11AC20	5260	Ant1	3.89	0.26	4.15	<11.00	PASS
11AC20	5260	Ant2	4.37	0.26	4.63	<11.00	PASS
11N20	5260	Ant2	5.85	0.27	6.12	<11.00	PASS
11N40	5270	Ant1	2.25	0.53	2.78	<11.00	PASS
11AC40	5270	Ant1	2.15	0.53	2.68	<11.00	PASS
11AC40	5270	Ant2	2.68	0.53	3.21	<11.00	PASS
11N40	5270	Ant2	2.38	0.53	2.91	<11.00	PASS
11AC80	5290	Ant1	-6.51	0.19	-6.32	<11.00	PASS
11AC80	5290	Ant2	-7.01	0.19	-6.82	<11.00	PASS
11AC20	5300	Ant1	3.6	0.26	3.86	<11.00	PASS
11N20	5300	Ant1	5.52	0.26	5.78	<11.00	PASS
11AC20	5300	Ant2	3.98	0.26	4.24	<11.00	PASS
11N20	5300	Ant2	5.65	0.27	5.92	<11.00	PASS
11AC40	5310	Ant1	-0.13	0.53	0.4	<11.00	PASS
11N40	5310	Ant1	-0.2	0.54	0.34	<11.00	PASS
11AC40	5310	Ant2	-0.84	0.67	-0.17	<11.00	PASS
11N40	5310	Ant2	-0.87	0.53	-0.34	<11.00	PASS
11N20	5320	Ant1	3.82	0.27	4.09	<11.00	PASS
11AC20	5320	Ant1	4.13	0.26	4.39	<11.00	PASS
11N20	5320	Ant2	4.44	0.33	4.77	<11.00	PASS
11AC20	5320	Ant2	3.83	0.33	4.16	<11.00	PASS
11N20	5500	Ant1	2.62	0.26	2.88	<11.00	PASS
11AC20	5500	Ant1	2.91	0.26	3.17	<11.00	PASS
11AC20	5500	Ant2	2.68	0.26	2.94	<11.00	PASS
				ervice printed overleaf, available on	-		•



Report No.: SZEM180500434405 Page: 513 of 641

11N20	5500)	Ant2	2.72			0.27	2	2.99		<11.00	P	ASS	
11N40	5510)	Ant1	-3.27			0.1	-;	3.17		<11.00	P	ASS	
11AC40	5510)	Ant1	-3.52			0.1	-:	3.42		<11.00	P	ASS	
11N40	5510)	Ant2	-3.45	-3.45		0.12	-;	3.33		<11.00	P	ASS	
11AC40	5510)	Ant2	-3.58			0.1	-;	3.48		<11.00	P	ASS	
11AC80	5530)	Ant1	-8.3			0.19	-6	3.11		<11.00	P	ASS	
11AC80	5530)	Ant2	-8.38			0.22	-6	3.16		<11.00	P	ASS	
11AC40	5550)	Ant1	1.33			0.53	1	.86		<11.00	P	ASS	
11N40	5550)	Ant1	1.35			0.53	1	.88		<11.00	P	ASS	
11AC40	5550)	Ant2	1.51			0.53	2	2.04		<11.00	P	ASS	
11N40	5550)	Ant2	1.67			0.54	2	2.21		<11.00	P	ASS	
11AC20	5580)	Ant1	1.92			0.26	2	2.18		<11.00	P	ASS	
11N20	5580)	Ant1	1.78			0.27	2	2.05		<11.00		PASS	
11AC20	5580)	Ant2	2.4		0.26		2.66			<11.00		PASS	
11N20	5580)	Ant2	2.29		0.26		2.55			<11.00	P	ASS	
11AC80	5610)	Ant1	-3.55		0.19		-3.36			<11.00		PASS	
11AC80	5610)	Ant2	2 -3.45		0.19		-:	-3.26		<11.00	P	ASS	
11N40	5670)	Ant1	1.37	7		0.54	1	.91		<11.00	P	ASS	
11AC40	5670)	Ant1	1.49	1.49		0.53	2	2.02		<11.00	P	ASS	
11AC40	5670)	Ant2	1.76			0.53	2	2.29		<11.00	P	ASS	
11N40	5670)	Ant2	1.7			0.53	2	2.23		<11.00	P	ASS	
11AC20	5700)	Ant1	2.82			0.26	3	8.08		<11.00	P	ASS	
11N20	5700)	Ant1	2.59			0.26	2	2.85		<11.00	P	ASS	
11N20	5700)	Ant2	2.66			0.26	2	2.92		<11.00	P	ASS	
11AC20	5700)	Ant2	2.71			0.26	2	2.97		<11.00	P	ASS	
Test Mode	Test Channe I	Ant		Level n/500kHz]		og(1/x) ctor[dB]	10log(500kl) Factor		PSD [dBm/500kl]	Hz	Limit [dBm/500kł]	Ηz	Verdic t	
11A	5745	Ant 1		-1.75	().25	0		-1.5		<30.00		PASS	
11A	5745	Ant 2		-1.57	().31	0		-1.26		<30.00		PASS	
11A	5785	Ant 1		-1.14	().25	0		-0.89	<30.00		PASS		
11A	5785	Ant 2		-1.16	().25	0		-0.91		<30.00		PASS	



Report No.: SZEM180500434405 Page: 514 of 641

11A	5825	Ant 1	-1.54	0.25	0	-1.29	<30.00	PASS
11A	5825	Ant 2	-1.28	0.25	0	-1.03	<30.00	PASS
11AC2 0	5745	Ant 1	-1.44	0.26	0	-1.18	<30.00	PASS
11N20	5745	Ant 1	-1.9	0.27	0	-1.63	<30.00	PASS
11AC2 0	5745	Ant 2	-0.98	0.26	0	-0.72	<30.00	PASS
11N20	5745	Ant 2	-1.46	0.33	0	-1.13	<30.00	PASS
11N40	5755	Ant 1	-1.52	0.53	0	-0.99	<30.00	PASS
11AC4 0	5755	Ant 1	-1.88	0.53	0	-1.35	<30.00	PASS
11N40	5755	Ant 2	-1.82	0.54	0	-1.28	<30.00	PASS
11AC4 0	5755	Ant 2	-1.59	0.67	0	-0.92	<30.00	PASS
11AC8 0	5775	Ant 1	-8.11	0.19	0	-7.92	<30.00	PASS
11AC8 0	5775	Ant 2	-7.61	0.22	0	-7.39	<30.00	PASS
11N20	5785	Ant 1	-1.28	0.27	0	-1.01	<30.00	PASS
11AC2 0	5785	Ant 1	-1.05	0.26	0	-0.79	<30.00	PASS
11AC2 0	5785	Ant 2	-0.89	0.26	0	-0.63	<30.00	PASS
11N20	5785	Ant 2	-1.35	0.26	0	-1.09	<30.00	PASS
11AC4 0	5795	Ant 1	-2.15	0.53	0	-1.62	<30.00	PASS
11N40	5795	Ant 1	-1.84	0.54	0	-1.3	<30.00	PASS
11N40	5795	Ant 2	-1.68	0.54	0	-1.14	<30.00	PASS
11AC4 0	5795	Ant 2	-1.73	0.53	0	-1.2	<30.00	PASS
11N20	5825	Ant 1	-1.39	0.27	0	-1.12	<30.00	PASS



Report No.: SZEM180500434405 Page: 515 of 641

11AC2 0	5825	Ant 1	-0.84	0.26	0	-0.58	<30.00	PASS
11AC2 0	5825	Ant 2	-1.54	0.26	0	-1.28	<30.00	PASS
11N20	5825	Ant 2	-1.94	0.26	0	-1.68	<30.00	PASS

MIMO:

MIMO:					
Test Mode	Test Channel	Ant	PSD [dBm/MHz]	Limit [dBm/MHz]	Verdict
11N20	5180	Ant1+2	7.20	<9.61	PASS
11N20	5220	Ant1+2	8.58	<9.61	PASS
11N20	5240	Ant1+2	8.83	<9.61	PASS
11N20	5260	Ant1+2	9.20	<9.61	PASS
11N20	5300	Ant1+2	8.86	<9.61	PASS
11N20	5320	Ant1+2	7.45	<9.61	PASS
11N20	5500	Ant1+2	2.99	<9.61	PASS
11N20	5580	Ant1+2	5.32	<9.61	PASS
11N20	5700	Ant1+2	5.90	<9.61	PASS
11N40	5190	Ant1+2	-0.37	<9.61	PASS
11N40	5230	Ant1+2	4.86	<9.61	PASS
11N40	5270	Ant1+2	5.86	<9.61	PASS
11N40	5310	Ant1+2	3.02	<9.61	PASS
11N40	5510	Ant1+2	-0.24	<9.61	PASS
11N40	5550	Ant1+2	5.06	<9.61	PASS
11N40	5670	Ant1+2	5.08	<9.61	PASS
11AC20	5180	Ant1+2	7.25	<9.61	PASS
11AC20	5220	Ant1+2	8.94	<9.61	PASS
11AC20	5240	Ant1+2	8.92	<9.61	PASS
11AC20	5260	Ant1+2	7.41	<9.61	PASS
11AC20	5300	Ant1+2	7.06	<9.61	PASS
11AC20	5320	Ant1+2	7.29	<9.61	PASS
11AC20	5500	Ant1+2	6.07	<9.61	PASS
11AC20	5580	Ant1+2	5.44	<9.61	PASS
11AC20	5700	Ant1+2	6.04	<9.61	PASS
11AC40	5190	Ant1+2	-0.45	<9.61	PASS
11AC40	5230	Ant1+2	4.59	<9.61	PASS
11AC40	5270	Ant1+2	5.96	<9.61	PASS
11AC40	5310	Ant1+2	3.13	<9.61	PASS
11AC40	5510	Ant1+2	-0.44	<9.61	PASS
11AC40	5550	Ant1+2	4.96	<9.61	PASS
11AC40	5670	Ant1+2	5.17	<9.61	PASS
11AC80	5210	Ant1+2	-4.12	<9.61	PASS




Report No.: SZEM180500434405 Page: 516 of 641

11AC80	5290	Ant1+2	-3.55	<9.61	PASS
11AC80	5530	Ant1+2	-5.12	<9.61	PASS
11AC80	5610	Ant1+2	-0.30	<9.61	PASS
11N20	5745	Ant1+2	1.46	<28.61	PASS
11N20	5785	Ant1+2	1.57	<28.61	PASS
11N20	5825	Ant1+2	1.45	<28.61	PASS
11N40	5755	Ant1+2	1.54	<28.61	PASS
11N40	5795	Ant1+2	1.51	<28.61	PASS
11AC20	5745	Ant1+2	1.61	<28.61	PASS
11AC20	5785	Ant1+2	1.70	<28.61	PASS
11AC20	5825	Ant1+2	1.62	<28.61	PASS
11AC40	5755	Ant1+2	1.54	<28.61	PASS
11AC40	5795	Ant1+2	1.45	<28.61	PASS
11AC80	5775	Ant1+2	0.34	<28.61	PASS




Report No.: SZEM180500434405 Page: 517 of 641

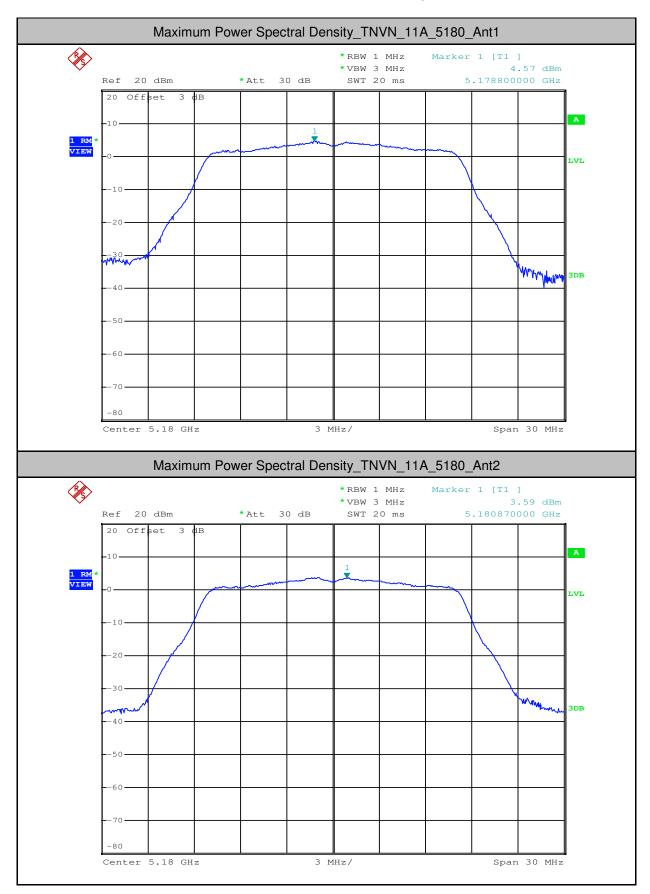




Report No.: SZEM180500434405 Page: 518 of 641

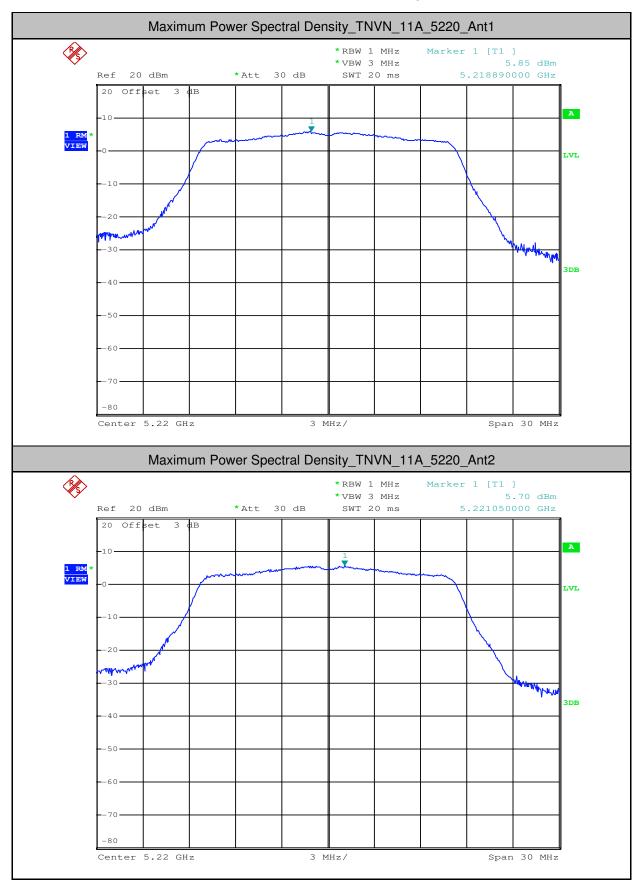




Report No.: SZEM180500434405 Page: 519 of 641

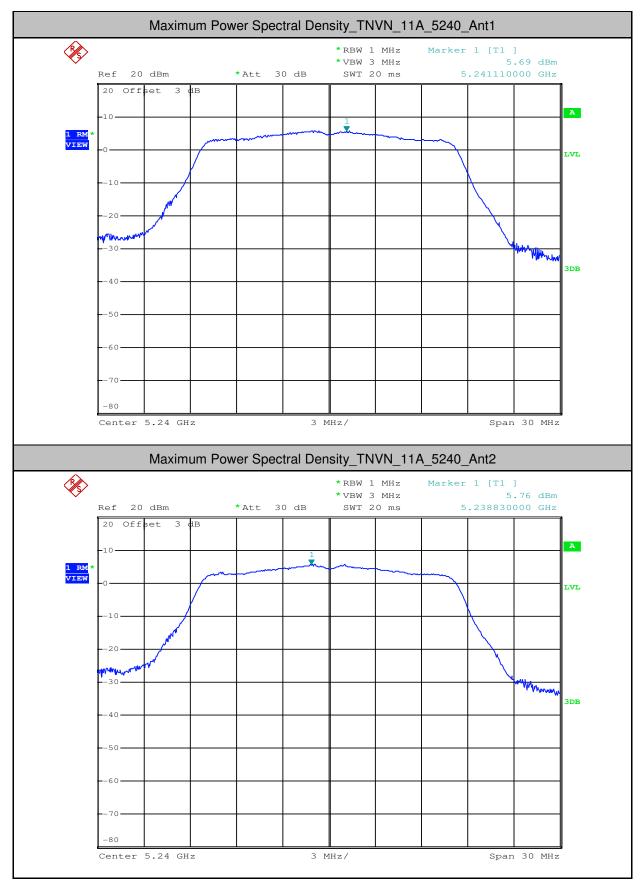




Report No.: SZEM180500434405 Page: 520 of 641

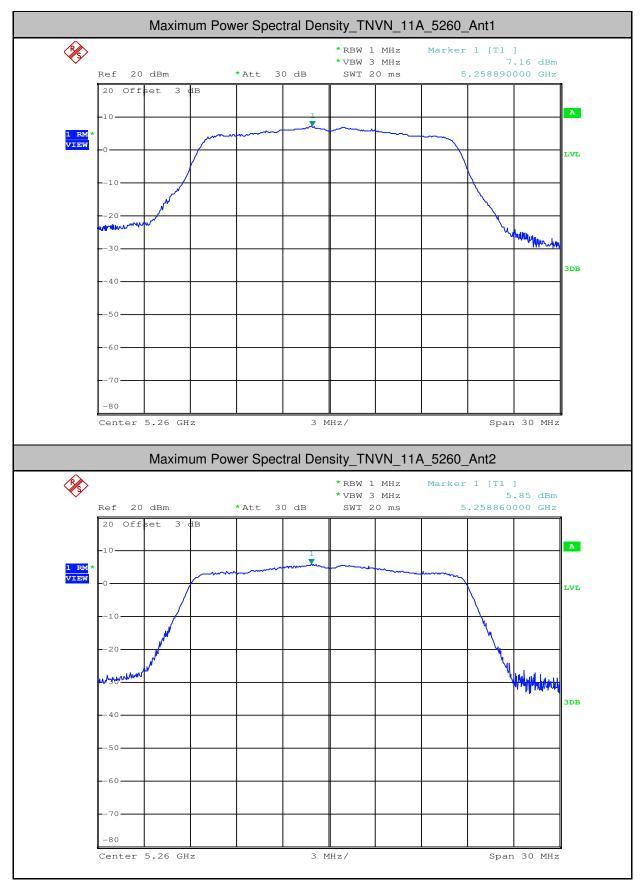




Report No.: SZEM180500434405 Page: 521 of 641

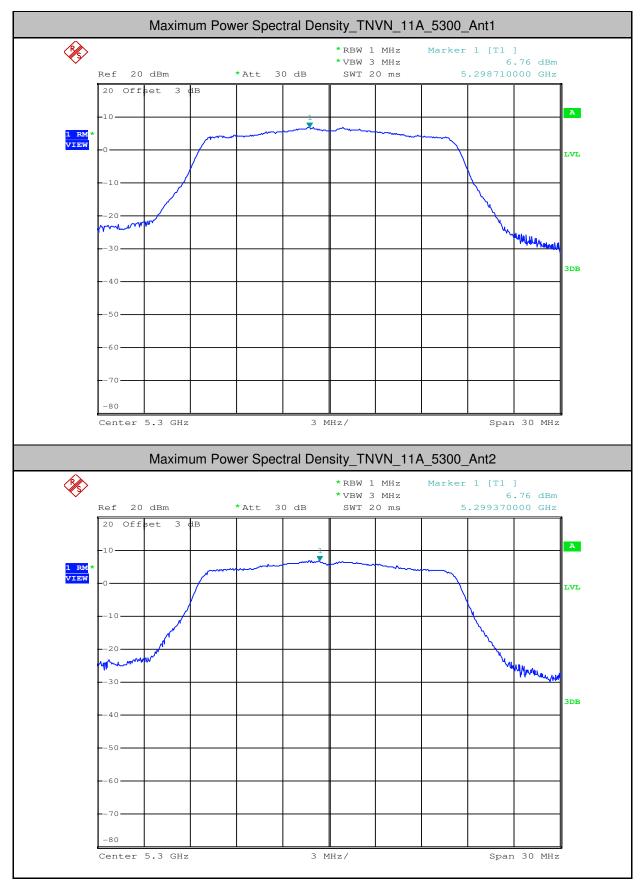




Report No.: SZEM180500434405 Page: 522 of 641

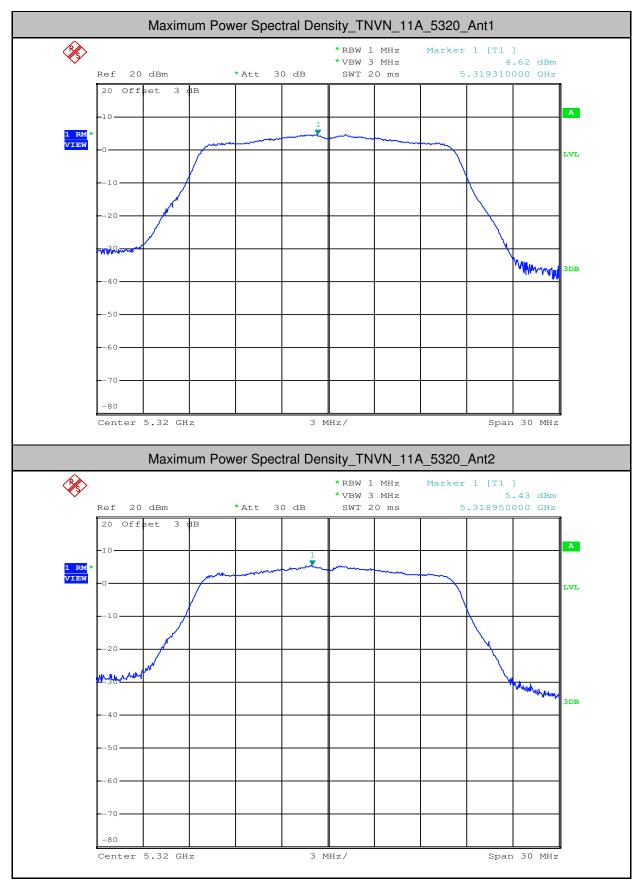




Report No.: SZEM180500434405 Page: 523 of 641

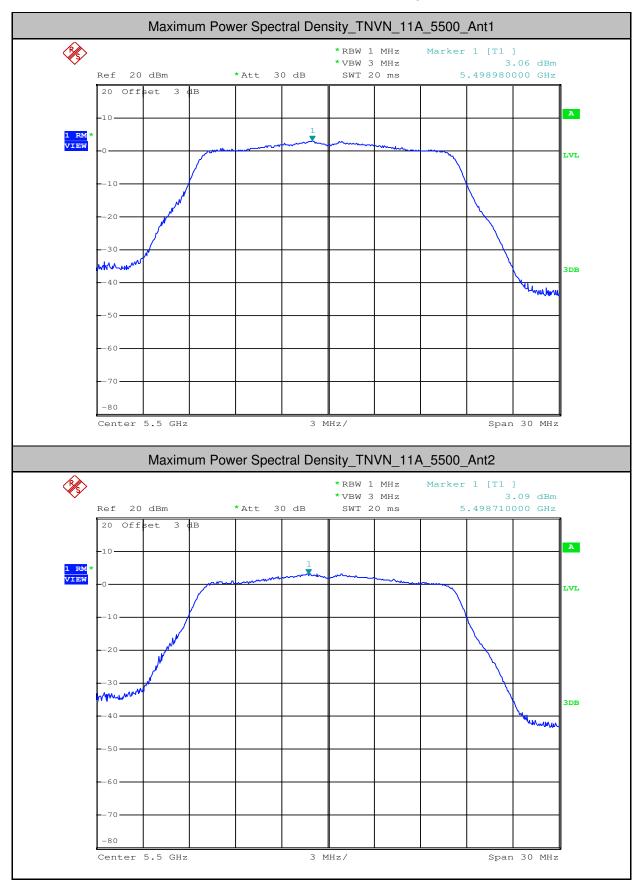




Report No.: SZEM180500434405 Page: 524 of 641

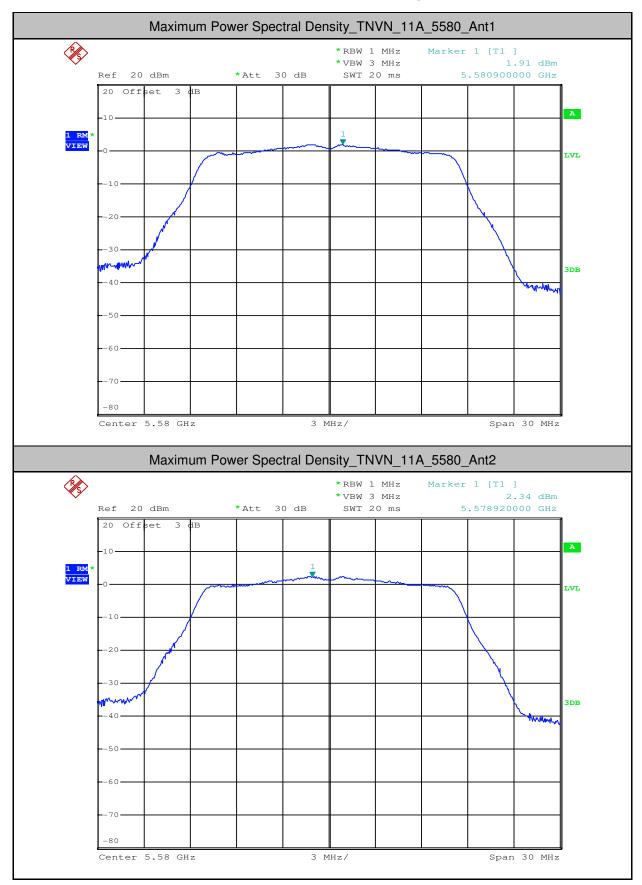




Report No.: SZEM180500434405 Page: 525 of 641

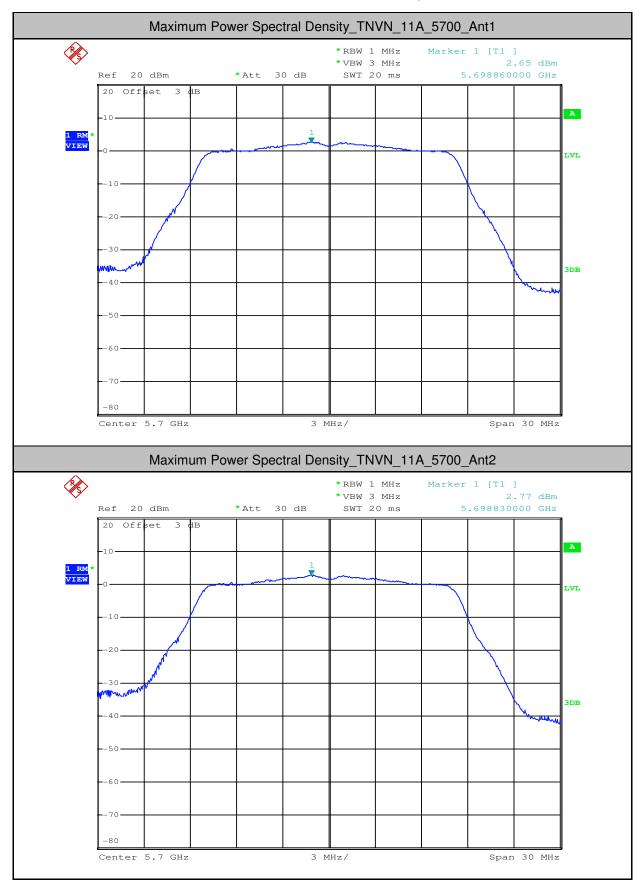




Report No.: SZEM180500434405 Page: 526 of 641

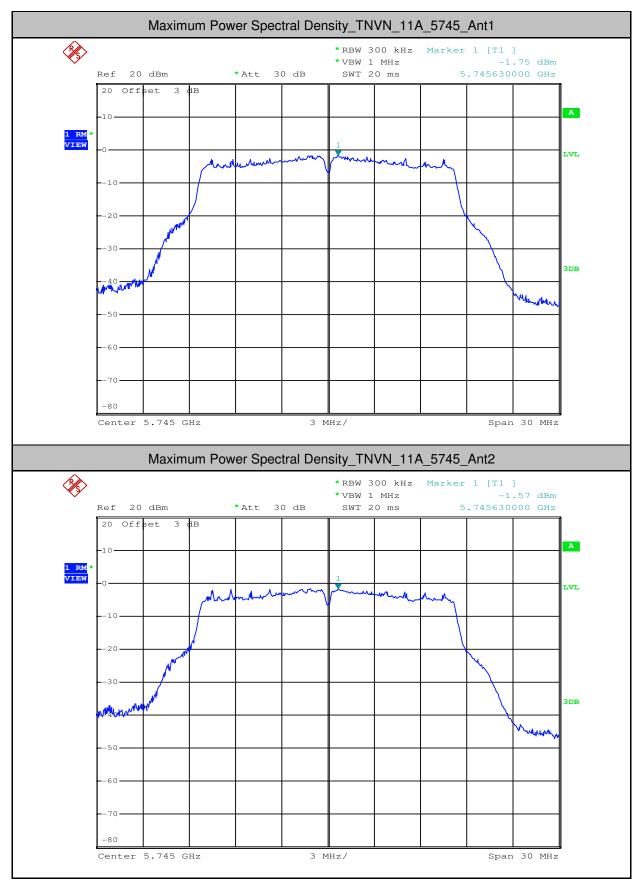




Report No.: SZEM180500434405 Page: 527 of 641

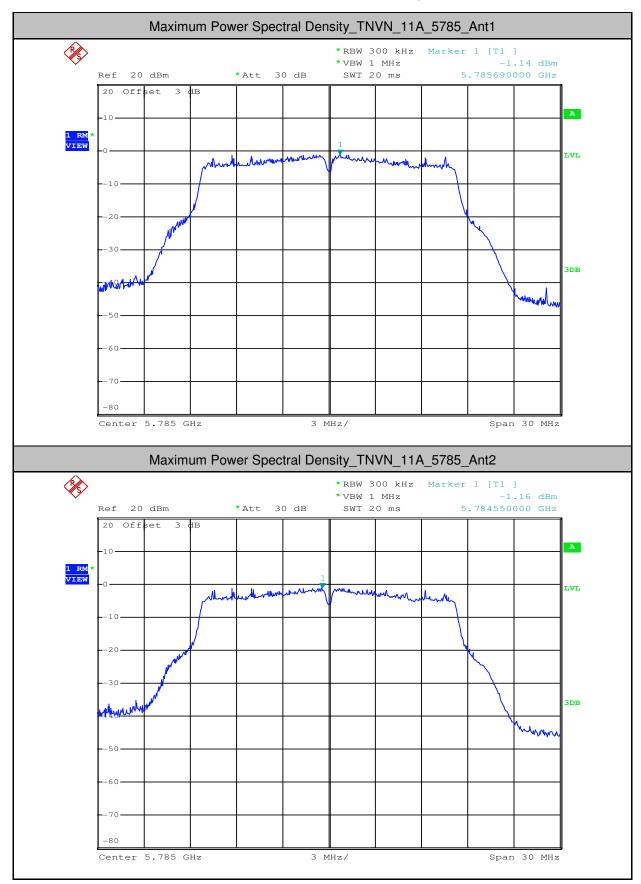




Report No.: SZEM180500434405 Page: 528 of 641

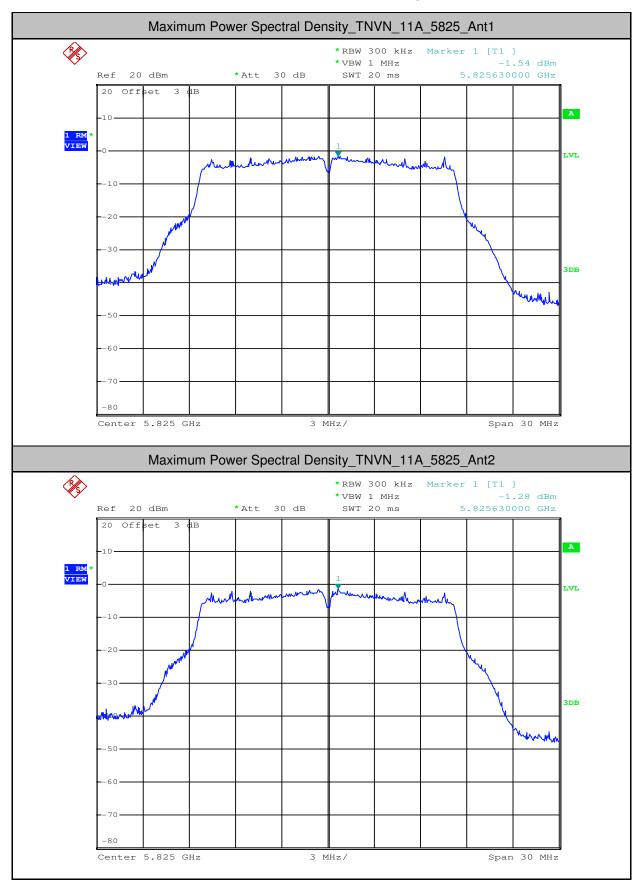




Report No.: SZEM180500434405 Page: 529 of 641

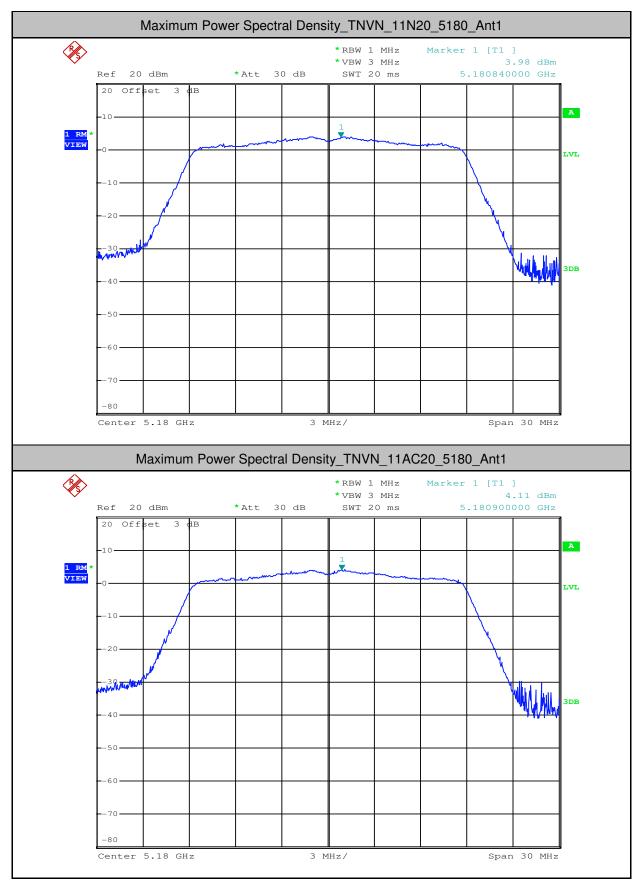




Report No.: SZEM180500434405 Page: 530 of 641

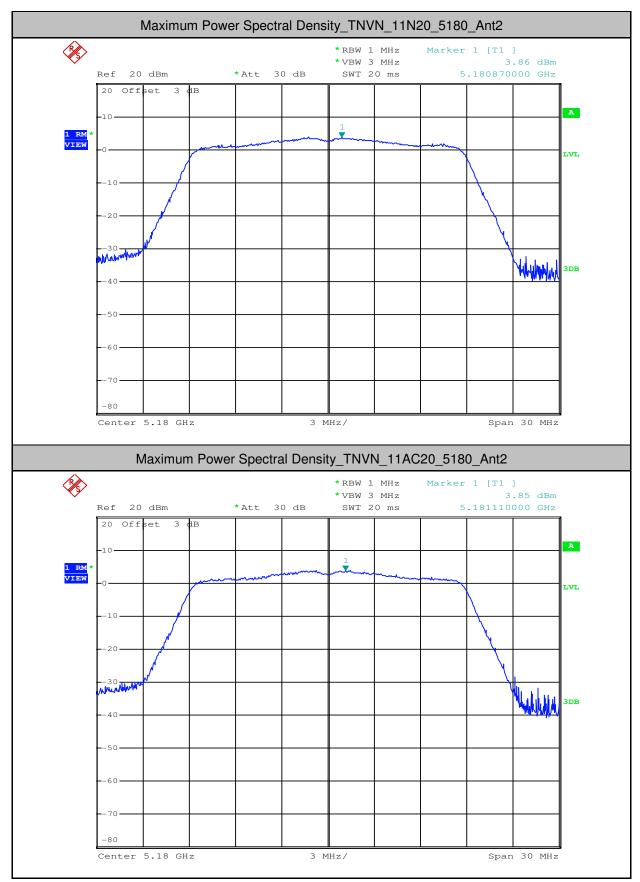




Report No.: SZEM180500434405 Page: 531 of 641

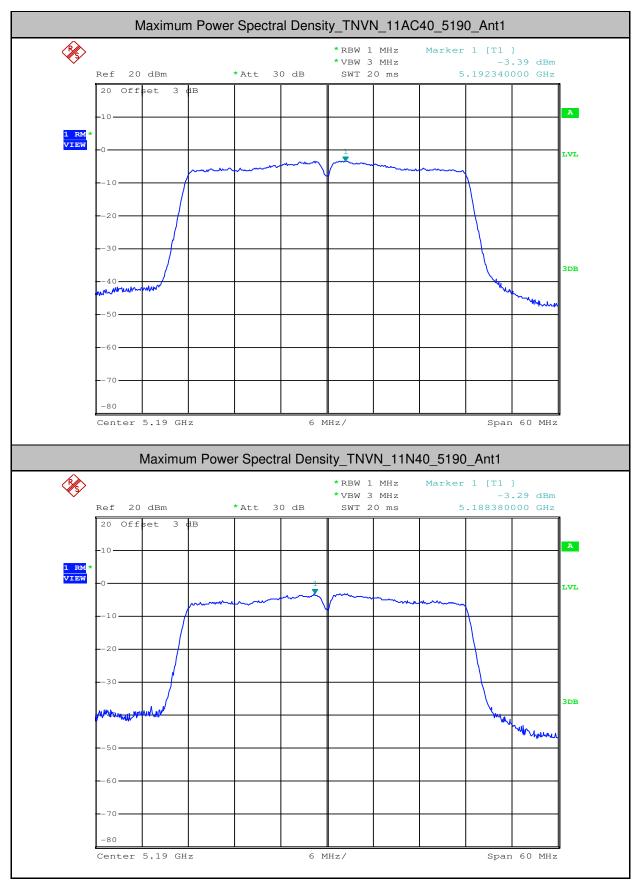




Report No.: SZEM180500434405 Page: 532 of 641

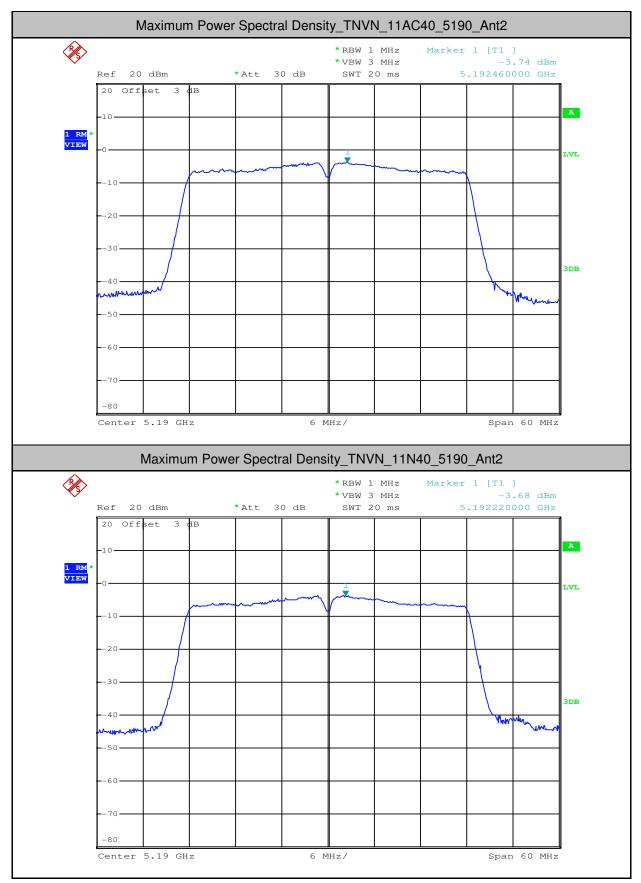




Report No.: SZEM180500434405 Page: 533 of 641

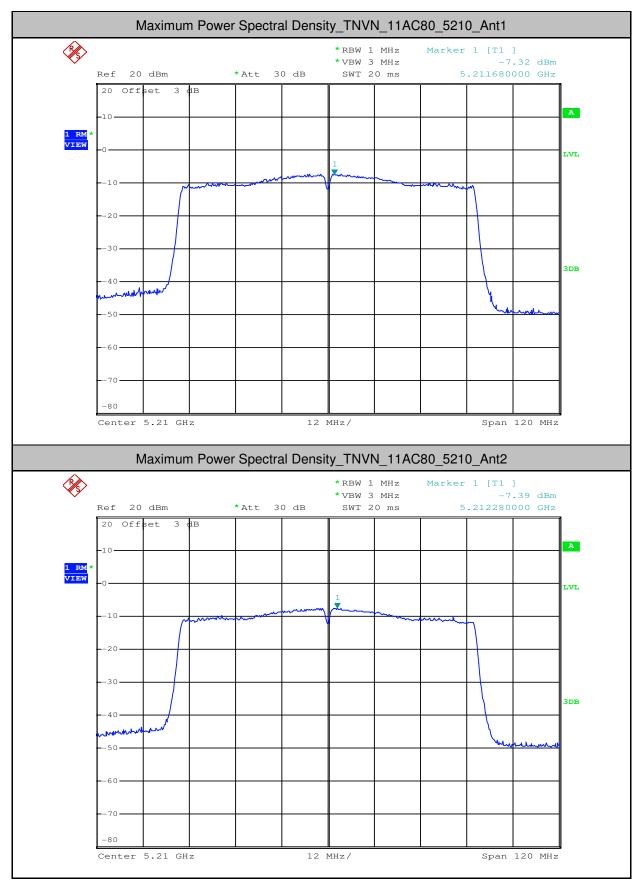




Report No.: SZEM180500434405 Page: 534 of 641

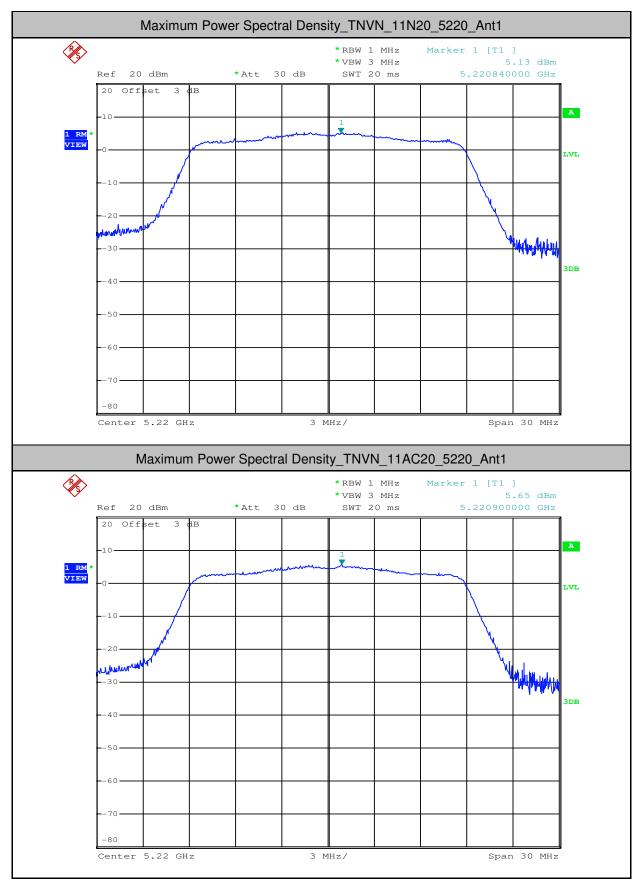




Report No.: SZEM180500434405 Page: 535 of 641

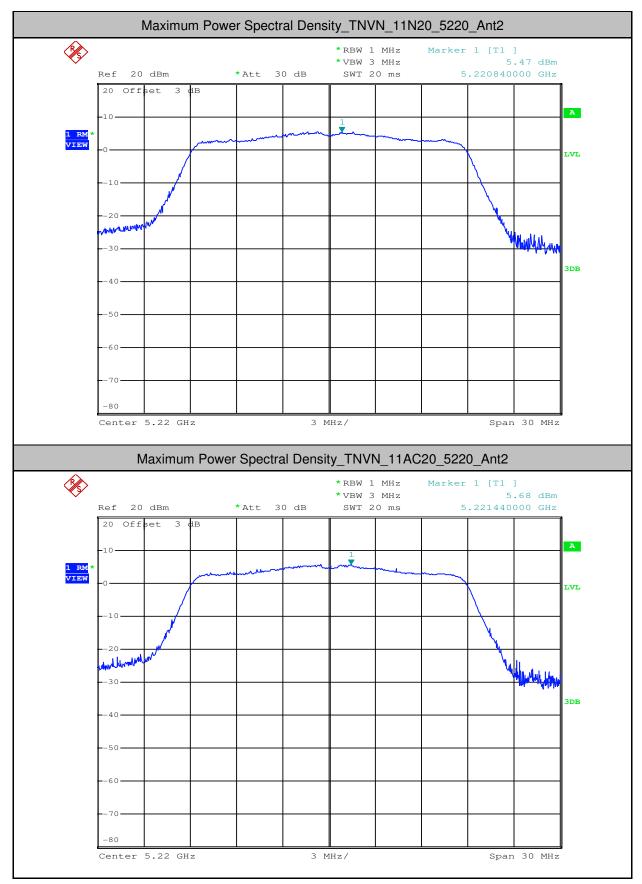




Report No.: SZEM180500434405 Page: 536 of 641

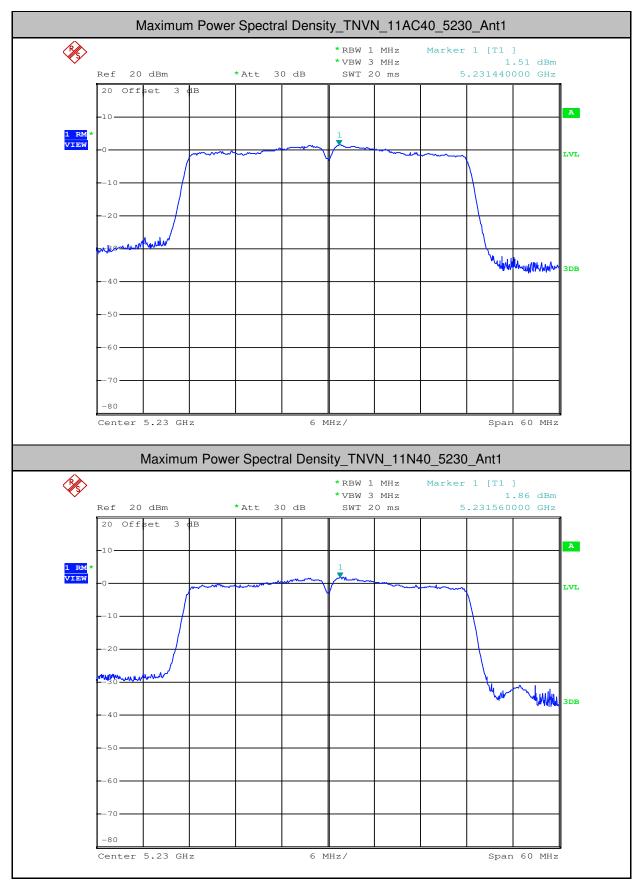




Report No.: SZEM180500434405 Page: 537 of 641

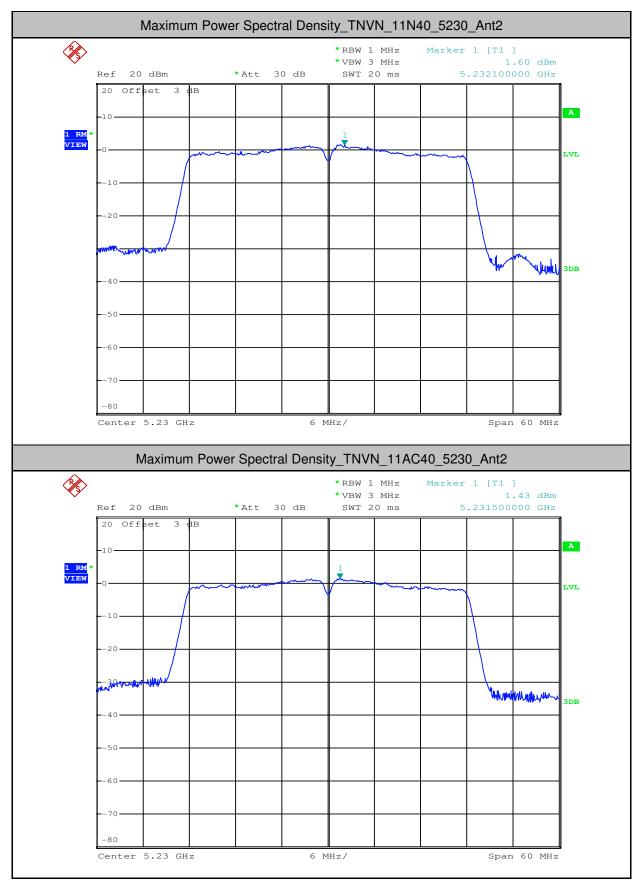




Report No.: SZEM180500434405 Page: 538 of 641

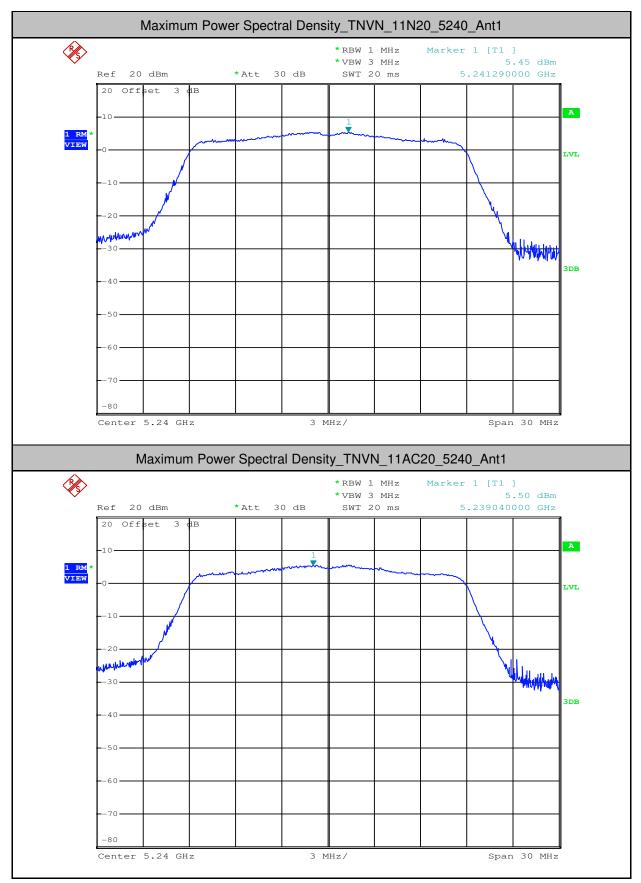




Report No.: SZEM180500434405 Page: 539 of 641

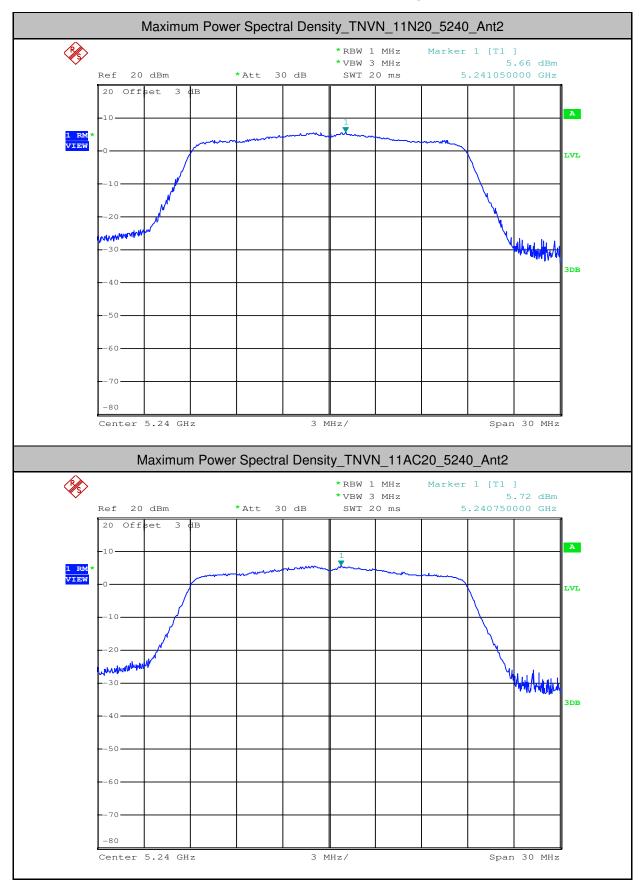




Report No.: SZEM180500434405 Page: 540 of 641

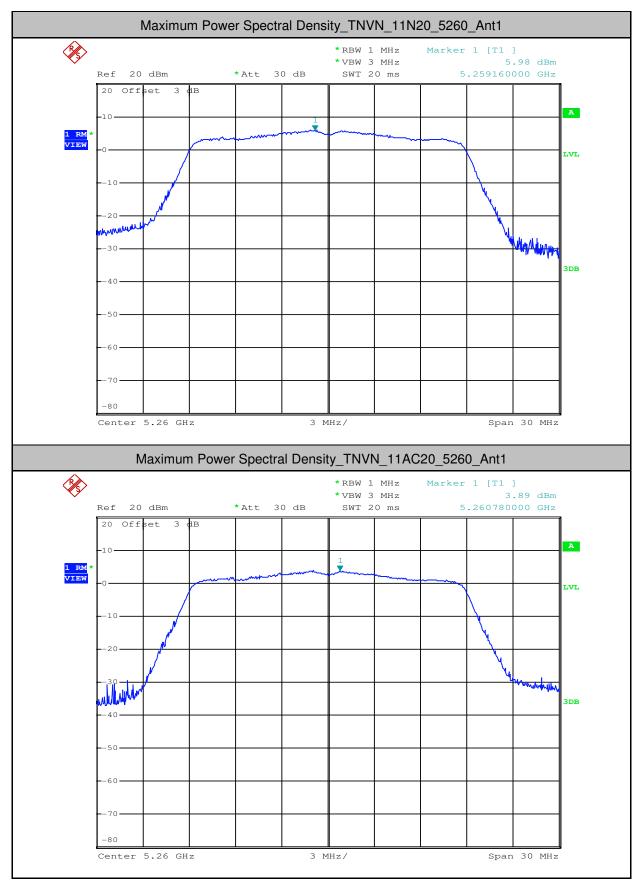




Report No.: SZEM180500434405 Page: 541 of 641

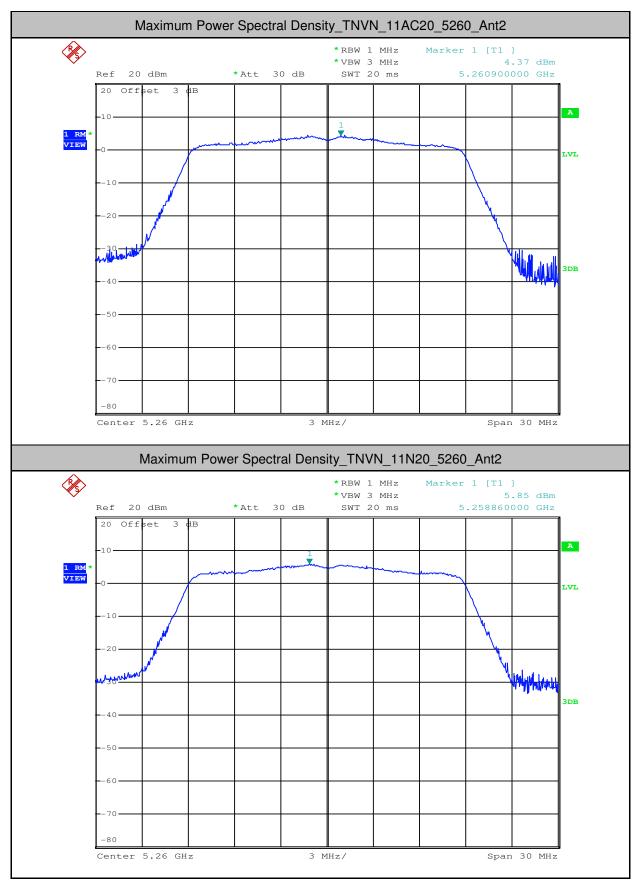




Report No.: SZEM180500434405 Page: 542 of 641

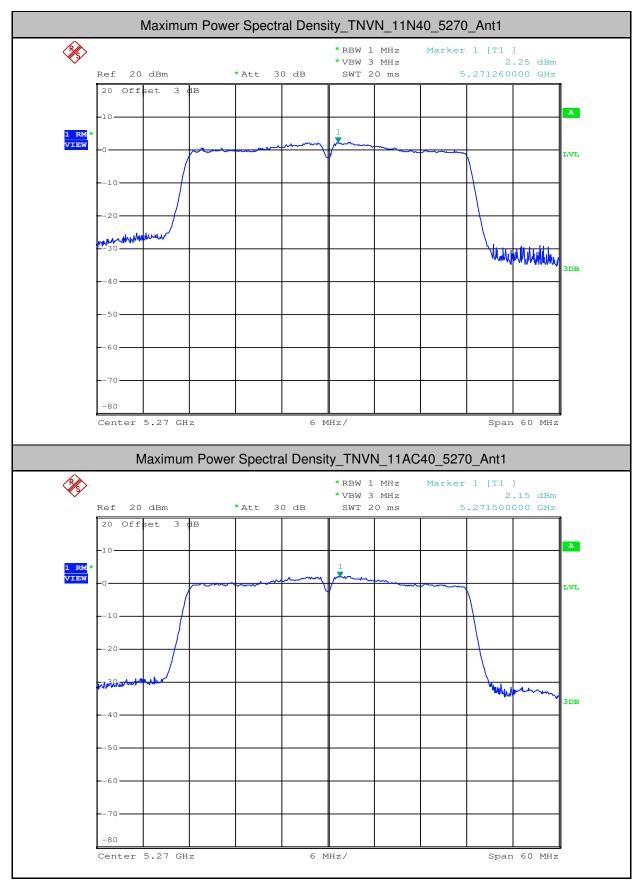




Report No.: SZEM180500434405 Page: 543 of 641

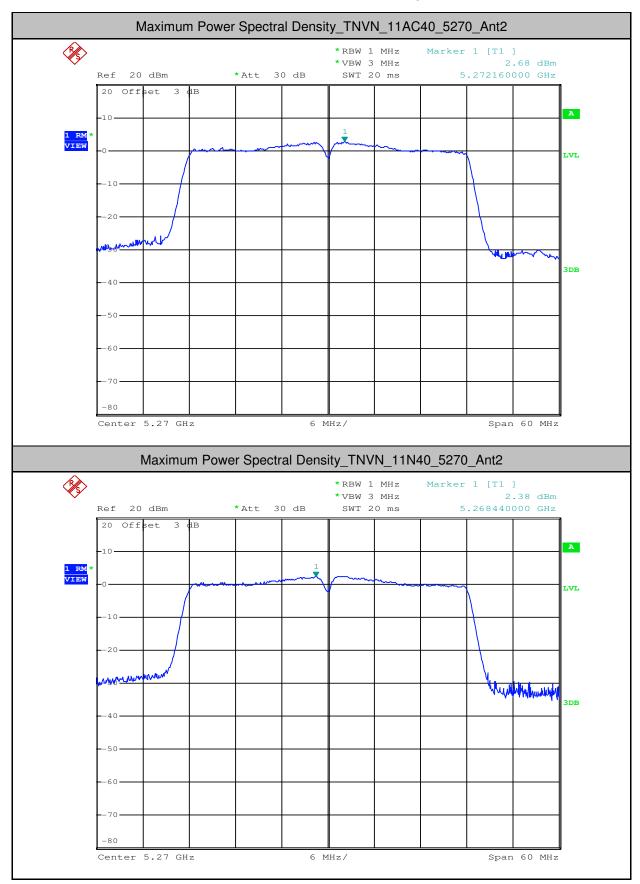




Report No.: SZEM180500434405 Page: 544 of 641

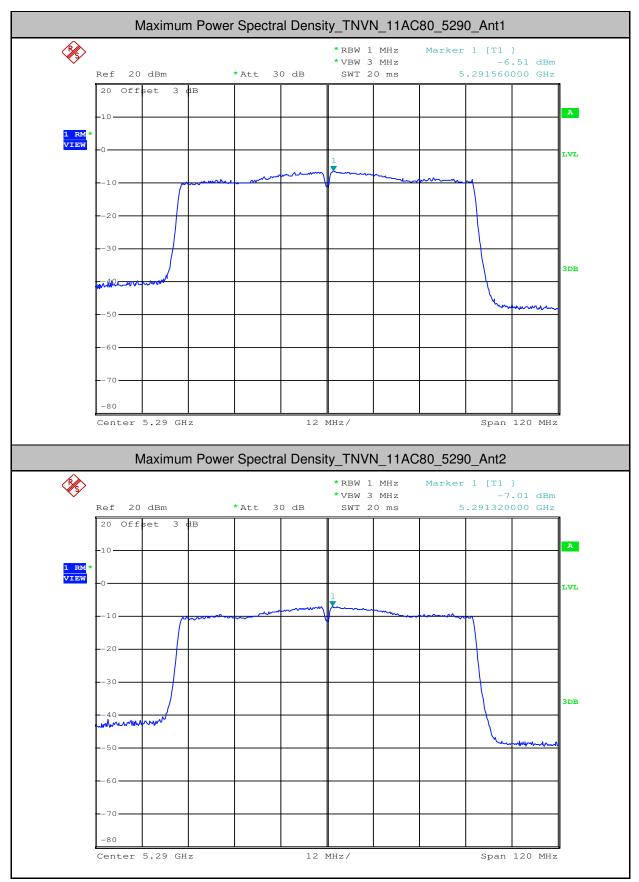




Report No.: SZEM180500434405 Page: 545 of 641

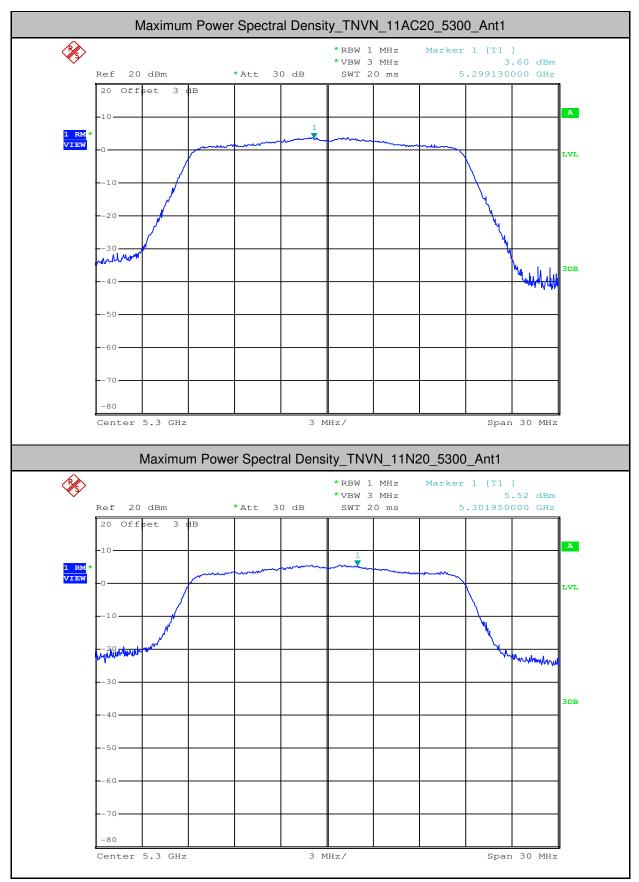




Report No.: SZEM180500434405 Page: 546 of 641

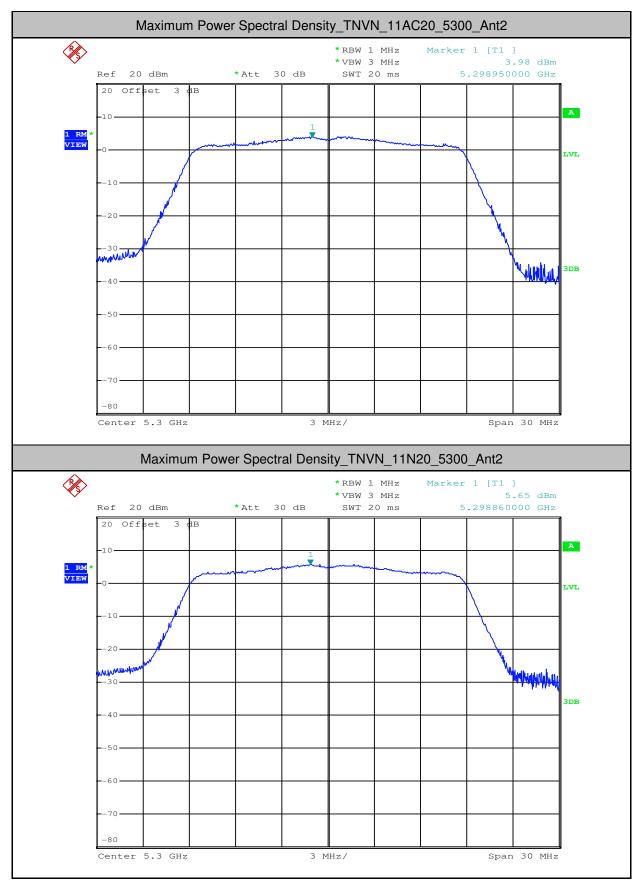




Report No.: SZEM180500434405 Page: 547 of 641

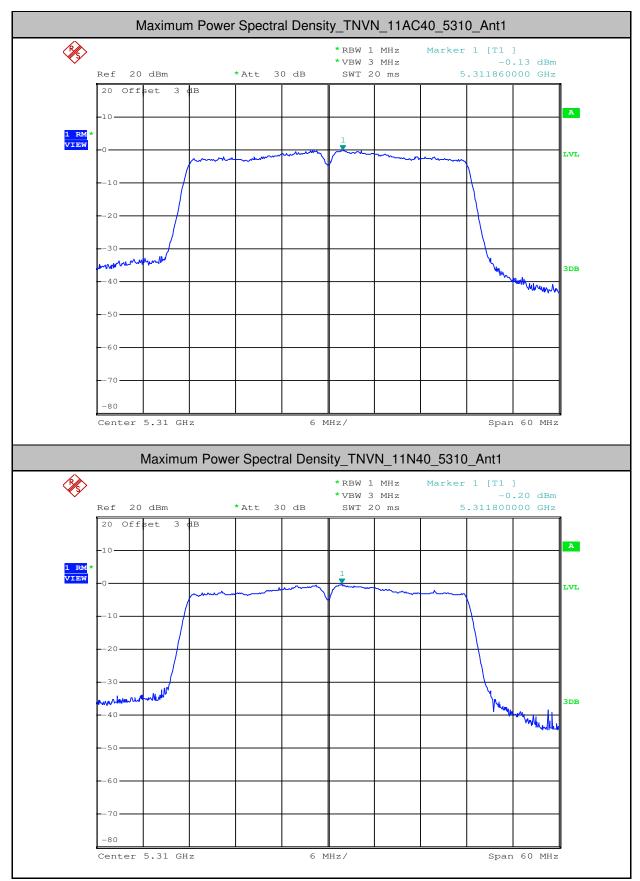




Report No.: SZEM180500434405 Page: 548 of 641

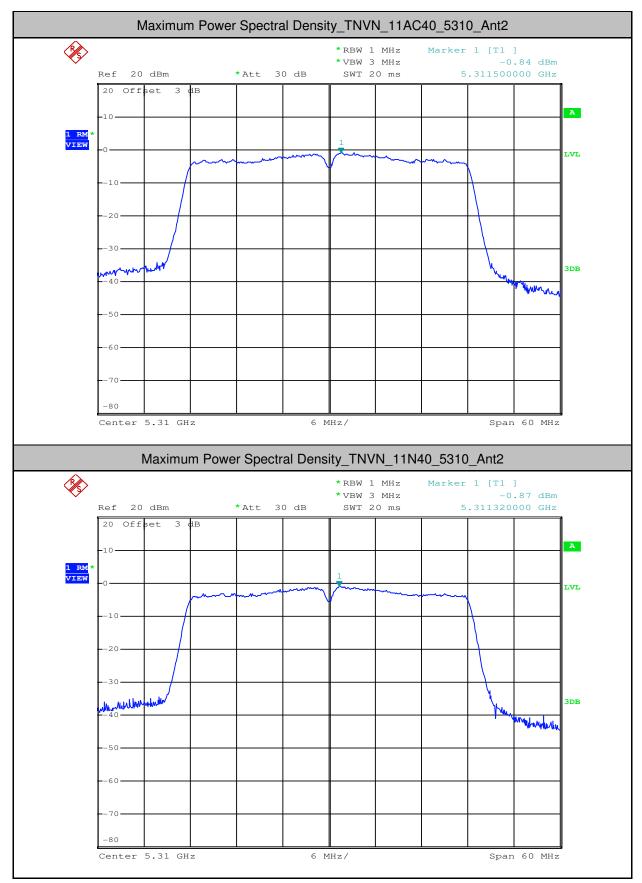




Report No.: SZEM180500434405 Page: 549 of 641

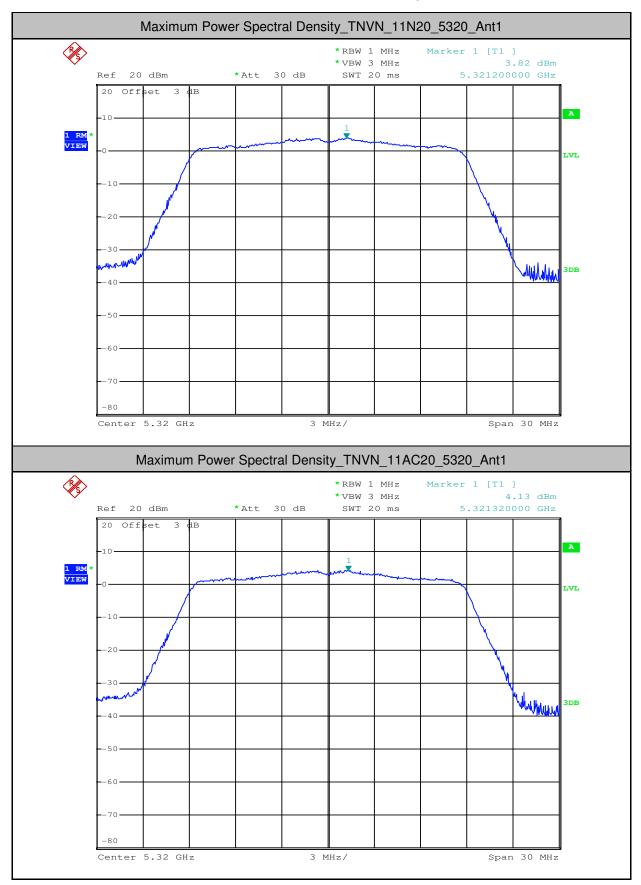




Report No.: SZEM180500434405 Page: 550 of 641

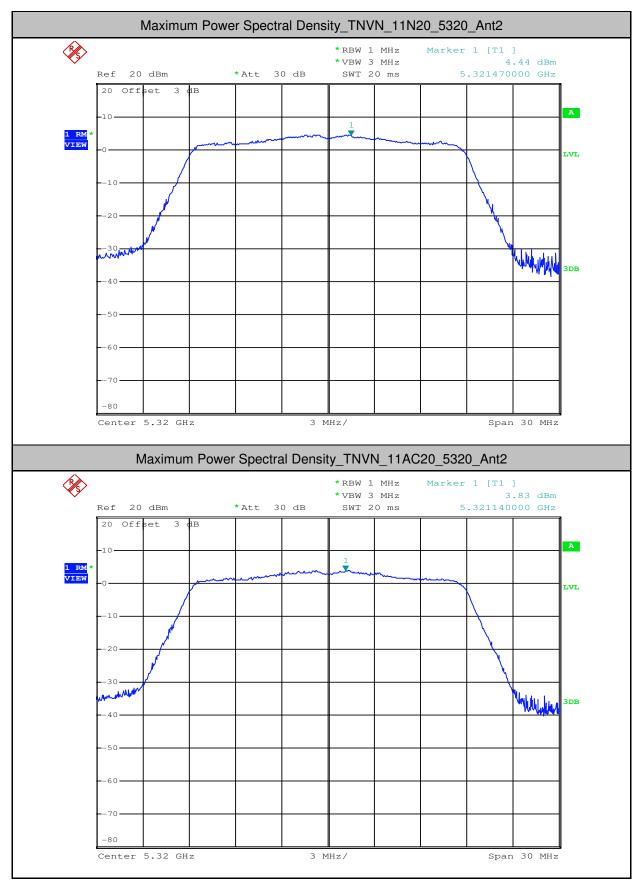




Report No.: SZEM180500434405 Page: 551 of 641

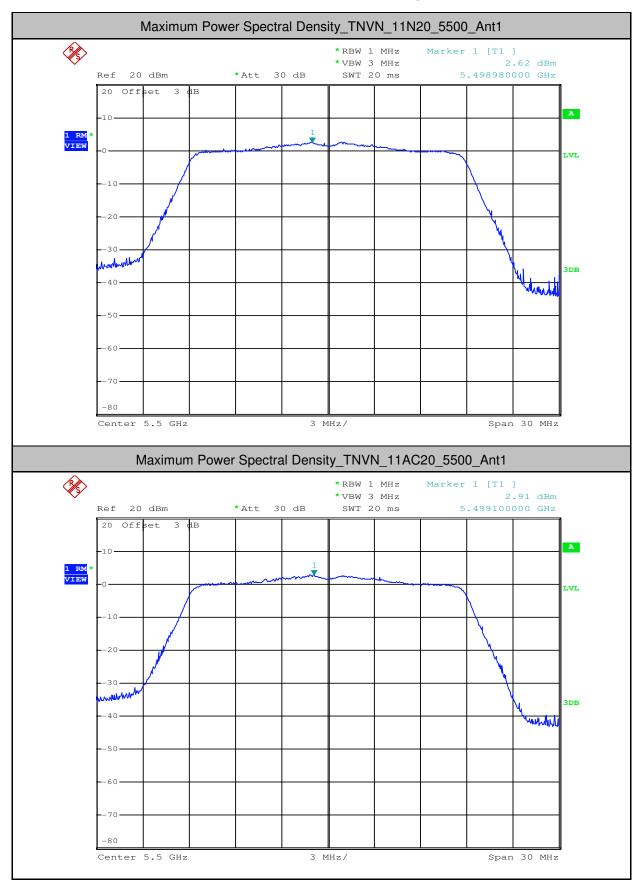




Report No.: SZEM180500434405 Page: 552 of 641

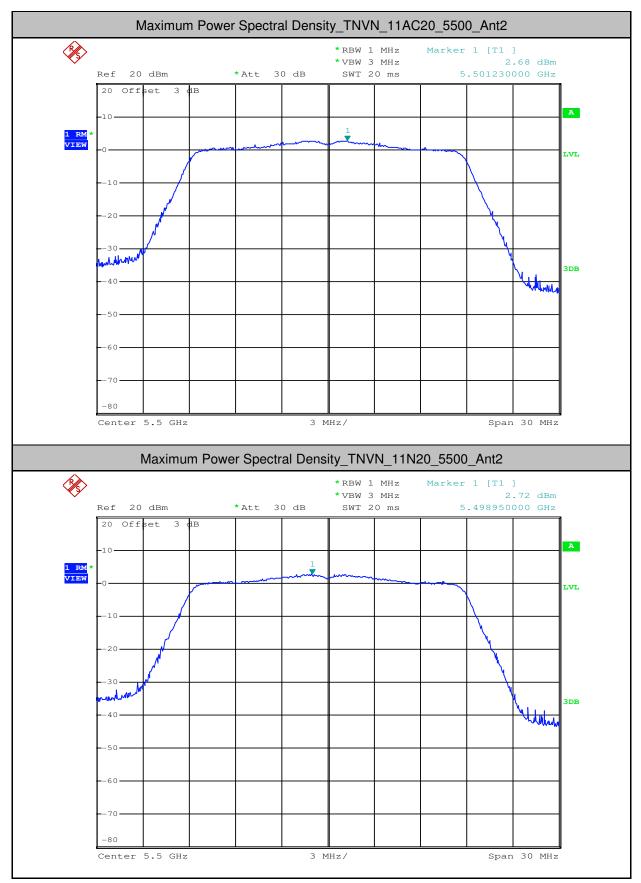




Report No.: SZEM180500434405 Page: 553 of 641

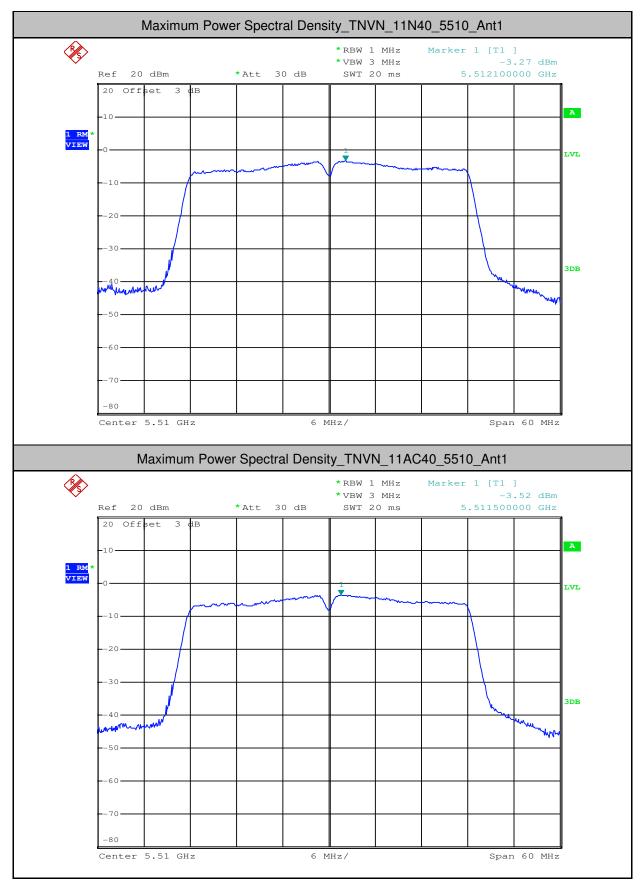




Report No.: SZEM180500434405 Page: 554 of 641

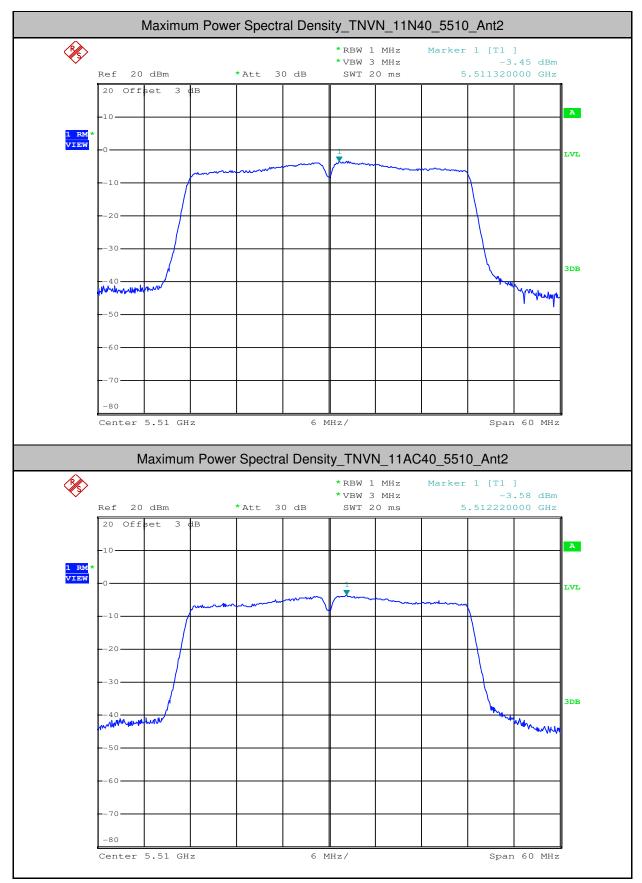




Report No.: SZEM180500434405 Page: 555 of 641

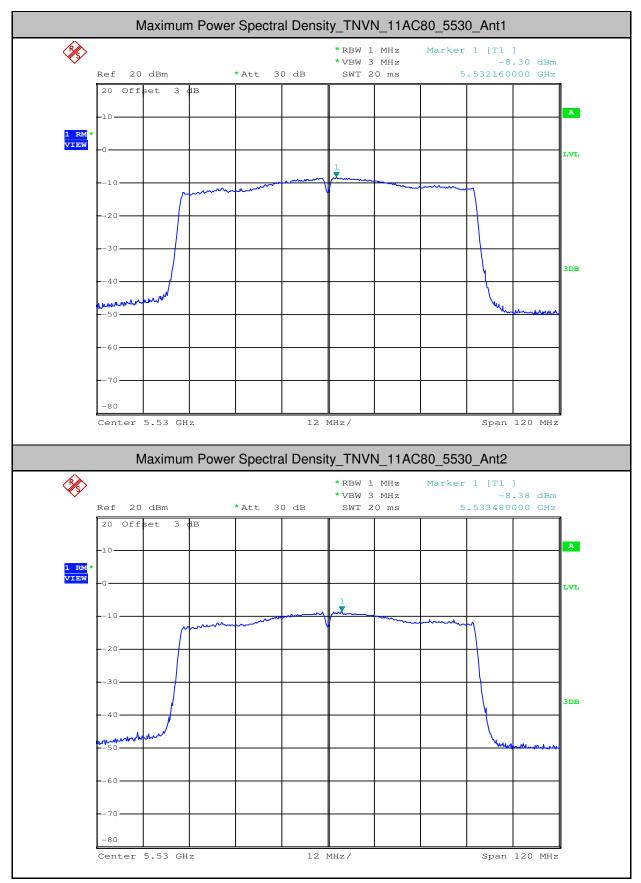




Report No.: SZEM180500434405 Page: 556 of 641

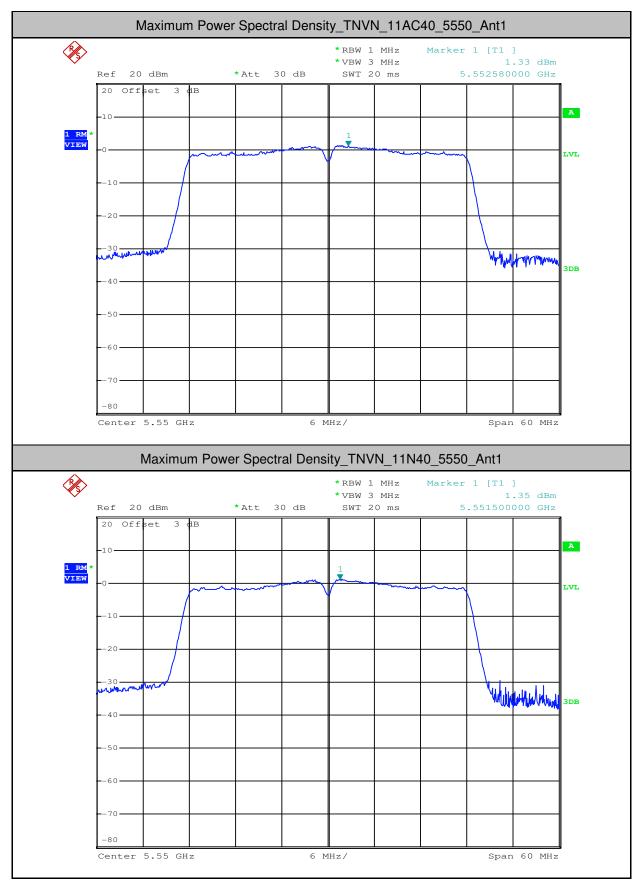




Report No.: SZEM180500434405 Page: 557 of 641

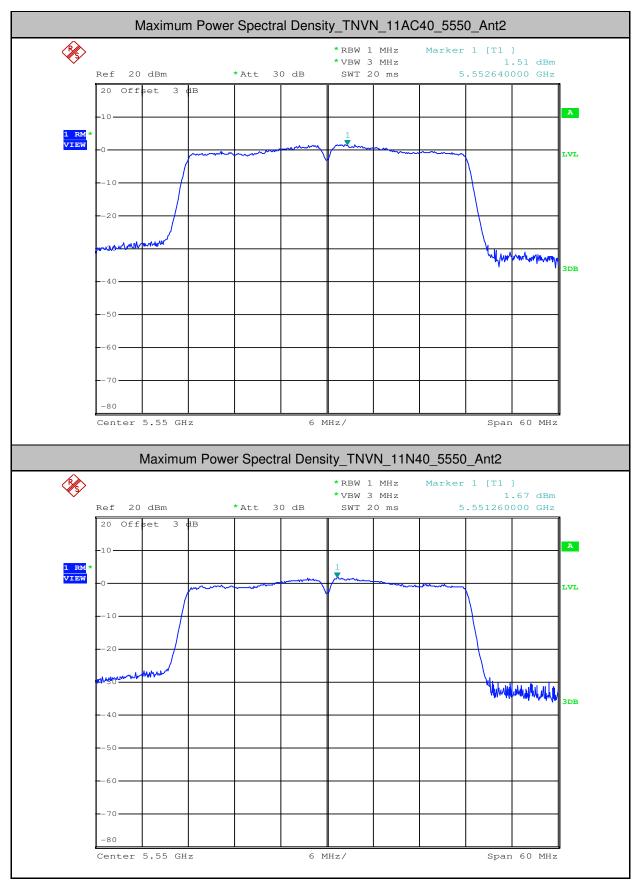




Report No.: SZEM180500434405 Page: 558 of 641

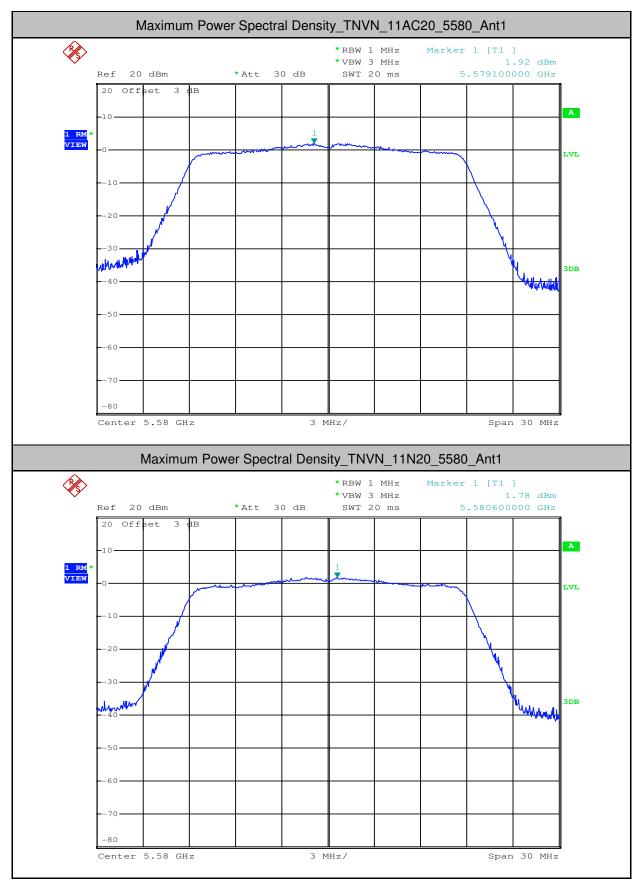




Report No.: SZEM180500434405 Page: 559 of 641

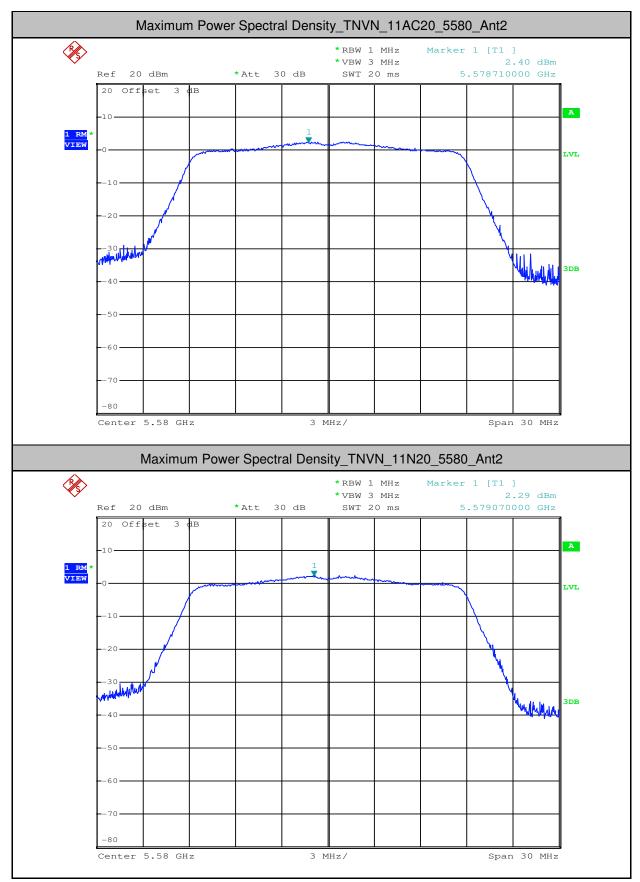




Report No.: SZEM180500434405 Page: 560 of 641

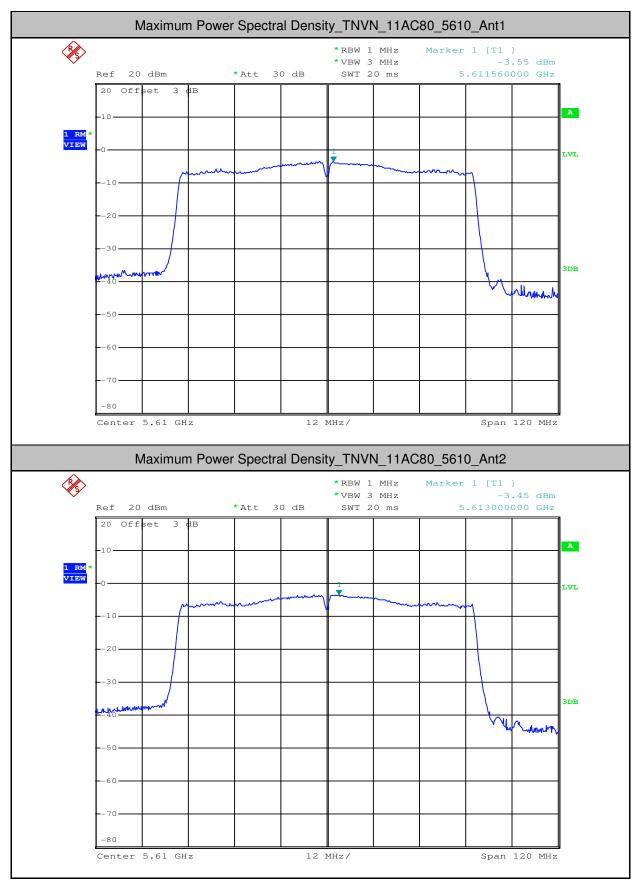




Report No.: SZEM180500434405 Page: 561 of 641

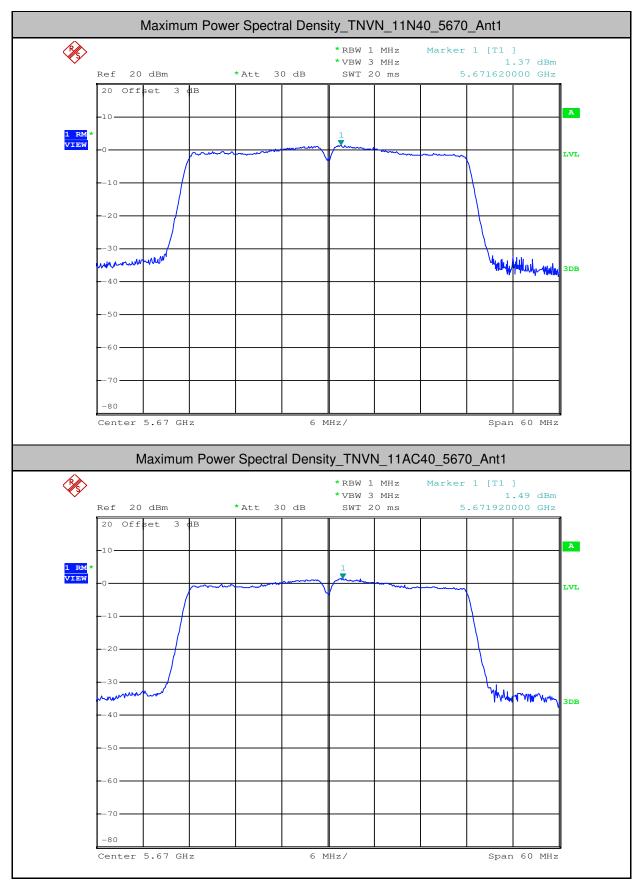




Report No.: SZEM180500434405 Page: 562 of 641

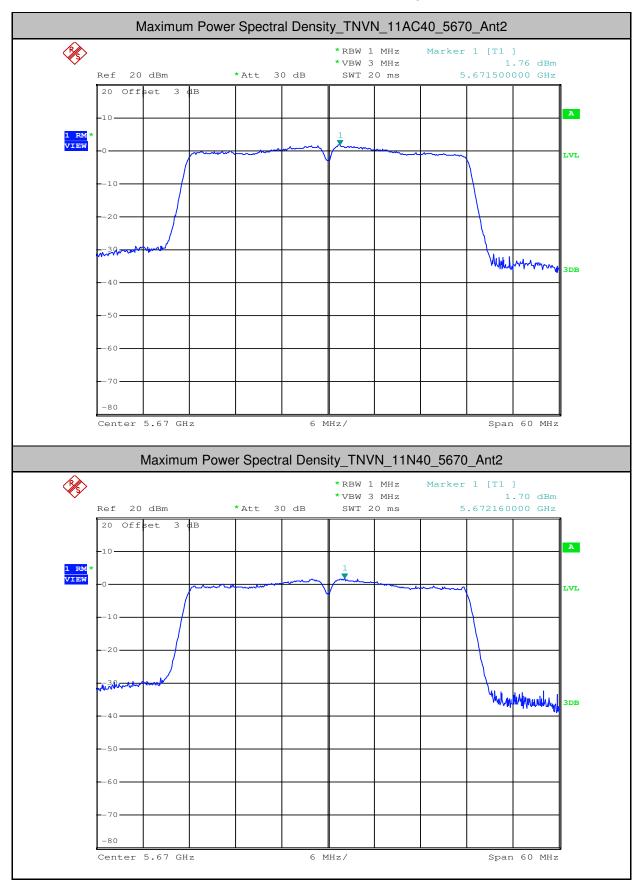




Report No.: SZEM180500434405 Page: 563 of 641

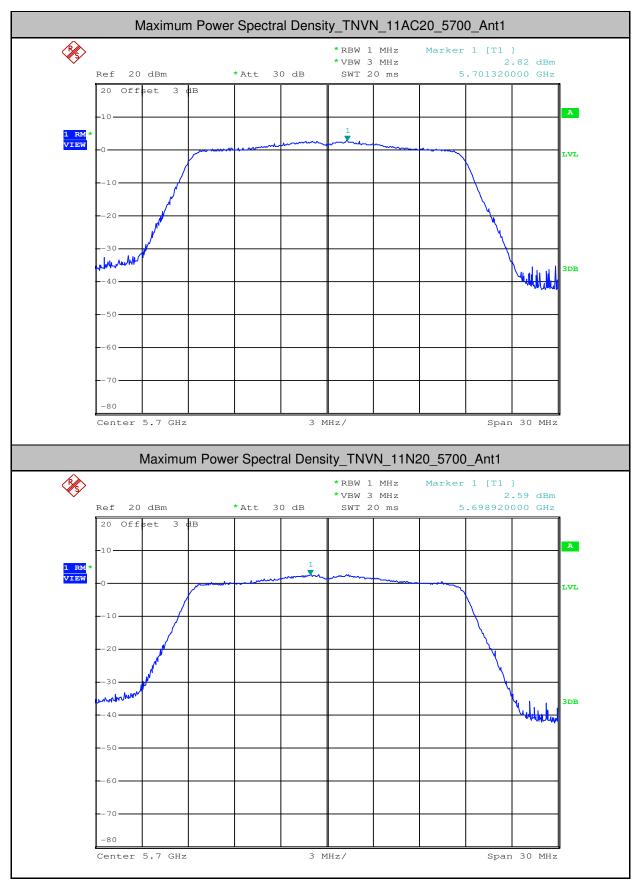




Report No.: SZEM180500434405 Page: 564 of 641

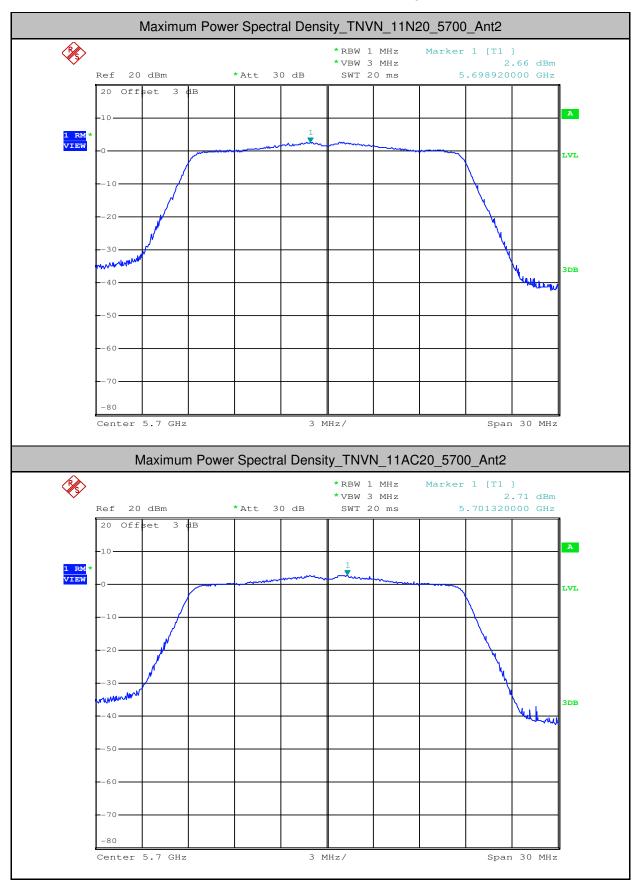




Report No.: SZEM180500434405 Page: 565 of 641

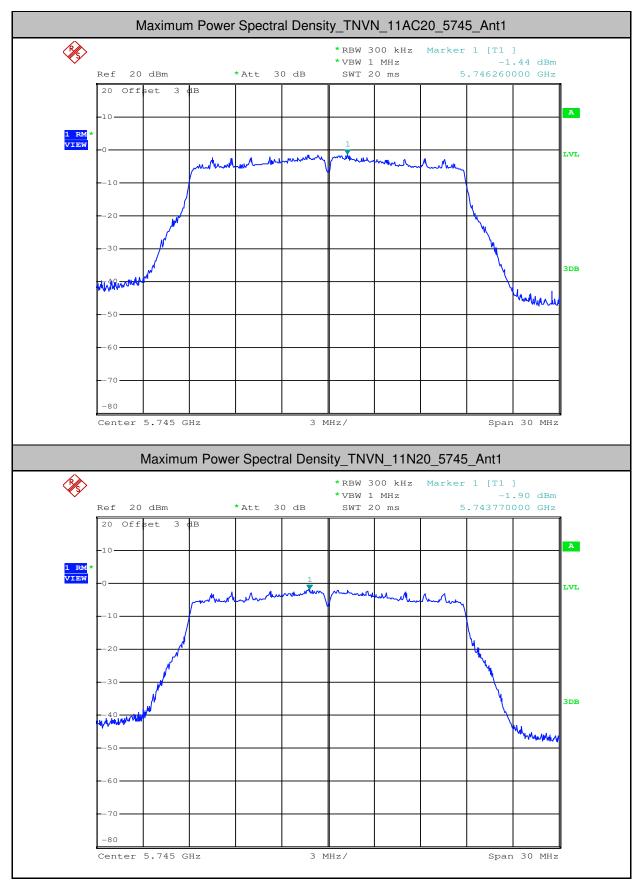




Report No.: SZEM180500434405 Page: 566 of 641

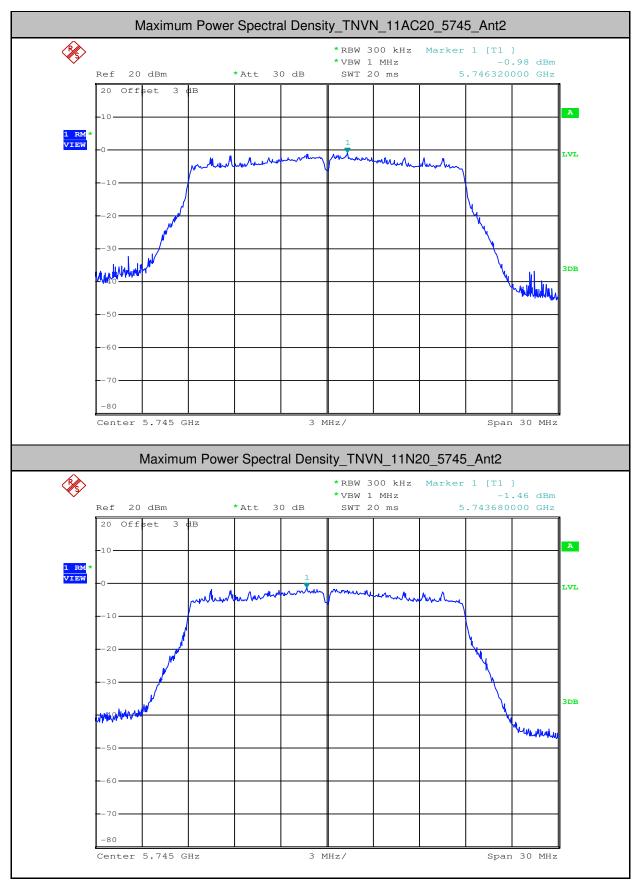




Report No.: SZEM180500434405 Page: 567 of 641

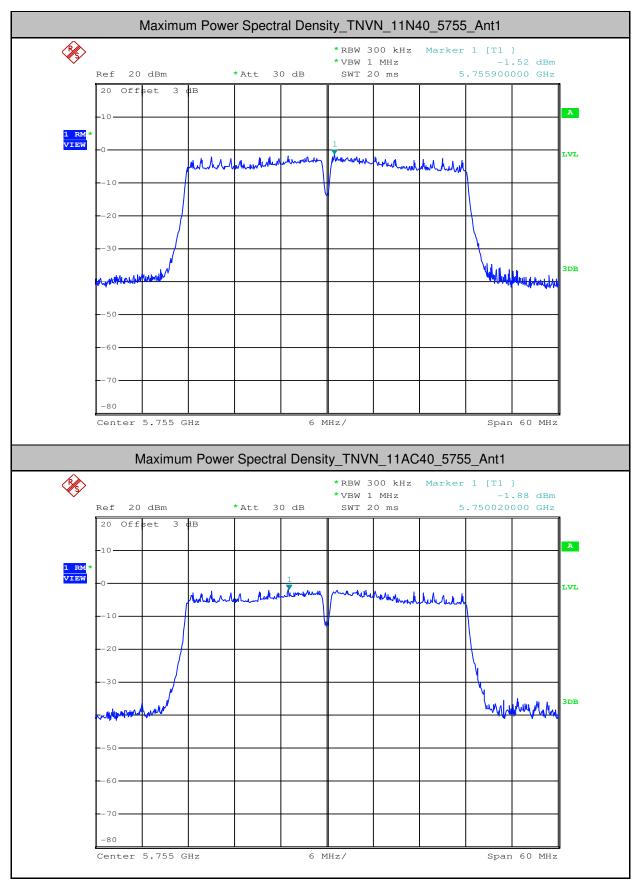




Report No.: SZEM180500434405 Page: 568 of 641

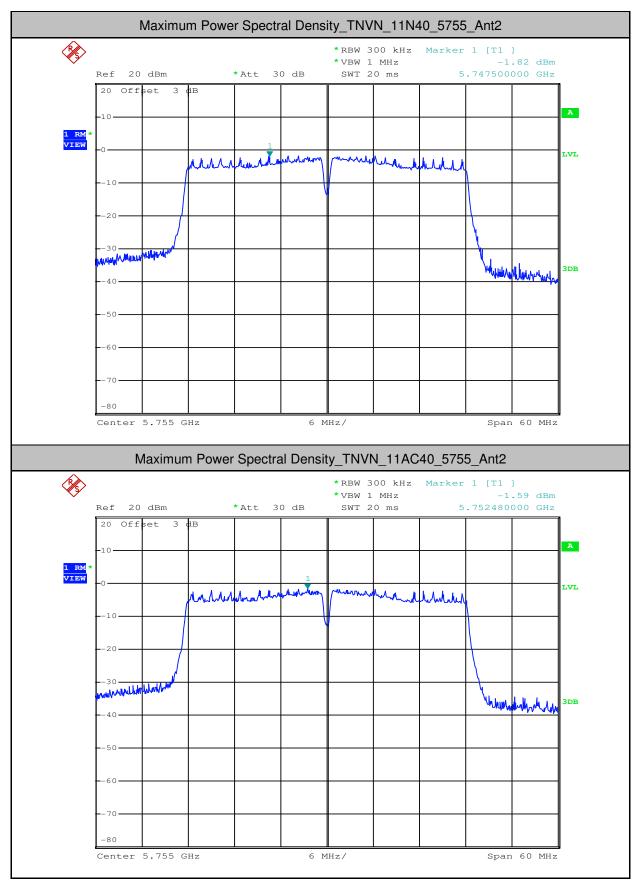




Report No.: SZEM180500434405 Page: 569 of 641

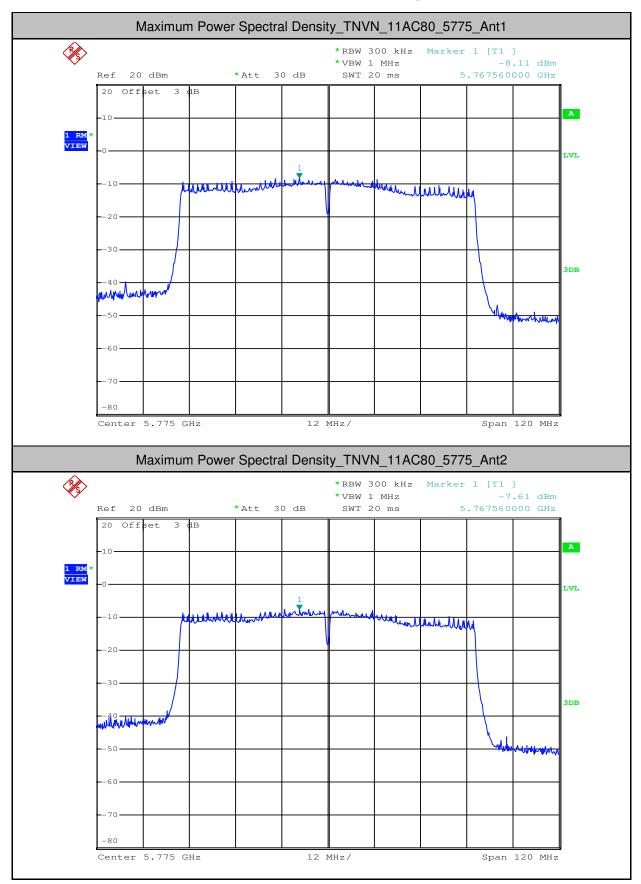




Report No.: SZEM180500434405 Page: 570 of 641

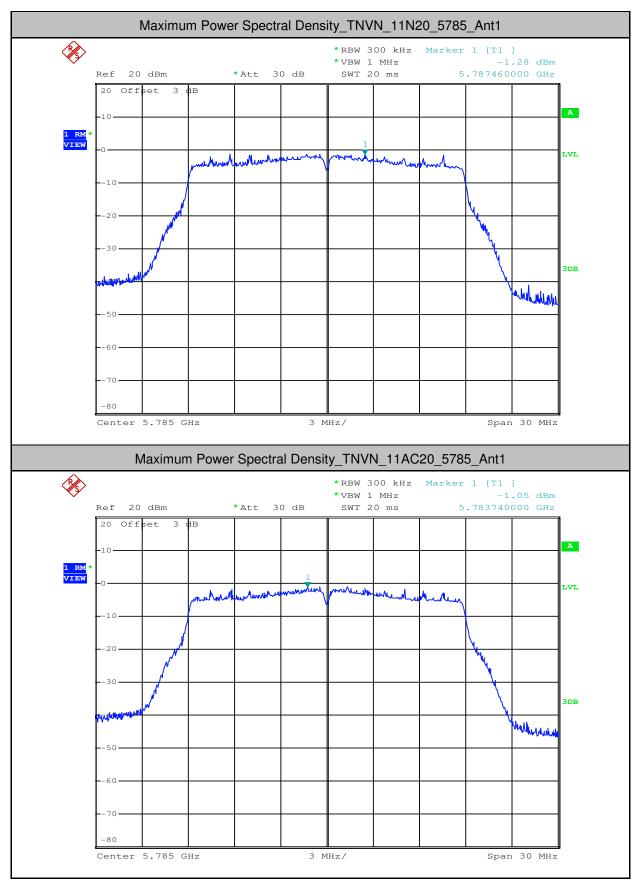




Report No.: SZEM180500434405 Page: 571 of 641

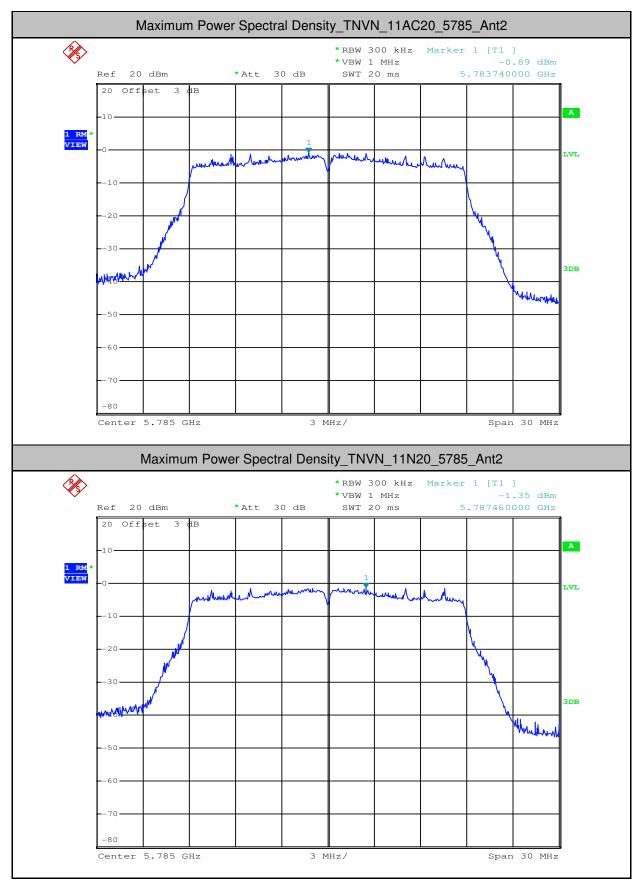




Report No.: SZEM180500434405 Page: 572 of 641

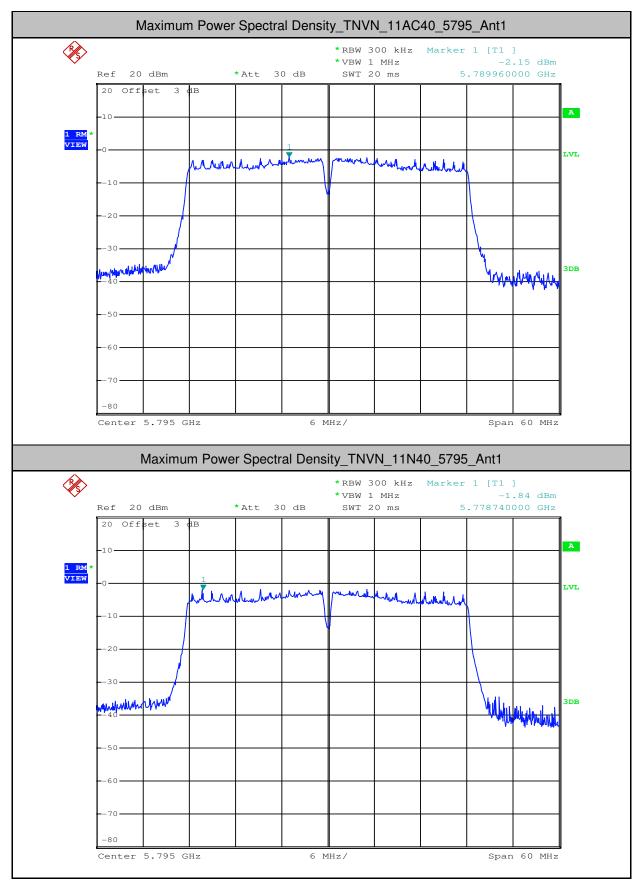




Report No.: SZEM180500434405 Page: 573 of 641

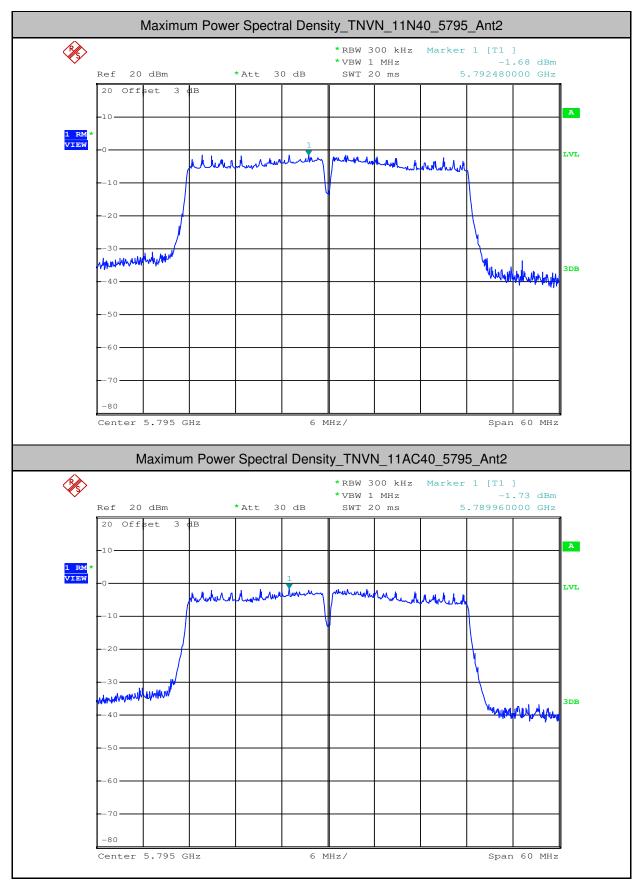




Report No.: SZEM180500434405 Page: 574 of 641

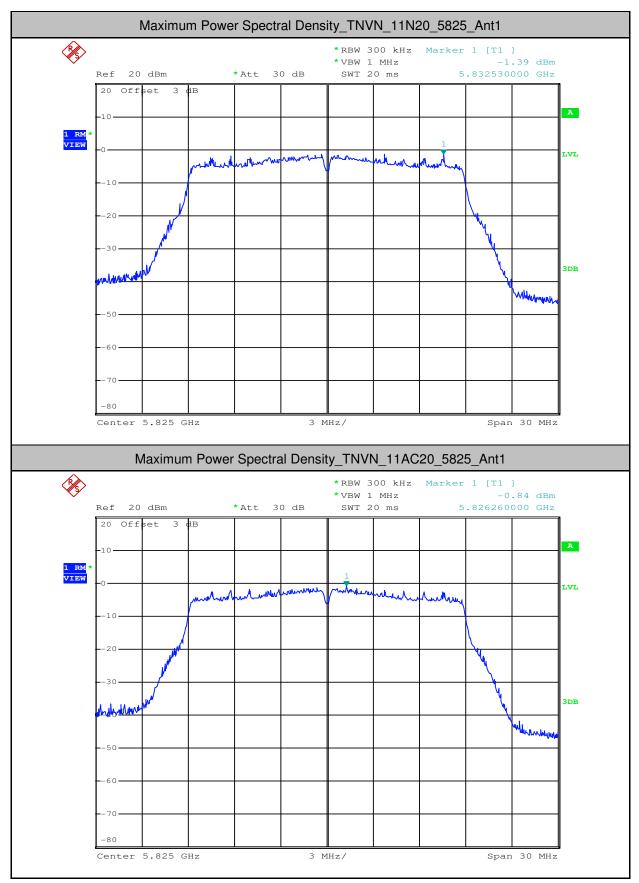



Report No.: SZEM180500434405 Page: 575 of 641

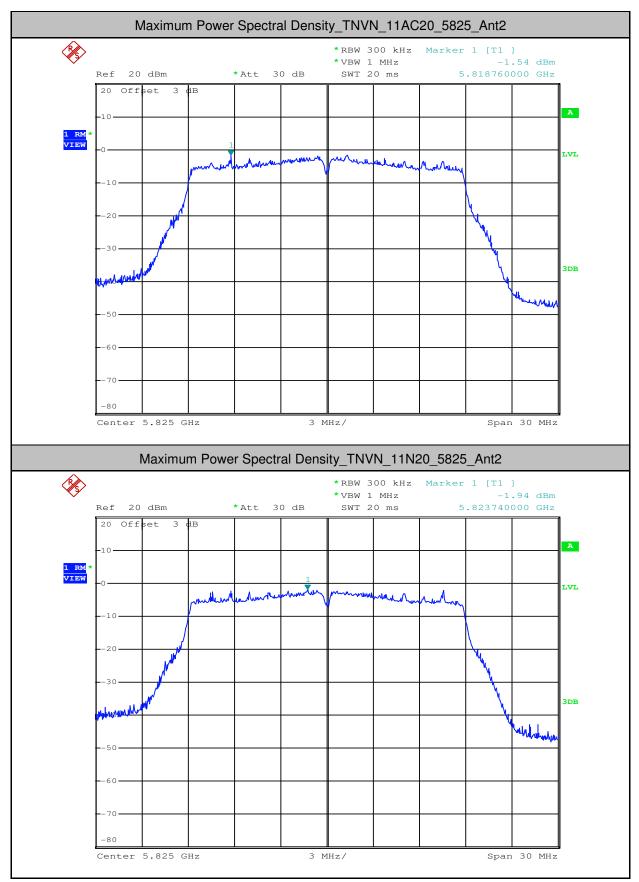



Report No.: SZEM180500434405 Page: 576 of 641

Test Mode	Test Channel	Ant	Duty Cycle[%]	10log(1/x) Factor[dB]
11A	5180	Ant1	94.44	0.25
11A	5180	Ant2	94.44	0.25
11A	5220	Ant1	94.44	0.25
11A	5220	Ant2	94.44	0.25
11A	5240	Ant1	94.44	0.25
11A	5240	Ant2	94.44	0.25
11A	5260	Ant1	94.44	0.25
11A	5260	Ant2	94.44	0.25
11A	5300	Ant1	93.06	0.31
11A	5300	Ant2	94.44	0.25
11A	5320	Ant1	94.44	0.25
11A	5320	Ant2	94.44	0.25
11A	5500	Ant1	94.44	0.25
11A	5500	Ant2	94.44	0.25
11A	5580	Ant1	94.44	0.25
11A	5580	Ant2	94.44	0.25
11A	5700	Ant1	94.44	0.25
11A	5700	Ant2	94.44	0.25
11A	5745	Ant1	94.44	0.25
11A	5745	Ant2	93.06	0.31
11A	5785	Ant1	94.44	0.25
11A	5785	Ant2	94.44	0.25
11A	5825	Ant1	94.44	0.25
11A	5825	Ant2	94.44	0.25
11N20	5180	Ant1	94.12	0.26
11AC20	5180	Ant1	94.12	0.26
11N20	5180	Ant2	94.03	0.27
11AC20	5180	Ant2	94.12	0.26
11N40	5190	Ant1	97.63	0.1
11AC40	5190	Ant1	97.64	0.1
11AC40	5190	Ant2	97.64	0.1

5.Duty Cycle (x)



Report No.: SZEM180500434405 Page: 577 of 641

			r ugo.	
11N40	5190	Ant2	97.62	0.1
11AC80	5210	Ant1	95.04	0.22
11AC80	5210	Ant2	95.04	0.22
11AC20	5220	Ant1	94.12	0.26
11N20	5220	Ant1	94.03	0.27
11N20	5220	Ant2	94.03	0.27
11AC20	5220	Ant2	94.12	0.26
11AC40	5230	Ant1	98.02	0.09
11N40	5230	Ant1	97.23	0.12
11N40	5230	Ant2	97.23	0.12
11AC40	5230	Ant2	97.25	0.12
11N20	5240	Ant1	94.12	0.26
11AC20	5240	Ant1	94.12	0.26
11N20	5240	Ant2	94.12	0.26
11AC20	5240	Ant2	92.65	0.33
11N20	5260	Ant1	94.03	0.27
11AC20	5260	Ant1	94.12	0.26
11AC20	5260	Ant2	94.12	0.26
11N20	5260	Ant2	94.03	0.27
11AC40	5270	Ant1	88.57	0.53
11N40	5270	Ant1	88.57	0.53
11N40	5270	Ant2	88.57	0.53
11AC40	5270	Ant2	88.57	0.53
11AC80	5290	Ant1	95.74	0.19
11AC80	5290	Ant2	95.77	0.19
11N20	5300	Ant1	94.12	0.26
11AC20	5300	Ant1	94.12	0.26
11N20	5300	Ant2	94.03	0.27
11AC20	5300	Ant2	94.12	0.26
11N40	5310	Ant1	88.24	0.54
11AC40	5310	Ant1	88.57	0.53
11N40	5310	Ant2	88.57	0.53
11AC40	5310	Ant2	85.71	0.67
11N20	5320	Ant1	94.03	0.27



Report No.: SZEM180500434405 Page: 578 of 641

			r ago.	
11AC20	5320	Ant1	94.12	0.26
11AC20	5320	Ant2	92.65	0.33
11N20	5320	Ant2	92.65	0.33
11N20	5500	Ant1	94.12	0.26
11AC20	5500	Ant1	94.12	0.26
11AC20	5500	Ant2	94.12	0.26
11N20	5500	Ant2	94.03	0.27
11N40	5510	Ant1	97.63	0.1
11AC40	5510	Ant1	97.64	0.1
11N40	5510	Ant2	97.23	0.12
11AC40	5510	Ant2	97.63	0.1
11AC80	5530	Ant1	95.77	0.19
11AC80	5530	Ant2	95.04	0.22
11N40	5550	Ant1	88.57	0.53
11AC40	5550	Ant1	88.57	0.53
11N40	5550	Ant2	88.24	0.54
11AC40	5550	Ant2	88.57	0.53
11N20	5580	Ant1	94.03	0.27
11AC20	5580	Ant1	94.12	0.26
11AC20	5580	Ant2	94.12	0.26
11N20	5580	Ant2	94.12	0.26
11AC80	5610	Ant1	95.74	0.19
11AC80	5610	Ant2	95.74	0.19
11N40	5670	Ant1	88.24	0.54
11AC40	5670	Ant1	88.57	0.53
11AC40	5670	Ant2	88.57	0.53
11N40	5670	Ant2	88.57	0.53
11AC20	5700	Ant1	94.12	0.26
11N20	5700	Ant1	94.12	0.26
11N20	5700	Ant2	94.12	0.26
11AC20	5700	Ant2	94.12	0.26
11AC20	5745	Ant1	94.12	0.26
11N20	5745	Ant1	94.03	0.27
11AC20	5745	Ant2	94.12	0.26




Report No.: SZEM180500434405 Page: 579 of 641

11N20	5745	Ant2	92.65	0.33
11N40	5755	Ant1	88.57	0.53
11AC40	5755	Ant1	88.57	0.53
11N40	5755	Ant2	88.24	0.54
11AC40	5755	Ant2	85.71	0.67
11AC80	5775	Ant1	95.71	0.19
11AC80	5775	Ant2	95.07	0.22
11N20	5785	Ant1	94.03	0.27
11AC20	5785	Ant1	94.12	0.26
11N20	5785	Ant2	94.12	0.26
11AC20	5785	Ant2	94.12	0.26
11N40	5795	Ant1	88.24	0.54
11AC40	5795	Ant1	88.57	0.53
11N40	5795	Ant2	88.24	0.54
11AC40	5795	Ant2	88.57	0.53
11N20	5825	Ant1	94.03	0.27
11AC20	5825	Ant1	94.12	0.26
11AC20	5825	Ant2	94.12	0.26
11N20	5825	Ant2	94.12	0.26




Report No.: SZEM180500434405 Page: 580 of 641

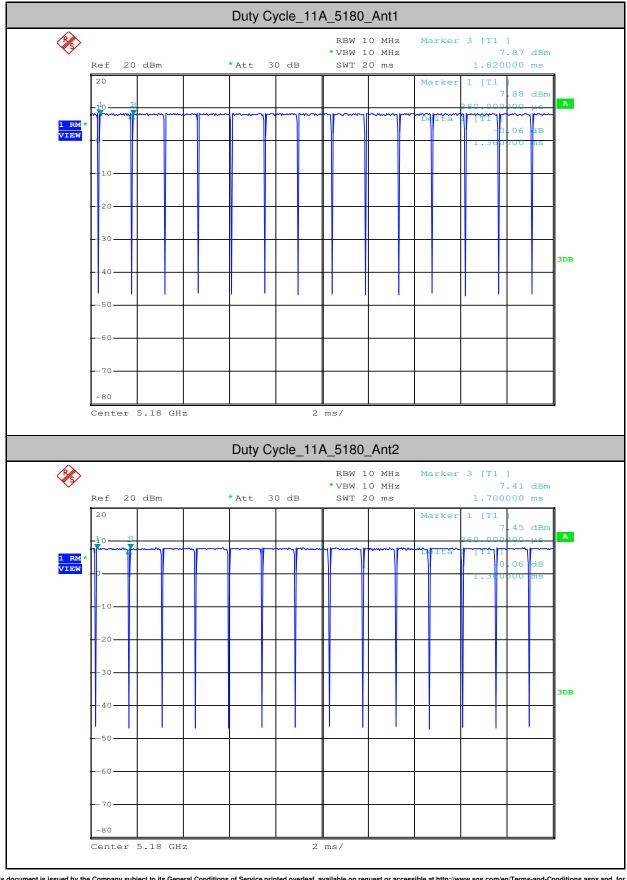




Report No.: SZEM180500434405 Page: 581 of 641

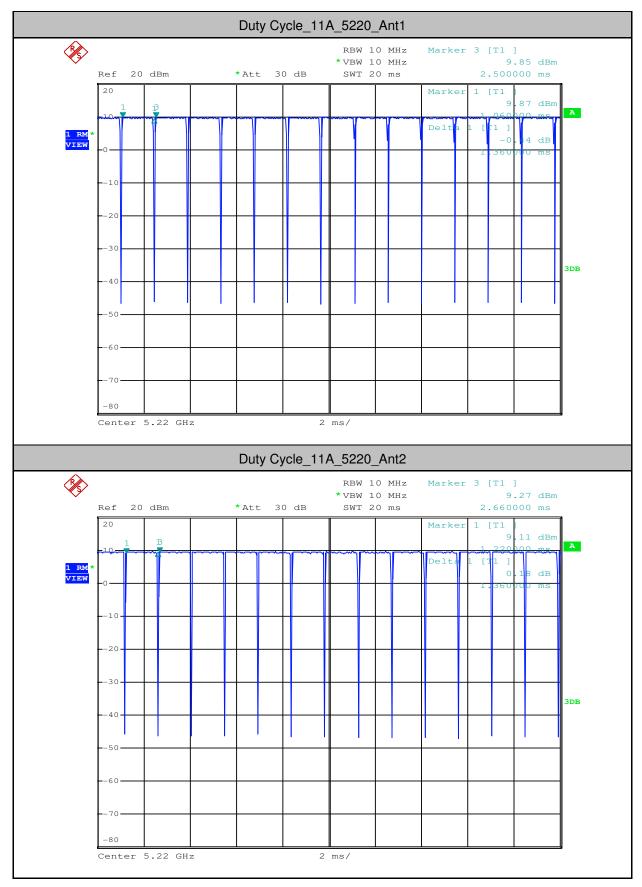




Report No.: SZEM180500434405 Page: 582 of 641

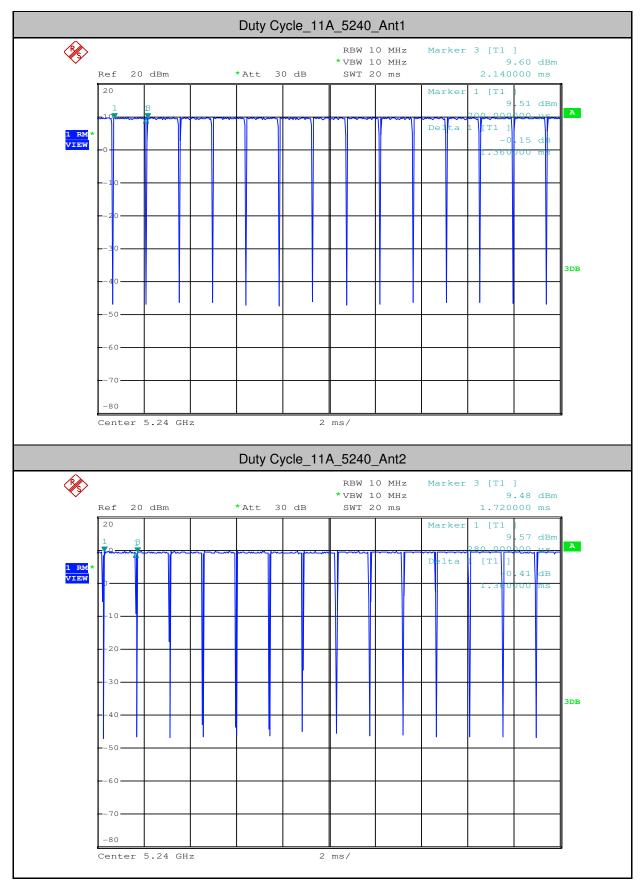




Report No.: SZEM180500434405 Page: 583 of 641

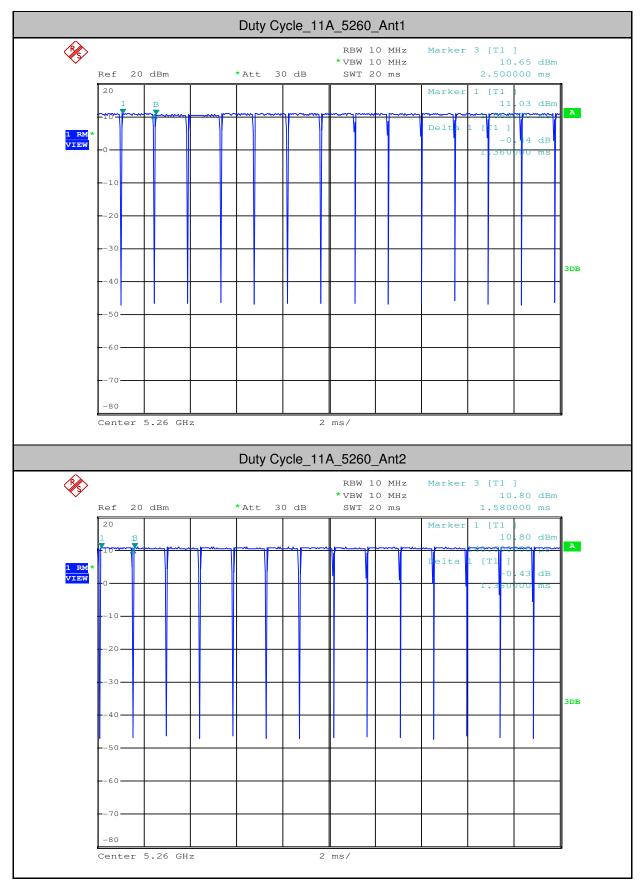



Report No.: SZEM180500434405 Page: 584 of 641

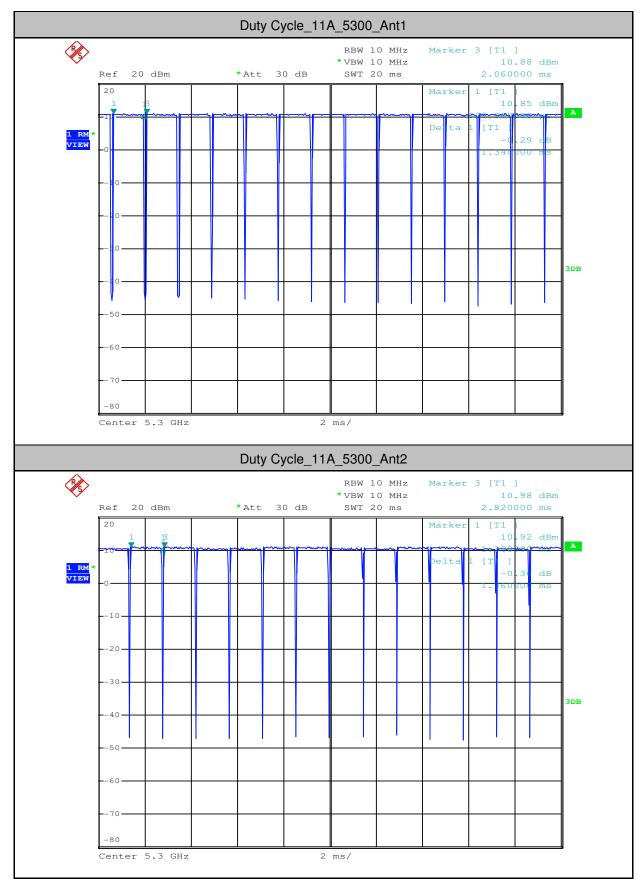




Report No.: SZEM180500434405 Page: 585 of 641





Report No.: SZEM180500434405 Page: 586 of 641

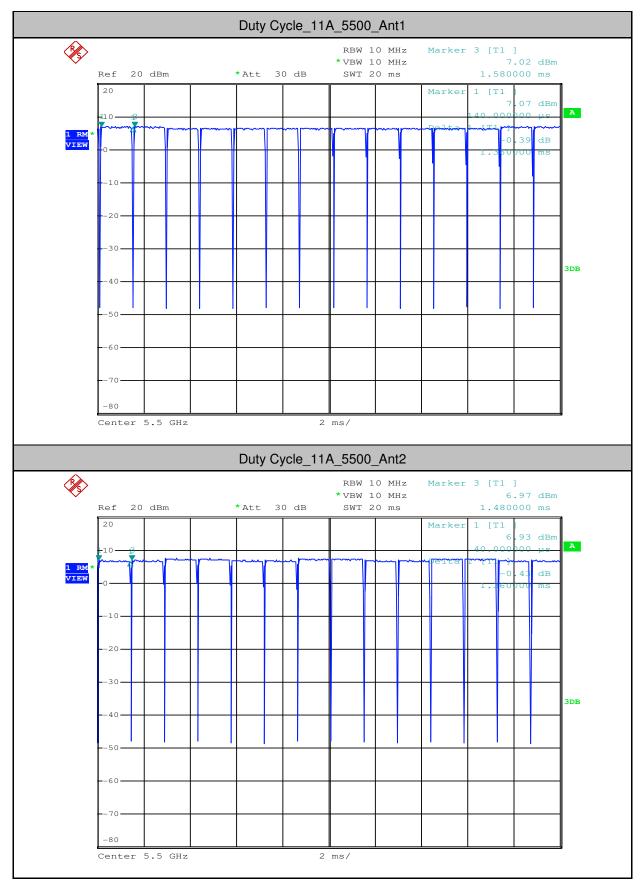




Report No.: SZEM180500434405 Page: 587 of 641





Report No.: SZEM180500434405 Page: 588 of 641

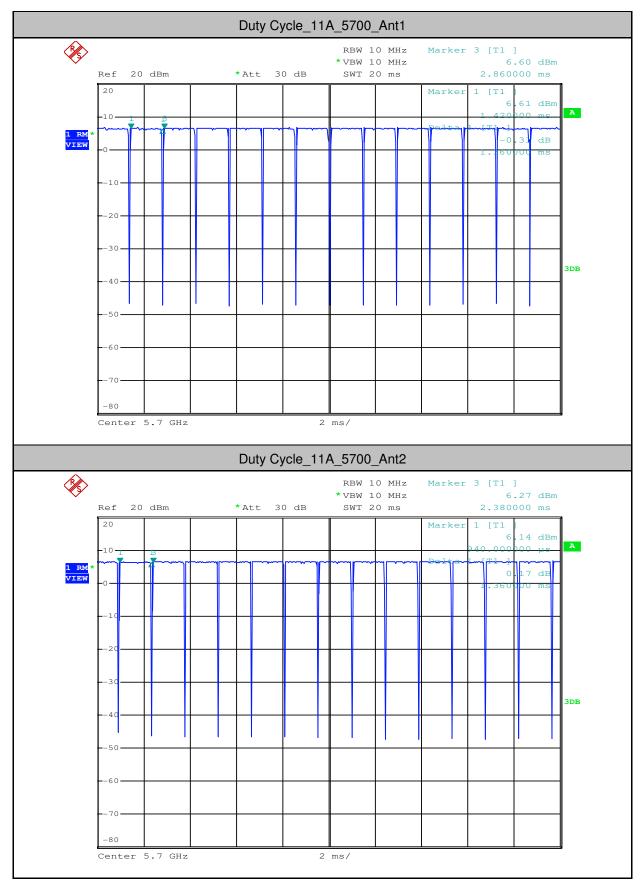




Report No.: SZEM180500434405 Page: 589 of 641





Report No.: SZEM180500434405 Page: 590 of 641

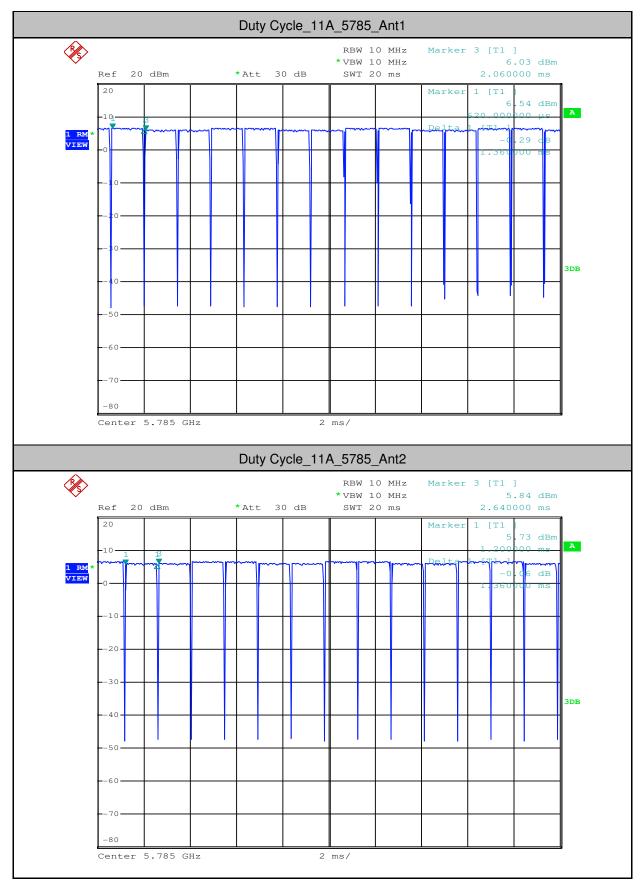



Report No.: SZEM180500434405 Page: 591 of 641





Report No.: SZEM180500434405 Page: 592 of 641





Report No.: SZEM180500434405 Page: 593 of 641





Report No.: SZEM180500434405 Page: 594 of 641





Report No.: SZEM180500434405 Page: 595 of 641






Report No.: SZEM180500434405 Page: 596 of 641





Report No.: SZEM180500434405 Page: 597 of 641

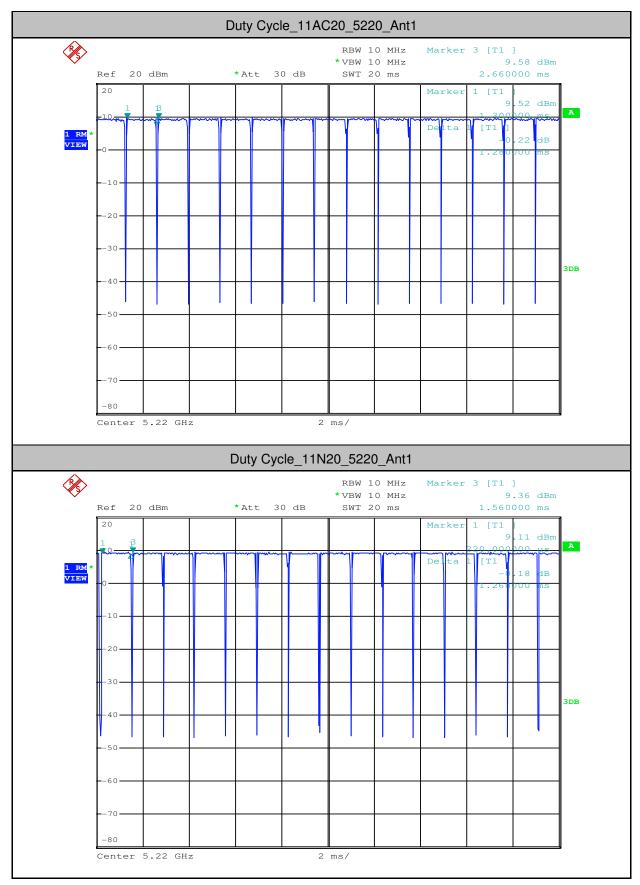



Report No.: SZEM180500434405 Page: 598 of 641





Report No.: SZEM180500434405 Page: 599 of 641






Report No.: SZEM180500434405 Page: 600 of 641






Report No.: SZEM180500434405 Page: 601 of 641

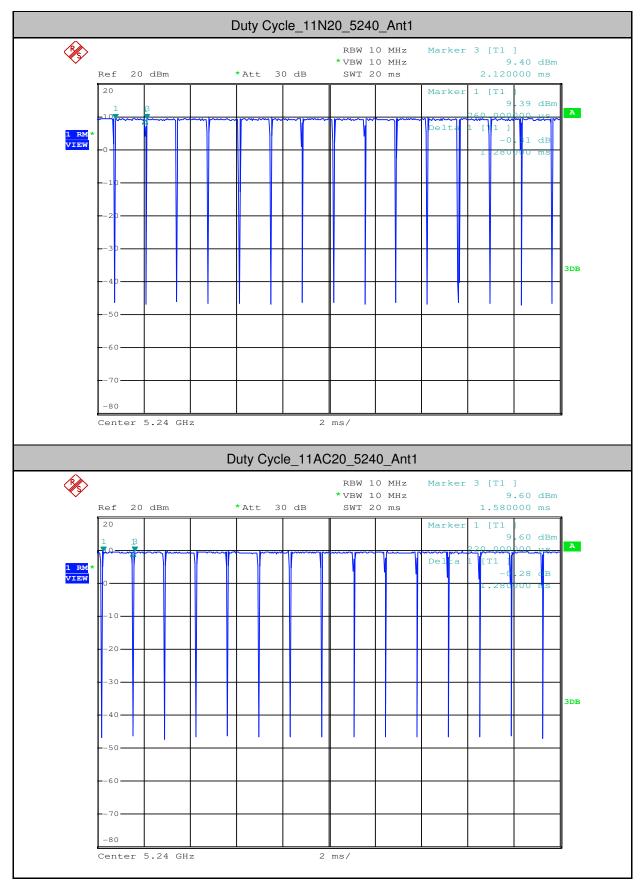




Report No.: SZEM180500434405 Page: 602 of 641

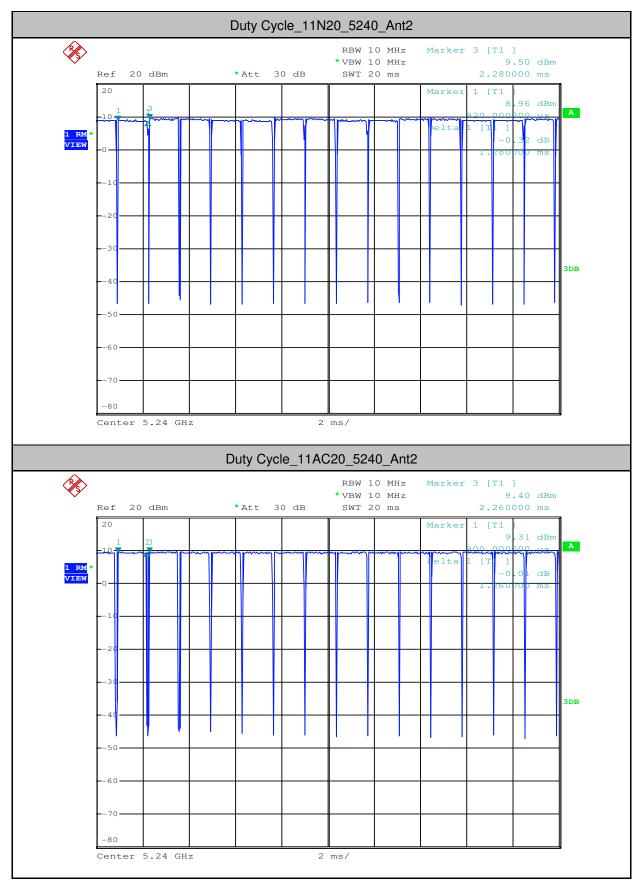




Report No.: SZEM180500434405 Page: 603 of 641

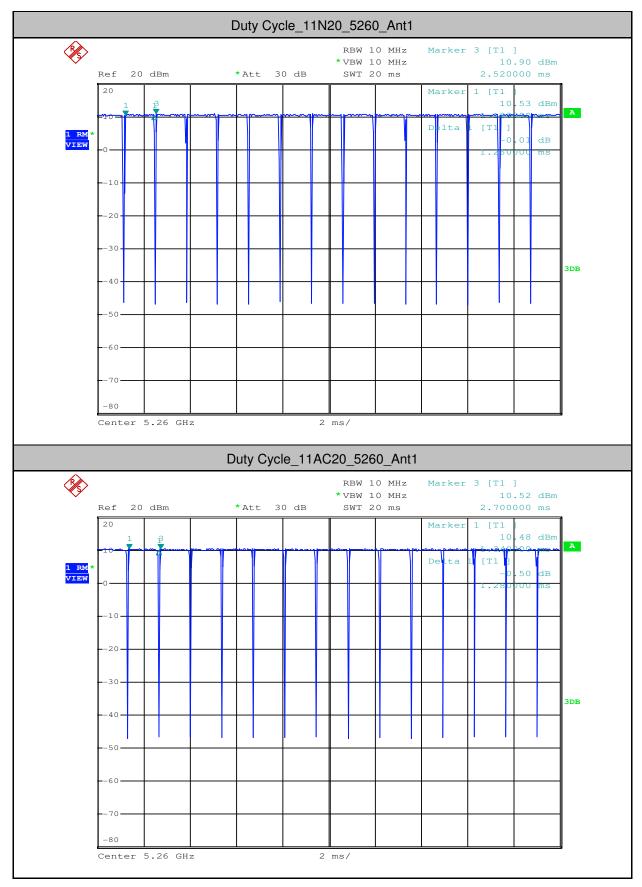




Report No.: SZEM180500434405 Page: 604 of 641

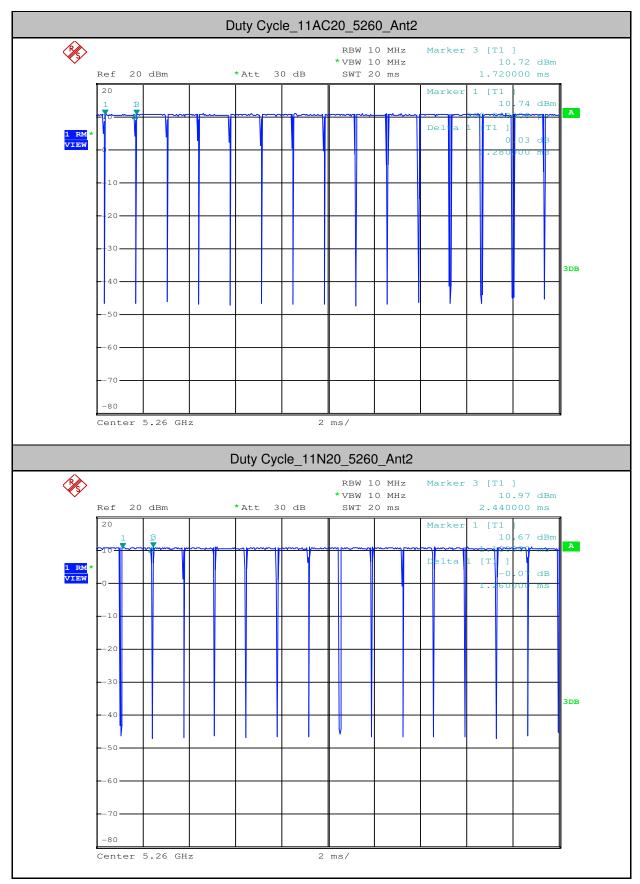



Report No.: SZEM180500434405 Page: 605 of 641

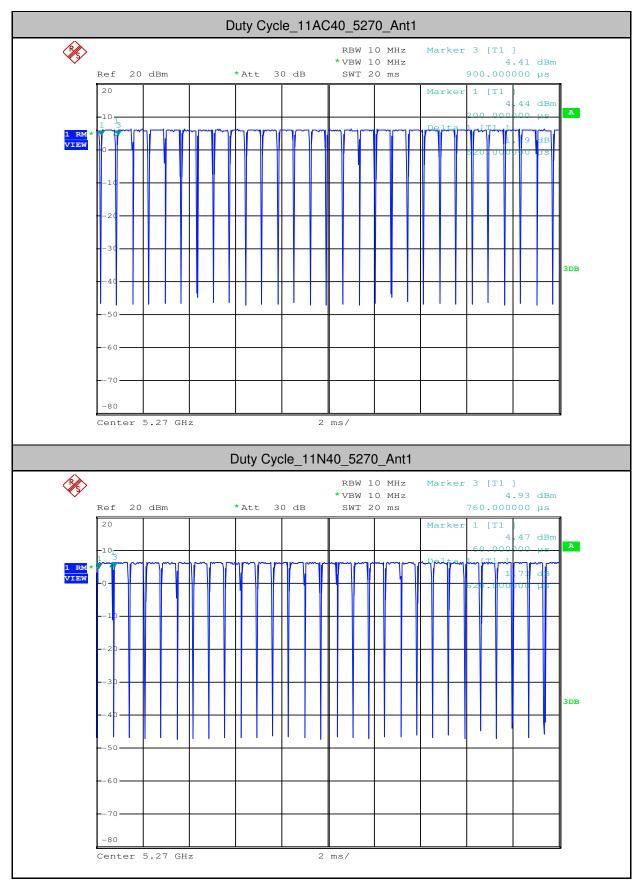




Report No.: SZEM180500434405 Page: 606 of 641






Report No.: SZEM180500434405 Page: 607 of 641

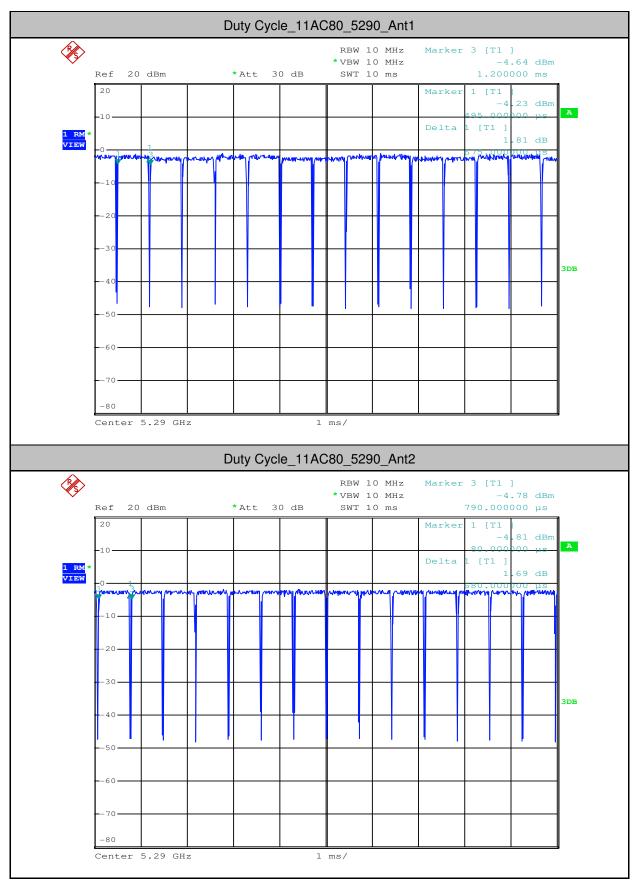




Report No.: SZEM180500434405 Page: 608 of 641

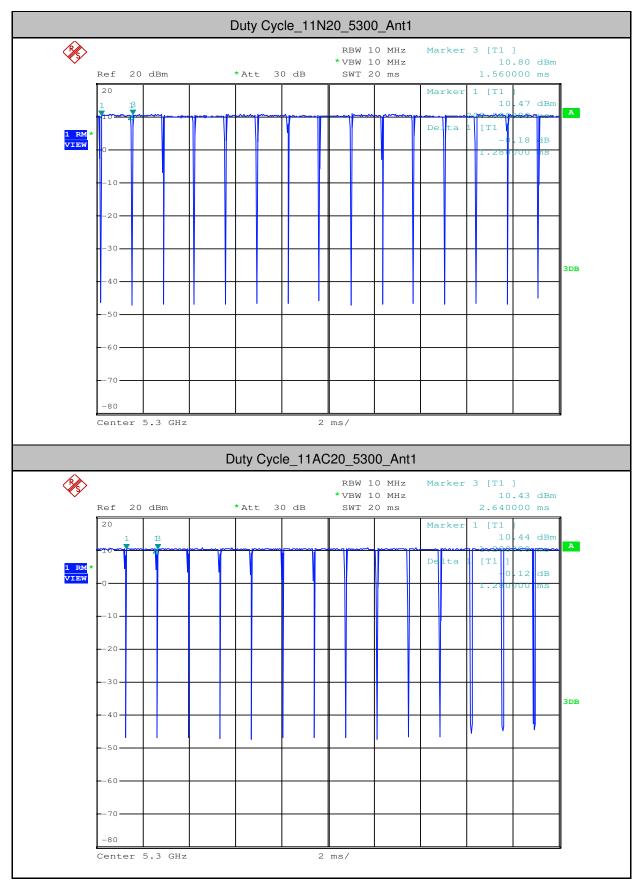



Report No.: SZEM180500434405 Page: 609 of 641

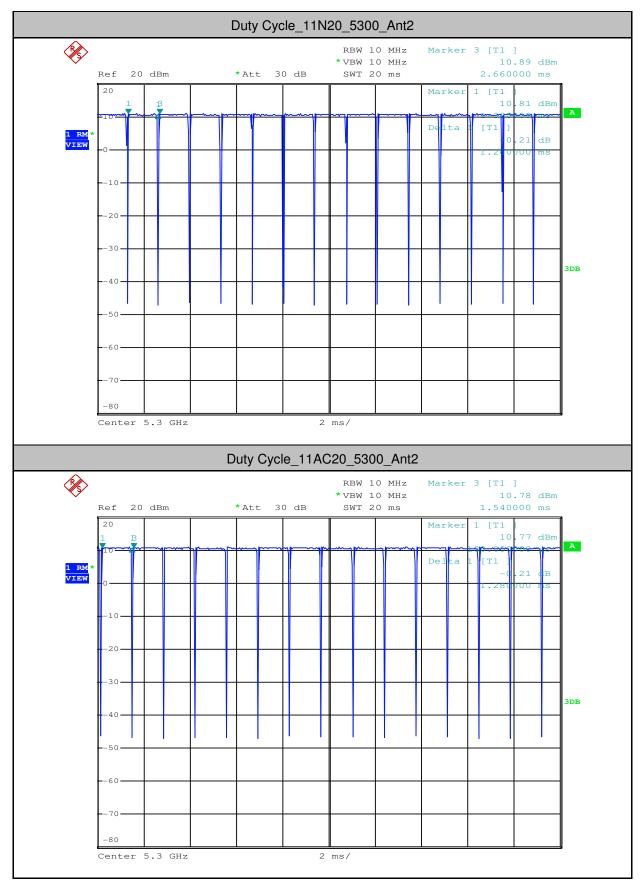




Report No.: SZEM180500434405 Page: 610 of 641






Report No.: SZEM180500434405 Page: 611 of 641

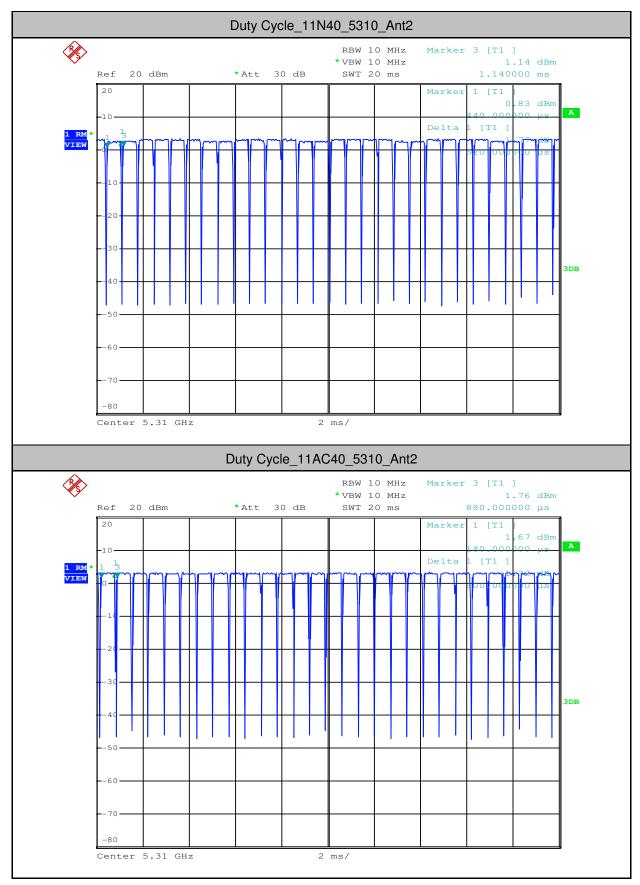



Report No.: SZEM180500434405 Page: 612 of 641

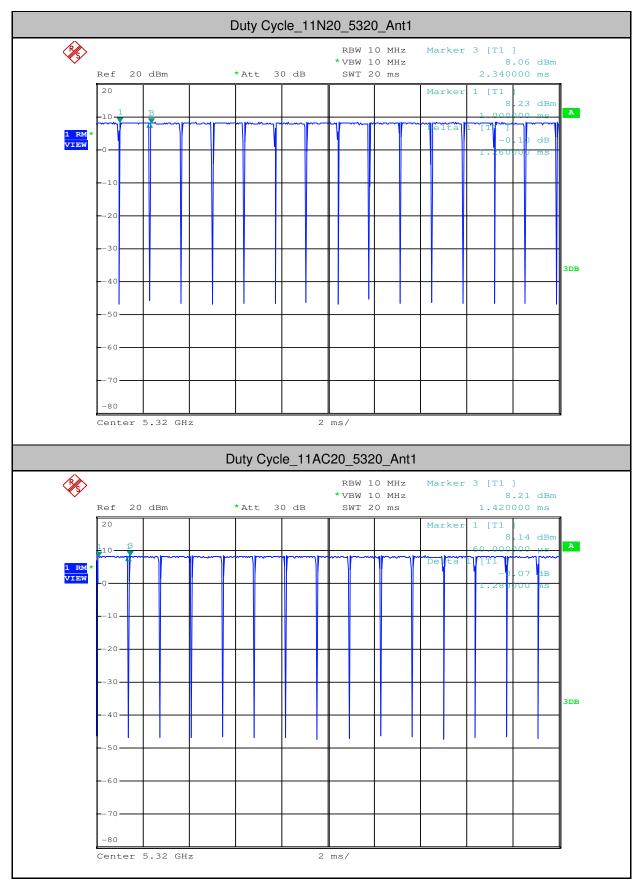



Report No.: SZEM180500434405 Page: 613 of 641






Report No.: SZEM180500434405 Page: 614 of 641





Report No.: SZEM180500434405 Page: 615 of 641

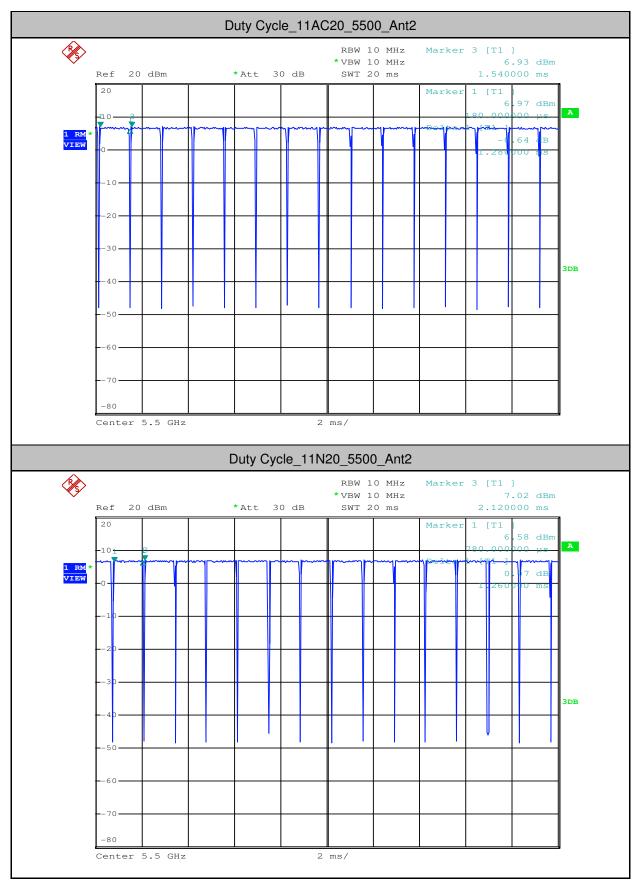



Report No.: SZEM180500434405 Page: 616 of 641





Report No.: SZEM180500434405 Page: 617 of 641






Report No.: SZEM180500434405 Page: 618 of 641






Report No.: SZEM180500434405 Page: 619 of 641

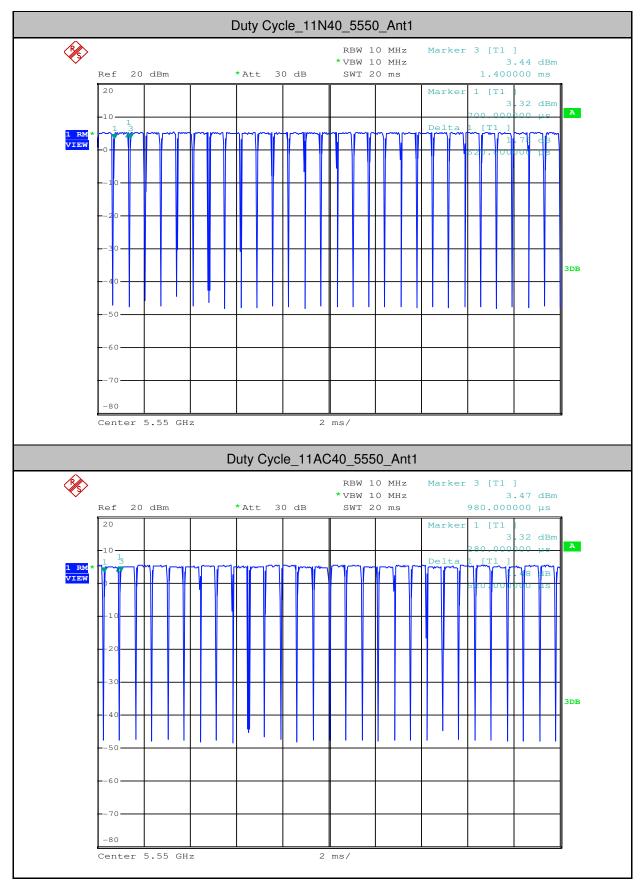



Report No.: SZEM180500434405 Page: 620 of 641

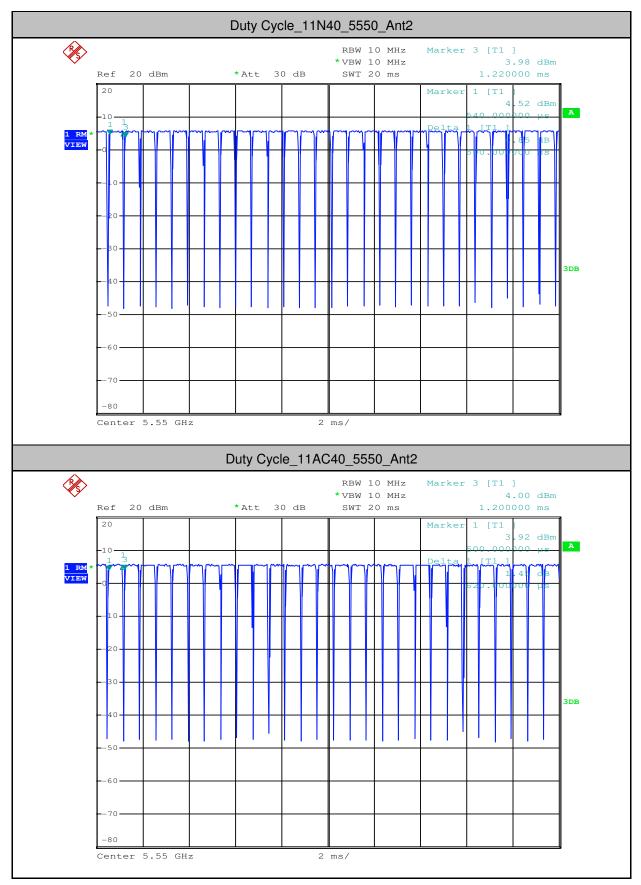




Report No.: SZEM180500434405 Page: 621 of 641





Report No.: SZEM180500434405 Page: 622 of 641

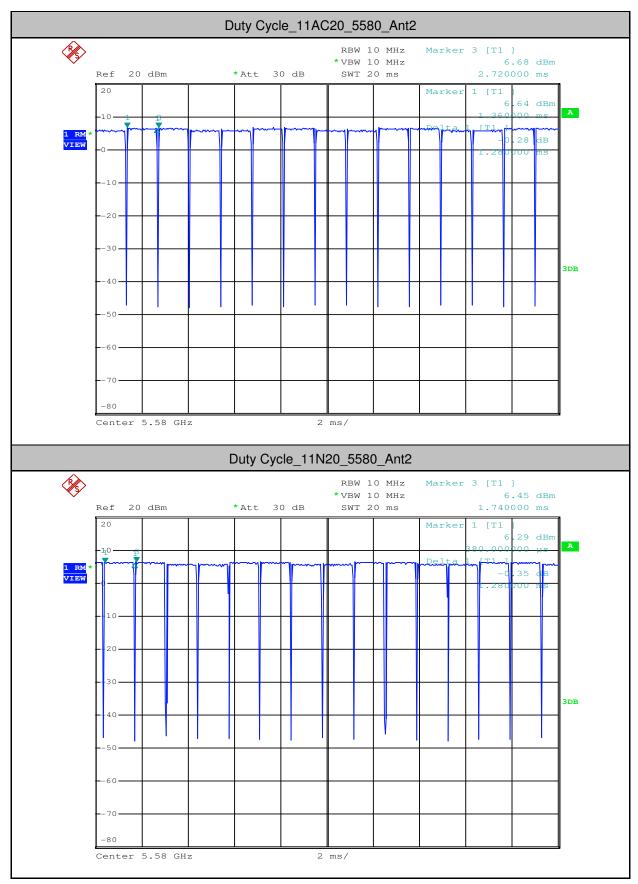




Report No.: SZEM180500434405 Page: 623 of 641






Report No.: SZEM180500434405 Page: 624 of 641

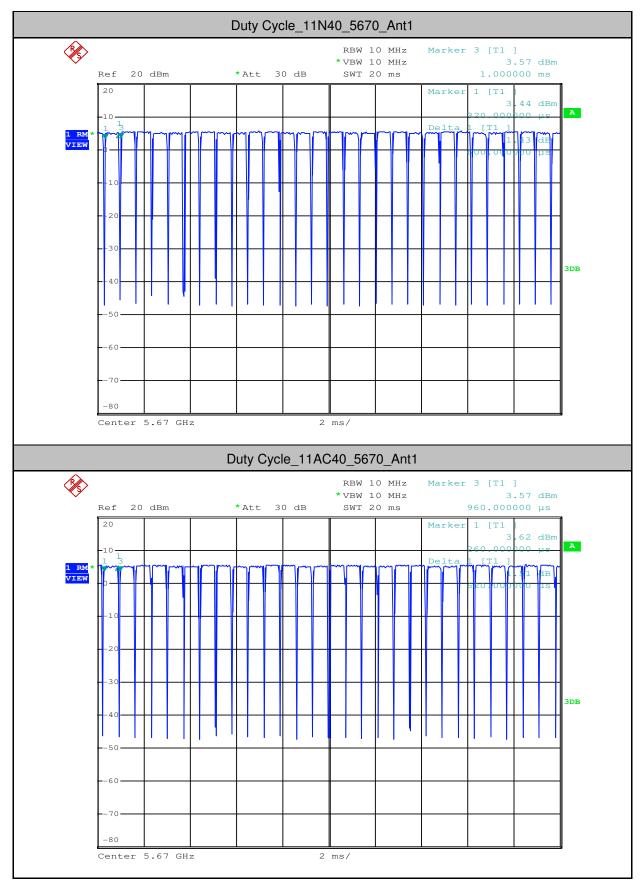




Report No.: SZEM180500434405 Page: 625 of 641

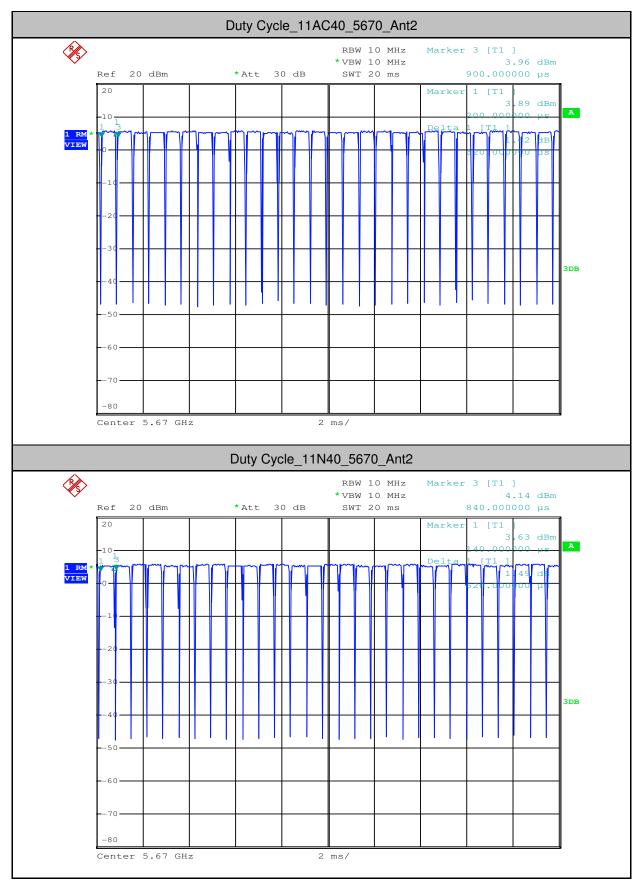




Report No.: SZEM180500434405 Page: 626 of 641

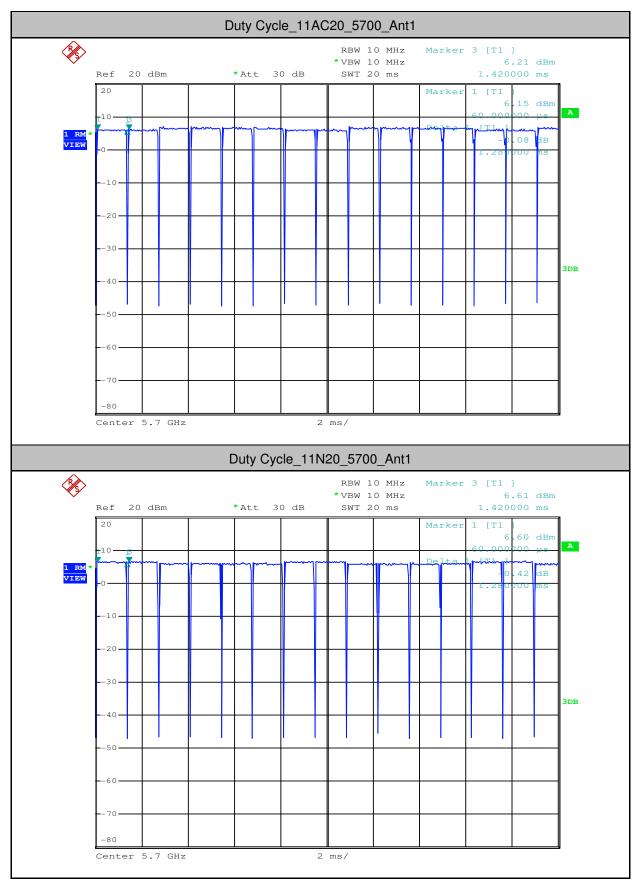



Report No.: SZEM180500434405 Page: 627 of 641

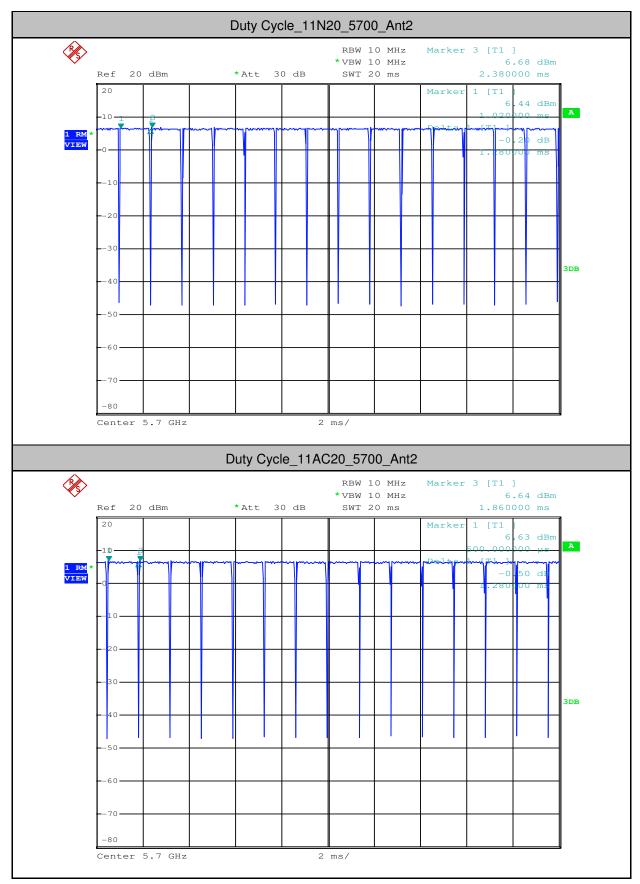




Report No.: SZEM180500434405 Page: 628 of 641






Report No.: SZEM180500434405 Page: 629 of 641

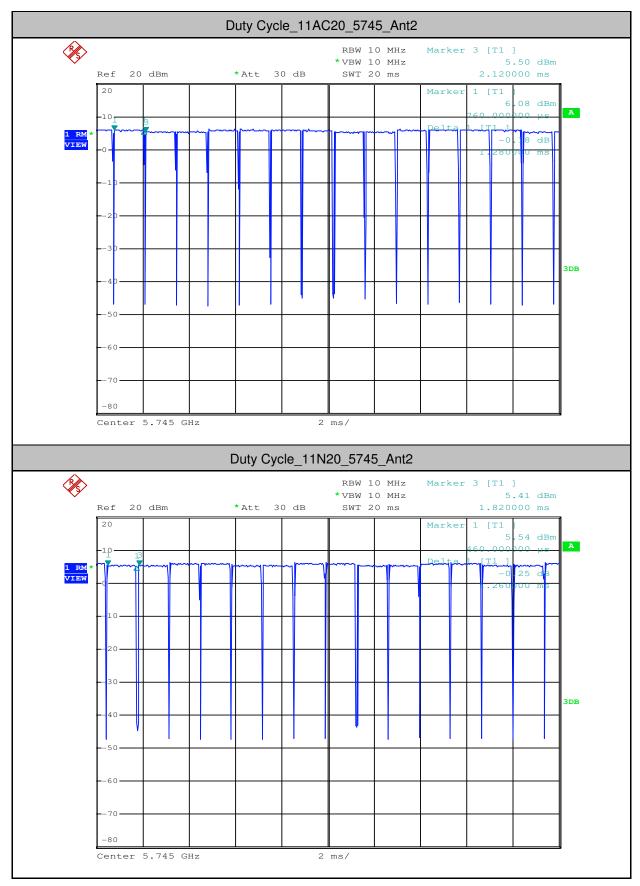




Report No.: SZEM180500434405 Page: 630 of 641

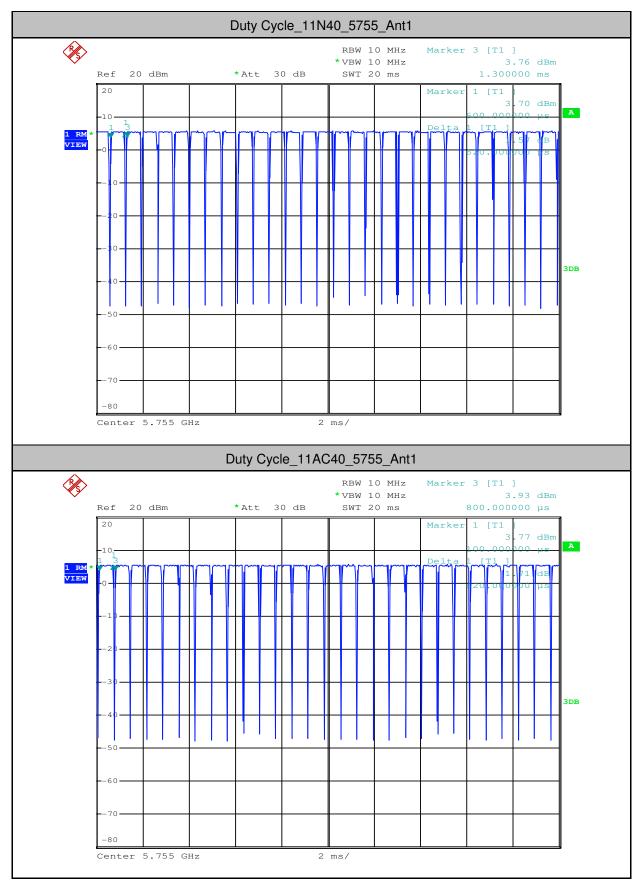



Report No.: SZEM180500434405 Page: 631 of 641

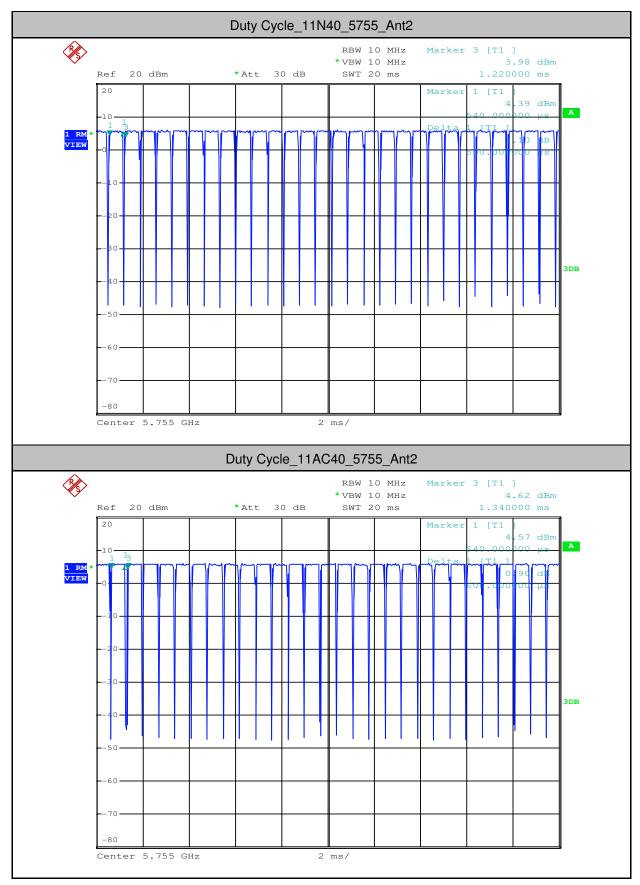




Report No.: SZEM180500434405 Page: 632 of 641





Report No.: SZEM180500434405 Page: 633 of 641

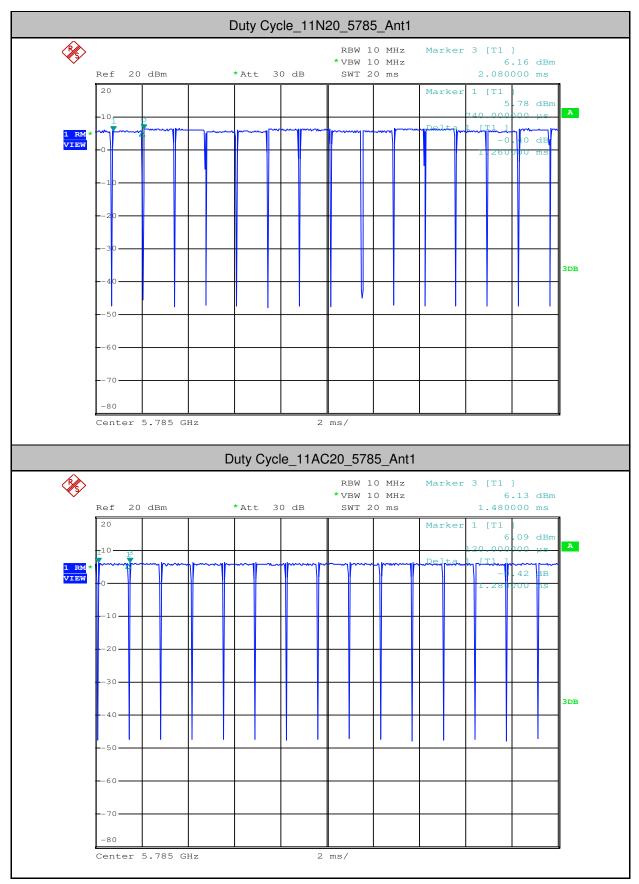




Report No.: SZEM180500434405 Page: 634 of 641






Report No.: SZEM180500434405 Page: 635 of 641

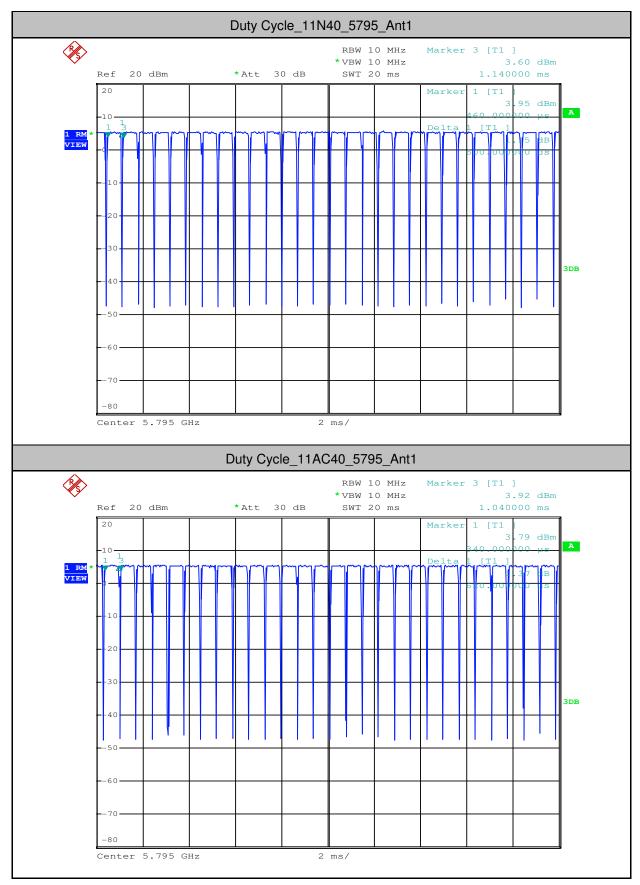



Report No.: SZEM180500434405 Page: 636 of 641

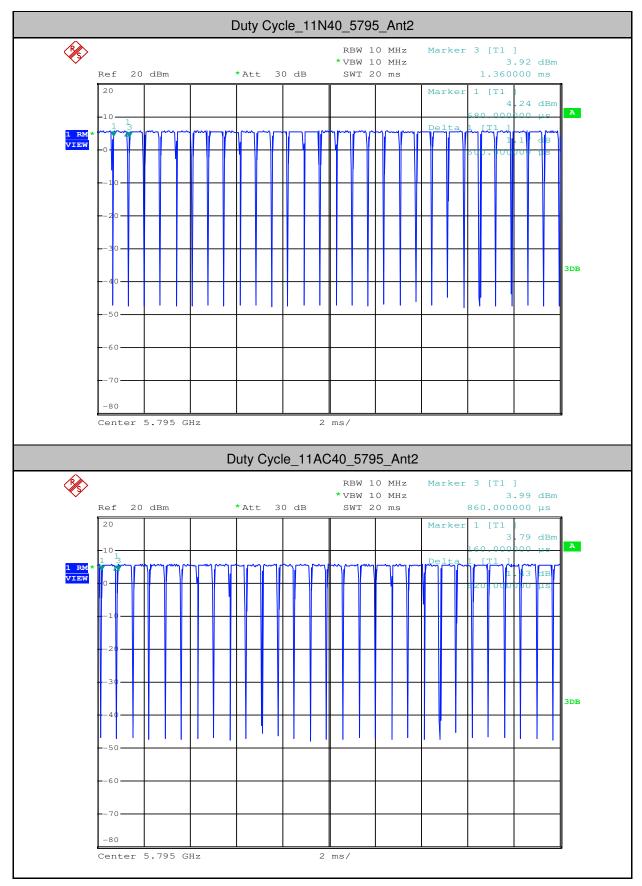




Report No.: SZEM180500434405 Page: 637 of 641





Report No.: SZEM180500434405 Page: 638 of 641

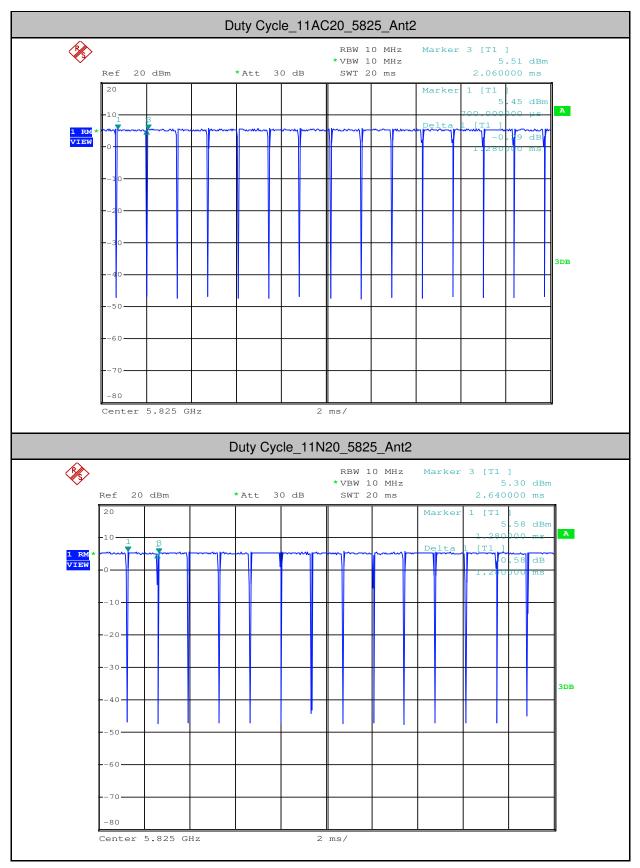



Report No.: SZEM180500434405 Page: 639 of 641

6. (DFS: Non-occupancy period; DFS: Channel Move Time; DFS: Channel Closing Transmission Time) Test plots as follows:

Remark: Only the data of Ant.2 of 5290MHz was recorded.

Radar Waveform Calibration Result

Radar Type 0 (80MHz / 5290MHz)

Keysight Spectrum Analyzer - Swept SA				
Marker 1 13.5477 ms			6 AM Jun 27, 2018 RACE 1 2 3 4 5 6 TYPE WWWWWW	Peak Search
	Gain:High #Atten: 0	Mkr1 -6	13.55 ms 0.96 dBm	Next Peak
-30.0				Next Pk Right
-40.0				Next Pk Left
-60.0			TRIG LVL	Marker Delta
-80.0				Mkr→CF
-100		ala likuaa n	. J. Juni (I. Joseffer, e	Mkr→RefLvl
-110 Hold and the filter of principal and a state of the	#UPPERDUCE CONTRACTOR And Bala And Calded Address #VBW 3.0 MHz	Sweep 26.00 ms	Span 0 Hz	More 1 of 2
MSG		STATUS		



Report No.: SZEM180500434405 Page: 640 of 641

Test Data: Antenna 2:

BW/Channel	Test Item	Test data	Limit	Results
	Non-occupancy period	Refer to test point	>30 min	pass
80MHz 5290MHz	Channel Move Time	0.28s	<10 s	Pass
525010112	Channel Closing Transmission Time	0.005ms	<60ms	Pass


Test plots as follows:

80MHz/5290MHz

🪾 Keysight Spectrum Analyze									
r l RF	50 Ω DC	CORREC			Avg Type	LIGN AUTO	TRAC	1 Jun 25, 2018 E 1 2 3 4 5 6	Trace/Detector
10 dB/div Ref -20	.00 dBm	PNO: Fast ++ IFGain:High	 Trig: Free #Atten: 0 c 	Run IB			TYF DE	E WWWWW T P N N N N N	Select Trace
-30.0									Clear Write
-40.0									Trace Average
-60.0									Max Hold
-80.0									Min Hold
-90.0		salibeiten eilen kertismerijen er			1	and the second second		dung de sale este	View Blank Trace On
-110	nem ing ing ing bah						ini _{in} y i Marki da da da da da da	pan 0 Hz	More 1 of 3
Res BW 3.0 MHz		#VBW	3.0 MHz				5.00 s (3	0000 pts)	
MSG						STATUS			



Report No.: SZEM180500434405 Page: 641 of 641

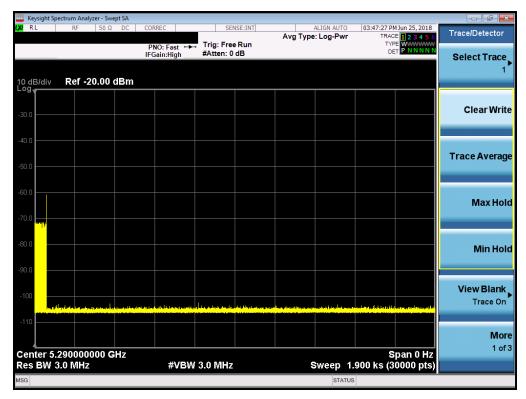

	ceMonitorUtility(10,0,0)(C:\Users\EMC\Desktop\DFS\harman0510\NEW\5290\5290-9.csv)			×
-62- -8- -8- -74- -74- -88- -88- -88- -2- -88- -2- -28- -28-	In Service Monitor			
-95- -98- -101- -104- -107- -110	t destant and an a definition for the sole and a second as well determined by any for the association of a structure of the sole definition of the sole of	and an and the first state of the	Nisala	
	0000 -1.00000 0.00000 1.00000 2.00000 3.00000 4.00000 5.00000 6.00000 7.00000 8.00000 9.00000 10.0000 Time (S)	0 11.00000 12.00000	3.00000 14	.00000
-2.00 Time Index T0 : -1 T1 : 0 T2 : 0	Time (S) x Info -0.0525 S (Radar Injection Start) 0.0000 S (Radar Injection Start) 0.0000 S (Radar Injection Start) Channel M	o 11.00000 12.00000 love Time: 0.278 lose Time: 0.000	0278 S	.00000

- End of the Report -