




Band Edge(Hopping) NVNT 3-DH5 2402MHz Ant1 Hopping Ref



Band Edge(Hopping) NVNT 3-DH5 2402MHz Ant1 Hopping Emission

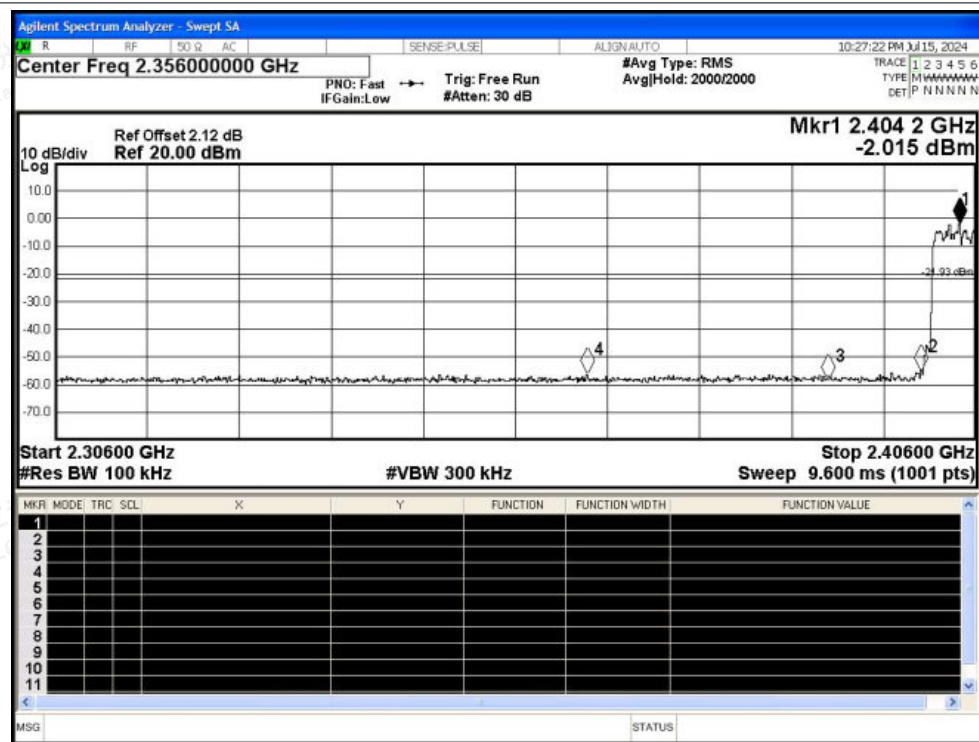

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge(Hopping) NVNT 3-DH5 2480MHz Ant1 Hopping Ref



Band Edge(Hopping) NVNT 3-DH5 2480MHz Ant1 Hopping Emission

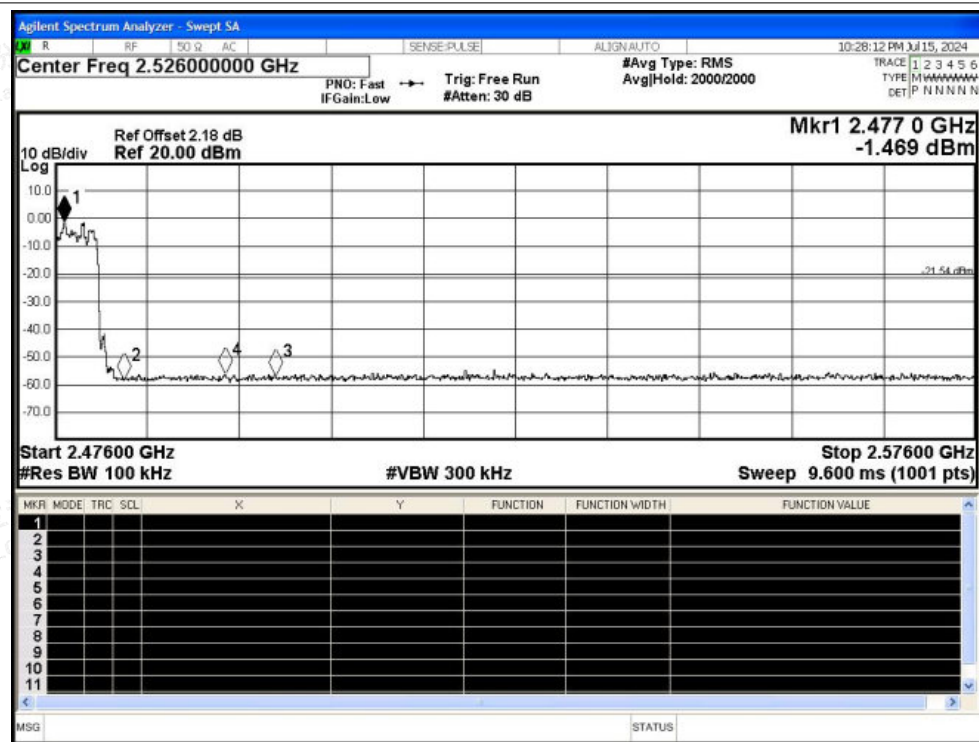

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.7 Conducted RF Spurious Emission


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	-54.74	-20	Pass
NVNT	1-DH5	2441	Ant1	-53.73	-20	Pass
NVNT	1-DH5	2480	Ant1	-55.17	-20	Pass
NVNT	2-DH5	2402	Ant1	-52.95	-20	Pass
NVNT	2-DH5	2441	Ant1	-54.01	-20	Pass
NVNT	2-DH5	2480	Ant1	-48.59	-20	Pass
NVNT	3-DH5	2402	Ant1	-53.26	-20	Pass
NVNT	3-DH5	2441	Ant1	-53.91	-20	Pass
NVNT	3-DH5	2480	Ant1	-53.42	-20	Pass






Test Graphs

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Ref

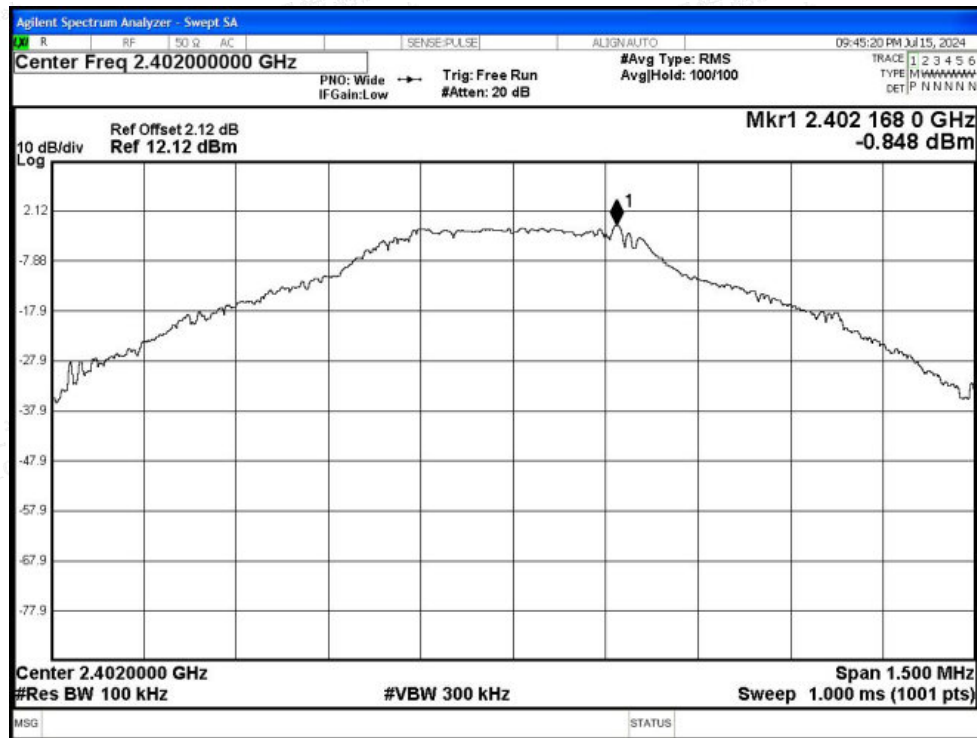

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Emission

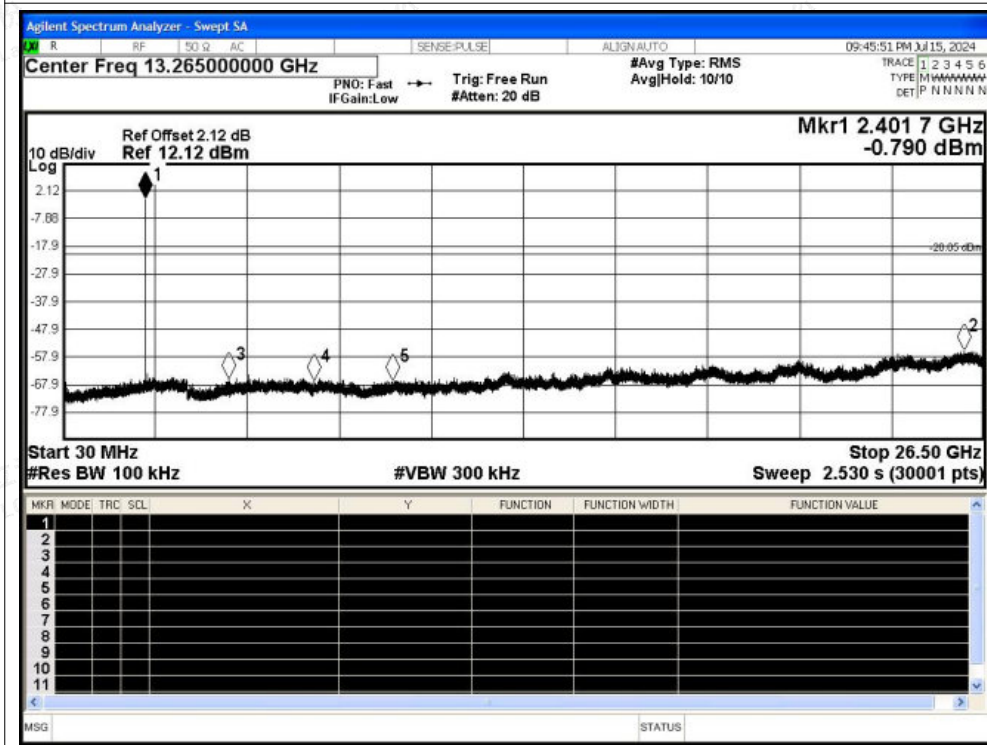

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Ref

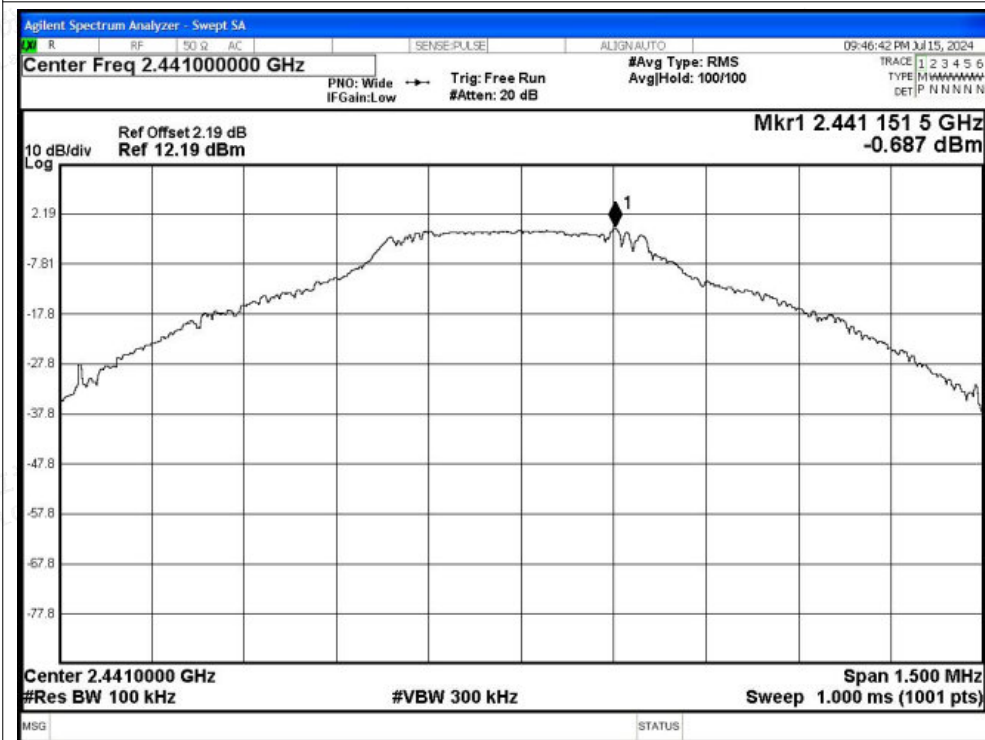

Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Emission

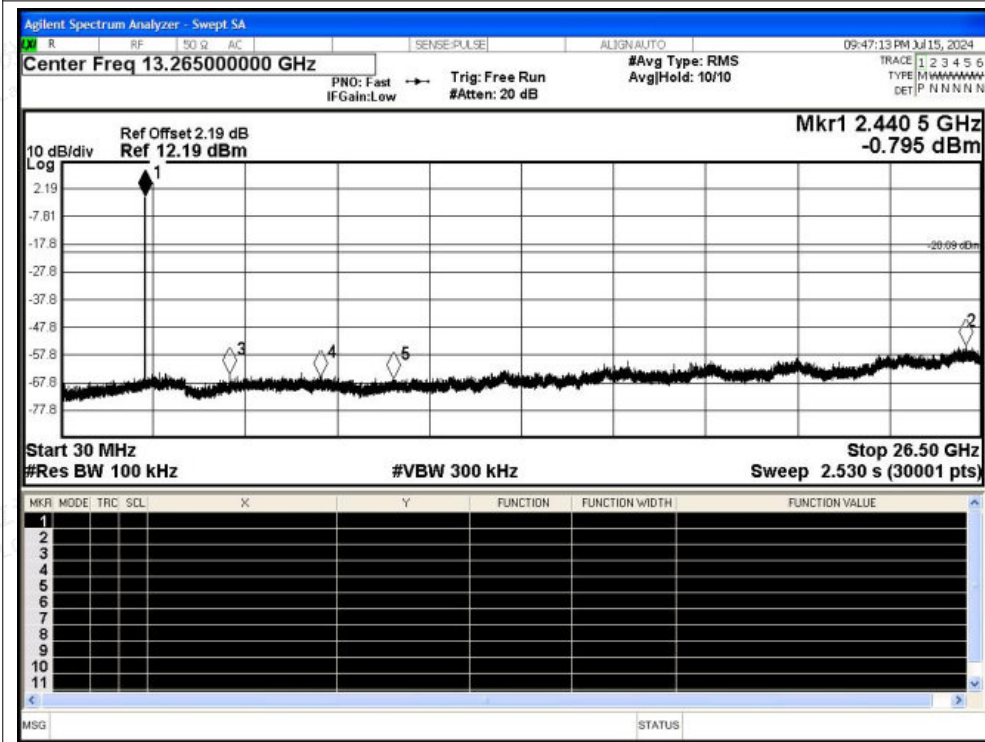

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Ref



Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Emission

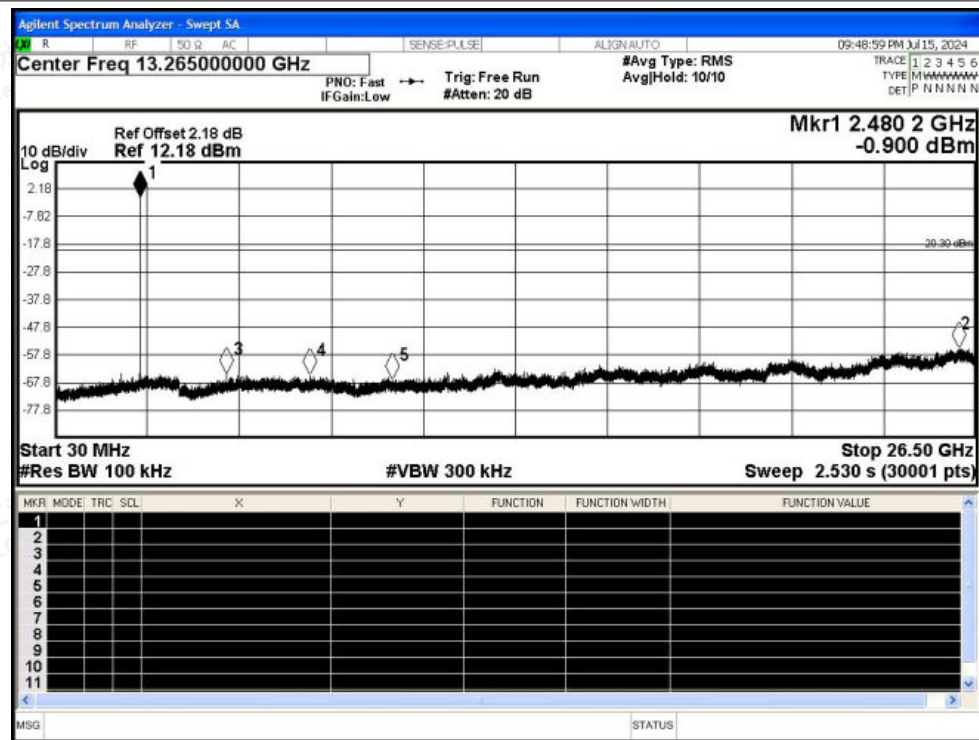

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Ref

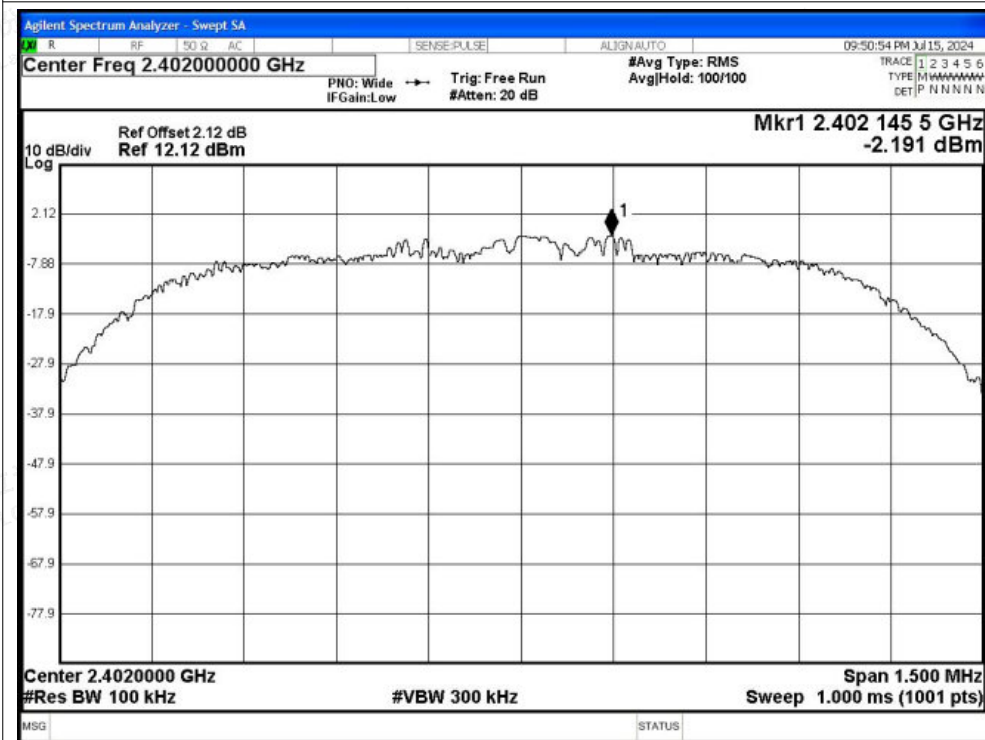

Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Emission

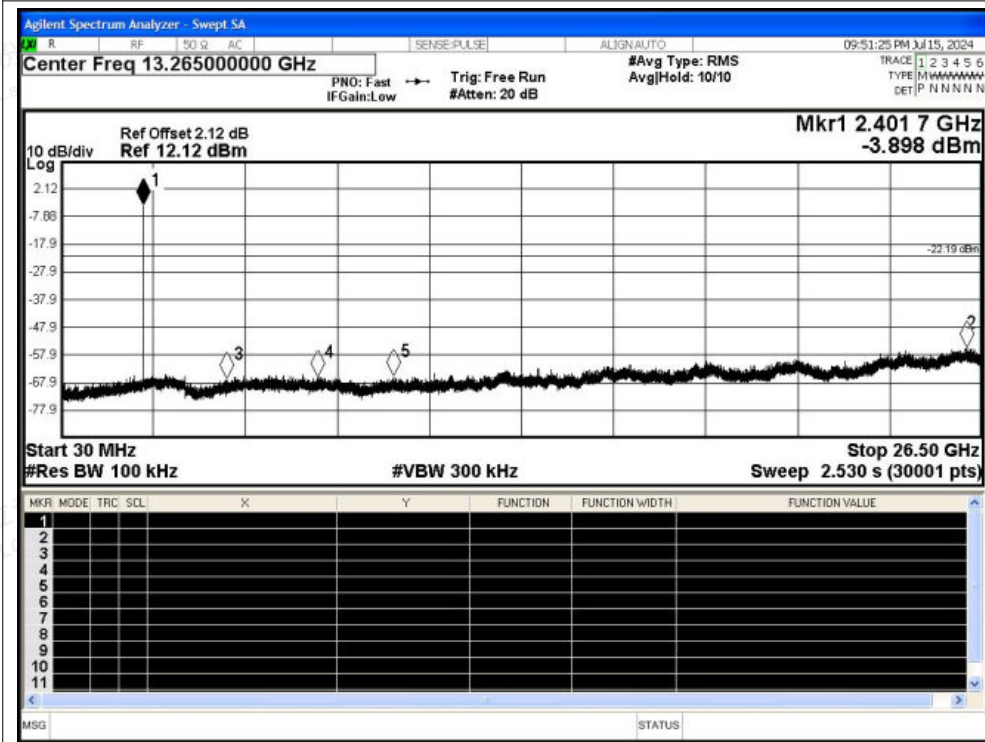

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Ref

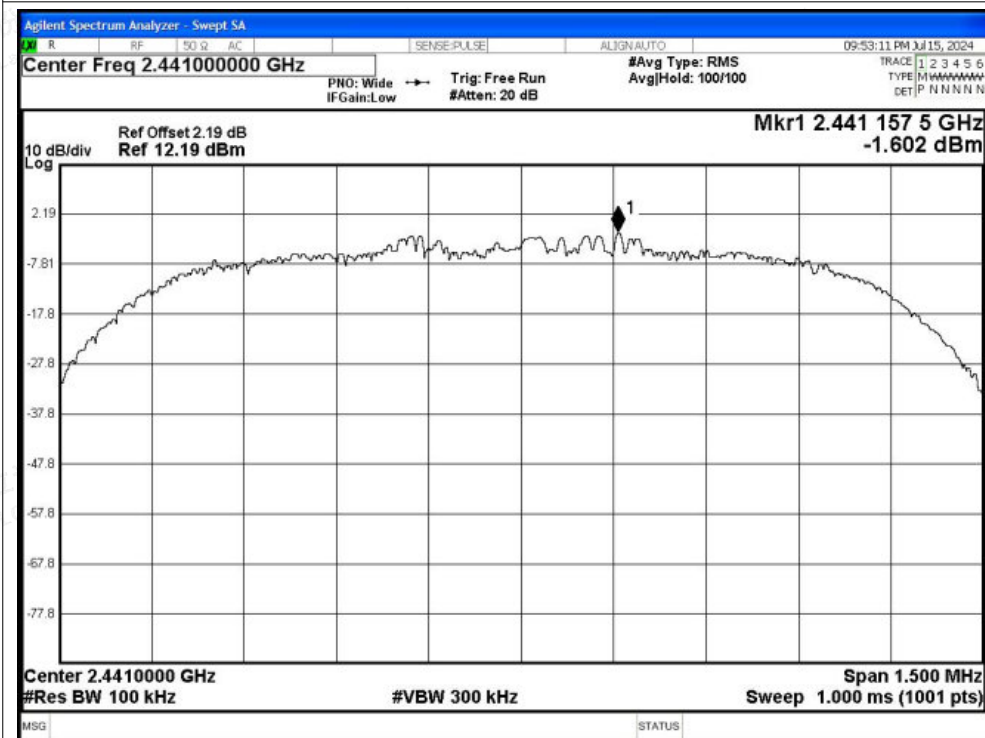

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Emission

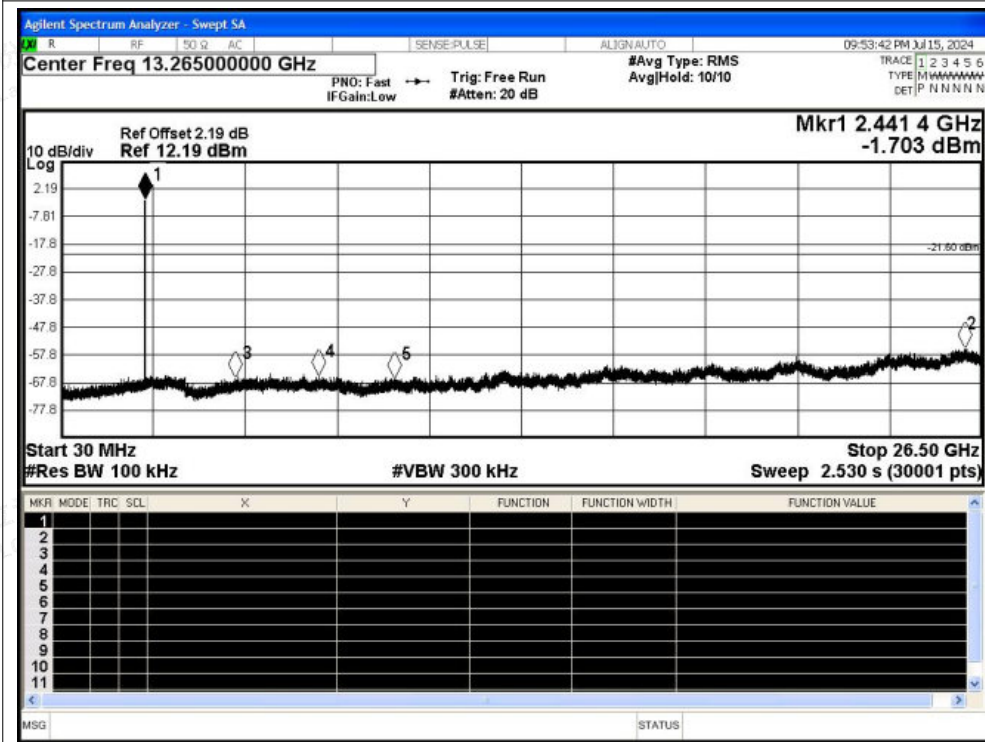

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref

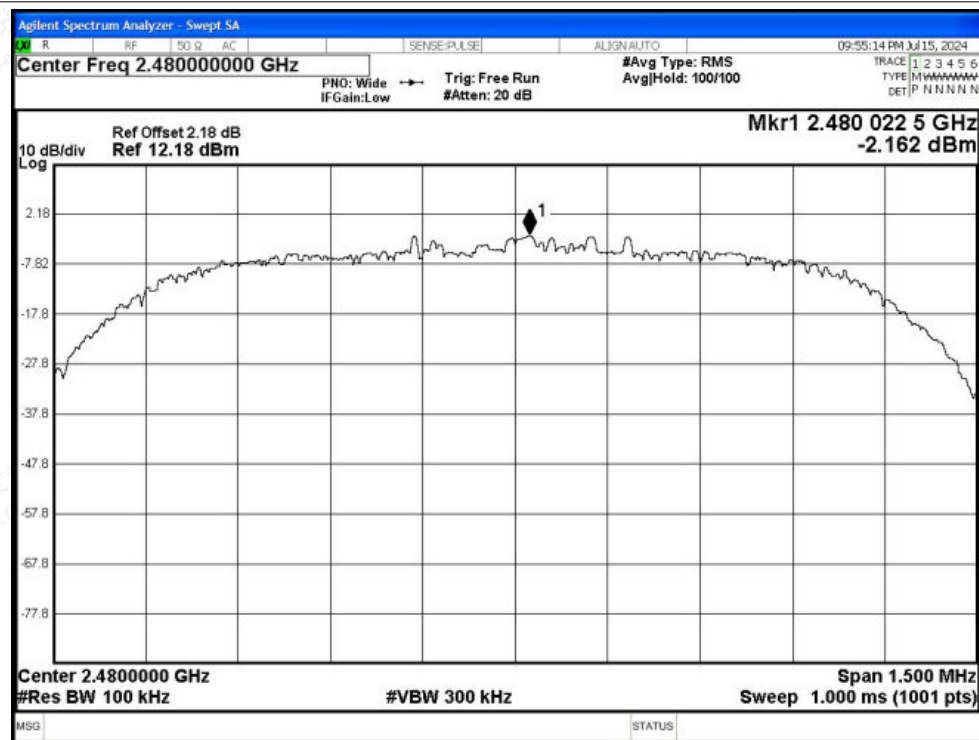

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission

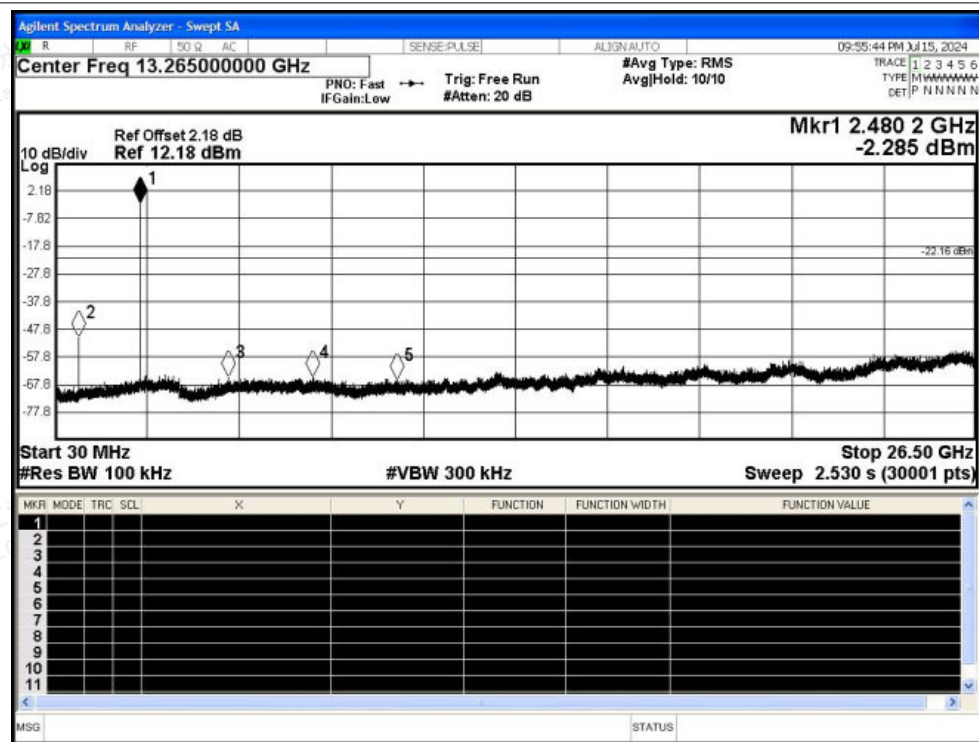

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref

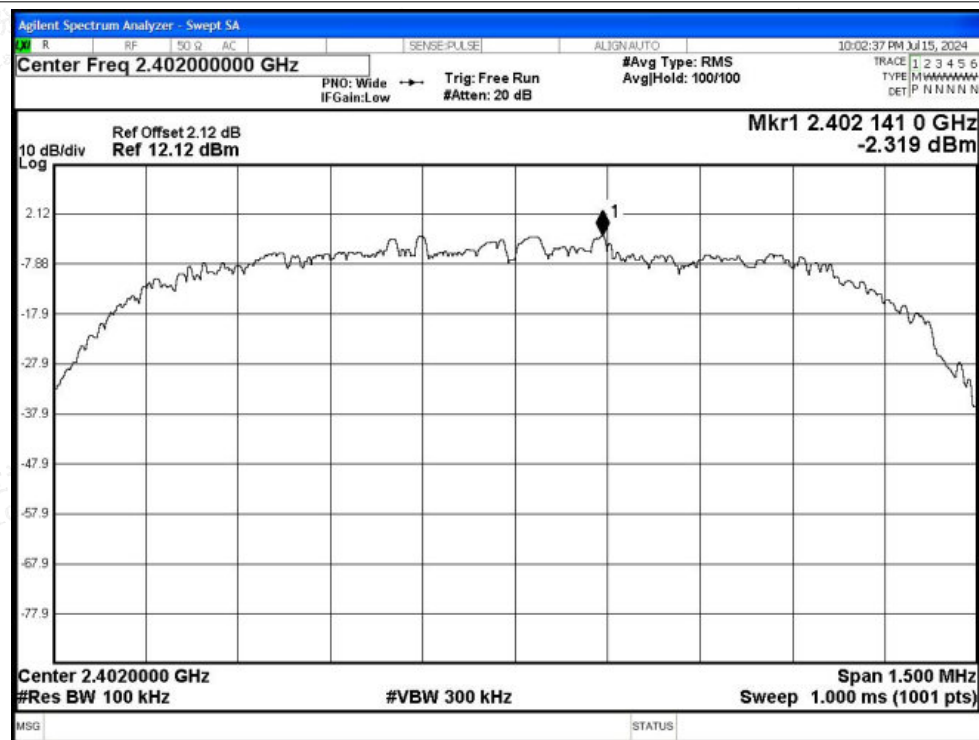

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission

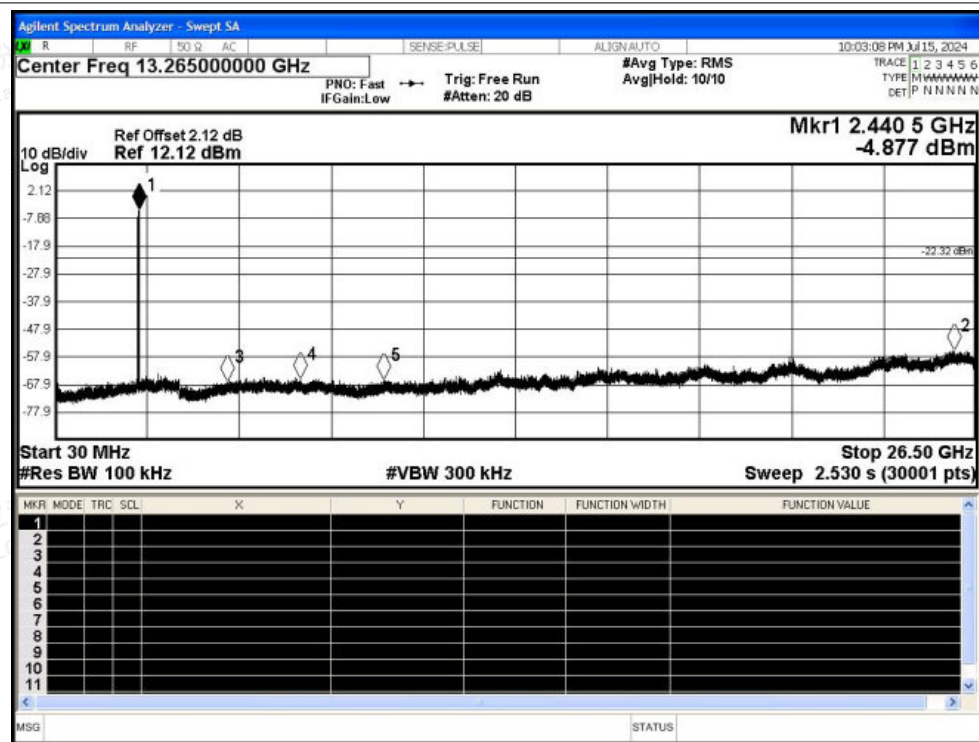

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref

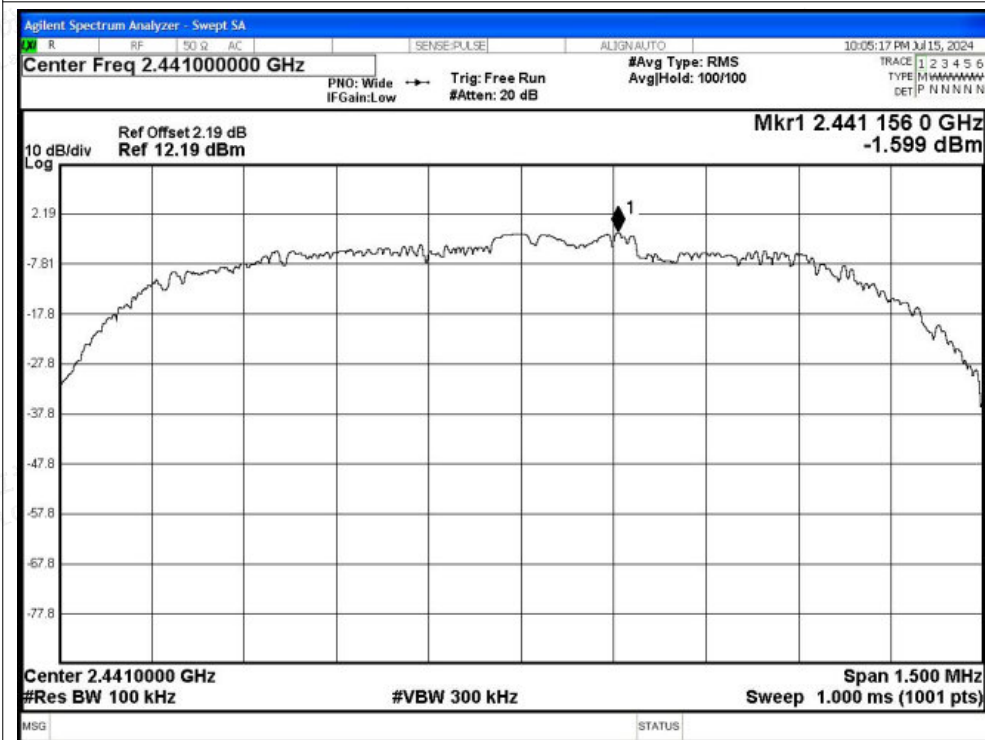

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission

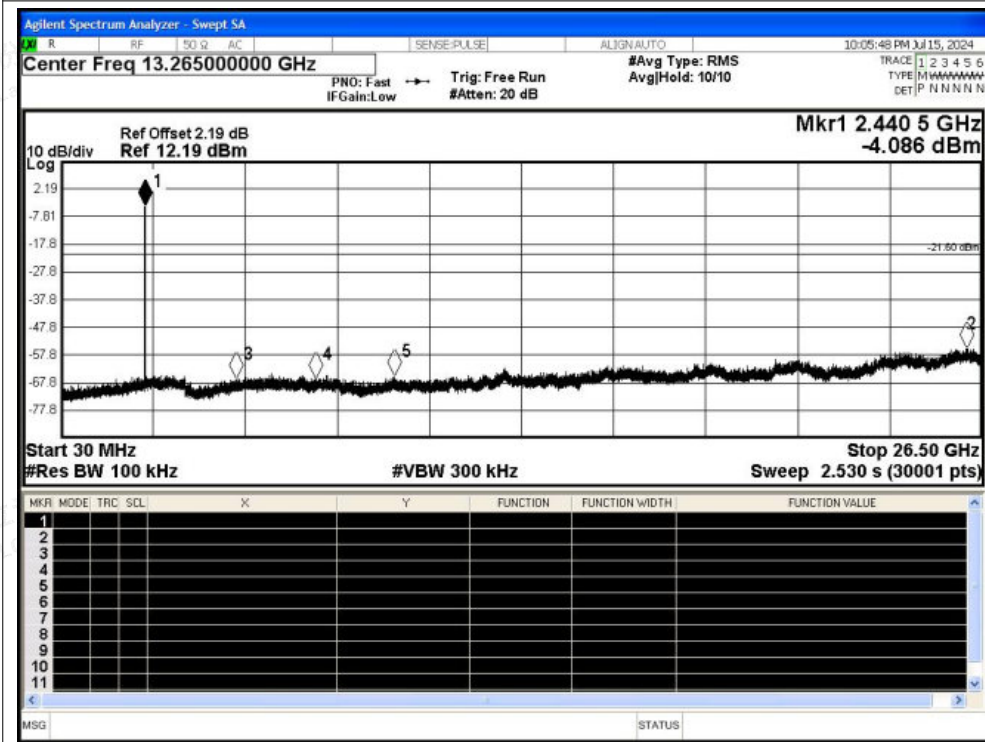

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref

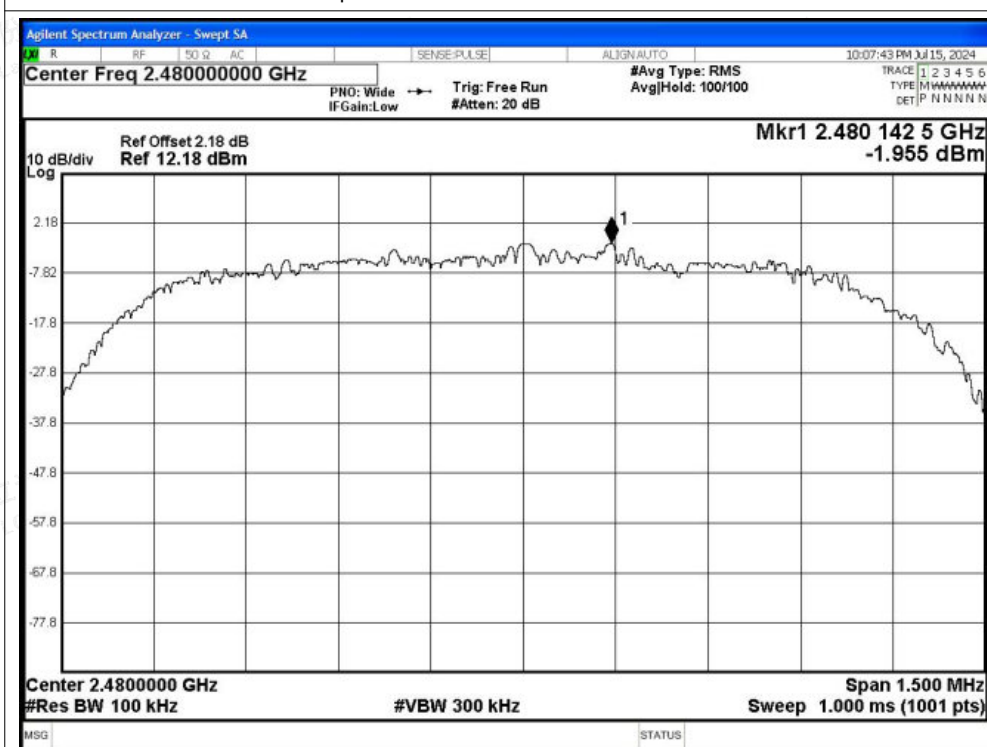

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission

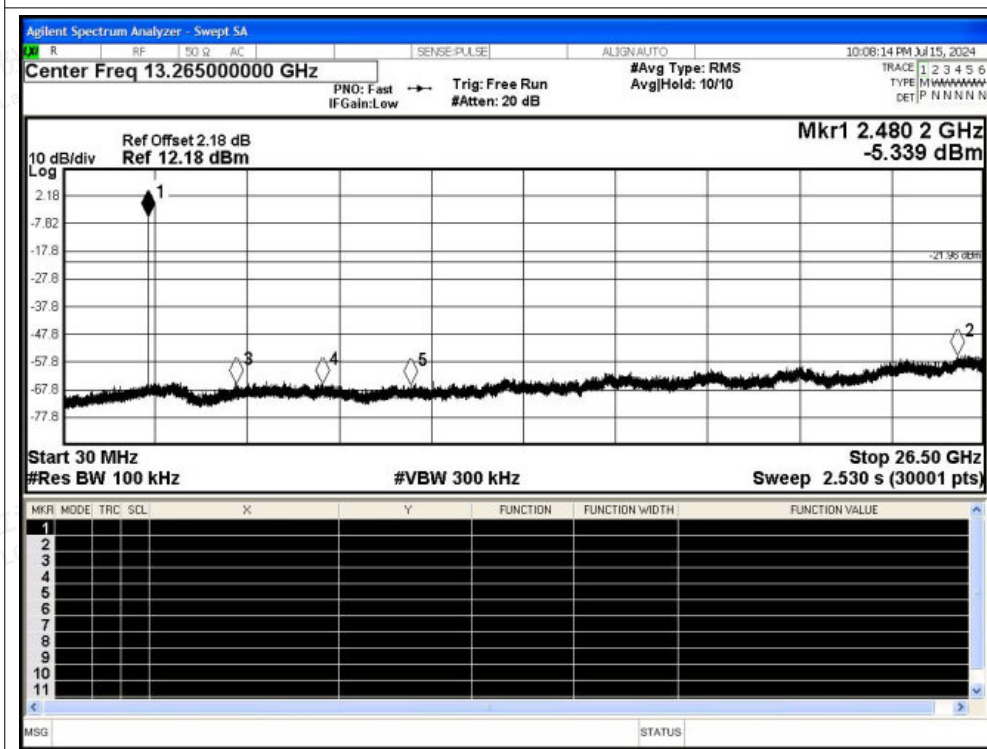

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.8 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	77.63	1.1	0.34
NVNT	1-DH5	2441	Ant1	77.6	1.1	0.34
NVNT	1-DH5	2480	Ant1	77.6	1.1	0.34
NVNT	2-DH5	2402	Ant1	76.41	1.17	0.36
NVNT	2-DH5	2441	Ant1	76.41	1.17	0.36
NVNT	2-DH5	2480	Ant1	76.41	1.17	0.36
NVNT	3-DH5	2402	Ant1	76.4	1.17	0.36
NVNT	3-DH5	2441	Ant1	76.38	1.17	0.36
NVNT	3-DH5	2480	Ant1	76.38	1.17	0.36






Test Graphs

Duty Cycle NVNT 1-DH5 2402MHz Ant1

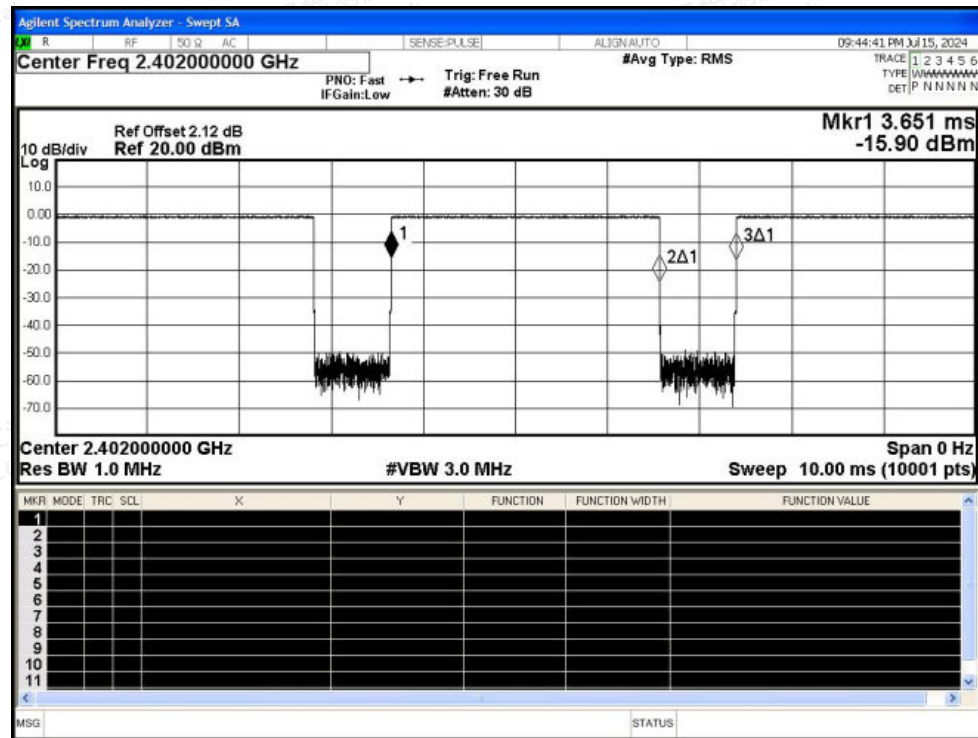

Duty Cycle NVNT 1-DH5 2441MHz Ant1

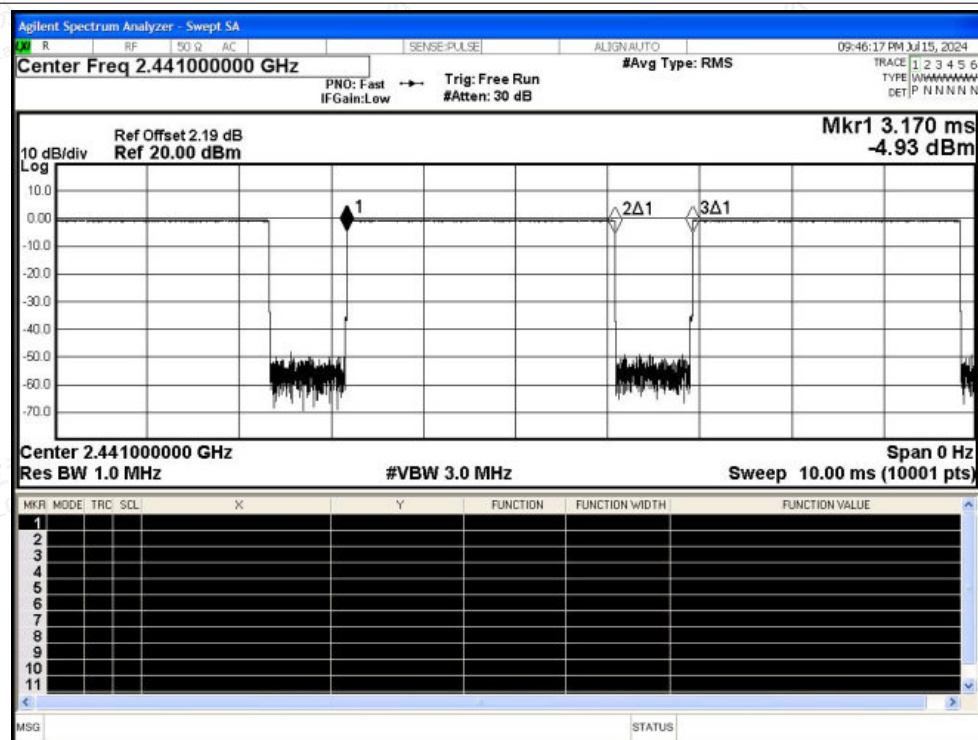

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 1-DH5 2480MHz Ant1

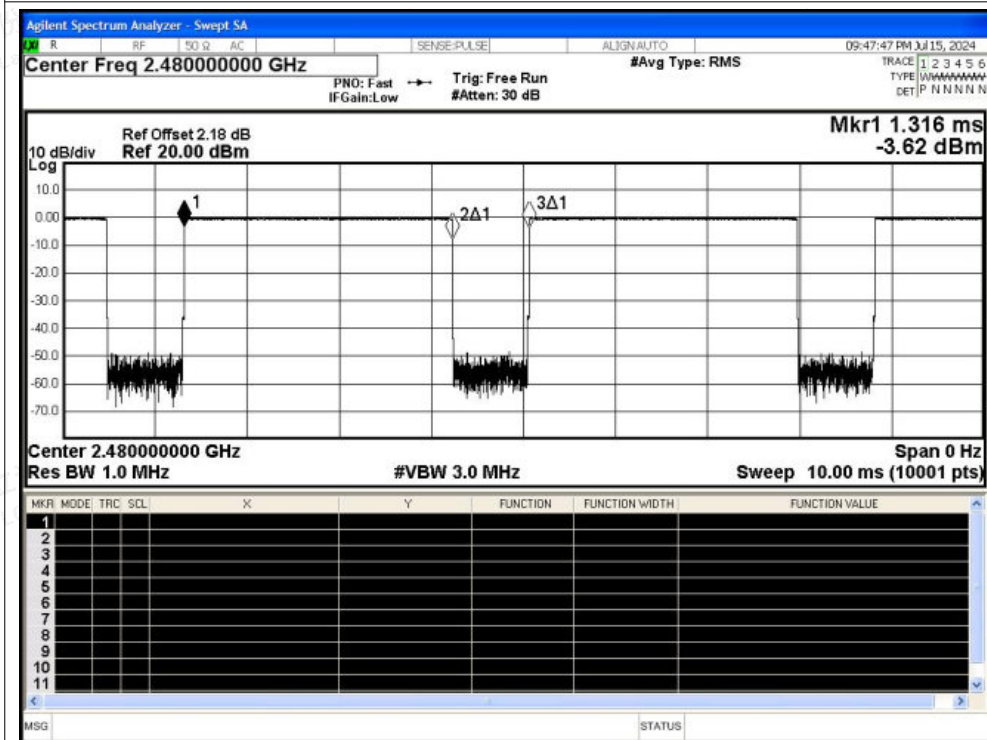

Duty Cycle NVNT 2-DH5 2402MHz Ant1

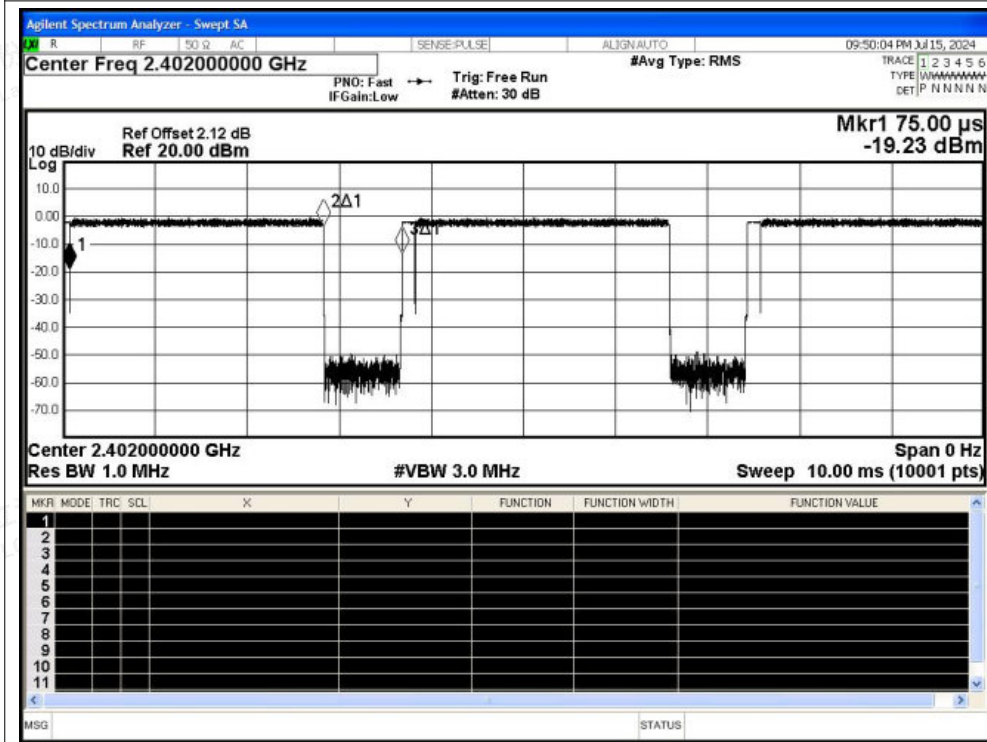

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 2-DH5 2441MHz Ant1

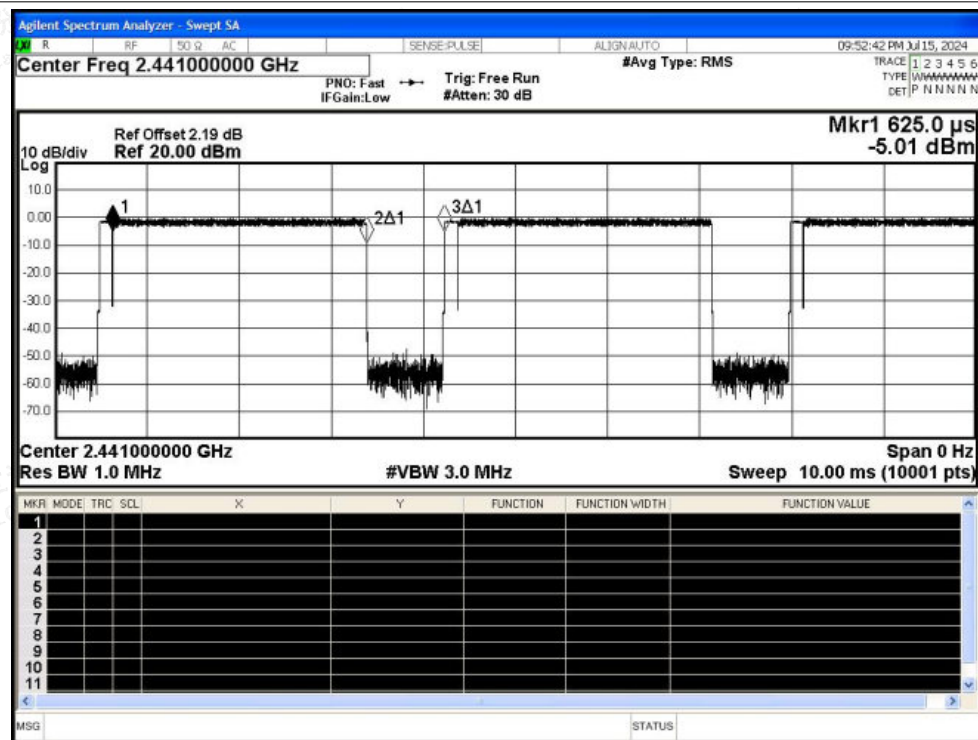

Duty Cycle NVNT 2-DH5 2480MHz Ant1

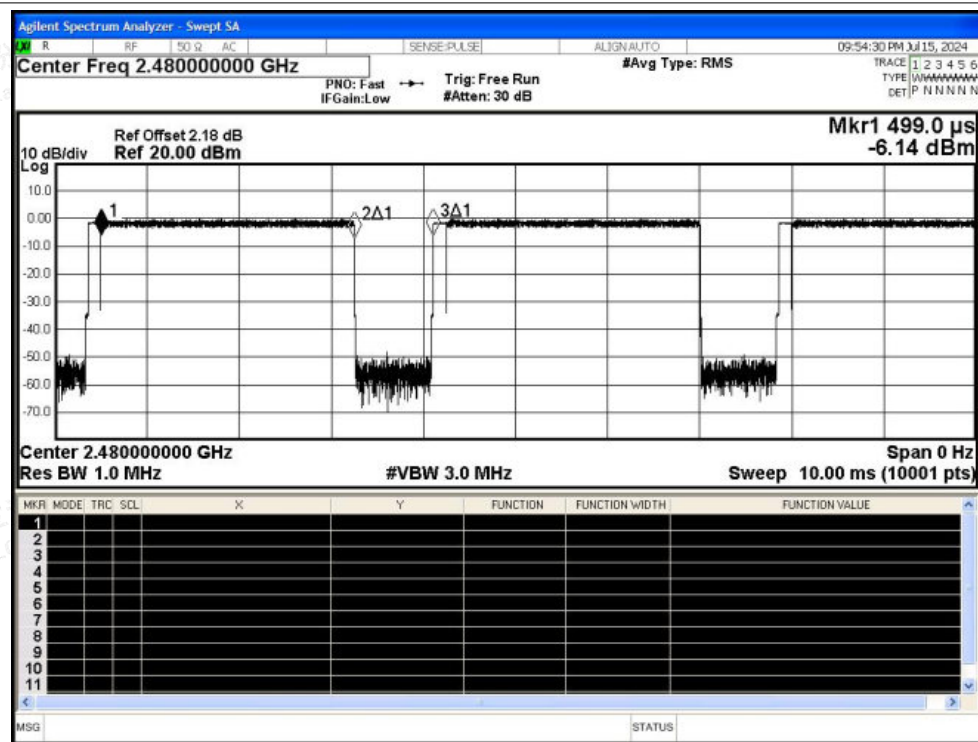

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2402MHz Ant1

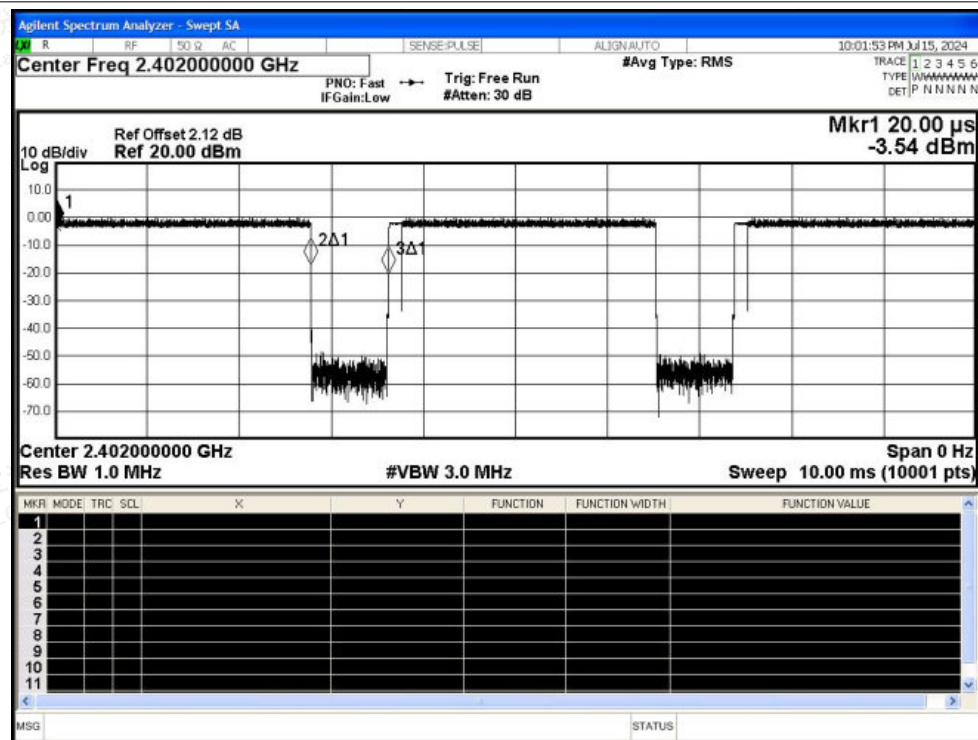

Duty Cycle NVNT 3-DH5 2441MHz Ant1

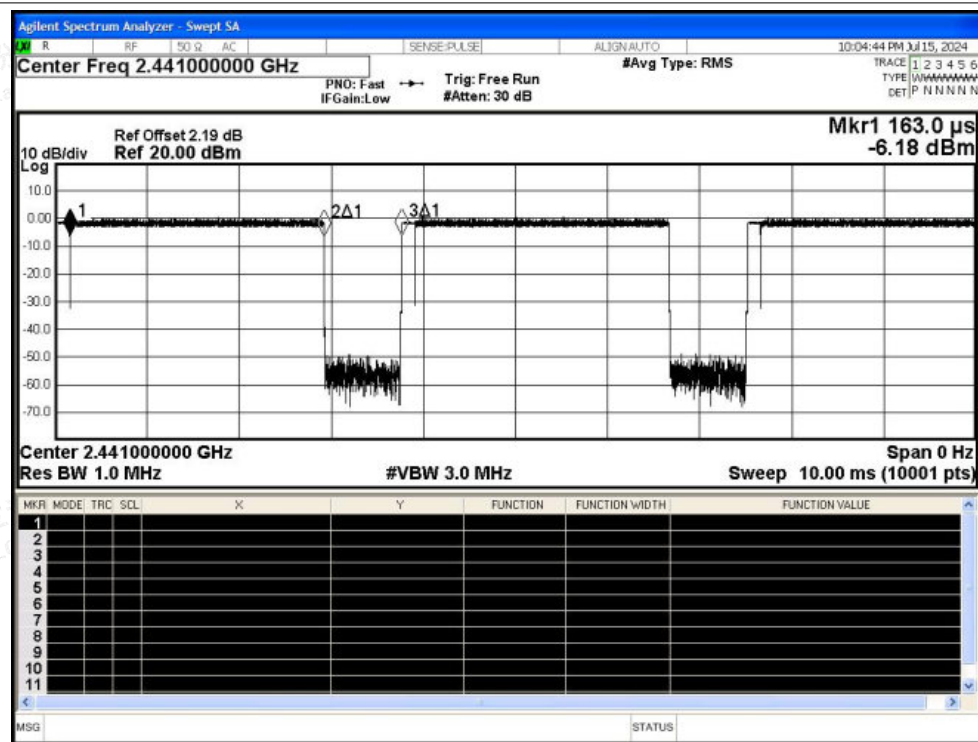


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

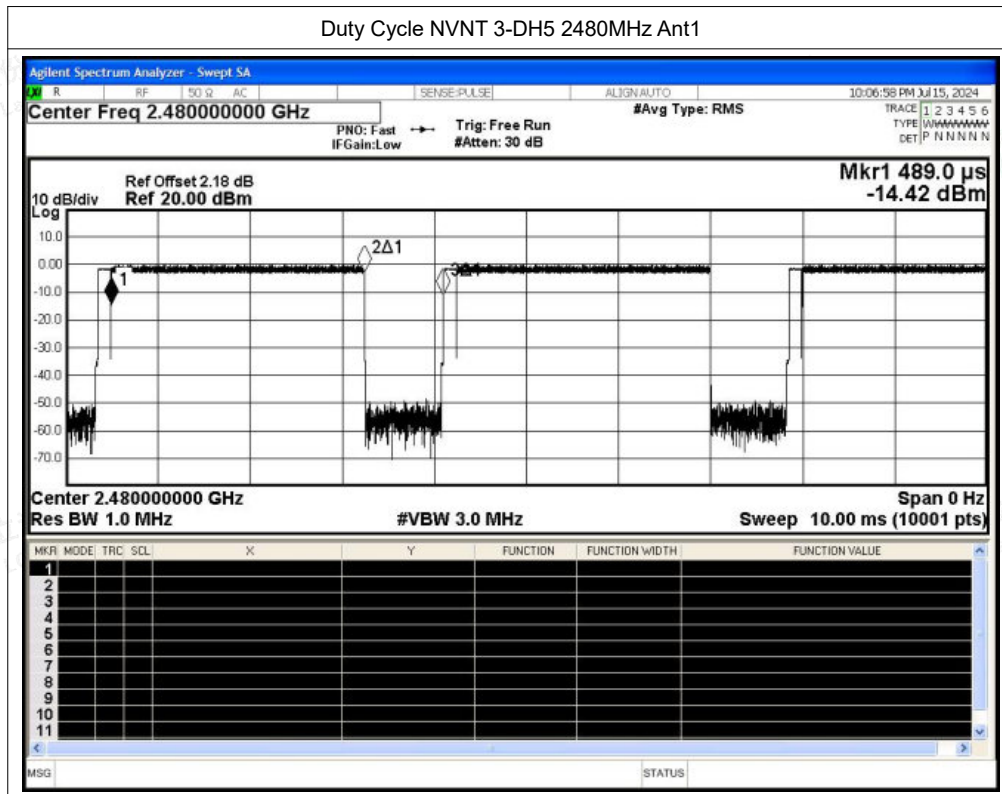

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-50.04	2	-	47.22	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-58.72	2	1.1	39.64	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2363.664	-47.62	2	-	49.64	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2365.872	-57.54	2	1.1	40.82	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-50.39	2	-	46.87	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.56	2	1.1	39.8	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-49.43	2	-	47.83	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-57.94	2	1.1	40.42	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2484.16	-45.31	2	-	51.95	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.848	-56.81	2	1.1	41.55	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-50.34	2	-	46.92	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-57.58	2	1.1	40.78	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-50.83	2	-	46.43	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-58.99	2	1.17	39.44	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2336.208	-47.01	2	-	50.25	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2365.392	-57.35	2	1.17	41.08	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-50.6	2	-	46.66	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.3	2	1.17	40.13	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-46.71	2	-	50.55	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-57.42	2	1.17	41.01	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.584	-42.04	2	-	55.22	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2497	-57.1	2	1.17	41.33	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-49.54	2	-	47.72	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-57.48	2	1.17	40.95	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-51.32	2	-	45.94	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-58.49	2	1.17	39.94	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2347.632	-47.22	2	-	50.04	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2379.312	-57.51	2	1.17	40.92	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-49.47	2	-	47.79	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-57.9	2	1.17	40.53	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-48.11	2	-	49.15	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-57.28	2	1.17	41.15	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.92	-44.36	2	-	52.9	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2484.04	-57.07	2	1.17	41.36	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-50.47	2	-	46.79	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-57.27	2	1.17	41.16	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

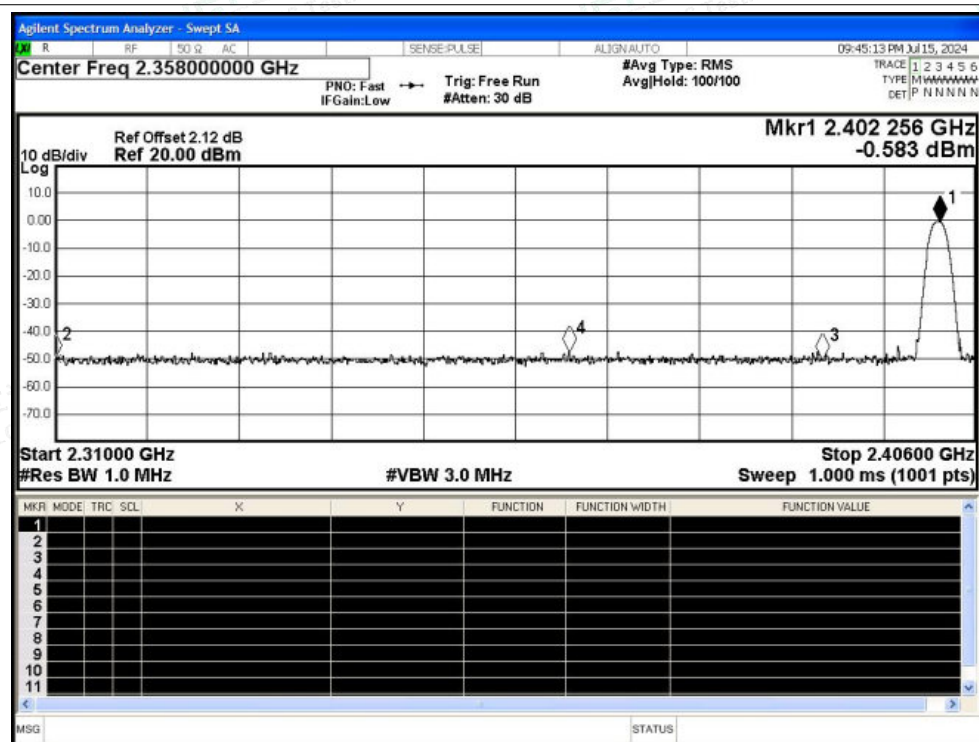

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average

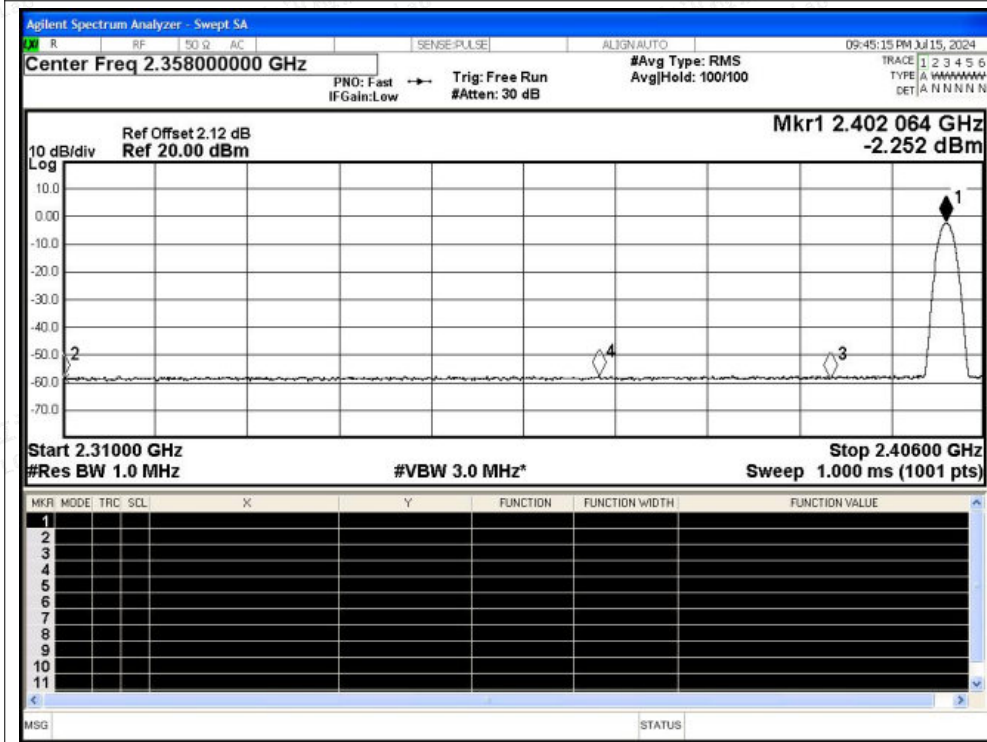

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

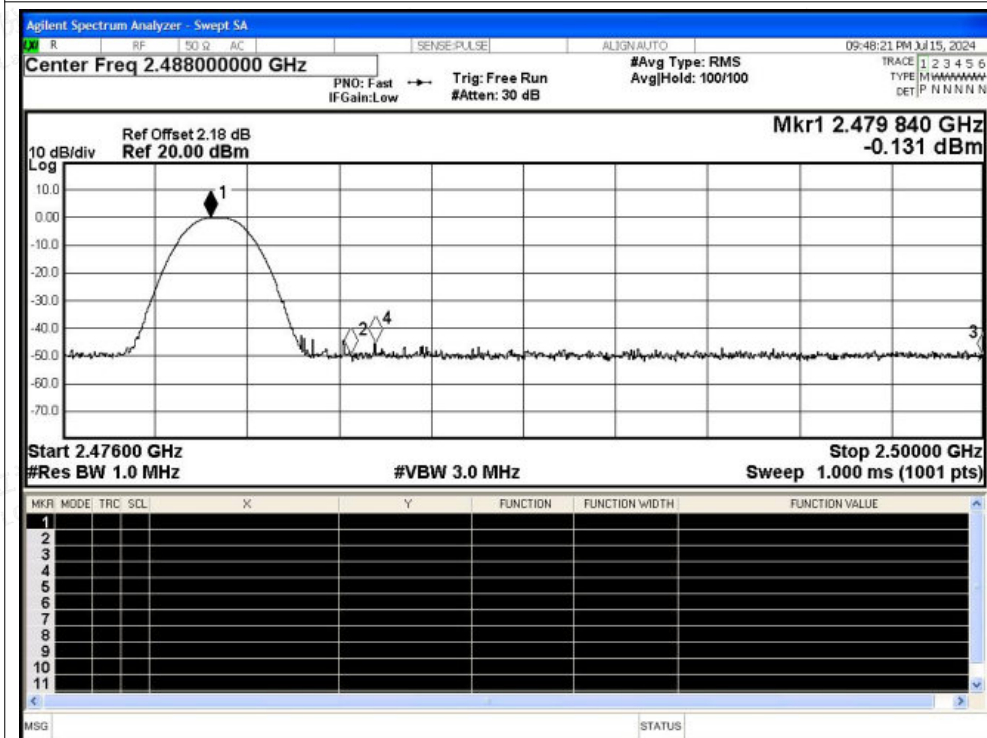

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average

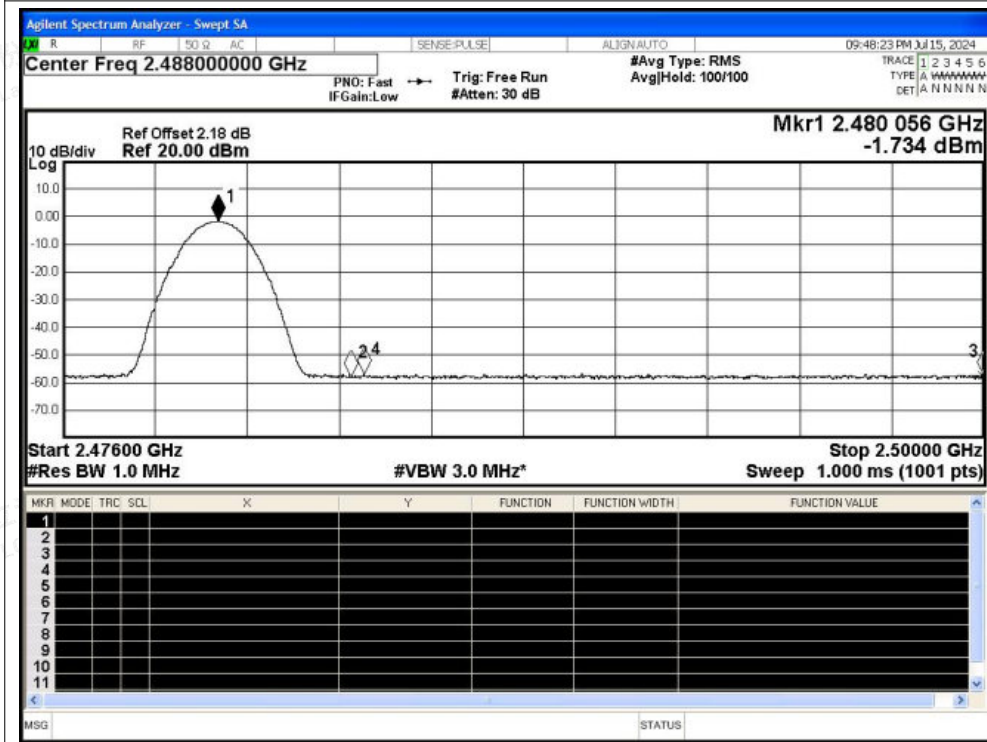

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Peak

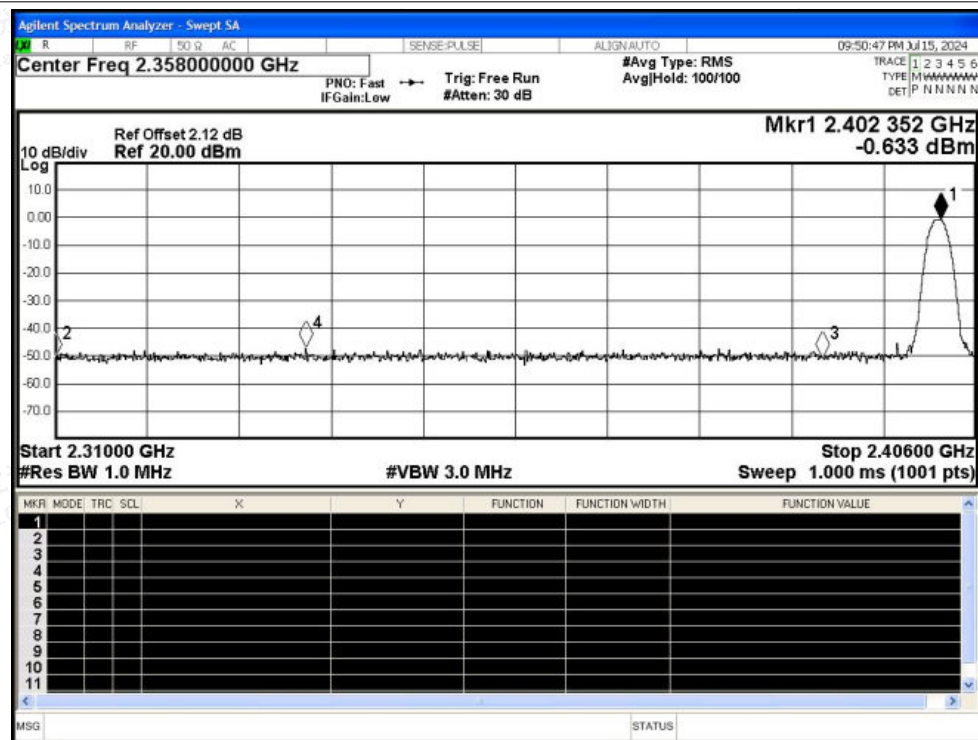

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Average

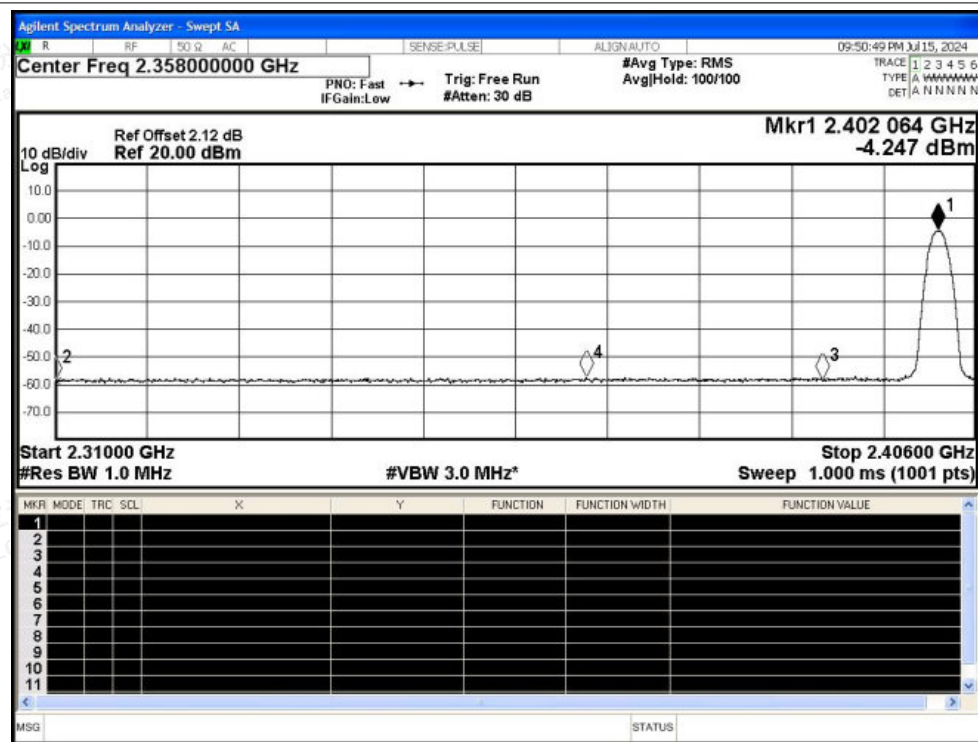

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak

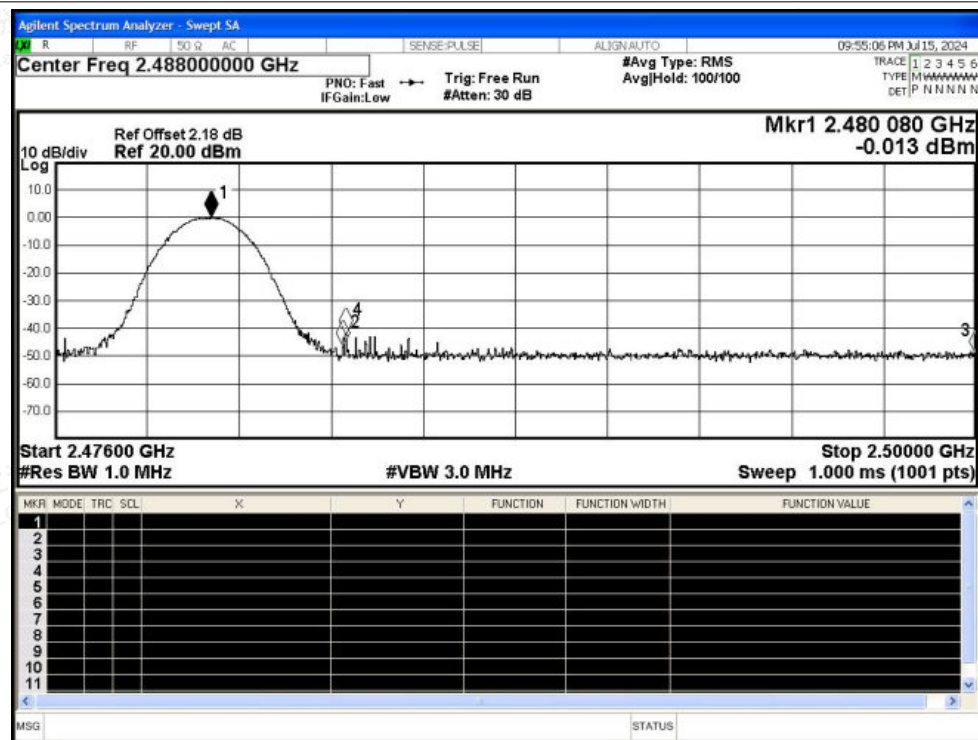

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average

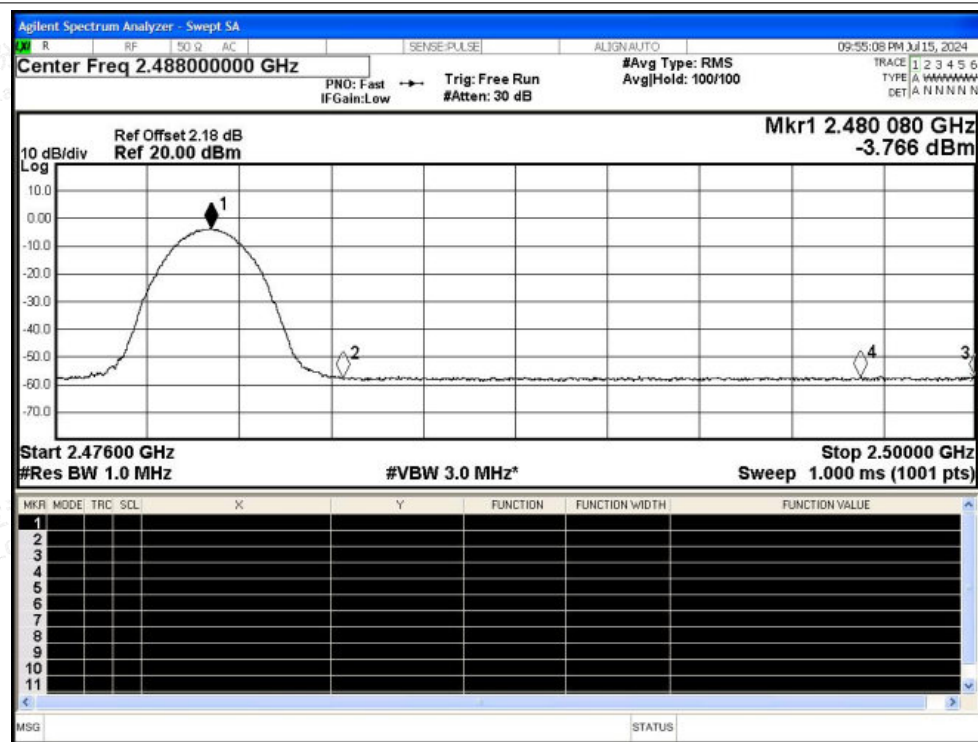

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak

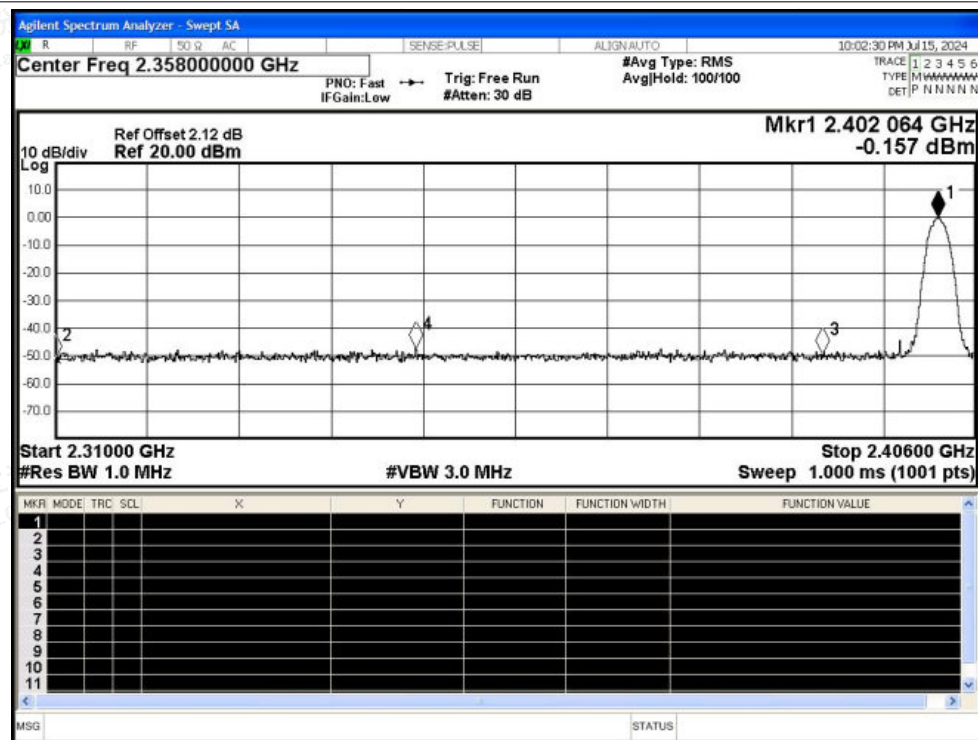

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average

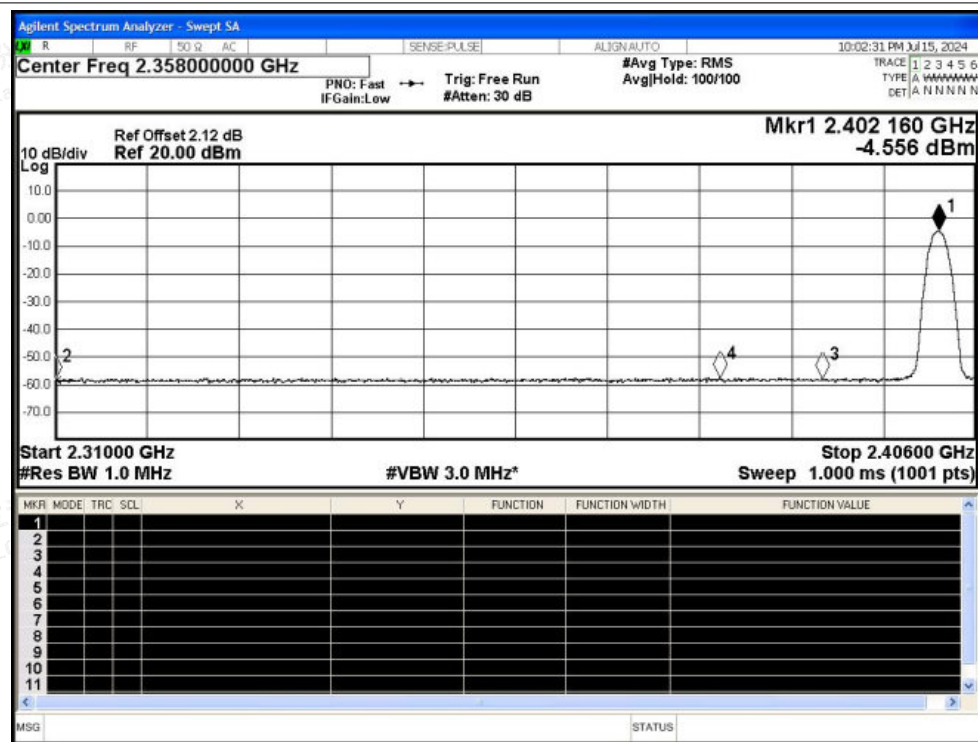

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak

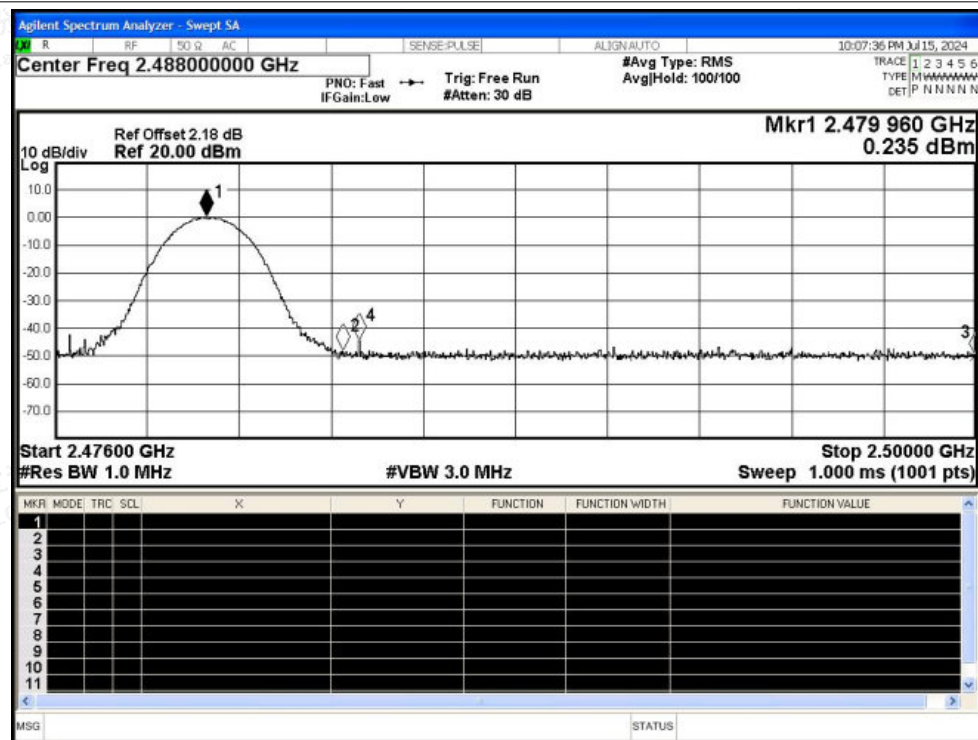

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average

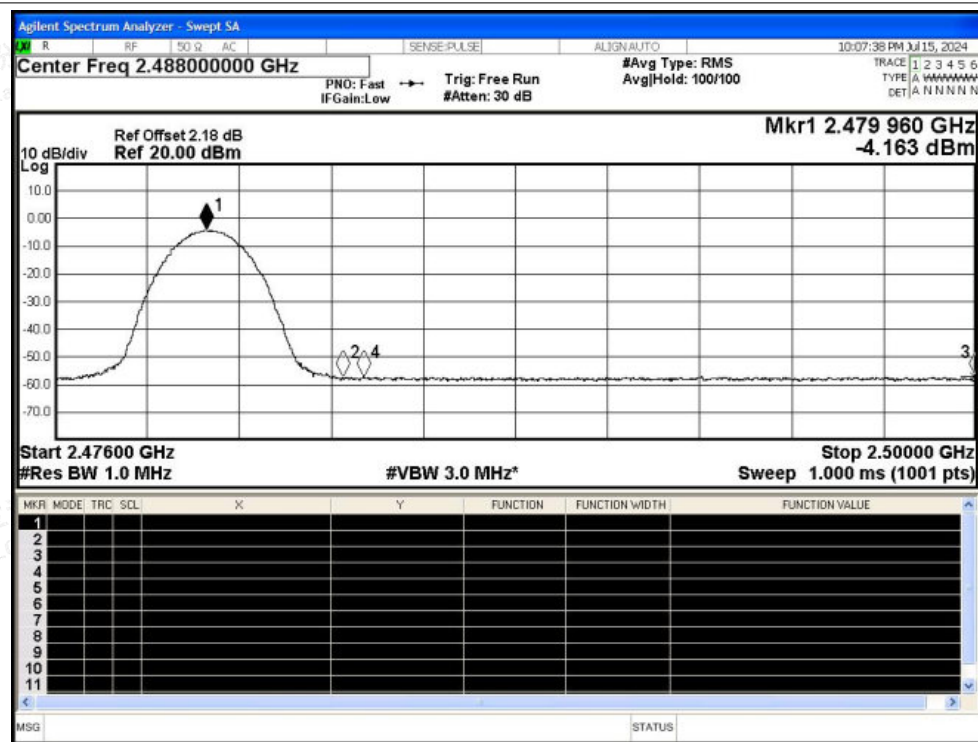

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity