

Mode	802.11a	Channel	144
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11440	36.66	19.06	55.72	74	-18.28	PK
Vertical	*	11440	34.14	19.06	53.2	74	-20.8	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

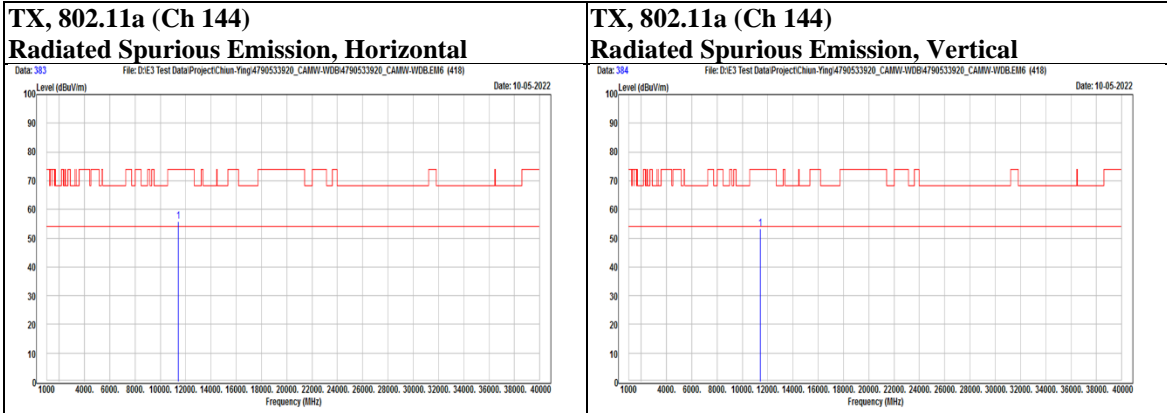

Mode	802.11a	Channel	149
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5575.5	41.44	19.77	61.21	68.2	-6.99	PK
		5683.5	40.71	19.7	60.41	93.03	-32.62	PK
	@	5745	85.24	20.15	105.39	N/A	N/A	PK
	*	11490	34.98	19.33	54.31	74	-19.69	PK
Vertical		5632	40.93	19.68	60.61	68.2	-7.59	PK
		5694.5	40.41	19.72	60.13	101.15	-41.02	PK
	@	5745	79.06	20.15	99.21	N/A	N/A	PK
	*	11490	36.94	19.33	56.27	74	-17.73	PK





Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

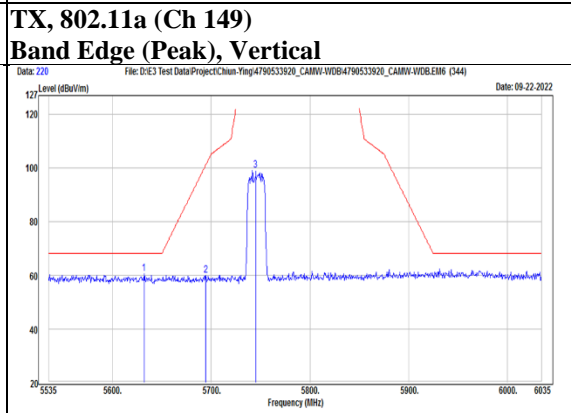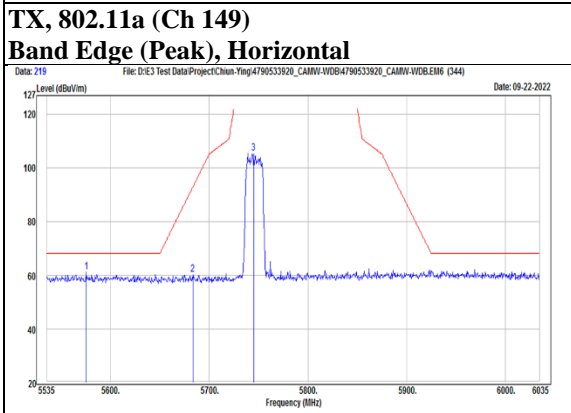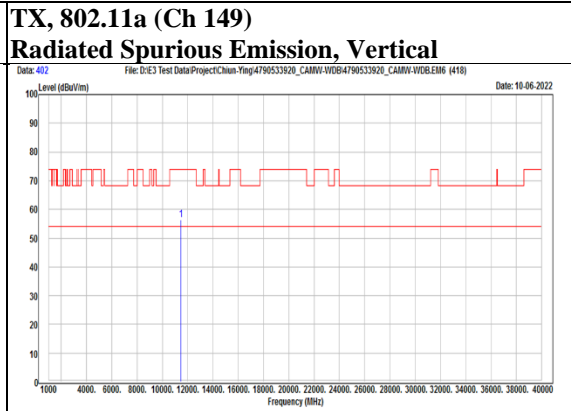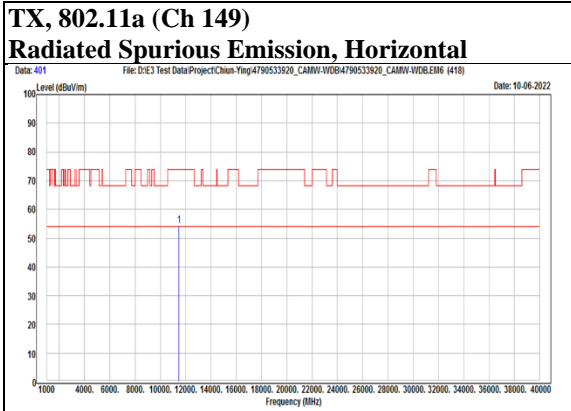

Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5568.5	41.05	19.79	60.84	68.2	-7.36	PK
		5699.5	40.6	19.73	60.33	104.83	-44.5	PK
	@	5785	84.12	20.45	104.57	N/A	N/A	PK
		5888.5	40.92	20.9	61.82	95.18	-33.36	PK
		6014	41.47	20.99	62.46	68.2	-5.74	PK
	*	11570	34.11	19.07	53.18	74	-20.82	PK
Vertical		5576.5	40.8	19.76	60.56	68.2	-7.64	PK
		5681.5	40.94	19.7	60.64	91.55	-30.91	PK
	@	5785	78.14	20.45	98.59	N/A	N/A	PK
		5909.5	41.85	20.97	62.82	79.64	-16.82	PK
		5976	41.48	20.97	62.45	68.2	-5.75	PK
	*	11570	35.98	19.07	55.05	74	-18.95	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

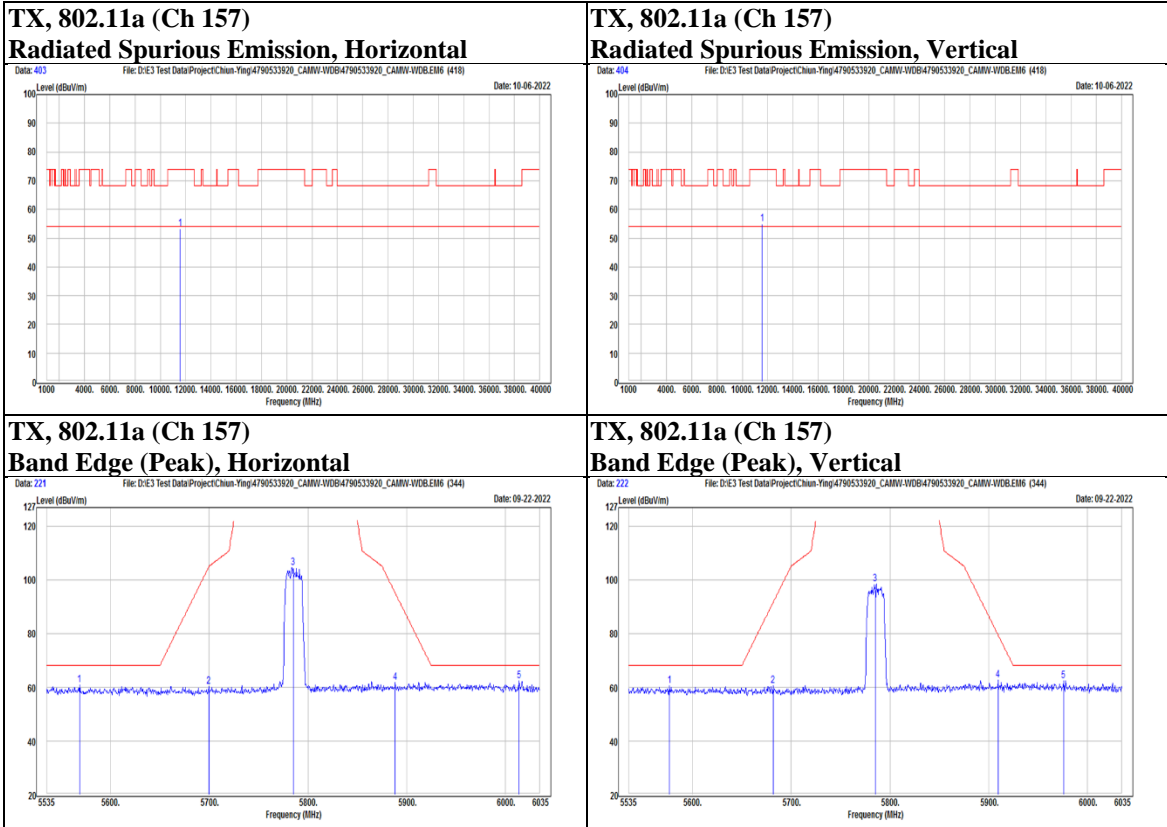

Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	83.09	20.58	103.67	N/A	N/A	PK
		5905.5	40.93	20.97	61.9	82.59	-20.69	PK
		5982	41.25	20.98	62.23	68.2	-5.97	PK
	*	11650	33.94	18.83	52.77	74	-21.23	PK
Vertical	@	5825	77.43	20.58	98.01	N/A	N/A	PK
		5901.5	40.51	20.98	61.49	85.55	-24.06	PK
		5948.5	41.02	20.94	61.96	68.2	-6.24	PK
	*	11650	36.45	18.83	55.28	74	-18.72	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

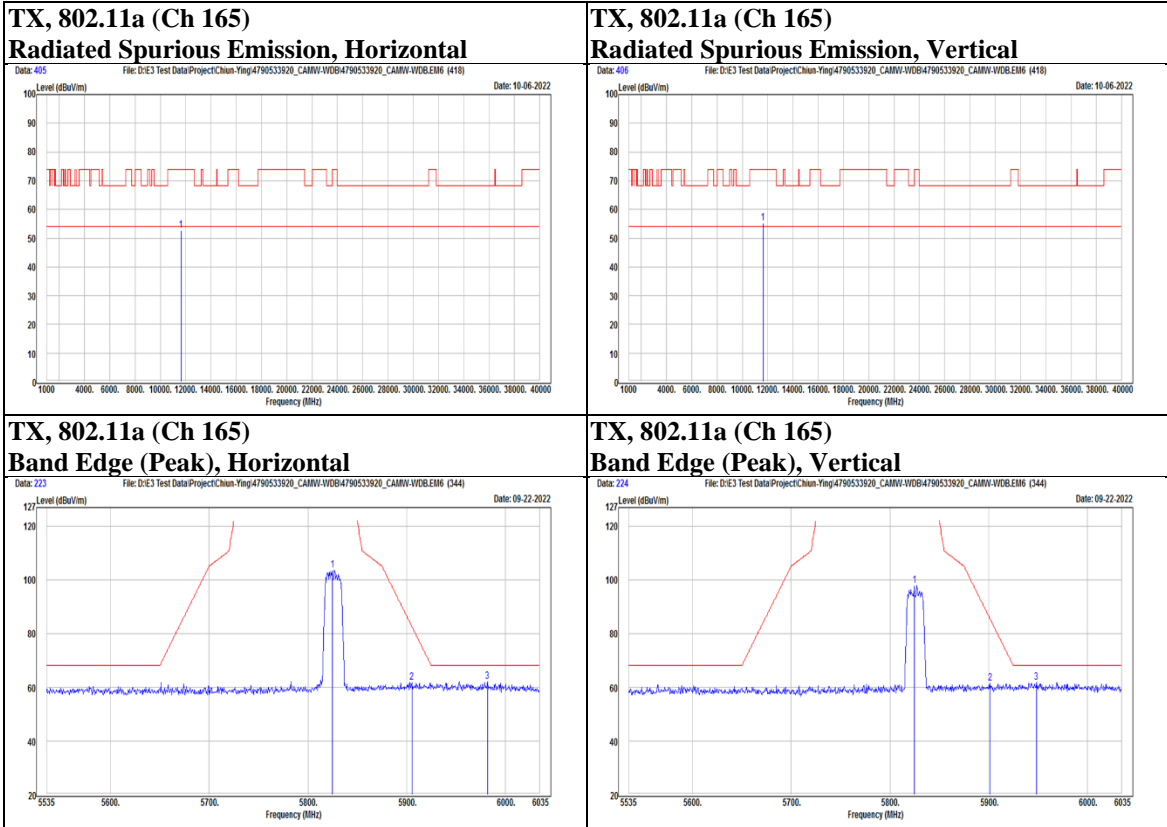

Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5095.55	29.75	19.41	49.16	54	-4.84	AVG
		5120.4	42.16	19.43	61.59	74	-12.41	PK
	@	5180	82.26	19.31	101.57	N/A	N/A	PK
	@	5180	71.03	19.31	90.34	N/A	N/A	AVG
	*	10360	29.41	17.51	46.92	68.2	-21.28	PK
Vertical		5089.6	42.72	19.37	62.09	74	-11.91	PK
		5100.45	29.75	19.44	49.19	54	-4.81	AVG
	@	5180	80.27	19.31	99.58	N/A	N/A	PK
	@	5180	70.43	19.31	89.74	N/A	N/A	AVG
	*	10360	29.5	17.51	47.01	68.2	-21.19	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

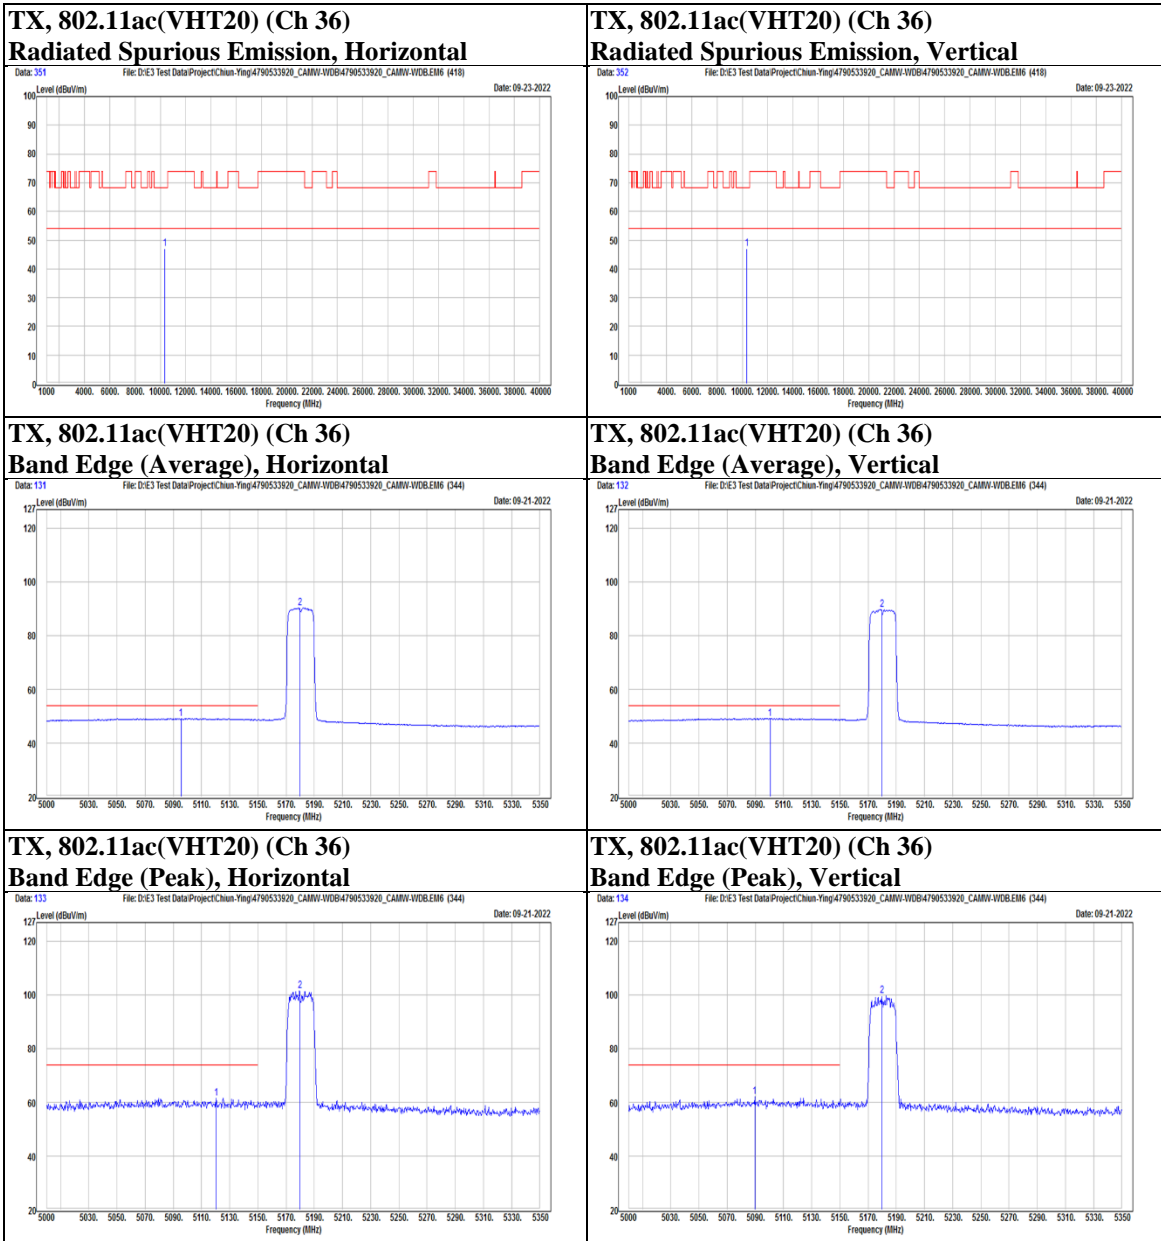

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5113.4	43.37	19.43	62.8	74	-11.2	PK
		5120.05	29.73	19.43	49.16	54	-4.84	AVG
	@	5220	82.78	19.12	101.9	N/A	N/A	PK
	@	5220	71.38	19.12	90.5	N/A	N/A	AVG
	*	10440	29.27	17.81	47.08	68.2	-21.12	PK
Vertical		5086.8	41.94	19.35	61.29	74	-12.71	PK
		5088.55	29.85	19.37	49.22	54	-4.78	AVG
	@	5220	79.52	19.12	98.64	N/A	N/A	PK
	@	5220	71.39	19.12	90.51	N/A	N/A	AVG
	*	10440	29.3	17.81	47.11	68.2	-21.09	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

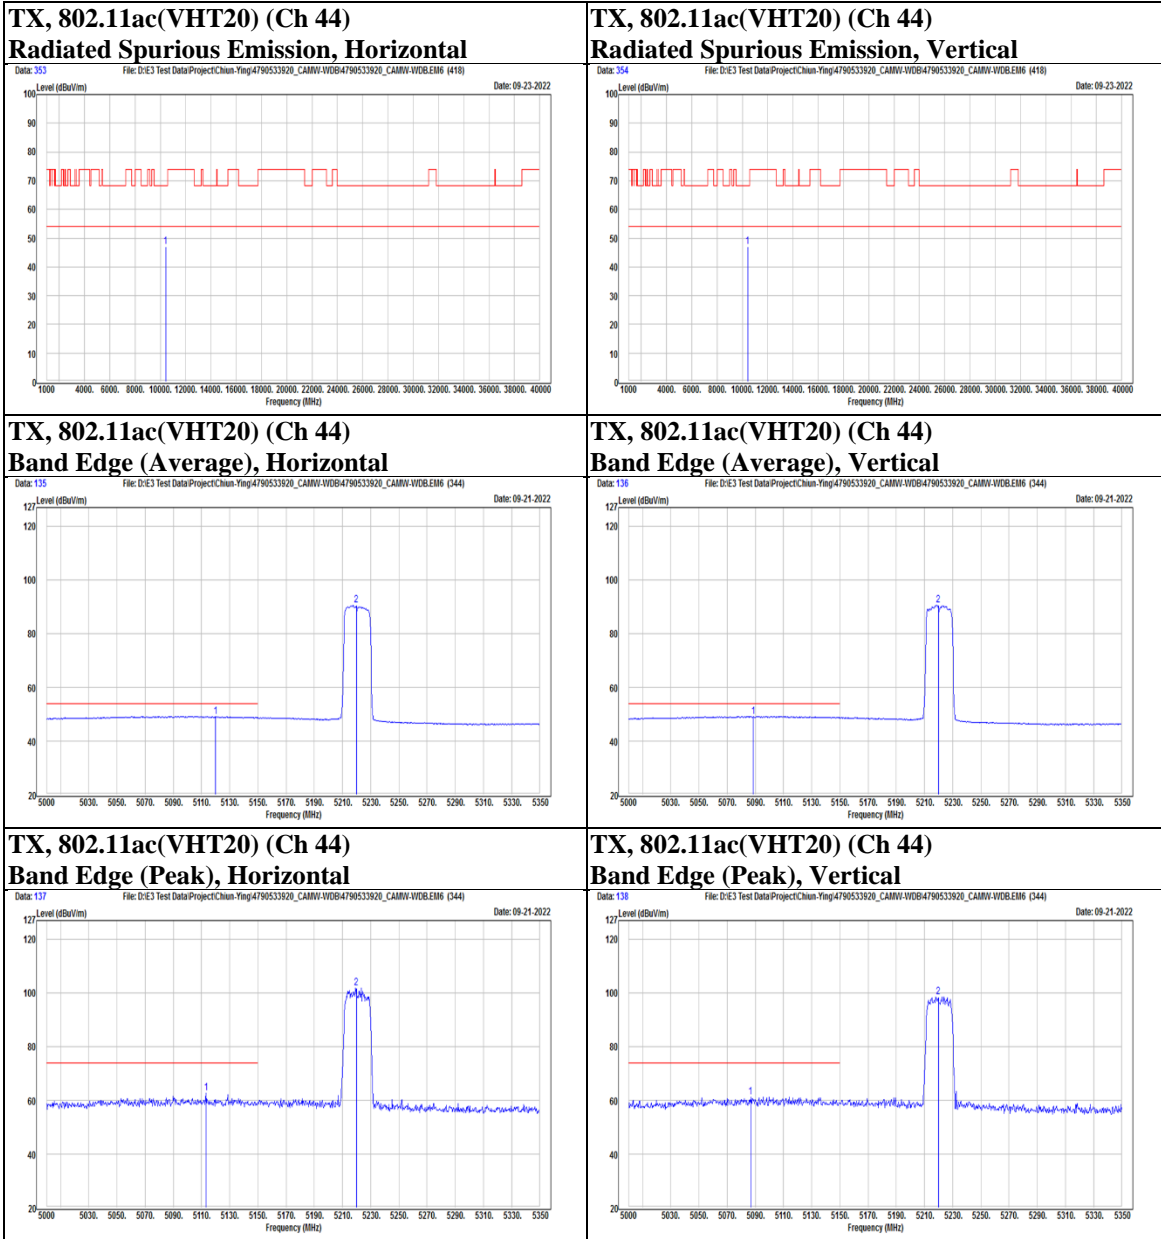

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5110.6	29.78	19.44	49.22	54	-4.78	AVG
		5119.35	42.49	19.43	61.92	74	-12.08	PK
	@	5240	82.47	18.97	101.44	N/A	N/A	PK
	@	5240	71.72	18.97	90.69	N/A	N/A	AVG
	*	10480	30.04	17.92	47.96	68.2	-20.24	PK
Vertical		5097.3	29.9	19.42	49.32	54	-4.68	AVG
		5100.8	41.72	19.44	61.16	74	-12.84	PK
	@	5240	79.33	18.97	98.3	N/A	N/A	PK
	@	5240	71.34	18.97	90.31	N/A	N/A	AVG
	*	10480	29.45	17.92	47.37	68.2	-20.83	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

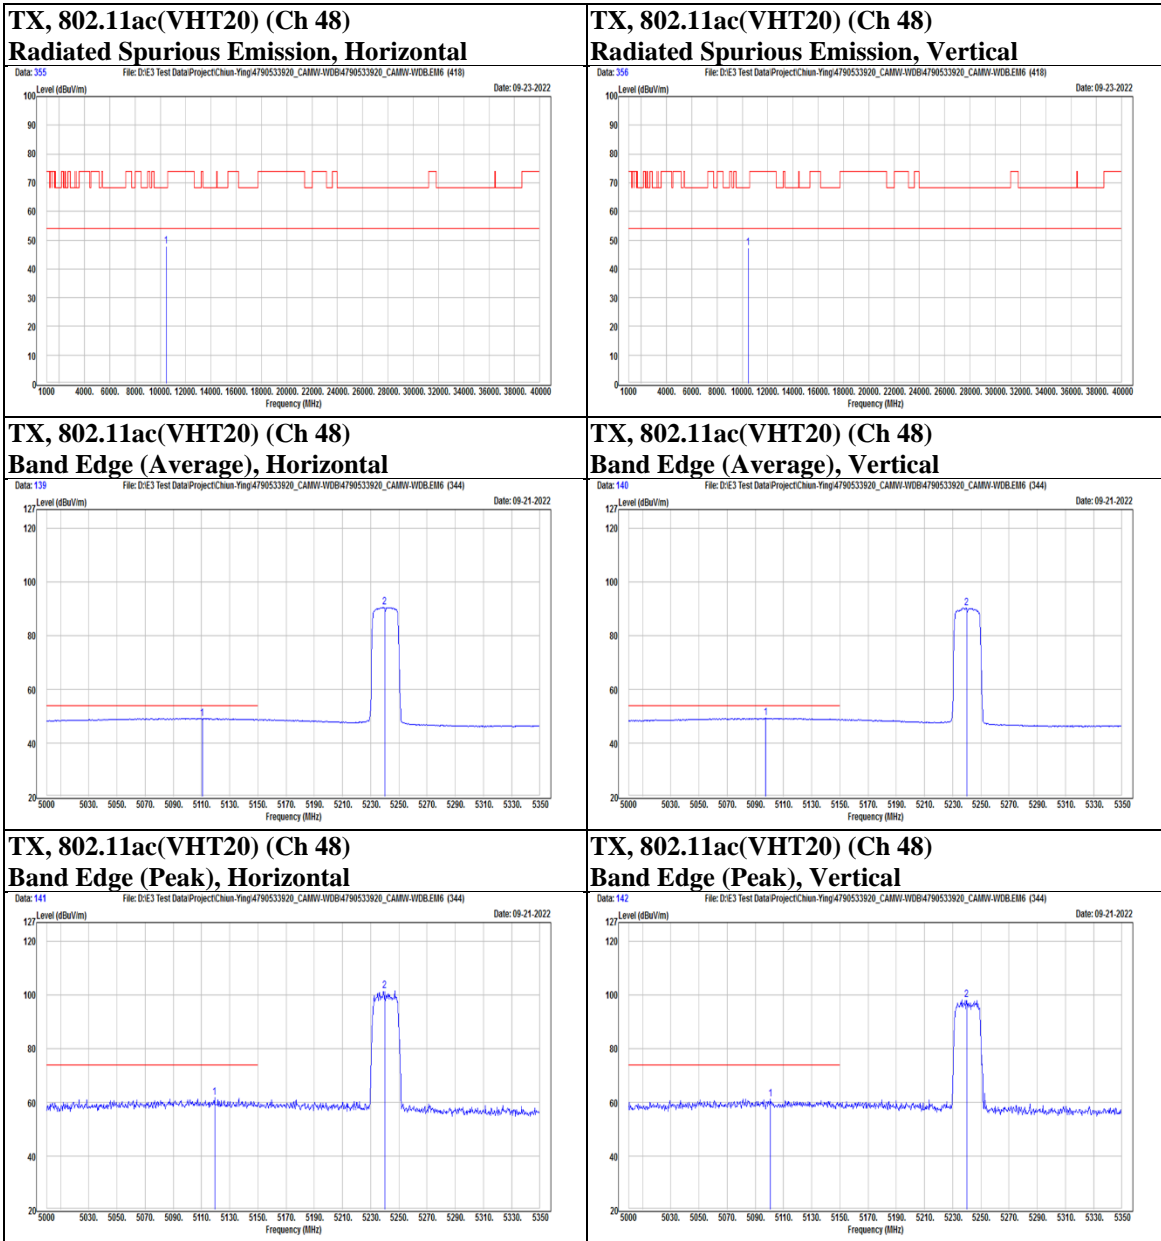

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	81.38	18.88	100.26	N/A	N/A	PK
	@	5260	71.8	18.88	90.68	N/A	N/A	AVG
		5427.3	40.44	19.41	59.85	74	-14.15	PK
		5460	28.35	19.57	47.92	54	-6.08	AVG
	*	10520	31.91	17.99	49.9	68.2	-18.3	PK
Vertical	@	5260	81.62	18.88	100.5	N/A	N/A	PK
	@	5260	71.37	18.88	90.25	N/A	N/A	AVG
		5422.5	40.12	19.38	59.5	74	-14.5	PK
		5460	28.48	19.57	48.05	54	-5.95	AVG
	*	10520	32.59	17.99	50.58	68.2	-17.62	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

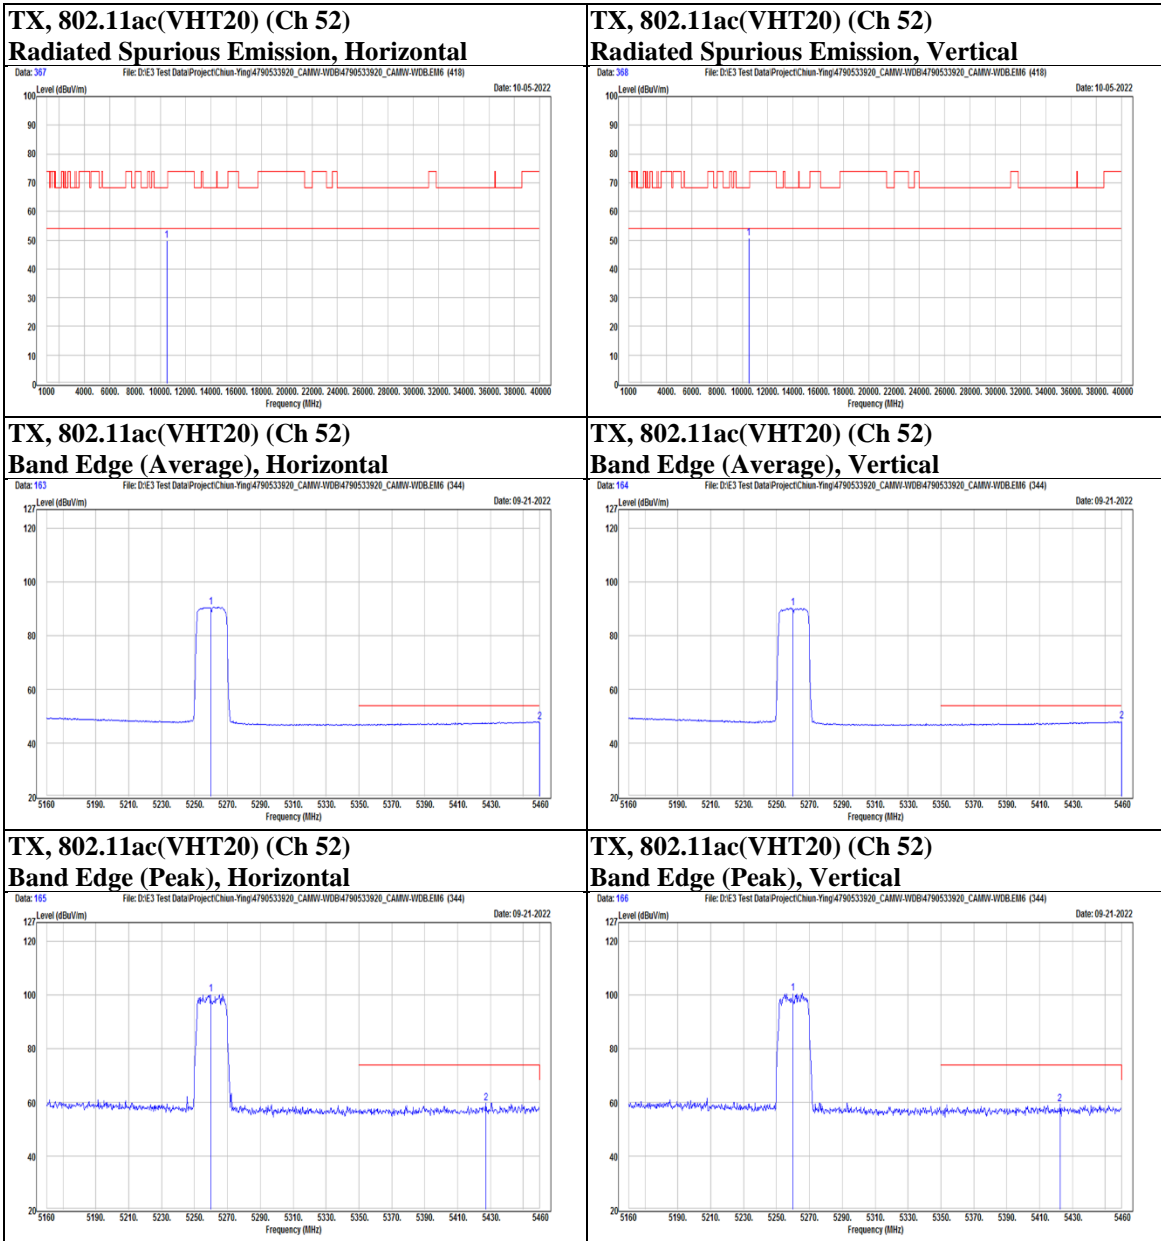

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	82.01	18.77	100.78	N/A	N/A	PK
	@	5300	71.86	18.77	90.63	N/A	N/A	AVG
		5455.8	40.27	19.54	59.81	74	-14.19	PK
		5459.7	28.39	19.57	47.96	54	-6.04	AVG
	*	10600	31.03	18.04	49.07	68.2	-19.13	PK
Vertical	@	5300	80.44	18.77	99.21	N/A	N/A	PK
	@	5300	70.78	18.77	89.55	N/A	N/A	AVG
		5424	39.85	19.39	59.24	74	-14.76	PK
		5458.2	28.46	19.56	48.02	54	-5.98	AVG
	*	10600	31.42	18.04	49.46	68.2	-18.74	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

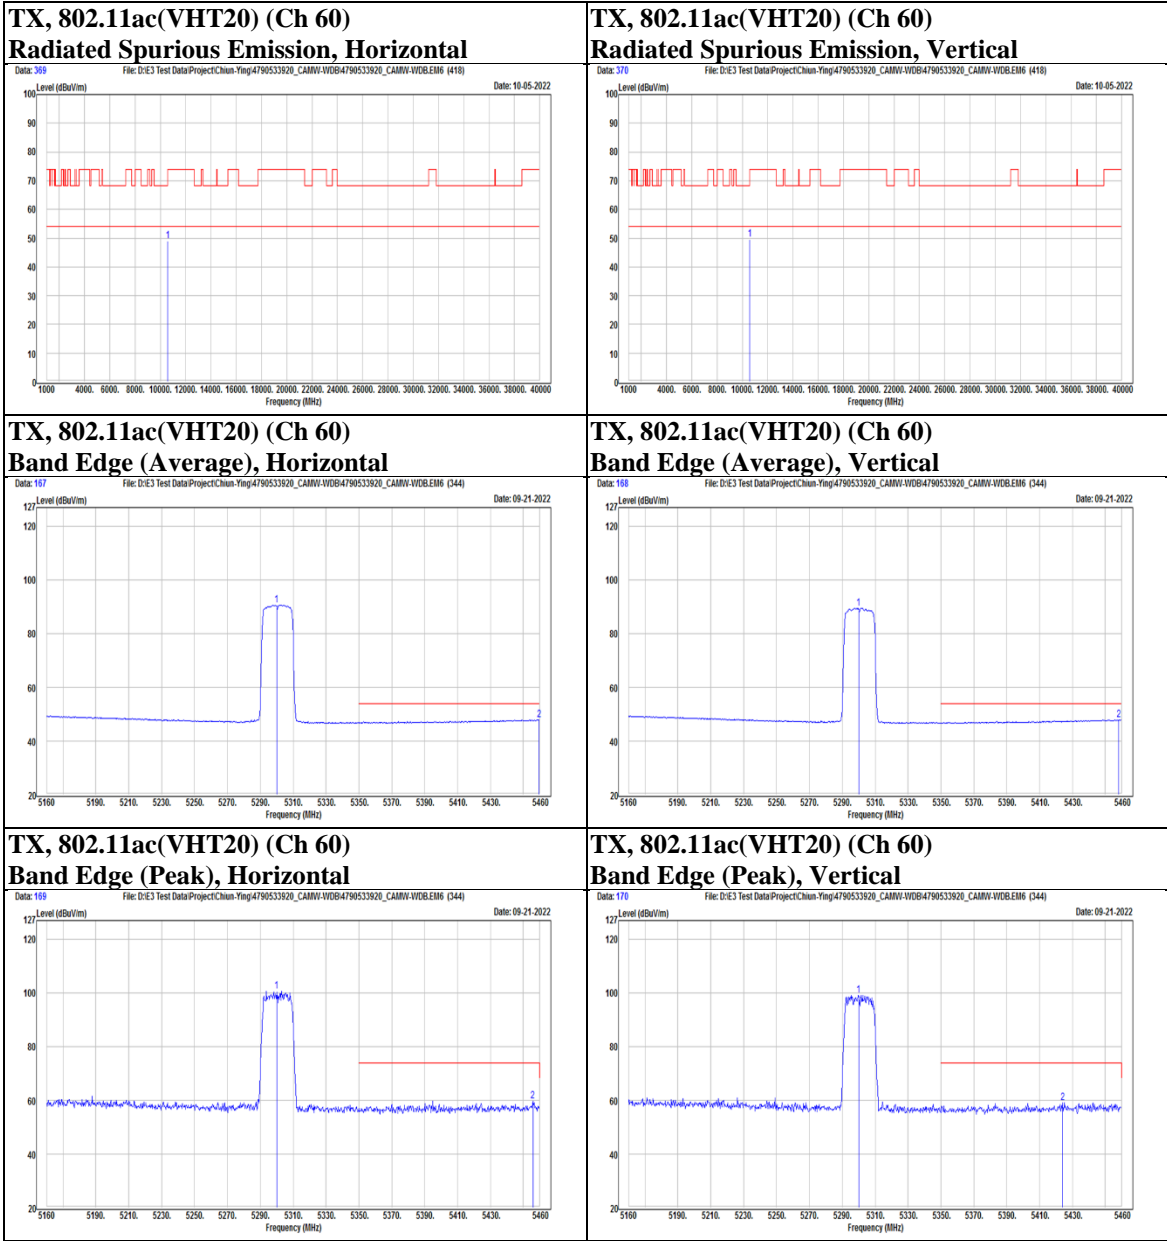

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	81.63	18.86	100.49	N/A	N/A	PK
	@	5320	71.44	18.86	90.3	N/A	N/A	AVG
		5366.4	40.29	19.1	59.39	74	-14.61	PK
		5454.3	28.36	19.54	47.9	54	-6.1	AVG
	*	10640	31.35	18.03	49.38	74	-24.62	PK
Vertical	@	5320	80.59	18.86	99.45	N/A	N/A	PK
	@	5320	70.24	18.86	89.1	N/A	N/A	AVG
		5389.5	40.16	19.22	59.38	74	-14.62	PK
		5459.1	28.54	19.57	48.11	54	-5.89	AVG
	*	10640	31.99	18.03	50.02	74	-23.98	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

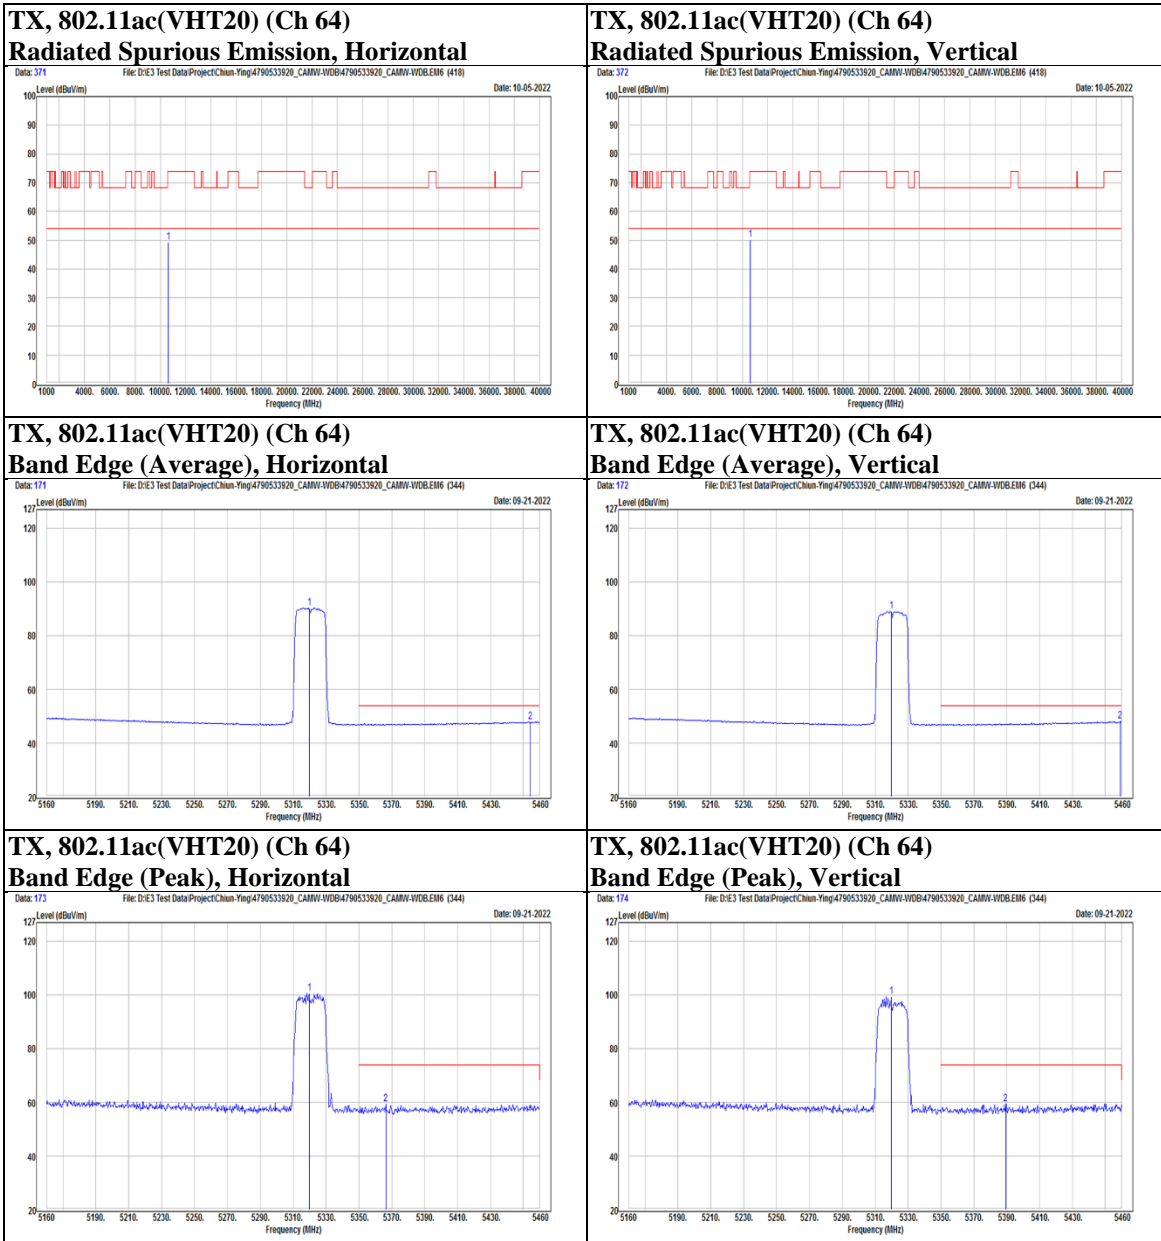

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5425.55	40.03	19.39	59.42	74	-14.58	PK
		5458.8	28.06	19.57	47.63	54	-6.37	AVG
		5468.95	39.69	19.62	59.31	68.2	-8.89	PK
	@	5500	85.73	19.77	105.5	N/A	N/A	PK
	@	5500	74.01	19.77	93.78	N/A	N/A	AVG
	*	11000	31.17	18.41	49.58	74	-24.42	PK
Vertical		5438.5	40.47	19.46	59.93	74	-14.07	PK
		5456.35	28.05	19.55	47.6	54	-6.4	AVG
		5470	39.46	19.62	59.08	68.2	-9.12	PK
	@	5500	80.2	19.77	99.97	N/A	N/A	PK
	@	5500	70.39	19.77	90.16	N/A	N/A	AVG
	*	11000	30.72	18.41	49.13	74	-24.87	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

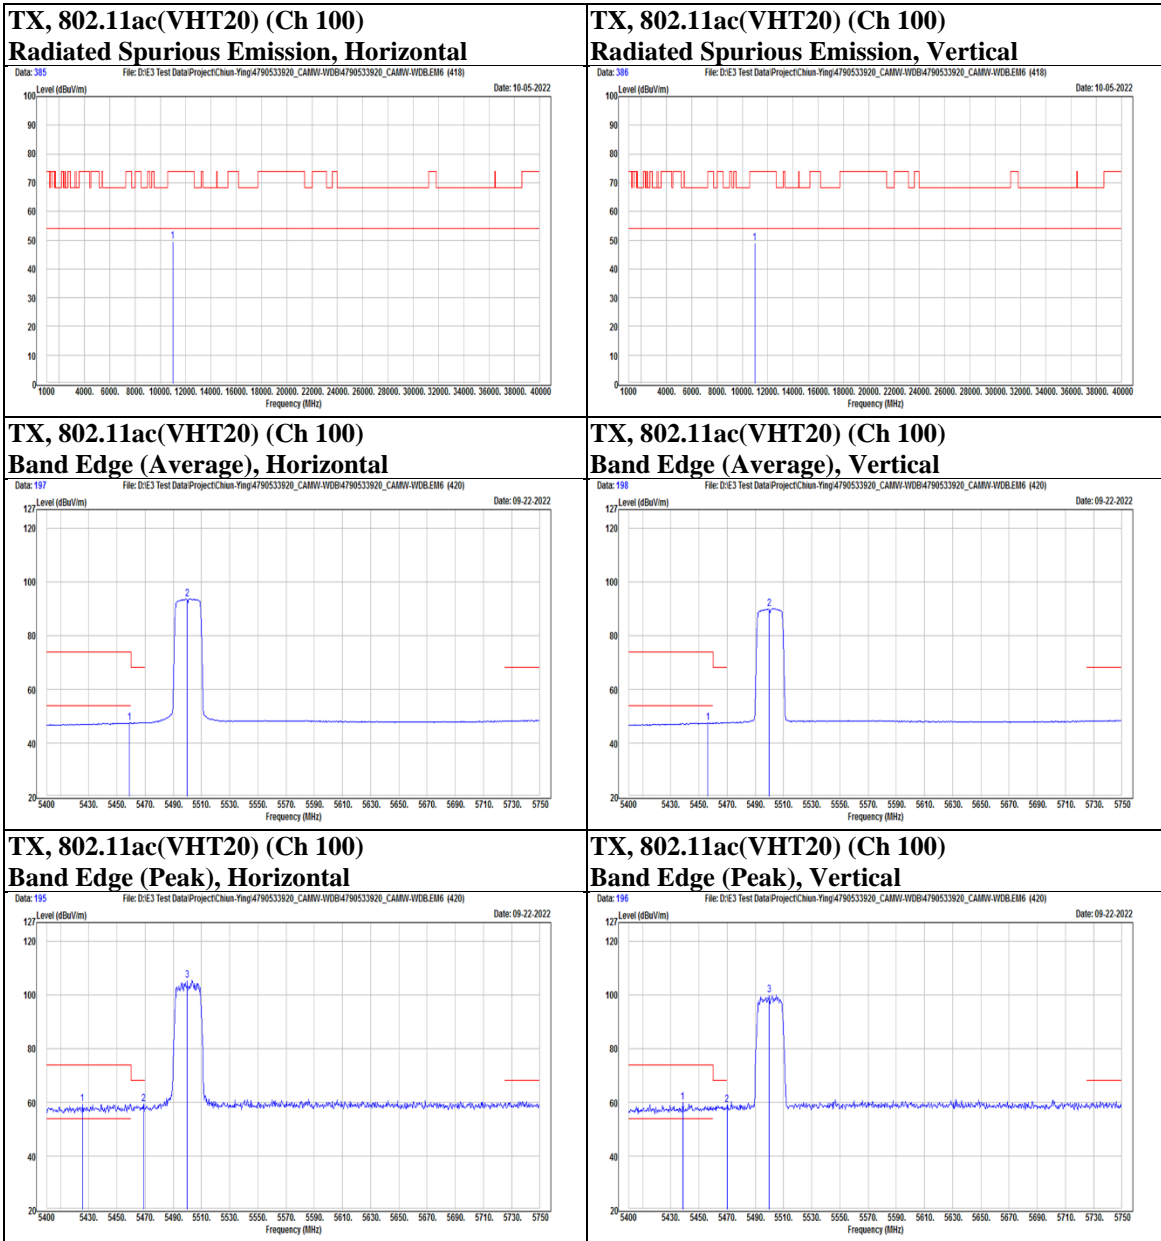

Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5438.85	40.58	19.47	60.05	74	-13.95	PK
		5453.2	28.09	19.53	47.62	54	-6.38	AVG
		5468.25	39.45	19.61	59.06	68.2	-9.14	PK
	@	5580	85.7	19.76	105.46	N/A	N/A	PK
	@	5580	75.34	19.76	95.1	N/A	N/A	AVG
		5738.1	39.87	20.08	59.95	68.2	-8.25	PK
	*	11160	31.69	18.47	50.16	74	-23.84	PK
Vertical		5447.25	40.82	19.5	60.32	74	-13.68	PK
		5450.75	28.06	19.52	47.58	54	-6.42	AVG
		5463.7	39.68	19.58	59.26	68.2	-8.94	PK
	@	5580	80.34	19.76	100.1	N/A	N/A	PK
	@	5580	69.07	19.76	88.83	N/A	N/A	AVG
		5745.1	40.32	20.15	60.47	68.2	-7.73	PK
	*	11160	31.14	18.47	49.61	74	-24.39	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

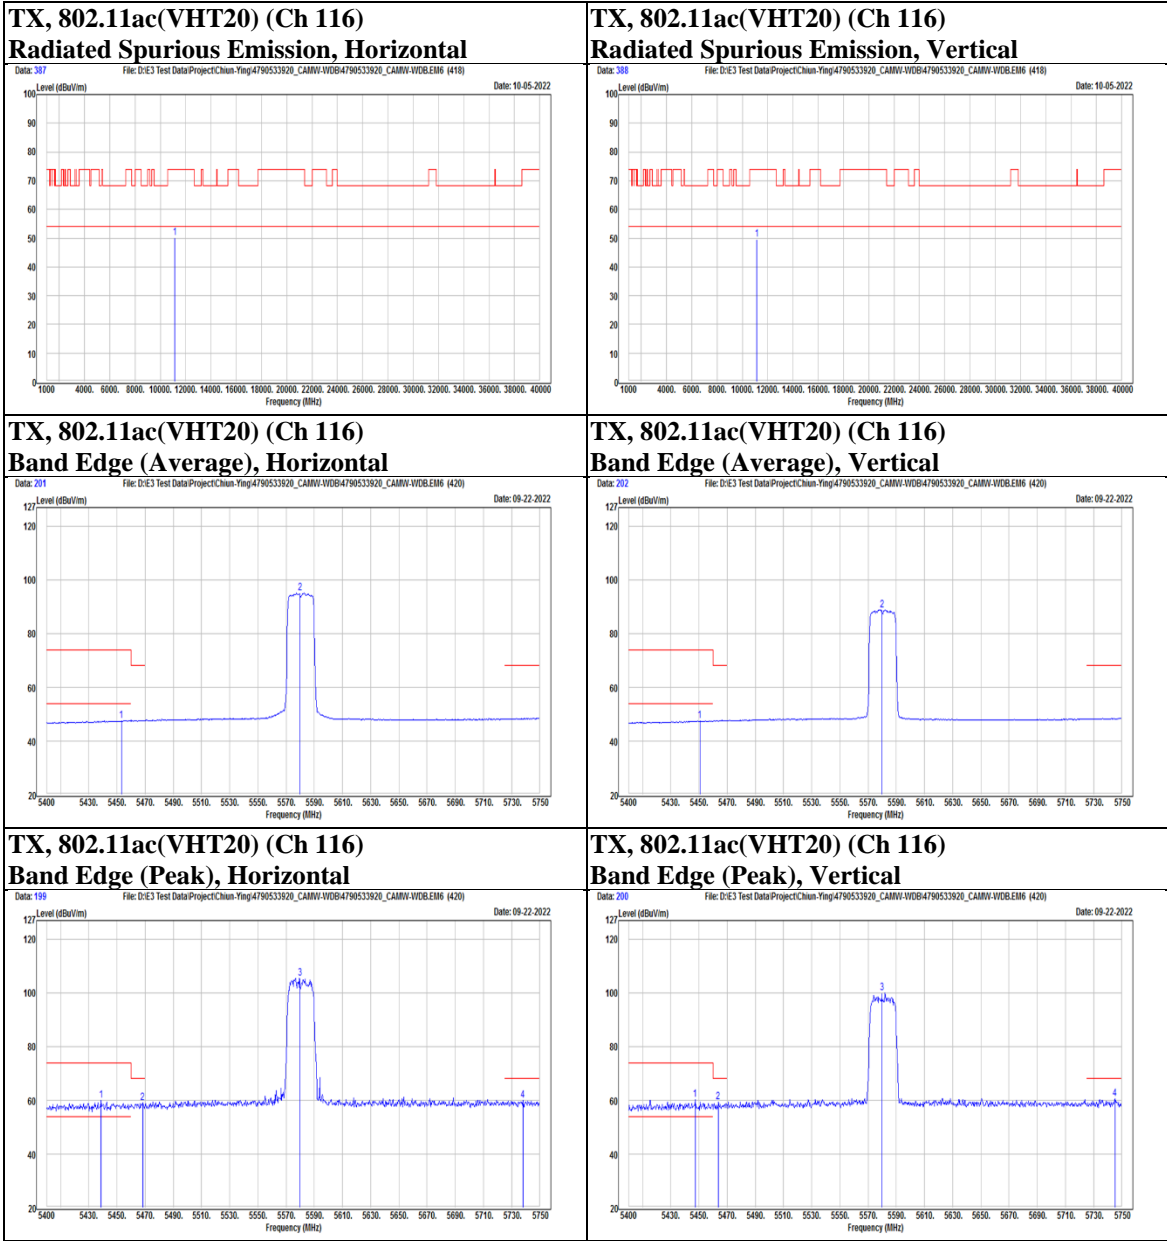

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5453.2	28.06	19.53	47.59	54	-6.41	AVG
	@	5700	85.37	19.73	105.1	N/A	N/A	PK
	@	5700	74.24	19.73	93.97	N/A	N/A	AVG
		5750	40.18	20.19	60.37	68.2	-7.83	PK
Vertical	*	11400	30.77	18.85	49.62	74	-24.38	PK
		5450.75	28.05	19.52	47.57	54	-6.43	AVG
	@	5700	78.35	19.73	98.08	N/A	N/A	PK
	@	5700	67.82	19.73	87.55	N/A	N/A	AVG
		5734.25	40.14	20.05	60.19	68.2	-8.01	PK
	*	11400	30.18	18.85	49.03	74	-24.97	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

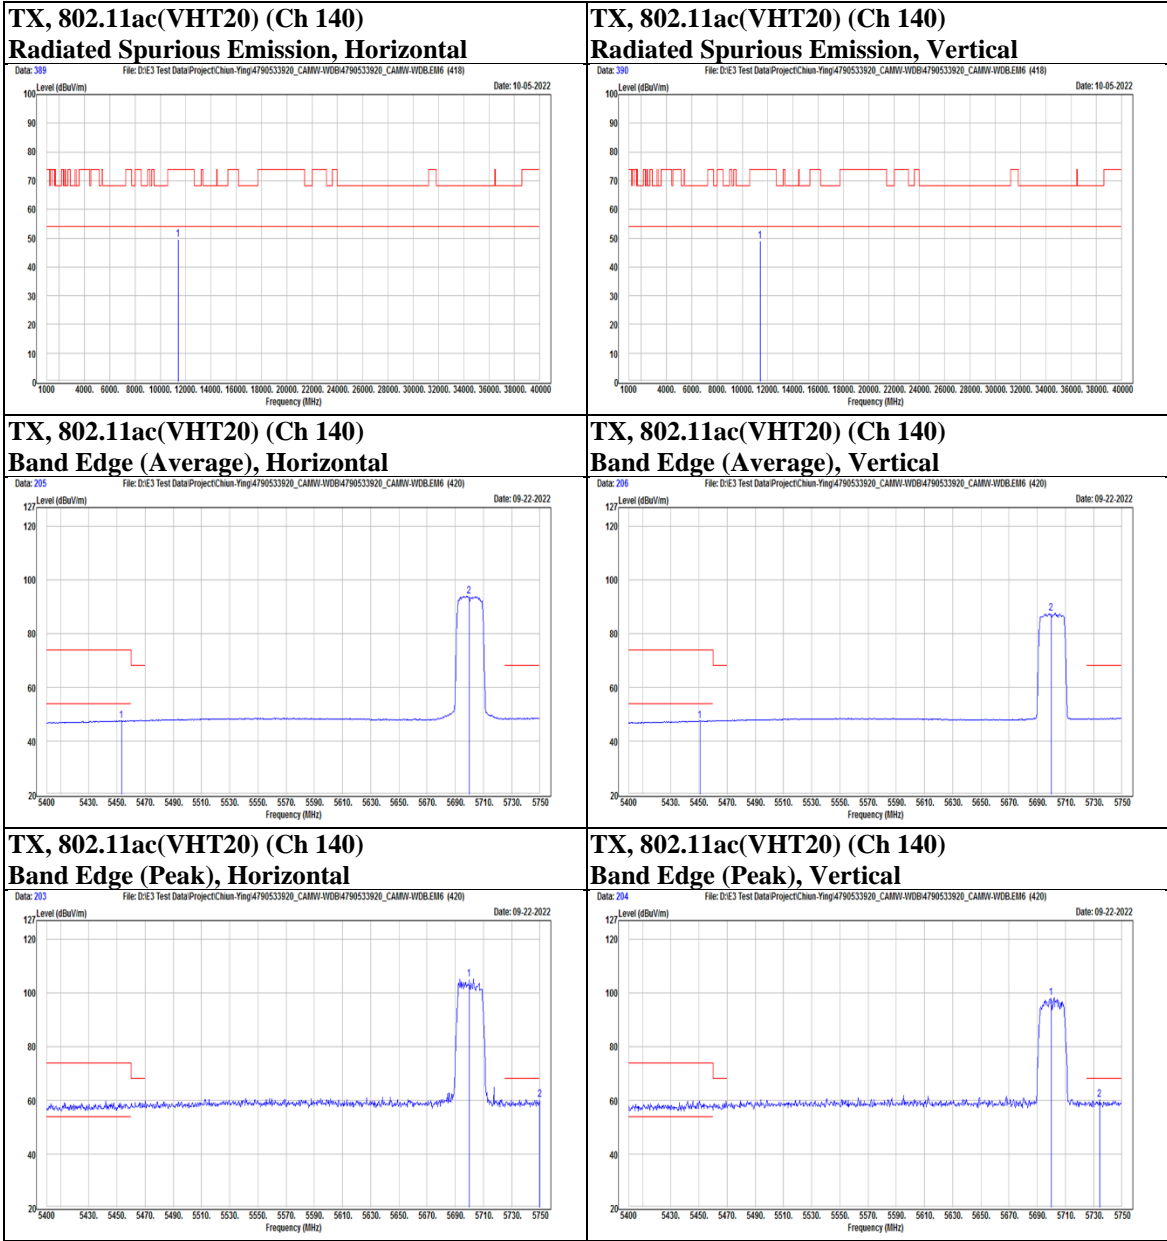

Mode	802.11ac(VHT20)	Channel	144
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11440	31.16	19.06	50.22	74	-23.78	PK
Vertical	*	11440	31.96	19.06	51.02	74	-22.98	PK

Underwriters Laboratories Taiwan Co., Ltd.


Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

TX, 802.11ac(VHT20) (Ch 144)
Radiated Spurious Emission, Horizontal

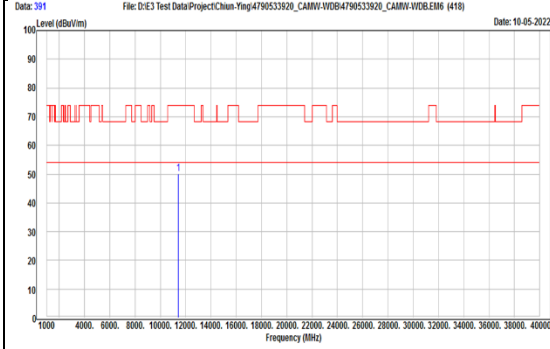

TX, 802.11ac(VHT20) (Ch 144)
Radiated Spurious Emission, Vertical

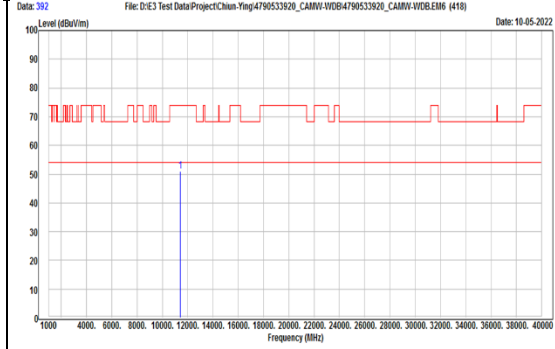

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5641.5	40.83	19.67	60.5	68.2	-7.7	PK
		5697	40.99	19.72	60.71	102.99	-42.28	PK
	@	5745	84.84	20.15	104.99	N/A	N/A	PK
	*	11490	29.9	19.33	49.23	74	-24.77	PK
Vertical		5600	41.12	19.7	60.82	68.2	-7.38	PK
		5662	40.52	19.68	60.2	77.11	-16.91	PK
	@	5745	77.82	20.15	97.97	N/A	N/A	PK
	*	11490	31.35	19.33	50.68	74	-23.32	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

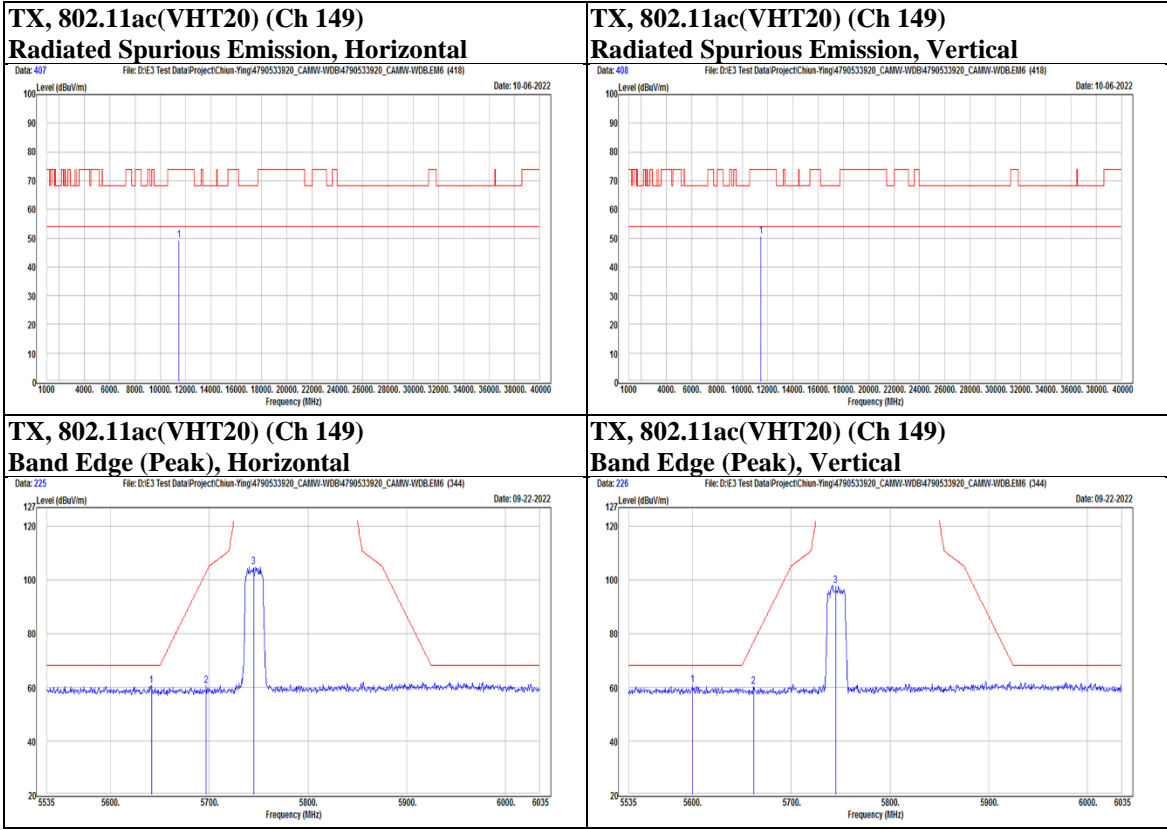

Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5549	41.76	19.83	61.59	68.2	-6.61	PK
		5691	40.45	19.71	60.16	98.56	-38.4	PK
	@	5785	83.74	20.45	104.19	N/A	N/A	PK
		5885	41.4	20.87	62.27	97.77	-35.5	PK
		5956	41.05	20.95	62	68.2	-6.2	PK
	*	11570	29.76	19.07	48.83	74	-25.17	PK
Vertical		5612	41.74	19.69	61.43	68.2	-6.77	PK
		5663	40.68	19.68	60.36	77.85	-17.49	PK
	@	5785	77.63	20.45	98.08	N/A	N/A	PK
		5917.5	41.54	20.96	62.5	73.73	-11.23	PK
		5944	42.52	20.94	63.46	68.2	-4.74	PK
	*	11570	30.66	19.07	49.73	74	-24.27	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

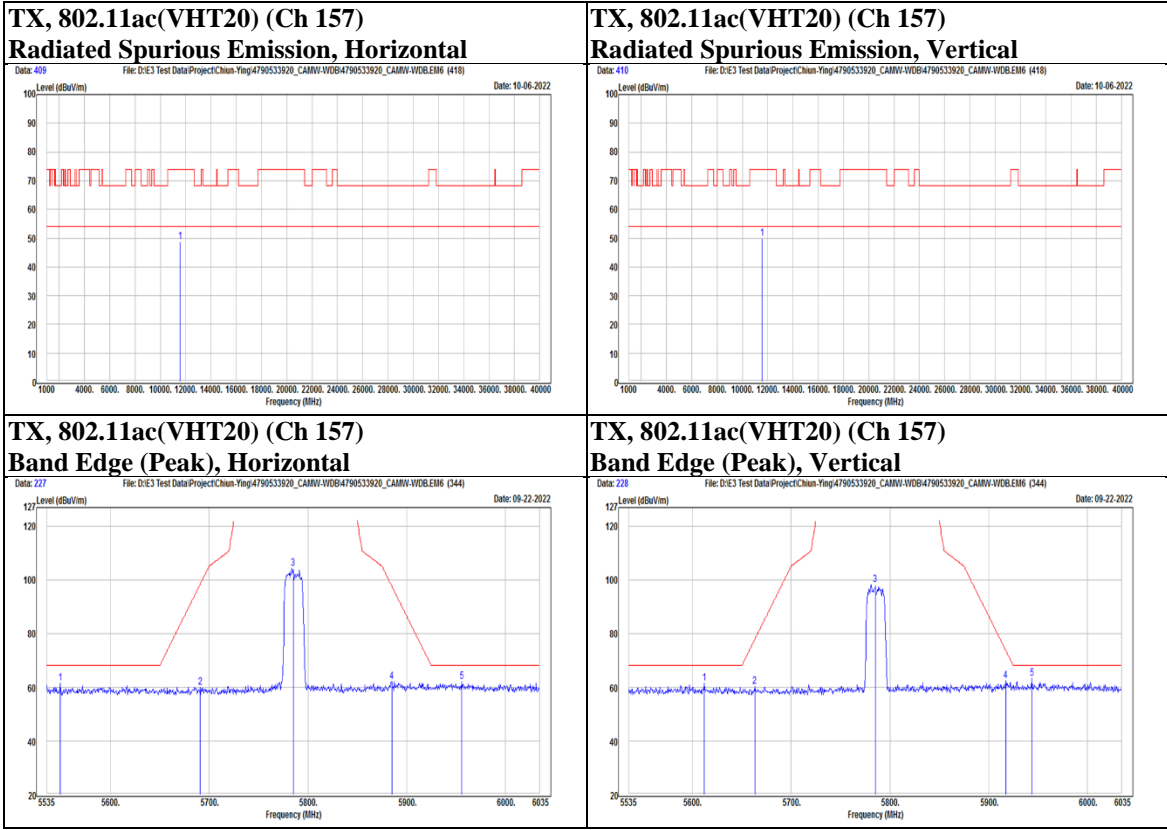

Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	83.49	20.58	104.07	N/A	N/A	PK
		5924	40.71	20.96	61.67	68.94	-7.27	PK
		5934	41.62	20.95	62.57	68.2	-5.63	PK
	*	11650	30.96	18.83	49.79	74	-24.21	PK
Vertical	@	5825	76.68	20.58	97.26	N/A	N/A	PK
		5890	41.44	20.91	62.35	94.07	-31.72	PK
		6016.5	40.76	20.99	61.75	68.2	-6.45	PK
	*	11650	29.51	18.83	48.34	74	-25.66	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

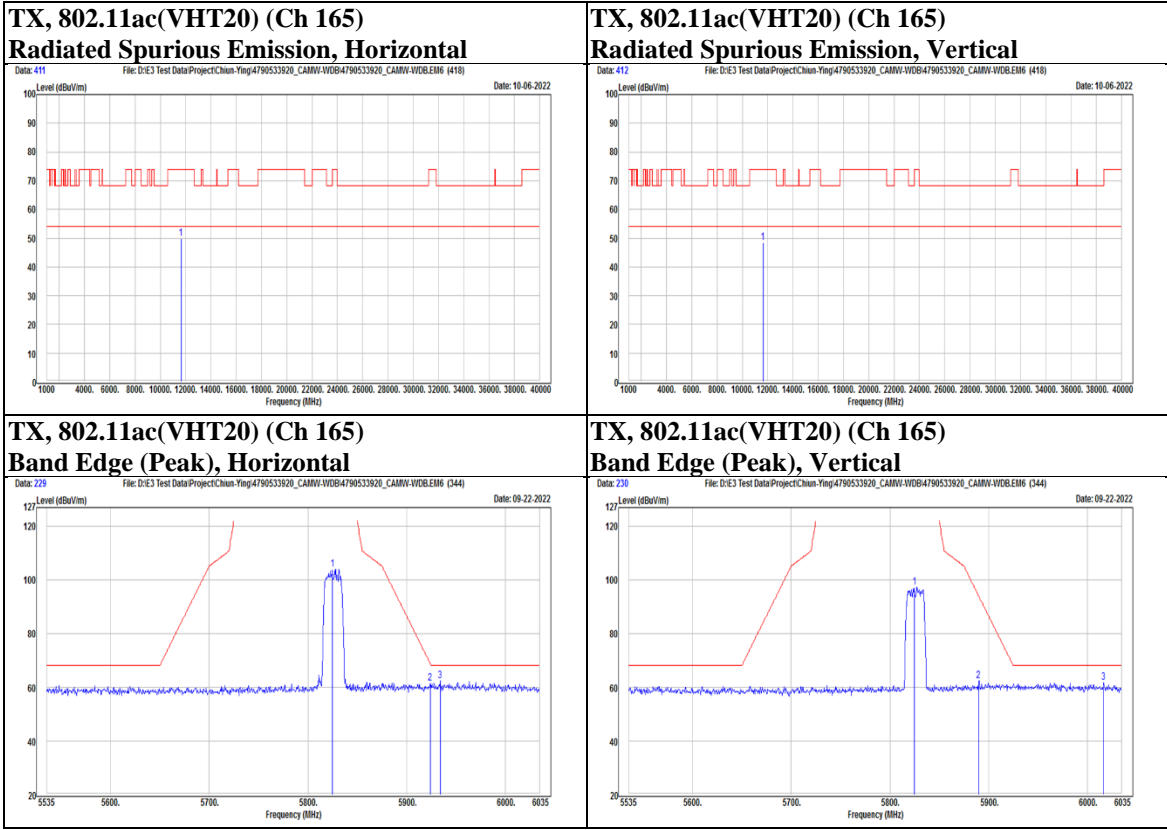

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5105.35	29.79	19.44	49.23	54	-4.77	AVG
		5106.4	42.47	19.44	61.91	74	-12.09	PK
	@	5190	79.5	19.29	98.79	N/A	N/A	PK
	@	5190	68.15	19.29	87.44	N/A	N/A	AVG
	*	10380	29.37	17.61	46.98	68.2	-21.22	PK
Vertical		5110.6	29.79	19.44	49.23	54	-4.77	AVG
		5118.3	42.11	19.43	61.54	74	-12.46	PK
	@	5190	77.31	19.29	96.6	N/A	N/A	PK
	@	5190	67.95	19.29	87.24	N/A	N/A	AVG
	*	10380	28.93	17.61	46.54	68.2	-21.66	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

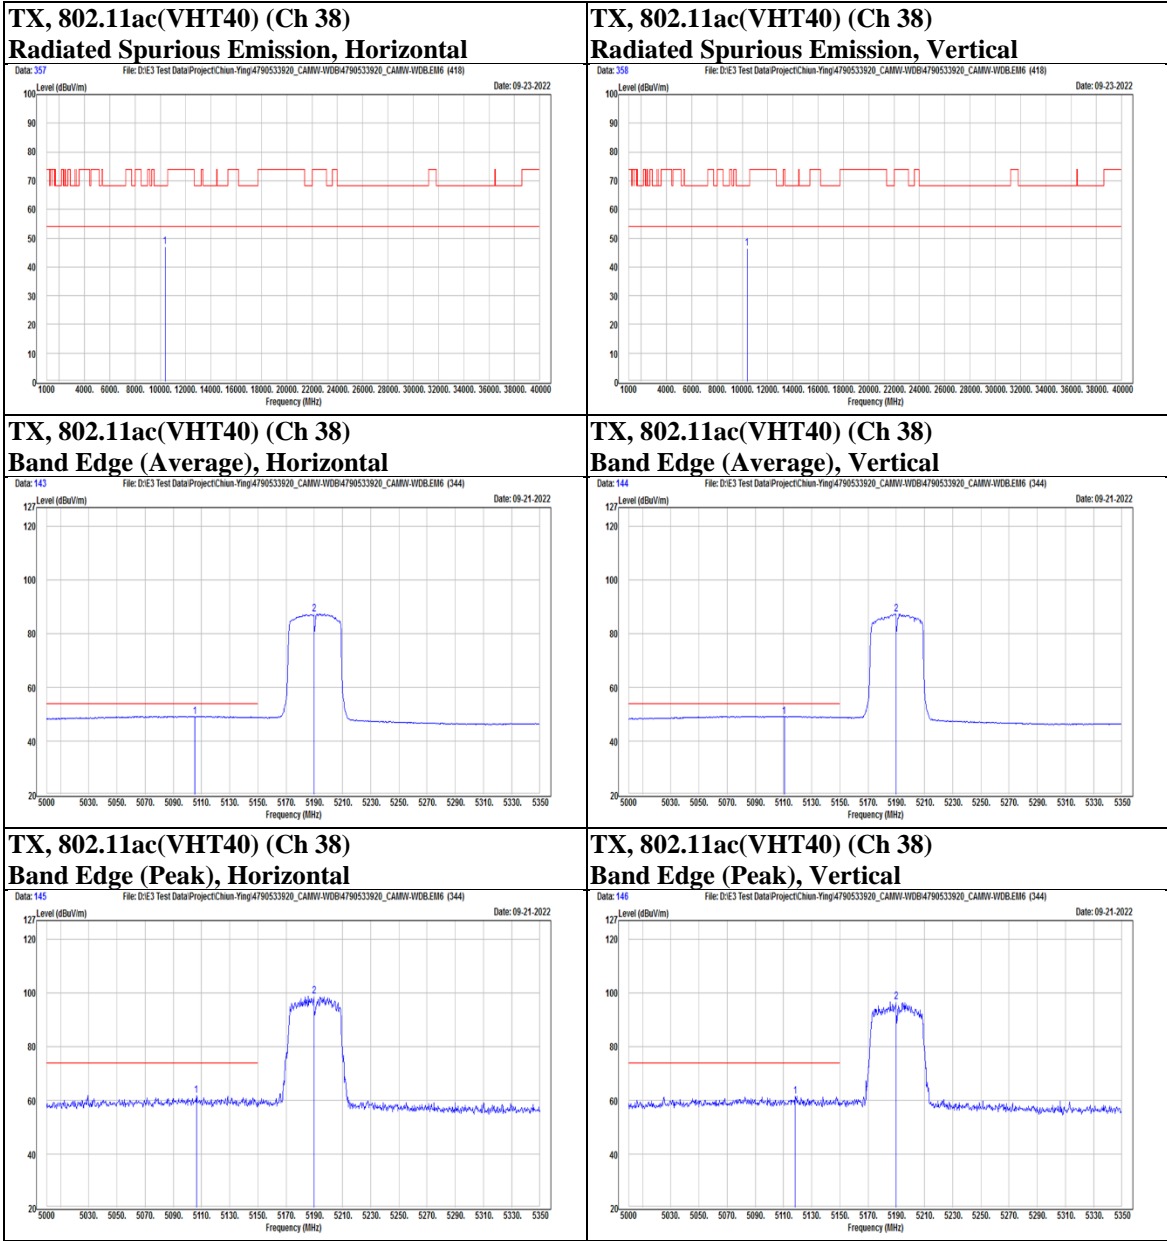

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5092.4	29.9	19.38	49.28	54	-4.72	AVG
		5142.1	42.93	19.41	62.34	74	-11.66	PK
	@	5230	86.36	19.05	105.41	N/A	N/A	PK
	@	5230	68.23	19.05	87.28	N/A	N/A	AVG
	*	10460	29.38	17.87	47.25	68.2	-20.95	PK
Vertical		5099.75	29.82	19.44	49.26	54	-4.74	AVG
		5139.65	42.75	19.41	62.16	74	-11.84	PK
	@	5230	86.58	19.05	105.63	N/A	N/A	PK
	@	5230	68.44	19.05	87.49	N/A	N/A	AVG
	*	10460	29.57	17.87	47.44	68.2	-20.76	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1

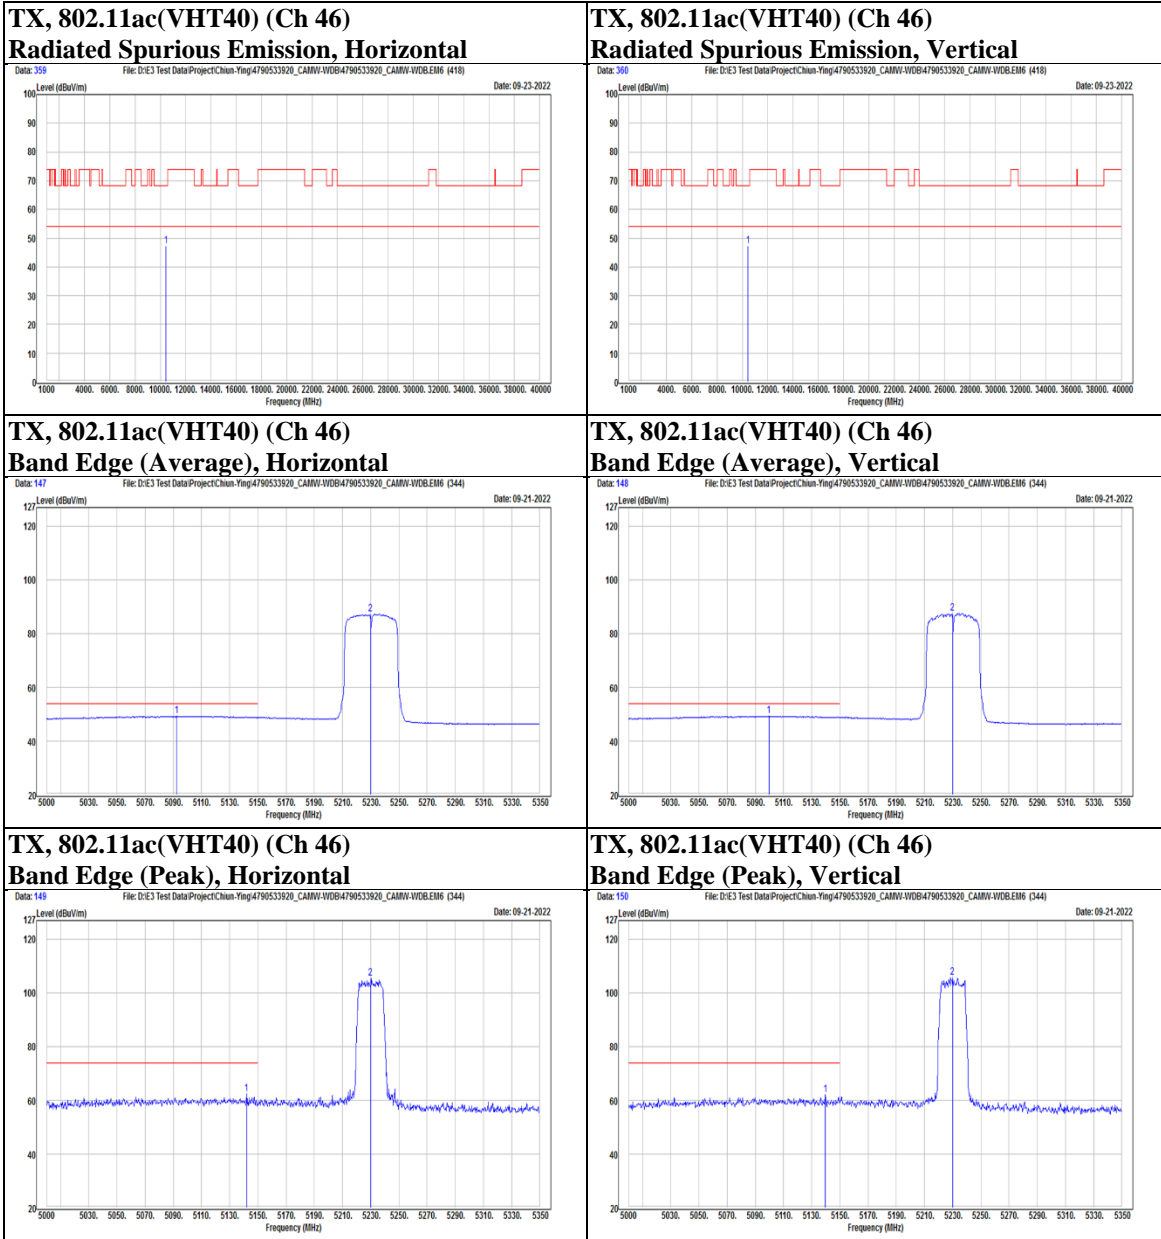

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	79.24	18.85	98.09	N/A	N/A	PK
	@	5270	68.52	18.85	87.37	N/A	N/A	AVG
		5448.3	40.14	19.5	59.64	74	-14.36	PK
		5458.8	28.68	19.57	48.25	54	-5.75	AVG
	*	10540	32.15	18.01	50.16	68.2	-18.04	PK
Vertical	@	5270	78.19	18.85	97.04	N/A	N/A	PK
	@	5270	68.62	18.85	87.47	N/A	N/A	AVG
		5424	39.92	19.39	59.31	74	-14.69	PK
		5459.4	28.75	19.57	48.32	54	-5.68	AVG
	*	10540	31.67	18.01	49.68	68.2	-18.52	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004739 (DCS:17-EM-F0878) / 6.1