## **UNISYS**

## **PCTC**

Product Compliance Test Center 2476 Swedesford Road, Malvern, PA 19355

October 15, 2001 20011020CL

Federal Communications Commission EQUIPMENT APPROVAL SERVICES P.O Box 358315 Pittsburgh, PA 15251-5315

Subject: Response to Questions/Requests for Information (Ref No. 20826/Conf No EA102031)

Dear Mr. Dichoso,

In reference to your correspondence (Reference No. 20826) on the Checkpoint Systems, PV2000 (9.5 MHz Version, FCC ID **DO4PV20009-5**, (731 Confirmation No EA102031), I have the assembled the following information and responses for your review. For clarity, I have included your text followed by my comments.

**<u>COMMENT 1</u>**: The block diagram and Schematics are unreadable please submit better versions. The block diagram and schematics appear to be for the 8.2 MHz version. Supply for this version.

**RESPONSE 1**: An updated version of the Theory of Operation, which includes the Block Diagram as its last page has been uploaded. It is labeled "NEW THEORY OF OPERATION WITH BLOCK DIAGRAM".

A cleaner copy of the schematics has been uploaded as a standalone PDF document. It is labeled "PV2000 Schematic 754427.pdf". For added clarity I have also uploaded a copy of the Checkpoint TEST AND TUNEUP PROCEDURE" for the 9.5 MHz version. With the exception of minor component changes, the schematic and PCB are common for both the 8.2 MHz and 9.5 MHz versions of the product. Component differences between the 8.2 and 9.5 MHz versions are identified on the schematic. The board is populated, tuned and setup for the appropriate application using the supplied procedure.

<u>COMMENT 2</u>: The Test Report contained the schematics. Supply a test report without confidential material.

**RESPONSE 2**: A revised report has been compiled, which has both photos and figures depicting confidential information removed. It has been uploaded and is labeled "PV2000 (9\_5 MHz Ver) FCC Report (20010808R1).pdf", where the report number – shown in parenthesis – is now amended with a suffix "1" showing the revision level of the test report.

**<u>COMMENT 3</u>**: The internal photos cannot be held confidential. Once someone purchases the device, they can make their own photos.

**RESPONSE 3**: We agree that photos of the internal construction and PCB details can be taken once a product has been purchased by an end user or by a competitor. However, it is Checkpoint's position that they would prefer the internal detail photos of the PCB, submitted to the FCC, be held as confidential and not be available through the FCC's web site, and are prepared to pay the fee associated with this request. The photos of the PCB show the internal components and the design of the antenna, which Checkpoint maintains, is proprietary. It is felt that if a competitor wishes to reverse engineer the device, they should not be given an unfair advantage by viewing information regarding the design and layout of the product freely at the FCC site.

**COMMENT 4**: Provide larger clear photos of the component side of the PCB boards.

**RESPONSE 4**: Two new photos of the PCB have been uploaded. One shows the full component side (labeled "pcb.jpg") and the second is a close-up of the of the lower end of the board showing the component placement on the PCB (labeled "pcb component detail.jpg").

**<u>COMMENT 5</u>**: Provide the Antenna correction chart for antennas used. Electric field measurements must be made.

**RESPONSE 5**: Two antennas were used during the measurement of emissions from the EUT as identified below. The chart of correction factors for the magnetic field antenna is shown below in Figure 1, and a table of the correction factors for the E-Field antenna is shown in below in Figure 2.

Frequency Range	Type of Antenna	Manufacturer	Model No.	
< 30 MHz	Active Broadband	Antenna Research	BBH-500/B	
	Magnetic Field Loop	Associates, Inc.		
	Antenna			
≥ 30 MHz	Passive Biconical-Log	Antenna Research	LPB-2520	
	Periodic Antenna	Associates, Inc.		

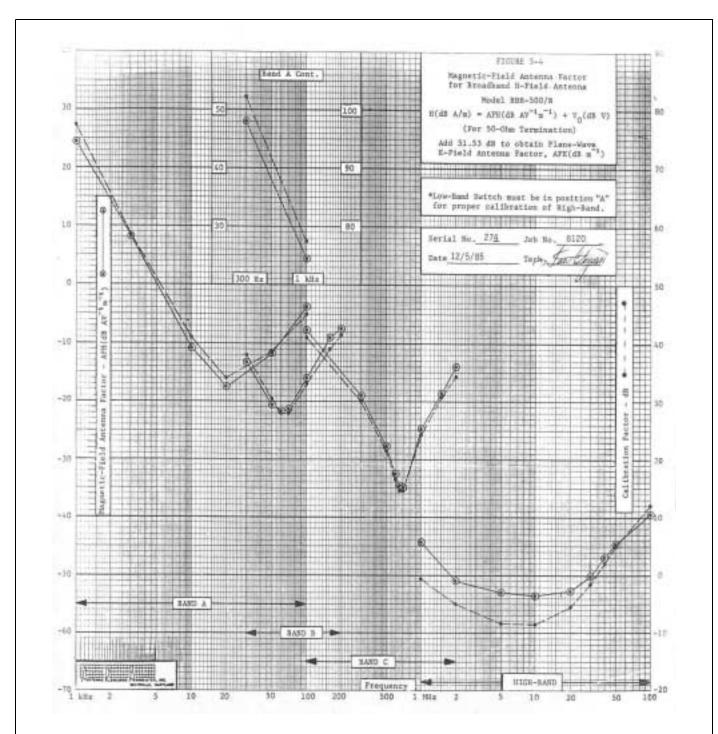


Figure 1 – Correction Factor Chart for the BBH-500/B Broadband Magnetic Field Antenna

As can be seen from the chart, at 9.5 MHz, the magnetic field correction factor is approximately -53 dB. A factor of 51.5 dB must then be added to convert the resultant H-Field measurement to an E-Field. The overall correction factor for a final E-Field measurement is then approximately -1.5 dB.



## Gain and Antenna Factors for Biconilog Antenna Manufactured by Antenna Research Model Number: LPB-2520 Serial Number: 1075 10.0 Meter Calibration Polarization: Horizontal

**METS** 

Gain and Antenna Factors for Biconilog Antenna
Manufactured by Antenna Research
Model Number: LPB-2520 Serial Number: 1075
10.0 Meter Calibration Polarization: Horizontal

Frequency (MHz)	Antenna Factor (dB)	Gain Numeric	Gain dBi	Frequency (MHz)	Antenna Factor (dB)	Gain Numeric	Gain dBi
26	16.8	0.01	-18.2	675	19.8	4.97	7.0
28 '	16.9	0.02	-17.8	700	20.0	5.18	7.1
30	17.0	0.02	-17.2	725	20.3	5.18	7.1
40	16.1	0.04	-13.8	750	20.4	5.34	7.3
50	13.7	0.11	-9.5	775	20.6	5.47	7.4
60	11.4	0.27	-5.7	800	21.1	5.20	7.2
70	9.7	0.56	-2.6	825	21.7	4.83	6.8
80	8.7	0.90	-0.4	850	21.9	4.91	6.9
90	8.8	1.12	0.5	875	22.0	5.07	7.1
100	9.6	1.15	0.6	900	22.4	4.86	6.9
110	10.4	1.15	0.6	925	22.9	4.65	6.7
120	10.6	1.30	1.1	950	22.9	4.90	6.9
130	10.3	1.64	2.1	975	22.8	5.28	7.2
140	9.7	2.21	3.4	1000	23.0 🕾	5.23	7.2
150	9.7	2.96	4.7	1050	23.4	5.26	7.2
160	8.9	3.47	5.4	1100	23.5	5.62	7.5
170	9.1	3.69	5.7	1150	23.8	5.81	7.6
180	9.6	3.74	5.7	1200	24.4	5.53	7.4
190	10.0	3.77	5.8	1250	24.3	6.05	7.8
200	10.3	3.87	5.9	1300	24.8	5.87	7.7
225	11.9	3.46	5.4	1350	25.3	5.60	7.5
250	13.0	3.26	5.1	1400	24.8	6.83	8.3
275	13.5	3.55	5.5	1450	25.0	6.94	8.4
300	13.7	4.00	6.0	1500	26.1	5.85	7.7
325	14.4	4.07	6.1	1550	25.9	6.43	8.1
350	14.8	4.26	6.3	1600	26.0	6.74	8.3
375	15.1	4.51	6.5	1650	26.5	6.42	8.1
400	15.5	4.68	6.7	1700	26.8	6.39	8.1
425	16.2	4.52	6.6	1750	27.3	6.01	7.8
450	16.7	4.59	6.6	1800	27.6	5.93	7.7
475	17.1	4.59	6.6	1850	27.8	5.93	7.7
500	17.4	4.78	6.8	1900	28.3	5.56	7.5
525	18.0	4.60	6.6	1950	28.9	5.15	7.1
550	18.2	4.84	6.9	2000	29.0	5.26	7.2
575	18.6	4.81	6.8				
600	18.8	5.00	7.0				
625	18.9	5.24	7.2				
	19.6	4.87	7.2 6.9				


Specification compliance testing factor (10.0 meter spacing) to be added to receiver meter reading in dBV to convert to field intensity in dBV/meter. Calibrated 15 Jun 99 (DD/MM/YYYY). Calibration per ANSI 063.5.

Specification compliance testing factor (10.0 meter spacing) to be added to receiver meter reading in dBV to convert to field intensity in dBV/meter. Calibrated 15 Jun 99 (DD/MM/YYYY). Calibration per ANSI C63.5.

Figures 2 & 3 – Tabulated Antenna Factors for the LPB-2520 BB BiLog E-Field Antenna

**COMMENT 6**: Provide a bandwidth plot of the device.

**RESPONSE 6**: A bandwidth plot was recorded using an HP 8566B spectrum analyzer and a small magnetic field loop field probe placed in close proximity to the device. It is attached below and has also been added to the revised test report referenced above. The red trace shows the envelope of the bandwidth and the blue trace shows the active sweep captured during operation of the device.

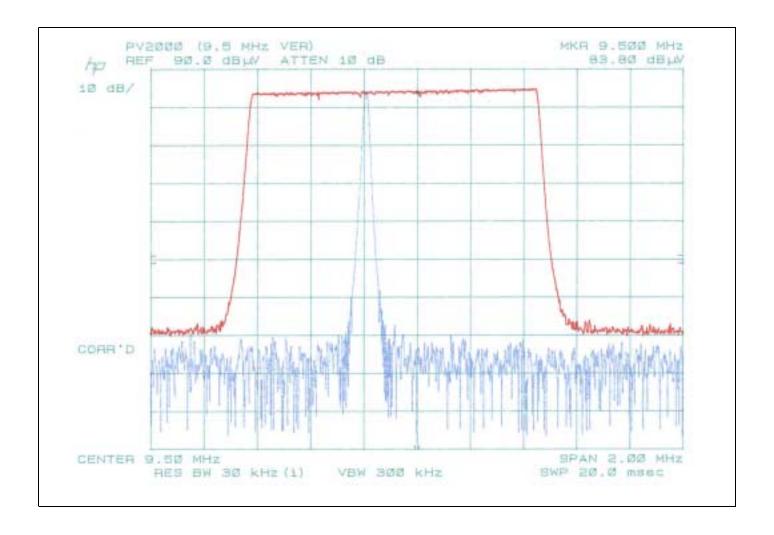

I hope these responses satisfy your questions. If more information is required, please contact either Gregory Sleet (gsleet@checkpt.com) at Checkpoint Systems, Inc., or myself (daniel.mis@unisys.com).

Sincerely,

Daniel J. Mis

Technical Staff Engineer Unisys Corporation

Daniel J. Mis

(610) 648-3746

E-Mail: daniel.mis@unisys.com