

Report No.: HA860727B



HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : HD5-CN80L1N

Brand Name : Honeywell Model Name : CN80L1N

Marketing Name : Dolphin CN80

T-Rating : T3

Applicant : Honeywell International Inc.

9680 Old Bailes Road, Fort Mill, SC 29707 USA

Manufacturer : Honeywell International Inc.

9680 Old Bailes Road, Fort Mill, SC 29707 USA

Standard : FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received on Jun. 08, 2018 and testing was started from Jun. 20, 2018 and completed on Jun. 20, 2018. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The report must not be used by the client to claim product certification, approval, or endorsement by TAF or any agency of government.

The test results in this variant report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai / Manager

SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

Table of Contents

1.	Attestation of Test Results	4
2.	General Information	5
	Testing Location	
4.	Applied Standards	6
	Air Interface and Operating Mode	
6.	Measurement standards for T-Coil	8
	6.1 Frequency Response	8
	6.2 T-Coil Signal Quality Categories	8
7.	T-Coil Test Procedure	9
	7.1 Test Flow Chart	10
	7.2 Test Setup Diagram	11
	7.3 Description of EUT Test Position	13
8.	Test Equipment List	14
	T-Coil testing for OTT VoIP Calling	
10.	Uncertainty Assessment	21
	References	

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Form version: 180516 Page: 2 of 22 Issued Date: Jun. 27, 2018

Report No.: HA860727B

History of this test report

Report No.: HA860727B

Report No.	Version	Description	Issued Date
HA860727B	Rev. 01	Initial issue of report	Jun. 27, 2018

TEL: 886-3-327-3456 Page: 3 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency Response	Magnetic Intensity
OTT	EDGE850	T3	Pass	Pass
OTT over EDGE	EDGE1900	T3	Pass	Pass
	Band 2	T4	Pass	Pass
OTT over UMTS	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	BC0	T4	Pass	Pass
OTT over CDMA	BC1	T4	Pass	Pass
	BC10	T4	Pass	Pass
	Band 2	T4	Pass	Pass
	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 7	T4	Pass	Pass
	Band 12	T4	Pass	Pass
OTT over LTE	Band 13	T4	Pass	Pass
	Band 17	T4	Pass	Pass
	Band 25	T4	Pass	Pass
	Band 26	T4	Pass	Pass
	Band 38	T4	Pass	Pass
	Band 41	T4	Pass	Pass
	2450	T4	Pass	Pass
	5200	T4	Pass	Pass
OTT over WiFi	5300	T4	Pass	Pass
	5500	T4	Pass	Pass
	5800	T4	Pass	Pass
Date Tested		2018/	/06/20	

Report No.: HA860727B

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

TEL: 886-3-327-3456 Page: 4 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

2. General Information

Product Feature & Specification						
Applicant Name	Honeywell International Inc.					
Brand Name	Honeywell					
Model Name	CN80L1N					
Marketing Name	Dolphin CN80					
FCC ID	HD5-CN80L1N					
S/N	18081D83E7					
HW Version	Rev 1.1					
HW P/N	DVT1					
SW Version	OS.01.009-HON.01.006					
SW P/N	540D					
EUT Stage	Engineering sample					
Date Tested	2018/06/20					
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz CDMA2000 BC0: 824.7 MHz ~ 848.31 MHz CDMA 2000 BC1: 1851.25 MHz ~ 1908.75 MHz CDMA 2000 BC1: 1871.9 MHz ~ 823.1 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 4: 1710.7 MHz ~ 848.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 784.5 MHz LTE Band 25: 1850.7 MHz ~ 713.5 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 27: 06.5 MHz ~ 713.5 MHz LTE Band 27: 070.5 MHz ~ 713.5 MHz LTE Band 28: 1850.7 MHz ~ 1914.3 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 38: 2572.5 MHz ~ 2617.5 MHz LTE Band 41: 2498.5 MHz ~ 2687.5 MHz WLAN 2.4GHz Band: 2412 MHz ~ 2462 MHz WLAN 5.3GHz Band: 5180 MHz ~ 5320 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5700 MHz WLAN 5.6GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz					
Mode	GSM/GPRS/EGPRS RMC/AMR 12.2Kbps HSDPA HSUPA DC-HSDPA CDMA2000: 1xRTT/1xEv-Do(Rev.0)/1xEv-Do(Rev.A) LTE: QPSK, 16QAM, 64QAM 802.11a/b/g/n/ac Bluetooth BR/EDR/LE NFC:ASK					

Report No.: HA860727B

Reviewed by: <u>Eric Huang</u> Report Producer: <u>Wan Liu</u>

TEL: 886-3-327-3456 Page: 5 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

3. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Report No.: HA860727B

Testing Laboratory				
Test Site SPORTON INTERNATIONAL INC.				
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978			
Test Site No.	Sporton Site No.: SAR04-HY			

4. Applied Standards

- FCC CFR47 Part 20.19
- · ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

TEL: 886-3-327-3456 Page: 6 of 22
FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction
2011	EDGE850	1/15		WLAN, BT	Google Duo ⁽¹⁾	No
GSM	EDGE1900	VD	Yes	WLAN, BT	Transmitter WLAN, BT Google Duo ⁽¹⁾ SIP calling ^(1,2) SM,WCDMA,CDMA,LTE Google Duo ⁽¹⁾ SIP calling ^(1,2)	No
	B5 HSPA			WLAN, BT		
UMTS	B4 HSPA	VD	Yes	WLAN, BT	_ /	No
	B2 HSPA			WLAN, BT	SIP calling ^(1,2)	No
	BC0 EvDO			WLAN, BT	Google Duo ⁽¹⁾	No
CDMA	BC1 EvDO	VD	Yes	WLAN, BT	/	No
	BC10 EvDO			WLAN, BT	SIP calling ^(1,2)	No
	Band 2			WLAN, BT		No
	Band 4			WLAN, BT		No
	Band 5			WLAN, BT		No
	Band 7		Yes	WLAN, BT	Google Duo ⁽¹⁾	No
LTE (FDD)	Band 12	VD		WLAN, BT	/	No
(/	Band 13			WLAN, BT	SIP calling(1,2)	No
	Band 17			WLAN, BT	/	No
	Band 25			WLAN, BT		(1,2) No O(1) No No No No No No No No No No
	Band 26			WLAN, BT		No
LTE	Band 38	VD	Vaa	WLAN, BT	Google Duo ⁽¹⁾	No
(TDD)	Band 41	VD	Yes	WLAN, BT	SIP calling ^(1,2)	No
	2450					No
	5200				Google Duo ⁽¹⁾	No
Wi-Fi	5300 VD	Yes	GSM,WCDMA,CDMA,LTE	/	No	
	5500				SIP calling ^(1,2)	No
	5800					No
ВТ	2450	DT	No	GSM,WCDMA,CDMA,LTE	NA	No

Report No.: HA860727B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

Remark:

- For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of -20 dBm0 should be used.
- The SIP calling is android internal auxiliary functions under the dialing program.

 The device have similar frequency in some LTE bands: LTE B2/B25, B5/B26, B12/B17 and B38/B41 since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.


TEL: 886-3-327-3456 Page: 7 of 22 FAX: 886-3-328-4978 Issued Date : Jun. 27, 2018

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA860727B

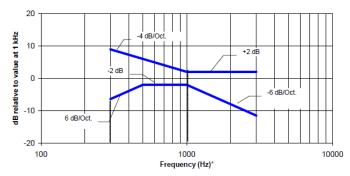

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

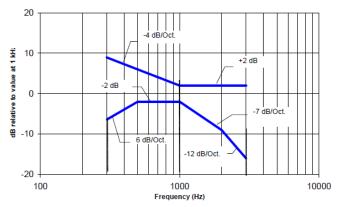

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

TEL: 886-3-327-3456 Page: 8 of 22
FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA860727B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 9 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

7.1 Test Flow Chart


Test Instructions Confirm calibration of test eq uip ment Configure and validate the test setup Establish WD reference level Find measurement locations Per sub clause 7.3, 7.4.1 a)-b) & 7.4.4.4 Position and orient probe Measure desired aud io band signal strength Per sub clause 7.4.1 c)-e) Calculate signal strength Calculate signal quality Measure frequency resposne (perpendicular orientation only) Per sub clause 7.4.5 - 7.4.6 All locations measured? All locations measured? Determine and record signal quality category Done Per sub clause 8.2.4

Report No. : HA860727B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 10 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

7.2 Test Setup Diagram

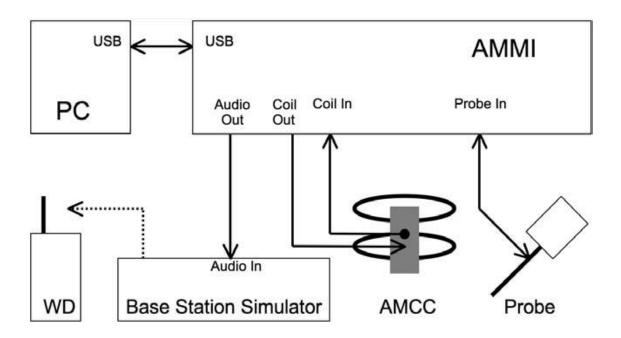

Report No.: HA860727B

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - OTT VoIP input Level: -20dBm0
- 2. The test setup used for Google DUO VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.
- 3. The test setup used for SIP VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and can be determined the audio input level of -20dBm0.

TEL: 886-3-327-3456 Page: 11 of 22
FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA860727B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Calculation formula:

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

- Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.47	3.14
10	20	-19.85	-14.24
8.17	18.24	-21.61	-16

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

TEL: 886-3-327-3456 Page: 12 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA860727B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- ◆ The measurement plane is parallel to, and 10 mm in front of, the reference plane.

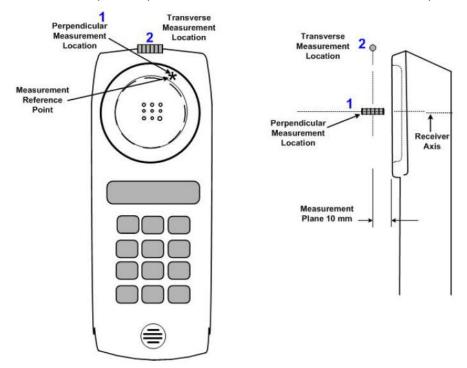


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 13 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

8. Test Equipment List

Manufacturer	Name of Equipment	Tyroc/Model	Serial Number	Calib	ration
Manufacturer	Name of Equipment	Type/Model	Serial Number	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018
SPEAG	Data Acquisition Electronics	DAE4	853	Jul. 19, 2017	Jul. 18, 2018
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
TESTO	Hygro meter	608-H1	34913631	Aug. 22, 2017	Aug. 21, 2018
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	SPEAG Phone Positioner		N/A	NCR	NCR
R&S	Base Station	CMW500	149637	Jul. 26, 2017	Jul. 25, 2018

Report No.: HA860727B

Note:

TEL: 886-3-327-3456 Page: 14 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

^{1.} NCR: "No-Calibration Required"

9. T-Coil testing for OTT VoIP Calling

General Notes:

 The google Duo and SIP calling VoIP application are pre-installed on this device. According to KDB 285076 D02, all air interfaces via a data connection with VOIP application need to be considered HAC testing.

Report No.: HA860727B

- 2. The Google Duo only support OPUS audio codec and support 6Kbpa to 75Kbps bitrate.
- 3. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 4. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band.
- 5. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

EDGE

ОТТ	Google Duo			OTT Google Duo						SIP Calling			
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 8 kHz	GSM -EFR	AMR 8 kHz	G.711 A-law	G.711 u-law	Orientation	Band / Channel			
ABM 1 (dBA/m)	-0.62	-0.57	-1.65	-2.98	-1.14	-1.17	-1.19	-1.16					
ABM 2 (dBA/m)	-34.5	-34.44	-33.91	-38.59	-35.23	-35.13	-35.15	-35.29	Axial	GSM850 /			
Signal Quality (dB)	33.88	33.87	32.26	35.61	34.09	33.96	33.96	34.13		189			
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS					

Remark: According to codec investigation, the worst codec is Bitrate 75Kbps.

TEL: 886-3-327-3456 Page: 15 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

SPORTON LAB. HAC T-COIL TEST REPORT

HSPA

ОТТ		Google Duc					SIP Calling			
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 8 kHz	GSM -EFR	AMR 8 kHz	G.711 A-law	G.711 u-law	Orientation	Band / Channel
ABM 1 (dBA/m)	-2	0.43	-2.06	-1.63	-0.5	-0.21	0.08	-0.36		
ABM 2 (dBA/m)	-45.52	-41.77	-43.14	-47.42	-47.55	-48.13	-47.1	-46.83	Audal	UMTS B2/
Signal Quality (dB)	43.52	42.2	41.08	45.79	47.05	47.92	47.18	46.47	- Axial	9400
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS		

Report No.: HA860727B

Remark: According to codec investigation, the worst codec is Bitrate 75Kbps.

CDMA

OTT		Google Duc	•	SIP Calling								
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 8 kHz	GSM -EFR	AMR 8 kHz	G.711 A-law	G.711 u-law	Orientation	Band / Channel		
ABM 1 (dBA/m)	-0.51	0.36	-1.52	-0.9	0.71	0.54	0.49	0.49				
ABM 2 (dBA/m)	-44.84	-41.98	-42.37	-46.38	-45.38	-46.77	-45.71	-45.46		CDMA		
Signal Quality (dB)	44.33	42.34	40.85	45.48	46.09	47.31	46.2	45.95	Axial	BC0 / 384		
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS				

Remark: According to codec investigation, the worst codec is Bitrate 75Kbps.

LTE FDD

OTT		Google Duc)	SIP Calling								
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 8 kHz	GSM -EFR	AMR 8 kHz	G.711 A-law	G.711 u-law	Orientation	Band / BW / Channel		
ABM 1 (dBA/m)	0.59	1.15	-3.31	-1.72	-1.91	-1.69	-1.72	-1.86				
ABM 2 (dBA/m)	-45.2	-43.29	-43.44	-45.86	-46.95	-46.88	-46.9	-46.87	Accel	LTE Band		
Signal Quality (dB)	45.79	44.44	40.13	44.14	45.04	45.19	45.18	45.01	Axial	25 / 20M / 26340		
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS				

Remark: According to codec investigation, the worst codec is Bitrate 75Kbps.

TEL: 886-3-327-3456 Page: 16 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

LTE TDD

OTT		Google Duc	,	SIP Calling								
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 8 kHz	GSM -EFR	AMR 8 kHz	G.711 A-law	G.711 u-law	Orientation	Band / BW / Channel		
ABM 1 (dBA/m)	-2.67	-2.46	-3.34	-2.36	-2.58	-2.53	-2.23	-2.48				
ABM 2 (dBA/m)	-40.23	-40.42	-40.18	-41.18	-41.26	-41.21	-41.11	-41.29	Actal	LTE Band		
Signal Quality (dB)	37.56	37.96	36.84	38.82	38.68	38.68	38.88	38.81	Axial	41/ 20M / 40620		
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS				

Report No.: HA860727B

Remark: According to codec investigation, the worst codec is Bitrate 75Kbps.

WLAN

OTT		Google Duc		SIP Calling								
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 8 kHz	GSM -EFR	AMR 8 kHz	G.711 A-law	G.711 u-law	Orientation	Band / Channel		
ABM 1 (dBA/m)	-1.37	-1.18	-2.29	-1.71	-0.96	-0.96	-1.13	-1.29				
ABM 2 (dBA/m)	-42.49	-42.37	-42.6	-45.95	-46.43	-46.38	-46.48	-46.69		WLAN2.4G		
Signal Quality (dB)	41.12	41.19	40.31	44.24	45.47	45.42	45.35	45.4	Axial	/6		
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS				

Remark: According to codec investigation, the worst codec is Bitrate 75Kbps.

TEL: 886-3-327-3456 Page: 17 of 22
FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

SPORTON LAB. HAC T-COIL TEST REPORT

<Air Interface Investigation>

Aiı	r Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B25	20	QPSK	1	0	26340	-3.64	-44.17	40.53
	LTE B25	20	QPSK	50	0	26340	-2.05	-43.45	41.40
	LTE B25	20	QPSK	100	0	26340	-1.29	-42.56	41.27
	LTE B25	20	16QAM	1	0	26340	-2.57	-43.43	40.86
FDD	LTE B25	20	64QAM	1	0	26340	-2.75	-43.53	40.78
FDD	LTE B25	15	QPSK	1	0	26340	-2.17	-43.67	41.50
	LTE B25	10	QPSK	1	0	26340	-2.46	-43.79	41.33
	LTE B25	5	QPSK	1	0	26340	-2.08	-43.45	41.37
	LTE B25	3	QPSK	1	0	26340	-2.12	-43.59	41.47
	LTE B25	1.4	QPSK	1	0	26340	-1.74	-43.23	41.49
	LTE B41	20	QPSK	1	0	40620	-4.51	-40.16	35.65
	LTE B41	20	QPSK	50	0	40620	-3.73	-40.38	36.65
	LTE B41	20	QPSK	100	0	40620	-2.39	-38.95	36.56
TDD	LTE B41	20	16QAM	1	0	40620	-2.74	-39.16	36.42
טטו	LTE B41	20	64QAM	1	0	40620	-2.95	-39.50	36.55
	LTE B41	15	QPSK	1	0	40620	-3.05	-39.17	36.12
	LTE B41	10	QPSK	1	0	40620	-3.17	-39.74	36.57
	LTE B41	5	QPSK	1	0	40620	-3.18	-39.81	36.63

Report No.: HA860727B

Remark:

Select LTE FDD/LTE TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration , the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.

Air	Interface	BW (MHz)	Modulation / Mode	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	802.11b	20	1M	6	-3.13	-43.56	40.43
	802.11b	20	11M	6	-1.81	-42.44	40.63
NA/I ANI O 4011-	802.11g	20	6M	6	-0.53	-41.38	40.85
WLAN 2.4GHz	802.11g	20	54M	6	-0.91	-42.28	41.37
	802.11n-HT20	20	MCS0	6	-1.18	-42.60	41.42
	802.11n-HT20	20	MCS7	6	-1.45	-42.27	40.82
	802.11a	20	6M	40	-1.42	-42.52	41.10
	802.11a	20	54M	40	-1.26	-42.74	41.48
	802.11an-HT20	20	MCS0	40	-0.99	-42.90	41.91
	802.11an-HT20	20	MCS7	40	-1.12	-42.78	41.66
	802.11an-HT40	40	MCS0	38	-1.23	-42.74	41.51
\\\\\\ \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	802.11an-HT40	40	MCS7	38	-1.27	-42.49	41.22
WLAN 5GHz	802.11ac-VHT20	20	MCS0	40	-1.35	-42.50	41.15
	802.11ac-VHT20	20	MCS8	40	-1.18	-42.70	41.52
	802.11ac-VHT40	40	MCS0	38	-1.45	-42.72	41.27
	802.11ac-VHT40	40	MCS8	38	-1.49	-42.91	41.42
	802.11ac-VHT80	80	MCS0	50	-1.49	-42.71	41.22
Domorke	802.11ac-VHT80	80	MCS8	50	-1.52	-42.72	41.20

Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.

TEL: 886-3-327-3456 Page: 18 of 22 FAX: 886-3-328-4978 Issued Date : Jun. 27, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

Report No. : HA860727B

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response
1	GSM850	EDGE 2 Tx slots	189	_	Axial (Z)	-1.65	-33.91	32.26	T4	-50.23	1.72	Pass
	00101000	EDGE 2 1X SIOLS	109	_	Transversal (Y)		-39.69	28.27	T3	-50.29	1.72	1 033
2	GSM1900	EDGE 2 Tx slots	661	_	Axial (Z)	-1.55	-36.13	34.58	T4	-50.29	2	Pass
	O3W1300	EDGE 2 1X SIOLS	001	_	Transversal (Y)	-11.75	-40.88	29.13	T3	-50.31		1 033
3	WCDMA II	HSPA	9400	_	Axial (Z)	-2.06	-43.14	41.08	T4	-50.31	1.73	Pass
3	WODIVIA II	HOFA	9400	-	Transversal (Y)	-11.17	-45.55	34.38	T4	-50.25	1.73	rass
4	WCDMA IV	HSPA	1413	_	Axial (Z)	-2.00	-43.09	41.09	T4	-50.23	1.73	Pass
4	VVCDIVIA IV	HOFA	1413	-	Transversal (Y)	-11.07	-45.75	34.68	T4	-50.28	1.73	Fass
5	WCDMA V	HSPA	4182		Axial (Z)	-2.46	-42.38	39.92	T4	-50.29	1.87	Pass
5	WCDIVIA V	пора	4102	-	Transversal (Y)	-10.92	-44.98	34.06	T4	-50.22	1.07	Pass
6	CDMA BC0	RTAP	384		Axial (Z)	-1.52	-42.37	40.85	T4	-50.28	0.0	Door
6	CDMA BC0	153.6Kbps	384	-	Transversal (Y)	-10.23	-47.16	36.93	T4	-50.25	0.9	Pass
7	CDMA DC4	RTAP	600		Axial (Z)	-1.91	-42.90	40.99	T4	-50.31	4.00	Dana
7	CDMA BC1	153.6Kbps	600	-	Transversal (Y)	-10.87	-45.57	34.70	T4	-50.26	1.63	Pass
	CDMA DC40	RTAP	500		Axial (Z)	-2.37	-43.54	41.17	T4	-50.31	4.04	Dana
8	CDMA BC10	153.6Kbps	580	-	Transversal (Y)	-10.56	-45.07	34.51	T4	-50.27	1.64	Pass
	LTE David 4	0014 00014 4 0	00475		Axial (Z)	-3.04	-43.86	40.82	T4	-50.29	4.0	D
9	LTE Band 4	20M_QPSK_1_0	20175	-	Transversal (Y)	-10.88	-46.46	35.58	T4	-50.25	1.8	Pass
40	LTE David 7	0014 00014 4 0	04400		Axial (Z)	-2.57	-43.46	40.89	T4	-50.34	4.04	D
10	LTE Band 7	20M_QPSK_1_0	21100	-	Transversal (Y)	-10.75	-47.04	36.29	T4	-50.22	1.81	Pass
4.4	LTE David 40	4014 ODOK 4 0	00005		Axial (Z)	-3.19	-44.03	40.84	T4	-50.33	4.70	D
11	LIE Band 12	10M_QPSK_1_0	23095	-	Transversal (Y)	-10.38	-46.34	35.96	T4	-50.21	1.79	Pass
40	LTE David 40	4014 ODOK 4 0	00000		Axial (Z)	-2.69	-43.86	41.17	T4	-50.35	4.55	D
12	LIE Band 13	10M_QPSK_1_0	23230	-	Transversal (Y)	-10.49	-46.49	36.00	T4	-50.22	1.55	Pass
40	1.TE D 1.05	0014 0001/ 4 0	00040		Axial (Z)	-3.31	-43.44	40.13	T4	-50.29	4.04	
13	LIE Band 25	20M_QPSK_1_0	26340	-	Transversal (Y)	-10.61	-46.10	35.49	T4	-50.26	1.94	Pass
4.4	LTE D	45M ODOK 4 0	00005		Axial (Z)	-2.32	-43.45	41.13	T4	-50.35	4.0	Desir
14	LIE Band 26	15M_QPSK_1_0	26865	-	Transversal (Y)	-9.92	-46.22	36.30	T4	-50.18	1.6	Pass
4-	LTED 141	0014 00014 4 5	40000		Axial (Z)	-3.34	-40.18	36.84	T4	-50.31	4 77	D-
15	LIE Band 41	20M_QPSK_1_0	40620	-	Transversal (Y)	-10.97	-45.44	34.47	T4	-50.18	1.77	Pass

TEL: 886-3-327-3456 Page: 19 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)		Frequency Response					
16	W/I AND 4CH-	802.11b 1Mbps	6	Ant 0	Axial (Z)	-2.29	-42.60	40.31	T4	-50.34	1.64	Pass					
10	WLAN2.4GHZ	602.11b Tivibps	O	Ant 0	Transversal (Y)	-11.11	-46.59	35.48	T4	-50.27	1.04	Pass					
17	WLAN5GHz	802.11a 6Mbps	40	Ant 0	Axial (Z)	-2.61	-44.07	41.46	T4	-50.33	1.66	Pass					
- 7	WLANSGIIZ	602.11a divibps	40	Anto	Transversal (Y)	-9.83	-46.81	36.98	T4	-50.18	1.00	газэ					
18	WLAN5GHz	802.11a 6Mbps	60	Ant 0	Axial (Z)	-2.77	-44.47	41.70	T4	-50.33	1.64	Pass					
10	WLANSGHZ	602.11a 61VIDPS	60	Anto	Transversal (Y)	-10.03	-47.21	37.18	T4	-50.26	1.04	F d 5 5					
19	MI ANECLI-	WLAN5GHz 802.11a 6Mbps	202 11a 6Mbaa	000 44 - 014	000 44 a CMb a a	902 112 6Mbps	902 11a 6Mbpa	124	Ant 0	Axial (Z)	-6.61	-47.92	41.31	T4	-50.31	1.68	Door
19	WLANSGHZ	602. I Ta bivibps	124	Ant 0	Transversal (Y)	-10.27	-47.32	37.05	T4	-50.25	1.00	Pass					
20	WLAN5GHz	902 11a 6Mbaa	157	Ant 0	Axial (Z)	-2.27	-43.89	41.62	T4	-50.34	1.56	Door					
20	WLANSGHZ	802.11a 6Mbps	157	Ant 0	Transversal (Y)	-10.30	-47.40	37.10	T4	-50.20	1.30	Pass					
21	\\\\\ A N \\\\\\\\\\\\\\\\\\\\\\\\\\\\\	000 445 4145	6	Ant 1	Axial (Z)	-3.10	-42.70	39.60	T4	-50.29	1.58	Pass					
21	WLAN2.4GHZ	802.11b 1Mbps	0	Anti	Transversal (Y)	-11.13	-46.23	35.10	T4	-50.18	1.36	Pass					
00	MALANIE CLI-	000 44 - CMb	40	A 4 4	Axial (Z)	-2.49	-44.06	41.57	T4	-50.30	1.7	Dana					
22	WLAN5GHz	802.11a 6Mbps	40	Ant 1	Transversal (Y)	-10.13	-47.18	37.05	T4	-50.16	1.7	Pass					
23	WLAN5GHz	902 11a 6Mbna	60	Ant 1	Axial (Z)	-2.91	-44.96	42.05	T4	-50.28	1.55	Pass					
23	WLANSGHZ	802.11a 6Mbps	60	Anti	Transversal (Y)	-10.01	-47.01	37.00	T4	-50.19	1.55	Pass					
0.4	MALANIE CLI-	000 44 - CMb	404	A 4 4	Axial (Z)	-2.46	-43.79	41.33	T4	-50.34	4 44	Dana					
24	WLAN5GHz	802.11a 6Mbps	124	Ant 1	Transversal (Y)	-10.19	-47.59	37.40	T4	-50.16	1.44	Pass					
25	MI ANEQUE	000 44 - CME	457	A 4 d	Axial (Z)	-2.76	-44.68	41.92	T4	-50.33	0.33	Pass					
25	WLAN5GHz	802.11a 6Mbps	157	Ant 1	Transversal (Y)	-10.08	-47.40	37.32	T4	-50.29	1.62						

Report No.: HA860727B

Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- 2. The detail frequency response results please refer to appendix A.
- 3. Test Engineer: Tom Jiang Steven Chang and Galen Chang

TEL: 886-3-327-3456 Page: 20 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

10. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA860727B

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)			
		Probe Ser	sitivity							
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %			
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %			
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %			
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %			
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %			
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %			
Probe System										
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %			
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %			
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %			
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %			
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %			
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %			
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %			
		Test Siç	gnal							
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %			
		Position	ning							
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %			
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %			
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %			
		External Con	tributions							
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %			
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %			
	Combined Star	ndard Uncertainty				± 4.1 %	± 6.1 %			
	Coverage F	actor for 95 %				K	= 2			
	Expanded	Uncertainty				± 8.1 %	± 12.3 %			

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 21 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018

11. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA860727B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 22 of 22 FAX: 886-3-328-4978 Issued Date: Jun. 27, 2018