# **FCC RF Test Report**

APPLICANT : Honeywell International Inc.

**Honeywell Safety and Productivity Solutions** 

Report No.: FR072404A

**EQUIPMENT**: Mobile Computer

BRAND NAME : Honeywell MODEL NAME : CT40P-L1N

FCC ID : HD5-CT40PL1N

STANDARD : FCC Part 15 Subpart C § 15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

This is a data re-used report which is only valid together with the original test report. We, Sporton International (Kunshan) Inc., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International (Kunshan) Inc., the test report shall not be reproduced except in full.

Reviewed by: Jason Jia / Supervisor

JasonJia

Approved by: James Huang / Manager

## Sporton International (Kunshan) Inc.

No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300 People's Republic of China

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 1 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Cert #5145.02

## **TABLE OF CONTENTS**

RE	EVISION HISTORY3					
SU	MMA	RY OF TEST RESULT	4			
1	GEN	IERAL DESCRIPTION	5			
	1.1	Applicant	5			
	1.2	Manufacturer	5			
	1.3	Product Feature of Equipment Under Test	5			
	1.4	Product Specification of Equipment Under Test	5			
	1.5	Modification of EUT	6			
	1.6	Testing Location	6			
	1.7	Test Software	6			
	1.8	Applicable Standards	6			
	1.9	Re-use of Measured Data	7			
2	TES	T CONFIGURATION OF EQUIPMENT UNDER TEST	8			
	2.1	Carrier Frequency Channel	8			
	2.2	Test Mode	9			
	2.3	Connection Diagram of Test System	10			
3	TES	T RESULT	11			
	3.1	Radiated Band Edges and Spurious Emission Measurement	11			
	3.2	Antenna Requirements				
4	LIST	OF MEASURING EQUIPMENT	16			
5	UNC	ERTAINTY OF EVALUATION	17			
ΑP	PEND	DIX A. RADIATED SPURIOUS EMISSION				
ΑP	PEND	DIX B. DUTY CYCLE PLOTS				
ΑP	PEND	DIX C. SETUP PHOTOGRAPHS				
ΑP	PEND	DIX D. REFERENCE REPORT				

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 2 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No. : FR072404A

## **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR072404A	Rev. 01	Initial issue of report	Sep. 02, 2020

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 3 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No. : FR072404A

### SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result	Remark
		Radiated Band Edges			Under limit
3.1	15.247(d)	and Radiated Spurious	15.209(a) & 15.247(d)	Pass	13.67 dB at
		Emission			66.860 MHz
3.2	15.203 &	N1/A	D		
3.2	15.247(b)	Antenna Requirement	N/A	Pass	-

Remark: Not required means after assessing, test items are not necessary to carry out.

#### Declaration of Conformity:

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

#### **Comments and Explanations:**

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 4 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

## 1 General Description

## 1.1 Applicant

Honeywell International Inc.

**Honeywell Safety and Productivity Solutions** 

9680 Old Bailes Rd. Fort Mill, SC 29707 United States

### 1.2 Manufacturer

Honeywell International Inc.

**Honeywell Safety and Productivity Solutions** 

9680 Old Bailes Rd. Fort Mill, SC 29707 United States

## 1.3 Product Feature of Equipment Under Test

Product Feature						
Equipment	Mobile Computer					
Brand Name	Honeywell					
Model Name	CT40P-L1N					
FCC ID	HD5-CT40PL1N					
EUT supports Radios application	CDMA/GSM/WCDMA/LTE/NFC/GNSS WLAN 2.4GHz 802.11b/g/n (HT20/HT40) WLAN 5GHz 802.11a/n/ac (HT20/HT40/VHT20/VHT40/VHT80) Bluetooth BR / EDR / LE					
IMEI Code	Radiation: 990016300003215					
HW Version	V2.0					
SW Version	OS.03.003-HON.02.001					
EUT Stage	Identical Prototype					

Report No.: FR072404A

**Remark:** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

## 1.4 Product Specification of Equipment Under Test

Standards-related Product Specification				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Antenna Type / Gain	IFA Antenna type with gain 1.6 dBi			
	Bluetooth BR (1Mbps) : GFSK			
Type of Modulation	Bluetooth EDR (2Mbps) : π /4-DQPSK			
	Bluetooth EDR (3Mbps) : 8-DPSK			

 Sporton International (Kunshan) Inc.
 Page Number
 : 5 of 17

 TEL: +86-512-57900158
 Report Issued Date
 : Sep. 02, 2020

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID : HD5-CT40PL1N Report Template No.: BU5-FR15CBT Version 2.0

#### 1.5 Modification of EUT

No modifications are made to the EUT during all test items.

## 1.6 Testing Location

Sporton International (Kunshan) Inc. is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

Test Firm	Sporton International (Kunshan) Inc.				
	No. 1098, Pengxi North	n Road, Kunshan Econom	ic Development Zone		
Toot Site Leastion	Jiangsu Province 2153	u Province 215300 People's Republic of China			
Test Site Location	TEL: +86-512-579001				
	FAX: +86-512-579009	58			
	Sporton Sito No	ECC Designation No.	FCC Test Firm		
Test Site No.	Sporton Site No.	FCC Designation No.	Registration No.		
rest one NO.	03CH02-KS 03CH05-KS TH01-KS	CN1257	314309		

#### 1.7 Test Software

lte	em	Site	Manufacture	Name	Version
	1.	03CH02-KS	AUDIX	E3	6.2009-8-24a
:	2.	03CH05-KS	AUDIX	E3	6.2009-8-24al

## 1.8 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

#### Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 6 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

#### 1.9 Re-use of Measured Data

#### 1.9.1 Introduction Section

This application re-uses data collected on a similar device. The subject device of this application (Model: CT40P-L1N, FCC ID: HD5-CT40PL1N) is electrically identical to the reference device (Model: CT40-L1N, FCC ID: HD5-CT40L1N) for the portions of the circuitry corresponding to the data being re-used, as treated by KDB Publication 484596 D01.

Report No.: FR072404A

#### 1.9.2 Difference Section

For details concerning the similarity with respect to component placement, mechanical/electrical design etc., please refer to the Product Equality Declaration.

The re-used RF data includes the following bands provided in Appendix D (Sporton RF Report No. FR850409A for the reference device Model: CT40-L1N, FCC ID: HD5-CT40L1N).

#### 1.9.3 Reference detail Section:

Equipment Class	Reference FCC ID	Folder Test	Report Title/Section
DSS (BR/EDR)	HD5-CT40L1N	Part15C(FR850409A)	All sections applicable
DXX(NFC)	HD5-CT40L1N	Part15C(FR850409D)	All sections applicable

#### 1.9.4 Spot Check Verification Data Section

In order to confirm hardware similarity of the subject device with the reference device, spot check measurements were performed on the subject device for the following test items, the test result were consistent with FCC ID: HD5-CT40L1N.

Assertions concerning the similarity of these devices are based on representations by the applicant. The applicant accepts full responsibility for the validity of the similarity claim, and for the determination that verification test data are sufficient to support it.

Test Item	Mode	HD5-CT40L1N Worst Result	HD5-CT40PL1N Worst Result	Difference (dB)
Conducted Power (dBm)	BT BR/EDR	9.53	6.28	-3.25
Radiated Spurious Emission (dBuV/m)	NFC	61.41	51.32	-10.09

 Sporton International (Kunshan) Inc.
 Page Number
 : 7 of 17

 TEL: +86-512-57900158
 Report Issued Date
 : Sep. 02, 2020

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

## 2 Test Configuration of Equipment Under Test

## 2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 8 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR072404A

#### 2.2 Test Mode

a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Y plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 1Mbps mode, and recorded in this report.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

Summary table of Test Cases						
		Data Rate / Modulation				
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps			
	8-DPSK					
	Bluetooth BR 1Mbps GFSK					
Radiated		Mode 1: CH00_2402 MHz				
Test Cases	Mode 2: CH39_2441 MHz					
	Mode 3: CH78_2480 MHz					

#### Remark:

- 1. For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter.


**Sporton International (Kunshan) Inc.** TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 9 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

## 2.3 Connection Diagram of Test System

For Radiation

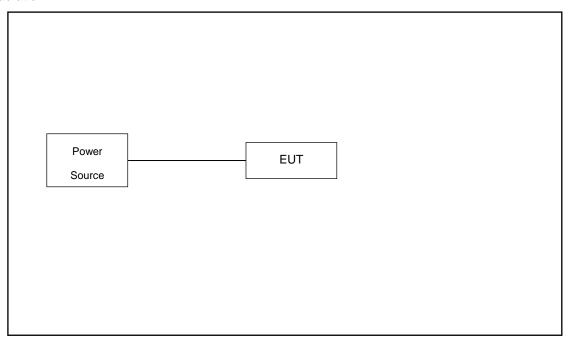

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 10 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

### 3 Test Result

## 3.1 Radiated Band Edges and Spurious Emission Measurement

### 3.1.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

### 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 11 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

#### 3.1.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
  - (1) Span shall wide enough to fully capture the emission being measured;
  - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
  - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time =  $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$ 

Where  $N_1$  is number of type 1 pulses,  $L_1$  is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20\*log(Duty cycle)

- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than average limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.


Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

Report Template No.: BU5-FR15CBT Version 2.0


Report No.: FR072404A

## 3.1.4 Test Setup


#### For radiated emissions below 30MHz

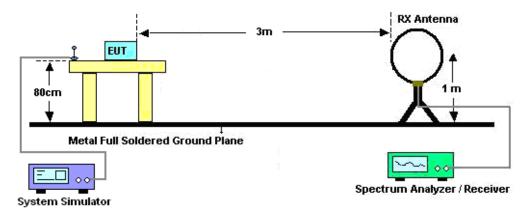

For radiated emissions from 30MHz to 1GHz

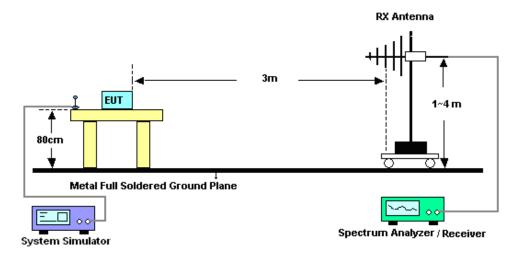

#### For radiated emissions above 1GHz

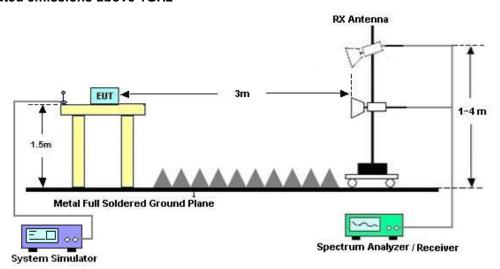

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 13 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

#### 3.1.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

Report No.: FR072404A

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

#### 3.1.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix A.

## 3.1.7 Test Result of Radiated Spurious Emission (30MHz ~ 10<sup>th</sup> Harmonic)

Please refer to Appendix A.

#### 3.1.8 Duty cycle correction factor for average measurement

Please refer to Appendix B.

 Sporton International (Kunshan) Inc.
 Page Number
 : 14 of 17

 TEL: +86-512-57900158
 Report Issued Date
 : Sep. 02, 2020

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID : HD5-CT40PL1N Report Template No.: BU5-FR15CBT Version 2.0

## 3.2 Antenna Requirements

### 3.2.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

### 3.2.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

#### 3.2.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 15 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

## 4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101040	10Hz~40GHz	Nov. 02, 2019	Aug. 26, 2020	Nov. 01, 2020	Conducted (TH01-KS)
Pulse Power Senor	Anritsu	MA2411B	0917070	300MHz~40GH z	Jan. 08, 2020	Aug. 26, 2020	Jan. 07, 2021	Conducted (TH01-KS)
Power Meter	Anritsu	ML2495A	1005002	50MHz Bandwidth	Jan. 08, 2020	Aug. 26, 2020	Jan. 07, 2021	Conducted (TH01-KS)
EMI Test Receiver	R&S	ESR7	101403	9kHz~7GHz;Ma x 30dBm	Oct, 18, 2019	Aug. 24, 2020	Oct, 17,2020	Radiation (03CH02-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY553705 28	10Hz-44G,MAX 30dB	Oct.18, 2019	Aug. 24, 2020	Oct, 17, 2020	Radiation (03CH02-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Nov. 10, 2019	Aug. 24, 2020	Nov. 09, 2020	Radiation (03CH02-KS)
Bilog Antenna	TeseQ	CBL6111D	44483	30MHz-1GHz	Dec. 30, 2019	Aug. 24, 2020	Dec. 29, 2020	Radiation (03CH02-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	75957	1GHz~18GHz	Nov. 10, 2019	Aug. 24, 2020	Nov. 09, 2020	Radiation (03CH02-KS)
high gain Amplifier	MITEQ	AMF-7D-0010 1800-30-10P	2025788	100MHz-18GHz	Jan. 02, 2020	Aug. 24, 2020	Jan. 03, 2021	Radiation (03CH02-KS)
SHF-EHF Horn	Com-power	AH-840	101115	18GHz~40GHz	Nov. 10, 2019	Aug. 24, 2020	Nov. 09, 2020	Radiation (03CH02-KS)
Amplifier	SONOMA	310N	187289	9KHz-1GHz	Jan. 02, 2020	Aug. 24, 2020	Jan. 03, 2021	Radiation (03CH02-KS)
Amplifier	Keysight	83017A	MY532703 16	500MHz~26.5G Hz	Oct, 18, 2019	Aug. 24, 2020	Oct, 17,2020	Radiation (03CH02-KS)
Amplifier	MITEQ	EM18G40GG A	060728	18~40GHz	Jan. 08, 2020	Aug. 24, 2020	Jan. 07, 2021	Radiation (03CH02-KS)
AC Power Source	Chroma	61601	616010002 473	N/A	NCR	Aug. 24, 2020	NCR	Radiation (03CH02-KS)
Turn Table	MF	MF7802	N/A	0~360 degree	NCR	Aug. 24, 2020	NCR	Radiation (03CH02-KS)
Antenna Mast	MF	MF7802	N/A	1 m~4 m	NCR	Aug. 24, 2020	NCR	Radiation (03CH02-KS)
EMI Test Receiver	Keysight	N9038A	MY564000 04	3Hz~8.5GHz;M ax 30dBm	Oct.18, 2019	Aug. 24, 2020	Oct.17, 2020	Radiation (03CH05-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY551502 44	10Hz-44G,MAX 30dB	Apr.15, 2020	Aug. 24, 2020	Apr. 14, 2021	Radiation (03CH05-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Nov. 10, 2019	Aug. 24, 2020	Nov. 09, 2020	Radiation (03CH05-KS)
Bilog Antenna	TeseQ	CBL6111D	49922	30MHz-1GHz	May. 30, 2020	Aug. 24, 2020	May. 29, 2021	Radiation (03CH05-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	00218652	1GHz~18GHz	Apr. 26, 2020	Aug. 24, 2020	Apr. 25, 2021	Radiation (03CH05-KS)
SHF-EHF Horn	Com-power	AH-840	101115	18GHz~40GHz	Nov. 10, 2019	Aug. 24, 2020	Nov. 09, 2020	Radiation (03CH05-KS)
Amplifier	SONOMA	310N	187289	9KHz-1GHz	Apr. 14, 2020	Aug. 24, 2020	Apr.13, 2021	Radiation (03CH05-KS)
Amplifier	MITEQ	EM18G40GG A	060728	18~40GHz	Jan. 08, 2020	Aug. 24, 2020	Jan. 07, 2021	Radiation (03CH05-KS)
high gain Amplifier	MITEQ	AMF-7D-0010 1800-30-10P	2012228	1Ghz-18Ghz	Oct. 18, 2019	Aug. 24, 2020	Oct. 17, 2020	Radiation (03CH05-KS)
Amplifier	Keysight	83017A	16	500MHz~26.5G Hz	Oct. 18, 2019	Aug. 24, 2020	Oct. 17, 2020	Radiation (03CH05-KS)
AC Power Source	Chroma	61601	F1040900 04	N/A	NCR	Aug. 24, 2020	NCR	Radiation (03CH05-KS)
Turn Table	ChamPro	EM 1000-T	060762-T	0~360 degree	NCR	Aug. 24, 2020	NCR	Radiation (03CH05-KS)
Antenna Mast	ChamPro	EM 1000-A	060762-A	1 m~4 m	NCR	Aug. 24, 2020	NCR	Radiation (03CH05-KS)

NCR: No Calibration Required

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : 16 of 17
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

## 5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.26-2015. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

Report No.: FR072404A

#### For 03CH02-KS

#### <u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

Measuring Uncertainty for a Level of	4.0.40
Confidence of 95% (U = 2Uc(y))	4.9dB

#### Uncertainty of Radiated Emission Measurement (1 GHz ~ 18 GHz)

Measuring Uncertainty for a Level of	
Confidence of 95% (U = 2Uc(y))	5.0dB

#### <u>Uncertainty of Radiated Emission Measurement (18 GHz ~ 40 GHz)</u>

Measuring Uncertainty for a Level of	E 4 dD
Confidence of 95% (U = 2Uc(y))	5.1dB

#### For 03CH05-KS

#### <u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

Measuring Uncertainty for a Level of	E OAD
Confidence of 95% (U = 2Uc(y))	5.0dB

#### <u>Uncertainty of Radiated Emission Measurement (1 GHz ~ 18 GHz)</u>

	7
Measuring Uncertainty for a Level of	5.0dB
Confidence of 95% (U = 2Uc(y))	3.00B

#### **Uncertainty of Radiated Emission Measurement (18 GHz ~ 40 GHz)**

Measuring Uncertainty for a Level of	5.0dB
Confidence of 95% (U = 2Uc(y))	3.00B

 Sporton International (Kunshan) Inc.
 Page Number
 : 17 of 17

 TEL: +86-512-57900158
 Report Issued Date
 : Sep. 02, 2020

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID : HD5-CT40PL1N Report Template No.: BU5-FR15CBT Version 2.0

## Appendix A. Radiated Spurious Emission

#### 2.4GHz 2400~2483.5MHz

## BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	( dBµV/m )	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	( deg )	(P/A)	(H/V
		2347.83	54.92	-19.08	74	48.01	31.17	7.41	31.67	369	175	Р	Н
	*	2347.83	30.13	-23.87	54	-	-	-	-	-	-	Α	Н
DT	*	2402	105.82	-	-	98.77	31.2	7.5	31.65	369	175	Р	Н
BT CH00		2402	81.03	-	-	-	ı	-	-	-	-	Α	Н
2402MHz		2343.54	55.46	-18.54	74	48.55	31.17	7.41	31.67	261	236	Р	V
ZTOZIVII IZ	*	2343.54	30.67	-23.33	54	-	ı	-	-	-	-	Α	V
	*	2402	106.83	-	-	99.78	31.2	7.5	31.65	261	236	Р	V
		2402	82.04	-	-	-		-	-	-	-	Α	V
	*	2480	102.98	-	-	95.15	31.77	7.64	31.58	340	189	Р	Н
		2480	78.19	-	-	-		-	-	-	-	Α	Н
5.7		2483.74	57.34	-16.66	74	49.51	31.77	7.64	31.58	340	189	Р	Н
BT CH 78		2483.74	32.55	-21.45	54	-		-	-	-	-	Α	Н
2480MHz	*	2480	104.8	-	-	96.97	31.77	7.64	31.58	287	212	Р	V
2400WII 12		2480	80.01	-	-	-	1	-	-	-	-	Α	V
Remark		2483.74	58.88	-15.12	74	51.05	31.77	7.64	31.58	287	212	Р	V
		2483.74	34.09	-19.91	54	-	-	-	-	-	-	Α	V
			34.09 us found.	-19.91	54	-	-		-	-	-		

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : A1 of A5
Report Issued Date : Sep. 02, 2020

Report No.: FR072404A

Report Version : Rev. 01

#### 2.4GHz 2400~2483.5MHz

## BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
		(MHz)	( dBµV/m )	Limit (dB)	Line ( dBµV/m )	Level ( dBµV )	Factor ( dB/m )	Loss (dB)	Factor ( dB )	Pos ( cm )	Pos ( deg )	Avg. (P/A)	
BT CH 00		4806	38.82	-35.18	74	54.38	33.7	10.78	60.04	300	0	Р	Н
2402MHz		4806	38.83	-35.17	74	54.39	33.7	10.78	60.04	100	360	Р	V
ВТ		4884	39.8	-34.2	74	55.19	33.77	10.87	60.03	300	0	Р	Н
		7320	42.3	-31.7	74	53.53	35.89	13.4	60.52	300	0	Р	Н
CH 39 2441MHz		4884	40.39	-33.61	74	55.78	33.77	10.87	60.03	100	360	Р	V
244 HVII12		7320	42.52	-31.48	74	53.75	35.89	13.4	60.52	100	360	Р	V
1		4962	38.9	-35.1	74	54.08	33.85	10.98	60.01	300	0	Р	Н
BT		7440	42.64	-31.36	74	53.56	36.11	13.51	60.54	300	0	Р	Н
CH 78 2480MHz		4962	39.01	-34.99	74	54.19	33.85	10.98	60.01	100	360	Р	V
		7440	41.77	-32.23	74	52.69	36.11	13.51	60.54	100	360	Р	V

### Remark

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : A2 of A5
Report Issued Date : Sep. 02, 2020

Report No.: FR072404A

Report Version : Rev. 01

<sup>.</sup> No other spurious found.

<sup>2.</sup> All results are PASS against Peak and Average limit line.

## **Emission below 1GHz**

## 2.4GHz BT (LF)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dBµV)	( dB/m )	( dB )	( dB )	( cm )	(deg)	(P/A)	(H/V)
		63.95	20.52	-19.48	40	39.69	12.14	1.81	33.12	-	-	Р	Н
		98.87	19.87	-23.63	43.5	34.73	15.97	2.25	33.08	-	-	Р	Н
		111.48	19.77	-23.73	43.5	33.4	17.11	2.38	33.12	-	-	Р	Н
		161.92	20.32	-23.18	43.5	34.3	16.34	2.88	33.2	-	-	Р	Н
2.4011-		186.17	20.35	-23.15	43.5	35.55	14.92	3.08	33.2	-	-	Р	Н
2.4GHz BT		954.41	29.78	-16.22	46	23.9	30.96	6.93	32.01	100	0	Р	Н
LF		50.37	25.99	-14.01	40	43.19	14.4	1.6	33.2	-	-	Р	V
		66.86	26.33	-13.67	40	45.3	12.32	1.85	33.14	100	0	Р	V
		95.96	26.81	-16.69	43.5	42.04	15.58	2.21	33.02	-	-	Р	V
		109.54	26.98	-16.52	43.5	40.73	17	2.37	33.12	-	-	Р	V
		184.23	24.91	-18.59	43.5	40.07	14.98	3.06	33.2	-	-	Р	٧
		915.61	28.49	-17.51	46	24.06	29.7	6.8	32.07	-	-	Р	٧
Remark		o other spurio I results are P		st limit li	ne.								

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N

: A3 of A5 Page Number Report Issued Date : Sep. 02, 2020

Report No.: FR072404A

Report Version : Rev. 01

All results are PASS against limit line.

## Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is <b>over limit</b> line.
P/A	Peak or Average
H/V	Horizontal or Vertical

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : A4 of A5
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No. : FR072404A

#### A calculation example for radiated spurious emission is shown as below:

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	( dBµV/m )	(dB)	(dBµV/m)	(dB <sub>µ</sub> V)	( dB/m )	( dB )	(dB)	( cm )	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level( $dB\mu V/m$ ) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB $\mu$ V/m) – Limit Line(dB $\mu$ V/m)

#### For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

#### For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level( $dB\mu V/m$ ) Limit Line( $dB\mu V/m$ )
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

**Sporton International (Kunshan) Inc.** TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : A5 of A5
Report Issued Date : Sep. 02, 2020

Report No.: FR072404A


Report Version : Rev. 01

## Appendix B. Duty Cycle Plots

## 3DH5 on time (One Pulse) Plot on Channel 39



### 3DH5 on time (Count Pulses) Plot on Channel 39

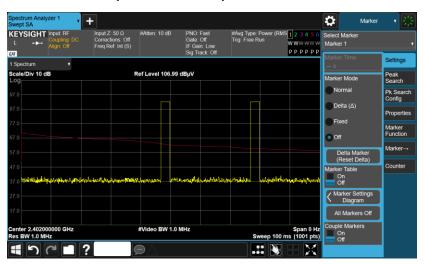

#### Note:

- 1. Worst case Duty cycle = on time/100 milliseconds =  $2 \times 2.88 / 100 = 5.76 \%$
- 2. Worst case Duty cycle correction factor = 20\*log(Duty cycle) = -24.79 dB
- 3. 3DH5 has the highest duty cycle worst case and is reported.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : B1 of B1
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A

## Appendix D. Reference Report

Please refer to Sporton report number FR850409A which is issued separately.

Sporton International (Kunshan) Inc.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: HD5-CT40PL1N Page Number : D1 of D1
Report Issued Date : Sep. 02, 2020
Report Version : Rev. 01

Report No.: FR072404A