

Report No.: HA081915-07B

Hearing Aid Compatibility (HAC) T-Coil Test Report

APPLICANT : Acer Incorporated

EQUIPMENT: Smart HandHeld

BRAND NAME: Acer

MODEL NAME : S120

FCC ID : HLZJMS120

STANDARD : FCC 47 CFR §20.19

ANSI C63.19-2007

T CATEGORY : T3

The product sample received on Nov. 25, 2010 and completely tested on Dec. 01, 2010. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures and shown the compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by:

Roy Wu / Manager





SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 1 of 32 Report Issued Date : Dec. 07, 2010

Table of Contents

| ĸe | | nistory | |
|-----|-------|---|----|
| 1. | State | ment of Compliance | 4 |
| 2. | Admi | inistration Data | |
| | 2.1 | Testing Laboratory | |
| | 2.2 | Applicant | |
| | 2.3 | Manufacturer | |
| | 2.4 | Application Details | |
| 3. | Gene | ral Information | |
| | 3.1 | Description of Device Under Test (DUT) | |
| | 3.2 | Product Photos | |
| | 3.3 | Applied Standards | |
| | 3.4 | Test Conditions | |
| | 0 | 3.4.1 Ambient Condition | |
| | | 3.4.2 Test Configuration | |
| 4. | Heari | ing Aid Compliance (HAC) | |
| •• | 4.1 | Introduction | |
| 5 | | T-Coil Measurement Setup | |
| ٠. | 5.1 | System Configuration | |
| | 5.2 | AM1D Probe | |
| | 0.2 | 5.2.1 Probe Calibration in AMCC | |
| | 5.3 | AMCC | 13 |
| | 5.4 | AMMI | |
| | 5.5 | DATA Acquisition Electronics (DAE) | |
| | 5.6 | Robot | 14 |
| | 5.7 | Measurement Server | |
| | 5.8 | Phone Positioner | |
| | 5.9 | Test Arch Phantom | 16 |
| | 5.10 | Cabling of System | 16 |
| | 5.11 | HAC Extension Software | 17 |
| | 5.12 | Test Equipment List | |
| | 5.13 | Reference Input of Audio Signal Spectrum | |
| | 5.14 | Signal Verification | |
| 6. | | ription for DUT Testing Position | |
| 7. | | il Test Procedure | |
| 8. | T-Coi | il Signal Quality Categories | 23 |
| 9. | HAC | T-Coil Test Results | 24 |
| | 9.1 | Magnitude Result | 24 |
| | 9.2 | Frequency Response Plots | |
| | 9.3 | T-Coil Coupling Field Intensity | |
| | | 9.3.1 Axial Field Intensity | |
| | | 9.3.2 Radial Field Intensity | 29 |
| | | 9.3.3 Frequency Response at Axial Measurement Point | 29 |
| | | 9.3.4 Signal Quality | |
| | | rtainty Assessment | |
| 11. | Refer | rences | 32 |

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate

Appendix C. Product Photos Appendix D. Test Setup Photos

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120



Revision History

| REPORT NO. | VERSION | DESCRIPTION | ISSUED DATE |
|--------------|---------|---------------------------------------|---------------|
| HA081915-07B | Rev. 01 | Initial issue of report | Dec. 06, 2010 |
| HA081915-07B | Rev. 02 | Update report for revising SW version | Dec. 07, 2010 |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 3 of 32
Report Issued Date : Dec. 07, 2010
Report Version : Rev. 02

1. Statement of Compliance

The Hearing Aid Compliance (HAC) maximum results found during testing for the Acer Incorporated Smart HandHeld Acer S120 are as follows (with expanded uncertainly ±8.1% for AMB1 and ±12.3% for AMB2):

| Reference (63.19) | Description | Verdict | Section |
|-------------------|------------------------|---------|---------|
| 7.3.1.1 | Axial Field Intensity | Pass | 9.2.1 |
| 7.3.1.2 | Radial Field Intensity | Pass | 9.2.2 |
| 7.3.2 | Frequency Response | Pass | 9.2.3 |
| 7.3.3 | Signal Quality | Т3 | 9.2.4 |

| Band | (S+N)/N in dB | T Rating |
|---------------|---------------|----------|
| GSM850 | 21.20 | Т3 |
| GSM1900 | 25.80 | Т3 |
| WCDMA Band V | 45.70 | Т4 |
| WCDMA Band II | 46.60 | Т4 |

They are in compliance with HAC limits (HAC Rated category T3) specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

Results Summary: T Category = T3 (ANSI C63.19-2007)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120

Page Number : 4 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B



2. Administration Data

2.1 Testing Laboratory

| Test Site SPORTON INTERNATIONAL INC. | |
|--------------------------------------|---|
| Test Site Location | No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park, Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C. TEL: +886-3-327-3456 FAX: +886-3-328-4978 |

2.2 Applicant

| Company Name | Acer Incorporated |
|--------------|---|
| Address | 8F., No. 88, Sec. 1, Hsin Tai Wu Rd., Hsichih, Taipei Hsien 221, Taiwan |

2.3 Manufacturer

| Company Name | Company Name Compal Communication (Nanjing) | |
|--------------|---|--|
| Address | Nanjing Jingning Export Processing Zone (South Area) No. 68-2 Suyuan Street | |

2.4 Application Details

| Date of Receipt of Application | Nov. 25, 2010 |
|--------------------------------|---------------|
| Date of Start during the Test | Nov. 25, 2010 |
| Date of End during the Test | Dec. 01, 2010 |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 5 of 32
Report Issued Date : Dec. 07, 2010

Report No.: HA081915-07B

3. General Information

3.1 <u>Description of Device Under Test (DUT)</u>

| Product Feature & Specification | | |
|----------------------------------|--|--|
| DUT Type | Smart HandHeld | |
| Brand Name | Acer | |
| Model Name | S120 | |
| FCC ID | HLZJMS120 | |
| | GSM850 : 824 MHz ~ 849 MHz | |
| Ty Fraguency | GSM1900 : 1850 MHz ~ 1910 MHz | |
| Tx Frequency | WCDMA Band V : 824 MHz ~ 849 MHz | |
| | WCDMA Band II: 1850 MHz ~ 1910 MHz | |
| | GSM850 : 869 MHz ~ 894 MHz | |
| D., F., | GSM1900 : 1930 MHz ~ 1990 MHz | |
| Rx Frequency | WCDMA Band V : 869 MHz ~ 894 MHz | |
| | WCDMA Band II: 1930 MHz ~ 1990 MHz | |
| | GSM850 : 33.58 dBm | |
| Maximum Output Bayyar to Antonna | GSM1900 : 30.56 dBm | |
| Maximum Output Power to Antenna | WCDMA Band V : 23.29 dBm | |
| | WCDMA Band II: 23.39 dBm | |
| Antenna Type | Fixed Internal Antenna | |
| HW Version | REV0E (DVT2) | |
| | Android version: 2.2 | |
| SW Version | Baseband version: A4-01.00.17 | |
| | Build number:Acer_LiquidMetal_1.000.23_EMEA_GEN1 | |
| Towns of Madelation | GSM : GMSK | |
| Type of Modulation | WCDMA: QPSK | |
| DUT Stage | Identical Prototype | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 6 of 32 Report Issued Date : Dec. 07, 2010

Report No.: HA081915-07B



List of Accessory:

| | Specification of Accessory | | |
|------------|----------------------------|---------------------|--|
| AC Adoptor | Brand Name | PHIHONG | |
| AC Adapter | Model Name | PSAI05R-050Q | |
| | Brand Name | Simplo | |
| Battery 1 | Model Name | BAT-510 | |
| | Wiodel Name | (P/N: BT.00107.010) | |
| | Brand Name | TWS | |
| Battery 2 | Model Name | BAT-510 | |
| | wodei Name | (P/N: BT.0010S.001) | |
| Earnhana | Brand Name | KINGSTATE | |
| Earphone | Model Name | KJAH4028AENCB-2 | |
| HCD Coble | Brand Name | MEC IMEX | |
| USB Cable | Model Name | 60-4721-100 | |
| LCD Panel | Brand Name | AUO | |
| LCD Failei | Model Name | H361VL01 V3 | |
| Momory 1 | Brand Name | Samsung | |
| Memory 1 | Model Name | KA100O015C-AJTT | |
| Mamany 2 | Brand Name | Hynix | |
| Memory 2 | Model Name | H8KES0XU0MRR-4EM | |

Remark: The above DUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

3.2 Product Photos

Refer to Appendix C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120

Page Number : 7 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B

3.3 Applied Standards

The Standard ANSI C63.19:2007 represents performance requirements for acceptable interoperability of hearing aids with wireless communications devices. When these parameters are met, a hearing aid operates acceptably in close proximity to a wireless communications device.

3.4 Test Conditions

3.4.1 Ambient Condition

| Ambient Temperature | 20-24 °ℂ |
|------------------------|-----------------------------------|
| Humidity | <60% |
| Acoustic Ambient Noise | >10dB below the measurement level |

3.4.2 Test Configuration

The device was controlled by using a base station emulator R&S CMU200. Communication between the device and the emulator was established by coaxial connection. The DUT was set from the emulator to radiate maximum output power during all testing.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 8 of 32
Report Issued Date : Dec. 07, 2010

Report No.: HA081915-07B



4. Hearing Aid Compliance (HAC)

4.1 Introduction

In September 2006, the T-Coil requirements of ANSI C63.19 Standard went into effect. The federal communication commission (FCC) adopted ANSI C63.19 as HAC test standard.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120

Page Number : 9 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B



5. HAC T-Coil Measurement Setup

5.1 System Configuration



Fig. 5.1 T-Coil setup with HAC Test Arch and AMCC

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 10 of 32 Report Issued Date : Dec. 07, 2010

Report No.: HA081915-07B



The DASY system for performance compliance tests is illustrated above graphically. This system consists of the following items:

Report No.: HA081915-07B

- A standard high precision 6-axis robot with controller, a teach pendant and software
- A data acquisition electronic (DAE) attached to the robot arm extension
- A dosimetric probe equipped with an optical surface detector system
- The electro-optical converter (ECO) performs the conversion between optical and electrical signals
- A measurement server performs the time critical tasks such as signal filtering, control of the robot operation and fast movement interrupts.
- A probe alignment unit which improves the accuracy of the probe positioning
- A computer operating Windows XP
- DASY software
- Remove control with teach pendant and additional circuitry for robot safety such as warming lamps,
- The SAM twin phantom
- A device holder
- Tissue simulating liquid
- \triangleright Dipole for evaluating the proper functioning of the system

Some of the components are described in details in the following sub-sections.

5.2 AM1D Probe

The AM1D probe is an active probe with a single sensor. It is fully RF-shielded and has a rounded tip 6mm in diameter incorporating a pickup coil with its center offset 3mm from the tip and the sides. The symmetric signal preamplifier in the probe is fed via the shielded symmetric output cable from the AMMI with a 48V "phantom" voltage supply. The 7-pin connector on the back in the axis of the probe does not carry any signals. It is mounted to the DAE for the correct orientation of the sensor. If the probe axis is tilted 54.7 degree from the vertical, the sensor is approximately vertical when the signal connector is at the underside of the probe (cable hanging downwards).

Specification:

| Frequency Range | 0.1 ~ 20 kHz (RF sensitivity <-100dB, fully RF shielded) |
|-----------------|---|
| Sensitivity | <-50dB A/m @ 1 kHz |
| Pre-amplifier | 40 dB, symmetric |
| Dimensions | Tip diameter/ length: 6/ 290 mm, sensor according to ANSI-PC63.19 |

SPORTON INTERNATIONAL INC. Page Number : 11 of 32 Report Issued Date: Dec. 07, 2010 Report Version FAX: 886-3-328-4978 : Rev. 02

TEL: 886-3-327-3456

FCC ID: HLZJMS120

5.2.1 Probe Calibration in AMCC

The probe sensitivity at 1 kHz is 0.00742647 V/(A/m) (-21.29 dBV/(A/m)) was calibrated by AMCC coil for verification of setup performance. The evaluated probe sensitivity was able to be compared to the calibration of the AM1D probe. The frequency response and sensitivity was shown in Fig. 5.3. The probe signal is represented after application of an ideal integrator. The green curve represents the current though the AMCC, the blue curve the integrated probe signal. The DIFFERENCE between the two curves is equivalent to the frequency response of the probe system and shows the characteristics. The probe/system complies with the frequency response and linearity requirements in C63.19 according to the Speag's calibrated report as shown in Annex B (AM1D probe: SPAM100AF) (1)The frequency response has been tested within +/- 0.5 dB of ideal differentiator from 100 Hz to 10 kHz. (2)The linearity has also been tested within 0.1dB from 5 dB below limitation to 16 dB above noise level. The AMCC coil is qualified according to certificate report, SDHACPO02A as shown in Annex B.

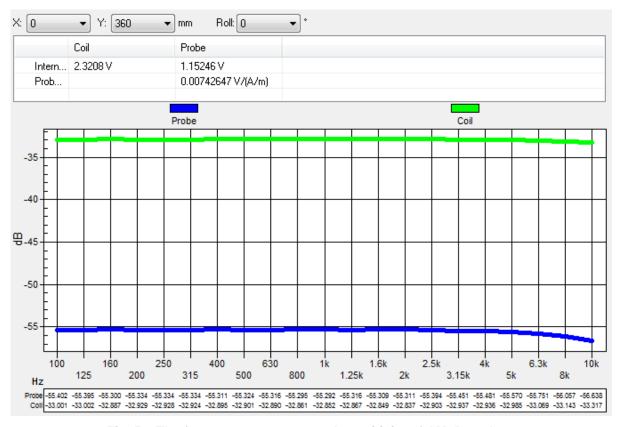


Fig. 5.3 The frequency response and sensitivity of AM1D probe

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 12 of 32 Report Issued Date : Dec. 07, 2010

Report No.: HA081915-07B

5.3<u>AMCC</u>

The Audio Magnetic Calibration coil is a Helmholtz Coil designed for calibration of the AM1D probe. The two horizontal coils generate a homogeneous magnetic field in the z direction. The DC input resistance is adjusted by a series resistor to approximately 500hm, and a shunt resistor of 10 0hm permits monitoring the current with a scale of 1:10.

Port description:

| Signal | Connector | Resistance |
|--------------|-----------|---|
| Coil In | BNC | typically 50 Ohm |
| Coil Monitor | BNO | 10Ohm ±1%(100mV corresponding to 1 A/m) |

Specification:

| Dimensions 370 x 370 x 196 mm, according to ANSI C63.19 |
|--|
|--|

5.4<u>AMMI</u>



Fig. 5.4 AMMI front panel

The Audio Magnetic Measuring Instrument (AMMI) is a desktop 19-inch unit containing a sampling unit, a waveform generator for test and calibration signals, and a USB interface.

Specification:

| Sampling rate | 48 kHz/24 bit |
|------------------------|---|
| Dynamic range | 85 dB |
| Test signal generation | User selectable and predefined (vis PC) |
| Calibration | Auto-calibration/full system calibration using AMCC with monitor output |
| Dimensions | 482 x 65 x 270 mm |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 13 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B



5.5 DATA Acquisition Electronics (DAE)

The data acquisition electronics (DAE) consists of a highly sensitive electrometer-grade preamplifier with auto-zeroing, a channel and gain-switching multiplexer, a fast 16 bit AD-converter and a command decoder and control logic unit. Transmission to the measurement server is accomplished through an optical downlink for data and status information as well as an optical uplink for commands and the clock.

The input impedance of the DAE is 200 MOhm; the inputs are symmetrical and floating. Common mode rejection is above 80 dB.



Report No.: HA081915-07B

Fig. 5.5 Photo of DAE

5.6 Robot

The SPEAG DASY system uses the high precision robots (DASY4: RX90BL; DASY5: TX90XL) type from Stäubli SA (France). For the 6-axis controller system, the robot controller version (DASY4: CS7MB; DASY5: CS8c) from Stäubli is used. The Stäubli robot series have many features that are important for our application:

- ➤ High precision (repeatability ±0.035 mm)
- > High reliability (industrial design)
- > Jerk-free straight movements
- ➤ Low ELF interference (the closed metallic construction shields against motor control fields)
- 6-axis controller



Fig. 5.6 Photo of DASY4



Fig. 5.7 Photo of DASY5

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 14 of 32 Report Issued Date : Dec. 07, 2010



5.7 Measurement Server

The measurement server is based on a PC/104 CPU board with CPU (DASY4: 166 MHz, Intel Pentium; DASY5: 400 MHz, Intel Celeron), chipdisk (DASY4: 32 MB; DASY5: 128 MB), RAM (DASY4: 64 MB, DASY5: 128 MB). The necessary circuits for communication with the DAE electronic box, as well as the 16 bit AD converter system for optical detection and digital I/O interface are contained on the DASY I/O board, which is directly connected to the PC/104 bus of the CPU board.

The measurement server performs all the real-time data evaluation for field measurements and surface detection, controls robot movements and handles safety operations.





Report No.: HA081915-07B

Fig. 5.8 Photo of Server for DASY4

Fig. 5.9 Photo of Server for DASY5

5.8 Phone Positioner

The phone positioner shown in Fig. 5.10 is used to adjust DUT to the suitable position.



Fig. 5.10 Phone Positioner

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 15 of 32 Report Issued Date : Dec. 07, 2010



Report No.: HA081915-07B

5.9 Test Arch Phantom

| Construction: | Enables easy and well defined positioning of the phone and validation dipoles as well as simple teaching of the robot. | |
|---------------|--|---------------------------------|
| Dimensions : | 370 x 370 x 370 mm | Fig. 5.12 Photo of Arch Phantom |

5.10 Cabling of System

The principal cabling of the T-Coil setup is shown in Fig. 5.6. All cables provided with the basic setup have a length of approximately 5 m.

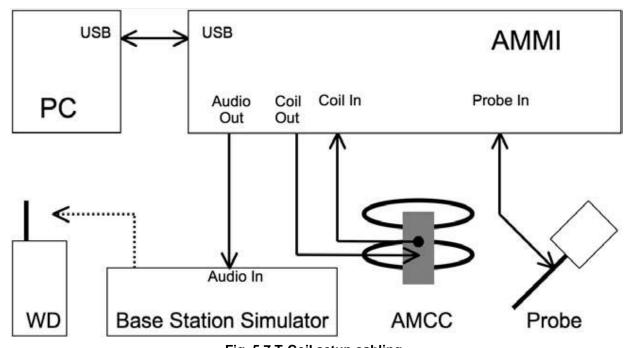


Fig. 5.7 T-Coil setup cabling

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120

: 16 of 32 Page Number Report Issued Date: Dec. 07, 2010

5.11 HAC Extension Software

Specification:

| opeomeanom | |
|-----------------------|--|
| Precise teaching | Easy teaching with adaptive distance verification |
| Measurement area | Flexible selection of measurement area, predefined according to ANSI C63.19 |
| | ABM: spectral processing, filtering, weighting and evaluation according to ANSI C63.19 |
| Report | Documentation ready for compliance report |

5.12 Test Equipment List

| Manager | Name of Emilional | T (0.01 - 1 | Ossisl Namelas | Calib | ration |
|--------------|--------------------------------------|-------------|----------------|---------------|---------------|
| Manufacturer | Name of Equipment | Type/Model | Serial Number | Last Cal. | Due Date |
| SPEAG | Isotropic E-Field Probe | ER3DV6 | 2358 | Jan. 22, 2010 | Jan. 21, 2011 |
| SPEAG | Isotropic H-Field Probe | H3DV6 | 6184 | Jan. 22, 2010 | Jan. 21, 2011 |
| SPEAG | Audio Magnetic 1D Field Probe | AM1DV2 | 1038 | Jan. 21, 2010 | Jan. 20, 2011 |
| SPEAG | Audio Magnetic Calibration Coil | AMCC | 1049 | NCR | NCR |
| SPEAG | Audio Measuring Instrument | AMMI | 1041 | NCR | NCR |
| SPEAG | 835MHz Calibration Dipole | CD835V3 | 1045 | Sep. 17, 2009 | Sep. 16, 2011 |
| SPEAG | 1880MHz Calibration Dipole | CD1880V3 | 1038 | Sep. 17, 2009 | Sep. 16, 2011 |
| SPEAG | 2450MHz Calibration Dipole | CD2450V3 | 1039 | Sep. 17, 2009 | Sep. 16, 2011 |
| SPEAG | Data Acquisition Electronics | DAE3 | 577 | Aug. 18, 2010 | Aug. 17, 2011 |
| SPEAG | Data Acquisition Electronics | DAE4 | 778 | Oct. 22, 2010 | Oct. 21, 2011 |
| SPEAG | Test Arch Phantom | N/A | N/A | NCR | NCR |
| SPEAG | Phone Positoiner | N/A | N/A | NCR | NCR |
| Agilent | Wireless Communication Test Set | E5515C | GB46311322 | Feb. 16, 2009 | Feb. 15, 2011 |
| R&S | Universal Radio Communication Tester | CMU200 | 117995 | Mar. 19, 2009 | Mar. 18, 2011 |
| Agilent | Dual Directional Coupler | 778D | 50422 | NCR | NCR |
| AR | Power Amplifier | 5S1G4M2 | 0328767 | NCR | NCR |
| R&S | Spectrum Analyzer | FSP7 | 101131 | Mar. 05, 2010 | Mar. 04, 2011 |

Table 5.1 Test Equipment List

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 17 of 32
Report Issued Date : Dec. 07, 2010

Report No.: HA081915-07B



Report No.: HA081915-07B

5.13 Reference Input of Audio Signal Spectrum

With the reference job "use as reference" in the beginning of a procedure, measure the spectrum of the current when applied to the AMCC, i.e. the input magnetic field spectrum, as shown below Fig. 5.8 and Fig. 5.9. For this, the delay of the window shall be set to a multiple of the signal period and at least 2s. From the measurement on the device, using the same signal, the postprocessor deducts the input spectrum, so the result represents the net DUT response.

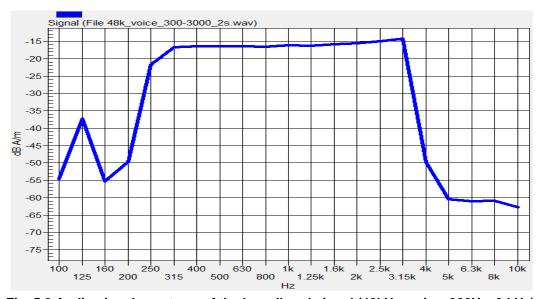


Fig. 5.8 Audio signal spectrum of the broadband signal (48kHz_voice_300Hz~3 kHz)

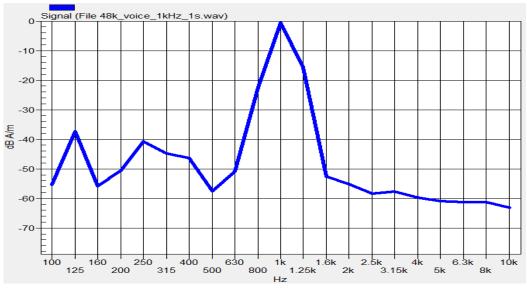


Fig. 5.9 Audio signal spectrum of the narrowband signal (48kHz_voice_1kHz)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 18 of 32 Report Issued Date: Dec. 07, 2010

5.14 Signal Verification

According to ANSI C63.19:2007 section 6.3.2.1, the normal speech input level for HAC T-coil tests shall be set to -16 dBm0 for GSM and UMTS (WCDMA), and to -18 dBm0 for CDMA. This technical note shows a possibility to evaluate and set the correct level with the HAC T-Coil setup with a Rohde&Schwarz communication tester CMU200 with audio option B52 and B85.

Establish a call from the CMU200 to a wireless device. Select CMU200 Network Bitstream "Decoder Cal" to have a 1 kHz signal with a level of 3.14 dBm0 at the speech output. Run the measurement job and read the voltage level at the multi-meter display "Coil signal". Read the RMS voltage corresponding to 3.14 dBm0 and note it. Calculate the desired signal levels of -16 dBm0:

3.14 dBm0 = -2.774 dBV-16 dBm0 = -21.914 dBV

Determine the 1 kHz input level to generate the desired signal level of -16 dBm0. Select CMU200 Network Bitstream "Codec Cal" to loop the input via the codec to the output. Run the measurement job (AMMI 1 kHz signal with gain 10 inserted) and read the voltage level at the multimeter display "Coil signal". Calculate the required gain setting for the above levels:

Gain 10 = -19.891 dBVDifference for -16 dBm0 = -21.914 - (-19.891) = -2.023 dB Gain factor = $10 \land ((-2.023) / 20) = 0.792$ Resulting Gain = $10 \times 0.792 = 7.92$

The predefined signal types have the following differences / factors compared to the 1 kHz sine signal:

| Signal Type | Duration (s) | Peak to RMS (dB) | RMS (dB) | Gain Factor | Gain Setting |
|--------------|-----------------|---------------------|-------------|-------------|--------------|
| 1kHz | 1 | 16.2 | -12.7 | 4.33 | 34.30 |
| 300Hz ~ 3kHz | 2 | 21.6 | -18.6 | 8.48 | 67.18 |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 19 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B

: Rev. 02 Report Version



t Report No. : HA081915-07B

6. <u>Description for DUT Testing Position</u>

Fig.6.1 illustrate the references and reference plane that shall be used in a typical DUT emissions measurement. The principle of this section is applied to DUT with similar geometry. Please refer to Appendix D for the setup photographs.

- The area is 5 cm by 5 cm.
- > The area is centered on the audio frequency output transducer of the DUT.
- The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the DUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

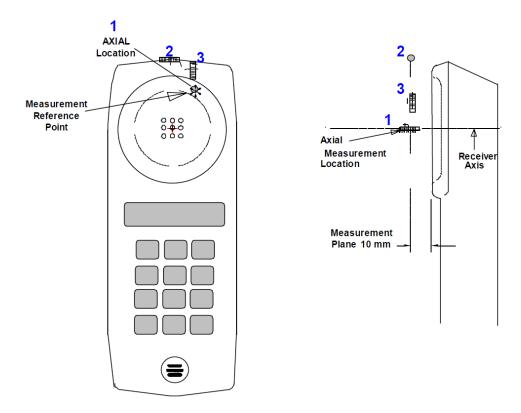


Fig 6.1 A typical DUT reference and plane for T-Coil measurements

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 20 of 32
Report Issued Date : Dec. 07, 2010



7. T-Coil Test Procedure

The following illustrate a typical test scan over a wireless communications device:

- Geometry and signal check: system probe alignment, proper operation of the field probe, probe
 measurement system, other instrumentation, and the positioning system was confirmed. A surface
 calibration was performed before each setup change to ensure repeatable spacing and proper
 maintenance of the measurement plane using the test Arch.
- 2. Set the reference drive level of signal voice defined in C63.19 per 6.3.2.1, as shown in this report of section 5.12.
- 3. The ambient and test system background noise (dB A/m) was measured as well as ABM2 over the full measurement. The maximum noise level must be at least 10dB below the limit of C63.19 per 7.3.2.
- 4. The DUT was positioned in its intended test position, acoustic output point of the device perpendicular to the field probe.
- 5. The DUT operation for maximum rated RF output power was configured and connected by using of coaxial cable connection to the base station simulator at the test channel and other normal operating parameters as intended for the test. The battery was ensured to be fully charged before each test. The center sub-grid was centered over the center of the acoustic output (also audio band magnetic output, if applicable). The DUT audio output was positioned tangent (as physically possible) to the measurement plane.
- 6. The DUT's RF emission field was eliminated from T-coil results by using a well RF-shielding of the probe, AM1D, and by using of coaxial cable connection to a Base Station Simulator. One test channel was pre-measurement to avoid this possibility.
- 7. Determined the optimal measurement locations for the DUT by following the three steps, coarse resolution scan, fine resolution scans, and point measurement, as described in C63.19 per 6.3.4.4. At each measurement locations, samples in the measurement window duration were evaluated to get ABM1 and the signal spectrum. The noise measurement was performed after the scan with the signal, the same happened, just with the voice signal switched off. The ABM2 was calculated from this second scan.
 - (1) Coarse resolution scans (1 kHz signal at 50 x 50 mm grid area with 10 mm spacing). Only ABM1 was measured in order to find the location of T-Coil source.
 - (2) Fine resolution scans (1 kHz signal at 10 x 10 mm grid area with 2 mm spacing). The positioned appropriately based on optimal AMB1 of coarse resolution scan. Both ABM1 and ABM2 were measured in order to find the location of the SNR point.
 - (3) Point measurement (1 kHz signal) for ABM1 and ABM2 in axial, radial transverse and radial longitudinal. The positioned appropriately based on optimal SNR of fine resolution scan. The SNR was calculated for axial, radial transverse and radial longitudinal orientation.
 - **(4)** Point measurement (300Hz to 3 kHz signal) for frequency response in axial. The positioned appropriately based on optimal SNR of fine resolution axial scan.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 21 of 32
Report Issued Date : Dec. 07, 2010
Report Version : Rev. 02



- 8. All results resulting from a measurement point in a T-Coil job were calculated from the signal samples during this window interval. ABM values were averaged over the sequence of these samples.
- 9. At an optimal point measurement, the SNR (ABM1/ABM2) was calculated for axial, radial transverse and radial longitudinal orientation, and the frequency response was measured in axial axis.
- 10. Corrected for the frequency response after the DUT measurement since the DASY system had known the spectrum of the input signal by using a reference job, as shown in this report of section 5.12.
- 11. In SEMCAD post-processing, the spectral points are in addition scaled with the high-pass (half-band) and the A-weighting, bandwidth compensated factor (BWC) and those results are final as shown in this report.
- 12. Classified the signal quality based on the table 8.1: T-Coil Signal Quality Categories.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 22 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B



8. T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 8.1. This establishes the RF environment presented by the WD to a hearing aid.

| Category | Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB) |
|-------------|--|
| Category T1 | 0 to 10 dB |
| Category T2 | 10 to 20 dB |
| Category T3 | 20 to 30 dB |
| Category T4 | > 30 dB |

Table 8.1 T-Coil Signal Quality Categories

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 23 of 32
Report Issued Date : Dec. 07, 2010
Report Version : Rev. 02



9. HAC T-Coil Test Results

9.1 Magnitude Result

The Table 9.1 shows testing result in position coordinates which are defined as deviation from earpiece center in millimeters. Axial measurement location was defined by the manufacture of the device. Signal strength measurement scans are presented in appendix A.

| Plot No. | Band | Channel | Battery | Probe Position | Coordinates (mm) | Ambient Noise (dB A/m) | ABM2 (dB A/m) | ABM1 (dB A/m) | SNR (dB) | T Rating | | | | | | |
|-------------|-----------------|---------|---------|-------------------|------------------|------------------------------|------------------|------------------|-------------|--------------|-------|--------|--------|-------|-------|----|
| | | | | Axial (Z) | -2,2 | -54.75 | -10.50 | 10.70 | 21.20 | T3 | | | | | | |
| #01 | GSM850 | 189 | 1 | Radial 1 (X) | 6,3 | -50.79 | -31.32 | 1.88 | 33.20 | T4 | | | | | | |
| | | | | Radial 2 (Y) | -3,3 | -43.82 | -43.10 | -10.60 | 32.50 | T4 | | | | | | |
| | | | | Axial (Z) | -2,0 | -53.22 | -10.60 | 10.80 | 21.40 | T3 | | | | | | |
| #02 | GSM850 | 128 | 1 | Radial 1 (X) | 6,3 | -52.41 | -28.63 | 2.07 | 30.70 | T4 | | | | | | |
| | | | | Radial 2 (Y) | -3,3 | -47.17 | -41.50 | -10.20 | 31.30 | T4 | | | | | | |
| | | | | Axial (Z) | -2,2.2 | -53.31 | -10.80 | 12.00 | 22.80 | T3 | | | | | | |
| #03 | GSM850 | 251 | 1 | Radial 1 (X) | 6,4.2 | -51.93 | -28.56 | 3.04 | 31.60 | T4 | | | | | | |
| | | | | Radial 2 (Y) | 0,1.2 | -47.77 | -38.86 | -5.96 | 32.90 | T4 | | | | | | |
| | | | | Axial (Z) | -2,2.2 | -52.34 | -10.10 | 11.10 | 21.20 | Т3 | | | | | | |
| #04 | GSM850 | 189 | 2 | Radial 1 (X) | 6,4.2 | -51.51 | -29.49 | 2.31 | 31.80 | T4 | | | | | | |
| | | | | Radial 2 (Y) | 0,4.2 | -47.81 | -38.68 | -6.98 | 31.70 | T4 | | | | | | |
| | | | | Axial (Z) | -2,2.2 | -53.25 | -16.20 | 11.20 | 27.40 | T3 | | | | | | |
| #05 | GSM1900 | 661 | 1 | Radial 1 (X) | 6,1.2 | -51.80 | -30.85 | 2.05 | 32.90 | T4 | | | | | | |
| | | | | Radial 2 (Y) | 0,-1.8 | -47.39 | -34.04 | 1.96 | 36.00 | T4 | | | | | | |
| | | | | Axial (Z) | -2,2.2 | -52.80 | -15.30 | 11.10 | 26.40 | T3 | | | | | | |
| #06 | GSM1900 | 512 | 1 | Radial 1 (X) | 6,4.2 | -51.41 | -34.01 | 2.09 | 36.10 | T4 | | | | | | |
| | | | | Radial 2 (Y) | -3,4.2 | -47.14 | -42.80 | -6.40 | 36.40 | T4 | | | | | | |
| | | | | Axial (Z) | -2,2.2 | -53.06 | -16.30 | 11.00 | 27.30 | T3 | | | | | | |
| #07 | GSM1900 | 810 | 1 | Radial 1 (X) | 6,1.2 | -51.82 | -34.77 | 2.03 | 36.80 | T4 | | | | | | |
| | | | | Radial 2 (Y) | 0,4.2 | -47.20 | -42.18 | -5.68 | 36.50 | T4 | | | | | | |
| | | | | Axial (Z) | 0,2.2 | -52.32 | -13.90 | 11.90 | 25.80 | Т3 | | | | | | |
| #08 | GSM1900 | 512 | 2 | Radial 1 (X) | 6,1.2 | -51.25 | -34.14 | 2.26 | 36.40 | T4 | | | | | | |
| | | | | | | | | | | Radial 2 (Y) | 0,4.2 | -47.63 | -41.96 | -6.76 | 35.20 | T4 |
| | | | | Axial (Z) | -2,4 | -50.27 | -41.30 | 10.70 | 52.00 | T4 | | | | | | |
| #13 | WCDMA Band V | 4182 | 1 | Radial 1 (X) | 9,0 | -50.34 | -48.01 | 2.59 | 50.60 | T4 | | | | | | |
| | Danu v | | | Radial 2 (Y) | 0,-6 | -42.75 | -41.52 | 4.48 | 46.00 | T4 | | | | | | |
| | | | | Axial (Z) | 0,0 | -50.73 | -40.60 | 11.30 | 51.90 | T4 | | | | | | |
| #14 | WCDMA | 4132 | 1 | Radial 1 (X) | 6,3 | -51.27 | -46.97 | 3.23 | 50.20 | T4 | | | | | | |
| | Band V | | | Radial 2 (Y) | 0,-6 | -42.37 | -41.59 | 4.31 | 45.90 | T4 | | | | | | |
| | WORLL | | | Axial (Z) | -2,4 | -50.79 | -42.21 | 9.89 | 52.10 | T4 | | | | | | |
| #15 | WCDMA Band V | 4233 | 1 | Radial 1 (X) | 9,0 | -50.86 | -48.09 | 2.61 | 50.70 | T4 | | | | | | |
| | Dailu V | | | Radial 2 (Y) | 0,9 | -43.02 | -42.21 | 3.49 | 45.70 | T4 | | | | | | |
| | 14400141 | | | Axial (Z) | -2,4 | -51.75 | -42.10 | 10.60 | 52.70 | T4 | | | | | | |
| #16 | WCDMA Band V | 4233 | 2 | Radial 1 (X) | 9,3 | -51.26 | -48.49 | 2.91 | 51.40 | T4 | | | | | | |
| | Dallu V | | | Radial 2 (Y) | 0,-6 | -44.77 | -43.65 | 4.55 | 48.20 | T4 | | | | | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 24 of 32
Report Issued Date : Dec. 07, 2010
Report Version : Rev. 02



| Plot No. | Band | Channel | Battery | Probe Position | Coordinates (mm) | Ambient Noise (dB A/m) | ABM2 (dB A/m) | ABM1 (dB A/m) | SNR (dB) | T Rating | | |
|-------------|-------------------------|---------|---------|-------------------|------------------|------------------------------|------------------|------------------|-------------|----------|-------|----|
| | WODMA | | | Axial (Z) | -4,2 | -50.12 | -42.39 | 9.91 | 52.30 | T4 | | |
| #09 | WCDMA Band II | 9400 | 1 | Radial 1 (X) | 6,3 | -51.40 | -46.54 | 3.46 | 50.00 | T4 | | |
| | Danu II | | | Radial 2 (Y) | 0,-6 | -43.33 | -42.16 | 4.44 | 46.60 | T4 | | |
| | 0 WCDMA Band II 9262 | | | | | Axial (Z) | -4,2 | -50.00 | -42.00 | 10.10 | 52.10 | T4 |
| #10 | | 9262 | 2 1 | Radial 1 (X) | 9,0 | -50.59 | -48.76 | 2.84 | 51.60 | T4 | | |
| | | | | Radial 2 (Y) | 0,-6 | -42.70 | -42.27 | 4.73 | 47.00 | T4 | | |
| | MODMA | 9538 | 9538 | 1 0538 | | Axial (Z) | -2,4 | -50.87 | -42.00 | 10.80 | 52.80 | T4 |
| #11 | WCDMA Band II | | | | 1 | Radial 1 (X) | 6,3 | -51.39 | -47.91 | 3.49 | 51.40 | T4 |
| | Danu II | | | Radial 2 (Y) | 0,-6 | -44.83 | -44.28 | 4.42 | 48.70 | T4 | | |
| | #12 WCDMA Band II 94 | | | Axial (Z) | -4,4 | -51.03 | -42.74 | 9.26 | 52.00 | T4 | | |
| #12 | | 9400 | 2 | Radial 1 (X) | 6,0 | -51.96 | -48.36 | 3.94 | 52.30 | T4 | | |
| | | | | Radial 2 (Y) | 0,-6 | -45.12 | -44.02 | 4.98 | 49.00 | T4 | | |

Table 9.1 Test Result for Various Positions

Remark:

- This device does not support HAC and V.O.I.P. function. It means that the functions of WLAN and Bluetooth do not have voice capability in the held to ear mode.
- The HAC mode software on this DUT was turned on during HAC testing. 2.
- The volume was adjusted to maximum level and the backlight turned off during T-Coil testing. 3.
- 4. Test Engineer: Eric Huang, Robert Liu and A-Rod Chen

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120


Page Number : 25 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B



9.2 Frequency Response Plots

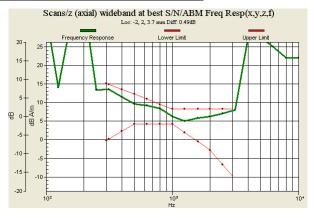


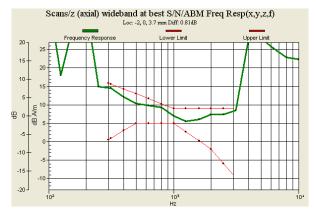

Report No.: HA081915-07B

Fig. 9.1 GSM850 Ch189 (Battery 1)

Fig. 9.2 GSM850 Ch128 (Battery 1)

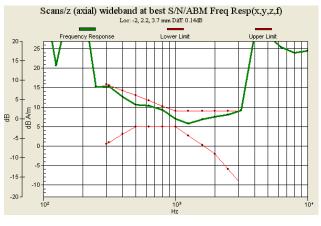

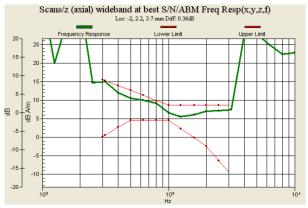
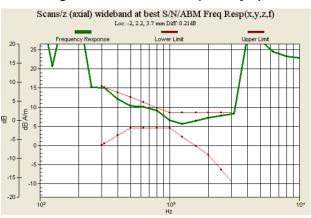


Fig. 9.3 GSM850 Ch251 (Battery 1)

Fig. 9.4 GSM850 Ch189 (Battery 2)



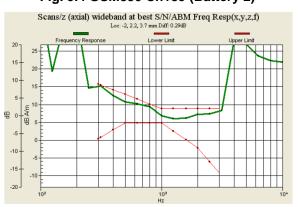
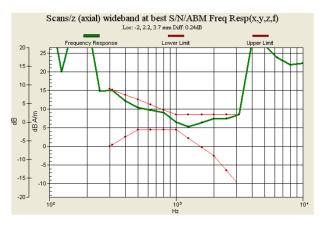


Fig. 9.5 GSM1900 Ch661 (Battery 1)

Fig. 9.6 GSM1900 Ch512 (Battery 1)

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 26 of 32
Report Issued Date : Dec. 07, 2010
Report Version : Rev. 02





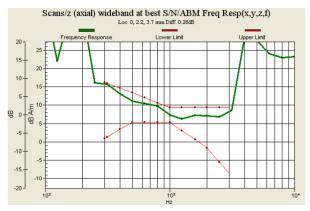
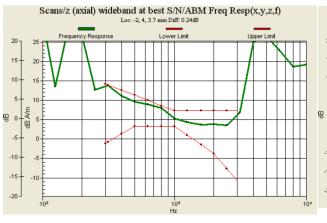


Fig. 9.7 GSM1900 Ch810 (Battery 1)

Fig. 9.8 GSM1900 Ch512 (Battery 2)



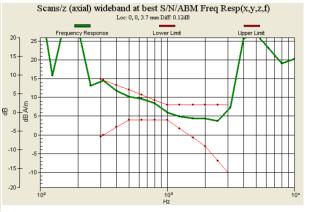
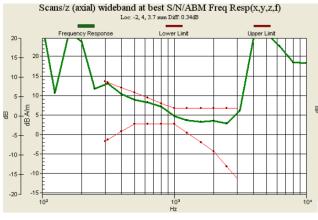


Fig. 9.9WCDMA Band V Ch4182 (Battery 1)

Fig. 9.10 WCDMA Band V Ch4132 (Battery 1)



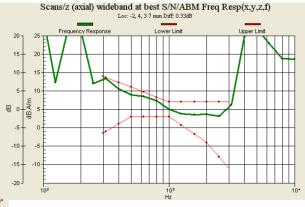


Fig. 9.11 CDMA Band V Ch4233 (Battery 1)

Fig. 9.12 WCDMA Band V Ch4233 (Battery 2)


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 27 of 32
Report Issued Date : Dec. 07, 2010



-20 -




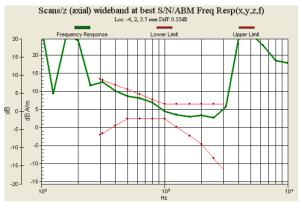

Report No.: HA081915-07B

Fig. 9.13 WCDMA Band II Ch9400 (Battery 1)

Fig. 9.14 WCDMA Band II Ch9262 (Battery 1)

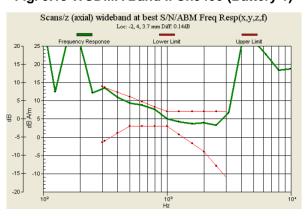

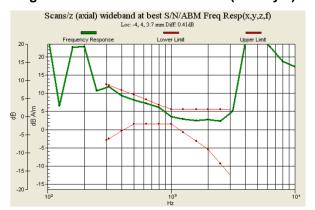


Fig. 9.15 WCDMA Band II Ch9538 (Battery 1)

Fig. 9.16 WCDMA Band II Ch9400 (Battery 2)

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 28 of 32 Report Issued Date: Dec. 07, 2010



9.3 T-Coil Coupling Field Intensity

9.3.1 Axial Field Intensity

| Cell Phone Mode | Minimum limit (dB A/m) | Result (dB A/m) | Verdict |
|-----------------|---------------------------|--------------------|---------|
| GSM850 | -18 | 10.70 | Pass |
| GSM1900 | -18 | 11.00 | Pass |
| WCDMA Band V | -18 | 9.89 | Pass |
| WCDMA Band II | -18 | 9.26 | Pass |

9.3.2 Radial Field Intensity

| rtadiai i ioid iiitoiioity | | | |
|----------------------------|---------------------------|--------------------|---------|
| Cell Phone Mode | Minimum limit (dB A/m) | Result (dB A/m) | Verdict |
| GSM850 | -18 | -10.60 | Pass |
| GSM1900 | -18 | -6.76 | Pass |
| WCDMA Band V | -18 | 2.59 | Pass |
| WCDMA Band II | -18 | 2.84 | Pass |

9.3.3 Frequency Response at Axial Measurement Point

| Cell Phone Mode | Verdict |
|-----------------|---------|
| GSM850 | Pass |
| GSM1900 | Pass |
| WCDMA Band V | Pass |
| WCDMA Band II | Pass |

9.3.4 Signal Quality

| | | Minimum | Minimum | | | |
|-----------------|----|---------|---------|-----|----------------|---------|
| Cell Phone Mode | T1 | T2 | Т3 | T4 | Result (dB) | Verdict |
| GSM850 | 0 | 10 | 20 | >30 | 21.20 | Т3 |
| GSM1900 | 0 | 10 | 20 | >30 | 25.80 | Т3 |
| WCDMA Band V | 0 | 10 | 20 | >30 | 45.70 | T4 |
| WCDMA Band II | 0 | 10 | 20 | >30 | 46.60 | T4 |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number : 29 of 32
Report Issued Date : Dec. 07, 2010
Report Version : Rev. 02

10. <u>Uncertainty Assessment</u>

The component of uncertainly may generally be categorized according to the methods used to evaluate them. The evaluation of uncertainly by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance.

A Type A evaluation of standard uncertainty may be based on any valid statistical method for treating data. This includes calculating the standard deviation of the mean of a series of independent observations; using the method of least squares to fit a curve to the data in order to estimate the parameter of the curve and their standard deviations; or carrying out an analysis of variance in order to identify and quantify random effects in certain kinds of measurement.

A type B evaluation of standard uncertainty is typically based on scientific judgment using all of the relevant information available. These may include previous measurement data, experience and knowledge of the behavior and properties of relevant materials and instruments, manufacture's specification, data provided in calibration reports and uncertainties assigned to reference data taken from handbooks. Broadly speaking, the uncertainty is either obtained from an outdoor source or obtained from an assumed distribution, such as the normal distribution, rectangular or triangular distributions indicated in Table 10.1.

| Uncertainty Distributions | Normal | Rectangular | Triangular | U-shape |
|-----------------------------------|--------------------|-------------|------------|---------|
| Multiplying factor ^(a) | 1/k ^(b) | 1/√3 | 1/√6 | 1/√2 |

⁽a) standard uncertainty is determined as the product of the multiplying factor and the estimated range of variations in the measured quantity

(b) κ is the coverage factor

Table 10.1 Multiplying Factions for Various Distributions

The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances.

Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. Typically, the coverage factor ranges from 2 to 3. Using a coverage factor allows the true value of a measured quantity to be specified with a defined probability within the specified uncertainty range. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 10.2.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120

Page Number : 30 of 32 Report Issued Date: Dec. 07, 2010 Report Version

: Rev. 02



| Error Description | Uncertainty Value (±%) | Probability Distribution | Divisor | Ci (ABM1) | Ci (ABM2) | Standard Uncertainty (ABM1) | Standard Uncertainty (ABM2) |
|---------------------------------------|------------------------|-----------------------------|---------|--------------|--------------|-----------------------------------|-----------------------------------|
| Probe Sensitivity | | | | | | | |
| Reference Level | 3.0 | Normal | 1 | 1 | 1 | ± 3.0 % | ± 3.0 % |
| AMCC Geometry | 0.4 | Rectangular | √3 | 1 | 1 | ± 0.2 % | ± 0.2 % |
| AMCC Current | 1.0 | Rectangular | √3 | 1 | 1 | ± 0.6 % | ± 0.6 % |
| Probe Positioning During Calibrate | 0.1 | Rectangular | √3 | 1 | 1 | ± 0.1 % | ± 0.1 % |
| Noise Contribution | 0.7 | Rectangular | √3 | 0.0143 | 1 | ± 0.0 % | ± 0.4 % |
| Frequency Slope | 5.9 | Rectangular | √3 | 0.1 | 1 | ± 0.3 % | ± 3.5 % |
| Probe System | Probe System | | | | | | |
| Repeatability / Drift | 1.0 | Rectangular | √3 | 1 | 1 | ± 0.6 % | ± 0.6 % |
| Linearity / Dynamic Range | 0.6 | Rectangular | √3 | 1 | 1 | ± 0.4 % | ± 0.4 % |
| Acoustic Noise | 1.0 | Rectangular | √3 | 0.1 | 1 | ± 0.1 % | ± 0.6 % |
| Probe Angle | 2.3 | Rectangular | √3 | 1 | 1 | ± 1.4 % | ± 1.4 % |
| Spectral Processing | 0.9 | Rectangular | √3 | 1 | 1 | ± 0.5 % | ± 0.5 % |
| Integration Time | 0.6 | Normal | 1 | 1 | 5 | ± 0.6 % | ± 3.0 % |
| Field Disturbation | 0.2 | Rectangular | √3 | 1 | 1 | ± 0.1 % | ± 0.1 % |
| Test Signal | | | | | | | |
| Reference Signal Spectral Response | 0.6 | Rectangular | √3 | 0 | 1 | ± 0.0 % | ± 0.4 % |
| Positioning | | | | | | | |
| Probe Positioning | 1.9 | Rectangular | √3 | 1 | 1 | ± 1.1 % | ± 1.1 % |
| Phantom Thickness | 0.9 | Rectangular | √3 | 1 | 1 | ± 0.5 % | ± 0.5 % |
| DUT Positioning | 1.9 | Rectangular | √3 | 1 | 1 | ± 1.1 % | ± 1.1 % |
| External Contributions | | | | | | | |
| RF Interference | 0.0 | Rectangular | √3 | 1 | 0.3 | ± 0.0 % | ± 0.0 % |
| Test Signal Variation | 2.0 | Rectangular | √3 | 1 | 1 | ± 1.2 % | ± 1.2 % |
| Combined Standard Uncertainty | | | | | ± 4.1 % | ± 6.1 % | |
| Coverage Factor for 95 % | | | | | | K = 2 | |
| Expanded Uncertainty | | | | | ± 8.1 % | ± 12.3 % | |

Table 10.2 Uncertainty Budget of DASY

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120

Page Number : 31 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B



11. References

- [1] ANSI C63.19 2007, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 8 June 2007
- [2] SPEAG DASY System Handbook

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120

Page Number : 32 of 32 Report Issued Date: Dec. 07, 2010

Report No.: HA081915-07B



Appendix A. Plots of T-Coil Measurement

The plots are shown as follows.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number A1 of A1
Report Issued Date : Dec. 07, 2010
Report Version : Rev. 02



Appendix B. Calibration Data

The DASY calibration certificates are shown as follows.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: HLZJMS120 Page Number B1 of B1
Report Issued Date: Dec. 07, 2010
Report Version: Rev. 02