

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com



Test Report

Product Name: 49 MHz HOMODYNE WALKIE TALKIE

FCC ID: ICK-TM-4655

Applicant:

LOYAL TECHNOLOGIES CO., LTD.
BLK. E & I, 11/F, VALIANT IND. CENTRE
2-12 AU PUI WAN STREET, FORTAN, SHATIN
N.T., HONG KONG

Date Receipt: JANUARY 13, 2003

Date Tested: JANUARY 17, 2003

APPLICANT: LOYAL TECHNOLOGY CO., LTD.
FCC ID: ICK-TM-4655
REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

COVER SHEET

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TABLE OF CONTENTS LIST

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

TEST REPORT CONTAINING:

PAGE	1-3	TEST EQUIPMENT LIST
PAGE	4	TEST PROCEDURE
PAGE	5	RADIATION INTERFERENCE 15.235 TEST DATA
PAGE	6	RADIATION INTERFERENCE 15.209 TEST DATA
PAGE	7	OCCUPIED BANDWIDTH
PAGE	8-9	OCCUPIED BANDWIDTH PLOT

EXHIBITS CONTAINING:

EXHIBIT	1	BLOCK DIAGRAM
EXHIBIT	2	SCHEMATIC
EXHIBIT	3	INSTRUCTION MANUAL
EXHIBIT	4	LABEL SAMPLE AND LOCATION
EXHIBIT	5	EXTERNAL PHOTOGRAPHS
EXHIBIT	6	INTERNAL PHOTOGRAPHS
EXHIBIT	7	CIRCUIT DESCRIPTION
EXHIBIT	8	TEST SET UP PHOTOGRAPH

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45
 Newberry, Florida 32669
<http://www.timcoengr.com>
 888.472.2424 F 352.472.2030 email: sid@timcoengr.com

EMC Equipment List

	DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
X	3-Meter OATS	TEI	N/A	N/A	Listed 12/22/99	12/22/02
	3/10-Meter OATS	TEI	N/A	N/A	Listed 3/26/01	3/26/04
	Receiver, Beige Tower Spectrum Analyzer (Tan) RF Preselector (Tan) Quasi-Peak Adapter (Tan)	HP	8566B Opt 462	3138A07786 3144A20661	CAL 8/31/01	8/31/03
		HP	85685A	3221A01400	CAL 8/31/01	8/31/03
		HP	85650A	3303A01690	CAL 8/31/01	8/31/03
X	Receiver, Blue Tower Spectrum Analyzer (Blue)	HP	8568B	2928A04729 2848A18049	CHAR 10/22/01	10/22/03
X	RF Preselector (Blue)	HP	85685A	2926A00983	CHAR 10/22/01	10/22/03
X	Quasi-Peak Adapter (Blue)	HP	85650A	2811A01279	CHAR 10/22/01	10/22/03
X	Biconnical Antenna	Electro-Metrics	BIA-25	1171	CAL 4/26/01	4/26/03
	Biconnical Antenna	Eaton	94455-1	1096	CAL 10/1/01	10/1/03
	Biconnical Antenna	Eaton	94455-1	1057	CHAR 3/15/00	3/15/02
	BiconiLog Antenna	EMCO	3143	9409-1043		
X	Log-Periodic Antenna	Electro-Metrics	LPA-25	1122	CAL 10/2/01	10/2/03
	Log-Periodic Antenna	Electro-Metrics	EM-6950	632	CHAR 10/15/01	10/15/03
	Log-Periodic Antenna	Electro-Metrics	LPA-30	409	CHAR 10/16/01	10/16/03
	Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	152	CAL 3/21/01	3/21/04
	Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	153	CHAR 11/24/00	11/24/03
	Double-Ridged Horn Antenna	Electro-Metrics	RGA -180	2319	CAL 12/19/01	12/19/03
	Horn Antenna	Electro-Metrics	EM-6961	6246	CAL 3/21/01	3/21/03
	Horn Antenna	ATM	19-443-6R	None	No Cal Required	

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DUE DATE or STATUS
Passive Loop Antenna	EMC Test Systems	EMCO 6512	9706-1211	CHAR 7/10/01	7/10/03
Line Impedance Stabilization . . .	Electro-Metrics	ANS-25/2	2604	CAL 10/9/01	10/9/03
Line Impedance Stabilization . . .	Electro-Metrics	EM-7820	2682	CAL 3/16/01	3/16/03
Termaline Wattmeter	Bird Electronic Corporation	611	16405	CAL 5/25/99	5/25/01
Termaline Wattmeter	Bird Electronic Corporation	6104	1926	CAL 12/12/01	12/12/03
Oscilloscope	Tektronix	2230	300572	CHAR 2/1/01	2/1/03
Temperature Chamber	Tenney Engineering	TTRC	11717-7	CHAR 1/22/02	1/22/04
AC Voltmeter	HP	400FL	2213A14499	CAL 10/9/01	10/9/03
AC Voltmeter	HP	400FL	2213A14261	CHAR 10/15/01	10/15/03
AC Voltmeter	HP	400FL	2213A14728	CHAR 10/15/01	10/15/03
X	Digital Multimeter	Fluke	77	CHAR 1/8/02	1/8/04
	Digital Multimeter	Fluke	77	CHAR 1/8/02	1/8/04
	Digital Multimeter	HP	E2377A	CHAR 1/8/02	1/8/04
	Multimeter	Fluke	FLUKE-77-3	CAL 9/26/01	9/26/03
	Peak Power Meter	HP	8900C	CHAR 1/26/01	1/26/03
	Digital Thermometer	Fluke	2166A	CAL 1/16/02	1/16/04
	Thermometer	Traulsen	SK-128	CHAR 1/22/02	1/22/04
X	Temp/Humidity gauge	EXTech	44577F	CHAR 1/22/02	1/22/04
	Frequency Counter	HP	5352B	CAL 11/28/01	11/28/03
	Power Sensor	Agilent Technologies	84811A	CAL 1/26/01	1/26/03
	Service Monitor	IFR	FM/AM 500A	CAL 11/22/00	11/22/02
	Comm. Serv. Monitor	IFR	FM/AM 1200S	CAL 5/12/02	5/12/04

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

DEVICE	MFGR	MODEL	SERNO	CAL/CHAR DATE	DU ^E DATE or STATUS
Signal Generator	HP	8640B	2308A21464	CAL 11/15/01	11/15/03
Modulation Analyzer	HP	8901A	3435A06868	CAL 9/5/01	9/5/03
Near Field Probe	HP	HP11940A	2650A02748	CHAR 2/1/01	2/1/03
BandReject Filter	Lorch Microwave	5BR4-2400/ 60-N	Z1	CHAR 3/2/01	3/2/03
BandReject Filter	Lorch Microwave	6BR6-2442/ 300-N	Z1	CHAR 3/2/01	3/2/03
BandReject Filter	Lorch Microwave	5BR4-10525/ 900-S	Z1	CHAR 3/2/01	3/2/03
High Pas Filter	Microlab	HA-10N		CHAR 10/4/01	10/4/03
Audio Oscillator	HP	653A	832-00260	CHAR 3/1/01	3/1/03
Frequency Counter	HP	5382A	1620A03535	CHAR 3/2/01	3/2/03
Frequency Counter	HP	5385A	3242A07460	CHAR 12/11/01	12/11/03
Preamplifier	HP	8449B-H02	3008A00372	CHAR 3/4/01	3/4/03
Amplifier	HP	11975A	2738A01969	CHAR 3/1/01	3/1/03
Egg Timer	Unk			CHAR 8/31/01	8/31/03
Measuring Tape, 20M	Kraftixx	0631-20		CHAR 2/1/02	2/1/04
Measuring Tape, 7.5M	Kraftixx	7.5M PROFI		2/1/02	2/1/04
Coaxial Cable #51	Insulated Wire Inc.	NPS 2251-2880	Timco #51	CHAR 1/23/02	1/23/04
Coaxial Cable #64	Semflex Inc.	60637	Timco #64	CHAR 1/24/02	1/24/04
Coaxial Cable #65	General Cable Co.	E9917 RG233/U	Timco #65	CHAR 1/23/02	1/23/04
Coaxial Cable #106	Unknown	Unknown	Timco #106	CHAR 1/23/02	1/23/04

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TEST PROCEDURE

GENERAL: This report shall NOT be reproduced except in full without the written approval of TIMCO ENGINEERING, INC.

RADIATION INTERFERENCE: The test procedure used was ANSI STANDARD C63.4-1992 using a HEWLETT PACKARD spectrum analyzer with a preselector. The bandwidth of the spectrum analyzer was 100 kHz with an appropriate sweep speed. The analyzer was calibrated in dB above a microvolt at the output of the antenna. The resolution bandwidth was 100 kHz and the video bandwidth was 300 kHz. The ambient temperature of the UUT was 50°C with a humidity of 31%.

FORMULA OF CONVERSION FACTORS: The Field Strength at 3m was established by adding the meter reading of the spectrum analyzer (which is set to read in units of dBuV) to the antenna correction factor supplied by the antenna manufacturer. The antenna correction factors are stated in terms of dB. The gain of the Preselector was accounted for in the Spectrum Analyzer Meter Reading.

Example:

Freq (MHz) METER READING + ACF = FS
33 20 dBuV + 10.36 dB = 30.36 dBuV/m @ 3m

ANSI STANDARD C63.4-1992 10.1.7 MEASUREMENT PROCEDURES: The unit under test was placed on a table 80 cm high and with dimensions of 1m by 1.5m. The table used for radiated measurements is capable of continuous rotation.

When an emission was found, the table was rotated to produce the maximum signal strength. At this point, the antenna was raised and lowered from 1m to 4m. The antenna was placed in both the horizontal and vertical planes.

APPLICANT: LOYAL TECHNOLOGY CO., LTD.
FCC ID: ICK-TM-4655
REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

NAME OF TEST: RADIATION INTERFERENCE

RULES PART NO.: 15.235

REQUIREMENTS: CARRIER FREQUENCY WILL NOT EXCEED 80 dBuV/m AT 3M.
OUT-OF-BAND EMISSIONS SHALL NOT EXCEED:

30 - 88 MHz	40.0 dBuV/M MEASURED AT 3 METERS
88 - 216 MHz	43.5 dBuV/M
216 - 960 MHz	46.0 dBuV/M
ABOVE 960 MHz	54.0 dBuV/M

TEST DATA:

Emission Frequency MHz	Meter Reading dBuv	Ant. Polarity	Coax Loss dB	Correction Factor dB	Field Strength dBuV/m	Margin dB
49.86	18.2	H	0.80	11.83	30.83	49.17
49.86	22.1	V	0.80	11.83	34.73	45.27

SAMPLE CALCULATION: FSdBuV/m = MR(dBuV) + ACFdB.

TEST PROCEDURE: The procedure used was ANSI STANDARD C63.4-1992. The spectrum was scanned from 30 MHz to 1000 MHz. When an emission was found, the table was rotated to produce the maximum signal strength. The antenna was placed in both the horizontal and vertical planes and the worse case emissions were reported. The UUT was tested in 3 orthogonal planes.

TEST RESULTS: THE UNIT DOES MEET THE FCC REQUIREMENTS.

PERFORMED BY: JOSEPH SCOGLIO

DATE: JANUARY 17, 2003

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

NAME OF TEST: RADIATION INTERFERENCE

RULES PART NUMBER: 15.209

REQUIREMENTS:

1.705 to 30 MHz:	49.54 dBuV/m @ 3 METERS
30 to 88 MHz:	40.00 dBuV/M @ 3 METERS
88 to 216 MHz:	43.52 dBuV/M
216 to 960 MHz:	46.02 dBuV/M
ABOVE 960 MHz:	54.00 dBuV/M

* Harmonics must be less than the fundamental.

TEST RESULTS: A search was made of the spectrum from 25 to 1000 MHz and the measurements indicate that the unit DOES meet the FCC requirements.

TEST DATA:

Emission Frequency MHz	Meter Reading dBuv	Ant. Polarity	Coax Loss dB	Correction Factor dB	Field Strength dBuv/m	Margin dB
49.40	15.9	H	0.79	11.94	28.63	11.37

SAMPLE CALCULATION: $FS_{dBuV/m} = MR_{(dBuV)} + ACF_{dB}$.

TEST PROCEDURE: ANSI STANDARD C63.4-1992 using a Hewlett Packard Model 8566B spectrum analyzer, a Hewlett Packard Model 85685A Pre-selector, a Hewlett Packard Model 85650A Quasi-Peak adapter, and an appropriate antenna. The bandwidth of spectrum analyzer was 100kHz with an appropriate sweep speed. When an emission was found, the table was rotated to produce the maximum signal strength. The antenna was placed in both the horizontal and vertical planes and the worse case emissions were reported.

PERFORMED BY: JOSEPH SCOGLIO

DATE: JANUARY 17, 200.

APPLICANT: LOYAL TECHNOLOGY CO., LTD.
FCC ID: ICK-TM-4655
REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

NAME OF TEST: Occupied Bandwidth

RULES PART NO.: 15.235 & 15.209

REQUIREMENTS: The field strength of any emissions appearing between the band edges and up to 10 kHz above and below the band edges shall be attenuated at least 26 dB below the level of the un-modulated carrier or to the general limits of 15.209, whichever permits the higher emission levels.

THE GRAPHS ON THE FOLLOWING PAGES REPRESENT THE EMISSIONS TAKEN FOR THIS DEVICE.

METHOD OF MEASUREMENT: A small sample of the transmitter output was fed into the spectrum analyzer and the attached plot was taken. The vertical scale is set to 10 dB per division. The horizontal scale is set to 8 kHz per division to show 15.235 compliance and 10 kHz per division to show the 15.209 compliance.

TEST RESULTS: The unit DOES meet the FCC requirements.

PERFORMED BY: JOSEPH SCOGLIO **DATE:** JANUARY 17, 2003

APPLICANT: LOYAL TECHNOLOGY CO., LTD.
FCC ID: ICK-TM-4655
REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

OCCUPIED BANDWIDTH PLOT - 15.235

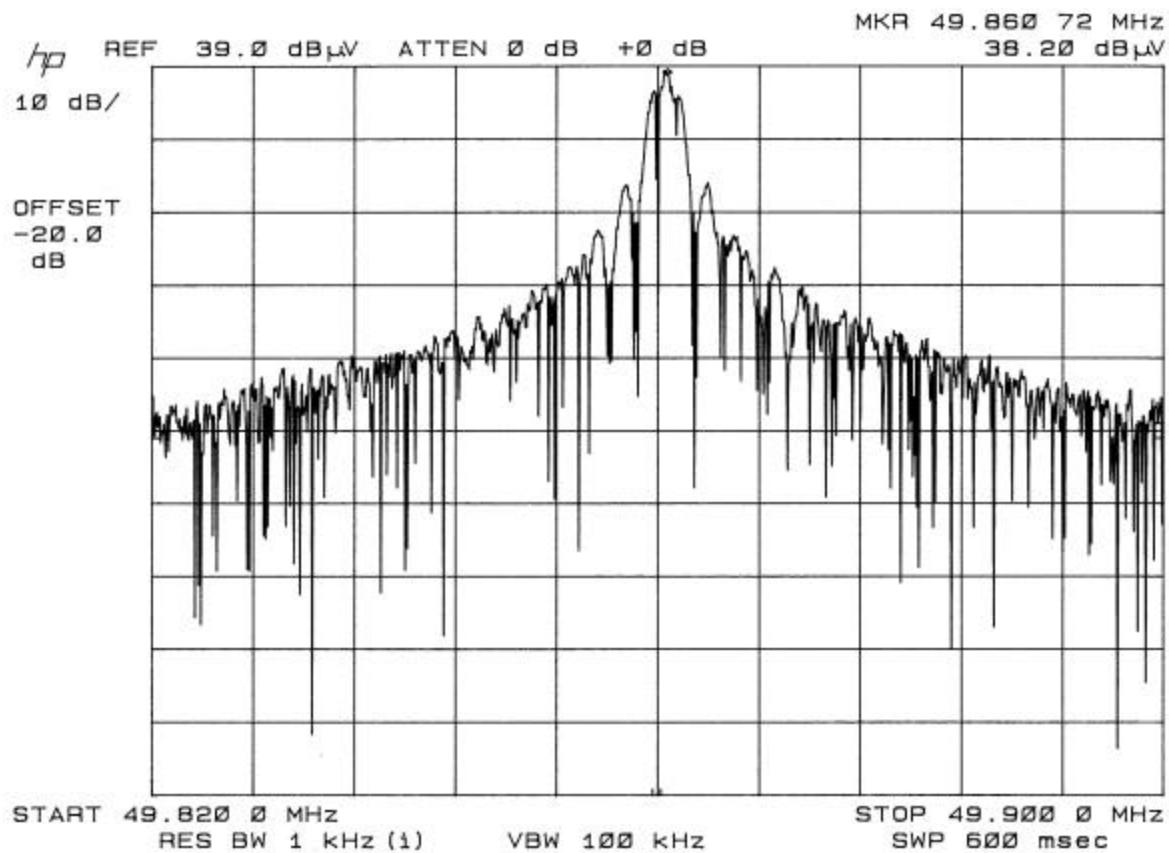

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

OCCUPIED BANDWIDTH PLOT - 15.209

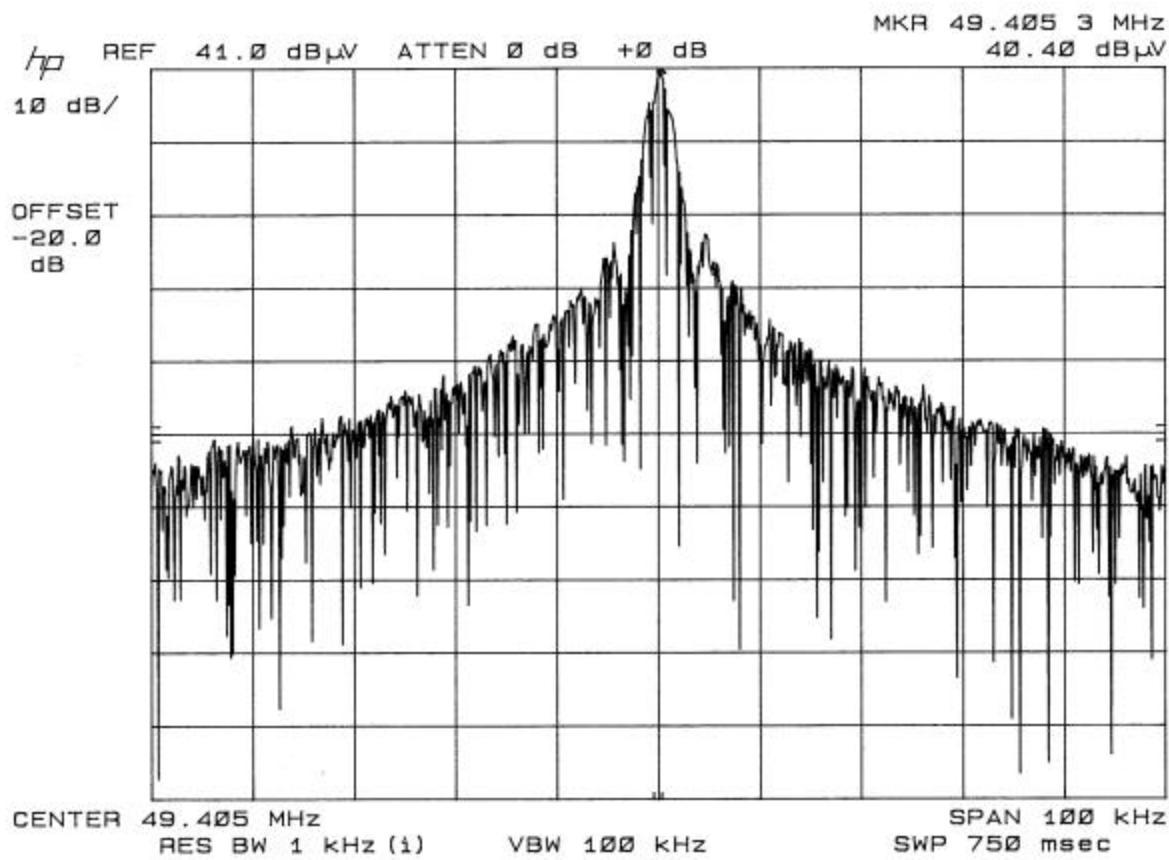

APPLICANT: LOYAL TECHNOLOGY CO., LTD.

FCC ID: ICK-TM-4655

REPORT #: L\LOYALICK\50AUT3\50AUT3TestReport.doc