# **FCC RF Test Report**

APPLICANT : Motorola Mobility LLC

**EQUIPMENT**: Mobile Phone

BRAND NAME : Motorola

MODEL NAME : XT2227-1

FCC ID : IHDT56AD5

STANDARD : 47 CFR Part 2, and 90(S)

**CLASSIFICATION**: PCS Licensed Transmitter Held to Ear (PCE)

TEST DATE(S) : Dec. 19, 2021 ~ Jan. 07, 2022

We, Sporton International Inc. (Kunshan), would like to declare that the tested sample has been evaluated in accordance with the procedures given in ANSI C63.26-2015 and shown compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Kunshan), the test report shall not be reproduced except in full.

Reviewed by: Jason Jia / Supervisor

JasonJia

Approved by: Alex Wang / Manager

Sporton International Inc. (Kunshan)

No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300 People's Republic of China

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 1 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# **TABLE OF CONTENTS**

RE	VISIO	N HISTORY	3
SU	MMAR	RY OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1.	Applicant	5
	1.2.	Manufacturer	5
	1.3.	Feature of Equipment Under Test	5
	1.4.	Product Specification of Equipment Under Test	
	1.5.	Modification of EUT	
	1.6.	Maximum Conducted Power and Emission Designator	
	1.7.	Testing Site	
	1.8.	Test Software	
	1.9.	Applied Standards	
	1.10.	Specification of Accessory	8
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	9
	2.1	Test Mode	
	2.2	Connection Diagram of Test System	10
	2.3	Support Unit used in test configuration and system	
	2.4	Measurement Results Explanation Example	
	2.5	Frequency List of Low/Middle/High Channels	11
3	TEST	RESULT	12
	3.1	Conducted Output Power Measurement	12
	3.2	99% Occupied Bandwidth and 26dB Bandwidth Measurement	13
	3.3	Emissions Mask Measurement	
	3.4	Emissions Mask – Out Of Band Emissions Measurement	
	3.5	Field Strength of Spurious Radiation Measurement	
	3.6	Frequency Stability Measurement	20
4	LIST	OF MEASURING EQUIPMENT	22
5	UNCE	ERTAINTY OF EVALUATION	23
ΑP	PEND	IX A. TEST RESULTS OF CONDUCTED TEST	
ΑP	PEND	IX B. TEST RESULTS OF RADIATED TEST	

Sporton International Inc. (Kunshan)

**APPENDIX C. TEST SETUP PHOTOGRAPHS** 

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 2 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report Template No.: BU5-FWLTE Version 2.0

# **REVISION HISTORY**

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FG1N3013C	Rev. 01	Initial issue of report	Feb. 10, 2022

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 3 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# **SUMMARY OF TEST RESULT**

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	§2.1046	Conducted Output Power	_	Report only	-
3.2	§2.1049 §90.209	Occupied Bandwidth and 26dB Bandwidth	_	Report only	-
3.3	§2.1051 §90.691	Emission masks – In-band emissions	< 50+10log <sub>10</sub> (P[Watts])	PASS	-
3.4	§2.1051 §90.691	Emission masks – Out of band emissions	< 43+10log <sub>10</sub> (P[Watts])	PASS	-
3.5	§2.1053 §90.691	Field Strength of Spurious  Radiation	< 43+10log <sub>10</sub> (P[Watts])	PASS	Under limit 44.63 dB at 2440.000 MHz
3.6	§2.1055 §90.213	Frequency Stability for Temperature & Voltage	< 2.5 ppm	PASS	-

#### **Declaration of Conformity:**

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

#### Comments and Explanations:

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 4 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# 1 General Description

# 1.1. Applicant

**Motorola Mobility LLC** 

222 W, Merchandise Mart Plaza, Chicago, IL 60654 USA

#### 1.2. Manufacturer

**Motorola Mobility LLC** 

222 W, Merchandise Mart Plaza, Chicago, IL 60654 USA

## 1.3. Feature of Equipment Under Test

Product Feature							
Equipment	Mobile Phone						
Brand Name	Motorola						
Model Name	XT2227-1						
FCC ID	IHDT56AD5						
IMEI Code	Conducted: 351822900008394/351822900008402 Radiation: 351822900015373/351822900015581						
HW Version	DVT2						
SW Version	ROR31.77						
EUT Stage	Identical Prototype						

Report No.: FG1N3013C

**Remark:** The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

# 1.4. Product Specification of Equipment Under Test

Product Specification subjective to this standard							
Tx Frequency	814 ~ 824 MHz						
Rx Frequency	859 ~ 869 MHz						
Bandwidth	1.4MHz / 3MHz / 5MHz / 10MHz / 15MHz						
Maximum Output Power to Antenna	23.42 dBm						
Antenna Gain	-5.4 dBi						
Type of Modulation	QPSK / 16QAM / 64QAM						

### 1.5. Modification of EUT

No modifications are made to the EUT during all test items.

 Sporton International Inc. (Kunshan)
 Page Number
 : 5 of 23

 TEL: +86-512-57900158
 Report Issued Date
 : Feb. 10, 2022

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID : IHDT56AD5 Report Template No.: BU5-FWLTE Version 2.0

# 1.6. Maximum Conducted Power and Emission Designator

L	TE Band 26	QP	SK	16QAM/64QAM			
BW (MHz)	Frequency Range (MHz)	Maximum Conducted power (W)	Emission Designator (99%OBW)	Maximum Conducted power (W)	Emission Designator (99%OBW)		
15	821.5	0.2198	13M5G7D	0.1795	13M5W7D		

Report No.: FG1N3013C

Note: Based on engineering evaluation, only the maximum bandwidth and the worst modulation test results are shown in the report.

# 1.7. Testing Site

Sporton International Inc. (Kunshan) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

Test Firm	Sporton International Ir	Sporton International Inc. (Kunshan)						
	No. 1098, Pengxi North Road, Kunshan Economic Development Zone							
Test Site Location	Jiangsu Province 215300 People's Republic of China							
rest site Location	TEL: +86-512-57900158							
	FAX: +86-512-57900958							
	Sporton Site No.	FCC Designation No.	FCC Test Firm					
Test Site No.	Sporton Site No.	T CC Designation No.	Registration No.					
	03CH04-KS TH01-KS	CN1257	314309					

### 1.8. Test Software

Item Site		Manufacturer	Name	Version	
1.	03CH04-KS	AUDIX	E3	6.2009-8-24a	

 Sporton International Inc. (Kunshan)
 Page Number
 : 6 of 23

 TEL: +86-512-57900158
 Report Issued Date
 : Feb. 10, 2022

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID : IHDT56AD5 Report Template No.: BU5-FWLTE Version 2.0

# 1.9. Applied Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 2, 90(S)
- ANSI C63.26-2015
- FCC KDB 971168 D01 Power Meas. License Digital Systems v03r01
- FCC KDB 971168 D02 Misc Rev Approv License Devices v02r01

#### Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 7 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report Template No.: BU5-FWLTE Version 2.0

# 1.10. Specification of Accessory

Specification of Accessory							
AC Adapter 1(US)	Brand Name	Motorola(Chenyang)	Model Name	MC-101			
AC Adapter 1(EU)	Brand Name	Motorola(Chenyang)	Model Name	MC-102			
AC Adapter 1(UK)	Brand Name	Motorola(Chenyang)	Model Name	MC-103			
AC Adapter 1(IN)	Brand Name	Motorola(Chenyang)	Model Name	MC-104			
AC Adapter 1(AU)	Brand Name	Motorola(Chenyang)	Model Name	MC-105			
AC Adapter 1(AR)	Brand Name	Motorola(Chenyang)	Model Name	MC-106			
AC Adapter 1(PRC)	Brand Name	Motorola(Chenyang)	Model Name	MC-108			
AC Adapter 2(US)	Brand Name	Motorola(Aohai)	Model Name	MC-101			
AC Adapter 2(EU)	Brand Name	Motorola(Aohai)	Model Name	MC-102			
AC Adapter 2(UK)	Brand Name	Motorola(Aohai)	Model Name	MC-103			
AC Adapter 2(AU)	Brand Name	Motorola(Aohai)	Model Name	MC-105			
AC Adapter 2(AR)	Brand Name	Motorola(Aohai)	Model Name	MC-106			
AC Adapter 2(IN)	Brand Name	Motorola(Aohai)	Model Name	MC-104			
AC Adapter 3(US)	Brand Name	Motorola(Salcomp)	Model Name	MC-101			
AC Adapter 3(EU)	<b>Brand Name</b>	Motorola(Salcomp)	Model Name	MC-102			
AC Adapter 3(UK)	<b>Brand Name</b>	Motorola(Salcomp)	Model Name	MC-103			
AC Adapter 3(AU)	<b>Brand Name</b>	Motorola(Salcomp)	Model Name	MC-105			
AC Adapter 3(AR)	<b>Brand Name</b>	Motorola(Salcomp)	Model Name	MC-106			
AC Adapter 3(PRC)	<b>Brand Name</b>	Motorola(Salcomp)	Model Name	MC-108			
AC Adapter 3(Chile)	<b>Brand Name</b>	Motorola(Salcomp)	Model Name	MC-109			
AC Adapter 4(UK)	<b>Brand Name</b>	Lenovo(Chenyang)	Model Name	SC-43			
AC Adapter 5(EU)	Brand Name	Lenovo(Salom)	Model Name	SC-42			
Battery 1	<b>Brand Name</b>	Motorola(ATL)	Model Name	NH50			
Battery 2	Brand Name	Motorola(Sunwoda)	Model Name	NH50			
Earphone 1	Brand Name	Motorola( NEW LEADER )	Model Name	NLD-EM313A-23SF			
Earphone 2	Brand Name	Motorola( Ju wei)	Model Name	JWEP1185-ZN01H			
USB Cable 1	Brand Name	Motorola(Washin)	Model Name	HX-ZN-13			
USB Cable 2	<b>Brand Name</b>	Motorola( Ju wei)	Model Name	JWUB1498-ZN01H			

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 8 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report Template No.: BU5-FWLTE Version 2.0

# 2 Test Configuration of Equipment Under Test

## 2.1 Test Mode

During all testing, EUT is in link mode with base station emulator at maximum power level. The spurious emission measurements were carried out in semi-anechoic chamber with 3-meter test range, and EUT is rotated on three test planes to find out the worst emission.


Frequency range investigated for radiated emission is 30 MHz to 9000 MHz.

Tool Name	D d	Bandwidth (MHz)				Modulation		RB#			Test Channel					
Test Items	Band	1.4	3	5	10	15	20	QPSK	16QAM	64QAM	1	Half	Full	L	М	Н
Max. Output Power	26	٧	٧	v	v	٧	-	v	v	v	٧	v	v	٧	٧	v
26dB and 99% Bandwidth	26					>	•	v	v				v	٧		
Emission masks																
In-band emissions	26	V	V	v	v	V	-	v	v	V	V		V	٧		V
Emission masks -																
Out of band emissions	26	v	V	v	V	V	-	v			٧			V	V	V
Frequency Stability	26				v		-	v					v		v	
Radiated																
Spurious	26							Worst o	ase						٧	
Emission	Emission															
Note	2. Th 3. LT	The mark "v" means that this configuration is chosen for testing  The mark "-" means that this bandwidth is not supported.  LTE Band26 transmit frequency for part22 rule is 824MHz-849MHz, for part90 rule is 814MHz-824MHz. ERP over 15MHz bandwidth complies the ERP limit line of part22 rule, therefore ERP of the partial frequency spectrum which falls within part 22 also complies.														

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 9 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report Template No.: BU5-FWLTE Version 2.0

## 2.2 Connection Diagram of Test System

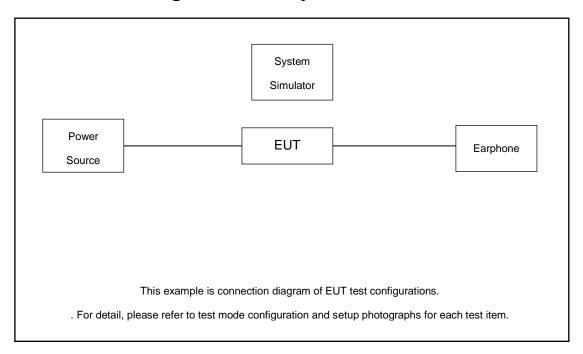

# 2.3 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model No.	FCC ID	Data Cable	Power Cord	
1.	System Simulator	Anritsu	MT8820C	N/A	N/A	Unshielded, 1.8 m	

# 2.4 Measurement Results Explanation Example

#### For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss between RF conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level will be exactly the RF output level.

The spectrum analyzer offset is derived from RF cable loss.

Offset = RF cable loss.

The following shows an offset computation example with RF cable loss 4.80 dB.

Example:

Offset(dB) = RF cable loss(dB).

= 4.80 (dB)

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 10 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# 2.5 Frequency List of Low/Middle/High Channels

LTE Band 26 Channel and Frequency List									
BW [MHz]	Channel/Frequency(MHz)	Lowest	Middle	Highest					
45	Channel	26765	-	-					
15	Frequency	821.5	-	-					
40	Channel	-	26740	-					
10	Frequency	-	819	-					
5	Channel	26715	26740	26765					
5	Frequency	816.5	819	821.5					
3	Channel	26705	26740	26775					
3	Frequency	815.5	819	822.5					
1 1	Channel	26697	26740	26783					
1.4	Frequency	814.7	819	823.3					

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 11 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

### 3 Test Result

## 3.1 Conducted Output Power Measurement

### 3.1.1 Description of the Conducted Output Power Measurement

A system simulator was used to establish communication with the EUT. Its parameters were set to enforce EUT transmitting at the maximum power. The measured power in the radio frequency on the transmitter output terminals shall be reported.


### 3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.1.3 Test Procedures

- 1. The transmitter output port was connected to the system simulator.
- 2. Set EUT at maximum power through the system simulator.
- 3. Select lowest, middle, and highest channels for each band and different modulation.
- 4. Measure and record the power level from the system simulator.

### 3.1.4 Test Setup

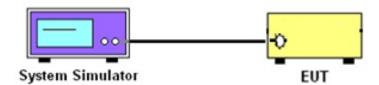

### 3.1.5 Test Result of Conducted Output Power

Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 12 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# 3.2 99% Occupied Bandwidth and 26dB Bandwidth Measurement

### 3.2.1 Description of (Occupied) Bandwidth Limitations Measurement

The 99% occupied bandwidth is the width of a frequency band such that, below the lower and above the upper frequency limits, the mean powers emitted are each equal to a specified percentage 0.5% of the total mean transmitted power.

The emission bandwidth is defined as the width of the signal between two points, located at the 2 sides of the carrier frequency, outside of which all emissions are attenuated at least 26 dB below the transmitter power.


### 3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.2.3 Test Procedures

- 1. The EUT was connected to spectrum analyzer and system simulator via a power divider.
- The 26dB and 99% occupied bandwidth (BW) of the middle channel for the highest RF power with full RB sizes were measured.

#### 3.2.4 Test Setup

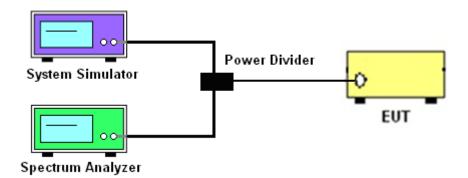

#### 3.2.5 Test Result of 99% Occupied Bandwidth and 26dB Bandwidth

Please refer to Appendix A.

Page Number : 13 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

### 3.3 Emissions Mask Measurement

### 3.3.1 Description of Emissions Mask Measurement

Equipment used in this licensed to EA or non-EA systems shall comply with the emission mask provisions of FCC Part 90.691.(a):

- (a) Out-of-band emission requirement shall apply only to the "outer" channels included in an EA license and to spectrum adjacent to interior channels used by incumbent licensees. The emission limits are as follows:
- (1) For any frequency removed from the EA licensee's frequency block by up to and including 37.5 kHz, the power of any emission shall be attenuated below the transmitter power (P) in watts by at least 116 Log<sub>10</sub>(f/6.1) decibels or 50 + 10 Log<sub>10</sub>(P) decibels or 80 decibels, whichever is the lesser attenuation, where f is the frequency removed from the center of the outer channel in the block in kilohertz and where f is greater than 12.5 kHz.
- (2) For any frequency removed from the EA licensee's frequency block greater than 37.5 kHz, the power of any emission shall be attenuated below the transmitter power (P) in watts by at least 43 + 10Log<sub>10</sub>(P) decibels or 80 decibels, whichever is the lesser attenuation, where f is the frequency removed from the center of the outer channel in the block in kilohertz and where f is greater than 37.5 kHz.


### 3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.3.3 Test Procedures

- 1. The EUT was connected to spectrum analyzer and base station via power divider.
- 2. The emissions mask of low and high channels for the highest RF powers were measured.
- The measured RBW and the VBW set 3 times of RBW are then set in spectrum analyzer, and the RBW correction factor 10log (1% of OBW/measured RBW)(dB) was compensated, if required.
- 4. The test results were shown below plots with a correction offset factor including cable loss, insertion loss of power divider.

## 3.3.4 Test Setup

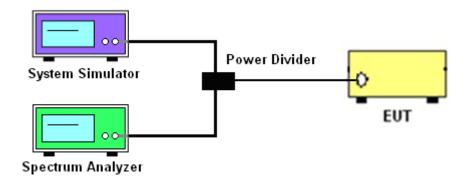

# 3.3.5 Test Result (Plots) of Conducted Emissions Mask

Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 15 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

### 3.4 Emissions Mask - Out Of Band Emissions Measurement

### 3.4.1 Description of Conducted Emissions Out of band emissions measurement

The power of any emission FCC Part 90.691 (a)(2) on any frequency removed from the assigned frequency by out of the authorized bandwidth at least 43 + 10 log (P) dB. It is measured by means of a calibrated spectrum analyzer and scanned from 30 MHz up to a frequency including its 10<sup>th</sup> harmonic.


### 3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.4.3 Test Procedures

- 1. The EUT was connected to spectrum analyzer and system simulator via a power divider.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
   The path loss was compensated to the results for each measurement.
- 3. The middle channel for the highest RF power within the transmitting frequency was measured.
- 4. The conducted spurious emission for the whole frequency range was taken.
- 5. Make the measurement with the spectrum analyzer's RBW = 1MHz, VBW = 3MHz, taking the record of maximum spurious emission.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.
- 7. The limit line is derived from 43 + 10log(P)dB below the transmitter power P(Watts)

## 3.4.4 Test Setup

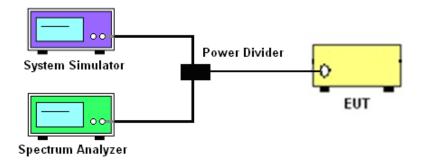

## 3.4.5 Test Result (Plots) of Conducted Emission

Please refer to Appendix A.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 16 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# 3.5 Field Strength of Spurious Radiation Measurement

### 3.5.1 Description of Field Strength of Spurious Radiated Measurement

The radiated spurious emission was measured by substitution method according to ANSI/TIA-603-E. The power of any emission FCC Part 90.691 on any frequency removed from the assigned frequency by more than 250 percent of the authorized bandwidth at least 43 + 10 log (P) dB. The spectrum is scanned from 30 MHz up to a frequency including its 10th harmonic.

The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitter power (P) by a factor of at least  $43+10\log_{10}(P[Watts])$  dB. The spectrum is scanned from 30 MHz up to a frequency including its 10th harmonic.

## 3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.5.3 Test Procedures


- The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the receiving antenna, which was mounted on the antenna tower.
- 3. The table was rotated 360 degrees to determine the position of the highest spurious emission.
- 4. The height of the receiving antenna is varied between one meter and four meters to search the maximum spurious emission for both horizontal and vertical polarizations.
- Make the measurement with the spectrum analyzer's RBW = 1MHz, VBW = 3MHz, Sweep = 500ms, Taking the record of maximum spurious emission.
- 6. A horn antenna was substituted in place of the EUT and was driven by a signal generator.
- 7. Tune the output power of signal generator to the same emission level with EUT maximum spurious emission.
- 8. Taking the record of output power at antenna port.
- 9. Repeat step 7 to step 8 for another polarization.
- 10. EIRP (dBm) = S.G. Power Tx Cable Loss + Tx Antenna Gain
- 11. ERP (dBm) = EIRP 2.15
- 12. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.
- 13. The limit line is derived from 43 + 10log(P) dB below the transmitter power P(Watts)

Page Number : 17 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01


Report No.: FG1N3013C

### 3.5.4 Test Setup

### For radiated test from 30MHz

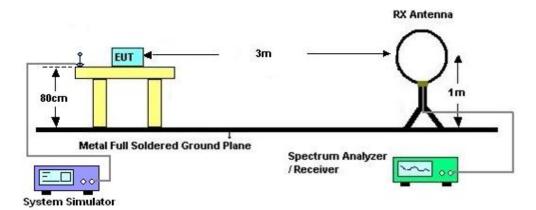

#### For radiated test from 30MHz to 1GHz

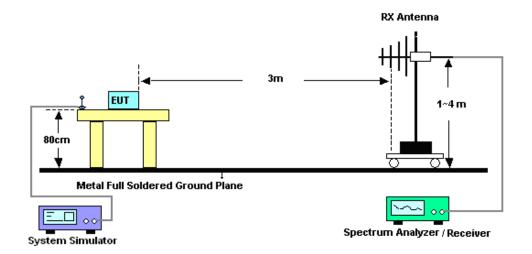


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5

Page Number : 18 of 23 Report Issued Date: Feb. 10, 2022 Report Version : Rev. 01

Report Template No.: BU5-FWLTE Version 2.0

#### For radiated test above 1GHz

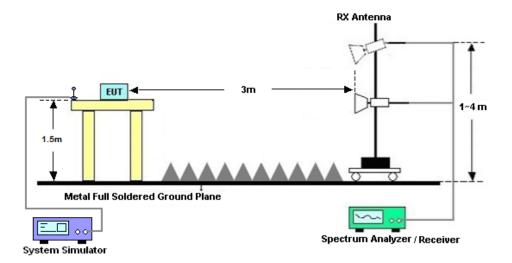

## 3.5.5 Test Result of Field Strength of Spurious Radiated

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

Please refer to Appendix B.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 19 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# 3.6 Frequency Stability Measurement

### 3.6.1 Description of Frequency Stability Measurement

The frequency stability shall be measured by variation of ambient temperature and variation of primary supply voltage to ensure that the fundamental emission stays within the authorized frequency block. The frequency stability of the transmitter shall be maintained within ±0.00025% (±2.5ppm) of the center frequency according to FCC Part 90.213.

### 3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

#### 3.6.3 Test Procedures for Temperature Variation

- 1. The EUT was set up in the thermal chamber and connected with the base station.
- With power OFF, the temperature was decreased to -30°C and the EUT was stabilized for three
  hours. Power was applied and the maximum change in frequency was recorded within one
  minute.
- 3. With power OFF, the temperature was raised in 10°C step up to 50°C. The EUT was stabilized at each step for at least half an hour. Power was applied and the maximum frequency change was recorded within one minute.


#### 3.6.4 Test Procedures for Voltage Variation

- 1. The EUT was placed in a temperature chamber at 20±5°C and connected with the system simulator.
- The power supply voltage to the EUT was varied from 85% to 115% of the nominal value for other than hand carried battery equipment.
- 3. For hand carried, battery powered equipment, reduce the primary ac or dc supply voltage to the
- 4. battery operating end point, which shall be specified by the manufacturer.
- 5. The variation in frequency was measured for the worst case.

Page Number : 20 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

## 3.6.5 Test Setup

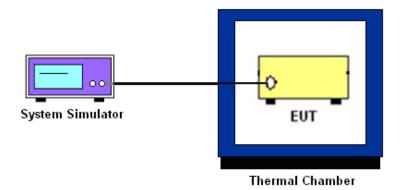

# 3.6.6 Test Result of Temperature Variation

Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 21 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# 4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101040	10Hz~40GHz	Oct. 14, 2021	Dec. 19, 2021~ Dec. 25, 2021	Oct. 13, 2022	Conducted (TH01-KS)
Power divider	STI	STI08-0055	-	0.5~40GHz	Aug. 26, 2021	Dec. 19, 2021~ Dec. 25, 2021	Aug. 25, 2022	Conducted (TH01-KS)
Temperature &hu midity chamber	Hongzhan	LP-150U	H201401144 0	-40~+150°C 20%~95%RH	Jul. 12, 2021	Dec. 19, 2021~ Dec. 25, 2021	Jul. 11, 2022	Conducted (TH01-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY55150244	10Hz-44G,MAX 30dB	Apr. 13, 2021	Jan. 07, 2022	Apr. 12, 2022	Radiation (03CH04-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Oct. 30, 2021	Jan. 07, 2022	Oct. 29, 2022	Radiation (03CH04-KS)
Bilog Antenna	TeseQ	CBL6111D	49922	30MHz-1GHz	May 30, 2021	Jan. 07, 2022	May 29, 2022	Radiation (03CH04-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	00218652	1GHz~18GHz	Apr. 25, 2021	Jan. 07, 2022	Apr. 24, 2022	Radiation (03CH04-KS)
SHF-EHF Horn	Com-power	AH-840	101115	18GHz~40GHz	Jan. 05, 2022	Jan. 07, 2022	Jan. 04, 2023	Radiation (03CH04-KS)
Amplifier	SONOMA	310N	187289	9KHz-1GHz	Jan. 05, 2022	Jan. 07, 2022	Jan. 04, 2023	Radiation (03CH04-KS)
Amplifier	MITEQ	EM18G40G GA	060728	18~40GHz	Jan. 05, 2022	Jan. 07, 2022	Jan. 04, 2023	Radiation (03CH04-KS)
high gain Amplifier	MITEQ	AMF-7D-00 101800-30- 10P	2025788	1Ghz-18Ghz	Jan. 05, 2022	Jan. 07, 2022	Jan. 04, 2023	Radiation (03CH04-KS)
Amplifier	Keysight	83017A	MY57280106	500MHz~26.5G Hz	Oct. 13, 2021	Jan. 07, 2022	Oct. 12, 2022	Radiation (03CH04-KS)
AC Power Source	Chroma	61601	F104090004	N/A	NCR	Jan. 07, 2022	NCR	Radiation (03CH04-KS)
Turn Table	ChamPro	EM 1000-T	060762-T	0~360 degree	NCR	Jan. 07, 2022	NCR	Radiation (03CH04-KS)
Antenna Mast	ChamPro	EM 1000-A	060762-A	1 m~4 m	NCR	Jan. 07, 2022	NCR	Radiation (03CH04-KS)

NCR: No Calibration Required.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 22 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report Template No.: BU5-FWLTE Version 2.0

# 5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.26-2015. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

#### <u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

	T
Measuring Uncertainty for a Level of	3.3dB
Confidence of 95% (U = 2Uc(y))	3.305

#### Uncertainty of Radiated Emission Measurement (1 GHz ~ 40 GHz)

Measuring Uncertainty for a Level of	2.8dB
Confidence of 95% (U = 2Uc(y))	2.000

----- THE END -----

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : 23 of 23
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

Report No.: FG1N3013C

# **Appendix A. Test Results of Conducted Test**

Test Engineer :	Alan He	Temperature :	21~24°C
rest Engineer.		Relative Humidity :	45~51%

# **Conducted Output Power (Average power)**

BW [MHz]	Modulation	RB Size	RB Offset	Power Low Ch. / Freq.	Power Middle Ch. / Freq.	Power High Ch. / Freq.
	Cha	nnel	26765			
	Frequen	cy (MHz)		821.5		
15	QPSK	1	0	23.38		
15	QPSK	1	37	23.42		
15	QPSK	1	74	23.36		
15	QPSK	36	0	22.59		
15	QPSK	36	20	22.36		
15	QPSK	36	39	22.52		
15	QPSK	75	0	22.44		
15	16QAM	1	0	22.54		
15	16QAM	1	37	22.32		
15	16QAM	1	74	22.34		
15	16QAM	36	0	21.36		
15	16QAM	36	20	21.27		
15	16QAM	36	39	21.47		
15	16QAM	75	0	21.37		
15	64QAM	1	0	21.51		
15	64QAM	1	37	21.46		
15	64QAM	1	74	21.44		
15	64QAM	36	0	20.52		
15	64QAM	36	20	20.33		
15	64QAM	36	39	20.51		
15	64QAM	75	0	20.41		
	Cha	nnel			26740	
	Frequen	cy (MHz)			819	
10	QPSK	1	0		23.23	
10	QPSK	1	25		23.05	
10	QPSK	1	49		23.14	
10	QPSK	25	0		22.56	
10	QPSK	25	12		22.54	
10	QPSK	25	25		22.20	
10	QPSK	50	0		22.54	
10	16QAM	1	0		22.53	
10	16QAM	1	25		22.20	
10	16QAM	1	49		22.54	

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A1 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01



10	16QAM	25	0		21.40	
10			-			
	16QAM	25	12		21.40	
10	16QAM	25	25 0		21.34	
10	16QAM 64QAM	50 1	0		21.31	
10	64QAM	1	25		21.12	
10	64QAM	1	49		21.12	
10	64QAM	25	0		20.36	
10	64QAM	25	12		20.24	
10	64QAM	25	25		20.43	
10	64QAM	50	0		20.23	
		innel		26715	26740	26765
	Freguen	cy (MHz)		816.5	819	821.5
5	QPSK	1	0	23.32	23.39	23.29
5	QPSK	1	12	23.27	23.29	23.12
5	QPSK	1	24	23.27	23.20	23.02
5	QPSK	12	0	22.35	22.55	22.45
5	QPSK	12	7	22.31	22.51	22.42
5	QPSK	12	13	22.34	22.38	22.22
5	QPSK	25	0	22.44	22.44	22.51
5	16QAM	1	0	22.31	22.68	22.42
5	16QAM	1	12	22.29	22.32	22.32
5	16QAM	1	24	22.21	22.44	22.31
5	16QAM	12	0	21.16	21.35	21.43
5	16QAM	12	7	21.24	21.29	21.08
5	16QAM	12	13	21.48	21.30	21.22
5	16QAM	25	0	21.41	21.32	21.30
5	64QAM	1	0	21.47	21.36	21.30
5	64QAM	1	12	21.21	21.23	21.50
5	64QAM	1	24	21.28	21.43	21.43
5	64QAM	12	0	20.30	20.47	20.21
5	64QAM	12	7	20.10	20.33	20.34
5	64QAM	12	13	20.40	20.49	20.32
5	64QAM	25	0	20.33	20.18	20.47
		ınnel		26705	26740	26775
	Frequen	cy (MHz)		815.5	819	822.5
3	QPSK	1	0	23.19	23.37	23.37
3	QPSK	1	8	23.34	23.28	23.26
3	QPSK	1	14	23.16	23.12	23.30
3	QPSK	8	0	22.58	22.52	22.48
3	QPSK	8	4	22.24	22.48	22.46
3	QPSK	8	7	22.47	22.30	22.40
3	QPSK	15	0	22.45	22.37	22.49
3	16QAM	1	0	22.37	22.60	22.51
3	16QAM	1	8	22.25	22.20	22.33
3	16QAM	1	14	22.21	22.54	22.40
3	16QAM	8	0	21.38	21.31	21.54

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A2 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01



FCC RF Test Report No. : FG1N3013C


3	16QAM	8	4	21.05	21.17	21.27
3	16QAM	8	7	21.23	21.42	21.30
3	16QAM	15	0	21.35	21.21	21.13
3	64QAM	1	0	21.38	21.27	21.42
3	64QAM	1	8	21.37	21.20	21.32
3	64QAM	1	14	21.29	21.51	21.43
3	64QAM	8	0	20.28	20.49	20.33
3	64QAM	8	4	20.14	20.27	20.18
3	64QAM	8	7	20.56	20.60	20.57
3	64QAM	15	0	20.42	20.34	20.40
	Cha	nnel		26697	26740	26783
	Frequen	cy (MHz)		814.7	819	823.3
1.4	QPSK	1	0	23.40	23.37	23.41
1.4	QPSK	1	3	23.35	23.13	23.07
1.4	QPSK	1	5	23.20	23.32	23.04
1.4	QPSK	3	0	23.23	23.42	23.39
1.4	QPSK	3	1	23.19	23.11	23.23
1.4	QPSK	3	3	23.40	23.07	23.28
1.4	QPSK	6	0	22.25	22.50	22.43
1.4	16QAM	1	0	22.40	22.57	22.35
1.4	16QAM	1	3	22.25	22.17	22.09
1.4	16QAM	1	5	22.32	22.42	22.46
1.4	16QAM	3	0	22.40	22.64	22.43
1.4	16QAM	3	1	22.31	22.26	22.24
1.4	16QAM	3	3	22.21	22.49	22.36
1.4	16QAM	6	0	21.40	21.29	21.17
1.4	64QAM	1	0	21.42	21.27	21.31
1.4	64QAM	1	3	21.48	21.29	21.50
1.4	64QAM	1	5	21.34	21.41	21.38
1.4	64QAM	3	0	21.51	21.47	21.39
1.4	64QAM	3	1	21.17	21.21	21.16
1.4	64QAM	3	3	21.34	21.35	21.43
1.4	64QAM	6	0	20.31	20.32	20.41

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A3 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

## LTE Band 26

# 26dB Bandwidth


Mode	LTE Band 26 : 26dB BW(MHz)		
BW	15MHz		
Mod.	QPSK 16QAM		
Low CH	14.57 14.81		

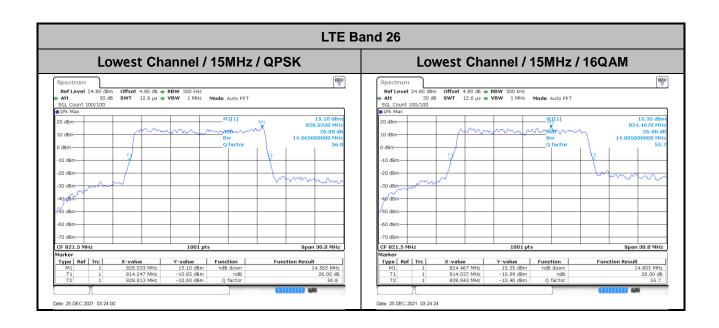

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A4 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01


# **Occupied Bandwidth**

Mode	LTE Band 26 : 99%OBW(MHz)		
BW	15MHz		
Mod.	QPSK 16QAM		
Low CH	13.49 13.52		

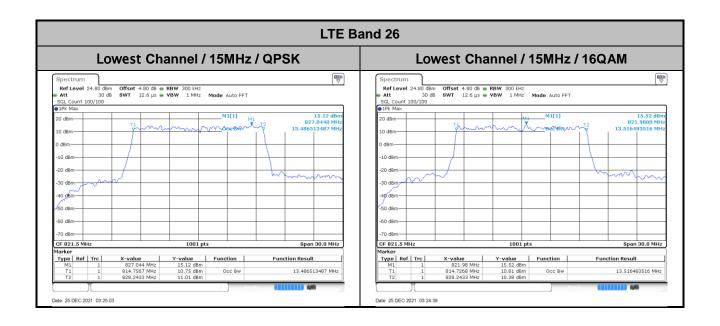


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A5 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

# **Conducted Band Edge**

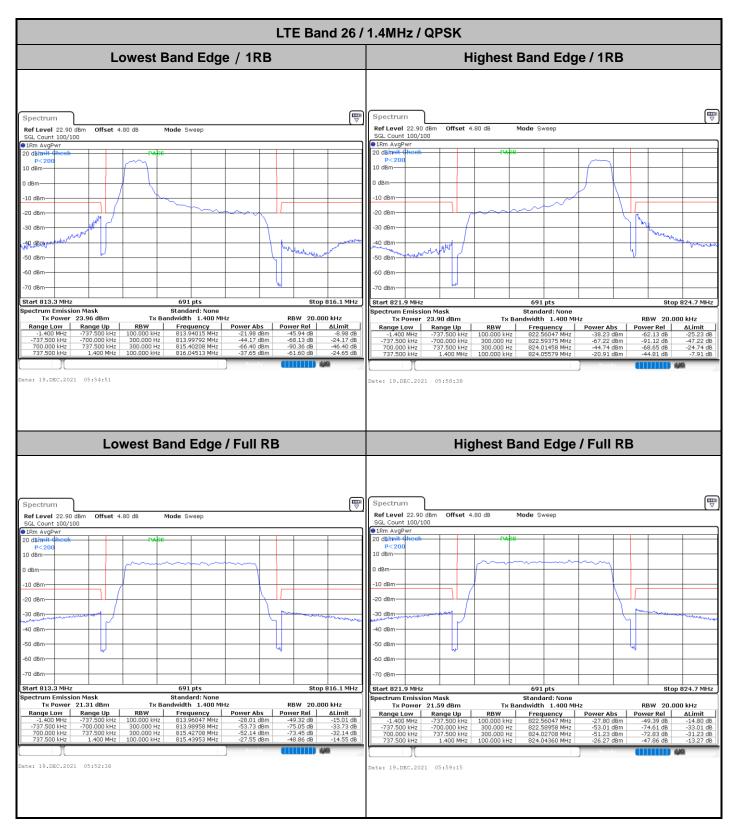


Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A6 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

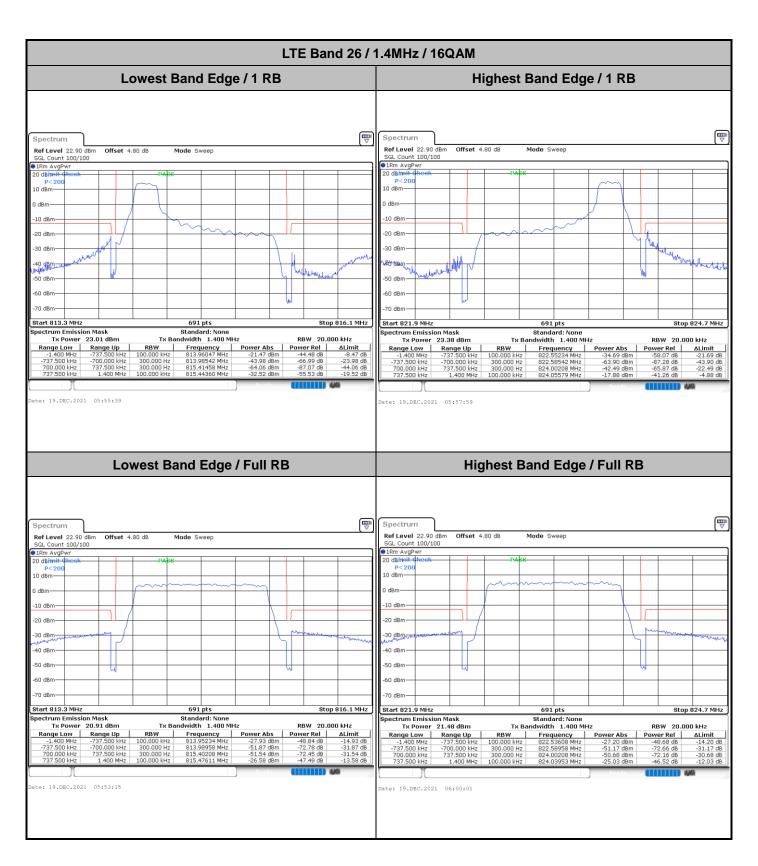


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A7 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

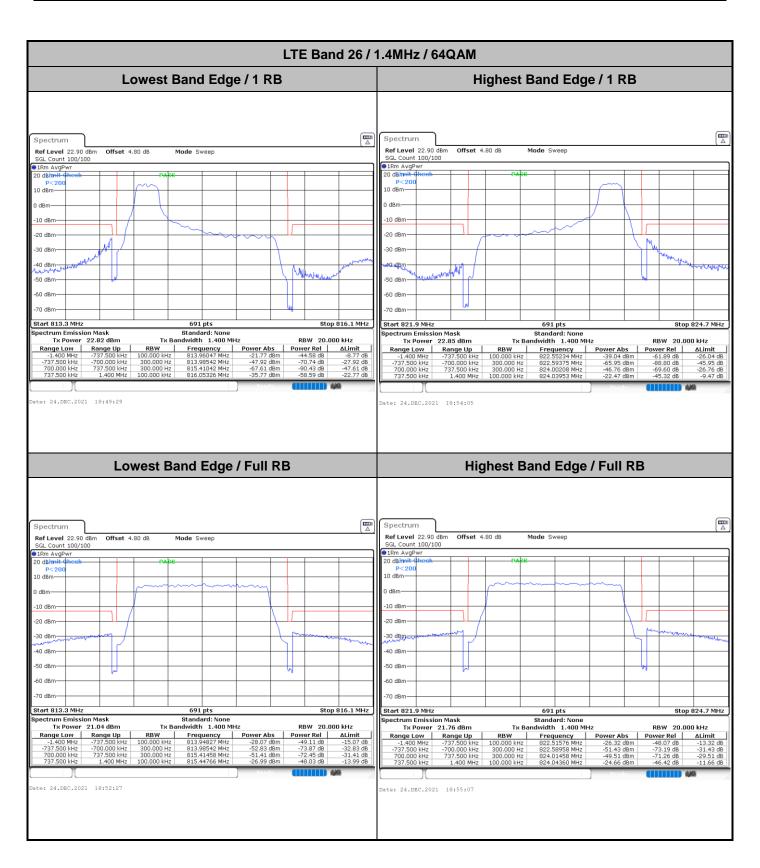


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A8 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

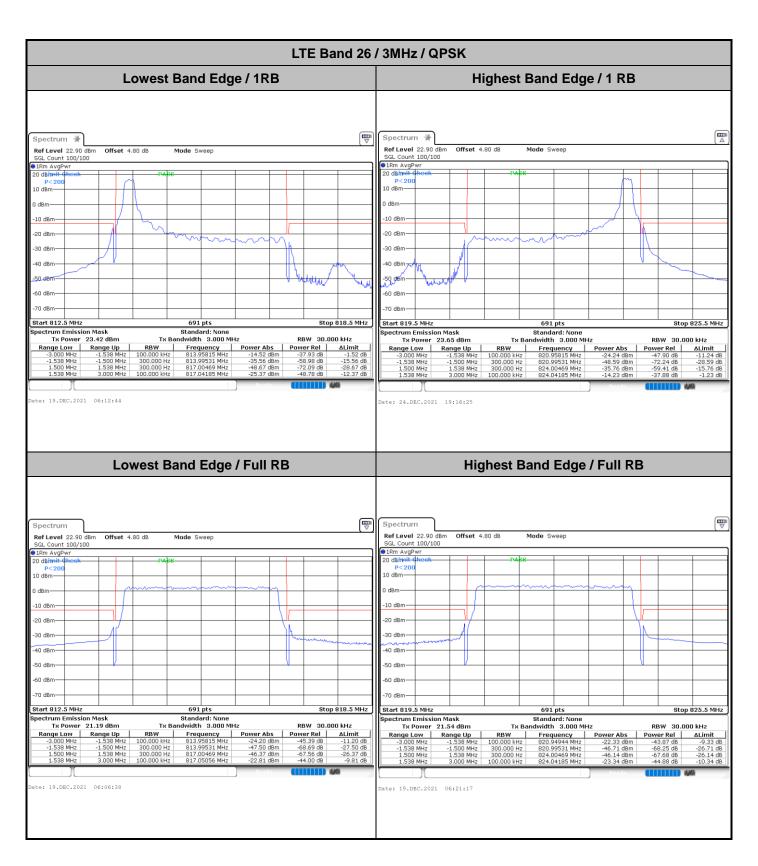


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A9 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

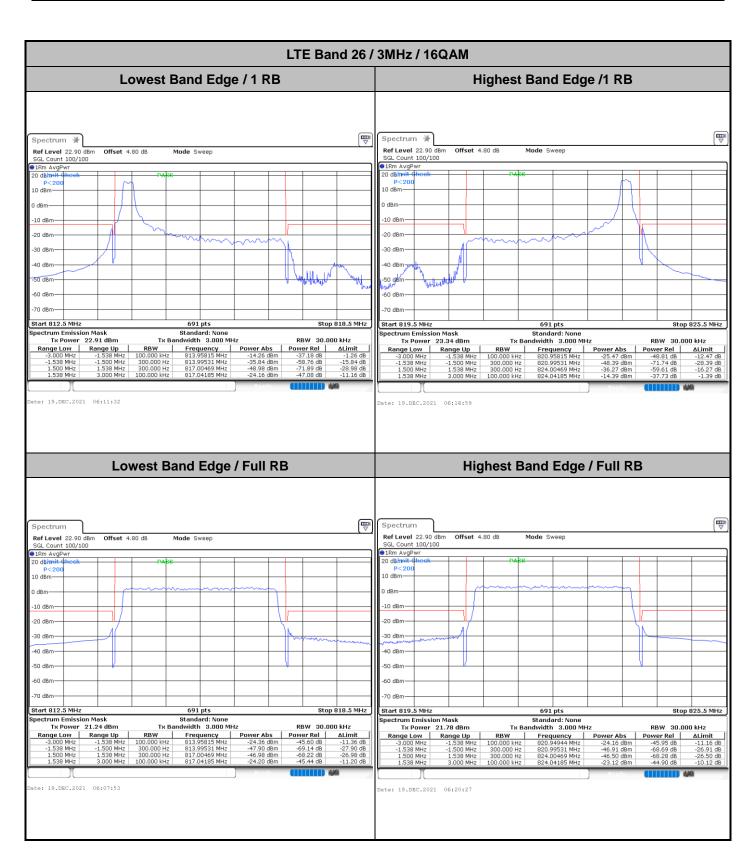


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A10 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

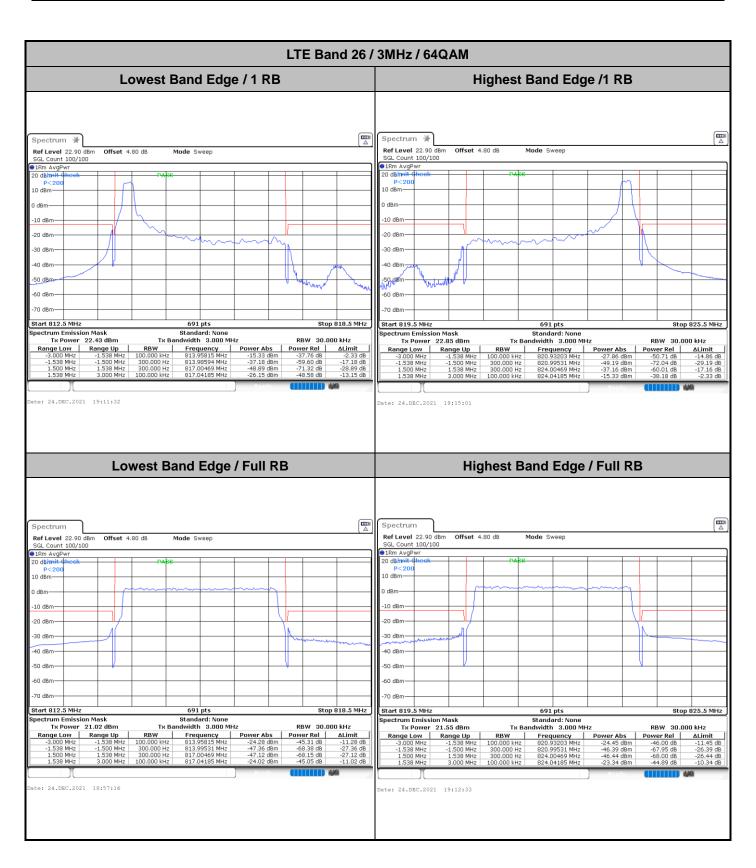


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A11 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

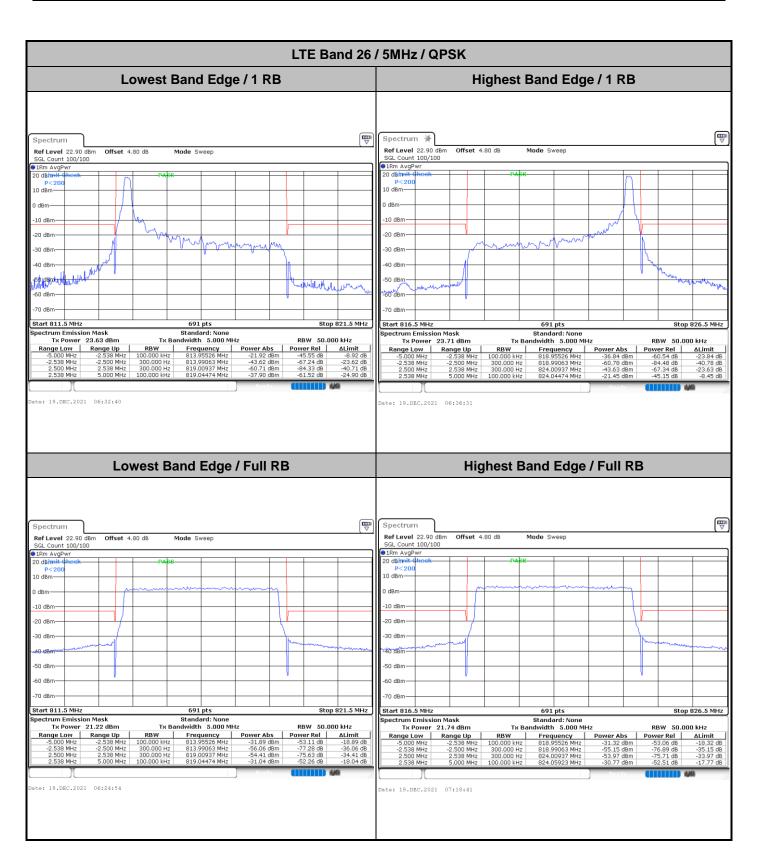


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A12 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

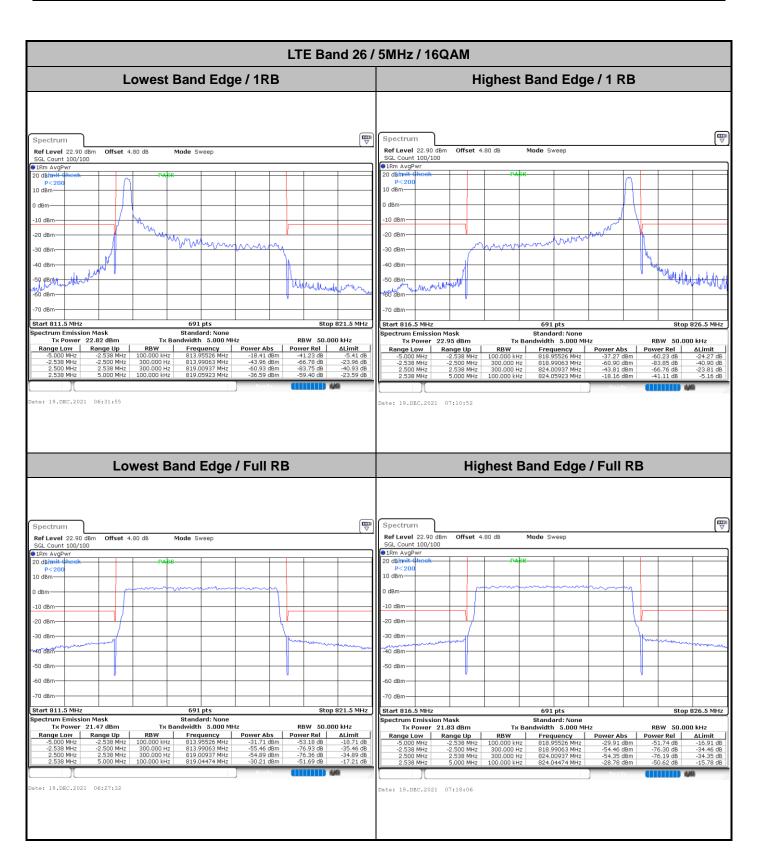


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A13 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

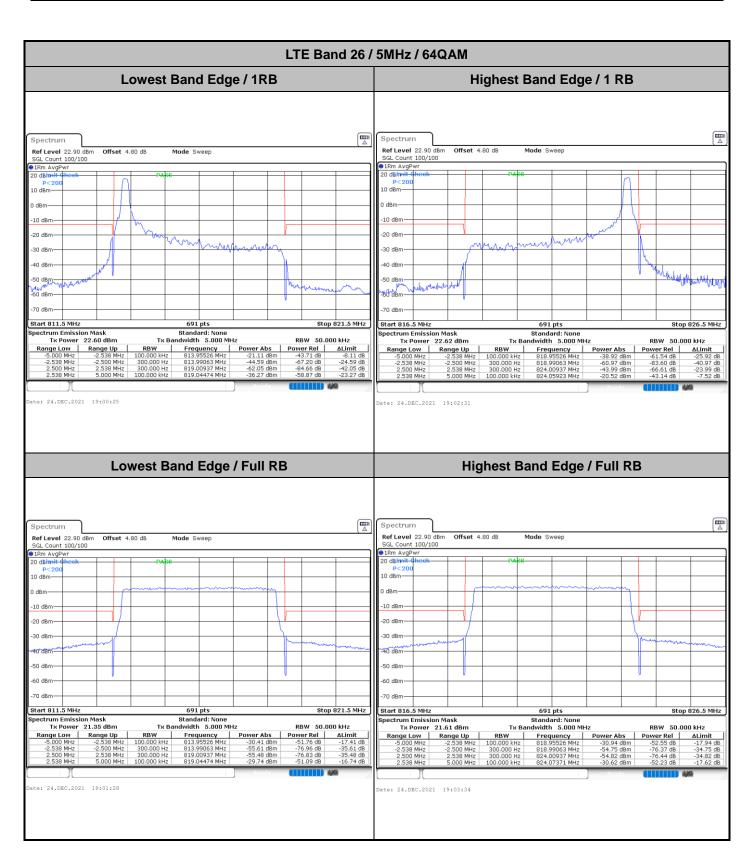


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A14 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

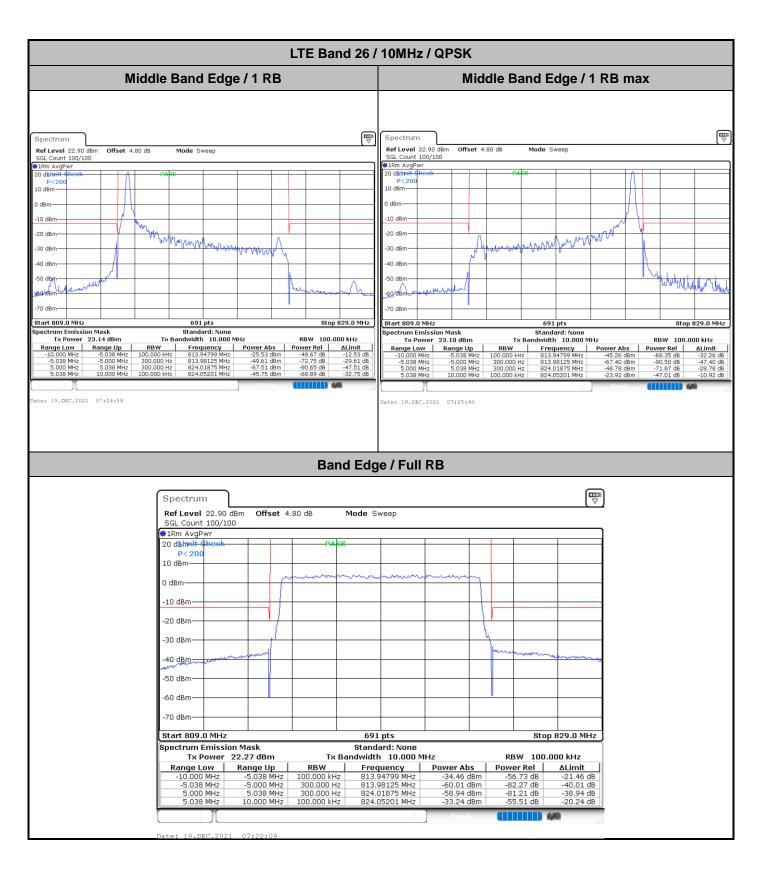


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A15 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

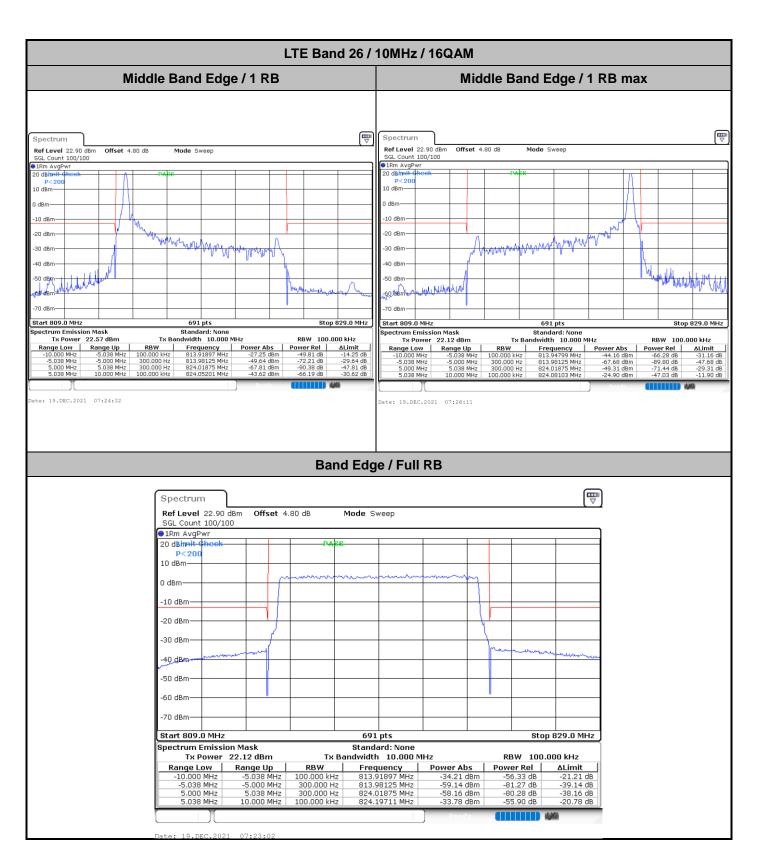


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A16 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

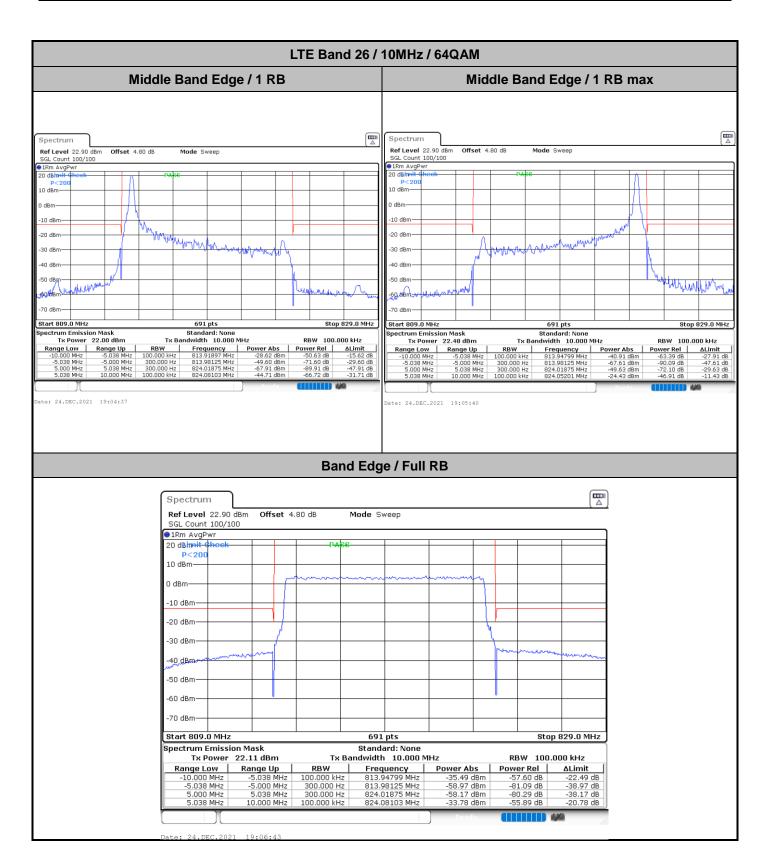


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A17 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

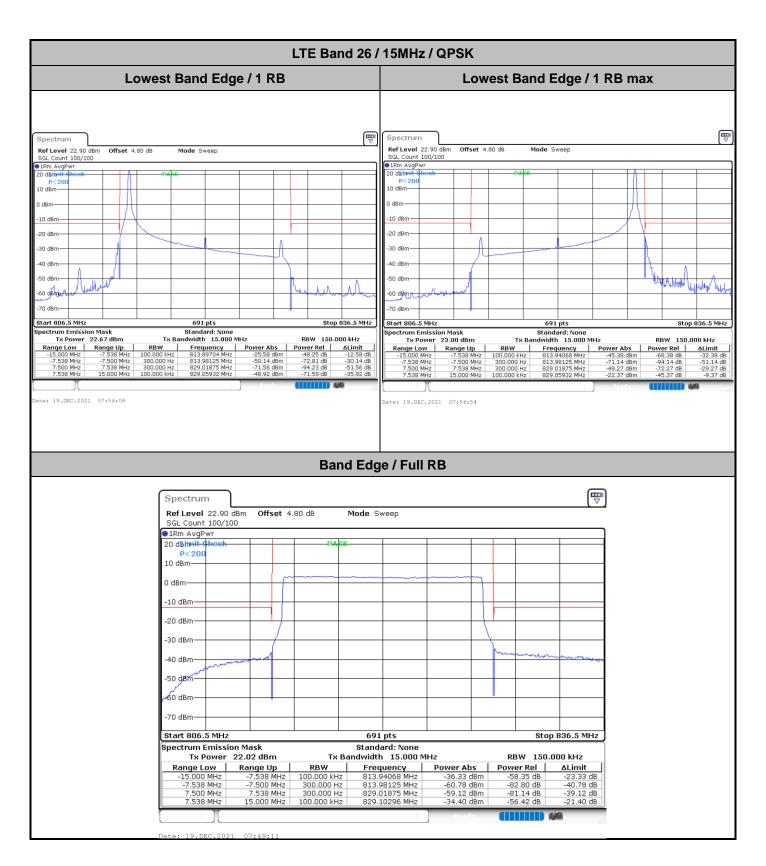

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A18 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

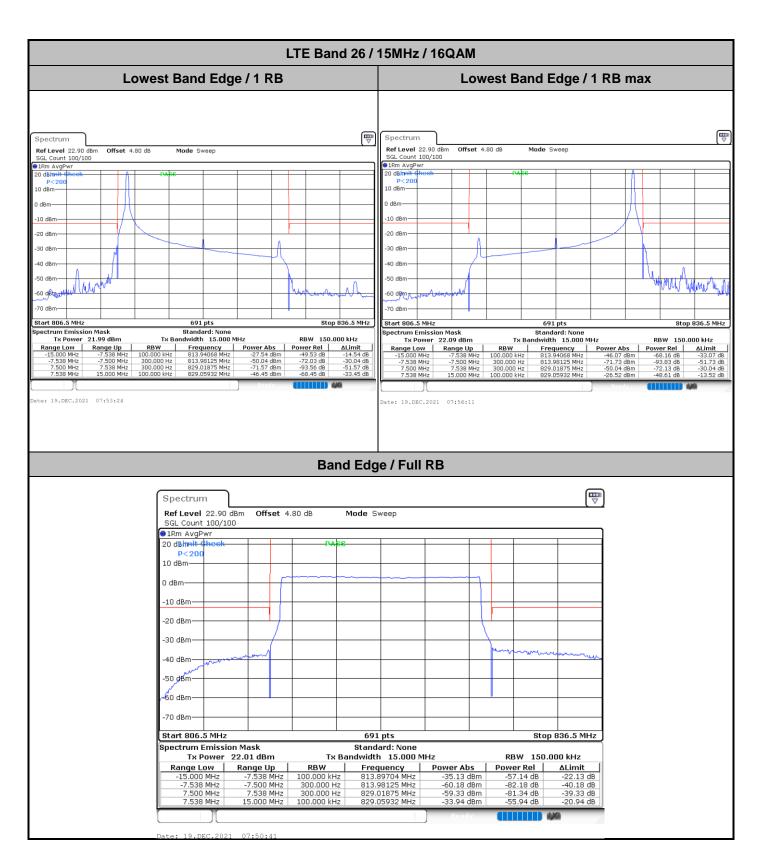

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A19 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

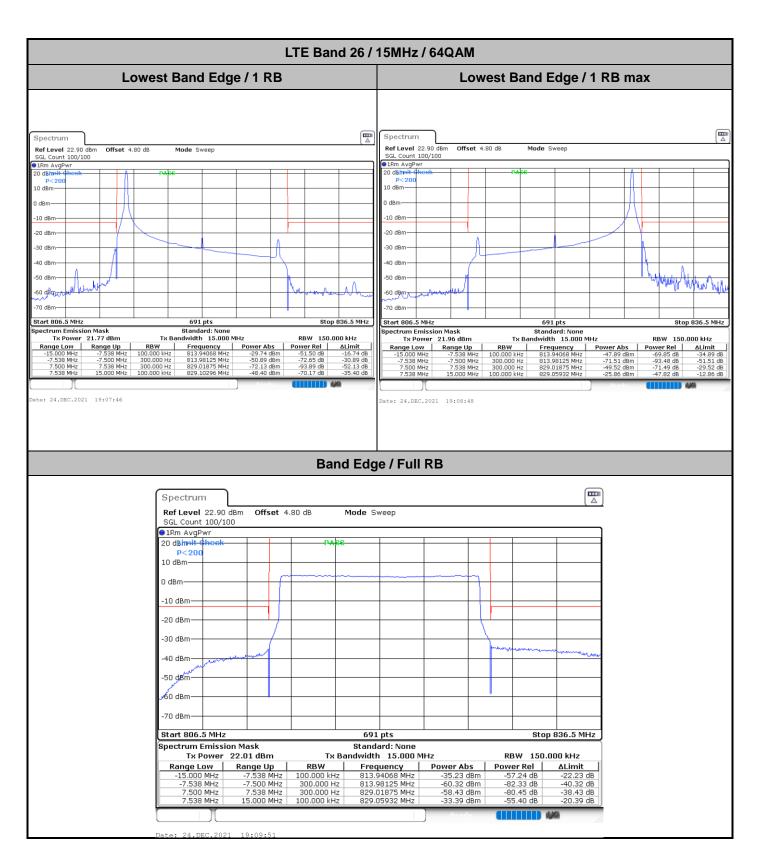


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A20 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

## **Conducted Spurious Emission**



Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A21 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

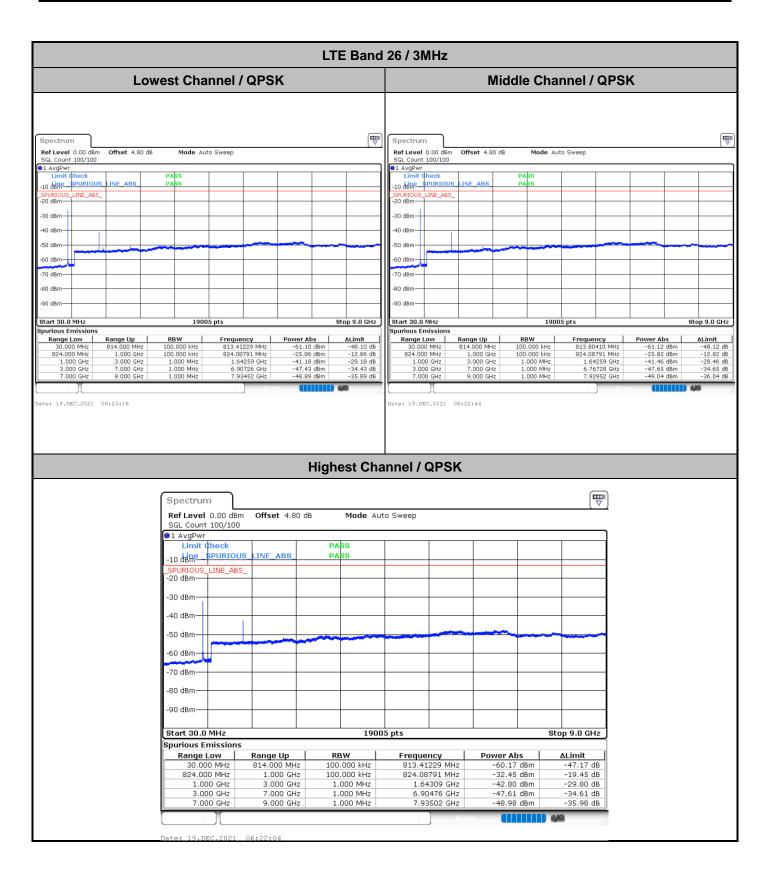

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A22 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01



TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A23 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

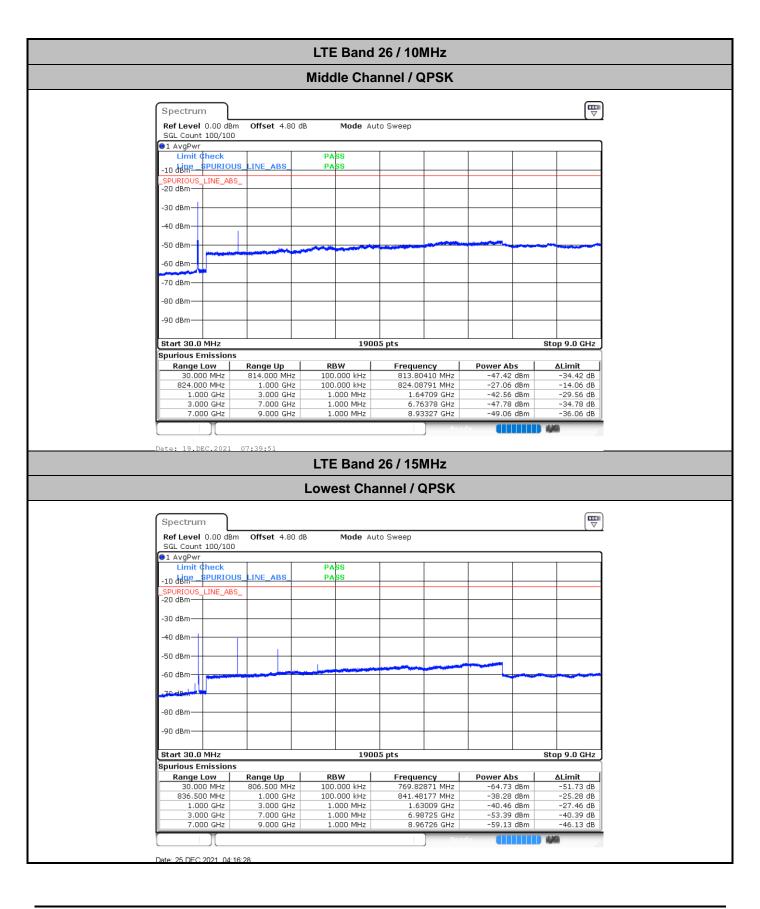

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : A24 of A25
Report Issued Date : Feb. 10, 2022
Report Version : Rev. 01

## Frequency Stability

Test Conditions		LTE Band 26 (QPSK) / Middle Channel		
Temperature (°C)		BW 10MHz		
	Voltage (Volt)	Deviation (ppm)	Result	
50	Normal Voltage	0.0006		
40	Normal Voltage	0.0008		
30	Normal Voltage	0.0015		
20(Ref.)	Normal Voltage	0.0000		
10	Normal Voltage	0.0023		
0	Normal Voltage	0.0016		
-10	Normal Voltage	0.0007	PASS	
-20	Normal Voltage	0.0013		
-30	Normal Voltage	0.0022		
20	Maximum Voltage	0.0025		
20	Normal Voltage	0.0000		
20	Battery End Point	0.0027		

Note: Normal Voltage =3.87 V.; Battery End Point (BEP) =3.6 V.; Maximum Voltage =4.45 V.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5

Page Number : A25 of A25 Report Issued Date: Feb. 10, 2022

Report No.: FG1N3013C

Report Version : Rev. 01

## **Appendix B. Test Results of Radiated Test**

## **Radiated Spurious Emission**

Test Engineer :	Chris Chen	Temperature :	22~23°C
rest Engineer.	Cillis Cileii	Relative Humidity :	41~42%

LTE Band 26 / 10MHz / QPSK / RB Size 1 Offset 0										
Channel	Frequency (MHz)	ERP (dBm)	Limit ( dBm )	Over Limit ( dB )	S.G. Power ( dBm )	TX Cable loss ( dB )	TX Antenna Gain (dBi)	Polarization (H/V)		
Middle	1632	-64.70	-13	-51.70	-71.67	1.58	10.70	Н		
	2440	-59.10	-13	-46.10	-67.35	2.102	12.50	Н		
	3256	-57.87	-13	-44.87	-66.76	2.856	13.90	Н		
	1632	-63.00	-13	-50.00	-69.97	1.58	10.70	V		
	2440	-57.63	-13	-44.63	-65.88	2.10	12.50	V		
	3256	-57.79	-13	-44.79	-66.68	2.86	13.90	V		

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AD5 Page Number : B1 of B1
Report Issued Date : Feb. 10, 2022

Report No.: FG1N3013C

Report Version : Rev. 01