FCC RF Test Report

Report No.: FR1D1023A

Cert #5145.02

Page Number

Report Version

: 1 of 59

: Rev. 01

Report Issued Date: Feb. 18, 2022

Report Template No.: BU5-FR15CBT Version 2.0

APPLICANT : Motorola Mobility LLC EQUIPMENT : Mobile Cellular Phone

BRAND NAME : Motorola

MODEL NAME : XT2221-1

FCC ID : IHDT56AE1

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

TEST DATE(S) : Jan. 18, 2022 ~ Feb. 14, 2022

We, Sporton International Inc. (Kunshan), would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Kunshan), the test report shall not be reproduced except in full.

Reviewed by: Jason Jia / Supervisor

JasonJia

Approved by: Alex Wang / Manager

Sporton International Inc. (Kunshan)

No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300 People's Republic of China

TABLE OF CONTENTS

RE	VISIO	N HISTORY	3
SU	MMAR	RY OF TEST RESULT	4
1	GENI	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Product Specification of Equipment Under Test	5
	1.5	Modification of EUT	6
	1.6	Specification of Accessory	6
	1.7	Testing Location	7
	1.8	Test Software	7
	1.9	Applicable Standards	7
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	8
	2.1	Carrier Frequency Channel	8
	2.2	Test Mode	9
	2.3	Connection Diagram of Test System	10
	2.4	Support Unit used in test configuration and system	11
	2.5	EUT Operation Test Setup	11
	2.6	Measurement Results Explanation Example	11
3	TEST	「 RESULT	12
	3.1	Number of Channel Measurement	12
	3.2	Hopping Channel Separation Measurement	14
	3.3	Dwell Time Measurement	20
	3.4	20dB and 99% Bandwidth Measurement	22
	3.5	Output Power Measurement	33
	3.6	Conducted Band Edges Measurement	34
	3.7	Conducted Spurious Emission Measurement	41
	3.8	Radiated Band Edges and Spurious Emission Measurement	51
	3.9	AC Conducted Emission Measurement	55
	3.10	Antenna Requirements	57
4	LIST	OF MEASURING EQUIPMENT	58
5	UNC	ERTAINTY OF EVALUATION	59
ΑP	PEND	IX A. CONDUCTED TEST RESULTS	
ΑP	PEND	IX B. AC CONDUCTED EMISSION TEST RESULT	
ΑP	PEND	IX C. RADIATED SPURIOUS EMISSION	
ΑP	PEND	IX D. DUTY CYCLE PLOTS	
ΔÞ	PEND	IX E SETUD PHOTOGRAPHS	

Report No.: FR1D1023A

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR1D1023A	Rev. 01	Initial issue of report	Feb. 18, 2022

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 3 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR1D1023A

SUMMARY OF TEST RESULT

Report Section	FCC Rule Description		Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	-	Report only	-
3.4	-	99% Bandwidth	-	Report only	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	3.7 Conducted Spurious Emission		≤ 20dBc	Pass	-
3.8	15.247(d)	Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 11.75 dB at 2483.500 MHz
3.9 15.207 AC Conducted Emission		15.207(a)	Pass	Under limit 10.57 dB at 0.186 MHz	
3.10	15.203 & 15.247(b)	Antenna Requirement	15.203 & 15.247(b)	Pass	-

Declaration of Conformity:

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

Comments and Explanations:

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 4 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

1 General Description

1.1 Applicant

Motorola Mobility LLC

222 W, Merchandise Mart Plaza, Chicago IL 60654 USA

1.2 Manufacturer

Motorola Mobility LLC

222 W, Merchandise Mart Plaza, Chicago IL 60654 USA

1.3 Product Feature of Equipment Under Test

Product Feature					
Equipment	Mobile Cellular Phone				
Brand Name	Motorola				
Model Name	XT2221-1				
IMEI Code	Conducted:358026320083036/358026320083044 Conduction:358026320007456/358026320007464				
FCC ID	Radiation:358026320082772/358026320082780 IHDT56AE1				
HW Version	DVT2				
SW Version	S1SR32.16				
EUT Stage	Identical Prototype				

Remark: The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

1.4 Product Specification of Equipment Under Test

Standards-related Product Specification				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	Bluetooth BR(1Mbps) : 13.29 dBm (0.0213 W) Bluetooth EDR (2Mbps) : 12.06 dBm (0.0161 W) Bluetooth EDR (3Mbps) : 12.31 dBm (0.0170 W)			
99% Occupied Bandwidth	Bluetooth BR(1Mbps) : 0.865MHz Bluetooth EDR (2Mbps) : 1.166MHz Bluetooth EDR (3Mbps) : 1.155MHz			
Antenna Type / Gain	PIFA Antenna type with gain -3.50 dBi			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) :π/4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 5 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

1.5 Modification of EUT

No modifications are made to the EUT during all test items.

1.6 Specification of Accessory

Specification of Accessory						
AC Adapter 1(US)	Brand Name	Motorola (Salcomp)	Model Name	MC-331		
AC Adapter 1(EU)	Brand Name	Motorola (Salcomp)	Model Name	MC-332		
AC Adapter 1(UK)	Brand Name	Motorola (Salcomp)	Model Name	MC-333		
AC Adapter 1(IN)	Brand Name	Motorola (Salcomp)	Model Name	MC-334		
AC Adapter 1(AU)	Brand Name	Motorola (Salcomp)	Model Name	MC-335		
AC Adapter 1(AR)	Brand Name	Motorola (Salcomp)	Model Name	MC-336		
AC Adapter 1(BR)	Brand Name	Motorola (Salcomp)	Model Name	MC-337		
AC Adapter 1(CHILE)	Brand Name	Motorola (Salcomp)	Model Name	MC-339		
AC Adapter 2(US)	Brand Name	Motorola (Acbel)	Model Name	MC-331		
AC Adapter 2(EU)	Brand Name	Motorola (Acbel)	Model Name	MC-332		
AC Adapter 2(UK)	Brand Name	Motorola (Acbel)	Model Name	MC-333		
AC Adapter 3(US)	Brand Name	Motorola (Aohai)	Model Name	MC-331		
AC Adapter 3(EU)	Brand Name	Motorola (Aohai)	Model Name	MC-332		
AC Adapter 3(UK)	Brand Name	Motorola (Aohai)	Model Name	MC-333		
Battery	Brand Name	Motorola (Sunwoda)	Model Name	NE50		
Earphone 1	Brand Name	Motorola (NEW LEADER)	Model Name	NLD-EM313A-09SF		
Earphone 2	Brand Name	Motorola (NEW LEADER)	Model Name	NLD-EM313A-19SF		
Earphone 3	Brand Name	Motorola(LYAND ACOUSTIC)	Model Name	LYM239-76C-006		
Earphone 4	Brand Name	Motorola(LYAND ACOUSTIC)	Model Name	LYM528-76C-001		
USB Cable 1	Brand Name	Motorola(Salbao)	Model Name	SHQ-A110A		
USB Cable 2	Brand Name	Motorola(Chuantuo)	Model Name	K235		

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 6 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

1.7 Testing Location

Sporton International Inc. (Kunshan) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

Test Firm	Sporton International Inc. (Kunshan)					
	No. 1098, Pengxi North	n Road, Kunshan Econom	ic Development Zone			
Toot Site Leastion	Jiangsu Province 2153	00 People's Republic of C	hina			
Test Site Location	TEL: +86-512-57900158					
	FAX: +86-512-57900958					
	Sporton Site No.	FCC Designation No.	FCC Test Firm			
Test Site No.	Sporton Site No.	rcc Designation No.	Registration No.			
rest site NO.	CO01-KS 03CH04-KS TH01-KS	CN1257	314309			

1.8 Test Software

Item	Site	Manufacturer	Name	Version
1.	03CH04-KS	AUDIX	E3	6.2009-8-24a
2.	CO01-KS	AUDIX	E3	6.2009-8-24

1.9 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International Inc. (Kunshan)
TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 7 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 8 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Z plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 1Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases							
	Data Rate / Modulation							
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps					
	GFSK	π/4-DQPSK	8-DPSK					
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz					
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz					
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz					
		Bluetooth BR 1Mbps GFSK						
Radiated	Mode 1: CH00_2402 MHz							
Test Cases	Mode 2: CH39_2441 MHz							
		Mode 3: CH78_2480 MHz						
AC								
Conducted		uetooth Link + WLAN Link (2.4	+G) + USB Cable 1(Charging					
Emission	from Adapter1) + Earphone 1							

Remark:

- 1. For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. All test modes of the Radiated Spurious Emission (RSE) were teste; only the test worse data in bold of these modes were reported.
- 3. For Radiated Test Cases, The tests were performed with Adapter 1, Earphone 1 and USB Cable 1.


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 9 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

2.3 Connection Diagram of Test System

For Conduction:

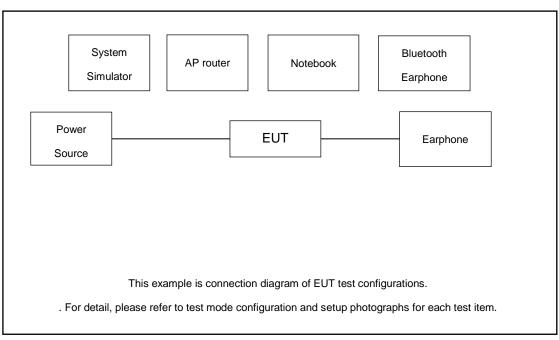

For Radiation:

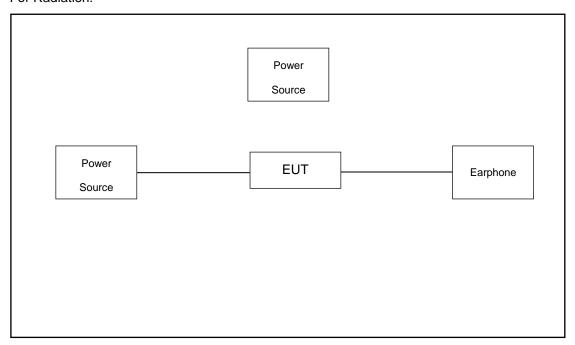

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 10 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	Base Station	Anritsu	MT8821C	N/A	N/A	Unshielded,1.8m
2.	WLAN AP	D-link	DIR-655	KA21R655B1	N/A	Unshielded,1.8m
3.	Notebook	Lenovo	G480	QDS-BRCM1050I	N/A	shielded cable DC O/P 1.8m, Unshielded AC I/P cable 1.8m
4.	Bluetooth Earphone	Lenovo	LBH308	N/A	N/A	N/A
5.	Bluetooth Base Station	R&S	CBT	N/A	N/A	Unshielded,1.8m

2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit.

For AC power line conducted emissions, the EUT was set to connect with the WLAN AP under large package sizes transmission.

2.6 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss.

Offset = RF cable loss

Following shows an offset computation example with cable loss 5.8 dB.

 $Offset(dB) = RF \ cable \ loss(dB) \ .$

= 5.8 (dB)

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 11 of 59
Report Issued Date : Feb. 18, 2022

Report No.: FR1D1023A

Report Version : Rev. 01

3 Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.


3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup

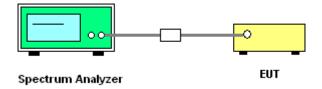

Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 12 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.1.5 Test Result of Number of Hopping Frequency


Please refer to Appendix A.

Number of Hopping Channel Plot on Channel 00 - 78

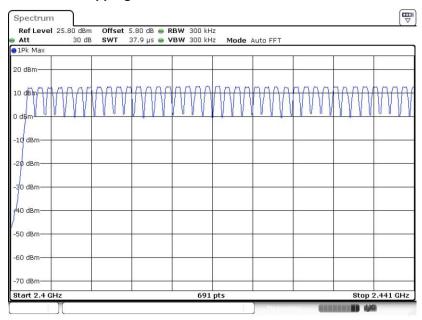

Date: 11.FEB.2022 04:30:27

Number of Hopping Channel Plot on Channel 00 - 78

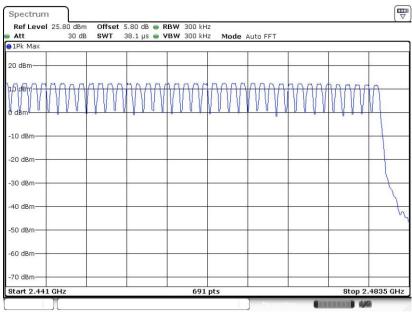

Date: 11.FEB.2022 04:31:00

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 13 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.


3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings:Span = wide enough to capture the peaks of two adjacent channels;
 - RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.2.4 Test Setup



Sporton International Inc. (Kunshan)
TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 14 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

3.2.5 Test Result of Hopping Channel Separation

Please refer to Appendix A.


<1Mbps>

Channel Separation Plot on Channel 00 - 01

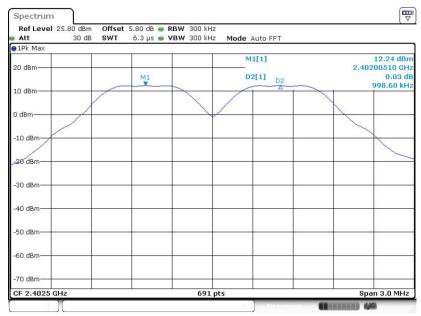

Date: 11.FEB.2022 04:21:20

Channel Separation Plot on Channel 39 - 40

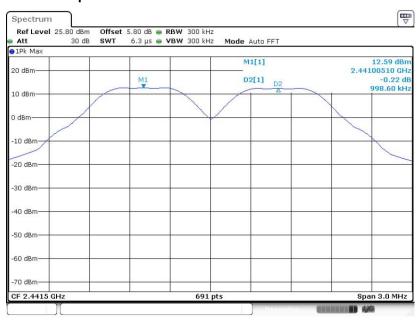


Date: 11.FEB.2022 04:27:04

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 15 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


Channel Separation Plot on Channel 77 - 78

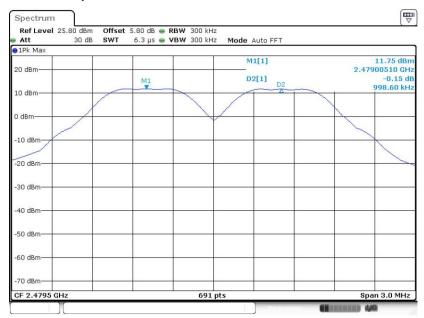

Date: 11.FEB.2022 04:33:37

<2Mbps>

Channel Separation Plot on Channel 00 - 01

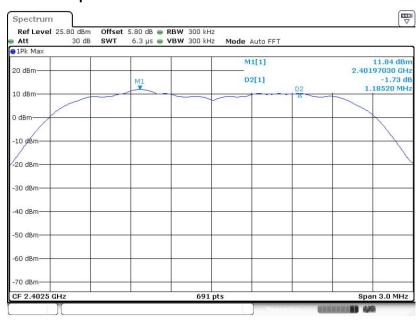


Date: 11.FEB.2022 04:52:00

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 16 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

Channel Separation Plot on Channel 39 - 40

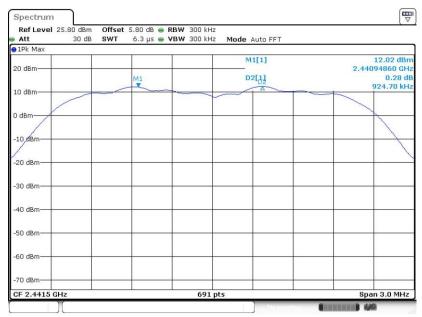

Date: 11.FEB.2022 05:03:23

Channel Separation Plot on Channel 77 - 78

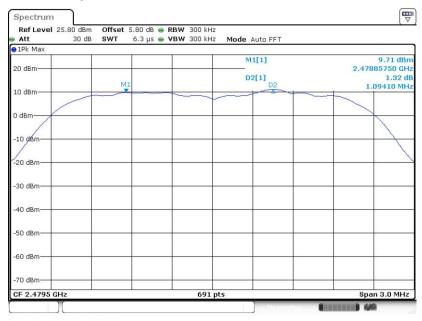

Date: 11.FEB.2022 05:10:07


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 17 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


<3Mbps>

Channel Separation Plot on Channel 00 - 01

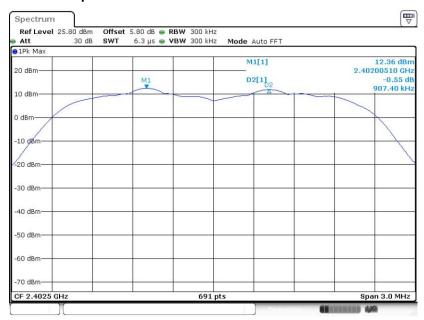

Date: 11.FEB.2022 05:22:08

Channel Separation Plot on Channel 39 - 40

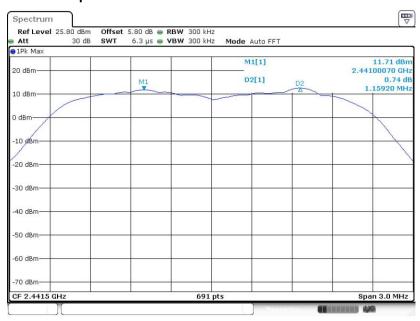


Date: 11.FEB.2022 05:36:27

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 18 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

Channel Separation Plot on Channel 77 - 78

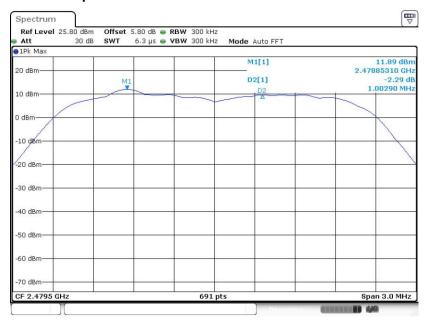

Date: 11.FEB.2022 05:40:55

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 19 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.


3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup



TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 20 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.3.5 Test Result of Dwell Time

Please refer to Appendix A.

Package Transfer Time Plot Spectrum Ref Level 37 Offset 7.00 dB • RBW 1 MHz Att 40 dB 👄 SWT 10 ms 🁄 **VBW** 1 MHz ●1Pk Max D3[1] 0.01 d 30 dBm M1[1] 14.08 dBr 20.dBm 376.8 μ 10 dBm -10 dBm -20 dBm -30 dBm Muhalp ±40 dBπ -50 dBm -60 dBm CF 2.441 GHz 1.0 ms/ Marker Type Ref Trc **value** 376.8 μs 2.8986 ms Y-value 14.08 dBm 0.07 dB -0.01 dB **Function Result** М1 3.7478 ms

Date: 18.JAN.2022 19:43:43

Remark:

In normal mode, hopping rate is 1600 hops/s with 6 slots (5 Transmit and 1 Receive slot)
 in 79 hopping channels.

With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4×79) (s), Hops Over Occupancy Time comes to $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$ hops.

- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels.
 With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4 x 20) (s),
 Hops Over Occupancy Time comes to (800 / 6 / 20) x (0.4 x 20) = 53.33 hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 21 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Pay 01

Report No.: FR1D1023A

Report Version : Rev. 01

3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.

Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;

The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = peak;

Trace = max hold.

5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.

Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;


The RBW is set to 1% to 5% of the 99% OBW, the VBW is set to 3 times the RBW;

Sweep = auto; Detector function = sample;

Trace = max hold.

6. Measure and record the results in the test report.

3.4.4 Test Setup



Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 22 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

3.4.5 Test Result of 20dB Bandwidth

Please refer to Appendix A.

<1Mbps>

20 dB Bandwidth Plot on Channel 00

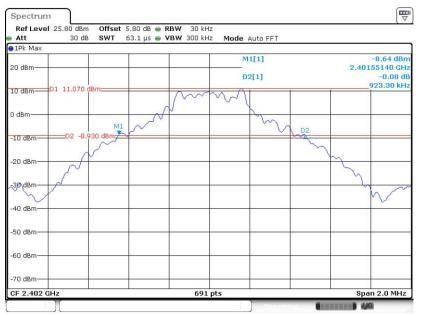

Date: 11.FEB.2022 04:18:40


20 dB Bandwidth Plot on Channel 39



Date: 11.FEB.2022 04:26:04

Report No.: FR1D1023A


20 dB Bandwidth Plot on Channel 78

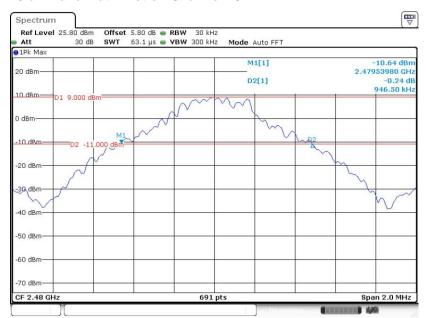

Date: 11.FEB.2022 04:32:24

<2Mbps>

20 dB Bandwidth Plot on Channel 00

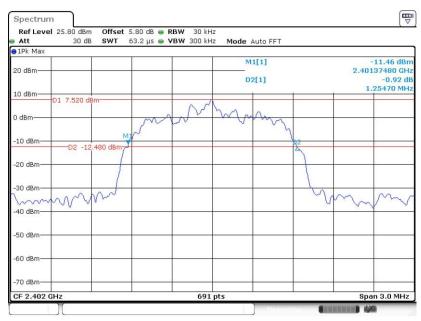


Date: 11.FEB.2022 04:41:46

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 24 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

20 dB Bandwidth Plot on Channel 39

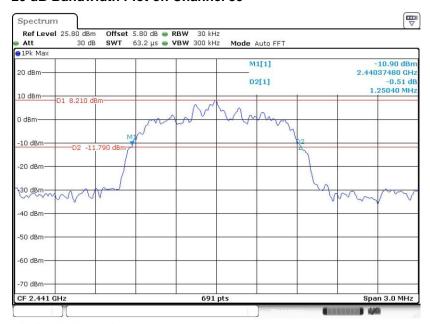

Date: 11.FEB.2022 04:59:33

20 dB Bandwidth Plot on Channel 78

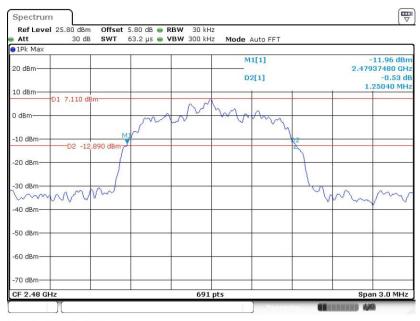


Date: 11.FEB.2022 05:08:45

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 25 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


<3Mbps>

20 dB Bandwidth Plot on Channel 00

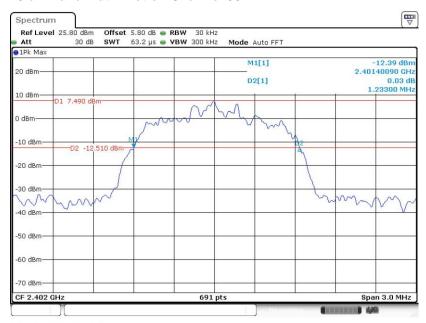

Date: 11.FEB.2022 05:17:42

20 dB Bandwidth Plot on Channel 39

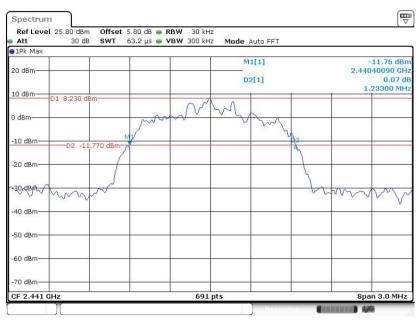


Date: 11.FEB.2022 05:31:28

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 26 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

20 dB Bandwidth Plot on Channel 78

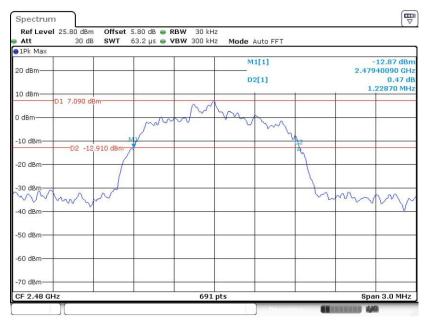

Date: 11.FEB.2022 05:40:01

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 27 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

3.4.6 Test Result of 99% Occupied Bandwidth

Please refer to Appendix A.

<1Mbps>

99% Occupied Bandwidth Plot on Channel 00

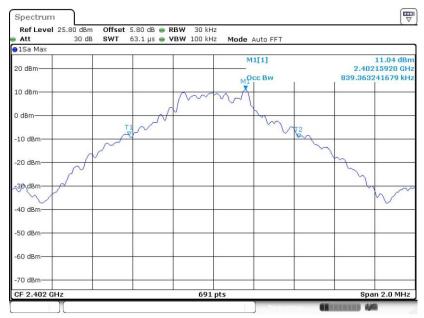

Date: 11.FEB.2022 04:19:38

99% Occupied Bandwidth Plot on Channel 39



Date: 11.FEB.2022 04:27:43

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 28 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

99% Occupied Bandwidth Plot on Channel 78



Date: 11.FEB.2022 04:34:24

<2Mbps>

99% Occupied Bandwidth Plot on Channel 00




Date: 11.FEB.2022 04:52:53

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 29 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

99% Occupied Bandwidth Plot on Channel 39

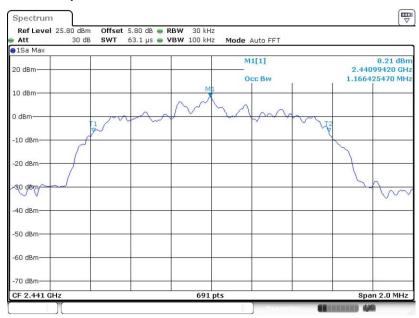

Date: 11.FEB.2022 05:04:28

99% Occupied Bandwidth Plot on Channel 78



Date: 11.FEB.2022 05:11:46

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 30 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


<3Mbps>

99% Occupied Bandwidth Plot on Channel 00



Date: 11.FEB.2022 05:23:07

99% Occupied Bandwidth Plot on Channel 39

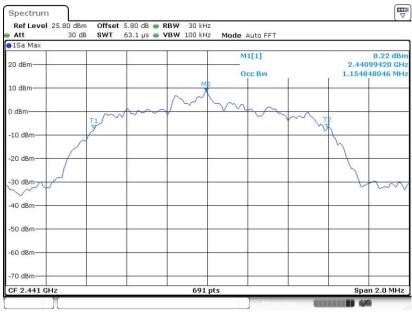

Date: 11.FEB.2022 05:37:15

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 31 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

99% Occupied Bandwidth Plot on Channel 78



Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 32 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.5 Output Power Measurement

3.5.1 Limit of Output Power

The maximum peak conducted output power of the intentional radiator shall not exceed the following:

(1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts.


3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup



3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 33 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup




TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 34 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.6.5 Test Result of Conducted Band Edges


<1Mbps>

Low Band Edge Plot on Channel 00

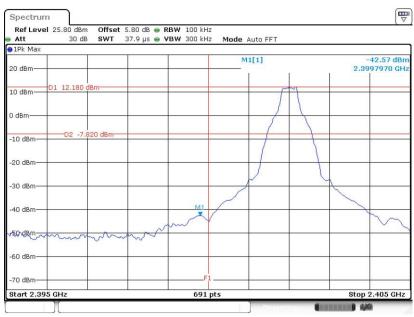

Date: 11.FEB.2022 04:23:51

High Band Edge Plot on Channel 78

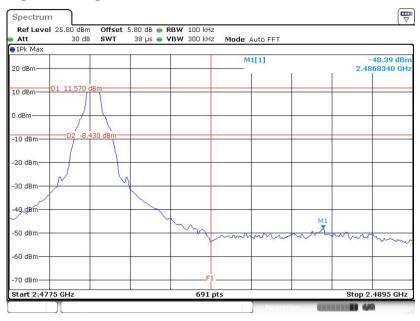


Date: 11.FEB.2022 04:39:22

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 35 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


<2Mbps>

Low Band Edge Plot on Channel 00

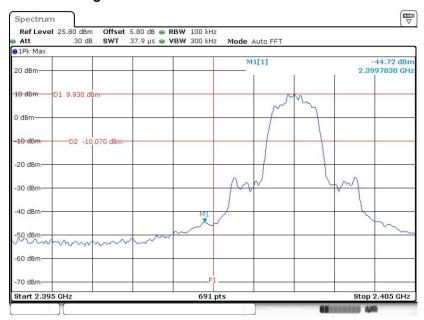

Date: 11.FEB.2022 04:57:12

High Band Edge Plot on Channel 78

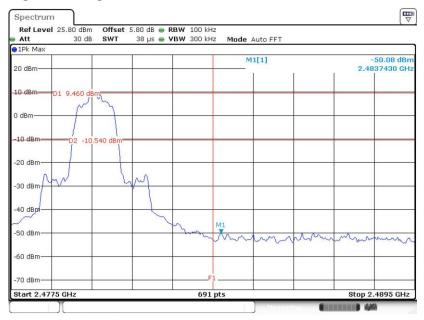

Date: 11.FEB.2022 05:15:13


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 36 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

<3Mbps>

Low Band Edge Plot on Channel 00

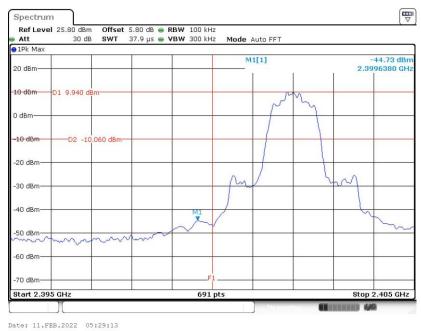

High Band Edge Plot on Channel 78

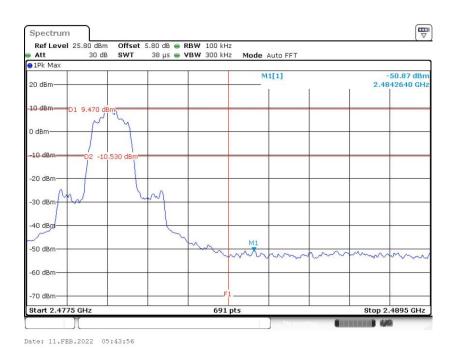

Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 37 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


3.6.6 Test Result of Conducted Hopping Mode Band Edges

<1Mbps>

Hopping Mode Low Band Edge Plot

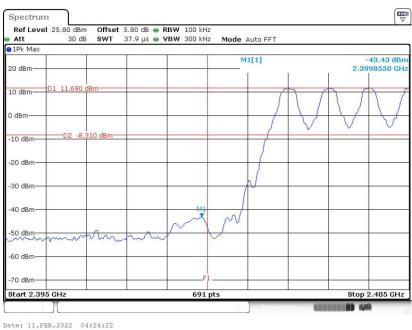

Hopping Mode High Band Edge Plot

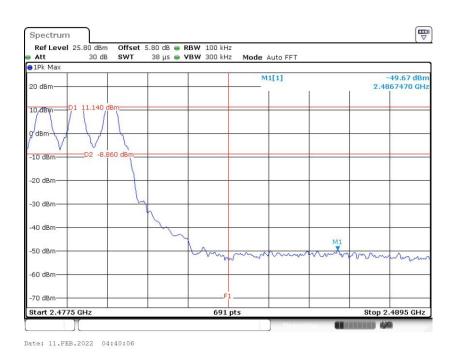


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 38 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


<2Mbps>

Hopping Mode Low Band Edge Plot

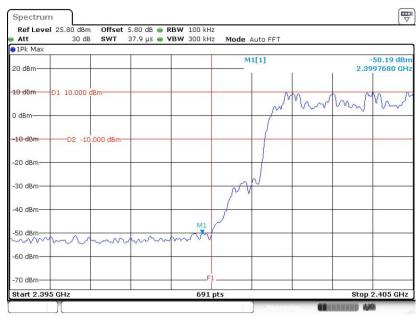

Date: 11.FEB.2022 04:58:01

Hopping Mode High Band Edge Plot

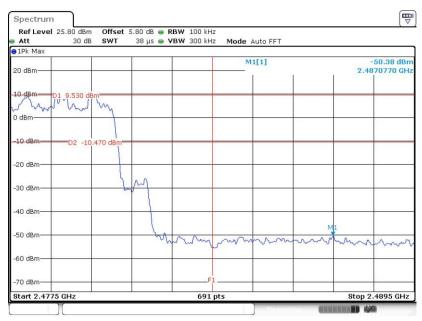


Date: 11.FEB.2022 05:15:55

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 39 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

<3Mbps>

Hopping Mode Low Band Edge Plot

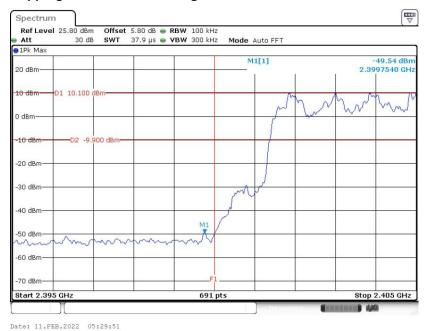

Hopping Mode High Band Edge Plot

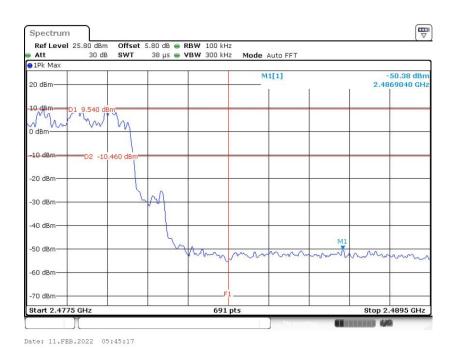

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 40 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.7 Conducted Spurious Emission Measurement

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup

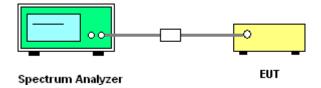

Sporton International Inc. (Kunshan)


TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 41 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


3.7.5 Test Result of Conducted Spurious Emission

<1Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

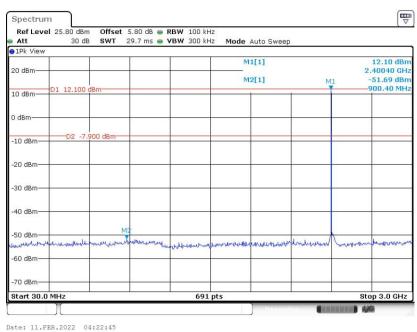

00E Blat --- 01-00 lateras 0.011- 05-011

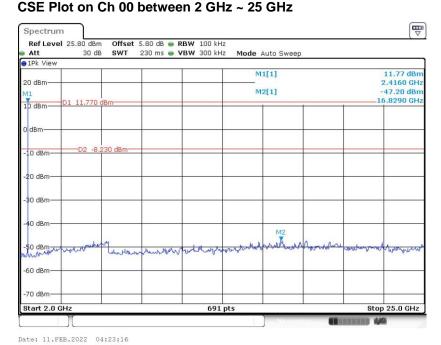


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 42 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

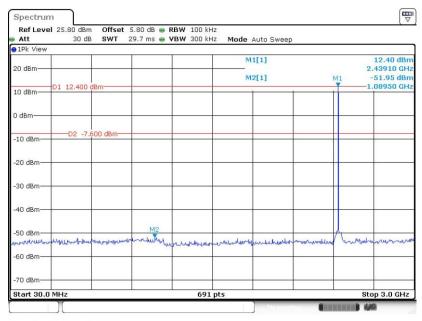

Date: 11.FEB.2022 04:28:35

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

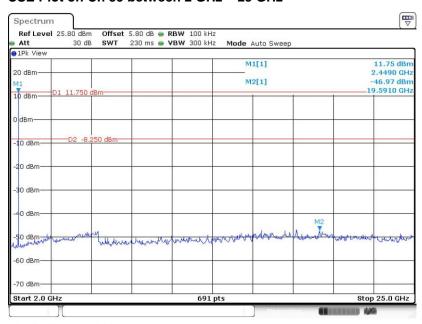


Date: 11.FEB.2022 04:29:06

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 43 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

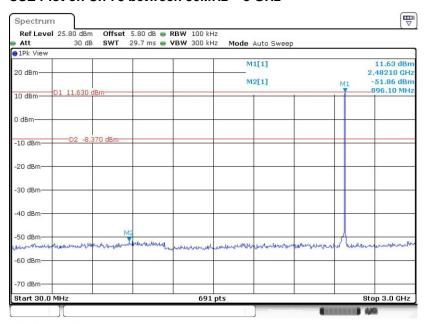

Date: 11.FEB.2022 04:37:59

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

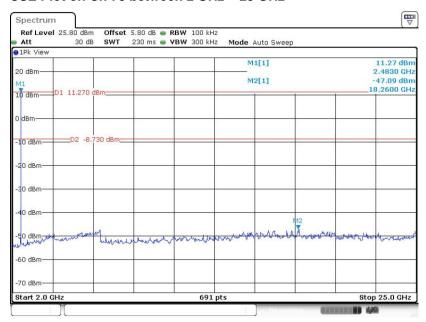

Date: 11.FEB.2022 04:38:32


Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 44 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


<2Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

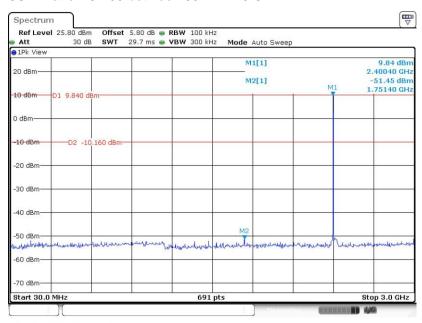

Date: 11.FEB.2022 04:56:10

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

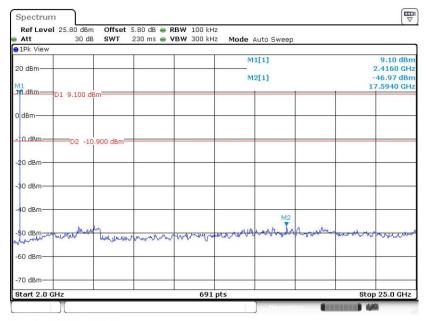


Date: 11.FEB.2022 04:56:39

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 45 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

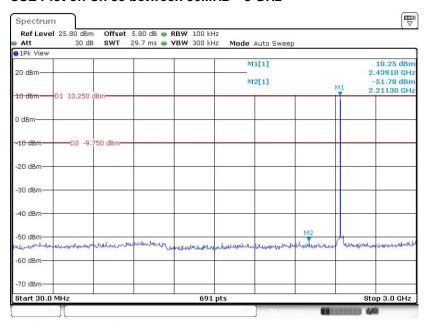

Date: 11.FEB.2022 05:05:54

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

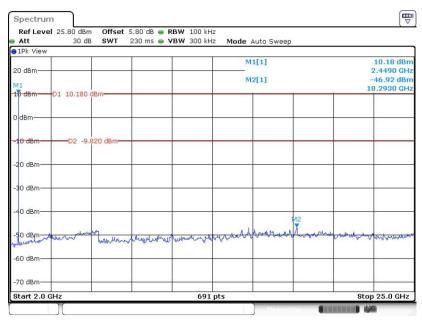


Date: 11.FEB.2022 05:06:28

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 46 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

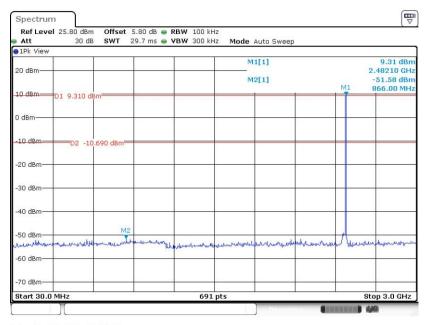

Date: 11.FEB.2022 05:14:20

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

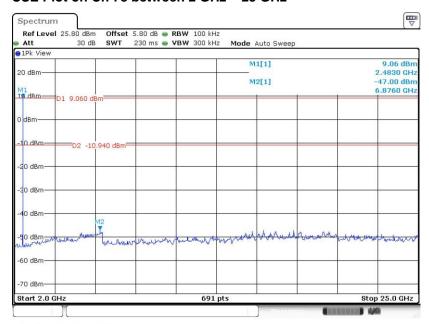


Date: 11.FEB.2022 05:14:50

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 47 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A


<3Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

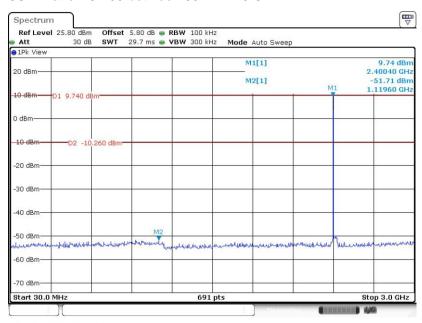

Date: 11.FEB.2022 05:27:49

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

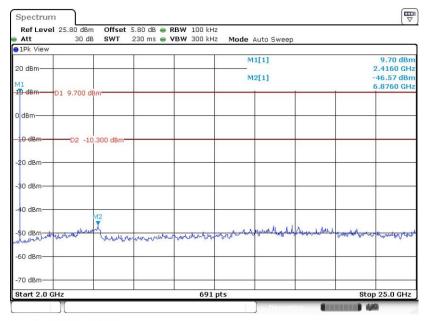


Date: 11.FEB.2022 05:28:24

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 48 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

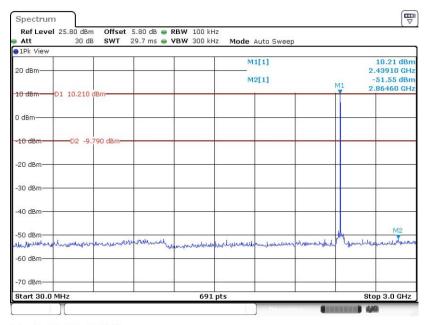

Date: 11.FEB.2022 05:38:10

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

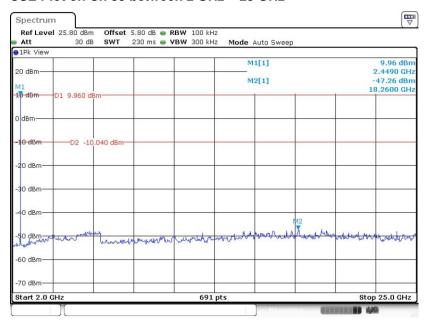


Date: 11.FEB.2022 05:38:40

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 49 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01


Report No.: FR1D1023A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

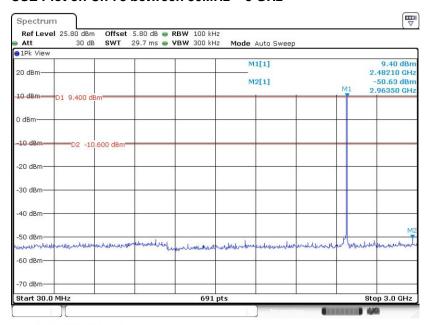

Date: 11.FEB.2022 05:42:50

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

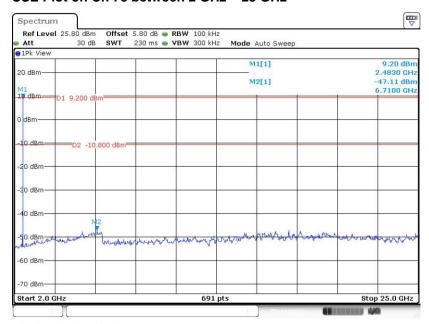

Date: 11.FEB.2022 05:43:34

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 50 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.8 Radiated Band Edges and Spurious Emission Measurement

3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 – 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 51 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$

Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20*log(Duty cycle)


- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- 7. For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 8. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than peak limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.79dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.


Report No.: FR1D1023A

3.8.4 Test Setup


For radiated emissions below 30MHz

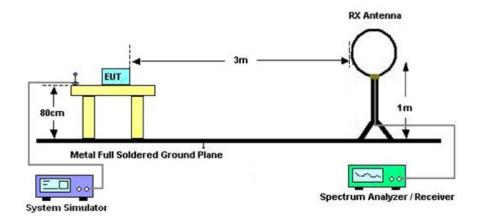

For radiated emissions from 30MHz to 1GHz

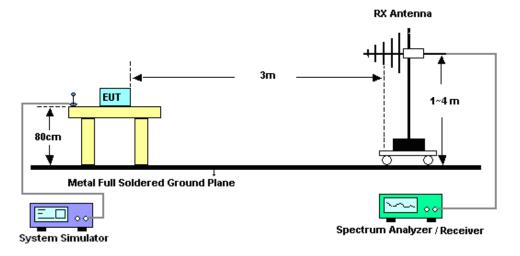

For radiated emissions above 1GHz

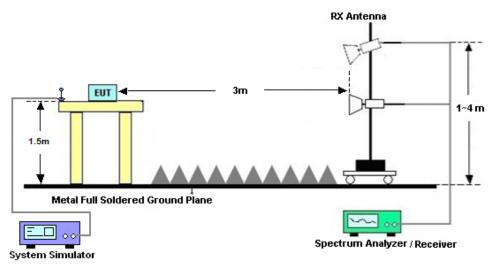

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 53 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix C.

3.8.7 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic or 40GHz, whichever is lower)

Please refer to Appendix C.

3.8.8 Duty cycle correction factor for average measurement

Please refer to Appendix D.

Sporton International Inc. (Kunshan) TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 54 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR1D1023A

3.9 AC Conducted Emission Measurement

3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Eroquency of emission (MUz)	Conducted limit (dBμV)			
Frequency of emission (MHz)	Quasi-peak	Average		
0.15-0.5	66 to 56*	56 to 46*		
0.5-5	56	46		
5-30	60	50		

^{*}Decreases with the logarithm of the frequency.

3.9.2 Measuring Instruments


The measuring equipment is listed in the section 4 of this test report.

3.9.3 Test Procedures

- The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

Report No.: FR1D1023A

3.9.4 Test Setup

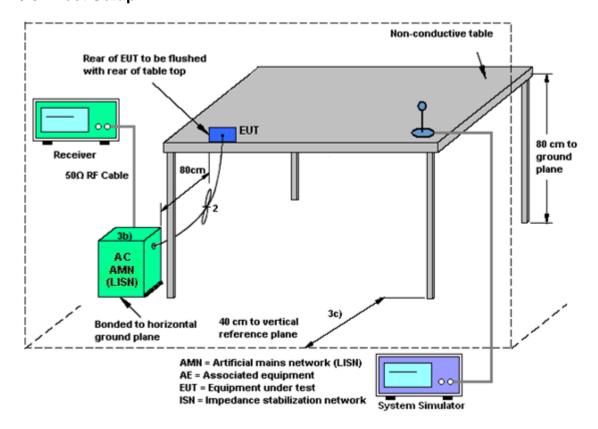

3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix B.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 56 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

3.10 Antenna Requirements

3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 57 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	R&S	FSV40	101040	10Hz~40GHz	Oct. 14, 2021	Jan. 18, 2022~ Feb. 11, 2022	Oct. 13, 2022	Conducted (TH01-KS)
Pulse Power Senor	Anritsu	MA2411B	0917070	300MHz~40GH z	Jan. 07, 2022	Jan. 18, 2022~ Feb. 11, 2022	Jan. 06, 2023	Conducted (TH01-KS)
Power Meter	Anritsu	ML2495A	1005002	50MHz Bandwidth	Jan. 07, 2022	Jan. 18, 2022~ Feb. 11, 2022	Jan. 06, 2023	Conducted (TH01-KS)
EMI Test Receiver	Keysight	N9038A	MY572901 51	3Hz~8.5GHz;M ax 30dBm	Jul. 12, 2021	Feb. 14, 2022	Jul. 11, 2022	Radiation (03CH04-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY551502 44	10Hz-44G,MAX 30dB	Apr. 13, 2021	Feb. 14, 2022	Apr. 12, 2022	Radiation (03CH04-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Oct. 30, 2021	Feb. 14, 2022	Oct. 29, 2022	Radiation (03CH04-KS)
Bilog Antenna	TeseQ	CBL6111D	49922	30MHz-1GHz	May 30, 2021	Feb. 14, 2022	May 29, 2022	Radiation (03CH04-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	75957	1GHz~18GHz	Oct. 30, 2021	Feb. 14, 2022	Oct. 29, 2022	Radiation (03CH04-KS)
SHF-EHF Horn	Com-power	AH-840	101070	18GHz~40GHz	Jan. 05, 2022	Feb. 14, 2022	Jan. 04, 2023	Radiation (03CH04-KS)
Amplifier	Burgeon	BPA-530	102219	0.01MHz ~3000MHz	Nov. 01, 2021	Feb. 14, 2022	Oct. 31, 2022	Radiation (03CH04-KS)
Amplifier	MITEQ	EM18G40GG A	060728	18~40GHz	Jan. 05, 2022	Feb. 14, 2022	Jan. 04, 2023	Radiation (03CH04-KS)
high gain Amplifier	MITEQ	AMF-7D-0010 1800-30-10P	2025788	1Ghz-18Ghz	Jul. 30, 2021	Feb. 14, 2022	Jul. 29, 2022	Radiation (03CH04-KS)
Amplifier	Keysight	83017A	MY572801 06	500MHz~26.5G Hz	Oct. 12, 2021	Feb. 14, 2022	Oct. 11, 2022	Radiation (03CH04-KS)
AC Power Source	Chroma	61601	F1040900 04	N/A	NCR	Feb. 14, 2022	NCR	Radiation (03CH04-KS)
Turn Table	ChamPro	EM 1000-T	060762-T	0~360 degree	NCR	Feb. 14, 2022	NCR	Radiation (03CH04-KS)
Antenna Mast	ChamPro	EM 1000-A	060762-A	1 m~4 m	NCR	Feb. 14, 2022	NCR	Radiation (03CH04-KS)
EMI Receiver	R&S	ESCI7	100768	9kHz~7GHz;	Apr. 21, 2021	Jan. 22, 2022	Apr. 20, 2022	Conduction (CO01-KS)
AC LISN (for auxiliary equipment)	MessTec	AN3016	060103	9kHz~30MHz	Oct. 14, 2021	Jan. 22, 2022	Oct. 13, 2022	Conduction (CO01-KS)
AC LISN	R&S	ENV216	100334	9kHz~30MHz	Oct. 14, 2021	Jan. 22, 2022	Oct. 13, 2022	Conduction (CO01-KS)
AC Power Source	Chroma	61602	ABP00000 0811	AC 0V~300V, 45Hz~1000Hz	Oct. 14, 2021	Jan. 22, 2022	Oct. 13, 2022	Conduction (CO01-KS)

NCR: No Calibration Required.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 58 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.10-2013. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

<u>Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)</u>

Measuring Uncertainty for a Level of Confidence	2.94dB
of 95% (U = 2Uc(y))	

<u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

Manager and the contribute formal and a form	
Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	3.VQB

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.1dB
of 95% (U = 2Uc(y))	3.1dB

Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

Measuring Uncertainty for a Level of Confidence	5.1dB
of 95% (U = 2Uc(y))	3.1dB

----- THE END ------

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : 59 of 59
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

Appendix A. Conducted Test Results

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : A1 of A1
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

Report Number : FR1D1023A

Bluetooth

Test Engineer:	Jacob Zhang	Temperature:	21~25	°C
Test Date:	2022/1/18~2022/2/11	Relative Humidity:	51~55	%

<u>TEST RESULTS DATA</u> 20dB and 99% Occupied Bandwidth and Hopping Channel Separation

Mod.	Data Rate	NTX	CH.	Freq. (MHz)	20db BW (MHz)	99% Bandwidth (MHz)	Hopping Channel Separation Measurement (kHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.923	0.839	998.600	0.6155	Pass
DH	1Mbps	1	39	2441	0.947	0.865	998.600	0.6310	Pass
DH	1Mbps	1	78	2480	0.947	0.863	998.600	0.6310	Pass
2DH	2Mbps	1	0	2402	1.255	1.164	1185.200	0.8365	Pass
2DH	2Mbps	1	39	2441	1.250	1.166	924.700	0.8336	Pass
2DH	2Mbps	1	78	2480	1.250	1.164	1094.100	0.8336	Pass
3DH	3Mbps	1	0	2402	1.233	1.149	907.400	0.8220	Pass
3DH	3Mbps	1	39	2441	1.233	1.155	1159.200	0.8220	Pass
3DH	3Mbps	1	78	2480	1.229	1.155	1002.900	0.8191	Pass

TEST RESULTS DATA

Dwell Time

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.8986	0.31	0.4	Pass
AFH	20	53.33	2.8986	0.15	0.4	Pass

TEST RESULTS DATA Peak Power Table

DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	12.86	20.97	Pass
DH1	39	1	13.29	20.97	Pass
	78	1	12.56	20.97	Pass

2DH CH.		NTX	Peak Power	Power Limit	Test
		INIA	(dBm)	(dBm)	Result
	0	1	11.92	20.97	Pass
2DH1	39	1	12.06	20.97	Pass
	78	1	11.36	20.97	Pass


3DH	CH.	NTX	Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	12.18	20.97	Pass
3DH1	39	1	12.31	20.97	Pass
	78	1	11.59	20.97	Pass

TEST RESULTS DATA

Number of Hoppina Frequency

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	79	> 15	Pass


Appendix B. AC Conducted Emission Test Results

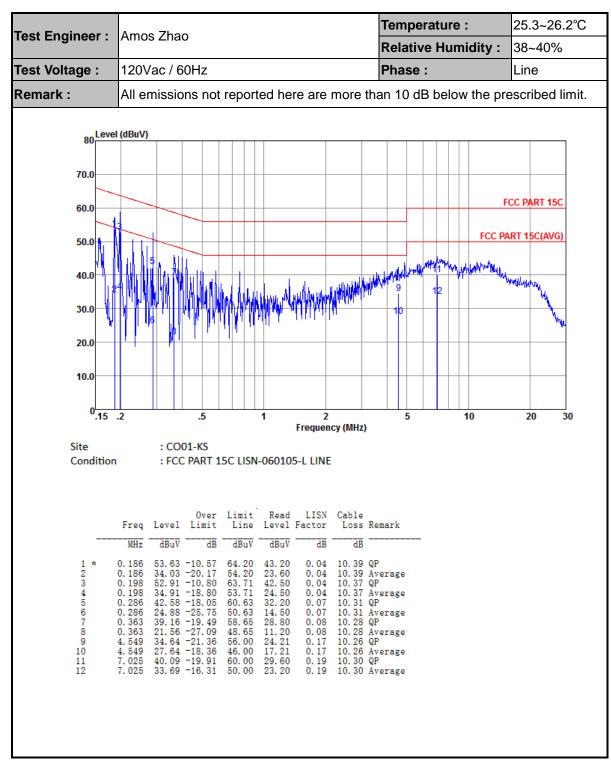

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : B1 of B2
Report Issued Date : Feb. 18, 2022
Report Version : Rev. 01

Report No.: FR1D1023A

Test Engineer :	Amos Zhao	Temperature :	25.3~26.2°C
rest Engineer.	ATTIOS ZITAO	Relative Humidity :	38~40% Neutral
Test Voltage :	120Vac / 60Hz	Phase :	Neutral
Remark :	All emissions not reported here are more that	an 10 dB below the pre	escribed limit.

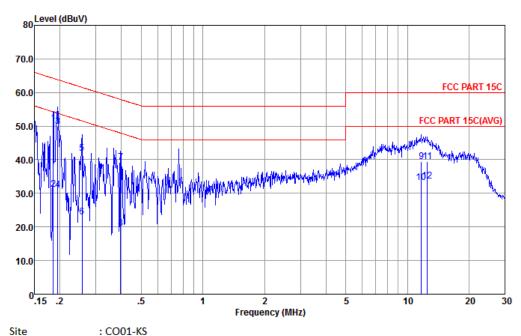

Site

Condition : FCC PART 15C LISN-060105-N NEUTRAL

	Freq	Level	Over Limit	Limit Line	Read Level	LISN Factor	Cable Loss	Remark
	MHz	dBuV	dB	dBuV	dBuV	dB	dB	
1 * 23 4 5 6 7 8 9 10 11 12	0. 185 0. 185 0. 195 0. 195 0. 256 0. 256 0. 396 11. 683 11. 683 12. 516	31. 10 49. 98 31. 08 41. 93 23. 03 39. 17 19. 57 39. 52 33. 12 39. 54	-13. 54 -23. 14 -13. 82 -22. 72 -19. 63 -28. 53 -18. 78 -28. 38 -20. 48 -16. 88 -20. 46 -16. 26	64. 24 54. 24 63. 80 53. 80 61. 56 51. 56 57. 95 47. 95 60. 00 50. 00 50. 00	40. 21 20. 61 39. 51 20. 61 31. 50 12. 60 28. 79 9. 19 28. 90 22. 50 28. 90 23. 10	0. 10 0. 10 0. 10 0. 10 0. 10 0. 11 0. 11 0. 26 0. 26 0. 27 0. 27	10. 37 10. 37 10. 33 10. 27 10. 27 10. 36 10. 36 10. 37	Average QP Average QP Average QP Average QP Average

Note:

- 1. Level(dB μ V) = Read Level(dB μ V) + LISN Factor(dB) + Cable Loss(dB)
- 2. Over Limit(dB) = Level(dB μ V) Limit Line(dB μ V)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1

Page Number : B2 of B2 Report Issued Date : Feb. 18, 2022 Report Version : Rev. 01

Report No.: FR1D1023A

Appendix C. Radiated Spurious Emission

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		2480	101.08	-	-	93.91	30.52	7.32	30.67	185	189	Р	Н
		2480	76.29	-	-	-	-	-	-	-	-	Α	Н
D.T		2483.5	58.94	-15.06	74	51.77	30.52	7.32	30.67	185	189	Р	Н
BT CU 70		2483.5	34.15	-19.85	54	-	-	1	-	-	-	Α	Н
CH 78 2480MHz		2480	104.60	-	-	97.43	30.52	7.32	30.67	100	110	Р	V
2400W112		2480	79.81	-	-	-	-	1	-	-	-	Α	V
		2483.5	62.25	-11.75	74	55.08	30.52	7.32	30.67	100	110	Р	V
		2483.5	37.46	-16.54	54	-	-	-	-	-	-	Α	V
Pomark	1. N	o other spurious	s found.									•	
Remark	2. A	ll results are PA	SS against F	Peak and	Average lim	it line.							

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
			Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
	(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
	4965	39.46	-34.54	74	60	33.82	10.45	64.81	300	0	Р	Н
	7440	41.71	-32.29	74	57.83	35.41	12.83	64.36	300	0	Р	Н
	4965	39.34	-34.66	74	59.88	33.82	10.45	64.81	100	0	Р	V
	7440	41.06	-32.94	74	57.18	35.41	12.83	64.36	100	0	Р	V
	Note	(MHz) 4965 7440 4965	(MHz) (dBμV/m) 4965 39.46 7440 41.71 4965 39.34	(MHz) (dBμV/m) (dB) 4965 39.46 -34.54 7440 41.71 -32.29 4965 39.34 -34.66	Limit Line (MHz) (dBμV/m) (dB) (dBμV/m) 4965 39.46 -34.54 74 7440 41.71 -32.29 74 4965 39.34 -34.66 74	Limit Line Level (MHz) (dBμV/m) (dB) (dBμV/m) (dBμV) 4965 39.46 -34.54 74 60 7440 41.71 -32.29 74 57.83 4965 39.34 -34.66 74 59.88	Limit Line Level Factor (MHz) (dBμV/m) (dB) (dBμV/m) (dBμV) (dB/m) 4965 39.46 -34.54 74 60 33.82 7440 41.71 -32.29 74 57.83 35.41 4965 39.34 -34.66 74 59.88 33.82	Limit Line Level Factor Loss (MHz) (dBμV/m) (dB) (dBμV/m) (dBμV) (dB/m) (dB) 4965 39.46 -34.54 74 60 33.82 10.45 7440 41.71 -32.29 74 57.83 35.41 12.83 4965 39.34 -34.66 74 59.88 33.82 10.45	Limit Line Level Factor Loss Factor (MHz) (dBμV/m) (dBμV/m) (dBμV) (dB/m) (dB) (dB) 4965 39.46 -34.54 74 60 33.82 10.45 64.81 7440 41.71 -32.29 74 57.83 35.41 12.83 64.36 4965 39.34 -34.66 74 59.88 33.82 10.45 64.81	Limit Line Level Factor Loss Factor Pos (MHz) (dBμV/m) (dBμV/m) (dBμV) (dB/m) (dB) (dB) (cm) 4965 39.46 -34.54 74 60 33.82 10.45 64.81 300 7440 41.71 -32.29 74 57.83 35.41 12.83 64.36 300 4965 39.34 -34.66 74 59.88 33.82 10.45 64.81 100	Limit Line Level Factor Loss Factor Pos Pos (MHz) (dBμV/m) (dBμV/m) (dBμV) (dB/m) (dB) (dB) (cm) (deg) 4965 39.46 -34.54 74 60 33.82 10.45 64.81 300 0 7440 41.71 -32.29 74 57.83 35.41 12.83 64.36 300 0 4965 39.34 -34.66 74 59.88 33.82 10.45 64.81 100 0	Limit Line Level Factor Loss Factor Pos Pos Avg. (MHz) (dBμV/m) (dB) (dBμV) (dB/m) (dB) (dB) (cm) (deg) (P/A) 4965 39.46 -34.54 74 60 33.82 10.45 64.81 300 0 P 7440 41.71 -32.29 74 57.83 35.41 12.83 64.36 300 0 P 4965 39.34 -34.66 74 59.88 33.82 10.45 64.81 100 0 P

Remark

No other spurious found.

2. All results are PASS against Peak and Average limit line.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : C1 of C3
Report Issued Date : Feb. 18, 2022

Report No.: FR1D1023A

Emission below 1GHz

2.4GHz BT (LF)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		50.37	19.73	-20.27	40	36.57	14.33	1.02	32.19	-	-	Р	Н
		96.93	21.53	-21.97	43.5	36.71	15.55	1.46	32.19	-	-	Р	Н
		177.44	20.65	-22.85	43.5	35.82	15.02	1.94	32.13	-	-	Р	Н
		309.36	21.21	-24.79	46	31.49	19.21	2.58	32.07	-	-	Р	Н
		607.15	24.98	-21.02	46	27.68	25.84	3.62	32.16	-	-	Р	Н
2.4GHz BT		831.22	28.42	-17.58	46	26.93	28.8	4.22	31.53	-	-	Р	Н
LF		61.04	26.95	-13.05	40	46.28	11.77	1.11	32.21	-	-	Р	V
		99.84	27.01	-16.49	43.5	41.85	15.9	1.45	32.19	-	-	Р	V
		176.47	26.5	-17	43.5	41.62	15.08	1.94	32.14	-	-	Р	V
		190.05	24.21	-19.29	43.5	39.5	14.81	2.01	32.11	-	-	Р	V
		434.49	22.08	-23.92	46	28.66	22.55	3.06	32.19	-	-	Р	٧
		831.22	29.08	-16.92	46	27.59	28.8	4.22	31.53	-	-	Р	٧
Remark	1. 1	No other spuriou	s found.										
Nemark	2. <i>F</i>	All results are PA	.SS against li	mit line.									

Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any unwanted emissions
	shall not exceed the level of the fundamental frequency.
!	Test result is over limit line.
P/A	Peak or Average
H/V	Horizontal or Vertical

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : C2 of C3
Report Issued Date : Feb. 18, 2022

Report No.: FR1D1023A

A calculation example for radiated spurious emission is shown as below:

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
вт		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 00													
2402MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

- 1. Path Loss(dB) = Cable loss(dB) + Filter loss(dB) + Attenuator loss(dB)
- 2. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

3. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBμV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : C3 of C3
Report Issued Date : Feb. 18, 2022


Report No.: FR1D1023A

Appendix D. Duty Cycle Plots

DH5 on time (One Pulse) Plot on Channel 79



DH5 on time (Count Pulses) Plot on Channel 39

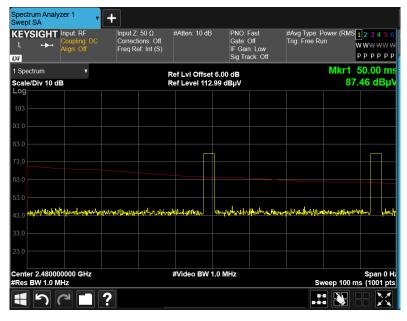

Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 2 * 2.88 / 100 = 5.76 %
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.79 dB
- 3. DH5 has the highest duty cycle worst case and is reported.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: IHDT56AE1 Page Number : D1 of D1
Report Issued Date : Feb. 18, 2022

Report No.: FR1D1023A