HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : IHDT56AN6

Equipment : Mobile Cellular Phone

Brand Name : Motorola

Model Name : XT2405-1, XT2405V

Test Results : PASS

Applicant : Motorola Mobility LLC

222 W, Merchandise Mart Plaza, Chicago IL 60654 USA

Manufacturer : Motorola Mobility LLC

222 W, Merchandise Mart Plaza, Chicago IL 60654 USA

Standard : FCC 47 CFR §20.19

ANSI C63.19-2019

Date Tested : Feb. 03, 2024 ~ Mar. 03, 2024

We, Sporton International Inc. (Shenzhen), would like to declare that the tested sample provide by manufacturer and the test data has been evaluated in accordance with the test procedures given in ANSI C63.19-2019 / 47 CFR Part 20.19 and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Shenzhen), the test report shall not be reproduced except in full.

Approved by: Si Zhang

Si Zhang

Sporton International Inc. (Shenzhen)

1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China

Sporton International Inc. (Shenzhen)TEL: +86-755-86379589 / FAX: +86-755-86379595

Form version: 231017

Page: 1 of 26 Issued Date: Mar. 25, 2024

Cert #5145.01

Report No.: HA411619B

Table of Contents

1.	Gene	eral Information	
2.	Testi	ing Location	
3.		ied Standards	
4.		nterface and Operating Mode	
5.		il coupling mode requirements	
	5.1	T-Coil coupling qualifying field strengths	
	5.2	Frequency Response	
	5.3	Desired ABM signal, undesired ABM field qualification requirements	
	5.4	T-Coil measurement and reference plane	
6.	Test	procedure for T-Coil signal	10
7.		Equipment List	
8.		il testing for CMRS Voice	
	8.1	GSM Evaluation Results	
	8.2	UMTS Evaluation Results	16
	8.3	VoLTE Evaluation Results	
	8.4	VoNR Evaluation Results	
	8.5	VoWiFi Evaluation Results	23
9.	Unce	ertainty Assessment	
10.		rences	0.4

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

TEL: +86-755-86379589 / FAX: +86-755-86379595

Form version: 231017

Report No.: HA411619B

History of this test report

Report No.: HA411619B

Report No.	Version	Description	Issued Date
HA411619B	Rev. 01	Initial issue of report	Mar. 25, 2024

 Sporton International Inc. (Shenzhen)
 Page: 3 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

1. General Information

	Product Feature & Specification
Applicant Name	Motorola Mobility LLC
Equipment Name	Mobile Cellular Phone
Brand Name	Motorola
Model Name	XT2405-1, XT2405V
IMEI Code	IMEI 1: 353533390046459 IMEI 2: 353533390046467
FCC ID	IHDT56AN6
HW	DVT2
SW	U2UAN34.50
EUT Stage	Identical Prototype
Frequency Band	GSM850: 824 MHz ~ 849 MHz GSM1900: 1850 MHz ~ 1910 MHz WCDMA Band II: 1850 MHz ~ 1910 MHz WCDMA Band IV: 1710 MHz ~ 1755 MHz WCDMA Band IV: 1710 MHz ~ 1755 MHz WCDMA Band V: 242 MHz ~ 849 MHz LTE Band 2: 1850 MHz ~ 1910 MHz LTE Band 4: 1710 MHz ~ 1755 MHz LTE Band 5: 824 MHz ~ 849 MHz LTE Band 5: 824 MHz ~ 849 MHz LTE Band 5: 824 MHz ~ 849 MHz LTE Band 12: 699 MHz ~ 716 MHz LTE Band 17: 704 MHz ~ 716 MHz LTE Band 17: 704 MHz ~ 716 MHz LTE Band 17: 704 MHz ~ 716 MHz LTE Band 26: 814 MHz ~ 849 MHz LTE Band 30: 2305 MHz ~ 2315 MHz LTE Band 30: 2305 MHz ~ 2315 MHz LTE Band 30: 2305 MHz ~ 2690 MHz LTE Band 31: 2500 MHz ~ 2690 MHz LTE Band 38: 2570 MHz ~ 2690 MHz LTE Band 66: 1710 MHz ~ 1780 MHz LTE Band 66: 1710 MHz ~ 1780 MHz LTE Band 7: 1860 MHz ~ 698 MHz SG NR 72: 1850 MHz ~ 910 MHz SG NR 71: 2690 MHz ~ 2570 MHz SG NR 71: 2690 MHz ~ 2690 MHz SG NR 71: 824 MHz ~ 849 MHz SG NR 71: 2690 MHz ~ 2510 MHz SG NR 71: 2690 MHz ~ 2510 MHz SG NR 71: 3690 MHz ~ 2690 MHz SG NR 71: 3690 MHz ~ 2690 MHz SG NR 71: 3690 MHz ~ 2910 MHz SG NR 71: 3690 MHz ~ 2910 MHz SG NR 71: 3690 MHz ~ 2910 MHz SG NR 71: 3690 MHz ~ 2690 MHz SG NR 71: 3690 MHz ~ 2690 MHz SG NR 71: 3690 MHz ~ 2690 MHz SG NR 71: 3690 MHz ~ 2716 MHz SG NR 72: 3140 MHz ~ 716 MHz SG NR 73: 3650 MHz ~ 2690 MHz SG NR 76: 31450 MHz ~ 716 MHz SG NR 76: 31450 MHz ~ 3550 MHz SG NR 76: 3680 MHz ~ 3550 MHz SG NR 77: 3450 MHz ~ 3550 MHz SG NR 78: 3550 MHz ~ 3550 MHz SG NR 78: 3550 MHz ~ 3550 MHz SG NR 77: 3450 MHz ~ 3550 MHz SG NR 78: 3550 MHz ~ 3550 MHz SG NR 78: 3550 MHz SG NR 78: 3550 MHz ~ 3550 MHz SG NR 78: 3550 MHz SG NR 78: 3550 MHz ~ 3550 MHz SG NR 78: 3550 MHz SG NR 78: 3550 MHz ~ 3550 MHz WLAN 2.4GHz Band: 5500 MHz ~ 5320 MHz WLAN 3.5GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.6GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.6GHz Band: 5500 MHz ~ 5320 MHz WLAN 1.NII 8: 6825 MHz ~ 6825 MHz WLAN 1.NII 8: 6825 MHz ~ 6825 MHz WLAN 1.NII 8: 6825 MHz ~ 6825 MHz WLAN 1.NII 8: 6
Mode	GSM/GPRS/EGPRS RMC/AMR 12.2Kbps HSDPA HSUPA DC-HSDPA HSPA+ (16QAM uplink is supported) LTE: QPSK, 16QAM, 64QAM, 256QAM

Sporton International Inc. (Shenzhen)

TEL: +86-755-86379589 / FAX: +86-755-86379595

Form version: 231017

Report No.: HA411619B

5G NR: DFT-s-OFDM/CP-OFDM, Pi/2 BPSK/QPSK/16QAM/64QAM/256QAM

Report No.: HA411619B

WLAN 2.4GHz 802.11b/g/n HT20/HT40 WLAN 2.4GHz 802.11ax HE20/HE40

WLAN 5GHz 802.11a/n HT20/HT40

WLAN 5GHz 802.11ac VHT20/VHT40/VHT80/VHT160

WLAN 5GHz 802.11ax HE20/HE40/HE80/HE160

WLAN 6GHz 802.11a/ax HE20/HE40/HE80/HE160

Bluetooth BR/EDR/LE

NFC: ASK

Remark: The two models XT2405-1, XT2405V is only for market segment purpose, no other difference.

2. Testing Location

Sporton International Inc. (Shenzhen) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.01.

Testing Laboratory									
Test Firm	Sporton International Inc	Sporton International Inc. (Shenzhen)							
Test Site Location	1/F, 2/F, Bldg 5, Shiling People's Republic of Chi TEL: +86-755-86379589 FAX: +86-755-86379595	ina	Xili, Nanshan, Shenzhen, 518055						
Total Cita No	Sporton Site No.	FCC Designation No.	FCC Test Firm Registration No.						
Test Site No.	SAR05-SZ	CN1256	421272						

3. Applied Standards

- · FCC CFR47 Part 20.19
- · ANSI C63.19-2019
- FCC KDB 285076 D01 HAC Guidance v06r04
- FCC KDB 285076 D02 T Coil testing v04
- FCC KDB 285076 D03 HAC FAQ v01r06

 Sporton International Inc. (Shenzhen)
 Page: 5 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

4. Air Interface and Operating Mode

Air	Dand Mile	Time	C63.19	Simultaneous	Name of Voice	Power
Interface	Band MHz	Type	Tested	Transmitter	Service	Reduction
	GSM850	VO	\/	WLAN, BT	OMDO Vaisa	No
GSM	GSM1900	VO	Yes	WLAN, BT	CMRS Voice	No
GSIVI	EDGE850	VD	Yes	WLAN, BT	Google Meet ⁽¹⁾	No
	EDGE1900	VD	163	,	google Fi	
	Band 2			WLAN, BT		No
LINATO	Band 4	VO	Yes	WLAN, BT	CMRS Voice	No
UMTS	Band 5			WLAN, BT	0 1 1 (1)	No
	HSPA	VD	Yes	WLAN, BT	Google Meet ⁽¹⁾ google Fi	No
	Band 2			5G NR, WLAN, BT		No
	Band 4			5G NR, WLAN, BT		No
	Band 5			5G NR, WLAN, BT	_	No
	Band 7			5G NR, WLAN, BT		No
	Band 12			5G NR, WLAN, BT	VoLTE	No
LTE	Band 13			5G NR, WLAN, BT	VOLTE /	No
(FDD)	Band 14	VD	Yes	5G NR, WLAN, BT	Google Meet ⁽¹⁾	No
	Band 17			5G NR, WLAN, BT	google Fi	No
	Band 25			5G NR, WLAN, BT	geog.e	No
	Band 26			5G NR, WLAN, BT		No
	Band 30			5G NR, WLAN, BT		No
	Band 66			5G NR, WLAN, BT		No
	Band 71			5G NR, WLAN, BT	VoLTE	No
LTE	Band 38 Band 41			5G NR, WLAN, BT 5G NR, WLAN, BT	/	No No
(TDD)	Band 48	VD	Yes	5G NR, WLAN, BT	Google Meet ⁽¹⁾	No
	n2			LTE, WLAN, BT	google Fi	No
	n5			LTE, WLAN, BT		No
	n7			LTE, WLAN, BT		No
	n12			LTE, WLAN, BT		No
	n14			LTE, WLAN, BT		No
	n25			LTE, WLAN, BT	VoNR	No
	n26			LTE, WLAN, BT		No
50 ND	n30	\/D		LTE, WLAN, BT		No
5G NR	n38	VD	Yes	LTE, WLAN, BT	Google Meet ⁽¹⁾	No
	n41			LTE, WLAN, BT	google Fi	No
	n48			LTE, WLAN, BT		No
	n66			LTE, WLAN, BT		No
	n70			LTE, WLAN, BT		No
	n71			LTE, WLAN, BT		No
	n77			LTE, WLAN, BT		No
	n78			LTE, WLAN, BT		No
	2450			GSM, WCDMA, LTE, 5G NR	VoWiFi	No
) A (; - = ;	5200	\/5	.,	GSM, WCDMA, LTE, 5G NR, BT	/ /	No
Wi-Fi	5300	VD	Yes	GSM, WCDMA, LTE, 5G NR, BT	Google Meet ⁽¹⁾	No
	5500			GSM, WCDMA, LTE, 5G NR, BT	google Fi	No
	5800 U-NII 5		Yes ⁽³⁾	GSM, WCDMA, LTE, 5G NR, BT	VoWiFi	No
	U-NII 5 U-NII 6		res		VOVVIFI /	
Wi-Fi		VD	No ⁽²⁾	GSM, WCDMA, LTE, 5G NR, BT	Google Meet ⁽¹⁾	No
	U-NII 7 No ⁽²⁾	INO		google Fi		
ВТ	2450	DT	No	GSM, WCDMA, LTE, 5G NR, 5G WLAN	NA NA	No
Type Transpo		וט	140	JOIN, WODING, ETE, JOININ, JOWEAN	INA	140

Report No.: HA411619B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

- For protocols not listed in Table 6.1 of ANSI C63.19:2019, the average speech level of –20 dBm0 should be used.

 The WLAN6GHz U-NII 6/7/8 were above 6GHz and were not evaluated due to outside of the current scope of ANSI C63.19 and FCC HAC regulations.
- The WLAN6GHz UNII-5 was evaluated for operations which are entirely below 6 GHz, above 6 GHz were not evaluated due outside of the current scope of ANSI C63.19 and FCC HAC regulations.
- Because features of Google Meet allow the option of voice-only communications, Meet has been tested for HAC/T-Coil compatibility to ensure the best user experience.
- The device have similar frequency in some LTE and NR bands: LTE B2/B25, B4/B66, B5/B26, B12/B17, B38/41, 5G NR n25/2, 5G NR n26/5, 5G NR n41/38, since the supported frequency spans for the smaller LTE and NR bands are completely cover by the larger LTE and NR bands, therefore, only larger LTE and NR bands were required to be tested for hearing-aid compliance.

 The Google Meet and google Fi the audio path, parameter and audio codec are all the same, therefore, the Google Meet is evaluation for this
- device to show compliance.
- This is partial report for CMRS voice T-Coil testing. VOIP test report will be separately submitted.

Sporton International Inc. (Shenzhen) Page: 6 of 26 TEL: +86-755-86379589 / FAX: +86-755-86379595 Issued Date: Mar. 25, 2024

5. <u>T-Coil coupling mode requirements</u>

5.1 T-Coil coupling qualifying field strengths

When measured as specified in this standard, there are two groups of qualifying measurement points:

Primary group: A qualifying measurement point shall have its T-Coil signal, desired ABM signal, ≥ -18 dB(A/m) at 1 kHz, in a 1/3 octave band filter. These measurements shall be made with the WD operating at a reference input level as specified in Table 6.1. simultaneously, the qualifying measurement point shall have its weighted magnetic noise, undesired ABM field ≤ -38 dB(A/m).


Secondary group: A qualifying measurement point shall have its weighted magnetic noise, undesired ABM field ≤−38 dB(A/m). This group inherently includes all the members of the primary group.

These levels are designed to be compatible with hearing aids that produce the same acoustic output level for either an acoustic input level of 65 dB SPL or a magnetic input level of -25 dB(A/m) (56.2 mA/m) 39 at either 1.0 kHz or 1.6 kHz. The hearing aid operational measurements are performed per ANSI S3.22-2014

5.2 Frequency Response


The frequency response of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this subclause, over the frequency range 300 Hz to 3 kHz.

Figure 6.4 and Figure 6.5 provide the boundaries for the specified frequency. These response curves are for true field strength measurements of the T-Coil signal. Thus the 6 dB/octave probe response has been corrected from the raw readings.

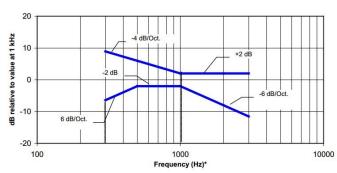

NOTE—Frequency response is between 300 Hz and 3 kHz.

Figure 6.4—Magnetic field frequency response for WDs with a maximum field ≤-15 dB(A/m) at 1 kHz

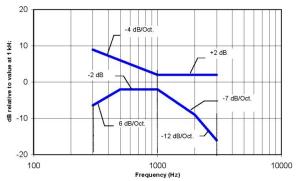

Report No.: HA411619B

NOTE—Frequency response is between 300 Hz and 3000 Hz.

Figure 6.5—Magnetic field frequency response for WDs with a maximum field that exceeds -15 dB(A/m) at 1 kHz

Sporton International Inc. (Shenzhen)

TEL: +86-755-86379589 / FAX: +86-755-86379595

Form version: 231017

Page : 7 of 26

Issued Date: Mar. 25, 2024

5.3 Desired ABM signal, undesired ABM field qualification requirements

<Non-2G GSM operating modes>

The goal of this requirement is to ensure an adequate area where desired ABM signal is sufficiently strong to be heard clearly and a larger area where undesired ABM field is sufficiently low as to avoid undue annoyance. Qualifying measurement points shall fulfill the requirements of ANSI C63.19-2019 section 6.6.2; both the primary and

Report No.: HA411619B

secondary group requirements shall be met:

- The primary group shall include at least 75 measurement points
- The secondary group shall include at least 300 contiguous measurement points

Additionally, to avoid an oddly shaped area of low noise, the secondary group shall include at least one longitudinal column of at least 10 contiguous qualifying points and at least one transverse row containing at least 15 contiguous qualifying points.


Figure 6.6 is an example of a qualifying scan. The total number of primary group qualifying measurement points is 161, which is ≥75. The total number of secondary group qualifying points is 536, which is ≥300

The secondary group has a longitudinal column of 26, which is ≥10, and a transverse row also of 26 contiguous points, which is ≥15

<2G GSM operating modes>

If the 2G GSM operating mode(s) are selected for qualification, the qualifying measurement points shall fulfil the requirements of ANSI C63.19-2019 section 6.6.2; both the primary and secondary group requirements shall be met:

- The primary group shall include at least 25 measurement points
- The secondary group shall include at least 125 contiguous measurement points

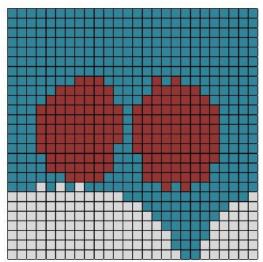


Red (primary group): AB desired ABM signal M1 \ge 18 dB(A/m) and undesired ABM field \le 38 dB(A/m) Blue and red (secondary group): undesired ABM field \le 38 dB(A/m)

Figure 6.6—An example of a qualifying desired ABM signal, undesired ABM field scan:

 Sporton International Inc. (Shenzhen)
 Page: 8 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

5.4 T-Coil measurement and reference plane

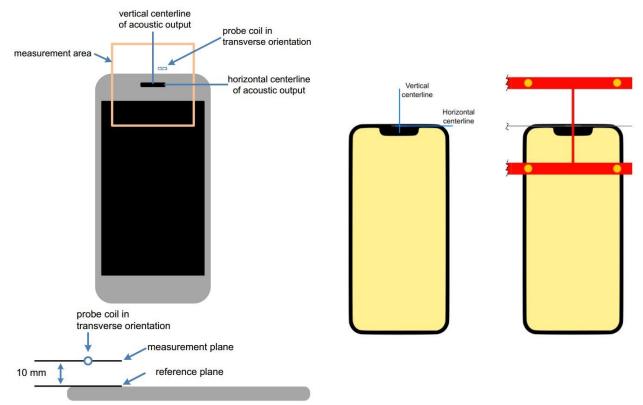

Measurement and reference planes probe orientation for WD audio frequency magnetic field measurements

Device Under Test Positioning under the Test Arch

Report No.: HA411619B

The T-Coil measurement plane, reference plane and other measurement parameters shall be:

- a. The reference plane is the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the WD handset, which, in normal handset use, rest against the ear.
- b. The measurement plane is parallel to, and 1 0 mm in front of, the reference plane.
- c. The reference axis is normal to the reference plane and passes through the center of the acoustic output (or the center of the hole array); or may be centered on or near a secondary inductive source. The actual location of the reference axis and resultant measurement area shall be noted in the test report.
- d. The measurement area shall be 50 mm by 50 mm. The measurement area for both desired ABM signal and undesired ABM field may be located where the transverse magnetic measurements are optimum with regard to the requirements. However, the measurement area should be in the vicinity of the acoustic output of the WD and shall be located in the same half of the phone as the WD receiver. In a WD handset with a centered receiver and a circularly symmetrical magnetic field, the measurement axis and the reference axis would coincide.
- e. Measurements of desired ABM signal strength and undesired ABM field are made at 2.0 mm ± 0.5 mm or 4 mm intervals in an X-Y measurement area pattern over the entire measurement area (676 measurement points total); either all measured, or measured plus interpolated, per ANSI C63.19-2019 section 6.4
- f. Desired ABM signal frequency response is measured at a single location at or near the maximum
- g. desired ABM signal strength location.
- h. The actual locations of the measurement points shall be noted in the test report.

 Sporton International Inc. (Shenzhen)
 Page: 9 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

6. Test procedure for T-Coil signal

This subclause describes the procedures used to measure the ABM (T-Coil) performance of the WD. Measurements shall be performed over a measurement area 50 mm square, in the measurement plane, as specified in ANSI C63.19-2019 A.3. The measurement area shall be scanned with a uniform measurement point spacing of 2.0 mm ± 0.5 mm in each X-Y axis of the plane, yielding 676 measurement points with approximately even spacing throughout the area

Report No.: HA411619B

Optionally, measurement point spacing may be increased to 4 mm, with interpolation employed to yield the required 676 equivalent measurement points distributed uniformly over the 50 mm square measurement area. Interpolated points shall be derived from the average of the linear representations of the field strengths of the nearest two or four equidistant measured points. The area of measurement is increased to a 52 mm square so that edge rows and columns of the required 50 mm square can be either measured or interpolated, with none extrapolated.

In addition to measuring the desired ABM signal levels, the weighted magnitude of the unintended signal shall also be determined. Weighting of the unintended and undesired ABM field shall be by the spectral and temporal weighting described in ANSI C63.19-2019 D.4 through D.6

In order to assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal shall be made at the same locations. Measurements shall not include undesired influence from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load might be necessary. However, even then with a coaxial connection to a base station simulator or non-radiating load there could still be RF leakage from the WD, which could interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be done with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2019 Table 6.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well. If tested with the display in the off state this shall be documented in the test report

Measurements shall be performed with the probe coil oriented in the transverse direction, as illustrated in ANSI C63.19-2019 A.3, that is, aligned in the plane of the measurement area and perpendicular to the long dimension of the WD. A multi-stage sequence consists of first measuring the field strength of the desired T-Coil signal (desired ABM signal) that is useful to a hearing aid T-Coil at each specified measurement point. The undesired magnetic component (undesired ABM field) is then measured in the same transverse orientation at each of the same measurement points. At a single location only, taken at or near the highest desired ABM signal reading, the desired ABM signal frequency response shall be determined in a third measurement stage. The flowchart in ANSI C63.19-2019 Figure 6.3 illustrates this three-stage process.

To minimize the need to test every WD operating mode to the telecoil requirements of ANSI C63.19-2019 Clause 6, it is permissible to exclude some subset of supported configurations. For a given WD, every mode that supports voice communication shall be considered for telecoil testing. However, if it can be demonstrated that a certain configuration will not be the worst-case telecoil configuration, such configurations may be excluded from the full telecoil scans of ANSI C63.19-2019 section 6.4. 34 For example, operating modes may be pre-screened by scanning for both desired ABM signal and undesired ABM field at a lower measurement point density than the final scans, thus saving considerable testing time by eliminating configurations that are excellent performers from more detailed testing for worst-case. In any case, the specific methods and criteria used to determine

which configurations are excluded for a WD shall be explicitly stated and justified in the test report. To be considered for exclusion from telecoil testing, operating modes shall also be shown to pass the frequency response requirements of ANSI C63.19-2019 section 6.6.3.


Many factors could affect telecoil test results. RF power level and amplitude modulation characteristics as well as the specific current paths within the WD associated with the RF output stage(s), the display, and processing circuitry could affect the undesired ABM field. Audio codec implementation and acoustic receiver characteristics could also affect the desired ABM signal). Therefore, any justifications for exclusions should be thorough documented. If an operating mode is under user control and instructions on how to place the WD in a less interfering condition is in the user instructions, those instructions may be followed in configuring the device for testing

 Sporton International Inc. (Shenzhen)
 Page: 10 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

Test flow for T-Coil signal test

Test Instructions

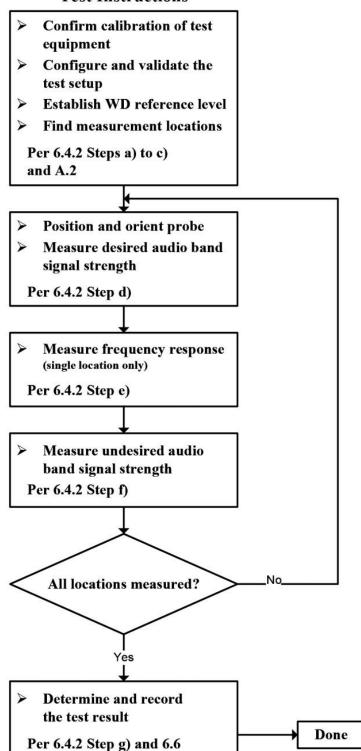

Form version: 231017

Report No.: HA411619B



HAC T-COIL TEST REPORT

The following steps summarize the basic test flow for determining desired ABM signal and undesired ABM field. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of desired ABM signal level. An alternative procedure, yielding equivalent results, using a broadband excitation is described in ANSI C63.19-2019 section 6.5.

Report No.: HA411619B


- a. A validation of the test setup and instrumentation shall be performed. This may be done using a TMFS or Helmholtz Coil. Measure the emissions and confirm that they are within tolerance of the expected values.
- b. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2019 section 6.3.2.
- c. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load (if necessary to control RF interference in the measurement equipment) as shown in section 6.1 or section 6.2.
- d. The drive level to the WD is set such that the reference input level specified in ANSI C63.19-2019 Table 6.1 is input to the base station simulator (or manufacturer's test mode equivalent) in the 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (desired ABM signal) at f = 1 kHz. Either a sine wave at 1025 Hz, or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as specified in 6.4.3, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. 35 The same drive level will be used for the desired ABM signal frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- e. At each measurement location over the measurement area and in the transverse orientation, measure and record the desired 1 kHz T-Coil magnetic signal (desired ABM signal) as described in Step c).
- f. At or near a location representing a maximum in the just-measured desired ABM signal, measure and record the desired T-Coil magnetic signals (desired ABM signal at fi) as described in ANSI C63.19-2019 section 6.4.5.2 in each individual ISO 266:1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in Step c), and the reading taken for that band. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input—output comparison using simulated speech. The full-band integrated or half-band integrated probe output, as described in ANSI C63.19-2019 D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB(A/m).) Compare the frequency response found to the requirements of ANSI C63.19-2019 section 6.6.3.
- g. At the same locations measured in Step d), measure and record the undesired broadband audio magnetic signal (undesired ABM field) with no audio signal applied (or digital zero applied, if appropriate) using the specified spectral weighting, the half-band integrator followed by the temporal weighting.
- h. Calculate and record the location and number of the measurement points that satisfy both the minimum desired ABM signal level and the maximum undesired ABM field level specified in ANSI C63.19-2019 section 6.6.2. Compare this to the requirements in ANSI C63.19-2019 section 6.6.4 and record the result.
- Calculate and record the location and number of the measurement points that satisfy the maximum undesired ABM field level and distribution requirements specified in ANSI C63.19-2019 section 6.6.4.

 Sporton International Inc. (Shenzhen)
 Page: 12 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

Test Setup Diagram for GSM /UMTS/VoLTE/VoWiFi/VoNR

Report No.: HA411619B

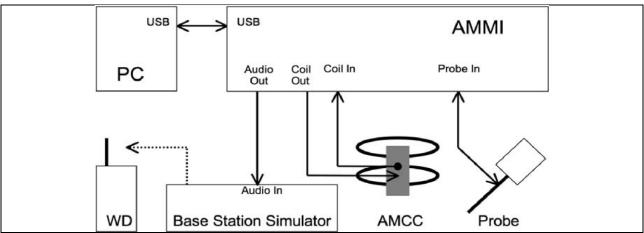

General Note:

- 1. Define the all applicable input audio level as below according to ANSI C63.19-2019 table 6.1:
 - GSM input level: -16dBm0
 - UMTS input level: -16dBm0
 - VoLTE input level: -16dBm0VoNR input level: -16dBm0
 - VoWiFi input level: -16dBm0
- 2. The test setup used for GSM /UMTS is via the callbox of CMW500 for T-coil measurement. The CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined. The CMW500 can be manually configured to control the speech input level and ensure that the result is -16dBm0 for GSM/UMTS CMRS Voice connection.
- 3. Voice over Long-Term Evolution (VoLTE) is a standard for high-speed wireless communication for mobile phones and data terminals including IoT devices and wearables. It is based on the IP Multimedia Subsystem (IMS) network, with specific profiles for control and media planes of voice service on LTE defined by GSMA in PRD IR.92. This approach results in the voice service (control and media planes) being delivered as data flows within the LTE data bearer. This means that there is no dependency on the legacy circuit-switched voice network to be maintained.
- 4. The test setup used for VoLTE and VoWiFI over IMS is via the callbox of CMW500 for T-coil measurement. The data application unit of the CMW500 is used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to control the speech input level and ensure that the result is -16dBm0 for VoLTE, and VoWiFi during the IMS connection.
- 5. The test setup used for VoNR over IMS is via the callbox of CMX500 for T-coil measurement, The data application unit of the CMX500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoNR when the device during the IMS connection.
- 6. According to KDB 285076 D02, T-Coil testing for VoLTE, VoNR and VoWiFi requires test instrumentation that can (1) for the system to be able to establish an IP call from/to the handset under test, (2) through an IMS (IP Multimedia Subsystem) and SIP/IP server, (3) to an analog audio adapter containing the permissible set of codecs used by the device under test, and (4) inject the necessary C63.19 test tones at the average speech level for the measurement The test setup is illustrated above Figure. The R&S CMW500 and CMX500 was used as system simulator for VoLTE, VoNR and VoWiFi T-Coil testing. The DAU (Data Application Unit) in CMW500, CMX500 integrates IMS and SIP/IP server that can establish VoLTE, VoNR and Wi-Fi calling, and transport the test tones from AMMI (Audio Magnetic Measuring Instrument) to EUT.

<Example define the input level for GSM /UMTS/VoLTE/VoNR/VoWiFi>

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)	
	3.14	1.5		0.51		
100	5.61		40	2.98	3.13	
8.31	-16		18.39		-18.48	
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting	
1kHz sine	•	3	0	1	8.31	
48k_voice_1kHz	1	16.2	-12.7	4.33	35.98	
48k_voice_300-3000	2	21.6	-18.6	8.48	70.46	

 Sporton International Inc. (Shenzhen)
 Page: 13 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

7. Test Equipment List

Manufacturer	Name of Equipment	Type/Model	Serial Number	Calibration		
Manufacturer	Name of Equipment	i ype/iviodei	Serial Number	Last Cal.	Due Date	
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3106	2023/12/13	2024/12/12	
SPEAG	Data Acquisition Electronics	DAE4	1664	2023/6/6	2024/6/5	
SPEAG	Audio Magnetic Calibration Coil	AMCC	1128	NCR	NCR	
SPEAG	Audio Measuring Instrument	AMMI	1137	NCR	NCR	
Anymetre	Thermo-Hygrometer	JR593	2020062101	2023/7/8	2024/7/7	
R&S	Wideband Radio Communication Tester	CMW500	157651	2023/12/28	2024/12/27	
R&S	Wideband Radio Communication Tester	CMX500	101931	2023/9/12	2024/9/11	
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR	
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR	

Report No.: HA411619B

Note:

 Sporton International Inc. (Shenzhen)
 Page: 14 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

^{1.} NCR: "No-Calibration Required"

8. T-Coil testing for CMRS Voice

General Note:

 Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (Primary Group, Secondary Group, longitudinal contiguous points, transverse row contiguous points, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.

Report No.: HA411619B

- 2. Air Interface Investigation:
 - a. Through Internal radio configuration investigation (e.g. bandwidth, modulation data rate, subcarrier spacings, and resource blocks) that the worst radio configuration was document as below table.
 - b. Use the worst-case codec test and document a limited set of bands/channel/bandwidths.
 - c. According to the ANSI C63.19-2019 section 6.3.3, using a frequency near the center of the frequency band perform T-coil evaluation.
- 3. LTE Band 2/4/25/48/66 and 5GNR n2/25/66/38/41/48/77/78 support different PAs for some antennas, and using the worst-case codec configuration and bitrate was performed for each LTE FDD and NR FDD band.

8.1 GSM Evaluation Results

<Codec Investigation>

		GS	SM Codec				
Codec	AMR NB Full Rate	AMR NB Full Rate	AMR WB Full Rate	AMR WB Full Rate	EFR NB (FR V2)	Orientation	Band /
Bit rate	4.75 Kbps	12.2 Kbps	6.6 Kbps	12.65 Kbps	12.2Kbps		Channel
Primary Group Contiguous Point Count	34	35	32	35	31		
Secondary Group Contiguous Point Count	162	166	156	166	188		
Secondary Group Max Longitudinal	15	15	15	16	17	Transversal(Y)	GSM850 / 189
Secondary Group Max Transverse	24	25	23	25	25		
Frequency Response	2	1.58	2	1.66	1.38		

Remark: According to codec investigation, the worst codec is EFR NB (FR V2) 12.2Kbps.

<Air Interface Investigation>

F	Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position	Ant Status	Primary Group Contiguous Point Count	Secondary Group Contiguous Point Count	Secondary Group Max Longitudinal	Group May	Frequency Response Margin [dB]	Ambient Noise dB (A/m)
	1	GSM850	Voice	189	Transversal (Y)	Main PA	31	188	17	25	1.38	-49.4
	2	GSM1900	Voice	661	Transversal (Y)	Main PA	60	229	16	26	1.43	-49.7

 Sporton International Inc. (Shenzhen)
 Page: 15 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

8.2 UMTS Evaluation Results

<Codec Investigation>

UMTS AMR Codec										
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel				
Primary Group Contiguous Point Count	283	245	279	249						
Secondary Group Contiguous Point Count	568	515	564	512						
Secondary Group Max Longitudinal	25	23	24	22	Transversal(Y)	B2 / 9400				
Secondary Group Max Transverse	26	26	26	26						
Frequency Response	0.8	2	1.07	1.91						

Report No.: HA411619B

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps.

<Air Interface Investigation>

Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position		Primary Group Contiguous Point Count		Group Max	Group Max		Ambient Noise dB (A/m)
3	WCDMA II	Voice	9400	Transversal (Y)	Main PA	245	515	23	26	2	-50.7
4	WCDMA IV	Voice	1413	Transversal (Y)	Main PA	352	577	24	26	2	-50.6
5	WCDMA V	Voice	4182	Transversal (Y)	Main PA	353	578	25	26	1.73	-50.2

 Sporton International Inc. (Shenzhen)
 Page: 16 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

8.3 VoLTE Evaluation Results

<Codec Investigation>

LTE FDD

VoLTE AMR Codec										
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel				
Primary Group Contiguous Point Count	160	190	178	188						
Secondary Group Contiguous Point Count	424	449	433	445						
Secondary Group Max Longitudinal	20	20	20	20	Transversal(Y)	B25 / 20M / 26340				
Secondary Group Max Transverse	26	26	26	26						
Frequency Response	0.86	1.16	1.01	1.2						

Report No.: HA411619B

			VoLTE EVS	S Codec				
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
Primary Group Contiguous Point Count	197	192	158	173	187	198		
Secondary Group Contiguous Point Count	450	448	414	427	443	455		
Secondary Group Max Longitudinal	20	20	19	20	20	20	Transversal(Y)	B25 / 20M / 26340
Secondary Group Max Transverse	26	26	26	26	26	26		
Frequency Response	0.85	2	1.05	2	1.01	0.87		

Remark: According to codec investigation, the worst codec is EVS WB 5.9Kbps.

 Sporton International Inc. (Shenzhen)
 Page: 17 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

LTE TDD

		VoLTE AMR	Codec			
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel
Primary Group Contiguous Point Count	146	141	136	141		
Secondary Group Contiguous Point Count	397	394	387	391		
Secondary Group Max Longitudinal	16	16	16	18	Transversal(Y)	B41 / 20M / 40620
Secondary Group Max Transverse	26	26	26	26		
Frequency Response	0.35	2	1.05	2		

Report No.: HA411619B

			VoLTE EV	'S Codec				
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
Primary Group Contiguous Point Count	144	138	122	138	125	130		
Secondary Group Contiguous Point Count	396	390	377	390	389	378		
Secondary Group Max Longitudinal	19	16	16	16	16	16	Transversal(Y)	B41 / 20M / 40620
Secondary Group Max Transverse	26	26	26	26	26	26		
Frequency Response	0.63	2	0.74	2	0.64	0.97		

Remark: According to codec investigation, the worst codec is EVS WB 5.9Kbps.

 Sporton International Inc. (Shenzhen)
 Page: 18 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

<Air Interface Investigation>

Air Interface	BW (MHz)	Modulation / Mode		RB offset	Channel	UL-DL Configuration	Probe Position		Secondary Group Contiguous Point Count	Secondary Group Max Longitudinal	Secondary Group Max Transverse	Frequency Response
LTE B41_PC3	20	QPSK	1	0	40620	0	Transversal (Y)	128	373	15	26	Pass
LTE B41_PC3	20	QPSK	100	0	40620	0	Transversal (Y)	129	375	15	26	Pass
LTE B41_PC3	20	16QAM	1	0	40620	0	Transversal (Y)	130	378	16	26	Pass
LTE B41_PC3	20	64QAM	1	0	40620	0	Transversal (Y)	131	378	14	26	Pass
LTE B41_PC3	20	256QAM	1	0	40620	0	Transversal (Y)	132	383	15	26	Pass
LTE B41_PC3	5	QPSK	1	0	40620	0	Transversal (Y)	131	385	15	26	Pass
UL CA B41_PC3	20	QPSK	1	0	40620	0	Transversal (Y)	133	378	15	26	Pass
LTE B41_PC2	20	QPSK	1	0	40620	1	Transversal (Y)	129	381	15	26	Pass
LTE B25	1.4	QPSK	1	0	26340	1	Transversal (Y)	196	456	20	26	Pass

Report No.: HA411619B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode		RB offset	Channel	Probe Position	Ant Status	Primary Group Contiguous Point Count	Secondary Group Contiguous Point Count		Group wax	Margin	Ambient Noise dB (A/m)
6	LTE Band 7	20M	QPSK	1	0	21100	Transversal (Y)	Main PA	229	489	22	26	1.84	-49.1
7	LTE Band 12	10M	QPSK	1	0	23095	Transversal (Y)	Main PA	235	541	24	26	1.73	-50.1
8	LTE Band 13	10M	QPSK	1	0	23230	Transversal (Y)	Main PA	201	494	22	26	1.46	-50.7
9	LTE Band 14	10M	QPSK	1	0	23330	Transversal (Y)	Main PA	249	520	23	26	1.93	-49.7
10	LTE Band 25	20M	QPSK	1	0	26340	Transversal (Y)	Main PA	158	414	19	26	1.05	-50.6
10_1	LTE Band 25	20M	QPSK	1	0	26340	Transversal (Y)	Other PA	96	363	15	26	1.55	-49.6
11	LTE Band 26	15M	QPSK	1	0	26865	Transversal (Y)	Main PA	234	528	22	26	1.24	-50.7
12	LTE Band 30	10M	QPSK	1	0	27710	Transversal (Y)	Main PA	203	445	20	26	0.63	-50.3
13	LTE Band 66	20M	QPSK	1	0	132322	Transversal (Y)	Main PA	210	493	21	26	1.68	-50.8
13_1	LTE Band 66	20M	QPSK	1	0	132322	Transversal (Y)	Other PA	91	375	15	26	1.85	-50.5
14	LTE Band 71	20M	QPSK	1	0	133297	Transversal (Y)	Main PA	229	518	23	26	1.31	-49.9
15	LTE Band 41	20M	QPSK	1	0	40620	Transversal (Y)	Main PA	122	377	16	26	0.74	-49.1
16	LTE Band 48	20M	QPSK	1	0	55830	Transversal (Y)	Main PA	124	350	15	26	0.55	-49.7
16_1	LTE Band 48	20M	QPSK	1	0	55830	Transversal (Y)	Other PA	111	385	16	26	1.73	-50.5

 Sporton International Inc. (Shenzhen)
 Page: 19 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

8.4 VoNR Evaluation Results

<Codec Investigation>

5G NR FDD

	VoNR AMR Codec												
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel							
Primary Group Contiguous Point Count	156	175	180	172									
Secondary Group Contiguous Point Count	410	444	449	439									
Secondary Group Max Longitudinal	19	20	20	20	Transversal(Y)	FR1 n25 / 40M / 376500							
Secondary Group Max Transverse	26	26	26	26									
Frequency Response	1.29	1.32	1.04	0.92									

Report No.: HA411619B

			VoNR EV	/S Codec				
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
Primary Group Contiguous Point Count	159	187	161	163	164	174		
Secondary Group Contiguous Point Count	418	458	448	427	425	439		
Secondary Group Max Longitudinal	20	20	20	19	20	20	Transversal(Y)	FR1 n25 / 40M / 376500
Secondary Group Max Transverse	26	26	26	26	26	26		
Frequency Response	1.4	1.66	1.14	1.67	1.69	1.96		

Remark: According to codec investigation, the worst codec is NB AMR 4.75Kbps.

 Sporton International Inc. (Shenzhen)
 Page: 20 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

5G NR TDD

		VoNR A	MR Codec			
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel
Primary Group Contiguous Point Count	113	117	114	120		
Secondary Group Contiguous Point Count	341	349	340	349		
Secondary Group Max Longitudinal	14	15	15	15	Transversal(Y)	FR1 n41 / 100M / 518598
Secondary Group Max Transverse	26	26	26	26		
Frequency Response	1.1	2	1.63	2		

Report No.: HA411619B

			VoNR E	VS Codec				
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
Primary Group Contiguous Point Count	104	91	84	104	97	110		
Secondary Group Contiguous Point Count	330	319	335	329	333	335		
Secondary Group Max Longitudinal	14	13	14	14	14	14	Transversal(Y)	FR1 n41 / 100M / 518598
Secondary Group Max Transverse	26	26	26	26	26	26		
Frequency Response	1.38	1.81	1.99	2	0.35	1.22		

Remark: According to codec investigation, the worst codec is EVS WB 5.9Kbps.

 Sporton International Inc. (Shenzhen)
 Page: 21 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

<Air Interface Investigation>

Air Interface	BW (MHz)	Modulation / Mode	RB Size	RB offset	Channel	Probe Position	Primary Group Contiguous Point Count	Secondary Group Contiguous Point Count	Secondary Group Max Longitudinal	Secondary Group Max Transverse	Frequency Response
5G NR B41 PC3	100	DFT-PI/2 BPSK	1	1	518598	Transversal (Y)	104	334	14	26	Pass
5G NR B41 PC3	100	DFT-PI/2 BPSK	270	0	518598	Transversal (Y)	109	334	14	26	Pass
5G NR B41 PC3	100	DFT-QPSK	1	1	518598	Transversal (Y)	84	335	14	26	Pass
5G NR B41 PC3	100	DFT-16QAM	1	1	518598	Transversal (Y)	108	342	17	26	Pass
5G NR B41 PC3	100	DFT-64QAM	1	0	518598	Transversal (Y)	112	352	16	26	Pass
5G NR B41 PC3	100	DFT-256QAM	1	0	518598	Transversal (Y)	268	517	22	26	Pass
5G NR B41 PC3	100	CP-QPSK	1	1	518598	Transversal (Y)	115	336	16	26	Pass
5G NR B41 PC3	10	DFT-QPSK	1	1	518598	Transversal (Y)	129	355	17	26	Pass
5G NR B41 PC2	100	DFT-QPSK	1	1	518598	Transversal (Y)	103	328	14	26	Pass
5G NR B41 PC1.5 UL-MIMO	100	DFT-QPSK	1	1	518598	Transversal (Y)	78	337	16	26	Pass
5G NR B25	40	DFT-QPSK	1	1	376500	Transversal (Y)	171	407	18	26	Pass
5G NR B25	5	DFT-QPSK	1	1	376500	Transversal (Y)	176	428	18	26	Pass

Report No.: HA411619B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode		RB offset	Channel	Probe Position	Ant Status	Primary Group Contiguous Point Count	Secondary Group Contiguous Point Count	Secondary Group Max Longitudinal	Group Max	Frequency Response Margin [dB]	Ambient Noise dB (A/m)
17	FR1 n7	40M	QPSK	1	1	507000	Transversal (Y)	Main PA	177	456	20	26	0.53	-49
18	FR1 n12	15M	QPSK	1	1	141500	Transversal (Y)	Main PA	211	500	23	26	1.68	-50.3
19	FR1 n14	10M	QPSK	1	1	158600	Transversal (Y)	Main PA	223	507	23	26	1.55	-49.1
20	FR1 n25	40M	QPSK	1	1	376500	Transversal (Y)	Main PA	161	448	20	26	1.96	-50.8
20_1	FR1 n25	40M	QPSK	1	1	376500	Transversal (Y)	Other PA	144	403	19	26	1.79	-50.2
21	FR1 n26	20M	QPSK	1	1	166300	Transversal (Y)	Main PA	221	519	23	26	1.73	-49.9
22	FR1 n30	10M	QPSK	1	1	462000	Transversal (Y)	Main PA	178	463	20	26	1.64	-49.8
23	FR1 n66	40M	QPSK	1	1	349000	Transversal (Y)	Main PA	174	452	19	26	1.77	-49.8
23_1	FR1 n66	40M	QPSK	1	1	349000	Transversal (Y)	Other PA	104	378	18	26	1.8	-50.2
24	FR1 n70	15M	QPSK	1	1	340500	Transversal (Y)	Main PA	180	466	20	26	1.77	-49.1
25	FR1 n71	30M	QPSK	1	1	136100	Transversal (Y)	Main PA	220	511	23	26	1.96	-49.7
26	FR1 n41	100M	QPSK	1	1	518598	Transversal (Y)	Main PA	84	335	14	26	1.99	-50.5
26_1	FR1 n41	100M	QPSK	1	1	518598	Transversal (Y)	Other PA	78	337	16	26	1.42	-49.1
27	FR1 n48	40M	QPSK	1	1	641666	Transversal (Y)	Main PA	120	383	17	26	1.81	-50.8
27_1	FR1 n48	40M	QPSK	1	1	641666	Transversal (Y)	Other PA	104	351	15	26	1.73	-50.6
28	FR1 n77	100M	QPSK	1	1	656000	Transversal (Y)	Main PA	92	339	14	26	1.53	-50.1
28_1	FR1 n77	100M	QPSK	1	1	656000	Transversal (Y)	Other PA	77	349	16	26	1.5	-51
29	FR1 n78	100M	QPSK	1	1	636666	Transversal (Y)	Main PA	107	358	15	26	1.79	-50.8
29_1	FR1 n78	100M	QPSK	1	1	636666	Transversal (Y)	Other PA	79	346	16	26	1.58	-50.5

 Sporton International Inc. (Shenzhen)
 Page: 22 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

8.5 VoWiFi Evaluation Results

<Codec Investigation>

		VoWIFI AMR	Codec			
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / Channel
Primary Group Contiguous Point Count	133	139	138	143		
Secondary Group Contiguous Point Count	379	391	387	392		
Secondary Group Max Longitudinal	18	17	17	17	Transversal(Y)	2.4GHz WLAN / 6
Secondary Group Max Transverse	26	26	26	26		
Frequency Response	1.15	2	1.4	1.72		

Report No.: HA411619B

VoWIFI EVS Codec									
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel	
Primary Group Contiguous Point Count	127	123	126	126	115	125		2.4GHz WLAN / 6	
Secondary Group Contiguous Point Count	373	371	384	375	379	372			
Secondary Group Max Longitudinal	17	18	18	16	18	16	Transversal(Y)		
Secondary Group Max Transverse	26	26	26	26	26	26			
Frequency Response	1.03	2	1.06	2	1.08	1.08			

Remark: According to codec investigation, the worst codec is EVS NB 5.9Kbps.

 Sporton International Inc. (Shenzhen)
 Page: 23 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

<Air Interface Investigation>

Air Interface	BW (MHz)	Modulation / Mode	Channel	Probe Position	Primary Group Contiguous Point Count	Secondary Group Contiguous Point Count	Secondary Group Max Longitudinal	Secondary Group Max Transverse	Frequency Response
802.11b	20	1M	6	Transversal (Y)	123	371	18	26	Pass
802.11g	20	6M	6	Transversal (Y)	173	443	20	26	Pass
802.11n-HT20	20	MCS0	6	Transversal (Y)	124	378	19	26	Pass
802.11n-HT40	40	MCS0	6	Transversal (Y)	195	475	21	26	Pass
802.11ax-HE20	20	MCS0	6	Transversal (Y)	207	484	21	26	Pass
802.11ax-HE40	40	MCS0	6	Transversal (Y)	188	467	21	26	Pass
802.11b	20	11M	6	Transversal (Y)	126	376	19	26	Pass
802.11a	20	6M	36	Transversal (Y)	224	489	23	26	Pass
802.11n-HT20	20	MCS0	36	Transversal (Y)	192	484	22	26	Pass
802.11n-HT40	40	MCS0	38	Transversal (Y)	194	478	21	26	Pass
802.11ac-VHT20	20	MCS0	36	Transversal (Y)	198	485	20	26	Pass
802.11ac-VHT40	40	MCS0	38	Transversal (Y)	197	480	20	26	Pass
802.11ac-VHT80	80	MCS0	42	Transversal (Y)	238	508	23	26	Pass
802.11ac-VHT160	160	MCS0	50	Transversal (Y)	230	500	23	26	Pass
802.11ax-HE20	20	MCS0	36	Transversal (Y)	154	418	20	26	Pass
802.11ax-HE40	40	MCS0	38	Transversal (Y)	231	495	23	26	Pass
802.11ax-HE80	80	MCS0	42	Transversal (Y)	225	485	23	26	Pass
802.11ax-HE160	160	MCS0	50	Transversal (Y)	196	449	19	26	Pass
802.11ax-HE20	20	MCS11	36	Transversal (Y)	168	452	19	26	Pass

Report No.: HA411619B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode	Channel	Probe Position	Group	Secondary Group Contiguous Point Count	Secondary Group Max Longitudinal	Group Max	Margin	Ambient Noise dB (A/m)
30	WLAN2.4GHz	20	802.11b 1Mbps	6	Transversal (Y)	104	361	19	26	0.94	-49
31	WLAN5GHz	20	802.11ax-HE20 MCS0	44	Transversal (Y)	165	444	22	26	2	-49.6
32	WLAN5GHz	20	802.11ax-HE20 MCS0	60	Transversal (Y)	183	457	20	26	1.65	-50
33	WLAN5GHz	20	802.11ax-HE20 MCS0	116	Transversal (Y)	153	429	20	26	1.54	-50.1
34	WLAN5GHz	20	802.11ax-HE20 MCS0	157	Transversal (Y)	178	452	19	26	1.11	-49.4
35	WLAN6GHz	20	802.11ax-HE20 MCS0	1	Transversal (Y)	161	434	21	26	1.43	-49.36

Remark

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- 2. Hearing Aid mode (Phone -> Setting ->Accessibility->Hearing aids) was set to on for improving the audio signal performance for HAC T-Coil compliance.

Test Engineer: Hank Huang, Kevin Xu, David Dai, Bin He

 Sporton International Inc. (Shenzhen)
 Page: 24 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024

9. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA411619B

The judgment of conformity in the report is based on the measurement results excluding the measurement uncertainty.

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABMd)	Ci (ABMu)	Standard Uncertainty (ABMd) (±%)	Standard Uncertainty (ABMu) (±%)		
Probe Sensitivity									
Reference Level	3.0	Normal	1	1	1	3.0	3.0		
AMCC Geometry	0.4	Rectangular	√3	1	1	0.2	0.2		
AMCC Current	1.0	Rectangular	√3	1	1	0.6	0.6		
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	0.1	0.1		
Noise Contribution	0.7	Rectangular	√3	0.0143	1	0.0	0.4		
Frequency Slope	5.9	Rectangular	√3	0.1	1	0.3	3.4		
		Probe Sy	stem						
Repeatability / Drift	1.0	Rectangular	√3	1	1	0.6	0.6		
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	0.3	0.3		
Acoustic Noise	1.0	Rectangular	√3	0.1	1	0.1	0.6		
Probe Angle	1.0	Rectangular	√3	1	1	0.6	0.6		
Spectral Processing	0.9	Rectangular	√3	1	1	0.5	0.5		
Integration Time	0.6	Normal	1	1	5	0.6	3.0		
Field Disturbation	0.2	Rectangular	√3	1	1	0.1	0.1		
		Test Sig	ınal						
Reference Signal Spectral Response	0.6	Rectangular	√3	0.0	0.3	0.0	0.3		
		Position	ing						
Probe Positioning	1.9	Rectangular	√3	1	1	1.1	1.1		
Phantom Thickness	0.9	Rectangular	√3	1	1	0.5	0.5		
EUT Positioning	1.9	Rectangular	√3	1	1	1.1	1.1		
External Contributions									
RF Interference	0.0	Rectangular	√3	1	0.3	0.0	0.0		
Test Signal Variation	2.0	Rectangular	√3	1	1	1.2	1.2		
	3.9%	6.0%							
Coverage Factor for 95 %							K = 2		
Expanded Uncertainty							11.9 %		

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

Comments and Explanations:

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification

Uncertainty Budget of audio band magnetic measurement

Sporton International Inc. (Shenzhen) Page: 25 of 26 TEL: +86-755-86379589 / FAX: +86-755-86379595 Issued Date: Mar. 25, 2024



SPORTON LAB. HAC T-COIL TEST REPORT

10. References

[1] ANSI C63.19-2019, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", Aug. 2019.

Report No.: HA411619B

- [2] FCC KDB 285076 D01v06r04, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep. 2023.
- [3] FCC KDB 285076 D02v04, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Feb 2022
- [4] FCC KDB 285076 D03v01r06, "Hearing aid compatibility frequently asked questions", Jul. 2022
- [5] SPEAG DASY System Handbook

 Sporton International Inc. (Shenzhen)
 Page: 26 of 26

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Issued Date: Mar. 25, 2024