HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : IHDT56AP7

Equipment: Mobile Cellular Phone

Brand Name: Motorola Model Name: XT2425-4

T-Rating: T4

Applicant : Motorola Mobility LLC

222 W. Merchandise Mart Plaza, Chicago IL 60654, USA

Manufacturer: Motorola Mobility LLC

222 W. Merchandise Mart Plaza, Chicago IL 60654, USA

Standard: FCC 47 CFR §20.19

ANSI C63.19-2011

We, Sporton International Inc. (Shenzhen), would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Shenzhen), the test report shall not be reproduced except in full.

Si Zhang

IIAC-MRA



Report No.: HA3O1717-04B

Approved by: Si Zhang

Sporton International Inc. (Shenzhen)

1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China

 Sporton International Inc. (Shenzhen)
 Page 1 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422



SPORTON LAB. HAC T-COIL TEST REPORT

Table of Contents

1.	Attestation of Test Results	4
2.		5
3.		6
4.	•	6
5.	• •	7
6.		8
•		
		<u>C</u>
7.	T-Coil Test Procedure	10
	7.1 Test Flow Chart	11
	7.2 Test Setup Diagram for GSM/UMTS/Vol	TE/VoWiFi12
8.	Test Equipment List	14
9.	T-Coil testing for CMRS Voice	15
	9.1 GSM Tests Results	15
	9.2 UMTS Tests Results	16
10.	T-Coil testing for CMRS IP Voice	17
	10.1 VoLTE Tests Results	17
11.	Uncertainty Assessment	22
12.	References	23

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

TEL: +86-755-86379589 / FAX: +86-755-86379595

Issued Date Form version.

: Nov. 15, 2023

Report No.: HA3O1717-04B

: 210422

History of this test report

Report No.: HA3O1717-04B

Report No.	Version	Description	Issued Date
HA3O1717-04B	Rev. 01	Initial issue of report	Nov. 15, 2023

 Sporton International Inc. (Shenzhen)
 Page 3 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency Response	Magnetic Intensity		
COM ONDO V	GSM850	T4	Pass	Pass		
GSM CMRS Voice	GSM1900	T4	Pass	Pass		
UMTS CMRS Voice	Band II	T4	Pass	Pass		
UIVITS CIVIRS VOICE	Band V	T4	Pass	Pass		
	Band 2	T4	Pass	Pass		
\/-! TE	Band 5	T4	Pass	Pass		
VoLTE	Band 7	T4	Pass	Pass		
	Band 41/38	T4	Pass	Pass		
	2450	T4	Pass	Pass		
	5200	T4	Pass	Pass		
VoWiFI	5300	T4	Pass	Pass		
	5500	T4	Pass	Pass		
	5800	T4	Pass	Pass		
Date Tested	2023/10/27~2023/10/31					

Report No.: HA3O1717-04B

- The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.
- 2. This is partial report for CMRS voice T-Coil testing . VOIP test report will be separately submitted.

 Sporton International Inc. (Shenzhen)
 Page 4 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

2. General Information

	Product Feature & Specification					
Applicant Name	Motorola Mobility LLC					
Equipment Name Mobile Cellular Phone						
Brand Name	Motorola					
Model Name	XT2425-4					
IMEI Code	Sample 1 IMEI 1: 351966220010083 IMEI 2: 351966220011396 Sample 2 IMEI 1: 351966220011834 IMEI 2: 351966220012709					
FCC ID	IHDT56AP7					
HW	DVT2					
SW	UTA34.66					
EUT Stage	Identical Prototype					
Frequency Band	GSM850: 824 MHz ~ 849 MHz GSM1900: 1850 MHz ~ 1910 MHz WCDMA Band II: 1850 MHz ~ 1910 MHz WCDMA Band V: 824 MHz ~ 849 MHz LTE Band 2: 1850 MHz ~ 1910 MHz LTE Band 5: 824 MHz ~ 849 MHz LTE Band 7: 2500 MHz ~ 2570 MHz LTE Band 38: 2570 MHz ~ 2620 MHz LTE Band 41: 2535 MHz ~ 2655 MHz WLAN 2.4GHz Band: 2412 MHz ~ 2462 MHz WLAN 5.2GHz Band: 5180 MHz ~ 2540 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5500 MHz ~ 5720 MHz WLAN 5.5GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz					
Mode	GSM/GPRS/EGPRS AMR / RMC 12.2Kbps HSDPA HSUPA DC-HSDPA HSPA+ (16QAM uplink is supported) LTE: QPSK, 16QAM, 64QAM WLAN 2.4GHz: 802.11b/g/n HT20/ HT40 WLAN 5GHz: 802.11a/n/ac HT20/HT40/VHT20/VHT80 Bluetooth BR/EDR/LE NFC:ASK					

Report No.: HA3O1717-04B

 Sporton International Inc. (Shenzhen)
 Page 5 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

3. Testing Location

Sporton International Inc. (Shenzhen) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.01.

Report No.: HA3O1717-04B

Testing Laboratory						
Test Firm	Sporton International Inc. (Shenzhen)					
Test Site Location	1/F, 2/F, Bldg 5, Shiling Industrial Zone, Xinwei Village, Xili, Nanshan, Shenzhen, 518055 People's Republic of China TEL: +86-755-86379589 FAX: +86-755-86379595					
Took Site No	Sporton Site No.	No. FCC Designation No. FCC Test Firm Regis				
Test Site No.	SAR01-SZ	CN1256	421272			

4. Applied Standards

- FCC CFR47 Part 20.19
- · ANSI C63.19-2011
- FCC KDB 285076 D01 HAC Guidance v06r04
- FCC KDB 285076 D02 T-Coil testing v04
- · FCC KDB 285076 D03 HAC FAQ v01r06

 Sporton International Inc. (Shenzhen)
 Page 6 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction	
	GSM850	VO	Yes	WLAN, BT	CMRS Voice	No	
0014	GSM1900	VO		WLAN, BT	CIVIRS VOICE	No	
GSM	EDGE850	VD	Yes	WLAN, BT	Google Meet ⁽¹⁾	No	
	EDGE1900	۷D	168	WLAN, BT	Google Meet	No	
	Band II	\/O	Vaa	WLAN, BT	CMDC Vains	No	
UMTS	Band V	VO	Yes	WLAN, BT	CMRS Voice	No	
	HSPA	VD	Yes	WLAN, BT	Google Meet ⁽¹⁾	No	
	Band 2			WLAN, BT	VoLTE / Google Meet ⁽¹⁾	No	
LTE (FDD)	Band 5	VD	Yes	WLAN, BT		No	
(100)	Band 7			WLAN, BT		No	
LTE	Band 38	. / 5		WLAN, BT	VoLTE	No	
(TDD)	Band 41	VD	Yes	WLAN, BT	Google Meet ⁽¹⁾	No	
	2450	VD	Yes	GSM,WCDMA,LTE	_	No	
	5200				VoWiFi ⁽¹⁾	No	
Wi-Fi	5300	VD	Voc	CSM WCDMA LTE	1	No	
	5500	VD Yes	VD Yes	res	GSM,WCDMA,LTE	Google Meet ⁽¹⁾	No
	5800					No	
BT	2450	DT	No	GSM,WCDMA,LTE	NA	No	

Report No.: HA3O1717-04B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

Remark:

- 1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.
- The device have similar frequency in some LTE bands: LTE B38/41, since the supported frequency spans for the smaller LTE bands
 are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid
 compliance.
- 3. This is partial report for CMRS voice T-Coil testing . VOIP test report will be separately submitted.
- 4. There are two samples, the different between them refer to the XT2425-4_Operational Description of Product Equality Declaration which is exhibit separately. According to the differences, so sample 1 was chosen to perform full testing and sample 2 verified the worst case of sample 1.

 Sporton International Inc. (Shenzhen)
 Page 7 of 23
 Issued Date
 : Nov. 15, 2023


 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA3O1717-04B

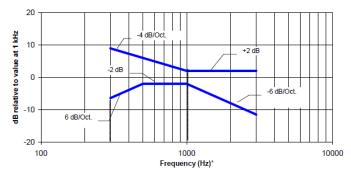

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

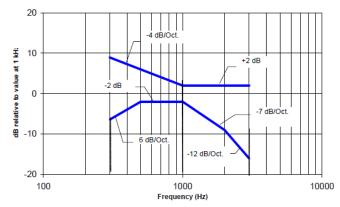

NOTE—The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

 Sporton International Inc. (Shenzhen)
 Page 8 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

6.3 <u>Description of EUT Test Position</u>

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA3O1717-04B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

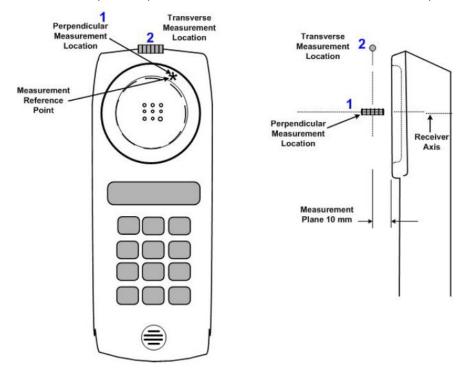


Fig.3 A typical EUT reference and plane for T-Coil measurements

 Sporton International Inc. (Shenzhen)
 Page 9 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

SPORTON LAB. HAC T-COIL TEST REPORT

7. <u>T-Coil Test Procedure</u>

Referenced to ANSI C63.19-2011, Section 7.4

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA3O1717-04B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.


The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

 Sporton International Inc. (Shenzhen)
 Page 10 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422


7.1 Test Flow Chart

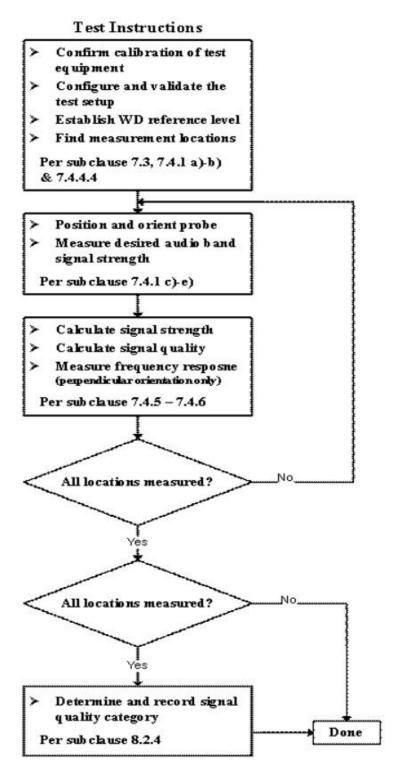

Report No.: HA3O1717-04B

Fig. 2 T-Coil Signal Test flowchart

7.2 Test Setup Diagram for GSM/UMTS/VoLTE/VoWiFi

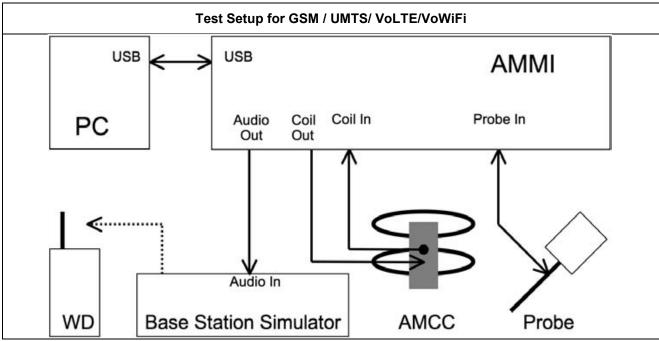

Report No.: HA3O1717-04B

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v04:
 - GSM input level: -16dBm0UMTS input level: -16dBm0
 - VoLTE input level: -16dBm0
 - VoWiFi input level: -20dBm0
- 2. For GSM / UMTS test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. Voice over Long-Term Evolution (VoLTE) is a standard for high-speed wireless communication for mobile phones and data terminals including IoT devices and wearables. It is based on the IP Multimedia Subsystem (IMS) network, with specific profiles for control and media planes of voice service on LTE defined by GSMA in PRD IR.92. This approach results in the voice service (control and media planes) being delivered as data flows within the LTE data bearer. This means that there is no dependency on the legacy circuit-switched voice network to be maintained
- 5. The test setup used for VoLTE and VoWiFI over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- 6. According to KDB 285076 D02, T-Coil testing for VoLTE and VoWiFi requires test instrumentation that can (1) for the system to be able to establish an IP call from/to the handset under test, (2) through an IMS (IP Multimedia Subsystem) and SIP/IP server, (3) to an analog audio adapter containing the permissible set of codecs used by the device under test, and (4) inject the necessary C63.19 test tones at the average speech level for the measurement The test setup is illustrated in Figure 3.9. The R&S CMW500 was used as system simulator for VoLTE and VoWiFi T-Coil testing. The DAU (Data Application Unit) in CMW500 integrates IMS and SIP/IP server that can establish VoLTE and Wi-Fi calling, and transport the test tones from AMMI (Audio Magnetic Measuring Instrument) to EUT.

 Sporton International Inc. (Shenzhen)
 Page 12 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

SPORTON LAB. HAC T-COIL TEST REPORT

<Define the input level for GSM/UMTS>

The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA3O1717-04B

The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

<Example define the input level for GSM/UMTS>

-=								
Gain Value	20* log(gain)	AMCC Coil In	Level					
(linear)	dB	(dBv RMS)	dBm0					
		-2.47	3.14					
10	20	-19.85	-14.24					
8.17	18.24	-21.61	-16					

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

<Example define the input level for Vol TE>

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)
	3.14	1.5		0.51	
100	5.57		40	2.94	3.09
8.35	-16		18.43		-18.48
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting
1kHz sine	-	3	0	1	8.35
48k_voice_1kHz	1	16.2	-12.7	4.33	36.15

<Example define the input level for VoWiFi>

~Example define	Example define the input level for vovin is								
Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)				
	3.14	1.5		0.51					
100	5.57		40	2.94	3.09				
5.27	-20		14.43		-22.48				
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting				
1kHz sine	-	3	0	1	5.27				
48k_voice_1kHz	1	16.2	-12.7	4.33	22.81				
48k_voice_300-3000	2	21.6	-18.6	8.48	44.67				

Issued Date Sporton International Inc. (Shenzhen) Page 13 of 23 : Nov. 15, 2023 Form version. TEL: +86-755-86379589 / FAX: +86-755-86379595 : 210422



8. Test Equipment List

Manufacturer	Name of Equipment	Type/Model	Serial Number	Calibration			
Manufacturer	Name of Equipment	i ype/wodei	Serial Nulliber	Last Cal.	Due Date		
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3106	Dec. 13, 2022	Dec. 12, 2023		
SPEAG	Data Acquisition Electronics	DAE4	1386	Jul. 17, 2023	Jul. 16, 2024		
SPEAG	Audio Magnetic Calibration Coil	AMCC	1128	NCR	NCR		
SPEAG	Audio Measuring Instrument	AMMI	1137	NCR	NCR		
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR		
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR		
R&S	Base Station(Measure)	CMU200	108440	Dec. 27, 2022	Dec. 26, 2023		
R&S	Base Station(Measure)	CMW500	157651	Jan. 04, 2023	Jan. 03, 2024		
Anymetre	Thermo-Hygrometer	JR593	2020062101	Jul. 08, 2023	Jul. 07, 2024		

Report No.: HA3O1717-04B

Note:

1. NCR: "No-Calibration Required"

 Sporton International Inc. (Shenzhen)
 Page 14 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

9. T-Coil testing for CMRS Voice

General Note:

- Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.
- Air Interface Investigation:
 - Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.

Report No.: HA3O1717-04B

According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

9.1 GSM Tests Results

<Codec Investigation>

	GSM Codec										
Codec	AMR NB FR	AMR WB FR	GSM EFR (FR V2)	Orientation	Band / Channel						
ABM 1 (dBA/m)	6.22	7.49	6.44								
ABM 2 (dBA/m)	-24.47	-24.39	-24.52	Assign	CCM050 / 400						
Signal Quality (dB)	30.69	31.88	30.96	Axial	GSM850 / 189						
Freq. Response	PASS	PASS	PASS								

Remark: According to codec investigation, the worst codec is AMR NB FR.

<Air Interface Investigation>

Plo No	t Air Interface	Modulation / Mode	Channel	Sample	Probe Position	dB	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response														
1	GSM850	Voice	189	1	Axial (Z)	6.22	-24.47	30.69	T4	-50.88	1.41	PASS														
1	GSIVIOSU	voice	109	1	Transversal (Y)	-6.83	-44.84	38.01	T4	-50.85	1.41	PASS														
1	GSM850	Voice	100	2	Axial (Z)	6.15	-28.44	34.59	T4	-53.92	1.45	DACC														
1_	GSIVIOSO	Voice	189	189	189	189	189	189	189	189	189	189	189	189	189	189	189	2	Transversal (Y)	-4.37	-41.69	37.32	T4	-53.54	1.45	PASS
_	CSM1000	Voice	661	1	Axial (Z)	6.21	-29.90	36.11	T4	-51.23	1.67	PASS														
2	GSM1900	voice	661	ı	Transversal (Y)	-3.83	-44.76	40.93	T4	-50.74	1.67	PASS														

Sporton International Inc. (Shenzhen) Page 15 of 23 Issued Date : Nov. 15, 2023 Form version. TEL: +86-755-86379589 / FAX: +86-755-86379595 : 210422

9.2 <u>UMTS Tests Results</u>

<Codec Investigation>

			UMTS AMR Codec				
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel	
ABM 1 (dBA/m)	7.55	8.13	7.62	8.76			
ABM 2 (dBA/m)	-45.19	-45.36	-45.57	-45.53	Assizal	DE / 4400	
Signal Quality (dB)	52.74	53.49	53.19	54.29	Axial	B5 / 4182	
Freq. Response	PASS	PASS	PASS	PASS			

Report No.: HA3O1717-04B

Remark: According to codec investigation, the worst codec is NB AMR 4.75Kbps.

<Air Interface Investigation>

PI N	lot lo.	Air Interface	Modulation / Mode	Channel	Sample	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	-	Ambient Noise dB (A/m)	Response	Frequency Response
	2	WCDMA V	Voice	4182	1	Axial (Z)	7.55	-45.19	52.74	T4	-50.69	1.36	PASS
,	3	VVCDIVIA V	Voice	4102	1	Transversal (Y)	-0.18	-46.36	46.18	T4	-50.84	1.30	PASS
	4	WCDMA II	Voice	9400	1	Axial (Z)	8.00	-45.64	53.64	T4	-50.77	1.33	PASS
'	4	WCDMA II	Voice	9400	'	Transversal (Y)	-0.17	-46.57	46.40	T4	-51.23	1.33	PASS

Sporton International Inc. (Shenzhen) Page 16 of 23 Issued Date : Nov. 15, 2023 TEL: +86-755-86379589 / FAX: +86-755-86379595 Form version. : 210422

10. T-Coil testing for CMRS IP Voice

10.1 VoLTE Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

Report No.: HA3O1717-04B

2. Air Interface Investigation:

- a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
- b. Select LTE FDD/TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration, the observed variation is very little to be within 1.5 dB which is much less than the margin from the rating threshold.
- c. The TDD LTE power class 3 supports uplink-downlink configuration 0 to 6 for this device, an investigation was performed to determine the worst-case uplink-downlink configuration to be used for the testing for the handset.
- d. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

LTE FDD

			VoLTE AMR Codec	:		
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	5.35	3.98	4.39	4.63		
ABM 2 (dBA/m)	-46.39	-47.31	-46.2	-47.16	Axial	B2 / 20M /18900
Signal Quality (dB)	51.74	51.29	50.59	51.79		B2 / 20W / 10900
Freq. Response	PASS	PASS	PASS	PASS		

			Vo	oLTE EVS Code	ес			
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	5.37	4.82	-5.28	5.29	-0.78	4.75		
ABM 2 (dBA/m)	-47.57	-47.43	-47.89	-47.1	-47.4	-47.23	-	B2 / 20M
Signal Quality (dB)	52.94	52.25	42.61	52.39	46.62	51.98	Axial	/18900
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is EVS WB 5.9Kbps

 Sporton International Inc. (Shenzhen)
 Page 17 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

LTE TDD

			VoLTE AMR Codec	;		
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	5.64	6.21	5.76	6.61		
ABM 2 (dBA/m)	-46.45	-46.94	-46.68	-46.94		B41 / 20M /
Signal Quality (dB)	52.09	53.15	52.44	53.55	Axial	40620
Freq. Response	PASS	PASS	PASS	PASS		

Report No.: HA3O1717-04B

			Vo	oLTE EVS Code	ec			
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	7	6.28	5.89	5.75	0.48	5.87		
ABM 2 (dBA/m)	-45.82	-45.99	-46.22	-45.67	-45.84	-45.23	Axial	B41 / 20M /
Signal Quality (dB)	52.82	52.27	52.11	51.42	46.32	51.1	Axiai	40620
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is EVS NB 5.9Kbps

Sporton International Inc. (Shenzhen) Page 18 of 23 Issued Date : Nov. 15, 2023 TEL: +86-755-86379589 / FAX: +86-755-86379595 Form version. : 210422



SPORTON LAB. HAC T-COIL TEST REPORT

<Air Interface Investigation>

Plot No.	Air Interface	BW (MHz)	Modulation / Mode	RB Size	RB offset	Channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B2	20	QPSK	1	0	18900		-5.28	-47.89	42.61
	LTE B2	20	QPSK	50	0	18900		2.43	-47.25	49.68
	LTE B2	20	QPSK	100	0	18900		2.84	-47.30	50.14
	LTE B2	20	16QAM	1	0	18900		0.88	-46.03	46.91
FDD	LTE B2	20	64QAM	1	0	18900		0.19	-49.82	50.01
FDD	LTE B2	15	QPSK	1	0	18900		1.55	-42.59	44.14
	LTE B2	10	QPSK	1	0	18900		2.43	-45.76	48.19
	LTE B2	5	QPSK	1	0	18900		1.53	-48.15	49.68
	LTE B2	3	QPSK	1	0	18900		0.41	-47.93	48.34
	LTE B2	1.4	QPSK	1	0	18900		2.86	-47.03	49.89
	LTE B41_PC3	20	QPSK	1	0	40620	0	0.48	-45.84	46.32
	LTE B41_PC3	20	QPSK	1	0	40620	1	6.01	-45.18	51.19
	LTE B41_PC3	20	QPSK	1	0	40620	2	5.89	-45.42	51.31
TDD	LTE B41_PC3	20	QPSK	1	0	40620	3	5.70	-44.86	50.56
	LTE B41_PC3	20	QPSK	1	0	40620	4	6.11	-44.94	51.05
	LTE B41_PC3	20	QPSK	1	0	40620	5	5.96	-44.78	50.74
	LTE B41_PC3	20	QPSK	1	0	40620	6	5.18	-45.32	50.50

Report No.: HA3O1717-04B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode	Channel	Sample	Probe Position	dB	ABM2 dB (A/m)	Signal Quality dB		Ambient Noise dB (A/m)	Response	Frequency Response
5	LTE Band 2	20M	QPSK	18900	1	Axial (Z)	1.83	-47.92	49.75	T4	-50.79	2	PASS
5	LIE Dallu Z	ZUIVI	QFSK	10900		Transversal (Y)	-6.72	-45.96	39.24	T4	-50.28	2	PASS
6	LTE Band 5	10M	QPSK	20525	1	Axial (Z)	3.11	-47.90	51.01	T4	-50.66	1 00	PASS
О	LIE Danu 3	TUIVI	QPSK	20525	1	Transversal (Y)	-14.33	-52.47	38.14	T4	-50.78	1.88	PASS
7	ITC Dated 7	20M	QPSK	21100	4	Axial (Z)	2.54	-47.46	50.00	T4	-50.65	0	PASS
′	LTE Band 7	ZUIVI	QPSK	21100	1	Transversal (Y)	-5.36	-46.16	40.80	T4	-50.49	2	PASS
8	LTE Band 41	20M	ODCK	40620	1	Axial (Z)	2.41	-43.80	46.21	T4	-50.63	1 20	DACC
0	LIE Dand 41	ZUIVI	QPSK	40620	1	Transversal (Y)	-3.82	-39.44	35.62	T4	-51.22	1.29	PASS

 Sporton International Inc. (Shenzhen)
 Page 19 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

10.2VoWiFi Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations
(WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It
is only necessary to document this for one channel/band, the following worst investigation codec would be remarked
to be used for the testing for the handset.

Report No.: HA3O1717-04B

- 2. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
 - b. Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
 - According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

			VoWIFI AMR Coded			
Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	4.51	5.11	4.94	5.48		
ABM 2 (dBA/m)	-44.9	-44.34	-44.89	-44.30	Avial	2.4GHz WLAN /
Signal Quality (dB)	49.41	49.45	49.83	49.78	— Axial	6
Freq. Response	PASS	PASS	PASS	PASS		

VoWIFI EVS Codec										
Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel		
ABM 1 (dBA/m)	5.92	5.67	0.38	6.05	1.8	5.14		2.4GHz WLAN / 6		
ABM 2 (dBA/m)	-45.1	-44.57	-44.72	-44.02	-44.87	-45.52	Axial			
Signal Quality (dB)	51.02	50.24	45.1	50.07	46.67	50.66	Axidi			
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS				

Remark: According to codec investigation, the worst codec is EVS WB 5.9Kbps.

 Sporton International Inc. (Shenzhen)
 Page 20 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422



<Air Interface Investigation>

Plot No.	Air Interface	BW (MHz)	Modulation / Mode	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	802.11b	20	1M	6	0.38	-44.72	45.10
	802.11b	20	11M	6	3.64	-44.86	48.50
	802.11g	20	6M	6	2.57	-45.24	47.81
M// ANI O 4011	802.11g	20	54M	6	-1.20	-46.73	45.53
WLAN 2.4GHz	802.11n-HT20	20	MCS0	6	4.47	-46.96	51.43
	802.11n-HT20	20	MCS7	6	5.75	-44.89	50.64
	802.11n-HT40	40	MCS0	6	4.11	-41.37	45.48
	802.11n-HT40	40	MCS7	6	4.60	-45.72	50.32
	802.11a	20	6M	40	4.22	-46.02	50.24
	802.11a	20	54M	40	2.77	-46.17	48.94
	802.11an-HT20	20	MCS0	40	4.24	-46.40	50.64
	802.11an-HT20	20	MCS7	40	4.18	-46.02	50.20
	802.11an-HT40	40	MCS0	38	2.56	-46.33	48.89
	802.11an-HT40	40	MCS7	38	4.79	-46.42	51.21
WLAN 5GHz	802.11ac-VHT20	20	MCS0	40	2.27	-46.51	48.78
	802.11ac-VHT20	20	MCS8	40	4.76	-46.75	51.51
	802.11ac-VHT40	40	MCS0	38	4.51	-46.44	50.95
	802.11ac-VHT40	40	MCS8	38	3.46	-46.34	49.80
	802.11ac-VHT80	80	MCS0	42	4.28	-45.75	50.03
	802.11ac-VHT80	80	MCS8	42	3.86	-45.77	49.63

Report No.: HA3O1717-04B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode	Channel	Sample	Probe Position	dB	ABM2 dB (A/m)	Signal Quality dB		Ambient Noise dB (A/m)	Response	Frequency Response
0	WI AN 2 4C	20	802.11b-1Mbps	6	1	Axial (Z)	4.73	-45.52	50.25	T4	-50.74	1.49	PASS
9	9 WLAN 2.4G	20				Transversal (Y)	-5.68	-43.84	38.16	T4	-50.63		
10	10 WLAN 5G 20	20	802.11ac-VHT20	40	1	Axial (Z)	3.93	-45.31	49.24	T4	-50.29	1.79	PASS
10		20	MCS0	40		Transversal (Y)	-5.12	-44.34	39.22	T4	-51.07		
11	11 WLAN 5G 2	20	802.11ac-VHT20 MCS0	56	1	Axial (Z)	4.55	-46.03	50.58	T4	-50.79	1.94	PASS
11		20				Transversal (Y)	-9.65	-48.30	38.65	T4	-50.68		
12	12 WLAN 5G 2	20	802.11ac-VHT20 MCS0	116	1	Axial (Z)	3.80	-45.53	49.33	T4	-50.43	1.99	PASS
12				110		Transversal (Y)	-3.68	-44.27	40.59	T4	-50.29		
13	13 WLAN 5G	20	802.11ac-VHT20	157	1	Axial (Z)	3.33	-45.16	48.49	T4	-50.77	2	PASS
13 WLAN 3G	20	MCS0	137	'	Transversal (Y)	-4.14	-44.31	40.17	T4	-50.29	2	PASS	

Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- 2. The detail frequency response results please refer to appendix A.

Test Engineer: Hank Huang, Kevin Xu, David Dai, Bin He

 Sporton International Inc. (Shenzhen)
 Page 21 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422

11. <u>Uncertainty Assessment</u>

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2. The judgment of conformity in the report is based on the measurement results excluding the measurement uncertainty.

Report No.: HA3O1717-04B

Error Description	Uncertainty Value (±%)	Probability	Divisor	(Ci) ABM1	(Ci) ABM2	Standard Uncertainty (ABM1) (±%)	Standard Uncertainty (ABM2) (±%)
Probe Sensitivity							
Reference Level	3.0	N	1	1	1	3.0	3.0
AMCC Geometry	0.4	R	1.732	1	1	0.2	0.2
AMCC Current	1.0	R	1.732	1	1	0.6	0.6
Probe Positioning during Calibr.	0.1	R	1.732	1	1	0.1	0.1
Noise Contribution	0.7	R	1.732	0.014	1	0.0	0.4
Frequency Slope	5.9	R	1.732	0.1	1	0.3	3.4
Probe System							
Repeatability / Drift	1.0	R	1.732	1	1	0.6	0.6
Linearity / Dynamic Range	0.6	R	1.732	1	1	0.3	0.3
Acoustic Noise	1.0	R	1.732	0.1	1	0.1	0.6
Probe Angle	2.3	R	1.732	1	1	1.3	1.3
Spectral Processing	0.9	R	1.732	1	1	0.5	0.5
Integration Time	0.6	N	1	1	5	0.6	3.0
Field Distribution	0.2	R	1.732	1	1	0.1	0.1
Test Signal							
Ref. Signal Spectral Response	0.6	R	1.732	0	1	0.0	0.3
Positioning							
Probe Positioning	1.9	R	1.732	1	1	1.1	1.1
Phantom Thickness	0.9	R	1.732	1	1	0.5	0.5
DUT Positioning	1.9	R	1.732	1	1	1.1	1.1
External Contributions							
RF Interference	0.0	R	1.732	1	0.3	0.0	0.0
Test Signal Variation	2.0	R	1.732	1	1	1.2	1.2
Com	4.0%	6.1%					
Coverage Factor for 95 %							K=2
Expanded STD Uncertainty							12.2%

Table 8.2 Uncertainty Budget of audio band magnetic measurement

 Sporton International Inc. (Shenzhen)
 Page 22 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422



12. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA3O1717-04B

- [2] FCC KDB 285076 D01v06r04, "Equipment Authorization Guidance for Hearing Aid Compatibility", September 29, 2023
- [3] FCC KDB 285076 D02 v04, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Feb. 23, 2022
- [4] FCC KDB 285076 D03v01r06, "Hearing aid compatibility frequently asked questions", July 20, 2022
- [5] SPEAG DASY System Handbook

----THE END-----

 Sporton International Inc. (Shenzhen)
 Page 23 of 23
 Issued Date
 : Nov. 15, 2023

 TEL: +86-755-86379589 / FAX: +86-755-86379595
 Form version.
 : 210422