Hearing Aid Compatibility (HAC) T-Coil Test Report

APPLICANT : Motorola Mobility LLC

EQUIPMENT: Mobile Cellular Phone

BRAND NAME: Motorola

MODEL NAME : XT1922-5, XT1922-4

FCC ID : IHDT56XB5

T-RATING: T3

STANDARD : FCC 47 CFR §20.19

ANSI C63.19-2011

We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures and shown the compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Eric Huang / Manager

Approved by: Jones Tsai / Manager





Report No.: HA7D0423B

SPORTON INTERNATIONAL INC.

No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: **IHDT56XB5** Page Number : 1 of 20 Report Issued Date : Feb. 07, 2018

Report Version : Rev. 01



SPORTON LAB. FCC HAC T-Coil Test Report

Report No.: HA7D0423B

Table of Contents

1.	Attestation of Test Summary	4
2.	General Information	
3.	Administration Data	
4.	Applied Standards	
5.	Air Interface and Operating Mode	
6.	Measurement standards for T-Coil	
	6.1 Frequency Response	
	6.2 T-Coil Signal Quality Categories	
7.	T-Coil Test Procedure	
	7.1 Test Flow Chart	
	7.2 Test Setup Diagram	
	7.3 Description of EUT Test Position	13
8.	Test Equipment List	14
9.	T-Coil testing for CMRS Voice	15
	9.1 GSM Tests Results	
	9.2 UMTS Tests Results	15
	9.3 VoLTE Tests Results	16
	9.4 VoWiFi Tests Results	17
10.	T-Coil testing for OTT VoIP Calling	18
	Uncertainty Assessment	
12.	References	20

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5

Report Version : Rev. 01



Revision History

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
HA7D0423B	Rev. 01	Initial issue of report	Feb. 07, 2018

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5 Page Number : 3 of 20
Report Issued Date : Feb. 07, 2018
Report Version : Rev. 01

1. Attestation of Test Summary

Air Interface	Band MHz	T-Rating	Frequency Response	Magnetic Intensity
0014 01450 1/ :	GSM850	T3	Pass	Pass
GSM CMRS Voice	GSM1900	T3	Pass	Pass
077 5005	EDGE850	T4	Pass	Pass
OTT over EDGE	EDGE1900	T4	Pass	Pass
	Band 2	T4	Pass	Pass
UMTS CMRS Voice	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 2	T4	Pass	Pass
OTT over UMTS	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 2	T4	Pass	Pass
VoLTE	Band 4	T4	Pass	Pass
VOLIE	Band 5	T4	Pass	Pass
	Band 7	T4	Pass	Pass
OTT over LTE	Band 4	T4	Pass	Pass
VoWiFI	2450	Т3	Pass	Pass
OTT over WiFi	2450	T4	Pass	Pass
Date Tested		2017/12/21	~ 2018/1/29	

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5 Page Number : 4 of 20
Report Issued Date : Feb. 07, 2018
Report Version : Rev. 01

2. General Information

	Product Feature & Specification					
Applicant Name	Motorola Mobility LLC					
Equipment Name	Mobile Cellular Phone					
Brand Name	Motorola					
Model Name	XT1922-5, XT1922-4					
FCC ID	IHDT56XB5					
HW Version	DVT1B					
SW Version	fastboot_aljeter_oem_userdebug_8.0.0_OPP27.38_1080_intcfg-test-keys					
EUT Stage	Identical Prototype					
Exposure category	General Population/Uncontrolled Exposure					
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz WLAN 2.4GHz Band: 2412 MHz ~ 2462 MHz Bluetooth: 2402 MHz ~ 2480 MHz					
Mode	GSM/GPRS/EGPRS RMC/AMR 12.2Kbps HSDPA HSUPA DC-HSDPA LTE: QPSK, 16QAM 802.11b/g/n HT20 Bluetooth v4.2 with LE					

Report No.: HA7D0423B

SPORTON INTERNATIONAL INC.Page Number: 5 of 20TEL: 886-3-327-3456Report Issued Date: Feb. 07, 2018

Report Version

: Rev. 01

FAX: 886-3-328-4978 FCC ID: IHDT56XB5

3. Administration Data

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Testing Laboratory					
Test Site	SPORTON INTERNATIONAL INC.				
Test Site Location	No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978				
Test Site No.	Sporton Site No. : SAR04-HY				
	Applicant				
Company Name	Motorola Mobility LLC				
Address	222 W,Merchandise Mart Plaza, Chicago IL 60654 USA				
Manufacturer					
Company Name Motorola Mobility LLC					
Address	222 W,Merchandise Mart Plaza, Chicago IL 60654 USA				

4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19-2011
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5 Page Number : 6 of 20 Report Issued Date : Feb. 07, 2018

Report No.: HA7D0423B

Report Version : Rev. 01

5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction
	GSM850	VO	Yes	WLAN, BT	CMRS Voice	No
0014	GSM1900	٧٥	res	WLAN, BT	CIVIRS VOICE	No
GSM	EDGE850	VD	Yes	WIAN DT	Google Duo ⁽¹⁾	No
	EDGE1900	۷۵	168	WLAN, BT	Google Duo	No
	850			WLAN, BT		No
UMTS	1750	VO	Yes	WLAN, BT	CMRS Voice	No
UIVITS	1900			WLAN, BT		No
	HSPA	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	Band 2		Yes	WLAN, BT		No
LTE	Band 4 VD Band 5	VD		WLAN, BT	VoLTE	No
LIC		162	WLAN, BT	Google Duo ⁽¹⁾	No	
	Band 7			WLAN, BT		No
Wi-Fi	2450	VD	Yes	GSM,WCDMA,LTE	VoWiFi / Google Duo ⁽¹⁾	No
BT	2450	DT	No	GSM,WCDMA,LTE	NA	No

Type Transport:
VO= Voice only
DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

Remark:

For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5

Page Number : 7 of 20 Report Issued Date: Feb. 07, 2018

Report No.: HA7D0423B


Report Version : Rev. 01

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA7D0423B

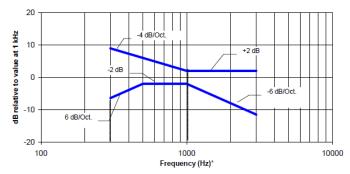

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

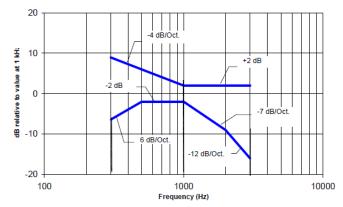

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

 SPORTON INTERNATIONAL INC.
 Page Number
 : 8 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA7D0423B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 9 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

Report No.: HA7D0423B

7.1 Test Flow Chart

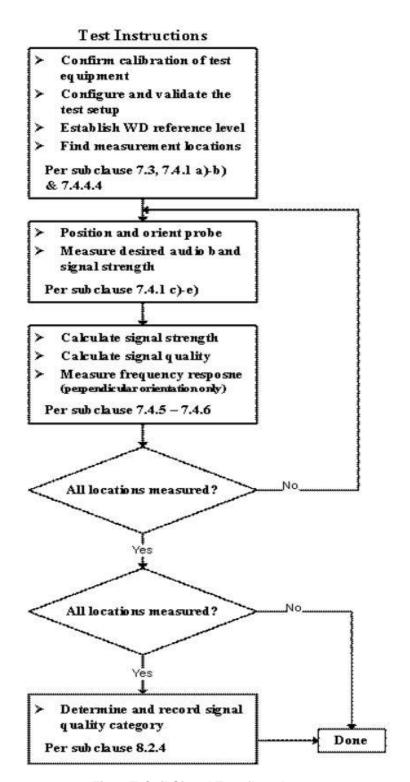



Fig. 2 T-Coil Signal Test flowchart

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5 Page Number : 10 of 20 Report Issued Date : Feb. 07, 2018 Report Version : Rev. 01

Report No. : HA7D0423B

7.2 Test Setup Diagram

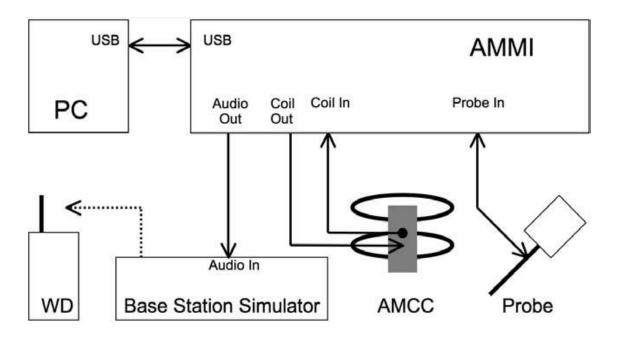

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - GSM input level: -16dBm0
 - UMTS input level: -16dBm0
 - CDMA input level: -18dBm0
 - VoLTE input level: -16dBm0
 - VoWiFi input level: -20dBm0
 - OTT VoIP input Level: -20dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. The test setup used for VoLTE over IMS and VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- 5. The test setup used for OTT VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5 Page Number : 11 of 20
Report Issued Date : Feb. 07, 2018
Report Version : Rev. 01



SPORTON LAB. FCC HAC T-Coil Test Report

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA7D0423B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	-
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k voice 300-3000 2s way	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

<An example for determine input level>

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

- Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.39	3.14
10	20	-19.93	-14.40
8.32	18.40	-21.53	-16

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.32
48k_voice_1kHz	1	16.2	-12.7	4.33	36.02
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	70.53

 SPORTON INTERNATIONAL INC.
 Page Number
 : 12 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA7D0423B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

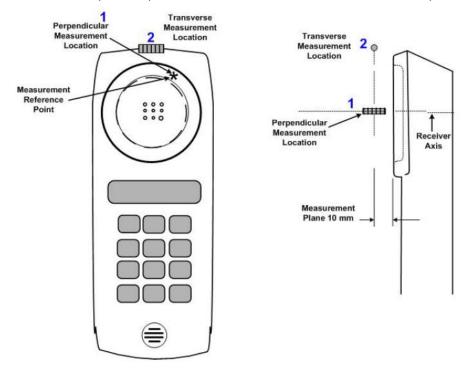


Fig.3 A typical EUT reference and plane for T-Coil measurements

 SPORTON INTERNATIONAL INC.
 Page Number
 : 13 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

8. Test Equipment List

Manufacturer	Name of Equipment	Type o/Mardal	Serial Number	Calibration		
Manuracturer	Name of Equipment	Type/Model	Seriai Number	Last Cal.	Due Date	
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3093	May. 19, 2017	May. 18, 2018	
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018	
SPEAG	Data Acquisition Electronics	DAE4	1326	Sep. 15, 2017	Sep. 14, 2018	
SPEAG	Data Acquisition Electronics	DAE4	854	May. 02, 2017	May. 01, 2018	
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR	
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR	
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR	
SPEAG	SPEAG Phone Positioner		N/A	NCR	NCR	
Gencom	Gencom Thermometer		TM685-1	Mar. 21, 2017	Mar. 20, 2018	
Gencom	Gencom Thermometer		TM685-2	Mar. 21, 2017	Mar. 20, 2018	
R&S	R&S Base Station		116457	May. 23, 2017	May. 22, 2018	
R&S	Base Station	CMW500	157119	Jun. 18, 2017	Jun. 17, 2018	

Report No.: HA7D0423B

Note:

1. NCR: "No-Calibration Required"

 SPORTON INTERNATIONAL INC.
 Page Number
 : 14 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

9. T-Coil testing for CMRS Voice

General Note:

- 1. The middle channel of each frequency band is used for T-Coil testing according ANSI C63.19 2011.
- 2. For VoLTE or VoWiFi radio configuration investigation is choose either one codec and an investigation was performed on all frequency band, data rates and modulations and RB configuration to determine the radio configuration to be used for testing, the following tests results which the worst case configuration would be remarked to be used for the testing for the handset.

Report No.: HA7D0423B

- 3. Choose worst case from radio configuration investigation. After investigation was performed to determine the audio codec configuration to be used for testing, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 4. For VoWiFi codec selection, due to the same with VoLTE codec configuration, therefore, worst codec is choose from VoLTE codec investigation to be used for others air interfaces testing of VoWiFi.

9.1 GSM Tests Results

<Summary Tests Results>

Plo No	Air Intertace	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
1	CSMSEO	CMRS Voice	189	Axial (Z)	-0.74	-25.22	24.48	Т3	PASS
1	1 GSM850 CMRS Void	CIVIRS VOICE		Transversal (Y)	-14.13	-38.70	24.57	Т3	PASS
2	CSM1000	CMPS Voice	661	Axial (Z)	-0.68	-30.56	29.88	Т3	PASS
2	G3W1900	GSM1900 CMRS Voice		Transversal (Y)	-14.15	-43.58	29.43	Т3	PASS

9.2 UMTS Tests Results

<Codec Investigation>

Codec	AMR 12.2Kbps	AMR 7.95Kbps	AMR 4.75Kbps	Orientation	Band / Channel	
ABM 1 (dBA/m)	-0.3	-0.33	-0.85			
ABM 2 (dBA/m)	-37.69	-37.69 -39.62		Audal	Daniel E / 4400	
Freq. Response	Pass	Pass	Pass	Axial	Band 5 / 4182	
Signal Quality (dB)	37.39	39.29	39.19			

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
3	WCDMA V	AMR 12.2Kbps	4182	Axial (Z)	-0.30	-37.69	37.39	T4	PASS
3	WCDIMA V AIMR 12.2Rbps	4102	Transversal (Y)	-9.03	-44.41	35.38	T4	FASS	
4	WCDMA IV	AMR 12.2Kbps	1413	Axial (Z)	-0.28	-38.52	38.24	T4	PASS
4	VVCDIVIA IV	AWIN 12.2NDps		Transversal (Y)	-9.04	-44.27	35.23	T4	FASS
5	WCDMA II	AMR 12.2Kbps	9400	Axial (Z)	-0.27	-38.75	38.48	T4	PASS
3	WCDINATI	AMR 12.2Kbps	9400	Transversal (Y)	-9.03	-44.04	35.01	T4	FASS

 SPORTON INTERNATIONAL INC.
 Page Number
 : 15 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

9.3 VoLTE Tests Results

< Radio Configuration Investigation>

Air Interface	bandwidth	modulation	RB size	RB offset	channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)
LTE Band 2	20	QPSK	1 RB	0	18900	-5.28	-40.06	34.78
LTE Band 2	20	QPSK	50RB	0	18900	-3.76	-43.82	40.06
LTE Band 2	20	QPSK	100RB	0	18900	-3.81	-43.62	39.81
LTE Band 2	20	16QAM	1 RB	0	18900	-3.71	-42.76	39.05
LTE Band 2	15	QPSK	1 RB	0	18900	-3.67	-43.13	39.46
LTE Band 2	10	QPSK	1 RB	0	18900	-3.67	-43.52	39.85
LTE Band 2	5	QPSK	1 RB	0	18900	-3.75	-43.62	39.87
LTE Band 2	3	QPSK	1 RB	0	18900	-3.72	-43.72	40.00
LTE Band 2	1.4	QPSK	1 RB	0	18900	-3.64	-43.56	39.92

<AMR Codec Investigation>

Codec	WB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	NB AMR 23.85Kbps	Orientation	Band / BW / Channel	
ABM 1 (dBA/m)	-1.06	-4.29	-5.28	-6.17			
ABM 2 (dBA/m)	-39.34	-46.88	-40.06	-45.17	Andal	B2 / 20M / 18900	
Freq. Response	Pass	Pass	Pass	Pass	Axial		
Signal Quality (dB)	38.28	42.59	34.78	39.00			

<EVS Codec Investigation>

Codec	EVS SWB 9.6Kbps	EVS SWB 13.2Kbps	EVS WB 5.9Kbps	EVS WB 13.2Kbps	EVS NB 5.9Kbps	EVS NB 13.2Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	-4.40	-4.37	-4.34	-4.42	-4.45	-4.37		
ABM 2 (dBA/m)	-41.51	-41.27	-40.64	-41.63	-41.15	-41.23	Axial	B2 / 20M /
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Axiai	18900
Signal Quality (dB)	37.11	36.90	36.30	37.21	36.70	36.86		

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response	
6	LTE Band 2	20M QPSK 1RB 0Offset AMR12.2Kbps	18900	Axial (Z)	-5.28	-40.06	34.78	T4	PASS	
O	LTL Dallu Z	TE Barid 2 20101_QF3K_TKB_0011Set_AlviK 12.2Kbps		Transversal (Y)	-11.28	-44.67	33.39	T4	FAGG	
7	LTE Band 4	20M OBSK 4BB 00ffeet AMB42 2Khpa	20175	Axial (Z)	-6.43	-41.72	35.29	T4	PASS	
,	LIE Danu 4	20M_QPSK_1RB_0Offset_AMR12.2Kbps	20173	Transversal (Y)	-11.33	-44.88	33.55	T4	PASS	
8	LTE Band 5	10M ODSK 1DD 00ffeet AMD12 2Khoo	20525	Axial (Z)	-0.73	-44.84	44.11	T4	PASS	
0	LTE Band 5 10M_QPSK_1RB_0Offset_AMR12.2Kbps		20020	Transversal (Y)	-12.62	-46.43	33.81	T4	PASS	
9	LTC Dond 7	20M ODSK 1DD 00ffeet AMD12 2Kbps	24400	Axial (Z)	-7.26	-45.57	38.31	T4	DACC	
9	LTE Band 7	20M_QPSK_1RB_0Offset_AMR12.2Kbps	21100	Transversal (Y)	-11.37	-46.80	35.43	T4	PASS	

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5

Page Number : 16 of 20 Report Issued Date: Feb. 07, 2018

Report No.: HA7D0423B

Report Version : Rev. 01

9.4 VoWiFi Tests Results

< Radio Configuration Investigation>

Air Interface	Bandwidth	Data rate	channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)
802.11b	20	1M	6	-11.11	-39.06	27.95
802.11b	20	11M	6	-11.13	-39.30	28.17
802.11g	20	6M	6	-11.09	-39.46	28.37
802.11g	20	54M	6	-11.10	-39.40	28.30
802.11n	20	MCS0	6	-10.94	-38.99	28.05
802.11n	20	MCS7	6	-10.95	-39.22	28.27

<Summary Tests Results>

	Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)		Frequency Response
	10 2.4GHz WLAN	902 11h 1M AMD12 2Kho	6	Axial (Z)	-11.38	-39.62	28.24	T3	PASS	
		Z.4GHZ WLAIN	002.11b_11v1_AlviK12.2Kbps	b	Transversal (Y)	-15.90	-45.04	29.14	T3	FASS

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5 Page Number : 17 of 20
Report Issued Date : Feb. 07, 2018
Report Version : Rev. 01

10. T-Coil testing for OTT VolP Calling

General Notes:

1. The google Duo VoIP call software is pre-installed on this device and head-to-ear scenario should be consideration, the google Duo only support OPUS audio codec and support 6Kbpa to 75Kbps bitrate. According to KDB 285076 D02, all air interfaces via a data connection with google Duo VoIP calling would be consideration to be tested.

Report No.: HA7D0423B

- 2. The test setup used for OTT VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0
- 3. According to VoLTE and VoWiFi radio configuration investigation, the worst case radio configuration is used for OTT over LTE and OTT over WiFi testing.
- 4. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VOLTE and VoWifi summary test results, the worst case air interface is used for OTT T-Coil testing
- 5. For OTT VoIP codec investigation test reduction, due to all air interface have the same codec configuration, therefore, the codec investigation was choose UMTS B2 to determine the audio codec configuration to be used for others air interfaces testing.

<Codec Investigation>

Codec	6Kbps	40Kbps	75Kbps	Orientation	Band / Channel	
ABM 1 (dBA/m)	4.11	4.71	4.60			
ABM 2 (dBA/m)	2 (dBA/m) -41.91 -40.99	-39.94	Axial	UMTS B2 / 9400		
Freq. Response	Pass	Pass	Pass	Axiai	UM15 B2 / 9400	
Signal Quality (dB)	46.02	45.70	44.54			

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response	
11	GSM850	EDGE 2 Tx slots	189	Axial (Z)	4.38	-40.33	44.71	T4	PASS	
11	G3101030	LDGL 2 1X SIOIS	109	Transversal (Y)	-7.51	-44.88	37.37	T4	PASS	
12	GSM1900	EDGE 2 Tx slots	661	Axial (Z)	4.71	-40.34	45.05	T4	PASS	
12	G3W1900	EDGE 2 1X SIOIS	001	Transversal (Y)	-7.35	-45.14	37.79	T4	PASS	
40	WCDMA II	HSPA	9400	Axial (Z)	4.60	-39.94	44.54	T4	PASS	
13	13 WCDMA II	HOFA	9400	Transversal (Y)	-7.44	-45.64	38.20	T4	PASS	
4.4	MCDMA IV	LICDA	4.440	Axial (Z)	4.54	-39.94	44.48	T4	DACC	
14	WCDMA IV	HSPA	1413	Transversal (Y)	-7.49	-45.64	38.15	T4	PASS	
45	WCDMAN	LICDA	4400	Axial (Z)	4.39	-40.31	44.70	T4	DACC	
15	WCDMA V	HSPA	4182	Transversal (Y)	-7.49	-46.31	38.82	T4	PASS	
16	LTC Dand 4	20M ODEK 1DD Ooffoot	20175	Axial (Z)	4.72	-39.79	44.51	T4	DACC	
16	LTE Band 4	20M_QPSK_1RB_0offset	20175	Transversal (Y)	-7.75	-45.51	37.76	T4	PASS	
17	17 2.4GHz WLAN		6	Axial (Z)	5.23	-42.95	48.18	T4	- PASS	
17		802.11b 1Mbps	6	Transversal (Y)	-7.21	-47.07	39.86	T4		

Remark:

1. Phone Condition: Mute on; Backlight off; Max Volume

2. The detail frequency response results please refer to appendix A.

Test Engineer : Nick Yu and Steven Chang

 SPORTON INTERNATIONAL INC.
 Page Number
 : 18 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

11. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA7D0423B

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)		
		Probe Sen	sitivity						
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %		
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %		
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %		
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %		
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %		
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %		
		Probe Sy	stem						
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %		
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %		
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %		
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %		
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %		
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %		
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %		
		Test Siç	gnal						
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %		
		Position	ning						
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %		
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %		
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %		
		External Con	tributions						
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %		
Test Signal Variation	Rectangular	√3	1	1	± 1.2 %	± 1.2 %			
	Combined Star	ndard Uncertainty				± 4.1 %	± 6.1 %		
Coverage Factor for 95 % K = 2									
	Expanded	Uncertainty				± 8.1 %	± 12.3 %		

Table 8.2 Uncertainty Budget of audio band magnetic measurement

 SPORTON INTERNATIONAL INC.
 Page Number
 : 19 of 20

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 07, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01



12. References

- [1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.
- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] SPEAG DASY System Handbook

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XB5 Page Number : 20 of 20
Report Issued Date : Feb. 07, 2018
Report Version : Rev. 01