

Report No.: HA9D0635B



# HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : IHDT56YJ1

**Equipment**: Mobile Cellular Phone

Brand Name : Motorola

T-Rating : T3

Applicant : Motorola Mobility, LLC

222 W Merchandise Mart Plaza, Suite 1800, Chicago, IL 60654,

**United States** 

Manufacturer : Motorola Mobility, LLC

222 W Merchandise Mart Plaza, Suite 1800, Chicago, IL 60654,

**United States** 

Standard : FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received on Dec. 26, 2020 and testing was started from Jan. 16, 2020 and completed on Jan. 27, 2020. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The report must not be used by the client to claim product certification, approval, or endorsement by TAF or any agency of government.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Cona Huang / Deputy Manager

Qua Grang.

SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 31 FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# Report No.: HA9D0635B

Page: 2 of 31

Issued Date: Feb. 07, 2020

# **Table of Contents**

1.	Attes	station of Test Results	4
2.	Gene	eral Information	5
3.	Testir	ng Location	6
4.	Appli	ied Standards	6
5.	Air In	nterface and Operating Mode	7
6.	Meas	surement standards for T-Coil	8
	6.1	Frequency Response	
	6.2	T-Coil Signal Quality Categories	8
7.	T-Coi	il Test Procedure	g
	7.1	Test Flow Chart	
	7.2	Test Setup Diagram for GSM/UMTS/CDMA/VoLTE	11
	7.3	Test Setup Diagram for VoWiFi – PAG reuse	13
	7.4	Test Setup and Diagram for OTT VoIP – PAG Reuse	
	7.5	Description of EUT Test Position	17
8.	Test E	Equipment List	18
9.	T-Coi	il testing for CMRS Voice	19
	9.1	GSM Tests Results	19
	9.2	UMTS Tests Results	20
	9.3	CDMA Tests Results	20
10.	T-Coi	il testing for CMRS IP Voice	21
	10.1	VoLTE Tests Results	21
		VoWiFi Tests Results	
11.	T-Coi	il testing for OTT VoIP Application	26
12.	Unce	ertainty Assessment	30
13.	Refer	rences	31

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate

# History of this test report

Report No.: HA9D0635B

Report No.	Version	Description	Issued Date
HA9D0635B	Rev. 01	Initial issue of report	Feb. 07, 2020

TEL: 886-3-327-3456 Page: 3 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency	Magnetic
			Response	Intensity
GSM CMRS Voice	GSM850	T3	Pass	Pass
OSIVI CIVIIXO VOICE	GSM1900	T4	Pass	Pass
OTT over EDGE	EDGE850	T3	Pass	Pass
OTT over EDGE	EDGE1900	T4	Pass	Pass
UMTS CMRS Voice	Band 2	T4	Pass	Pass
CIVITO CIVITO VOICE	Band 5	T4	Pass	Pass
OTT over LIMTS	Band 2	T4	Pass	Pass
OTT over UMTS	Band 5	T4	Pass	Pass
CDMA CMRS Voice	BC0	T4	Pass	Pass
CDIMA CIVIRS VOICE	BC1	T4	Pass	Pass
OTT over CDMA	BC0	T4	Pass	Pass
OTT OVEL COMA	BC1	T4	Pass	Pass
	Band 2	T4	Pass	Pass
	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 7	T4	Pass	Pass
VoLTE	Band 12	T4	Pass	Pass
	Band 13	T4	Pass	Pass
	Band 17	T4	Pass	Pass
	Band 48	T4	Pass	Pass
	Band 66	T4	Pass	Pass
OTT WALLE	Band 12	T4	Pass	Pass
OTT over LTE	Band 48	T4	Pass	Pass
	2450	T4	Pass	Pass
	5200	T4	Pass	Pass
VoWiFI	5300	T4	Pass	Pass
	5500	T4	Pass	Pass
	5800	T4	Pass	Pass
OTT WITH	2450	T4	Pass	Pass
OTT over WiFi	5300	T4	Pass	Pass
Date Tested		2020/1/16	~ 2020/1/27	

Report No.: HA9D0635B

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

Reviewed by: <u>Jason Wang</u> Report Producer: <u>Daisy Peng</u>

TEL: 886-3-327-3456 Page: 4 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 2. General Information

	Product Feature & Specification
Applicant Name	Motorola Mobility, LLC
Equipment Name	Mobile Cellular Phone
Brand Name	Motorola
FCC ID	IHDT56YJ1
HW Version	DVT2
EUT Stage	Identical Prototype
Date Tested	2020/1/16 ~ 2020/1/27
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz CDMA2000 BC0: 824.7 MHz ~ 848.31 MHz CDMA 2000 BC1: 1851.25 MHz ~ 1908.75 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 784.5 MHz LTE Band 48: 3552.5 MHz ~ 3697.5 MHz LTE Band 66: 1710.7 MHz ~ 1779.3 MHz LTE Band 66: 1710.7 MHz ~ 1779.3 MHz SG NR n260: 37000 MHz ~ 40000 MHz 5G NR n261: 27500 ~ 28350 MHz WLAN 2.4GHz Band: 5180 MHz ~ 2462 MHz WLAN 5.2GHz Band: 5180 MHz ~ 5240 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz
Mode	GSM/GPRS/EGPRS AMR / RMC 12.2Kbps HSDPA HSUPA DC-HSDPA CDMA2000: 1xRTT/1xEv-Do(Rel.0)/1xEv-Do(Rev.B) LTE: QPSK, 16QAM, 64QAM 5G NR n260: 37000 MHz ~ 40000 MHz: QPSK, 16QAM, and 64QAM for CP-OFDM 5G NR n261: 27500 ~ 28350 MHz: QPSK, 16QAM, and 64QAM for CP-OFDM WLAN: 802.11a/b/g/n/ac/ax HT20 / HT40 / VHT20 / VHT40 / VHT80 / VHT160 / HE20 / HE40 / HE80 Bluetooth BR/EDR/LE NFC:ASK

Report No.: HA9D0635B

TEL: 886-3-327-3456 Page: 5 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 3. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Report No.: HA9D0635B

	Testing Laboratory				
Test Site SPORTON INTERNATIONAL INC.					
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978				
Test Site No.	Sporton Site No.: SAR04-HY				

# 4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

TEL: 886-3-327-3456 Page: 6 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 5. Air Interface and Operating Mode

Air	Band MHz	Туре	C63.19	Simultaneous	Name of Voice	Power
Interface		.,,,,,	Tested	Transmitter	Service	Reduction
	GSM850	VO	Yes	WLAN, BT	CMRS Voice	No
GSM	GSM1900	VO	163	WLAN, BT	CIVILO VOICE	No
GSIVI	EDGE850	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
	EDGE1900	VD	163	WEAN, BT	Google Duo	INO
	850			WLAN, BT		No
UMTS	1750	VO	Yes	WLAN, BT	CMRS Voice	No
OWITS	1900			WLAN, BT		No
	HSPA	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
	850	VO	Yes	WLAN, BT	CMRS Voice	No
CDMA	1900	VO	163	WLAN, BT		No
	EVDO	VD	Yes	WLAN, BT	Google Duo <sup>(1)</sup>	No
	Band 2			WLAN, BT		No
	Band 4			WLAN, BT		No
	Band 5			WLAN, BT		No
LTE	Band 7	VD	Yes	WLAN, BT	VoLTE	No
(FDD)	Band 12	۷۵	162	WLAN, BT	Google Duo <sup>(1)</sup>	No N
	Band 13			WLAN, BT		
	Band 17			WLAN, BT		No
	Band 66			WLAN, BT		No
LTE (TDD)	Band 48	VD	Yes	WLAN, BT	VoLTE / Google Duo <sup>(1)</sup>	No
NR	n260	VD	No <sup>(3)</sup>	WLAN, BT	NA	No
(TDD)	n261	VD	INO	WLAN, DI	IVA	NO
	2450					No
	5200				VoWiFi <sup>(1)</sup>	No
Wi-Fi	5300	VD	Yes	GSM,WCDMA,CDMA,LTE	/	No
	5500				Google Duo <sup>(1)</sup>	No
	5800					No
ВТ	2450	DT	No	GSM,WCDMA,CDMA,LTE	NA	No

Report No.: HA9D0635B

# Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

#### Remark:

- 1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.
- 2. The device have similar frequency in some LTE bands: LTE B12/17, 4/66, since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.
- 3. N260 and n261 are currently outside the scope of ANSI C63.19 and FCC HAC regulations therefore they were not evaluated.


TEL: 886-3-327-3456 Page: 7 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 6. Measurement standards for T-Coil

#### 6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA9D0635B

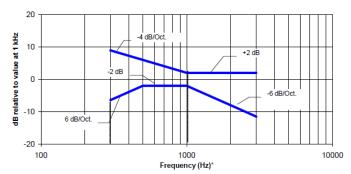

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

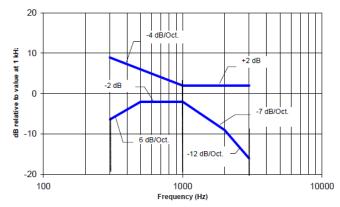

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

#### 6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

**Table 1 T-Coil Signal Quality Categories** 

TEL: 886-3-327-3456 Page: 8 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

## 7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA9D0635B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 9 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

### 7.1 Test Flow Chart


# Test Instructions Confirm calibration of test eq uip ment Configure and validate the test setup Establish WD reference level Find measurement locations Per sub clause 7.3, 7.4.1 a)-b) & 7.4.4.4 Position and orient probe Measure desired aud io band signal strength Per sub clause 7.4.1 c)-e) Calculate signal strength Calculate signal quality Measure frequency resposne (perpendicular orientation only) Per sub clause 7.4.5 - 7.4.6 All locations measured? All locations measured? Determine and record signal quality category Done Per sub clause 8.2.4

Report No.: HA9D0635B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 10 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 7.2 Test Setup Diagram for GSM/UMTS/CDMA/VoLTE

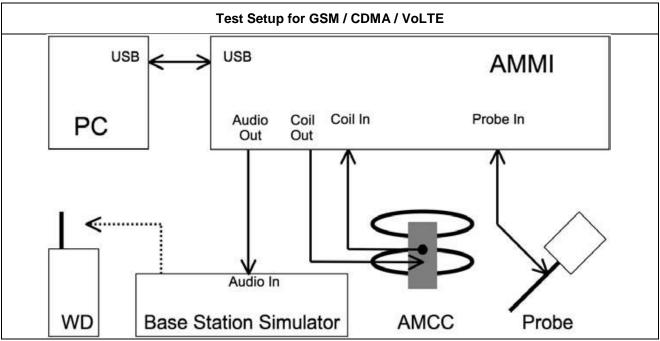

Report No.: HA9D0635B

#### **General Note:**

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
  - GSM input level: -16dBm0
  - UMTS input level: -16dBm0
  - CDMA input level: -18dBm0
  - VoLTE input level: -16dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. Voice over Long-Term Evolution (VoLTE) is a standard for high-speed wireless communication for mobile phones and data terminals including IoT devices and wearables. It is based on the IP Multimedia Subsystem (IMS) network, with specific profiles for control and media planes of voice service on LTE defined by GSMA in PRD IR.92. This approach results in the voice service (control and media planes) being delivered as data flows within the LTE data bearer. This means that there is no dependency on the legacy circuit-switched voice network to be maintained
- 5. The test setup used for VoLTE over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE when the device during the IMS connection.

TEL: 886-3-327-3456 Page: 11 of 31 FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

#### <Define the input level for GSM/UMTS/CDMA>

1. The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA9D0635B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(\*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

<Example define the input level for GSM/UMTS/CDMA>

ALXAMPIG GOTTIO THE ACTION OF COMPONITOR CONTROL					
Gain Value	20* log(gain)	AMCC Coil In	Level		
(linear)	dB	(dBv RMS)	dBm0		
		-2.47	3.14		
10	20	-19.85	-14.24		
8.17	18.24	-21.61	-16		


Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

<Example define the input level for VoLTE>

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)
	3.14	1.5		0.51	
100	5.61		40	2.98	3.13
8.31	-16		18.39		-18.48
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting
1kHz sine	-	3	0	1	8.31
48k_voice_1kHz	1	16.2	-12.7	4.33	35.98
48k_voice_300-3000	2	21.6	-18.6	8.48	70.46

TEL : 886-3-327-3456 Page : 12 of 31
FAX : 886-3-328-4978 Issued Date : Feb. 07, 2020

### 7.3 Test Setup Diagram for VoWiFi - PAG reuse

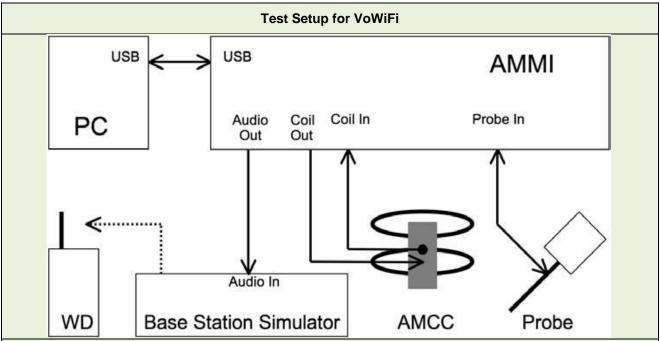

Report No.: HA9D0635B

#### **General Note:**

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
  - VoWiFi input level: -20dBm0
- 2. For Voice over Wi-Fi (VoWiFi) is a term typically employed to describe the delivery of commercial telephony services using Voice over IP (VoIP) technologies from mobile devices connected across Wi-Fi. This is typically counter to alternatives, predominantly Voice over LTE (VoLTE), in which a mobile network operator's (MNO's) licensed spectrum (i.e. 4G LTE) is used to carry packetized voice. Broadly speaking, VoWiFi terminology is assigned to all core IMS services accessed from unlicensed spectrum and across untrusted access infrastructures, such as public Wi-Fi access points
- 3. The test setup used for VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -20dBm0 for VoWiFi when the device during the IMS connection.
- 4. An investigation was perfromed to determine worst case codec, bit rate and air interface configuration refer to section10.2

TEL: 886-3-327-3456 Page: 13 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

#### <Define the input level for VoWiFi>

1. The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA9D0635B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
	3.0	0.0	1.00	
10	3.0	0.0	1.00	
10	6.0	-3.0	1.42	
10	6.0	-2.9	1.40	
10	13.8	-10.5	3.34	
10	11.1	-7.9	2.49	
1	16.2	-12.7	4.33	
2	21.6	-18.6	8.48	
	[s] 10 10 10 10 10 10 10 11 1	[s] RMS [dB] 3.0 10 3.0 10 6.0 10 6.0 10 13.8 10 11.1 1 16.2	[s] RMS [dB] [dB] 3.0 0.0 10 3.0 0.0 10 6.0 -3.0 10 6.0 -2.9 10 13.8 -10.5 10 11.1 -7.9 1 16.2 -12.7	[s] RMS [dB] [dB] factor *) 3.0 0.0 1.00 10 3.0 0.0 1.00 10 6.0 -3.0 1.42 10 6.0 -2.9 1.40 10 13.8 -10.5 3.34 10 11.1 -7.9 2.49 1 16.2 -12.7 4.33

(\*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.


Insert the gain applicable for your setup in the last column of the table.

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)
	3.14	1.5		0.51	
100	5.61		40	2.98	3.13
5.24	-20		14.39		-22.48
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting
1kHz sine	-	3	0	1	5.24
48k_voice_1kHz	1	16.2	-12.7	4.33	22.70
48k_voice_300-3000	2	21.6	-18.6	8.48	44.46

TEL: 886-3-327-3456 Page: 14 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# C T-COIL TEST REPORT Report No. : HA9D0635B

#### 7.4 Test Setup and Diagram for OTT VoIP - PAG Reuse

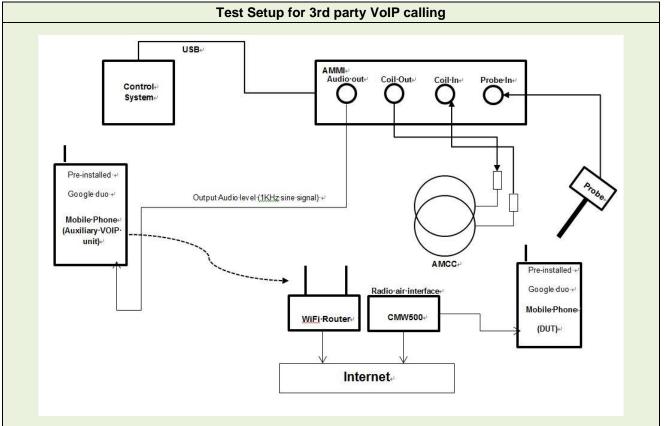

#### **General Note:**

- Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
- OTT VoIP input Level: -20dBm0
- 2. Voice over Internet Protocol (VoIP) such as google duo application, also called IP telephony, is a methodology and group of technologies for the delivery of voice communications and multimedia sessions over Internet Protocol (IP) networks, such as the Internet. The terms Internet telephony, broadband telephony, and broadband phone service specifically refer to the provisioning of communications services (voice, fax, SMS, voice-messaging) over the public Internet, rather than via the public switched telephone network (PSTN)
- 3. The **Google DUO** service and relate codec "**OPUS**" and support 6Kbps to 75Kbps bitrate and the customized **Google DUO** software is installed on a mobile phone which is used as the Auxiliary for the test. The **DUO** software enables audio coding rate to be changed, and reports the input digital audio level before DUO audio processing which can be used to calibrate the input audio level.
- 4. This device comes with the preinstalled VoIP application that supports the Google DUO service and related codec OPUS. The test configuration establishes a call between the device under test and an auxiliary handset via the DUO server
- 5. The test setup used for Google DUO VoIP call is via the data application unit on the CMW, connected to the internet via the DUO server to the auxiliary device. The auxiliary device runs special software that allows the codec bit rate (6Kbps to 75 Kbps) to be fixed to a specific value. Please refer to section11, an assessment was made of each of the different codec bit rates to determine the worst case for each of the different OTT transport (WiFi, LTE FDD, LTE TDD, GSM, WCDMA)
- 6. The auxiliary device includes software that displays the audio level in dBFS which allows calibration of the system to establish the -20dBm0 reference level. After establishing the voice call between auxiliary device and device under test the audio output from the AMMI is injected into the auxiliary device. The gain factor to establish a reference level of -20dBm0 for use during the test is determined as detailed in the next page based on the 0dBFull Scale (0dBFS) value being equivalent to 3.14dBm0.

TEL: 886-3-327-3456 Page: 15 of 31 FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

#### <Define the input level for OTT VoIP>

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA9D0635B

- 2. The below calculation formula is an example and showing how to determine the input level for the device.
- 3. Input a gain value to readout the -23dBFS level as reference. (0dBFS = 3.14 dBm0)
- 4. Adjust gain level until to readout the dBFS level until it changes to -24dBFS.
- 5. Based on the step 1 and 2, and then calculate the gain value(dB) by interpolation to get the -20dBm0 corresponding gain value.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(\*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Step	Cianal turns	Audi	o out	Target Level			
Step	Signal type	Gain value	Gain value (dB)	dBFS	dBm0		
Step 1	1KHz Sine	7.7	17.73 (Ref.)	-23			
Step 2	1KHz Sine	6.8	16.65	-24			
Step 3	1KHz Sine	7.57**	17.58*	-23.14	-20		

Remark (\*) Based on the step 1 and 2 and then via interpolation to get this value. (\*\*) Gain value=10^Gain value(dB)/20

Signal type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain value
1kHz sine		3	0	1	7.57
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	32.77
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	64.79

- 1. According to the gain setting for 1kHz sine wave, determine the gain setting for signals above.
- 2. The gain for the specific signal is multiplied by this factor to achieve the same level as for the 1kHz sine signal.

TEL: 886-3-327-3456 Page: 16 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

### 7.5 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA9D0635B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- ◆ The measurement plane is parallel to, and 10 mm in front of, the reference plane.

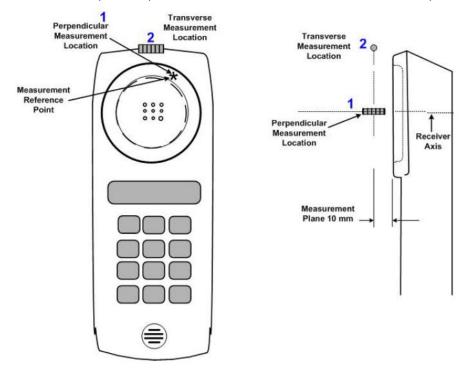


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 17 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 8. Test Equipment List

Manufacturer	Name of Equipment	Type/Medal	Serial Number	Calib	ration
Manufacturer	Name of Equipment	Type/Model	Serial Number	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 20, 2019	Nov. 19, 2020
SPEAG	Data Acquisition Electronics	DAE4	1311	Aug. 27, 2019	Aug. 26, 2020
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
RCPTWN	Thermometer	HTC-1	TM685-1	Nov. 12, 2019	Nov. 11, 2020
R&S	Base Station	CMW500	115793	Jun. 04, 2019	Jun. 03, 2020
R&S	Base Station	CMU200	117591	Dec. 09, 2019	Dec. 08, 2020
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR

Report No.: HA9D0635B

Note:

TEL: 886-3-327-3456 Page: 18 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

<sup>1.</sup> NCR: "No-Calibration Required"

# 9. T-Coil testing for CMRS Voice

#### **General Note:**

1. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.

#### 2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.

Report No.: HA9D0635B

b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

#### 9.1 GSM Tests Results

#### <Codec Investigation>

Codec	FR_V1	HR_V1	Orientation	Band / Channel		
ABM 1 (dBA/m)	-5.15	-5.46				
ABM 2 (dBA/m)	3M 2 (dBA/m) -30.04 -33.66		Axial	CCM050 / 490		
Signal Quality (dB)	24.89	28.2	Axiai	GSM850 / 189		
Freq. Response	Pass	Pass				

Remark: According to codec investigation, the worst codec is FR\_V1

#### <Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
1	GSM850	GSM Voice	189	Axial (Z)	-5.15	-30.04	24.89	T3	-50.33	1.11	Pass
	GSIVIOSO	GSIVI VOICE	109	Transversal (Y)	-16.21	-42.34	26.13	T3	-50.21	1.11	1 055
				Axial (Z)	-4.54	-41.68	37.14	T4	-50.34		
2	2 GSM1900 GSM Voice	GSM Voice	661	Transversal (Y)	-12.36	-45.65	33.29	T4	-50.27	1	Pass
				Transversal (Y)	-12.10	-46.34	34.24	T4	-50.25		

TEL: 886-3-327-3456 Page: 19 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# 9.2 UMTS Tests Results

#### <Codec Investigation>

Codec	AMR 4.75Kbps	AMR 7.95Kbps	AMR 12.2Kbps	Orientation	Band / Channel	
ABM 1 (dBA/m)	-3.58	-3.14	-3.21			
ABM 2 (dBA/m)	-44.16	-43.18	-42.86	Axial	Band 5 / 4182	
Signal Quality (dB)	40.58	40.04	39.65	Axiai	Banu 5 / 4162	
Freq. Response	Pass	Pass	Pass			

Report No.: HA9D0635B

Remark: According to codec investigation, the worst codec is AMR 12.2Kbps

#### <Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
3	WCDMA II	Voice	9400	Axial (Z)	-3.21	-42.86	39.65	T4	-50.37	0.91	Pass
3	WCDIVIA	VOICE	3400	Transversal (Y)	-10.72	-47.33	36.61	T4	-50.24		
				Axial (Z)	-3.34	-43.42	40.08	T4	-50.38		
4	4 WCDMA V Voice	4182	Transversal (Y)	-10.79	-47.22	36.43	T4	-50.23	1.05	Pass	
				Transversal (Y)	-12.10	-46.34	34.24	T4	-50.25		

### 9.3 CDMA Tests Results

#### <Codec Investigation>

Codec	RC1 SO68	RC3 SO68	RC4 SO68	Orientation	Band / Channel		
ABM 1 (dBA/m)	-2.47	-2	-2.66				
ABM 2 (dBA/m)	-41.38	-49.98	-48.9	Axial	BC0 / 384		
Signal Quality (dB)	38.91	47.98	46.24	Axiai	BC0 / 364		
Freq. Response	Pass	Pass	Pass				

Remark: According to codec investigation, the worst codec is RC1 SO68

# <Air Interface Investigation>

Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
_	RC1+SO3 Voice	204	Axial (Z)	-2.47	-41.38	38.91	T4	-50.36	0.70	Davis	
5	CDMA BC0	codec / 8K Enhanced low	384	Transversal (Y)	-11.49	-48.05	36.56	T4	-50.21	0.78	Pass
	CDMA DC4	RC1+SO3 Voice	600	Axial (Z)	-4.66	-47.75	43.09	T4	-50.34	0.00	Dana
б	6 CDMA BC1	codec / 8K Enhanced low	600	Transversal (Y)	-12.10	-46.34	34.24	T4	-50.25	0.89	Pass

TEL: 886-3-327-3456 Page: 20 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

### 10. T-Coil testing for CMRS IP Voice

### 10.1 VoLTE Tests Results

#### **General Note:**

- Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.
- 2. Air Interface Investigation:
  - a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.

Report No.: HA9D0635B

- b. Select LTE FDD / TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration, the observed variation is very little to be within 1.5 dB which is much less than the margin from the rating threshold.
- c. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

#### <Codec Investigation>

#### LTE FDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	-1.34	-2.97	-1.15	-1.24	-0.05	-0.63	-0.71	-0.41	-0.6	-0.56		
ABM 2 (dBA/m)	-45.35	-44	-43.72	-43.13	-46.63	-46.38	-46.28	-46.07	-46.72	-46.62		B2 / 20M /
Signal Quality (dB)	44.01	41.03	42.57	41.89	46.58	45.75	45.57	45.66	46.12	46.06	Axial	18900
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

#### LTE TDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	-1.34	-3.14	-0.96	-1.05	0.07	-0.39	-0.5	-0.18	-0.55	-0.41		
ABM 2 (dBA/m)	-42.19	-39.43	-41.86	-41.48	-43.28	-43.14	-41.97	-43.04	-43.18	-42.89	Axial	B48 / 20M /
Signal Quality (dB)	40.85	36.29	40.9	40.43	43.35	42.75	41.47	42.86	42.63	42.48	Axiai	55830
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 21 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# SPORTON LAB. HAC T-COIL TEST REPORT

# <Air Interface Investigation>

	Air Interface	BW (MHz)	Modulation / Mode	RB Size	RB offset	Channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B2	20	QPSK	1	0	18900	-	-2.77	-43.05	40.28
	LTE B2	20	QPSK	50	0	18900	•	-2.91	-43.82	40.91
	LTE B2	20	QPSK	100	0	18900	•	-3.11	-43.96	40.85
	LTE B2	20	16QAM	1	0	18900	-	-3.02	-44.01	40.99
FDD	LTE B2	20	64QAM	1	0	18900	-	-2.81	-43.54	40.73
רטט	LTE B2	15	QPSK	1	0	18900	-	-3.05	-43.99	40.94
	LTE B2	10	QPSK	1	0	18900	-	-3.09	-43.80	40.71
	LTE B2	5	QPSK	1	0	18900	-	-2.84	-43.39	40.55
	LTE B2	3	QPSK	1	0	18900	-	-2.87	-43.59	40.72
	LTE B2	1.4	QPSK	1	0	18900	-	-2.77	-43.78	41.01
	LTE B48	20	QPSK	1	0	55830	0	-4.43	-40.91	36.48
	LTE B48	20	QPSK	50	0	55830	0	-4.15	-41.05	36.90
	LTE B48	20	QPSK	100	0	55830	0	-3.92	-40.83	36.91
	LTE B48	20	16QAM	1	0	55830	0	-3.99	-40.82	36.83
	LTE B48	20	64QAM	1	0	55830	0	-4.06	-40.92	36.86
	LTE B48	15	QPSK	1	0	55830	0	-4.45	-41.04	36.59
TDD	LTE B48	10	QPSK	1	0	55830	0	-4.01	-40.84	36.83
	LTE B48	5	QPSK	1	0	55830	0	-4.17	-40.91	36.74
	LTE B48	20	QPSK	1	0	55830	1	-4.22	-41.25	37.03
	LTE B48	20	QPSK	1	0	55830	2	-4.36	-41.47	37.11
	LTE B48	20	QPSK	1	0	55830	3	-4.24	-41.18	36.94
	LTE B48	20	QPSK	1	0	55830	4	-4.39	-41.47	37.08
	LTE B48	20	QPSK	1	0	55830	5	-4.15	-41.07	36.92

Report No.: HA9D0635B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode		RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB		Ambient Noise dB (A/m)	Response	Frequency Response
7	LTE Band 2	20	QPSK	1	0	18900	Axial (Z)	-2.97	-44.00	41.03	T4	-50.31	1	Pass
_ ′	LTL Danu Z	20	QI SIX	'	0	10900	Transversal (Y)	-11.63	-46.16	34.53	T4	-50.23	'	1 033
8	LTE Band 5	10	QPSK	1	0	20525	Axial (Z)	-3.20	-45.07	41.87	T4	-50.36	1.22	Pass
0	LIL Danu 3	10	QFSK	l '	U	20323	Transversal (Y)	-11.12	-46.86	35.74	T4	-50.21	1.22	F 455
9	LTE Band 7	20	QPSK	1	0	21100	Axial (Z)	-3.09	-44.51	41.42	T4	-50.34	1.12	Pass
9	LIE Band /	20	QPSK	'	U	21100	Transversal (Y)	-11.62	-47.23	35.61	T4	-50.23	1.12	Pass
40	LTE Band 12	10	QPSK	1	0	22205	Axial (Z)	-3.98	-44.54	40.56	T4	-50.34	1.16	Dana
10	LIE Danu 12	10	QPSK	'	0	23095	Transversal (Y)	-11.05	-46.80	35.75	T4	-50.20	1.10	Pass
44	LTC David 40	40	ODCK	4	0	22220	Axial (Z)	-3.10	-44.80	41.70	T4	-50.33	0.7	Dana
11	LTE Band 13	10	QPSK	1	0	23230	Transversal (Y)	-10.99	-47.28	36.29	T4	-50.26	0.7	Pass
40	LTC David 40	00	ODCK	4	0	FF000	Axial (Z)	-3.14	-39.43	36.29	T4	-50.33	0.00	Dana
12	LTE Band 48	20	QPSK	1	0	55830	Transversal (Y)	-13.01	-43.33	30.32	T4	-50.27	0.92	Pass
40	LTE David CC	20	ODCK	_	0	422222	Axial (Z)	-3.57	-44.24	40.67	T4	-50.36	0.70	Dana
13	LTE Band 66	20	QPSK	1	0	132322	Transversal (Y)	-10.73	-46.19	35.46	T4	-50.21	0.73	Pass

TEL: 886-3-327-3456 Page: 22 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

#### 10.2 VoWiFi Tests Results

#### **General Note:**

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations
(WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It
is only necessary to document this for one channel/band, the following worst investigation codec would be remarked
to be used for the testing for the handset.

Report No.: HA9D0635B

- 2. Air Interface Investigation:
  - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
  - b. Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
  - c. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

#### <Codec Investigation>

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	-7.93	-8.65	-5	-9.3	-7.7	-4.53	-6.98	-3.98	-7.9	-4.27		
ABM 2 (dBA/m)	-44.25	-42.75	-43.2	-47.92	-47.11	-48.78	-42.64	-46.09	-48.53	-45.36		2.4GHz
Signal Quality (dB)	36.32	34.1	38.2	38.62	39.41	44.25	35.66	42.11	40.63	41.09	Axial	WLAN / 6
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 23 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# <Air Interface Investigation>

Frequency Bands	Modulation	Bandwidth	Data Rate	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
WLAN 2.4GHz	802.11b	20	1M	6	-12.73	-43.85	31.12
	802.11b	20	11M	6	-10.39	-45.90	35.51
	802.11g	20	6M	6	-10.11	-45.98	35.87
	802.11g	20	54M	6	-6.76	-42.42	35.66
\\\\\	802.11n-HT20	20	MCS0	6	-6.92	-43.22	36.30
WLAN 2.4GHZ	802.11n-HT20	20	MCS7	6	-12.14	-45.81	33.67
	802.11ax-HE20	20	MCS0	6	-12.85	-45.27	32.42
	802.11ax-HE20	20	MCS11	6	-12.57	-46.27	33.70
	802.11ax-HE40	40	MCS0	6	-6.92	-43.17	36.25
	802.11ax-HE40	40	MCS11	6	-11.86	-46.08	34.22
	802.11a	20	6M	40	-11.73	-45.98	34.25
	802.11a	20	54M	40	-11.65	-46.90	35.25
	802.11an-HT20	20	MCS0	40	-11.69	-46.96	35.27
	802.11an-HT20	20	MCS7	40	-11.85	-46.42	34.57
	802.11an-HT40	40	MCS0	38	-11.66	-46.81	35.15
	802.11an-HT40	40	MCS7	38	-11.57	-46.91	35.34
	802.11ac-VHT20	20	MCS0	40	-13.49	-48.01	34.52
	802.11ac-VHT20	20	MCS8	40	-13.64	-48.70	35.06
WI AN FOLL	802.11ac-VHT40	40	MCS0	38	-11.77	-46.51	34.74
WLAN 5GHZ	802.11ac-VHT40	40	MCS8	38	-11.66	-46.99	35.33
	802.11ac-VHT80	80	MCS0	42	-11.71	-46.19	34.48
	802.11ac-VHT80	80	MCS8	42	-11.47	-46.38	34.91
	802.11ax-HE20	20	MCS0	40	-11.90	-46.73	34.83
	802.11ax-HE20	20	MCS11	40	-14.07	-48.33	34.26
	802.11ax-HE40	40	MCS0	38	-12.82	-49.12	36.30
	802.11ax-HE40	40	MCS11	38	-11.56	-46.44	34.88
	802.11ax-HE80	80	MCS0	42	-11.62	-46.88	35.26
	802.11ax-HE80	80	MCS11	42	-11.30	-46.72	35.42

Report No.: HA9D0635B

TEL: 886-3-327-3456 Page: 24 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020



Air Interface

WLAN2.4GHz

WLAN5GHz

WLAN5GHz

WLAN5GHz

WLAN5GHz

WLAN2.4GHz

WLAN5GHz

WLAN5GHz

WLAN5GHz

WLAN5GHz

802.11a 6Mbps

802.11a 6Mbps

802.11a 6Mbps

802.11a 6Mbps

40

60

124

157

Ant 2

Ant 2

Ant 2

Ant 2

Plot

No.

14

15

16

17

18

19

20

21

22

23

### HAC T-COIL TEST REPORT

Freq. ABM2 ABM1 Signal **Ambient Probe** Ant Response Frequency Mode Channel dB dB Quality Noise Status Rating **Position** Variation Response dB (A/m) (A/m) (A/m) dB dB -42.75 -50.34 -8.65 34.10 T4 Axial (Z) 6 0.89 Pass 802.11b 1Mbps Ant 1 Transversal (Y) -14.62 -47.33 32.71 T4 -50.21 -13.19 Axial (Z) -48.93 35.74 T4 -50.32 802.11a 6Mbps 40 Ant 1 0.86 **Pass** -16.94 -48.43 31.49 T4 -50.19 Transversal (Y) Axial (Z) -8.39 -48.53 40.14 T4 -50.36 802.11a 6Mbps 60 Ant 1 0.63 Pass -16.50 -48.07 31.57 T4 -50.20 Transversal (Y) -6.79 -46.11 39.32 **T4** -50.31 Axial (Z) 802.11a 6Mbps 124 Ant 1 0.99 **Pass** -14.92 -47.27 T4 -50.21 Transversal (Y) 32.35 Axial (Z) -7.26 -44.26 37.00 Τ4 -50.34 802.11a 6Mbps 157 Ant 1 0.7 Pass -15.13 -47.56 32.43 T4 -50.23 Transversal (Y) -50.34 Axial (Z) -9.81 -47.98 38.17 T4 802.11b 1Mbps 6 Ant 2 0.76 Pass Transversal (Y) -14.66 -48.56 33.90 T4 -50.29

Report No.: HA9D0635B

TEL: 886-3-327-3456 Page: 25 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

Axial (Z)

Transversal (Y)

Axial (Z)

Transversal (Y)

Axial (Z)

Transversal (Y)

Axial (Z)

Transversal (Y)

-7.22

-14.76

-7.20

-14.37

-9.77

-14.58

-12.08

-14.91

-43.54

-48.73

-45.01

-46.71

-47.54

-48.40

-45.53

-48.25

36.32

33.97

37.81

32.34

37.77

33.82

33.45

33.34

T4

T4

T4

T4

T4

T4

T4

T4

-50.34

-50.23

-50.30

-50.23

-50.33

-50.27

-50.33

-50.21

0.67

0.96

1.57

0.62

Pass

**Pass** 

Pass

Pass

# 11. T-Coil testing for OTT VoIP Application

#### **General Notes:**

- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.
- 2. The google Duo VoIP application are pre-installed on this device. According to KDB 285076 D02, all air interfaces via a data connection with VoIP application need to be considered HAC testing.

Report No.: HA9D0635B

- 3. The Google Duo only support OPUS audio codec and support 6Kbps to 75Kbps bitrate.
- 4. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 5. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 6. Air Interface Investigation:
  - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
  - b. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VoLTE and VoWiFi test results of air interface investigation, the worst configuration and frequency band of air interface was used for OTT T-Coil testing.
    - -LTE FDD worst configuration and band: LTE Band 12/10MHz/QPSK/1RB Size
    - -LTE TDD worst configuration and band: LTE Band 48/20MHz/QPSK/1RB Size
    - -WLAN2.4GHz Ant 1 worst configuration: 802.11b /1Mbps
    - -WLAN2.4GHz Ant 2 worst configuration: 802.11b /1Mbps
    - -WLAN5GHz Ant 1 worst configuration and Band: WLAN 5.2GHz /11a/6Mbps
    - -WLAN5GHz Ant 2 worst configuration and Band: WLAN 5.3GHz /11a/6Mbps

#### <Codec Investigation>

#### **EDGE**

		Googl	e Duo			
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel	
ABM 1 (dBA/m)	-3.53	-2.23	-3.29			
ABM 2 (dBA/m)	-36.42	-35.23	-35.6	Axial	GSM850 / 189	
Signal Quality (dB)	32.89	33	32.31	Axiai	G310000 / 109	
Freq. Response	Pass	Pass	Pass			

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 26 of 31 FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

# SPORTON LAB. HAC T-COIL TEST REPORT

#### **HSPA**

	Google Duo										
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel						
ABM 1 (dBA/m)	-2.06	-2.1	-2.41								
ABM 2 (dBA/m)	-48.02	-47.95	-47.86	Axial	UMTS B2 / 9400						
Signal Quality (dB)	45.96	45.85	45.45	Axiai	01VITS B2 / 9400						
Freq. Response	Pass	Pass	Pass								

Report No.: HA9D0635B

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

#### 1XEVDO Rev A

		Googl	e Duo		
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	-2.06	-2.35	-1.99		
ABM 2 (dBA/m)	-48.66	-48.45	-47.66	Axial	BC0 / 384
Signal Quality (dB)	46.6	46.1	45.67	Axiai	BC0 / 364
Freq. Response	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

#### LTE FDD

		Googl	e Duo				
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel		
ABM 1 (dBA/m)	-1.77	-2.1	-1.79				
ABM 2 (dBA/m)	-47.32	-48.16	-47.08	Axial	B12 / 10M / 23095		
Signal Quality (dB)	uality (dB) 45.55		45.29	Axiai	B12 / 10WI / 23095		
Freq. Response	Pass	Pass	Pass				

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 27 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

### LTE TDD

	Google Duo										
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel						
ABM 1 (dBA/m)	-1.68	-1.57	-1.62								
ABM 2 (dBA/m)	-43.02	-43.07	-42.89	Avial	B48 / 20M / 55830						
Signal Quality (dB)	41.34	41.5	41.27	Axial	B46 / 20W / 53630						
Freq. Response	Pass	Pass	Pass								

Report No.: HA9D0635B

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

#### **WLAN**

	Google Duo										
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel						
ABM 1 (dBA/m)	-1.98	-1.81	-1.99								
ABM 2 (dBA/m)	-45.87	-44.66	-44.38	Axial	WLAN2.4G / 6						
Signal Quality (dB)	43.89	42.85	42.39	Axiai	WLAN2.4G / 6						
Freq. Response	Pass	Pass	Pass								

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 28 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020



### SPORTON LAB. HAC T-COIL TEST REPORT

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	dB	Signal Quality dB	T Rating	Ambient Noise dB (A/m)		Frequency Response
24	GSM850	EDGE 2 Tx slots	189	_	Axial (Z)	-3.29	-35.60	32.31	T4	-50.38	0.29	Pass
24	031/1030	EDGE 2 1X SIOIS	109		Transversal (Y)	-13.55	-44.91	31.36	T4	-50.26	0.29	1 033
25	GSM1900	EDGE 2 Tx slots	661	_	Axial (Z)	-5.11	-40.58	35.47	T4	-50.31	0.35	Pass
25	O3W1900	EDGE 2 1X SIOIS	001		Transversal (Y)	-13.06	-46.09	33.03	T4	-50.23	0.55	1 033
26	WCDMA II	HSPA	9400	_	Axial (Z)	-2.41	-47.86	45.45	T4	-50.31	0.5	Pass
20	WODIVIA	IIOI A	3400		Transversal (Y)	-10.13	-48.77	38.64	T4	-50.28	0.5	1 033
27	WCDMA V	HSPA	4182	_	Axial (Z)	-2.55	-47.90	45.35	T4	-50.34	0.19	Pass
21	WODINA	1101 A	4102		Transversal (Y)	-9.95	-48.30	38.35	T4	-50.27	0.19	1 033
28	CDMA BC0	RTAP 153.6Kbps	384	_	Axial (Z)	-1.99	-47.66	45.67	T4	-50.32	0.26	Pass
20	CDIVIA BCO	KTAL 100.0Kbps	304		Transversal (Y)	-10.16	-48.64	38.48	T4	-50.25	0.20	1 033
29	CDMA BC1	RTAP 153.6Kbps	600	_	Axial (Z)	-2.08	-48.26	46.18	T4	-50.32	0.41	Pass
23	CDIVIA BC1	KTAI 155.0Kbps	000		Transversal (Y)	-10.27	-48.21	37.94	T4	-50.27	0.41	1 033
30	LTE Band 12	10 QPSK 1 0	23095	_	Axial (Z)	-1.79	-47.08	45.29	T4	-50.30	0.06	Pass
30	LTL Band 12	10_Q1 3K_1_0	23093		Transversal (Y)	-9.79	-47.80	38.01	T4	-50.24	0.00	1 033
31	LTE Band 48	20_QPSK_1_0	55830	_	Axial (Z)	-1.62	-42.89	41.27	T4	-50.37	0.34	Pass
31	LIL Band 40	20_Q1 OR_1_0	33030		Transversal (Y)	-11.52	-43.98	32.46	T4	-50.22	0.04	1 433
32	WLAN2.4GHz	802.11b 1Mbps	6	Ant 1	Axial (Z)	-1.99	-44.38	42.39	T4	-50.35	0.29	Pass
52	WEATVE. FOTTE	002.11b 11lbp3		Ailt	Transversal (Y)	-10.00	-48.66	38.66	T4	-50.25	0.23	1 433
33	WLAN2.4GHz	802.11b 1Mbps	6	Ant 2	Axial (Z)	-1.87	-45.77	43.90	T4	-50.32	0.19	Pass
33	WLANZ.40112	002.11b 11lbps	U	AIIL Z	Transversal (Y)	-9.76	-48.64	38.88	T4	-50.26	0.19	1 033
34	WLAN5GHz	802.11a 6Mbps	40	Ant 1	Axial (Z)	-1.82	-42.50	40.68	T4	-50.34	0.05	Pass
J-4	VVLAINOOIIZ	002.11a 01v1bps	40	AIIL I	Transversal (Y)	-9.76	-47.82	38.06	T4	-50.21	0.03	1 000
35	WLAN5GHz	802.11a 6Mbps	60	Ant 2	Axial (Z)	-2.29	-46.35	44.06	T4	-50.33	0.43	Pass
33	VVLAINOOIIZ	002.11a 01v1bps	00	AIIL Z	Transversal (Y)	-9.90	-49.18	39.28	T4	-50.26	0.43	1 000

Report No.: HA9D0635B

#### Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- 2. The detail frequency response results please refer to appendix A.
- 3. Test Engineer: Bevis Chang, Nick Yu and Tom Jiang

TEL: 886-3-327-3456 Page: 29 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

## 12. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2. The judgment of conformity in the report is based on the measurement results excluding the measurement uncertainty.

Report No.: HA9D0635B

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)
Probe Sensitivity							
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %
Probe System							
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %
Test Signal							
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %
Positioning							
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %
External Contributions							
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %
Combined Standard Uncertainty						± 4.1 %	± 6.1 %
Coverage Factor for 95 %						K = 2	
Expanded Uncertainty						± 8.1 %	± 12.3 %

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 30 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020

### 13. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA9D0635B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 31 of 31
FAX: 886-3-328-4978 Issued Date: Feb. 07, 2020