

Report No.: HA9D0635-05B



HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : IHDT56YJ1

Equipment: Mobile Cellular Phone

Brand Name: Motorola

T-Rating : T3

Applicant : Motorola Mobility, LLC

222 W Merchandise Mart Plaza, Suite 1800, Chicago, IL 60654, United States

Manufacturer : Motorola Mobility, LLC

222 W Merchandise Mart Plaza, Suite 1800, Chicago, IL 60654, United States

Standard: FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received on Dec. 26, 2020 and testing was started from Jan. 16, 2020 and completed on Oct. 16, 2020. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Cona Huang / Deputy Manager

Gua Grang

SPORTON INTERNATIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

Table of Contents

1.	Attest	tation of Test Results	4
2.	Gener	ral Information	5
3.	Testin	ng Location	ε
4.		ed Standards	
5.		terface and Operating Mode	
6.		urement standards for T-Coil	
•	6.1	Frequency Response	
	6.2	T-Coil Signal Quality Categories	
7.	T-Coil	Test Procedure	
	7.1	Test Flow Chart	-
	7.2	Test Setup Diagram for GSM/UMTS/CDMA/VoLTE	
	7.3	Test Setup Diagram for VoWiFi – PAG reuse	
	7.4	Test Setup and Diagram for OTT VoIP – PAG Reuse	
	7.5	Description of EUT Test Position	
8.	Test E	Equipment List	18
9.	T-Coil	testing for CMRS Voice	19
	9.1	GSM Tests Results	19
	9.2	UMTS Tests Results	
	9.3	CDMA Tests Results	20
10.	T-Coil	I testing for CMRS IP Voice	21
	10.1	VoLTE Tests Results	21
	10.2	VoWiFi Tests Results	23
11.	T-Coil	I testing for OTT VoIP Application	26
	11.1	General OTT evaluation	26
	11.2	5G FR1 OTT evaluation	30
12.	Uncer	rtainty Assessment	31
13.	Refere	ences	32

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photo

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Form version: 181113 Page: 2 of 32 Issued Date: Oct. 20, 2020

Report No.: HA9D0635-05B

History of this test report

Report No.: HA9D0635-05B

Report No.	Version	Description	Issued Date
HA9D0635-05B	Rev. 01	Initial issue of report	Sep. 02, 2020
HA9D0635-05B	Rev. 02	Update section 8 and Appendix A, B.	Sep. 22, 2020
HA9D0635-05B	Rev. 03	Revised report to include all air interface	Sep. 24, 2020
HA9D0635-05B	Rev. 04	Update section8, 11 and appendix A, B	Oct. 20, 2020

TEL: 886-3-327-3456 Page: 3 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency	Magnetic
			Response	Intensity
GSM CMRS Voice	GSM850	T3	Pass	Pass
OSIVI CIVILOS VOICE	GSM1900	T4	Pass	Pass
OTT over EDGE	EDGE850	T3	Pass	Pass
OTT OVER EDOL	EDGE1900	T4	Pass	Pass
UMTS CMRS Voice	Band 2	T4	Pass	Pass
SWITE CWITE VOICE	Band 5	T4	Pass	Pass
OTT over UMTS	Band 2	T4	Pass	Pass
OTT OVER OWITS	Band 5	T4	Pass	Pass
CDMA CMRS Voice	BC0	T4	Pass	Pass
OTT over CDMA	BC1	T4	Pass	Pass
OTT over CDMA	BC0	T4	Pass	Pass
OTT OVER COINIA	BC1	T4	Pass	Pass
	Band 2	T4	Pass	Pass
VoLTE	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 7	T4	Pass	Pass
	Band 12	T4	Pass	Pass
	Band 13	T4	Pass	Pass
	Band 17	T4	Pass	Pass
	Band 48	T4	Pass	Pass
	Band 66	T4	Pass	Pass
OTT over LTE	Band 12	T4	Pass	Pass
OTTOVERLIE	Band 48	T4	Pass	Pass
	n2	T4	Pass	Pass
OTT over 5G FR1	n5	T4	Pass	Pass
	n66	T4	Pass	Pass
	2450	T4	Pass	Pass
	5200	T4	Pass	Pass
VoWiFI	5300	T4	Pass	Pass
	5500	T4	Pass	Pass
	5800	T4	Pass	Pass
OTT MIST	2450	T4	Pass	Pass
OTT over WiFi	5300	T4	Pass	Pass
Date Tested	W 1140 E W	2020/1/16	~ 2020/10/16	

Report No.: HA9D0635-05B

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

Reviewed by: <u>Jason Wang</u> Report Producer: <u>Daisy Peng</u>

TEL: 886-3-327-3456 Page: 4 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

2. General Information

	Product Feature & Specification
Applicant Name	Motorola Mobility, LLC
Equipment Name	Mobile Cellular Phone
Brand Name	Motorola
FCC ID	IHDT56YJ1
HW Version	DVT2
EUT Stage	Identical Prototype
Date Tested	2020/1/16 ~ 2020/1/27
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz CDMA2000 BC0: 824.7 MHz ~ 848.31 MHz CDMA 2000 BC1: 1851.25 MHz ~ 1908.75 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 715.3 MHz LTE Band 17: 706.5 MHz ~ 713.5 MHz LTE Band 48: 3552.5 MHz ~ 3697.5 MHz LTE Band 66: 1710.7 MHz ~ 779.3 MHz GG NR n2: 1850 MHz ~ 1910 MHz SG NR n6: 1710 MHz ~ 1840 MHz SG NR n66: 1710 MHz ~ 1780 MHz SG NR n66: 27500 ~ 28350 MHz WLAN 2.4GHz Band: 2412 MHz ~ 2462 MHz WLAN 5.3GHz Band: 5560 MHz ~ 5320 MHz WLAN 5.3GHz Band: 5560 MHz ~ 5320 MHz WLAN 5.6Hz Band: 5560 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz Bluetooth: 2402 MHz ~ 2480 MHz Bluetooth: 2402 MHz ~ 22480 MHz Bluetooth: 2402 MHz ~ 22480 MHz
Mode	GSM/GPRS/EGPRS AMR / RMC 12.2Kbps HSDPA HSUPA DC-HSDPA CDMA2000: 1xRTT/1xEv-Do(Rel.0)/1xEv-Do(Rev.B) LTE: QPSK, 16QAM, 64QAM 5G FR1: DFT-s-OFDM/CP-OFDM, Pi/2 BPSK/QPSK/16QAM/64QAM/256QAM 5G FR2: QPSK, 16QAM, and 64QAM for CP-OFDM WLAN: 802.11a/b/g/n/ac/ax HT20 / HT40 / VHT20 / VHT40 / VHT80 / VHT160 / HE20 / HE40 / HE80 Bluetooth BR/EDR/LE NFC:ASK

Report No.: HA9D0635-05B

TEL: 886-3-327-3456 Page: 5 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

3. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Report No.: HA9D0635-05B

	Testing Laboratory				
Test Site	SPORTON INTERNATIONAL INC.				
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978				
Test Site No.	Sporton Site No.: SAR04-HY				

4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

TEL: 886-3-327-3456 Page: 6 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

5. Air Interface and Operating Mode

Air	David Mile	T	C63.19	Simultaneous	Name of Voice	Power
Interface	Band MHz	Туре	Tested	Transmitter	Service	Reduction
	GSM850	\/O	V	WLAN, BT	CMDC Vaine	No
0014	GSM1900	VO	Yes	WLAN, BT	CMRS Voice	No
GSM	EDGE850	VD	Vaa	MI AN DT	Google Duo ⁽¹⁾	No
	EDGE1900	VD	Yes	WLAN, BT	Google Duo	No
	850			WLAN, BT		No
UMTS	1750	VO	Yes	WLAN, BT	CMRS Voice	No
UNITS	1900			WLAN, BT		No
	HSPA	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	850	VO	Yes	WLAN, BT	CMRS Voice	No
CDMA	1900	٧٥	168	WLAN, BT	CIVIRS VOICE	No
	EVDO	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	Band 2		Yes	5G NR, WLAN, BT		No
	Band 4			5G NR, WLAN, BT		No
	Band 5	VD		5G NR, WLAN, BT		No
LTE	Band 7			5G NR, WLAN, BT	VoLTE	No
(FDD)	Band 12			5G NR, WLAN, BT	Google Duo ⁽¹⁾	No
	Band 13			5G NR, WLAN, BT	J	No
	Band 17			5G NR, WLAN, BT		No
	Band 66			5G NR, WLAN, BT		No
LTE (TDD)	Band 48	VD	Yes	5G NR, WLAN, BT	VoLTE / Google Duo ⁽¹⁾	No
	n2					
	n5	VD	Yes	LTE, WLAN, BT	NA	No
5G NR	n66					
	n260	\/D	No ⁽³⁾	LTE MUAN DT	NIA	No
	n261	VD	NO ^(*)	LTE, WLAN, BT	NA	No
	2450					No
	5200			GSM,CDMA,WCDMA,LTE, 5G NR	VoWiFi ⁽¹⁾	No
Wi-Fi	5300	VD	Yes	GSM,CDMA,WCDMA,LTE, 5G NR	/	No
	5500			GSM,CDMA,WCDMA,LTE, 5G NR	Google Duo ⁽¹⁾	No
	5800					No
ВТ	2450	DT	No	GSM,CDMA,WCDMA,LTE, 5G NR	NA	No

Report No.: HA9D0635-05B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

Remark:

- 1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.
- 2. The device have similar frequency in some LTE bands: LTE B12/17, 4/66, since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.
- 3. n260 and n261 are currently outside the scope of ANSI C63.19 and FCC HAC regulations therefore they were not evaluated.
- 4. In this report to enable 5G FR1 evaluation, the other air interfaces are refer to original sporton T-coil report, report no.: HA9D0635B.


TEL: 886-3-327-3456 Page: 7 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

6. Measurement standards for T-Coil

6.1 Frequency Response

The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA9D0635-05B

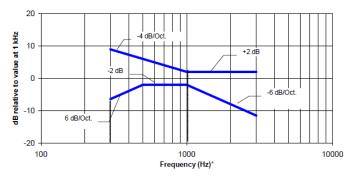

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

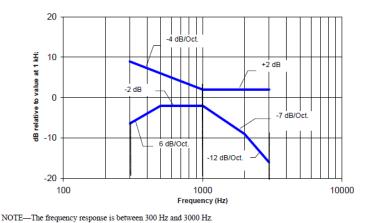


Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds –15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

TEL: 886-3-327-3456 Page: 8 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA9D0635-05B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 9 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

7.1 Test Flow Chart


Test Instructions Confirm calibration of test eq uip ment Configure and validate the test setup Establish WD reference level Find measurement locations Per sub clause 7.3, 7.4.1 a)-b) & 7.4.4.4 Position and orient probe Measure desired aud io band signal strength Per sub clause 7.4.1 c)-e) Calculate signal strength Calculate signal quality Measure frequency resposne (perpendicular orientation only) Per sub clause 7.4.5 - 7.4.6 All locations measured? All locations measured? Determine and record signal quality category Done Per sub clause 8.2.4

Report No. : HA9D0635-05B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 10 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

7.2 Test Setup Diagram for GSM/UMTS/CDMA/VoLTE

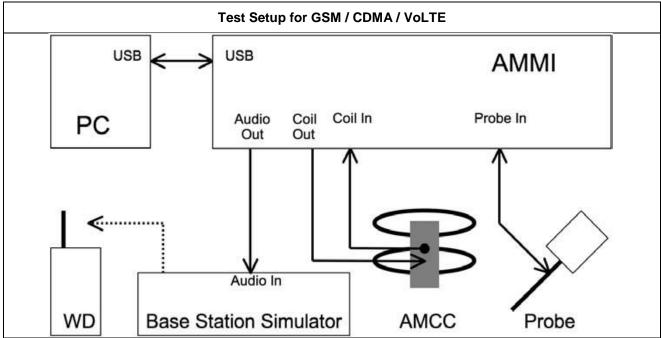

Report No.: HA9D0635-05B

General Note:

- Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - GSM input level: -16dBm0
 - UMTS input level: -16dBm0
 - CDMA input level: -18dBm0
 - VoLTE input level: -16dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. Voice over Long-Term Evolution (VoLTE) is a standard for high-speed wireless communication for mobile phones and data terminals including IoT devices and wearables. It is based on the IP Multimedia Subsystem (IMS) network, with specific profiles for control and media planes of voice service on LTE defined by GSMA in PRD IR.92. This approach results in the voice service (control and media planes) being delivered as data flows within the LTE data bearer. This means that there is no dependency on the legacy circuit-switched voice network to be maintained
- 5. The test setup used for VoLTE over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE when the device during the IMS connection.

TEL: 886-3-327-3456 Page: 11 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

<Define the input level for GSM/UMTS/CDMA>

1. The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No. : HA9D0635-05B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

<Example define the input level for GSM/UMTS/CDMA>

AEXAMPIO GOMEO CIT	o inipat lovoi loi col	III OI OI O DIIII I V	
Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.47	3.14
10	20	-19.85	-14.24
8.17	18.24	-21.61	-16


Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

<Example define the input level for VoLTE>

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)
	3.14	1.5		0.51	
100	5.61		40	2.98	3.13
8.31	-16		18.39		-18.48
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting
1kHz sine	-	3	0	1	8.31
48k_voice_1kHz	1	16.2	-12.7	4.33	35.98
48k_voice_300-3000	2	21.6	-18.6	8.48	70.46

TEL: 886-3-327-3456 Page: 12 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

7.3 Test Setup Diagram for VoWiFi – PAG reuse

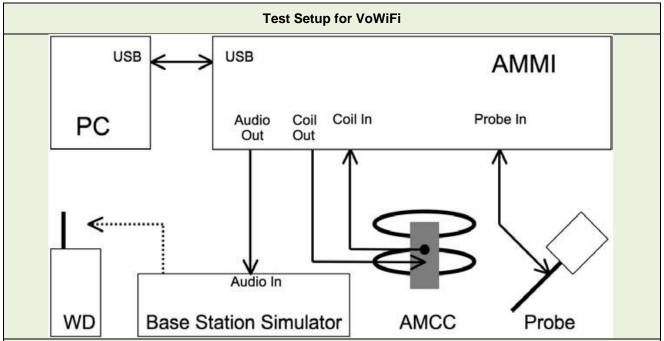

Report No.: HA9D0635-05B

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - VoWiFi input level: -20dBm0
- 2. For Voice over Wi-Fi (VoWiFi) is a term typically employed to describe the delivery of commercial telephony services using Voice over IP (VoIP) technologies from mobile devices connected across Wi-Fi. This is typically counter to alternatives, predominantly Voice over LTE (VoLTE), in which a mobile network operator's (MNO's) licensed spectrum (i.e. 4G LTE) is used to carry packetized voice. Broadly speaking, VoWiFi terminology is assigned to all core IMS services accessed from unlicensed spectrum and across untrusted access infrastructures, such as public Wi-Fi access points
- 3. The test setup used for VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -20dBm0 for VoWiFi when the device during the IMS connection.
- 4. An investigation was perfromed to determine worst case codec, bit rate and air interface configuration refer to section10.2

TEL: 886-3-327-3456 Page: 13 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

<Define the input level for VoWiFi>

1. The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA9D0635-05B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	


(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Gain Value	dBm0	Full scal Voltage	dB	AMMI audio out dBv (RMS)	AMCC Coil Out (dBv (RMS)
	3.14	1.5		0.51	
100	5.61		40	2.98	3.13
5.24	-20		14.39		-22.48
Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain Setting
1kHz sine	-	3	0	1	5.24
48k_voice_1kHz	1	16.2	-12.7	4.33	22.70
48k_voice_300-3000	2	21.6	-18.6	8.48	44.46

TEL: 886-3-327-3456 Page: 14 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

7.4 Test Setup and Diagram for OTT VoIP - PAG Reuse

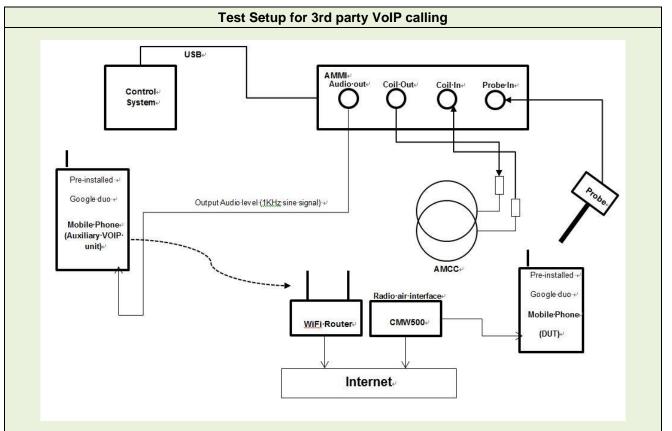

Report No.: HA9D0635-05B

General Note:

- Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
- OTT VoIP input Level: -20dBm0
- 2. Voice over Internet Protocol (VoIP) such as google duo application, also called IP telephony, is a methodology and group of technologies for the delivery of voice communications and multimedia sessions over Internet Protocol (IP) networks, such as the Internet. The terms Internet telephony, broadband telephony, and broadband phone service specifically refer to the provisioning of communications services (voice, fax, SMS, voice-messaging) over the public Internet, rather than via the public switched telephone network (PSTN)
- 3. The **Google DUO** service and relate codec "**OPUS**" and support 6Kbps to 75Kbps bitrate and the customized **Google DUO** software is installed on a mobile phone which is used as the Auxiliary for the test. The **DUO** software enables audio coding rate to be changed, and reports the input digital audio level before DUO audio processing which can be used to calibrate the input audio level.
- This device comes with the preinstalled VoIP application that supports the Google DUO service and related codec OPUS. The test configuration establishes a call between the device under test and an auxiliary handset via the DUO server.
- 5. The test setup used for Google DUO VoIP call is via the data application unit on the CMW, connected to the internet via the DUO server to the auxiliary device. The auxiliary device runs special software that allows the codec bit rate (6Kbps to 75 Kbps) to be fixed to a specific value. Please refer to section11, an assessment was made of each of the different codec bit rates to determine the worst case for each of the different OTT transport (WiFi, LTE FDD, LTE TDD, GSM, WCDMA)
- 6. The auxiliary device includes software that displays the audio level in dBFS which allows calibration of the system to establish the -20dBm0 reference level. After establishing the voice call between auxiliary device and device under test the audio output from the AMMI is injected into the auxiliary device. The gain factor to establish a reference level of -20dBm0 for use during the test is determined as detailed in the next page based on the 0dBFull Scale (0dBFS) value being equivalent to 3.14dBm0.

TEL: 886-3-327-3456 Page: 15 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

<Define the input level for OTT VoIP>

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA9D0635-05B

- 2. The below calculation formula is an example and showing how to determine the input level for the device.
- 3. Input a gain value to readout the -23dBFS level as reference. (0dBFS = 3.14 dBm0)
- 4. Adjust gain level until to readout the dBFS level until it changes to -24dBFS.
- 5. Based on the step 1 and 2, and then calculate the gain value(dB) by interpolation to get the -20dBm0 corresponding gain value.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Cton	Signal type	Audi	o out	Target Level			
Step	Signal type	Gain value	Gain value (dB)	dBFS	dBm0		
Step 1	1KHz Sine	7.7	17.73 (Ref.)	-23			
Step 2	1KHz Sine	6.8	16.65	-24			
Step 3	1KHz Sine	7.57**	17.58*	-23.14	-20		

Remark (*) Based on the step 1 and 2 and then via interpolation to get this value. (**) Gain value=10^Gain value(dB)/20

Signal type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Gain Factor	Gain value
1kHz sine		3	0	1	7.57
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	32.77
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	64.79

- 1. According to the gain setting for 1kHz sine wave, determine the gain setting for signals above.
- 2. The gain for the specific signal is multiplied by this factor to achieve the same level as for the 1kHz sine signal.

TEL: 886-3-327-3456 Page: 16 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

7.5 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA9D0635-05B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

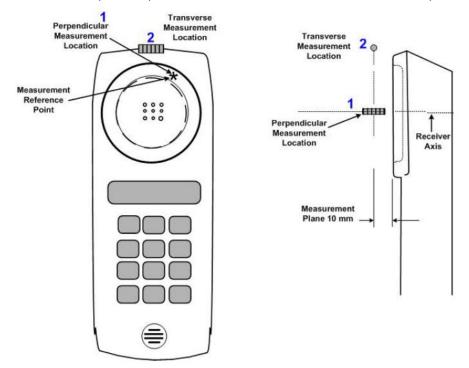


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 17 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

8. Test Equipment List

Manufacturer	Name of Equipment	Type/Medal	Serial Number	Calib	ration
Manuracturer	Name of Equipment	Type/Model	Serial Number	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 20, 2019	Nov. 19, 2020
SPEAG	Data Acquisition Electronics	DAE4	1311	Aug. 27, 2019	Aug. 26, 2020
SPEAG	Data Acquisition Electronics	DAE4	1311	Aug. 25, 2019	Aug. 24, 2021
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
RCPTWN	Thermometer	HTC-1	TM685-1	Nov. 12, 2019	Nov. 11, 2020
R&S	Wideband Radio Communication Tester	CMW500	115793	Jun. 04, 2019	Jun. 03, 2020
R&S	Wideband Radio Communication Tester	CMW500	169351	Aug. 28, 2020	Aug. 27, 2021
R&S	Base Station	CMU200	117591	Dec. 09, 2019	Dec. 08, 2020
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR

Report No.: HA9D0635-05B

Note:

TEL: 886-3-327-3456 Page: 18 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

^{1.} NCR: "No-Calibration Required"

9. T-Coil testing for CMRS Voice

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.

Report No.: HA9D0635-05B

2. Air Interface Investigation:

- a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
- b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

9.1 GSM Tests Results

<Codec Investigation>

Codec	FR_V1	HR_V1	Orientation	Band / Channel
ABM 1 (dBA/m)	-5.15	-5.46		
ABM 2 (dBA/m)	(dBA/m) -30.04 -33.66		Axial	GSM850 / 189
Signal Quality (dB)	24.89	28.2	Axiai	G310050 / 169
Freq. Response	ı. Response Pass Pass			

Remark: According to codec investigation, the worst codec is FR_V1

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
1	GSM850	GSM Voice	189	Axial (Z)	-5.15	-30.04	24.89	T3	-50.33	1.11	Pass
	GSIVIOSO	GSW VOICE	109	Transversal (Y)	-16.21	-42.34	26.13	T3	-50.21		
				Axial (Z)	-4.54	-41.68	37.14	T4	-50.34		
2	2 GSM1900 GSM Voice	661	Transversal (Y)	-12.36	-45.65	33.29	T4	-50.27	1	Pass	
			Transversal (Y)	-12.10	-46.34	34.24	T4	-50.25			

TEL: 886-3-327-3456 Page: 19 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

9.2 UMTS Tests Results

<Codec Investigation>

Codec	AMR 4.75Kbps	AMR 7.95Kbps	AMR 12.2Kbps	Orientation	Band / Channel	
ABM 1 (dBA/m)	-3.58	-3.14	-3.21			
ABM 2 (dBA/m)	-44.16	-43.18	-42.86	Axial	Band 5 / 4182	
Signal Quality (dB)	uality (dB) 40.58 40.04		39.65	Axiai	Bana 5 / 4 162	
Freq. Response	Pass	Pass	Pass			

Report No.: HA9D0635-05B

Remark: According to codec investigation, the worst codec is AMR 12.2Kbps

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response						
3	WCDMA II	Voice	9400	Axial (Z)	-3.21	-42.86	39.65	T4	-50.37	0.91	Pass						
3	WCDIVIA	VOICE	9400	3400	Transversal (Y)	-10.72	-47.33	36.61	T4	-50.24	0.91	F 455					
										Axial (Z)	-3.34	-43.42	40.08	T4	-50.38		
4	4 WCDMA V Voice	4182	Transversal (Y)	-10.79	-47.22	36.43	T4	-50.23	1.05	Pass							
			Transversal (Y)	-12.10	-46.34	34.24	T4	-50.25									

9.3 CDMA Tests Results

<Codec Investigation>

Codec	RC1 SO68	RC3 SO68	RC4 SO68	Orientation	Band / Channel	
ABM 1 (dBA/m)	-2.47	-2	-2.66			
ABM 2 (dBA/m)	-41.38	-49.98	-48.9	Axial	BC0 / 384	
Signal Quality (dB)	38.91	47.98	46.24	Axiai	BC0 / 364	
Freq. Response	Pass	Pass	Pass			

Remark: According to codec investigation, the worst codec is RC1 SO68

<Air Interface Investigation>

Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
_	CDMA DCO	RC1+SO3 Voice	204	Axial (Z)	-2.47	-41.38	38.91	T4	-50.36	0.70	Dana
5		codec / 8K Enhanced low	384	Transversal (Y)	-11.49	-48.05	36.56	T4	-50.21	0.78	Pass
	CDMA DC4	RC1+SO3 Voice	600	Axial (Z)	-4.66	-47.75	43.09	T4	-50.34	0.00	Dana
6	6 CDMA BC1	codec / 8K Enhanced low	600	Transversal (Y)	-12.10	-46.34	34.24	T4	-50.25	0.89	Pass

TEL: 886-3-327-3456 Page: 20 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

10. T-Coil testing for CMRS IP Voice

10.1 VoLTE Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.

Report No.: HA9D0635-05B

- b. Select LTE FDD / TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration, the observed variation is very little to be within 1.5 dB which is much less than the margin from the rating threshold.
- c. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

LTE FDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	-1.34	-2.97	-1.15	-1.24	-0.05	-0.63	-0.71	-0.41	-0.6	-0.56		
ABM 2 (dBA/m)	-45.35	-44	-43.72	-43.13	-46.63	-46.38	-46.28	-46.07	-46.72	-46.62		B2 / 20M /
Signal Quality (dB)	44.01	41.03	42.57	41.89	46.58	45.75	45.57	45.66	46.12	46.06	Axial	18900
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

LTE TDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	-1.34	-3.14	-0.96	-1.05	0.07	-0.39	-0.5	-0.18	-0.55	-0.41		
ABM 2 (dBA/m)	-42.19	-39.43	-41.86	-41.48	-43.28	-43.14	-41.97	-43.04	-43.18	-42.89	Axial	B48 / 20M /
Signal Quality (dB)	40.85	36.29	40.9	40.43	43.35	42.75	41.47	42.86	42.63	42.48	Axiai	55830
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 21 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

SPORTON LAB. HAC T-COIL TEST REPORT

<Air Interface Investigation>

	Air Interface	BW (MHz)	Modulation / Mode	RB Size	RB offset	Channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B2	20	QPSK	1	0	18900	-	-2.77	-43.05	40.28
	LTE B2	20	QPSK	50	0	18900	•	-2.91	-43.82	40.91
	LTE B2	20	QPSK	100	0	18900	•	-3.11	-43.96	40.85
	LTE B2	20	16QAM	1	0	18900	-	-3.02	-44.01	40.99
FDD	LTE B2	20	64QAM	1	0	18900	-	-2.81	-43.54	40.73
רטט	LTE B2	15	QPSK	1	0	18900	-	-3.05	-43.99	40.94
	LTE B2	10	QPSK	1	0	18900	-	-3.09	-43.80	40.71
	LTE B2	5	QPSK	1	0	18900	-	-2.84	-43.39	40.55
	LTE B2	3	QPSK	1	0	18900	-	-2.87	-43.59	40.72
	LTE B2	1.4	QPSK	1	0	18900	-	-2.77	-43.78	41.01
	LTE B48	20	QPSK	1	0	55830	0	-4.43	-40.91	36.48
	LTE B48	20	QPSK	50	0	55830	0	-4.15	-41.05	36.90
	LTE B48	20	QPSK	100	0	55830	0	-3.92	-40.83	36.91
	LTE B48	20	16QAM	1	0	55830	0	-3.99	-40.82	36.83
	LTE B48	20	64QAM	1	0	55830	0	-4.06	-40.92	36.86
	LTE B48	15	QPSK	1	0	55830	0	-4.45	-41.04	36.59
TDD	LTE B48	10	QPSK	1	0	55830	0	-4.01	-40.84	36.83
	LTE B48	5	QPSK	1	0	55830	0	-4.17	-40.91	36.74
	LTE B48	20	QPSK	1	0	55830	1	-4.22	-41.25	37.03
	LTE B48	20	QPSK	1	0	55830	2	-4.36	-41.47	37.11
	LTE B48	20	QPSK	1	0	55830	3	-4.24	-41.18	36.94
	LTE B48	20	QPSK	1	0	55830	4	-4.39	-41.47	37.08
	LTE B48	20	QPSK	1	0	55830	5	-4.15	-41.07	36.92

Report No.: HA9D0635-05B

Plot No.	Air Interface	BW (MHz)	Modulation / Mode		RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB		Ambient Noise dB (A/m)	Response	Frequency Response
7	LTE Band 2	20	QPSK	1	0	18900	Axial (Z)	-2.97	-44.00	41.03	T4	-50.31	1	Pass
_ ′	LTL Danu Z	20	QI SIX	'	0	10900	Transversal (Y)	-11.63	-46.16	34.53	T4	-50.23	1	1 033
8	LTE Band 5	10	QPSK	1	0	20525	Axial (Z)	-3.20	-45.07	41.87	T4	-50.36	1.22	Pass
0	LIL Danu 3	10	QFSK	'	U	20323	Transversal (Y)	-11.12	-46.86	35.74	T4	-50.21	1.22	F 455
9	LTE Band 7	20	QPSK	1	0	21100	Axial (Z)	-3.09	-44.51	41.42	T4	-50.34	1.12	Pass
9	LIE Band /	20	QPSK	'	U	0 21100	Transversal (Y)	-11.62	-47.23	35.61	T4	-50.23	1.12	1 033
10	LTE Band 12	10	QPSK	1	0	22205	Axial (Z)	-3.98	-44.54	40.56	T4	-50.34	1.16	Dana
10	LIE Danu 12	10	QPSK	'	0	23095	Transversal (Y)	-11.05	-46.80	35.75	T4	-50.20	1.10	Pass
44	LTC David 40	40	ODCK	4	0	22220	Axial (Z)	-3.10	-44.80	41.70	T4	-50.33	0.7	Dana
11	LTE Band 13	10	QPSK	1	0	23230	Transversal (Y)	-10.99	-47.28	36.29	T4	-50.26	0.7	Pass
40	LTC David 40	00	ODCK	4	0	FF000	Axial (Z)	-3.14	-39.43	36.29	T4	-50.33	0.00	Dana
12	LTE Band 48	20	QPSK	1	0	55830	Transversal (Y)	-13.01	-43.33	30.32	T4	-50.27	0.92	Pass
40	LTE David CC	20	ODCK	_	0	422222	Axial (Z)	-3.57	-44.24	40.67	T4	-50.36	0.70	Dana
13 L	LTE Band 66	20	QPSK	1	0	132322	Transversal (Y)	-10.73	-46.19	35.46	T4	-50.21	0.73	Pass

TEL: 886-3-327-3456 Page: 22 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

10.2 VoWiFi Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations
(WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It
is only necessary to document this for one channel/band, the following worst investigation codec would be remarked
to be used for the testing for the handset.

Report No.: HA9D0635-05B

- 2. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
 - b. Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
 - c. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	-7.93	-8.65	-5	-9.3	-7.7	-4.53	-6.98	-3.98	-7.9	-4.27		
ABM 2 (dBA/m)	-44.25	-42.75	-43.2	-47.92	-47.11	-48.78	-42.64	-46.09	-48.53	-45.36		2.4GHz
Signal Quality (dB)	36.32	34.1	38.2	38.62	39.41	44.25	35.66	42.11	40.63	41.09	Axial	WLAN / 6
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is WB AMR 6.60Kbps

TEL: 886-3-327-3456 Page: 23 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

<Air Interface Investigation>

Frequency Bands	Modulation	Bandwidth	Data Rate	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	802.11b	20	1M	6	-12.73	-43.85	31.12
WLAN 2.4GHz	802.11b	20	11M	6	-10.39	-45.90	35.51
	802.11g	20	6M	6	-10.11	-45.98	35.87
	802.11g	20	54M	6	-6.76	-42.42	35.66
\\\\\	802.11n-HT20	20	MCS0	6	-6.92	-43.22	36.30
WLAN 2.4GHZ	802.11n-HT20	20	MCS7	6	-12.14	-45.81	33.67
	802.11ax-HE20	20	MCS0	6	-12.85	-45.27	32.42
	802.11ax-HE20	20	MCS11	6	-12.57	-46.27	33.70
	802.11ax-HE40	40	MCS0	6	-6.92	-43.17	36.25
	802.11ax-HE40	40	MCS11	6	-11.86	-46.08	34.22
	802.11a	20	6M	40	-11.73	-45.98	34.25
	802.11a	20	54M	40	-11.65	-46.90	35.25
	802.11an-HT20	20	MCS0	40	-11.69	-46.96	35.27
	802.11an-HT20	20	MCS7	40	-11.85	-46.42	34.57
	802.11an-HT40	40	MCS0	38	-11.66	-46.81	35.15
	802.11an-HT40	40	MCS7	38	-11.57	-46.91	35.34
	802.11ac-VHT20	20	MCS0	40	-13.49	-48.01	34.52
	802.11ac-VHT20	20	MCS8	40	-13.64	-48.70	35.06
WLAN 5GHz	802.11ac-VHT40	40	MCS0	38	-11.77	-46.51	34.74
WLAN 5GHZ	802.11ac-VHT40	40	MCS8	38	-11.66	-46.99	35.33
	802.11ac-VHT80	80	MCS0	42	-11.71	-46.19	34.48
	802.11ac-VHT80	80	MCS8	42	-11.47	-46.38	34.91
	802.11ax-HE20	20	MCS0	40	-11.90	-46.73	34.83
	802.11ax-HE20	20	MCS11	40	-14.07	-48.33	34.26
	802.11ax-HE40	40	MCS0	38	-12.82	-49.12	36.30
	802.11ax-HE40	40	MCS11	38	-11.56	-46.44	34.88
	802.11ax-HE80	80	MCS0	42	-11.62	-46.88	35.26
	802.11ax-HE80	80	MCS11	42	-11.30	-46.72	35.42

Report No.: HA9D0635-05B

TEL: 886-3-327-3456 Page: 24 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020



SPORTON LAB. HAC T-COIL TEST REPORT

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response
14	WLAN2.4GHz	802.11b 1Mbps	6	Ant 1	Axial (Z)	-8.65	-42.75	34.10	T4	-50.34	0.89	Pass
14	WEAT12.40112	002.11b 110bp3	U	Aire	Transversal (Y)	-14.62	-47.33	32.71	T4	-50.21	0.00	1 433
15	WLAN5GHz	802.11a 6Mbps	40	Ant 1	Axial (Z)	-13.19	-48.93	35.74	T4	-50.32	0.86	Pass
13	WLANSGIIZ	602.11a divibps	40	Anti	Transversal (Y)	-16.94	-48.43	31.49	T4	-50.19	0.80	Fass
16	WLAN5GHz	902 11a 6Mbna	60	Ant 1	Axial (Z)	-8.39	-48.53	40.14	T4	-50.36	0.63	Pass
10	WLANSGHZ	802.11a 6Mbps	60	Anti	Transversal (Y)	-16.50	-48.07	31.57	T4	-50.20	0.63	Pass
17	WLAN5GHz	902 11a 6Mbna	104	Ant 1	Axial (Z)	-6.79	-46.11	39.32	T4	-50.31	0.99	Pass
17	WLANSGHZ	802.11a 6Mbps	124	Anti	Transversal (Y)	-14.92	-47.27	32.35	T4	-50.21	0.99	Pass
18	WLAN5GHz	902 11a 6Mbna	157	Ant 1	Axial (Z)	-7.26	-44.26	37.00	T4	-50.34	0.7	Pass
10	WLANSGHZ	802.11a 6Mbps	157	Anti	Transversal (Y)	-15.13	-47.56	32.43	T4	-50.23	0.7	Pass
19	WLAN2.4GHz	902 11h 1Mhna	6	Ant 2	Axial (Z)	-9.81	-47.98	38.17	T4	-50.34	0.76	Pass
19	WLANZ.4GHZ	802.11b 1Mbps	6	Ant 2	Transversal (Y)	-14.66	-48.56	33.90	T4	-50.29	0.76	Pass
20	MI ANGOLI-	000 44 a CMb a a	40	A = 4 O	Axial (Z)	-7.22	-43.54	36.32	T4	-50.34	0.67	Dana
20	WLAN5GHz	802.11a 6Mbps	40	Ant 2	Transversal (Y)	-14.76	-48.73	33.97	T4	-50.23	0.67	Pass
21	WLAN5GHz	902 11a 6Mbna	60	Ant 2	Axial (Z)	-7.20	-45.01	37.81	T4	-50.30	0.96	Pass
21	WLANSGHZ	802.11a 6Mbps	60	Ant 2	Transversal (Y)	-14.37	-46.71	32.34	T4	-50.23	0.96	Pass
	MI ANGOLI-	000 44 a CMb a a	404	A = 4 O	Axial (Z)	-9.77	-47.54	37.77	T4	-50.33	4.57	Dana
22	WLAN5GHz	802.11a 6Mbps	124	Ant 2	Transversal (Y)	-14.58	-48.40	33.82	T4	-50.27	1.57	Pass
00	VALLANIE CI I-	000 44a CMbaa	457	A 4 O	Axial (Z)	-12.08	-45.53	33.45	T4	-50.33	3 0.62	Poor
23	WLAN5GHz	802.11a 6Mbps	157	Ant 2	Transversal (Y)	-14.91	-48.25	33.34	T4	-50.21	0.6∠	Pass

Report No.: HA9D0635-05B

TEL: 886-3-327-3456 Page: 25 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

11. T-Coil testing for OTT VoIP Application

11.1 General OTT evaluation

General Notes:

- 1. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.
- 2. The google Duo VoIP application are pre-installed on this device. According to KDB 285076 D02, all air interfaces via a data connection with VoIP application need to be considered HAC testing.

Report No.: HA9D0635-05B

- 3. The Google Duo only support OPUS audio codec and support 6Kbps to 75Kbps bitrate.
- 4. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 5. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 6. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VoLTE and VoWiFi test results of air interface investigation, the worst configuration and frequency band of air interface was used for OTT T-Coil testing.
 - -LTE FDD worst configuration and band: LTE Band 12/10MHz/QPSK/1RB Size
 - -LTE TDD worst configuration and band: LTE Band 48/20MHz/QPSK/1RB Size
 - -WLAN2.4GHz Ant 1 worst configuration: 802.11b /1Mbps
 - -WLAN2.4GHz Ant 2 worst configuration: 802.11b /1Mbps
 - -WLAN5GHz Ant 1 worst configuration and Band: WLAN 5.2GHz /11a/6Mbps
 - -WLAN5GHz Ant 2 worst configuration and Band: WLAN 5.3GHz /11a/6Mbps

<Codec Investigation>

EDGE

Google Duo									
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel				
ABM 1 (dBA/m)	-3.53	-2.23	-3.29						
ABM 2 (dBA/m)	-36.42	-35.23	-35.6	Axial	OCM050 / 400				
Signal Quality (dB)	32.89	33	32.31	Axiai	GSM850 / 189				
Freq. Response	Pass	Pass	Pass						

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 26 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

SPORTON LAB. HAC T-COIL TEST REPORT

HSPA

Google Duo									
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel				
ABM 1 (dBA/m)	-2.06	-2.1	-2.41						
ABM 2 (dBA/m)	-48.02	-47.95	-47.86	Avial	UMTS B2 / 9400				
Signal Quality (dB)	45.96	45.85	45.45	Axial	OWI 3 B2 / 9400				
Freq. Response	Pass	Pass	Pass						

Report No.: HA9D0635-05B

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

1XEVDO Rev A

Google Duo									
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel				
ABM 1 (dBA/m)	-2.06	-2.35	-1.99						
ABM 2 (dBA/m)	-48.66	-48.45	-47.66	Axial	DC0 / 204				
Signal Quality (dB)	46.6	46.1	45.67	Axiai	BC0 / 384				
Freq. Response	Pass	Pass	Pass						

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

LTE FDD

	Google Duo									
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel					
ABM 1 (dBA/m)	-1.77	-2.1	-1.79							
ABM 2 (dBA/m)	-47.32	-48.16	-47.08	Axial	D40 / 40M / 22005					
Signal Quality (dB)	45.55	46.06	45.29	Axiai	B12 / 10M / 23095					
Freq. Response	Pass	Pass	Pass							

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 27 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

LTE TDD

Google Duo									
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel				
ABM 1 (dBA/m)	-1.68	-1.57	-1.62						
ABM 2 (dBA/m)	-43.02	-43.07	-42.89	Avial	B48 / 20M / 55830				
Signal Quality (dB)	41.34	41.5	41.27	Axial	D46 / ZUIVI / 5583U				
Freq. Response	Pass	Pass	Pass						

Report No.: HA9D0635-05B

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

WLAN

	Google Duo									
Codec	OPUS Bitrate 6Kbps	OPUS Bitrate 40Kbps	OPUS Bitrate 75Kbps	Orientation	Band / Channel					
ABM 1 (dBA/m)	-1.98	-1.81	-1.99							
ABM 2 (dBA/m)	-45.87	-44.66	-44.38	Axial	WI AND 40 / 6					
Signal Quality (dB)	43.89	42.85	42.39	Axiai	WLAN2.4G / 6					
Freq. Response	Pass	Pass	Pass							

Remark: According to codec investigation, the worst codec bitrate is 75Kbps

TEL: 886-3-327-3456 Page: 28 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020



SPORTON LAB. HAC T-COIL TEST REPORT

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB		Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response
24 GSM850	GSM850	EDGE 2 Tx slots	189	1	Axial (Z)	-3.29	-35.60	32.31	T4	-50.38	0.29	Pass
24	G3101030				Transversal (Y)	-13.55	-44.91	31.36	T4	-50.26		
25	GSM1900	EDGE 2 Tx slots	661	_	Axial (Z)	-5.11	-40.58	35.47	T4	-50.31	0.35	Pass
25	OSW1900	EDGE 2 1X 31013	001		Transversal (Y)	-13.06	-46.09	33.03	T4	-50.23	0.55	
26	WCDMA II	HSPA	9400	ı	Axial (Z)	-2.41	-47.86	45.45	T4	-50.31	0.5	Pass
20	WODIVIA				Transversal (Y)	-10.13	-48.77	38.64	T4	-50.28		
27	WCDMA V	HSPA	4182	-	Axial (Z)	-2.55	-47.90	45.35	T4	-50.34	0.19	Pass
	WODINA				Transversal (Y)	-9.95	-48.30	38.35	T4	-50.27		
28	CDMA BC0	RTAP 153.6Kbps	384	-	Axial (Z)	-1.99	-47.66	45.67	T4	-50.32	- 0.26	Pass
20	OBIVIA BOO				Transversal (Y)	-10.16	-48.64	38.48	T4	-50.25		
29	CDMA BC1	RTAP 153.6Kbps	600	-	Axial (Z)	-2.08	-48.26	46.18	T4	-50.32	0.41	Pass
23	OBIVIA BOT				Transversal (Y)	-10.27	-48.21	37.94	T4	-50.27		
30	LTE Band 12	10 QPSK 1 0	23095	_	Axial (Z)	-1.79	-47.08	45.29	T4	-50.30	0.06	Pass
30	LTL Band 12	10_Q1 3K_1_0	23093		Transversal (Y)	-9.79	-47.80	38.01	T4	-50.24		
31	LTE Band 48	20 QPSK 1 0	55830	-	Axial (Z)	-1.62	-42.89	41.27	T4	-50.37	0.34	Pass
31	ETE Band 40	20_Q1 ON_1_0			Transversal (Y)	-11.52	-43.98	32.46	T4	-50.22		
32	WLAN2.4GHz	802.11b 1Mbps	6	Ant 1	Axial (Z)	-1.99	-44.38	42.39	T4	-50.35	0.29	Pass
52	WEATVE. FOTTE	002.11b 11lbp3			Transversal (Y)	-10.00	-48.66	38.66	T4	-50.25		
33	WLAN2.4GHz	802.11b 1Mbps	6	Ant 2	Axial (Z)	-1.87	-45.77	43.90	T4	-50.32	0.19	Pass
- 55				AIIL Z	Transversal (Y) -9.76 -48.64 38.88 T4 -50	-50.26	0.13	1 433				
34	WLAN5GHz	802.11a 6Mbps	40	Ant 1	Axial (Z)	-1.82	-42.50	40.68	T4	-50.34	0.05	Pass
54			70	AIRT	Transversal (Y)	-9.76	-47.82	38.06	T4	-50.21	0.00	1 033
35	WLAN5GHz	802.11a 6Mbps	60	Ant 2	Axial (Z)	-2.29	-46.35	44.06	T4	-50.33	0.43	Pass
35				AIIL Z	Transversal (Y)	-9.90	-49.18	39.28	T4	-50.26		

Report No.: HA9D0635-05B

TEL: 886-3-327-3456 Page: 29 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

11.25G FR1 OTT evaluation

General Notes:

- 1. According to KDB 285076 D03, For 5G FR1 NSA mode OTT, establish the ABM1S65G value by using an IP connection for magnetic intensity for a call in the same band as the 5G FR1 band under test.
- Also note the actual ABM2LTE/OTT value and establish an ABM2S65G value, using a 5G manufacture test mode over 5 G Sub 6 channels for the same band under test.

Report No.: HA9D0635-05B

- 3. Document in the test report matrix:
 - a. Include columns for both ABM2LTE & ABM2S65G for comparison
 - b. Establish the S+N1/N2 for the rating
 - i. S+N1 = ABM1LTE (step 1) and
 - ii. N2 = ABM2S65G (step 2).
 - iii. Subtract 3 dB from S+N1/N2
 - c. Rating based on (ABM1LTE/ ABM2S65G) -3dB.

Plot No.	Air Interface	Modulation / Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	Signal Quality dB-3dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
	LTE Band 2	20M_QPSK_1_0	18900	Axial (Z)	-1.64	-46.25	44.61	-	T4	-50.30	0.49	Pass
36				Transversal (Y)	-10.27	-46.31	36.04	-	T4	-50.24		
30	5G NR n2	20_QPSK_1_1	376000	Axial (Z)	-1.64	-47.89	46.25	43.25	T4	-50.14	NA	NA
				Transversal (Y)	-10.27	-48.98	38.71	35.71	T4	-50.18		
37	LTE Band 5	10M_QPSK_1_0	20525	Axial (Z)	-1.80	-48.34	46.54	-	T4	-50.30	0.35	Pass
				Transversal (Y)	-9.75	-47.22	37.47	-	T4	-50.24		
	5G NR n5	20_QPSK_1_1	167300	Axial (Z)	-1.80	-47.95	46.15	43.15	T4	-50.32	NA NA	NA
				Transversal (Y)	-9.75	-48.34	38.59	35.59	T4	-50.29		
38	LTE Band 66	20M_QPSK_1_0	132322	Axial (Z)	-1.77	-46.05	44.28	-	T4	-50.30	0.47	Pass
				Transversal (Y)	-9.89	-46.33	36.44	-	T4	-50.24		
	5G NR n66	20_QPSK_1_1	349000	Axial (Z)	-1.77	-42.29	40.52	37.52	T4	-50.32	NA	NA
				Transversal (Y)	-9.89	-46.53	36.64	33.64	T4	-50.15		

Remark:

- 1. Phone Condition: Mute on; Backlight off; Max Volume
- 2. The detail frequency response results please refer to appendix A.
- 3. Test Engineer: Bevis Chang, Nick Yu and Tom Jiang

TEL: 886-3-327-3456 Page: 30 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

12. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2. The judgment of conformity in the report is based on the measurement results excluding the measurement uncertainty.

Report No.: HA9D0635-05B

Error Description	Uncertainty Error Description Value (±%)		ability Divisor		Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)		
		Probe Sen	sitivity						
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %		
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %		
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %		
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %		
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %		
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %		
		Probe Sy	stem						
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %		
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %		
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %		
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %		
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %		
Integration Time	0.6	Normal 1		1	5	± 0.6 %	± 3.0 %		
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %		
		Test Siç	gnal						
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %		
		Position	ning						
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %		
Phantom Thickness	Phantom Thickness 0.9		√3	1	1	± 0.5 %	± 0.5 %		
EUT Positioning	1.9	Rectangular √3		1	1	± 1.1 %	± 1.1 %		
External Contributions									
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %		
Test Signal Variation	2.0	2.0 Rectangular		1	1	± 1.2 %	± 1.2 %		
	± 4.1 %	± 6.1 %							
	K = 2								
		± 8.1 %	± 12.3 %						

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 31 of 32
FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020

13. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No. : HA9D0635-05B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 32 of 32 FAX: 886-3-328-4978 Issued Date: Oct. 20, 2020