
Testing Services™	Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW Page 1(34)			
Author Data	Dates of Test	Report No	FCC ID	
Andrew Becker	March 1-23, 2012	RTS-5994-1204-08	L6ARI	FD30CW

Annex A: Probe sensitivity and reference signal measurement plots



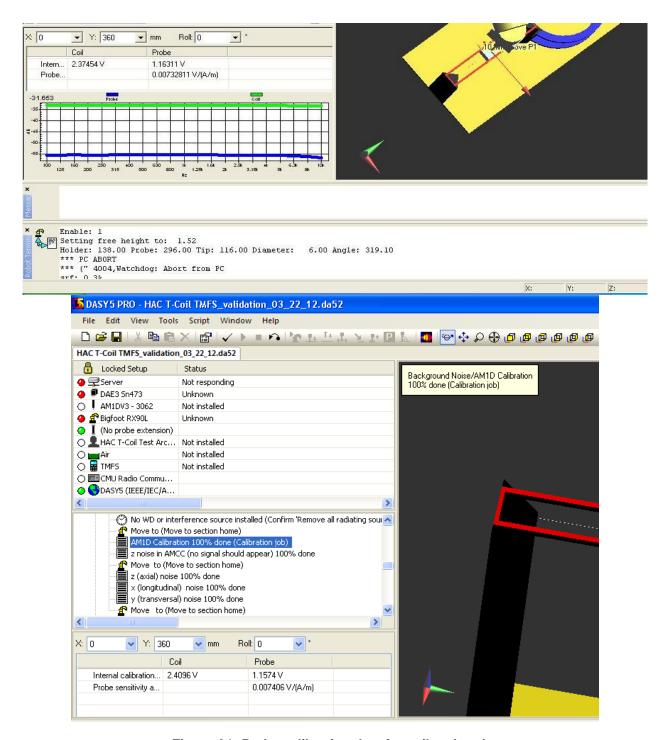


Figure A1: Probe calibration data for coil and probe

Testing Services™	Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW		^{Page} 3(34)	
Author Data	Dates of Test	Report No	FCC ID	
Andrew Becker	March 1-23, 2012	RTS-5994-1204-08	L6ARI	FD30CW

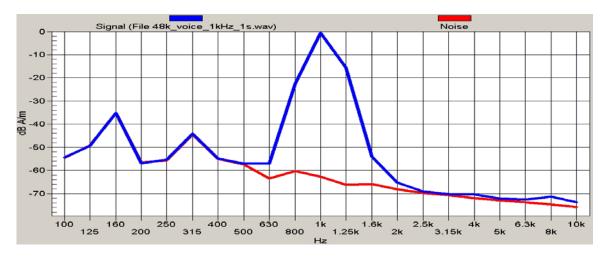


Figure A2: Reference voice 1 kHz signal and noise

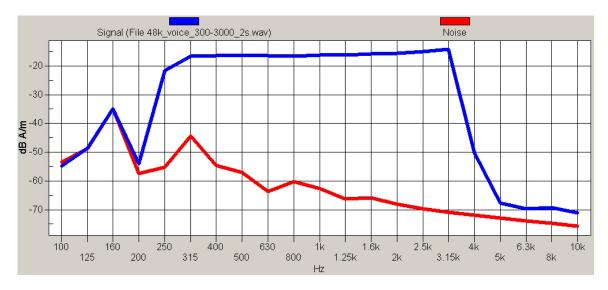


Figure A3: Reference voice simulated signal and noise

Testing Services™				Page 4(34)
Author Data	Dates of Test	Report No	FCC ID	
Andrew Becker	March 1-23, 2012	RTS-5994-1204-08	L6AR	FD30CW

Annex B: TMFS system validation and ambient data/plots

Testing Services™		Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW		Page 5(34)
Author Data	Dates of Test	Report No	FCC ID	
Andrew Becker	March 1-23, 2012	RTS-5994-1204-08	L6AR	FD30CW

Date/Time: 3/22/2012 2:26:08 PM

Test Laboratory: RIM Testing Services

HAC T-Coil TMFS_validation_03_22_12

DUT: TMFS; Type: TMFS-1

Communication System: CW; Frequency: 835 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn473; Calibrated: 1/13/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA;
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan/Background Noise/z (axial) noise/ABM Noise Spectrum(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off Output Gain: 0

Measure Window Start: 2000ms Measure Window Length: 5000ms Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM = -56.03 dB A/m Location: 0, 0, 13 mm



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Report No

Page 6(34)

Andrew Becker

Dates of Test

March 1-23, 2012 RTS-5994-1204-08

L6ARFD30CW

T-Coil scan/Background Noise/x (longitudinal) noise/ABM Noise Spectrum(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off Output Gain: 0

Measure Window Start: 2000ms Measure Window Length: 5000ms Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM = -56.01 dB A/m Location: 0, 0, 13 mm

T-Coil scan/Background Noise/y (transversal) noise/ABM Noise Spectrum(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off Output Gain: 0

Measure Window Start: 2000ms Measure Window Length: 5000ms Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM = -55.93 dB A/m Location: 0, 0, 13 mm

T-Coil scan/TMFS Validation/z (axial) 8 x 8 step 2/ABM Signal(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine Output Gain: 35.05

Measure Window Start: 0ms Measure Window Length: 1000ms

BWC applied: 0.0031 dB

Device Reference Point: 0, 0, -6.3 mm

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 7(34)

Author Data
Andrew Becker

Dates of Test

March 1-23, 2012

Report No RTS-5994-1204-08

L6ARFD30CW

Cursor:

ABM1 comp = -20.48 dB A/m BWC Factor = 0.0031 dB Location: 0, 0, 3.7 mm

T-Coil scan/TMFS Validation/x (longitudinal) 52 x 16 step 4/ABM Signal(x,y,z) (14x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: 0.0031 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -25.80 dB A/m BWC Factor = 0.0031 dB Location: -18, 0, 3.7 mm

T-Coil scan/TMFS Validation/y (transversal) 16 x 52 step 4/ABM Signal(x,y,z) (5x14x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine Output Gain: 35.05

Measure Window Start: 0ms Measure Window Length: 1000ms

BWC applied: 0.0031 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -25.76 dB A/m BWC Factor = 0.0031 dB Location: 0, -18, 3.7 mm

Testing Services™	1
----------------------	---

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page **8(34)**

Author Data

Andrew Becker

Dates of Test
March 1-23, 2012

Report No RTS-5994-1204-08

L6ARFD30CW

T-Coil scan/TMFS Validation/z (axial) at center 100% gain/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_multisine_50_10k_10s.wav

Output Gain: 87.2

Measure Window Start: 2000ms Measure Window Length: 5000ms


BWC applied: 13.16 dB


Device Reference Point: 0, 0, -6.3 mm


Cursor:


Diff = 1.99 dB


BWC Factor = 13.16 dB Location: 0, 0, 3.7 mm

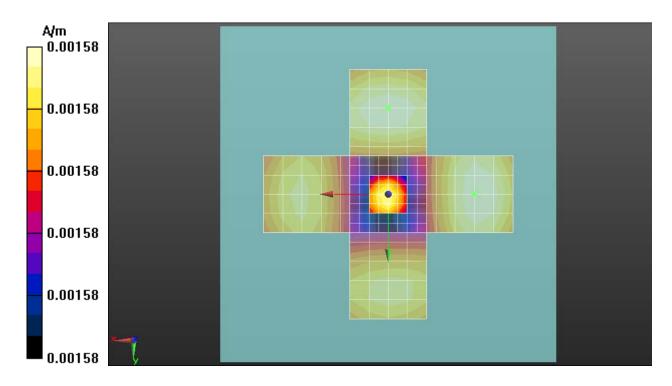





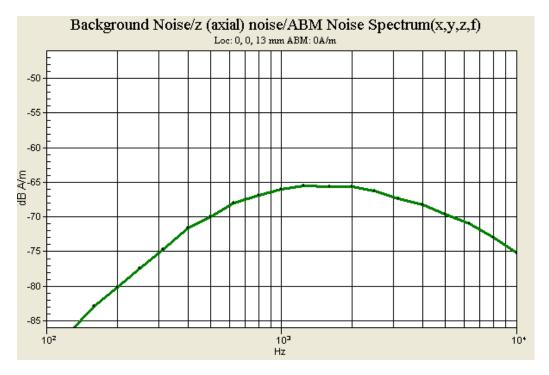

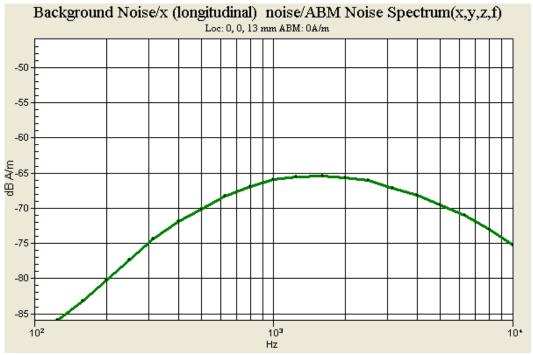



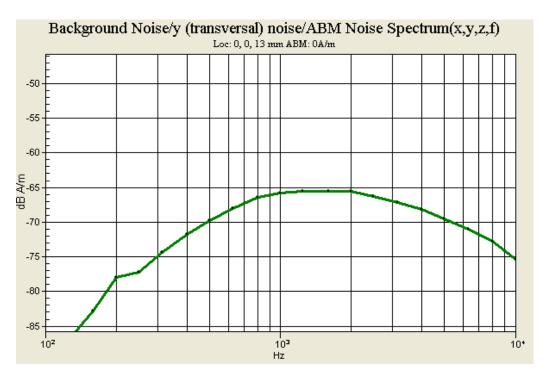

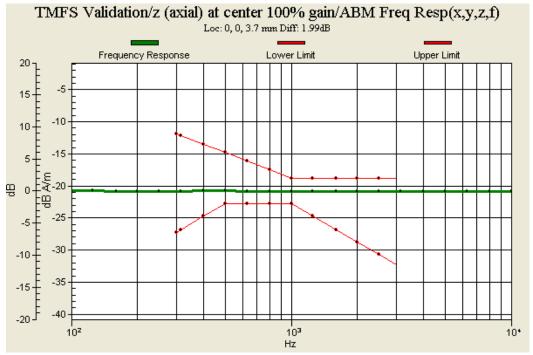

Testing Services™	l ·			Page 11(34)
Author Data	Dates of Test	Report No	FCC ID	
Andrew Becker	March 1-23, 2012	RTS-5994-1204-08	L6AR	FD30CW

Annex C: Audio Band Magnetic measurement data and plots

	Testing Services™
Author Data	

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

12(34)

Andrew Becker

Dates of Test

Report No March 1-23, 2012

RTS-5994-1204-08

L6ARFD30CW

Date/Time: 3/23/2012 12:58:21 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA800_Axial

DUT: BlackBerry; Type: Sample; Serial: 331D34F3

Communication System: CDMA 800 1/8 th; Frequency: 817.9 MHz, Frequency: 820.5 MHz,

Frequency: 823.1 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012

Sensor-Surface: 0mm (Fix Surface), z = 3.0

Electronics: DAE3 Sn473; Calibrated: 1/13/2012

Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: Not Specified

DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan/General Scans Low Ch./z (axial) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 13(34)

Author Data
Andrew Becker

Dates of Test

March 1-23, 2012

RTS-5994-1204-08

L6ARFD30CW

T-Coil scan/General Scans Low Ch./z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.39 dBABM1 comp = 10.27 dB A/m

BWC Factor = 0.16 dBLocation: -7, -7, 4.4 mm

T-Coil scan/General Scans Low Ch./z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms Measure Window Length: 2000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 2.00 dB

BWC Factor = 10.80 dB Location: -5, -5, 3.7 mm

T-Coil scan/General Scans Low Ch./z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.way) 48k voice 300-3000 2s.way

Output Gain: 69.12

Measure Window Start: 300ms Measure Window Length: 6000ms



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 14(34)

Author Data
Andrew Becker

Dates of Test
Morch

March 1-23, 2012

RTS-5994-1204-08

L6ARFD30CW

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

T-Coil scan/General Scans Mid Ch./z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.04 dBABM1 comp = 10.33 dB A/m

BWC Factor = 0.16 dB Location: -7, -7, 4.4 mm

T-Coil scan/General Scans Mid Ch./z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms Measure Window Length: 2000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.62 dB

BWC Factor = 10.80 dB Location: 0, 0, 13 mm

T-Coil scan/General Scans Mid Ch./z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 15(34)

Andrew Becker

Dates of Test

March 1-23, 2012

Report No

RTS-5994-1204-08

L6ARFD30CW

Measure Window Start: 2000ms Measure Window Length: 4000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 1.69 dB

BWC Factor = 10.80 dB Location: 0, 0, 13 mm

T-Coil scan/General Scans High Ch./z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.01 dBABM1 comp = 10.07 dB A/m

BWC Factor = 0.16 dB Location: -5, -5, 4.4 mm

T-Coil scan/General Scans High Ch./z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k voice 300-3000 2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms Measure Window Length: 4000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Testing Services™

Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 16(34)

Author Data
Andrew Becker

Dates of Test

March 1-23, 2012

Report No RTS-5994-1204-08

L6ARFD30CW

T-Coil scan/General Scans High Ch./z (axial) wideband at best S/N 2 2/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms Measure Window Length: 2000ms


BWC applied: 10.80 dB


Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 1.61 dB

BWC Factor = 10.80 dB Location: -5, -5, 3.7 mm

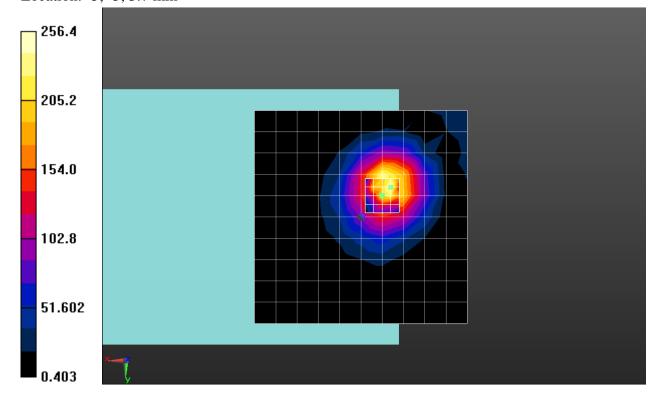



March 1-23, 2012

Andrew Becker

17(34)

L6ARFD30CW

General Scans Low Ch./z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) Loc: -5, -5, 3.7 mm Diff: 2dB Frequency Response Lower Limit Upper Limit 30 15 25 10 F 20 5 E15 ₽ 0 ·罗₁₀ -5 5 0 -15 -5 -20 5 103 10² 104

RTS-5994-1204-08



General Scans Low Ch./z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) Loc: -5, -5, 3.7 mm Diff: 2dB Frequency Response Lower Limit Upper Limit 20 30 15 25 10= 20 5 0 = £15 FB₁₀ -5 5 -10 0 -15 -20 J 10² 103 104



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Report No


18(34)


Andrew Becker


March 1-23, 2012

RTS-5994-1204-08


L6ARFD30CW

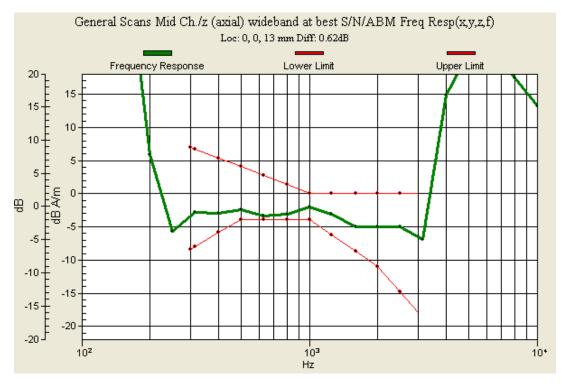


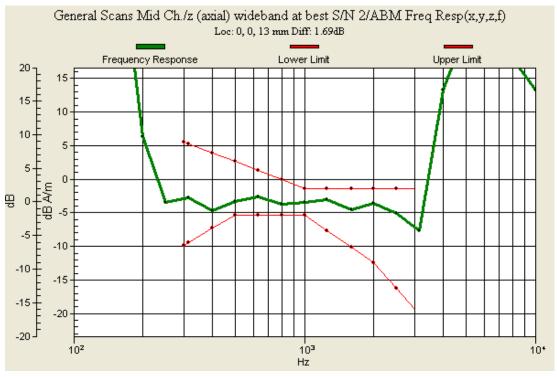



19(34)

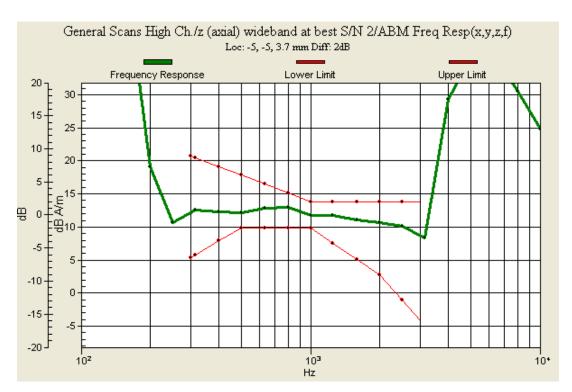

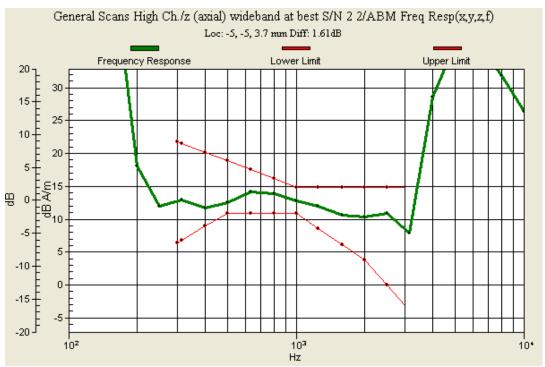

|--|

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

20(34)

Author Data

Andrew Becker

Dates of Test March 1-23, 2012 Report No RTS-5994-1204-08

L6ARFD30CW

Date/Time: 3/23/2012 1:11:46 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA800_Radial_L

DUT: BlackBerry; Type: Sample; Serial: 331D34F3

Communication System: CDMA 800 1/8 th; Frequency: 817.9 MHz, Frequency: 820.5 MHz,

Frequency: 823.1 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012

Sensor-Surface: 0mm (Fix Surface), z = 3.0

Electronics: DAE3 Sn473; Calibrated: 1/13/2012

Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: Not Specified

DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan/General Scans Low Ch./x (longitudinal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Testing Services™
Author Data

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Report No

21(34)

Andrew Becker

Dates of Test
March 1-23, 2012

RTS-5994-1204-08

L6ARFD30CW

T-Coil scan/General Scans Low Ch./x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 46.45 dB ABM1 comp = 1.59 dB A/m BWC Factor = 0.16 dB Location: 2, -8, 4.4 mm

T-Coil scan/General Scans Mid Ch./x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 46.44 dB ABM1 comp = 1.57 dB A/m BWC Factor = 0.16 dB Location: 2, -8, 4.4 mm

Document
Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFD31CW

Report No

Page 22(34)

Andrew Becker

Dates of Test

March 1-23, 2012

RTS-5994-1204-08

L6ARFD30CW

T-Coil scan/General Scans High Ch./x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28


Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 47.33 dBABM1 comp = 2.42 dB A/mBWC Factor = 0.16 dB

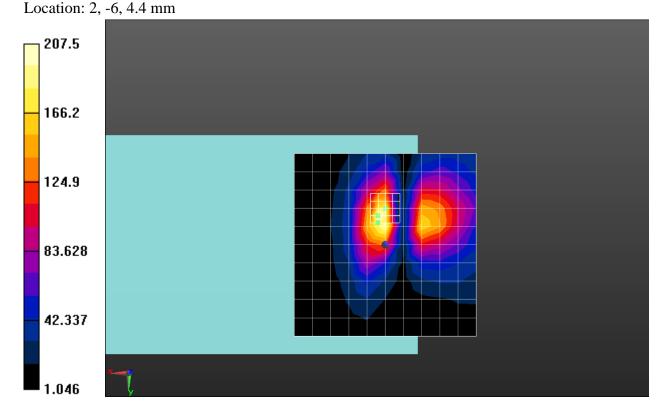

Testing Services	M.
Author Data	

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 23(34)

Andrew Becker

Dates of Test

March 1-23, 2012

Report No **RTS-5994-1204-08**

L6ARFD30CW

Date/Time: 3/23/2012 1:25:16 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA800_Radial_T

DUT: BlackBerry; Type: Sample; Serial: 331D34F3

Communication System: CDMA 800 1/8 th; Frequency: 817.9 MHz, Frequency: 820.5 MHz,

Frequency: 823.1 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn473; Calibrated: 1/13/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: Not Specified
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan/General Scans Low Ch./y (transversal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Testing Services™
Author Data

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Report No

24(34)

Andrew Becker

Dates of Test
March 1-23, 2012

RTS-5994-1204-08

L6ARFD30CW

T-Coil scan/General Scans Low Ch./y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 53.51 dB ABM1 comp = 0.80 dB A/m BWC Factor = 0.16 dB Location: -7, 3, 4.4 mm

T-Coil scan/General Scans Mid Ch./y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 53.32 dB ABM1 comp = 0.12 dB A/m BWC Factor = 0.16 dB Location: -9, 3, 4.4 mm

	Testing Services™	Hearing A Test Repo
Author Data		Dates of Test

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Fest Report for BlackBerry® Smartphone model RFD31CW

Page 25(34)

Andrew Becker

Dates of Test
March 1-23, 2012

Report No **RTS-5994-1204-08**

L6ARFD30CW

T-Coil scan/General Scans High Ch./y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28


Measure Window Start: 300ms Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 53.40 dB ABM1 comp = -1.21 dB A/m BWC Factor = 0.16 dB

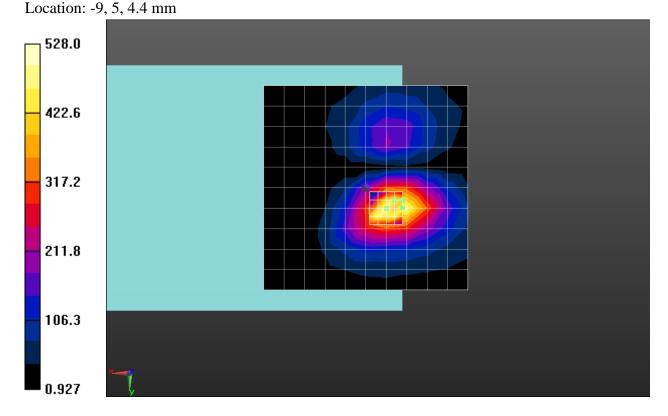

Testing Services™		udio Band Magnetic (ABM) T- Smartphone model RFD31CW		Page 26(34)
Author Data	Dates of Test Report No FCC ID			
Andrew Becker	March 1-23, 2012	RTS-5994-1204-08	L6AR	FD30CW

Annex D: Probe/TMFS calibration certificate



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

27(34)

Author Data

Andrew Becker

Dates of Test

March 1-23, 2012

Report No

RTS-5994-1204-08

L6ARFD30CW

Calibration Laboratory of Schmid & Partner Engineering AG Zeughausstrasse 43, 8004 Zurich, Switzerland





S Schweizerischer Kalibrierdienst
C Service suisse d'étalonnage
Servizio svizzero di taratura
S Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)

The Swiss Accreditation Service is one of the signatories to the EA

Multilateral Agreement for the recognition of calibration certificates

Client RTS (RIM Testing Services)

Certificate No: AM1DV3-3062 Jan12

Accreditation No.: SCS 108

Client RTS (RIM Test	ing Services)	Certificate	No: AM1DV3-3062_Jan12
CALIBRATION C	CERTIFICA		
Object	AM1DV3 - SN	: 3062	A A A A STATE OF THE STATE OF T
Calibration procedure(s)	QA CAL-24.v3 Calibration pro audio range) ocedure for AM1D magnetic field	probes and TMFS in the
Calibration date:	January 12, 2	012	
The measurements and the unce	ertainties with confiden	national standards, which realize the physical corprobability are given on the following pages	s and are part of the certificate.
vi calibrations have been condu Calibration Equipment used (M&		ratory facility: environment temperature (22 ±	3)*C and numidity < 70%.
Primary Standards	ID#	Cal Date (Certificate No.)	Scheduled Calibration
Ceithley Multimeter Type 2001	SN: 0810278	28-Sep-11 (No:11450)	Sep-12
Reference Probe AM1DV3	SN: 3000	17-Aug-11 (No. AM1D-3000_Aug11)	Aug-12
DAE4	SN: 781	20-Apr-11 (No. DAE4-781_Apr11)	Apr-12
Secondary Standards	ID#	Check Date (in house)	Scheduled Check
AMCC	1050	12-Oct-11 (in house check Oct-11)	Oct-13
	Name	Function	Signature
Calibrated by:	Dimoe lliev	Laboratory Technician	D. Sew
Approved by:	Katja Pokovic	Technical Manager	De 15
			Issued: January 13, 2012
This calibration certificate shall n	ot be reproduced exce	pt in full without written approval of the labora	tory.

Certificate No: AM1D-3062_Jan12

Page 1 of 3



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 28(34)

Author Data
Andrew Becker

Dates of Test

March 1-23, 2012

Report No

RTS-5994-1204-08

L6ARFD30CW

FCC ID

References

[1] ANSI C63.19-2007

American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.

[2] DASY5 manual, Chapter: Hearing Aid Compatibility (HAC) T-Coil Extension

Description of the AM1D probe

The AM1D Audio Magnetic Field Probe is a fully shielded magnetic field probe for the frequency range from 100 Hz to 20 kHz. The pickup coil is compliant with the dimensional requirements of [1]. The probe includes a symmetric low noise amplifier for the signal available at the shielded 3 pin connector at the side. Power is supplied via the same connector (phantom power supply) and monitored via the LED near the connector. The 7 pin connector at the end of the probe does not carry any signals, but determines the angle of the sensor when mounted on the DAE. The probe supports mechanical detection of the surface.

The single sensor in the probe is arranged in a tilt angle allowing measurement of 3 orthogonal field components when rotating the probe by 120° around its axis. It is aligned with the perpendicular component of the field, if the probe axis is tilted nominally 35.3° above the measurement plane, using the connector rotation and sensor angle stated below.

The probe is fully RF shielded when operated with the matching signal cable (shielded) and allows measurement of audio magnetic fields in the close vicinity of RF emitting wireless devices according to [1] without additional shielding.

Handling of the item

The probe is manufactured from stainless steel. In order to maintain the performance and calibration of the probe, it must not be opened. The probe is designed for operation in air and shall not be exposed to humidity or liquids. For proper operation of the surface detection and emergency stop functions in a DASY system, the probe must be operated with the special probe cup provided (larger diameter).

Methods Applied and Interpretation of Parameters

- Coordinate System: The AM1D probe is mounted in the DASY system for operation with a HAC Test
 Arch phantom with AMCC Helmholtz calibration coil according to [2], with the tip pointing to "southwest"
 orientation.
- Functional Test: The functional test preceding calibration includes test of Noise level
 - RF immunity (1kHz AM modulated signal). The shield of the probe cable must be well connected. Frequency response verification from 100 Hz to 10 kHz.
- Connector Rotation: The connector at the end of the probe does not carry any signals and is used for
 fixation to the DAE only. The probe is operated in the center of the AMCC Helmholtz coil using a 1 kHz
 magnetic field signal. Its angle is determined from the two minima at nominally +120° and -120°
 rotation, so the sensor in the tip of the probe is aligned to the vertical plane in z-direction, corresponding
 to the field maximum in the AMCC Helmholtz calibration coil.
- Sensor Angle: The sensor tilting in the vertical plane from the ideal vertical direction is determined from
 the two minima at nominally +120° and -120°. DASY system uses this angle to align the sensor for
 radial measurements to the x and y axis in the horizontal plane.
- Sensitivity: With the probe sensor aligned to the z-field in the AMCC, the output of the probe is
 compared to the magnetic field in the AMCC at 1 kHz. The field in the AMCC Helmholtz coil is given by
 the geometry and the current through the coil, which is monitored on the precision shunt resistor of the
 coil.

Certificate No: AM1D-3062 Jan12	Page 2 of 3	



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 29(34)

Author Data

Andrew Becker

Dates of Test
March 1-23, 2012

Report No

RTS-5994-1204-08

L6ARFD30CW

AM1D probe identification and configuration data

Item	AM1DV3 Audio Magnetic 1D Field Probe
Type No	SP AM1 001 BA
Serial No	3062

Overall length	296 mm
Tip diameter	6.0 mm (at the tip)
Sensor offset	3.0 mm (centre of sensor from tip)
Internal Amplifier	20 dB

Manufacturer / Origin	Schmid & Partner Engineering AG, Zürich, Switzerland
Manufacturing date	October 30, 2008
Last calibration date	April 07, 2011

Calibration data

Connector rotation angle (in DASY system) 61.0 ° +/- 3.6 ° (k=2)

Sensor angle (in DASY system) 0.18 ° +/- 0.5 ° (k=2)

Sensitivity at 1 kHz (in DASY system) 0.00741 V / (A/m) +/- 2.2 % (k=2)

Certificate No: AM1D-3062_Jan12

Page 3 of 3



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

30(34)

Author Data

Andrew Becker

Dates of Test

March 1-23, 2012

Report No

RTS-5994-1204-08

L6ARFD30CW

Calibration Laboratory of Schmid & Partner Engineering AG Zeughausstrasse 43, 8004 Zurich, Switzerland





S Schweizerischer Kalibrierdienst
C Service sulsse d'étalonnage
Servizio svizzero di taratura
S Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)

The Swiss Accreditation Service is one of the signatories to the EA Multilateral Agreement for the recognition of calibration certificates

Accreditation No.: SCS 108

Client RTS (RIM Testing Services)

Certificate No: TMFS 1003 Nov11

	Services)	Shootin's alone is alone to another annualities of	MFS_1003_Nov11
CALIBRATION CE	RTIFICATE	111111	
Object / Identification	TMFS - SN: 1003		学、新学、新学生
	QA CAL-24.v2 Calibration proced audio range	lure for AM1D magnetic field probes	s and TMFS in the
Calibration date	November 30, 20		
	ed in the R&D laboratory	nal standards, which realize the physical units of facility: environment temperature $(22 \pm 3)^{\circ}$ C and	
	ID#	Cal Date (Calibrated by, Certificate No.)	Scheduled Calibration
Primary Standards	ID#		
	SN: 0610278	28-Sep-11 (No:11450)	Sep-12
Keithley Multimeter Type 2001	SN: 0810278	28-Sep-11 (No:11450)	Sep-12
Keithley Multimeter Type 2001 Secondary Standards	100 11		
Seithley Multimeter Type 2001 Secondary Standards	SN: 0810278	28-Sep-11 (No:11450) Cal / Check Date	Sep-12 Scheduled Calibration Check
Seithley Multimeter Type 2001 Secondary Standards AMCC Reference Probe AM1DV2	SN: 0610278 ID # 1050	28-Sep-11 (No:11450) Cal / Check Date 12-Oct-11 (in house check Oct-11)	Sep-12 Scheduled Calibration Check Oct-13
Keithley Multimeter Type 2001 Secondary Standards AMCC Reference Probe AM1DV2 AMMI Audio Measuring Instrument	SN: 0810278 ID # 1050 SN: 1008	28-Sep-11 (No:11450) Cal / Check Date 12-Oct-11 (in house check Oct-11) 18-Jan-11 (No. AM1D-1008_Jan11)	Sep-12 Scheduled Calibration Check Oct-13 Jan-12
Primary Standards Keithley Multimeter Type 2001 Secondary Standards AMCC Reference Probe AM1DV2 AMMI Audio Measuring Instrument Aglient WF Generator 33120A Calibrated by:	SN: 0810278 ID # 1050 SN: 1008 1062	28-Sep-11 (No:11450) Cal / Check Date 12-Oct-11 (in house check Oct-11) 18-Jan-11 (No. AM1D-1008_Jan11) 20-Sep-10 (in house check Sep-10)	Sep-12 Scheduled Calibration Check Oct-13 Jan-12 Sep-12
Keithley Multimeter Type 2001 Secondary Standards AMCC Reference Probe AM1DV2 AMMI Audio Measuring Instrument Agilent WF Generator 33120A	SN: 0610278 ID # 1050 SN: 1008 1062 MY40005266	28-Sep-11 (No:11450) Cal / Check Date 12-Oct-11 (in house check Oct-11) 18-Jan-11 (No. AM1D-1006_Jan11) 20-Sep-10 (in house check Sep-10) 12-Oct-11 (in house check Oct-11)	Sep-12 Scheduled Calibration Check Oct-13 Jan-12 Sep-12

Certificate No: TMFS_1003_Nov11

Page 1 of 5



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

Page 31(34)

Author Data
Andrew Becker

Dates of Test

March 1-23, 2012

Report No

RTS-5994-1204-08


L6ARFD30CW


References

- ANSI-C63.19-2007
 American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] DASY manual, Chapter "Hearing Aid Compatibility (HAC) T-Coil Extension"

Methods Applied and Interpretation of Parameters

- Coordinate System: The TMFS is mounted underneath the HAC Test Arch touching equivalently to a wireless device according to [2] 29.2.2.: In "North" orientation, the TMFS signal connector is directed to the north, with x and y axes of TMFS and Test arch coinciding (see fig. 1). The rotational symmetry axis of the TMFS is aligned to the center of the HAC test Arch. For East, South and West configuration, the TMFS has been rotated clockwise in steps of 90°, so the connector looks into the specified direction. The evaluation of the radial direction is referenced to the device orientation equivalent to South direction).
- Plane: Measurement coincidence with standard [1], the measurement plane (probe sensor center) is selected to be at a distance of 10 mm above the the surface of the TMFS touching the frame. The 50 x 50 mm scan area is aligned to the center of the unit. The scanning plane is verified to be parallel to the phantom frame before the measurements using the predefined "Geometry and signal check" procedure according to the predefined procedures described in [2].

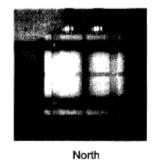

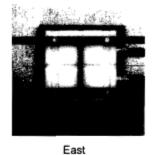



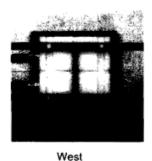


Fig. 1 TMFS scanning measurement configurations

- Measurement Conditions: Calibration of AM1D probe and AMMI are according to [2]. The 1 kHz sine signal
 for the level measurement is supplied from an external, independent generator via a BNC cable to TMFS IN
 and monitored at TMFS OUT with an independent RMS voltmeter or Audio Analyzer. The level is set to 0.5
 Vrms and monitored during the scans.
- For the frequency response, a higher suppression of the background ambient magnetic field over the full frequency range was achieved by placing the TMFS in a magnetically shielded box. The AM1D probe was fixed without robot positioner near the axial maximum for this measurement. The background noise suppression was typ. 30 dB at 100 Hz (minimum) and 42 dB at 1 kHz. The predefined multisine signal (48k_multisine_50-10000_10s.wav) was used and evaluated in the third-octave bands from 100 Hz to 10000 Hz.

Certificate No: TMFS_1003_Nov11

Page 2 of 5



Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

32(34)

Author Data

Andrew Becker

Dates of Test
March 1-23, 2012

Report No

RTS-5994-1204-08

L6ARFD30CW

FCC ID

1 Measurement Conditions

DASY system configuration, as far as not given on page 1.

DASY Version	DASY5	V52.6.2 (482)
DASY PP Version	SEMCAD	V14.4.5 (3634)
Phantom	HAC Test Arch	SD HAC P01 BA, #1002
Distance TMFS Top - Probe Centre	10 mm	
Scan resolution	dx, dy = 5 mm	area = 50 x 50 mm
Frequency	for field scans	1 kHz
Signal level to TMFS	for field scans	500 mV RMS
Signal	for frequency response	multisine signal 50-10000 Hz, each third-octave band

Table 1: System configuration

2 Axial Maximum Field

Configuration	East	South	West	North	Subset Average	Average
Axial Max	-20.36	-20.35	-20.38	-20.35		-20.36
TMFS Y Axis 1st Max	-26.11	-26.06	-26.11	-26.07		
TMFS Y Axis 2nd Max	-26.15	-26.15	-26.29	-26.16		
Longitudinal Max Avg	-26.13	-26,11	-26.20	-26.12	-26.14	
TMFS X Axis 1st Max	-25.95	-25.99	-26.02	-25.94		
TMFS X Axis 2nd Max	-25.91	-25.89	-25.95	-25.95		
Transversal Max Avg	-25.93	-25.94	-25.99	-25.95	-25.95	
Radial Max			-26.09			-26.04

Table 2: Axial and radial field maxima measured with probe center at 10mm distance in dB A/m

The maximum was calculated as the average from the values measured in the 4 orientations listed in table 2.

Axial Maximum -20.36 dB A/m (+/- 0.33dB, k=2)

3 Radial Maximum Field

In addition, the average from the 16 maxima of the radial field listed in table 2 (measured at 10mm) was calculated:

Radial Maximum -26.04 dB A/m

Certificate No: TMFS_1003_Nov11

Page 3 of 5

Testing Services™

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW

33(34)

Author Data
Andrew Becker

Dates of Test
March 1-23, 2012

Report No

RTS-5994-1204-08

L6ARFD30CW

4 Appendix

4.1 Frequency response

Max. deviation measured, relative to 1 kHz: min. -0.03, max. 0.01 dB

Frequency [Hz]	Response [dB]		
100	0.01		
125	0.00		
160	-0.03		
200	0.00		
250	-0.01		
315	0.00		
400	0.00		
500	0.00		
630	0.00		
800	0.00		
1000	0.00		
1250	-0.01		
1600	-0.01		
2000	-0.01		
2500	-0.01		
3150	-0.01		
4000	-0.02		
5000	-0.02		
6300	-0.03		
8000	-0.03		
10000	-0.03		

Table 3: Frequency response

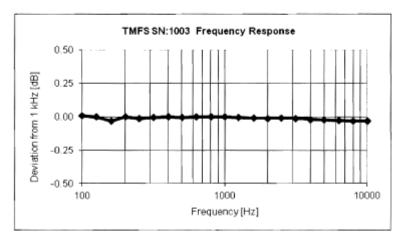


Fig. 2 Frequency response 100 to 10'000 Hz

Testing Services™	Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFD31CW			Page 34(34)
Author Data	Dates of Test	Report No	FCC ID	
Andrew Becker	March 1-23, 2012	RTS-5994-1204-08	L6AR	FD30CW

4.2 Field plots

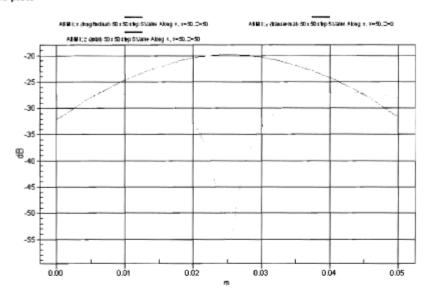


Fig. 3: Typical 2D field plots for x (red), y (green) and z (blue) components

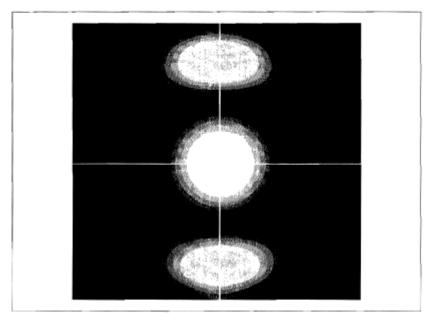


Fig. 4: Superponed field plots of z (axial), x and y radial magnetic field, 50 x 50 mm, individual scaling: white = max. field level, black = -4dB below max. The lines show the position of the 2D field plot of figure 3.

Certificate No: TMFS_1003_Nov11