



849 NW STATE ROAD 45  
NEWBERRY, FL 32669 USA  
PH: 888.472.2424 OR 352.472.5500  
FAX: 352.472.2030  
EMAIL: [INFO@TIMCOENGR.COM](mailto:INFO@TIMCOENGR.COM)  
[HTTP://WWW.TIMCOENGR.COM](http://WWW.TIMCOENGR.COM)

---

## **FCC PART 90 TEST REPORT**

APPLICANT	MIDLAND RADIO CORPORATION
	5900 PARRETTA DRIVE
	KANSAS CITY MISSOURI 64120 USA
FCC ID	MMA918100R
MODEL NUMBER	91-8100R
PRODUCT DESCRIPTION	BASE STATION
DATE SAMPLE RECEIVED	7/7/2009
DATE TESTED	7/29/2009
TESTED BY	Joe Scoglio
APPROVED BY	Mario de Aranzeta
TIMCO REPORT NO.	1538AUT9TestReport.doc
TEST RESULTS	<input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL

**THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL  
WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.**



Certificate # 0955-01

## TABLE OF CONTENTS

GENERAL REMARKS.....	3
GENERAL INFORMATION .....	4
EQUIPMENT LIST .....	5
TEST PROCEDURE .....	6
RF POWER OUTPUT .....	7
MODULATION CHARACTERISTICS.....	8
VOICE MODULATED COMMUNICATION EQUIPMENT .....	10
OTHER MODULATION CHARACTERISTICS .....	13
OCCUPIED BANDWIDTH .....	14
OCCUPIED BANDWIDTH PLOTS.....	16
SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED).....	19
FIELD STRENGTH OF SPURIOUS EMISSIONS.....	22
FREQUENCY STABILITY.....	24
FREQUENCY STABILITY(cont'd).....	25
ADJACENT CHANNEL POWER .....	27

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

## Summary

The device under test does:

- ☒ fulfill the general approval requirements as identified in this test report  
☐ not fulfill the general approval requirements as identified in this test report

## Attestations

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025:2005 requirements.



Testing Certificate # 0955-01

I attest that the necessary measurements were made, under my supervision, at:

Timco Engineering Inc.  
849 NW State Road 45  
Newberry, FL 32669



## Authorized Signatory Name:

Mario de Aranzeta C.E.T.  
Compliance Engineer/ Lab. Supervisor

**Date:** 8/17/2009

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## GENERAL INFORMATION

### DUT Specification

<b>DUT Description</b>	BASE STATION
<b>FCC ID</b>	MMA918100R
<b>Model Number</b>	91-8100R
<b>Operating Frequency</b>	851 - 870 MHz
<b>Type of Emission</b>	16K0F3E,F1D,F2D/11K0F3E,F1D,F2D
<b>Modulation</b>	FM,CQPSK
<b>DUT Power Source</b>	<input type="checkbox"/> 110-120Vac/50- 60Hz
	<input checked="" type="checkbox"/> DC Power 24V
	<input type="checkbox"/> Battery Operated Exclusively
<b>Test Item</b>	<input type="checkbox"/> Prototype
	<input checked="" type="checkbox"/> Pre-Production
	<input type="checkbox"/> Production
<b>Type of Equipment</b>	<input checked="" type="checkbox"/> Fixed
	<input type="checkbox"/> Mobile
	<input type="checkbox"/> Portable
<b>Test Conditions</b>	The temperature was 26°C with a relative humidity of 50%.
<b>Modification to the DUT</b>	None
<b>Test Exercise</b>	The DUT was placed in continuous transmit mode.
<b>Applicable Standards</b>	ANSI/TIA 603-C:2004, FCC CFR 47 Part 90
<b>Test Facility</b>	Timco Engineering Inc. at 849 NW State Road 45 Newberry, FL 32669 USA.

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## EQUIPMENT LIST

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
3/10-Meter OATS	TEI	N/A	N/A	Listed 3/20/07	3/19/10
3-Meter OATS	TEI	N/A	N/A	Listed 2/5/09	2/5/12
3-Meter Semi-Anechoic Chamber	Panashield	N/A	N/A	Listed 5/11/07	5/11/10
AC Voltmeter	HP	400FL	2213A14499	CAL 3/23/09	3/23/11
Analyzer Tan Tower Quasi-Peak Adapter	HP	85650A	3303A01690	CAL 11/30/07	11/30/09
Analyzer Tan Tower RF Preselector	HP	85685A	3221A01400	CAL 11/30/07	11/30/09
Analyzer Tan Tower Spectrum Analyzer	HP	8566B Opt 462	3138A07786 3144A20661	CAL 11/30/07	11/30/09
Analyzer Tan Tower Preamplifier	HP	8449B-H02	3008A00372	CAL 11/30/07	11/30/09
Hygro-Thermometer	Extech	445703	0602	CAL 11/15/07	11/15/09
Measuring Tape-7.5M	Kraftixx	7.5M PROFI		CHAR 11/13/07	11/13/09
Digital Multimeter	Fluke	FLUKE-77-3	79510405	CAL 5/18/09	5/18/11
System One	Audio Precision	System One	SYS1-45868	CHAR 2/27/08	2/27/10
Temperature Chamber	Tenney Engineering	TTRC	11717-7	CHAR 4/25/08	4/25/10

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## TEST PROCEDURE

**Power Line Conducted Interference:** The procedure used was ANSI/TIA 603-C:2004, using a 50uH LISN. Both lines were observed with the DUT transmitting. The bandwidth of the spectrum analyzer was 10 kHz with an appropriate sweep speed.

**Bandwidth 20 dB:** The measurements were made with the spectrum analyzer's resolution bandwidth (RBW) = 1 MHz and the video bandwidth (VBW) = 3 MHz and the span set as shown on plot.

**Power Output:** The RF power output was measured at the antenna feed point using a peak power meter.

**Antenna Conducted Emissions:** The RBW = 100 kHz, VBW = 300 kHz and the span set to 10.0 MHz and the spectrum was scanned from 30 MHz to the 10<sup>th</sup> harmonic of the fundamental. Above 1 GHz the resolution bandwidth was 1 MHz and the VBW = 3 MHz and the span to 50 MHz.

**Radiation Interference:** The test procedure used was ANSI/TIA 603-C:2004, using an Agilent spectrum receiver with pre-selector. The bandwidth (RBW) of the spectrum ANSI/TIA 603-C:2004, receiver was 100 kHz up to 1 GHz and 1 MHz above 1 GHz with an appropriate sweep speed. The VBW above 1 GHz was 3 MHz. The analyzer was calibrated in dB above a microvolt at the output of the antenna.

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc


## RF POWER OUTPUT

**Rule Part No.:** Part 2.1046(a), Part 90

### Test Requirements:

**Method of Measurement:** RF power is measured by connecting a 50-ohm, resistive wattmeter to the RF output connector. With a nominal battery voltage, and the transmitter properly adjusted the RF output measures:

### Test Setup Diagram:

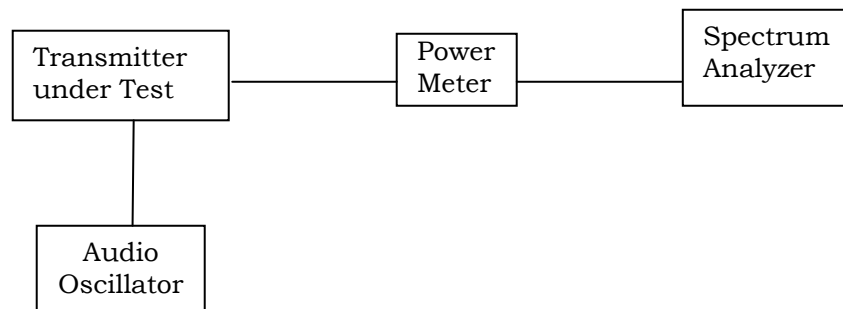

### Test Data:

OUTPUT POWER: HIGH – 100.00 Watts  
LOW - 25.00 Watts

## Part 2.1033 (C)(8) DC Input into the final amplifier

FOR LOW POWER SETTING INPUT POWER:  $(24.0V)(7.0A) = 168 \text{ Watts}$

FOR HIGH POWER SETTING INPUT POWER:  $(24.0V)(10.9A) = 262 \text{ Watts}$

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## MODULATION CHARACTERISTICS

**Rule Part No.:** Part 2.1047(a)(b)


### Test Requirements:

### Method of Measurement:

*Audio frequency response*

The audio frequency response was measured in accordance with ANSI/TIA 603-C:2004. A curve or equivalent data showing the frequency response of the audio modulating circuit over a range of 100 – 5000Hz shall be submitted. The audio frequency response curve is shown below.


### AUDIO FREQUENCY RESPONSE PLOT Narrow

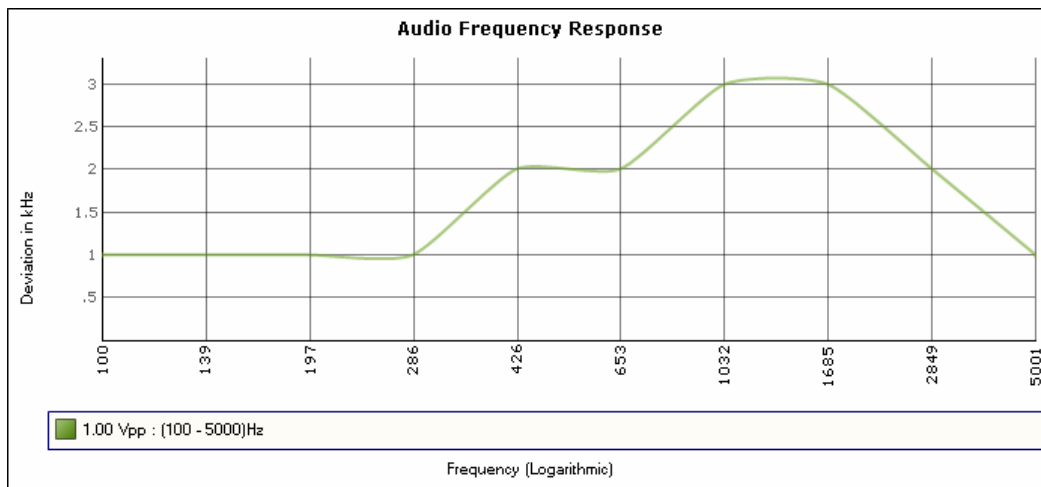

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc



# **AUDIO FREQUENCY RESPONSE PLOT** **Wide**

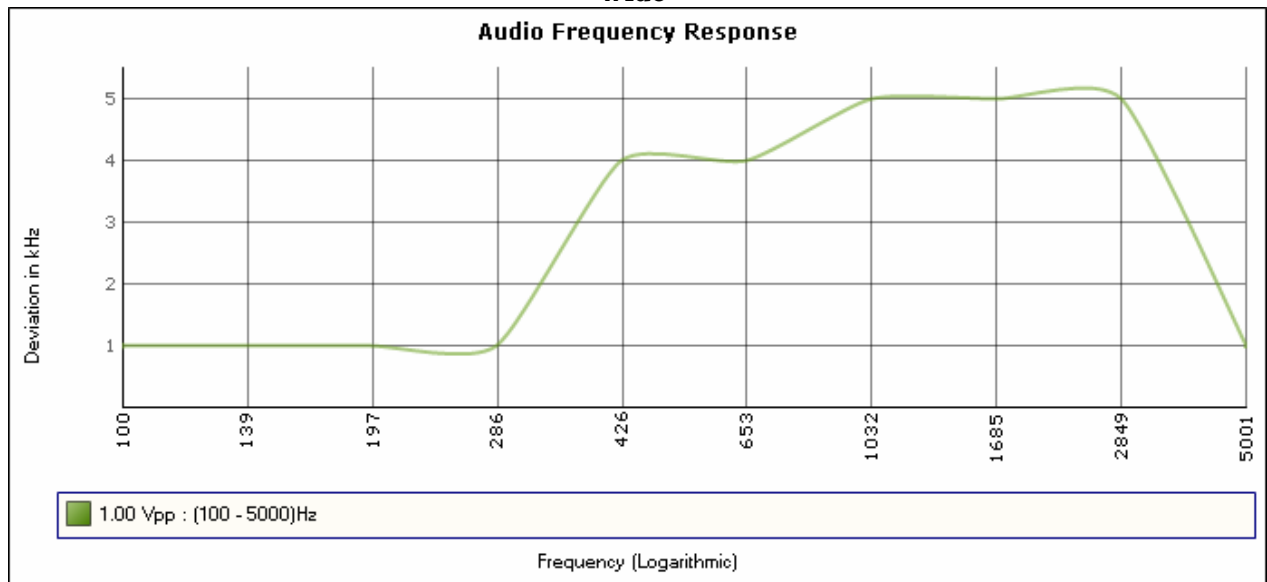


Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc


## VOICE MODULATED COMMUNICATION EQUIPMENT

**Part 2.1047(a):** For equipment required to have an audio low-pass filter, a curve showing the frequency response of the filter, or of all the circuitry installed between the modulation limiter and the modulated stage shall be submitted.

### AUDIO LOW PASS FILTER (narrow).

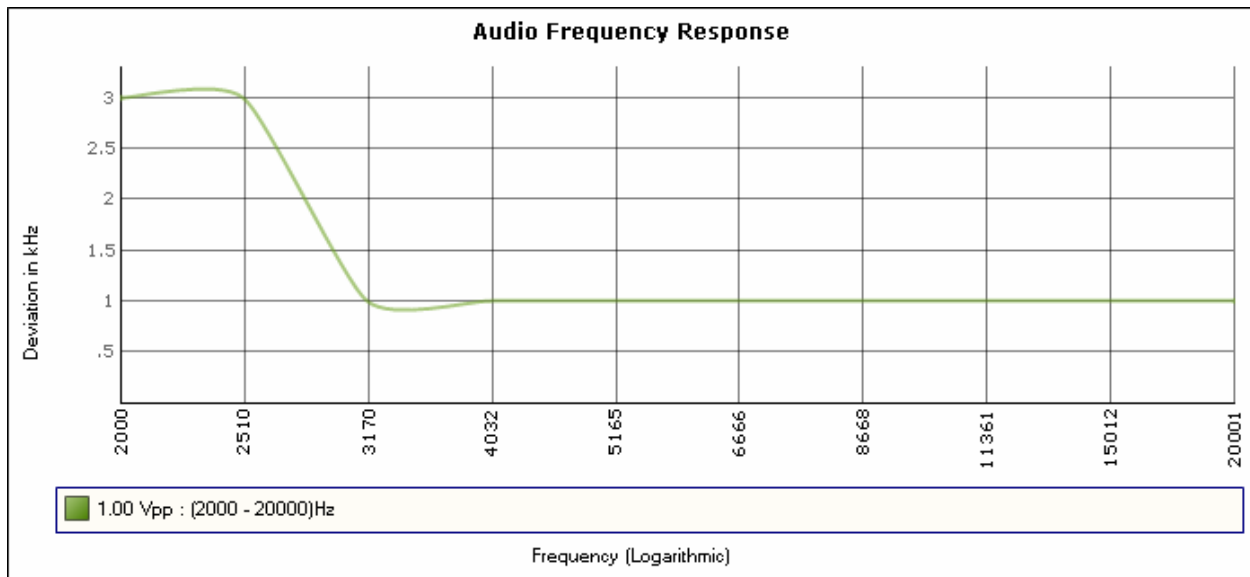

### AUDIO LOW PASS FILTER (wide).

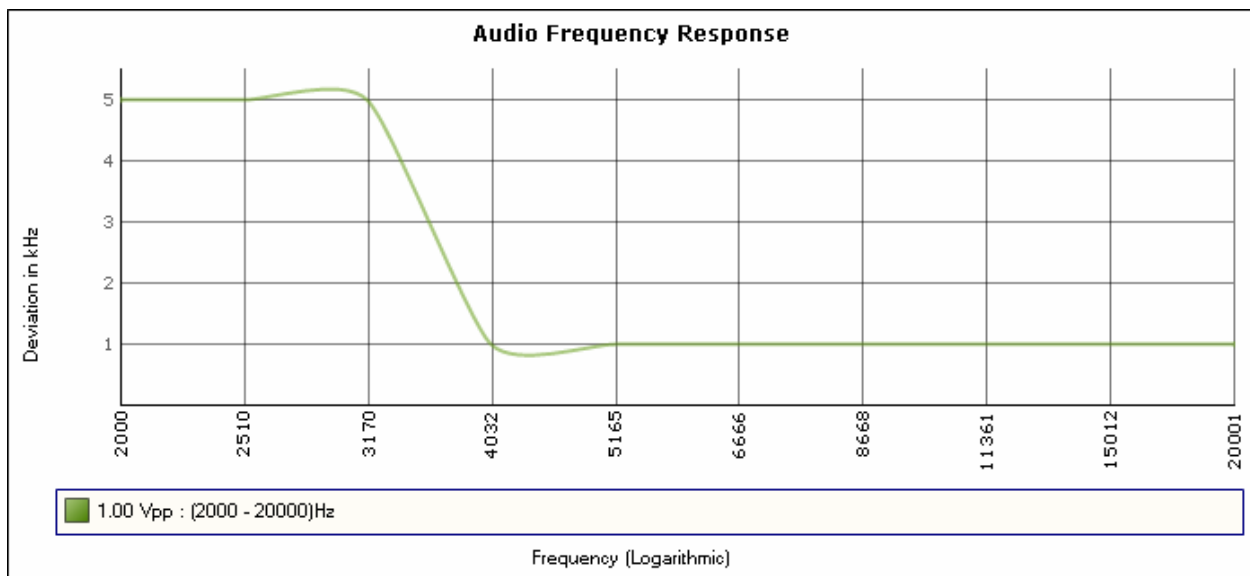

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## AUDIO INPUT VERSUS MODULATION


**Rule Part No.:** Part 2.1047(b) & 90

### Test Requirements:

**Method of Measurement:** **Modulation cannot exceed 100%,** The audio input level needed for a particular percentage of modulation was measured in accordance with ANSI/TIA 603-C: 2004. The audio input curves versus modulation are shown below. Curves are provided for audio input frequencies of 300, 1000, and 3000 Hz.


### Test data:

Modulation Limiting Plot (12.5 kHz)

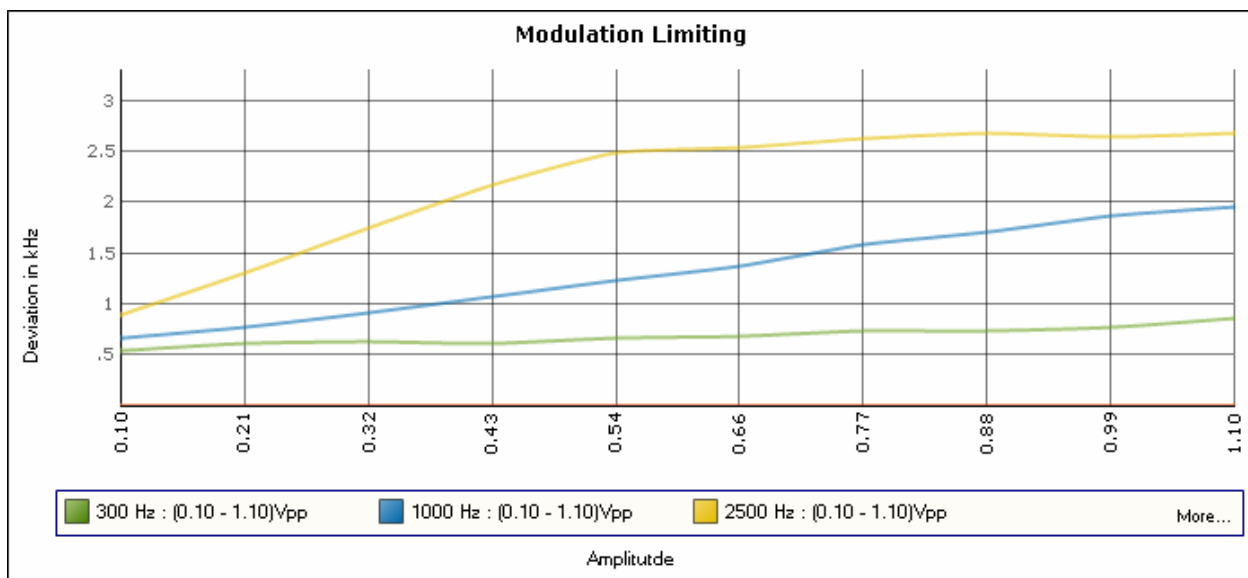

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

# Modulation Limiting Plot (25.0 kHz)

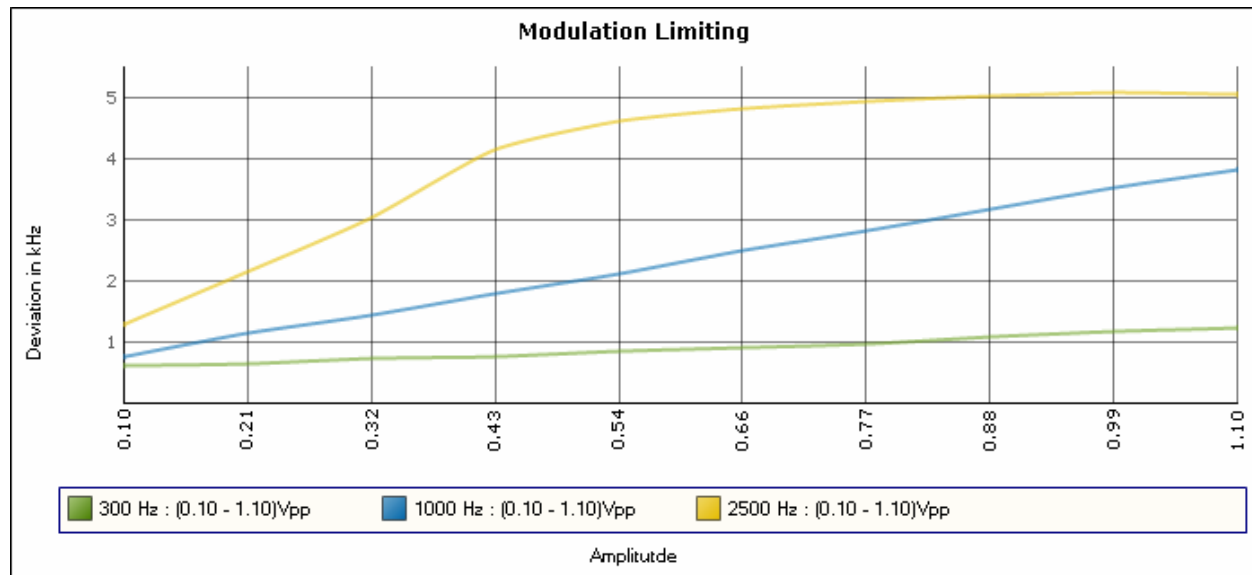

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## **OTHER MODULATION CHARACTERISTICS**

**Part 2.1033(c)**

**Part 2.1033(c) (4)** Type of Emission:

**Part 90.209**

**Part 2.1033(c) (4)** Type of Emission: 11K2F3E

**Part 90.209**

**Part 90.207**  $B_n = 2M + 2DK$

$$M = 2000$$

$$D = 3000$$

$$K=1$$

$$B_n = 2(3000) + 2(2000) = 10 \text{ k}$$

**Part 2.1033(c) (4)** Type of Emission: 16K0F3E

**Part 90.209**

**Part 90.207**  $B_n = 2M + 2DK$

$$M = 3000$$

$$D = 4200$$

$$K=1$$

$$B_n = 2(3000) + 2(4200) = 14.4 \text{ k}$$

11K2F1D, 11K2F2D, 11K2F1E

16K0F1D, 16K0F2D, 16K0F1E

The radio is capable of CQPSK modulation described in APCO 25 or P-25.

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA918100R

Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## OCCUPIED BANDWIDTH

### **Part 2.1049(c) EMISSION BANDWIDTH:**

#### **Part 90.210(b) 25kHz Channel Spacing**

Data in the plots show that on any frequency removed from the assigned frequency by more than 50%, but not more than 100%: At least 25dB. On any frequency removed from the assigned frequency by more than 100%, but not more than 250%: At least 35 dB. On any frequency removed from the assigned frequency by more than 250%, of the authorized bandwidth: At least  $43 + 10\log(P)$ dB.

#### **Part 90.210(c) 12.5kHz Channel Spacing Not Equipped with a Low Pass Filter**

For transmitters that are not equipped with an audio low pass filter pursuant to S90.211 (b), the power of any emission must be attenuated below the un-modulated carrier output power as follows; (1) On any frequency removed from the center of the authorized bandwidth by a displacement frequency ( $f_d$  in kHz) of more than 5 kHz but not more than 10 kHz: At least  $83 \log(f_d/5)$  dB; (2) ON any frequency removed from the center of the authorized bandwidth by a displacement frequency ( $f_d$  in kHz) of more than 10 kHz, but not more than 250% of the authorized bandwidth: At least  $29 \log(f_d^2/11)$ dB or 50 dB, whichever is the lesser attenuation; (3) On any frequency removed from the center of the authorized bandwidth by more than 250% of the authorized bandwidth: At least  $43 + 10 \log(P_o)$ dB.

#### **Part 90.210(d) Emission Mask D - 12.5 kHz channel BW equipment.**

For transmitters designed to operate with a 12.5 kHz channel bandwidth, any emission must be attenuated below the power (P) of the highest emission contained within the authorized bandwidth as follows:

- (1) On any frequency from the center of the authorized bandwidth  $f_0$  to 5.625 kHz removed from  $f_0$ : Zero dB.
- (2) On any frequency from the center of the authorized bandwidth by a displacement frequency ( $f_d$  in kHz) of more than 5.625 kHz but no more than 12.5 kHz: At least  $7.27(f_d - 2.88 \text{ kHz})$  dB.
- (3) On any frequency removed from the center of the authorized bandwidth by a displacement frequency ( $f_d$  in kHz) of more than 12.5 kHz: At least  $50 + 10\log(P)$  dB or 70 dB, whichever is the lesser attenuation.

#### **Part 90.210(e) Emission Mask E – 6.25 kHz channel BW equipment.**

For transmitters designed to operate with a 6.25 kHz bandwidth, any emission must be attenuated below the power (P) of the highest emission contained within the authorized bandwidth as follows:

- (1) On any frequency from the center of the authorized bandwidth  $f_0$  to 3.0 kHz removed from  $f_0$ : Zero dB.
- (2) On any frequency from the center of the authorized bandwidth by a displacement frequency ( $f_d$  in kHz) of more than 3.0 kHz but no more than 4.6 kHz: At least  $30 + 16.67(f_d - 3.0 \text{ kHz})$  or  $55 + 10 \log(P)$  or 65, whichever is the lesser attenuation.
- (3) On any frequency removed from the center of the authorized bandwidth by more than 4.6kHz: At least  $55 + 10\log(P)$  dB or 65 dB, whichever is the lesser attenuation.


Applicant: MIDLAND RADIO CORP.

FCC ID: MMA918100R

Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

**Method of Measurement:** ANSI/TIA 603-C: 2004

**Test Setup Diagram:**

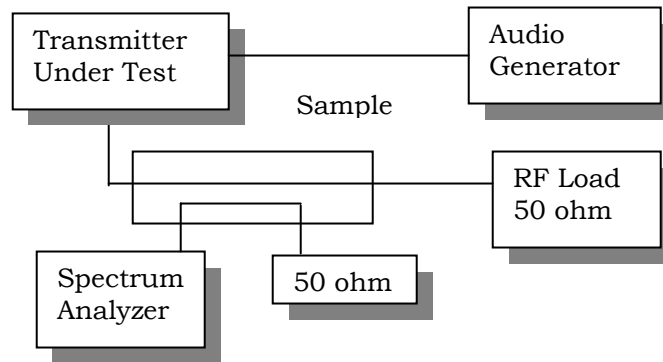

**Test Data:** See the plots below

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc


## OCCUPIED BANDWIDTH PLOTS

Part 90.210(b) 12.5 kHz Channel Spacing (digital)

### NOTES:

MIDLAND RADIO CORPORATION - FCC ID: MMA918100R  
OCCUPIED BANDWIDTH PLOT

### FCC 90.210 Mask B

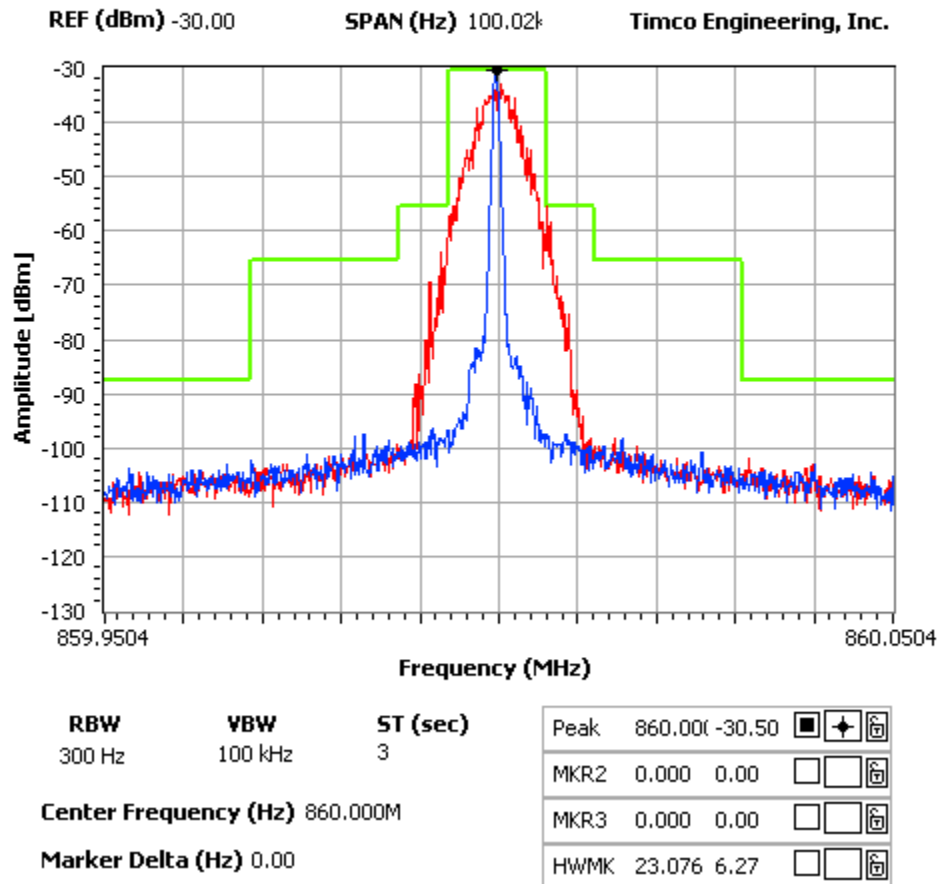


Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc



Occupied BW plot 25 kHz

**NOTES:**

Occupied Bandwidth  
Wide

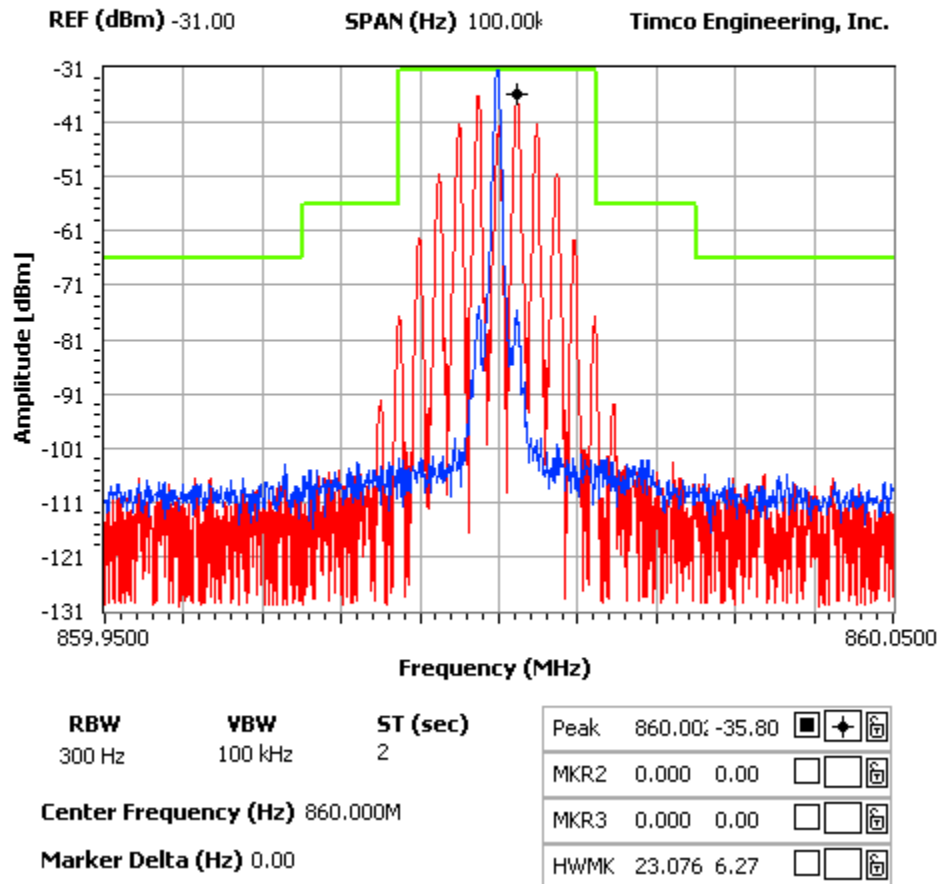


Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

Part 90.210(d) Emission Mask D - 12.5 kHz channel

**NOTES:**

Occupied Bandwidth  
Narrow

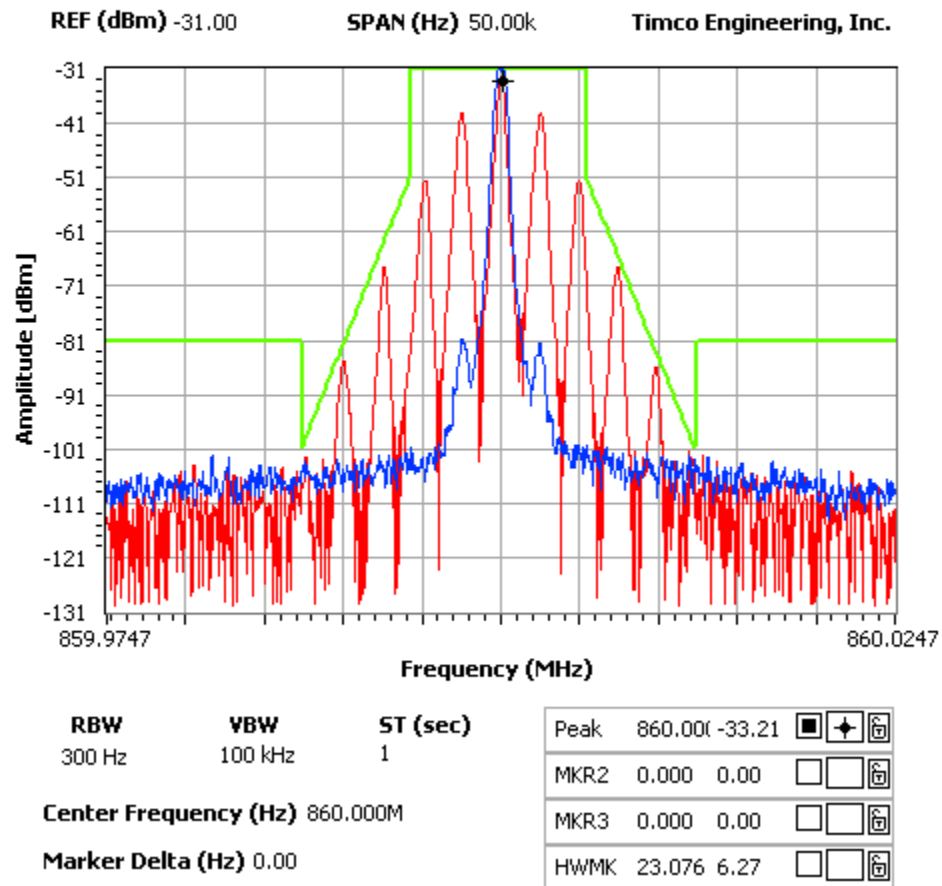

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED)

**Rule Part No.:** Part 2.1051(a)

**Requirements:** 25kHz Channel Spacing =  $43+10\log(OP)$  = dBc  
 12.5kHz Channel Spacing =  $50+10\log(OP)$  = dBc

**Method of Measurement:** The carrier was modulated 100% using a 2500 Hz tone. The spectrum was scanned from 0.4 to at least the 10th harmonic of the fundamental. The measurements were made in accordance with standard ANSI/TIA 603-C: 2004.

**Test Data:** High power:  $50+10\log(100.00)$  = 70.00 dBc  
 Low power:  $50+10\log(25.00)$  = 64.00 dBc

TF HIGH POWER	EF	dB below carrier		TF LOW POWER	EF	dB below carrier
851	851	0		851	851	0
	1702	78.6			1702	74.2
	2553	105.7			2553	106.6
	3404	101.4			3404	108.7
	4255	120.4			4255	122.7
	5106	116.8			5106	125.7
	5957	120.3			5957	116.7
	6808	113.7			6808	121.8
	7659	108.1			7659	103
	8510	103.1			8510	106.2

TF HIGH POWER	EF	dB below carrier		TF LOW POWER	EF	dB below carrier
860	860	0		860	860	0
	1720	84.9			1720	78.2
	2580	103.5			2580	112.2
	3440	124			3440	119.9
	4300	115.6			4300	114.9
	5160	125.1			5160	118.6
	6020	126.7			6020	123.8
	6880	125.3			6880	126.9
	7740	110			7740	106.7
	8600	102.6			8600	106.1


Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

**TEST DATA CONTD.**

<b>TF HIGH POWER</b>	<b>EF</b>	<b>dB below carrier</b>		<b>TF LOW POWER</b>	<b>EF</b>	<b>dB below carrier</b>
870	870	0		870	870	0
	1740	85.5			1740	76.7
	2610	94.1			2610	102.6
	3480	115.7			3480	121.2
	4350	115.5			4350	124.8
	5220	96.9			5220	108.3
	6090	116.3			6090	122.5
	6960	117.7			6960	124.6
	7830	111			7830	107.8
	8700	109.7			8700	114.5

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

### **Method of Measuring Conducted Spurious Emissions**

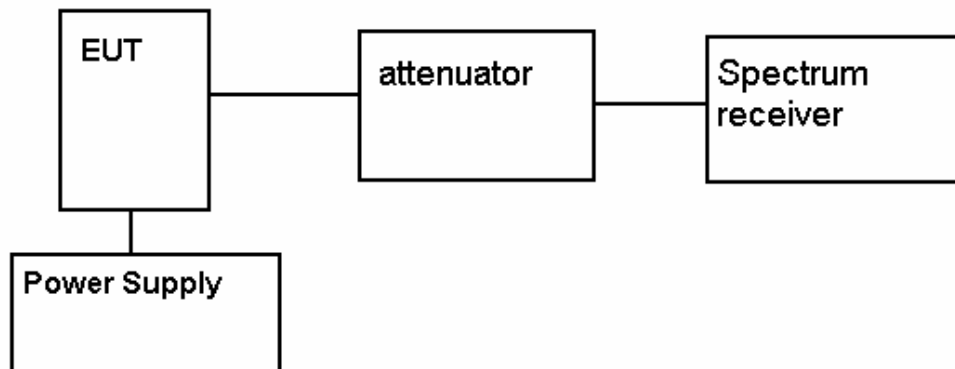

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc


## FIELD STRENGTH OF SPURIOUS EMISSIONS

**Rule Parts. No.:** Part 2.1053

**Requirements:** 25kHz Channel Spacing =  $43 + 10\log(OP)$  = dBc  
12.5kHz Channel Spacing =  $50 + 10\log(OP)$  = dBc

**METHOD OF MEASUREMENT:** The tabulated data shows the results of the radiated field strength emissions test. The spectrum was scanned from 30 MHz to at least the tenth harmonic of the fundamental. This test was conducted per ANSI/TIA 603-C: 2004 using the substitution method. Measurements were made at the test site of TIMCO ENGINEERING, INC. located at 849 NW State Road 45, Newberry, FL 32669.

### Test Setup Diagram:

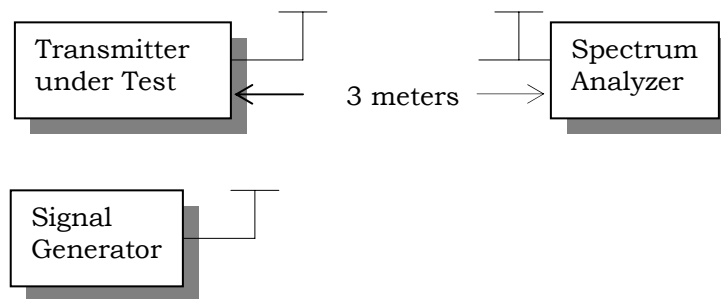

### Test Data:

High power:  $50 + 10\log(100.00)$  = 70.00 dBc

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
851.00	V	0
1702.00	H	79.12
2553.00	V	85.49
3404.00	H	90.35
4255.00	H	92.66
5106.00	H	90.68
5957.00	H	82.22
6808.00	H	81.02
7659.00	H	94.37
8510.00	H	90.45

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
860.00	V	0
1720.00	H	81.06
2580.00	V	77.37
3440.00	H	85.02
4300.00	H	86.84
5160.00	H	93.68
6020.00	H	81.12
6880.00	H	88.32
7740.00	H	83.27
8600.00	H	93.35

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
870.00	V	0
1740.00	V	75.25
2610.00	V	76.65
3480.00	H	82.39
4350.00	H	80.57
5220.00	H	90.72
6090.00	H	79.07
6960.00	H	78.46
7830.00	H	88.24
8700.00	H	88.76

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

Low power:  $50 + 10\log(25.00) = 64.00$  dBc

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
851.00	V	0
1702.00	V	73.72
2553.00	V	93.39
3440.00	V	89.95
4300.00	H	88.06
5160.00	H	87.78
6020.00	H	77.82
6880.00	H	89.12
7740.00	H	80.97
8600.00	H	92.25

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
860.00	V	0
1720.00	V	71.36
2580.00	V	86.87
3440.00	H	86.12
4300.00	H	84.04
5160.00	H	92.58
6020.00	H	78.22
6880.00	H	88.12
7740.00	H	81.57
8600.00	H	85.65

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
870.00	V	0
1740.00	V	69.55
2610.00	V	84.75
3480.00	V	85.19
4350.00	H	82.17
5220.00	H	92.82
6090.00	H	78.77
6960.00	H	84.06
7830.00	H	88.54
8700.00	H	86.86

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## FREQUENCY STABILITY

**Rule Parts. No.:** Part 2.1055, Part 90.213

**Requirements:** Temperature range requirements: -30 to +50° C.  
Voltage Variation +, -15%  
±2.5 PPM

**Method of Measurements:** ANSI/TIA 603-C: 2004.

**Test Data: (**

Assigned Frequency (Ref. Frequency) (MHz)		860.000070
Temperature (°C)	Frequency (MHz)	Frequency Stability (PPM)
-30	860.000067	0.12
-20	859.999813	-0.18
-10	859.99989	-0.09
0	860.000070	0.12
+10	860.000097	0.15
+20	859.999962	-0.01
+30	859.999723	-0.28
+40	859.999694	-0.32
+50	859.999689	-0.32

Assigned Frequency (Ref. Frequency) (MHz)		
% Battery	Frequency (MHz)	Frequency Stability (PPM)
-15%	859.999967	0.0
0	859.999968	
+15%	859.999959	-0.01

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc



## FREQUENCY STABILITY(cont'd)

### Part 90.214 Transient Frequency Behavior

**REQUIREMENTS:** Transmitters designed to operate in the 150-174 MHz and 421-512 MHz frequency bands must maintain transient frequencies within the maximum transient frequencies within the maximum frequency difference limits during the time intervals indicated:

Time Intervals	Maximum frequency difference	All Equipment	
		150-174 MHz	421-512 MHz

#### Transient Frequency Behavior for Equipment Designed to Operate on 25 kHz Channels

$t_1^4$	$\pm 25.0$ kHz	5.0 ms	10.0 ms
$t_2$	$\pm 12.5$ kHz	20.0 ms	25.0 ms
$t_3^4$	$\pm 25.0$ kHz	5.0 ms	10.0 ms

#### Transient Frequency Behavior for Equipment Designed to Operate on 12.5 kHz Channels

$t_1^4$	$\pm 12.5$ kHz	5.0 ms	10.0 ms
$t_2$	$\pm 6.25$ kHz	20.0 ms	25.0 ms
$t_3^4$	$\pm 12.5$ kHz	5.0 ms	10.0 ms


#### Transient Frequency Behavior for Equipment Designed to Operate on 6.25 kHz Channels

$t_1^4$	$\pm 6.25$ kHz	5.0 ms	10.0 ms
$t_2$	$\pm 3.125$ kHz	20.0 ms	25.0 ms
$t_3^4$	$\pm 6.25$ kHz	5.0 ms	10.0 ms

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

**TEST PROCEDURE:** ANSI/TIA 603-C:2004, the levels were set as follows:

1. Using the variable attenuator the transmitter level was set to 40 dB below the test receivers maximum input level, then the transmitter was turned off.
2. With the transmitter off the signal generator was set 20dB below the level of the transmitter in the above step, this level will be maintained with the signal generator through-out the test.
3. Reduce the attenuation between the transmitter and the RF detector by 30 dB.
4. With the levels set as above, the transient frequency behavior was observed and recorded.

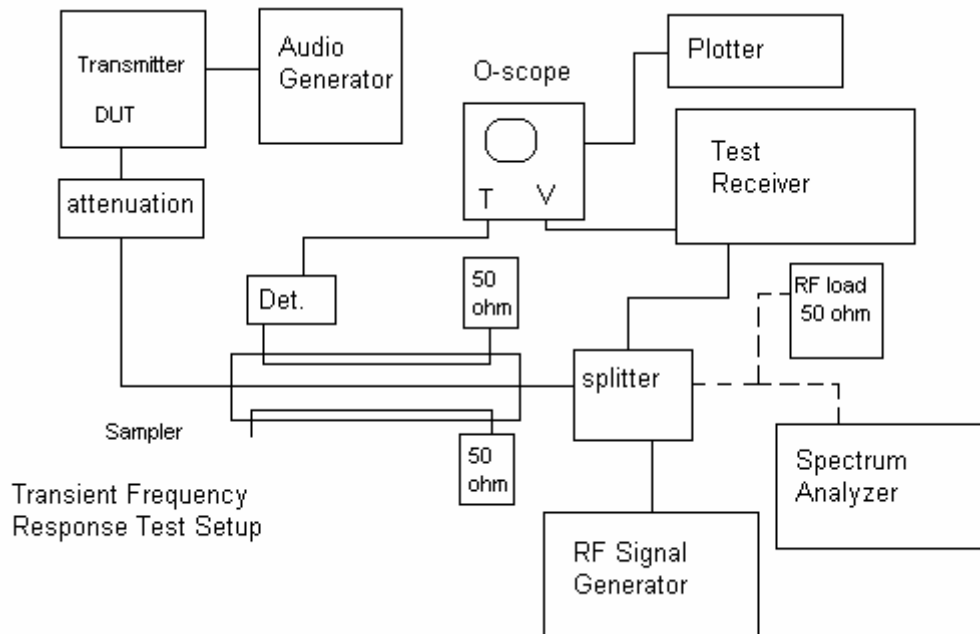

Applicant: MIDLAND RADIO CORP.  
 FCC ID: MMA918100R  
 Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc

## **ADJACENT CHANNEL POWER**

**Rule Part No.:** FCC Part 90.543

**Requirements:** Transmitters designed to operate in 769–775 MHz and 799–805 MHz frequency bands must meet the emission limitations in paragraphs (a) through (d) of this section. Transmitters operating in 763–768 MHz and 793–798 MHz bands must meet the emission limitations in (e) of this section.

**Test Data:**

Not applicable to this device.

Applicant: MIDLAND RADIO CORP.  
FCC ID: MMA918100R  
Report: Y:\M\MidlandRadio\_MMA\1538AUT9\1538AUT9TestReport.doc