

Report No.: HA852405B



HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : MSQZ01QD

Equipment: ASUS Phone (Mobile Phone)

Brand Name : ASUS

Model Name : ASUS_Z01QD

T-Rating : T3

Applicant : ASUSTeK COMPUTER INC.

4F, No. 150, LI-TE RD., PEITOU, TAIPEI, TAIWAN

Manufacturer : Arima Communications (Jiangsu) Co., LTD

No.168, Jiao Tong North Road, Wu Jiang, Su

Zhou, Jiang Su, PRC.

Standard : FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received on Jun. 03, 2018 and testing was started from Jun. 04, 2018 and completed on Jul. 09, 2018. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The report must not be used by the client to claim product certification, approval, or endorsement by TAF or any agency of government.

The test results in this variant report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai / Manager

SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

Table of Contents

Report No.: HA852405B

Page: 2 of 24

Issued Date: Jul. 24, 2018

Attestation of Test Results	
· · · · · · · · · · · · · · · · · · ·	
7.1 Test Flow Chart	
7.2 Test Setup Diagram	10
7.3 Description of EUT Test Position	12
Test Equipment List	
T-Coil testing for CMRS Voice	14
9.1 GSM Tests Results	14
). T-Coil testing for CMRS IP Voice	
10.1 VoLTE Tests Results	
. T-Coil testing for OTT VoIP Application	19
•	
). 2.	T-Coil Test Procedure 7.1 Test Flow Chart 7.2 Test Setup Diagram 7.3 Description of EUT Test Position Test Equipment List T-Coil testing for CMRS Voice 9.1 GSM Tests Results 9.2 UMTS Tests Results T-Coil testing for CMRS IP Voice 10.1 VoLTE Tests Results

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

History of this test report

Report No.: HA852405B

Report No.	Version	Description	Issued Date
HA852405B	Rev. 01	Initial issue of report	Jul. 24, 2018

TEL: 886-3-327-3456 Page: 3 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	T-Rating Frequency Response			
	GSM850	T3	Pass	Pass		
GSM CMRS Voice	GSM1900	Т3	Pass	Pass		
	EDGE850	T3	Pass	Pass		
OTT over EDGE	EDGE1900	Т3	Pass	Pass		
	Band 2	T4	Pass	Pass		
UMTS CMRS Voice	Band 4	T4	Pass	Pass		
	Band 5	T4	Pass	Pass		
	Band 2	T4	Pass	Pass		
OTT over UMTS	Band 4	T4	Pass	Pass		
	Band 5	T4	Pass	Pass		
	Band 2	T4	Pass	Pass		
	Band 4	T4	Pass	Pass		
	Band 5	T4	Pass	Pass		
	Band 7	T4	Pass	Pass		
VoLTE	Band 12	T4	Pass	Pass		
VOLIE	Band 13	T4	Pass	Pass		
	Band 17	T4	Pass	Pass		
	Band 26	T4	Pass	Pass		
	Band 38	T4	Pass	Pass		
	Band 41	T4	Pass	Pass		
OTT over LTE	Band 13	T4	Pass	Pass		
OTT over LTE	Band 41	T4	Pass	Pass		
	2450	T4	Pass	Pass		
	5200	T4	Pass	Pass		
OTT over WiFi	5300	T4	Pass	Pass		
	5500	T4	Pass	Pass		
	5800	T4	Pass	Pass		
Date Tested	2018/6/4 ~ 2018/7/9					

Report No.: HA852405B

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

Reviewed by: <u>Eric Huang</u> Report Producer: <u>Wan Liu</u>

TEL: 886-3-327-3456 Page: 4 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

2. General Information

	Product Feature & Specification
Applicant Name	ASUSTeK COMPUTER INC.
Equipment Name	ASUS Phone (Mobile Phone)
Brand Name	ASUS
Model Name	ASUS_Z01QD
FCC ID	MSQZ01QD
HW Version	R2.0
EUT Stage	Identical Prototype
Date Tested	2018/6/4 ~ 2018/7/9
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 784.5 MHz LTE Band 17: 706.5 MHz ~ 713.5 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 38: 2572.5 MHz ~ 2617.5 MHz LTE Band 41: 2498.5 MHz ~ 2687.5 MHz WLAN 2.4GHz Band: 5180 MHz ~ 2462 MHz WLAN 5.3GHz Band: 5180 MHz ~ 5240 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5500 MHz ~ 5700 MHz WLAN 5.8GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz
Mode	GSM/GPRS/EGPRS AMR / RMC 12.2Kbps HSDPA HSUPA DC-HSDPA LTE: QPSK, 16QAM 802.11a/b/g/n/ac HT20/HT40/VHT20/VHT40/VHT80 Bluetooth BR/EDR/LE NFC:ASK

Report No.: HA852405B

3. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Testing Laboratory			
Test Site	SPORTON INTERNATIONAL INC.		
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978		
Test Site No.	Sporton Site No.: SAR04-HY		

TEL: 886-3-327-3456 Page: 5 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction
	GSM850	1/0	V	WLAN, BT	CMDC Vaine	No
	GSM1900	VO	Yes	WLAN, BT	CMRS Voice	No
GSM	EDGE850	1/15		WLAN, BT	SIP Calling ⁽²⁾	NI.
	EDGE1900	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	850			WLAN, BT	Ĭ	No
	1750	VO	Yes	WLAN, BT	CMRS Voice	No
WCDMA	1900			WLAN, BT		No
	HSPA	VD	Yes	WLAN, BT	SIP Calling ⁽²⁾ / Google Duo ⁽¹⁾	No
	Band 2			WLAN, BT		No
	Band 4			WLAN, BT		No
	Band 5		VD Yes	WLAN, BT	VoLTE	No
LTE	Band 7	VD		WLAN, BT	/ SIP Calling ⁽²⁾	No
(FDD)	Band 12			WLAN, BT		No
	Band 13			WLAN, BT	Google Duo ⁽¹⁾	No
	Band 17			WLAN, BT		No
	Band 26			WLAN, BT		No
LTE	Band 38	VD	Voc	WLAN, BT	VoLTE / SIP Calling ⁽²⁾	No
(TDD)	Band 41	VD	162	Yes WLAN, BT		No
	2450			GSM,WCDMA,LTE	Google Duo ⁽¹⁾	No
	5200			GSM,WCDMA,LTE	SIP Calling ⁽²⁾	No
Wi-Fi	5300	VD	Yes	GSM,WCDMA,LTE	/	No
	5500			GSM,WCDMA,LTE	Google Duo ⁽¹⁾	No
	5800			GSM,WCDMA,LTE		No
BT	2450	DT	No	GSM,WCDMA,LTE	NA	No

Report No.: HA852405B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

Remark

- 1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.
- 2. The SIP calling is android internal auxiliary functions under the dialing program.
- The device have similar frequency in some LTE bands: LTE B12/17, 5/26, 38/41, since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.


TEL: 886-3-327-3456 Page: 6 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA852405B

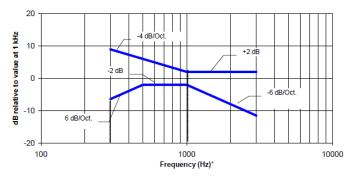

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

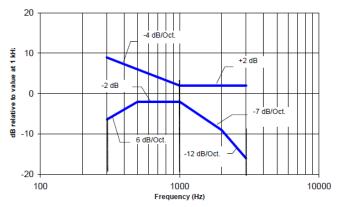

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

TEL: 886-3-327-3456 Page: 7 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA852405B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 8 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

7.1 Test Flow Chart


Test Instructions Confirm calibration of test eq uip ment Configure and validate the test setup Establish WD reference level Find measurement locations Per sub clause 7.3, 7.4.1 a)-b) & 7.4.4.4 Position and orient probe Measure desired aud io band signal strength Per sub clause 7.4.1 c)-e) Calculate signal strength Calculate signal quality Measure frequency resposne (perpendicular orientation only) Per sub clause 7.4.5 - 7.4.6 All locations measured? All locations measured? Determine and record signal quality category Done Per sub clause 8.2.4

Report No.: HA852405B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 9 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

7.2 Test Setup Diagram

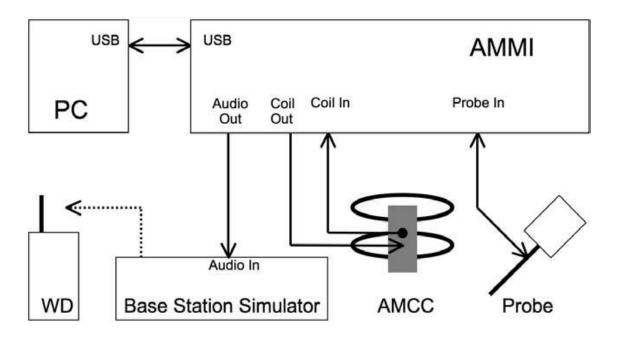

Report No.: HA852405B

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - GSM input level: -16dBm0
 - UMTS input level: -16dBm0
 - CDMA input level: -18dBm0
 - VoLTE input level: -16dBm0
 - VoWiFi input level: -20dBm0
 - OTT VoIP input Level: -20dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. The test setup used for VoLTE over IMS and VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- 5. The test setup used for Google DUO VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.
- 6. The test setup used for SIP Calling is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and can be determined the audio input level of -20dBm0.

TEL: 886-3-327-3456 Page: 10 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA852405B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k csek 8k 441 white 10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Calculation formula:

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

- Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.47	3.14
10	20	-19.85	-14.24
8.17	18.24	-21.61	-16

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

TEL: 886-3-327-3456 Page: 11 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA852405B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

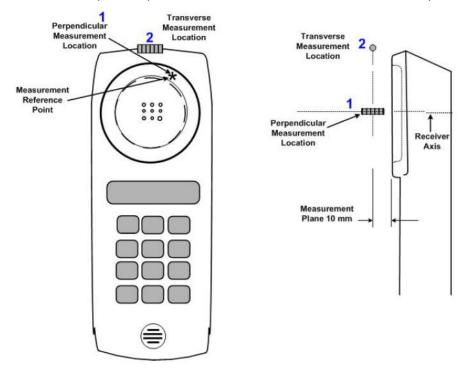


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 12 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

8. Test Equipment List

Manufacturer	nufacturer Name of Equipment Type/Model Serial Number	Type/Model	Carial Number	Calibration	
Manufacturer		Serial Number	Last Cal.	Due Date	
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018
SPEAG	Data Acquisition Electronics	DAE4	853	Jul. 19, 2017	Jul. 18, 2018
SPEAG	Data Acquisition Electronics	DAE4	1424	Jan. 18, 2018	Jan. 17, 2019
SPEAG	Data Acquisition Electronics	DAE4	1399	Nov. 16, 2017	Nov. 15, 2018
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
TESTO	Hygro meter	608-H1	34913631	Aug. 22, 2017	Aug. 21, 2018
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR
R&S	Base Station	CMU200	116457	May 20, 2018	May 19, 2019
R&S	Base Station	CMW500	115793	Aug. 23, 2017	Aug. 22, 2019

Report No.: HA852405B

Note:

TEL: 886-3-327-3456 Page: 13 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

^{1.} NCR: "No-Calibration Required"

9. T-Coil testing for CMRS Voice

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.

Report No.: HA852405B

- 2. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

9.1 GSM Tests Results

<Codec Investigation>

Codec	FR_V1	HR_V1	Orientation	Band / Channel	
ABM 1 (dBA/m)	6	6.41			
ABM 2 (dBA/m)	-19.79	-22.56	Axial	GSM1900 / 661	
Signal Quality (dB)	25.79	28.97	Axiai	GSW1900 / 661	
Freq. Response	PASS	PASS			

Remark: According to codec investigation, the worst codec is FR_V1

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel		ABM1 dB (A/m)	dB	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response	
1	GSM850	Voice(speech codec	189	Axial (Z)	4.27	-18.34	22.61	T3	-50.36	1.46	PASS	
	GSIVIOSO	handset low)	109	Transversal (Y)	-6.99	-32.28	25.29	T3	-50.22	1.40	FASS	
2	GSM1900	Voice(speech codec	661	Axial (Z)	6.00	-19.79	25.79	T3	-50.33	2	PASS	
	handset low)		001	Transversal (Y)	-10.00	-35.08	25.08	T3	-50.19	2	FASS	

TEL: 886-3-327-3456 Page: 14 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

9.2 UMTS Tests Results

<Codec Investigation>

Codec	AMR 4.75Kbps	AMR 7.95Kbps	AMR 12.2Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	5.56	5.97	5.96		
ABM 2 (dBA/m)	-45.81	-45.62	-45.99	Axial	Band 5 / 4182
Signal Quality (dB)	51.37	51.59	51.95	Axiai	Ballu 3 / 4162
Freq. Response	PASS	PASS	PASS		

Report No.: HA852405B

Remark: According to codec investigation, the worst codec is AMR 4.75Kbps

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel		dB	ABM2 dB (A/m)	Signal Quality dB		Ambient Noise dB (A/m)	Response	Frequency Response	
3	WCDMA II	Voice (appeals and a low)	9400	Axial (Z)	5.56	-45.81	51.37	T4	-50.32	2	PASS	
	WCDIVIA II	Voice (speech codec low)	9400	Transversal (Y)	-2.18	-48.35	46.17	T4	-50.21		FAGG	
4	WCDMA IV	Voice (anacch acdes law)	1.410	Axial (Z)	5.67	-45.90	51.57	T4	-50.30	2	PASS	
4	WCDIVIA IV	Voice (speech codec low)	1413	Transversal (Y)	-2.37	-48.03	45.66	T4	-50.22		PASS	
5	WCDMA V	Voice (appeals and a low)	4182	Axial (Z)	5.53	-46.33	51.86	T4	-50.29	2	PASS	
5	WCDMA V Voice (speech codec low)		4102	Transversal (Y)	-1.77	-47.65	45.88	T4	-50.19		PASS	

TEL: 886-3-327-3456 Page: 15 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

10. T-Coil testing for CMRS IP Voice

10.1 VoLTE Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.

Report No.: HA852405B

- b. Select LTE FDD / TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration, the observed variation is very little to be within 1.5 dB which is much less than the margin from the rating threshold.
- c. The TDD LTE supports uplink-downlink configuration 0 and 6 for this device, an investigation was performed to determine the worst-case uplink-downlink configuration to be used for the testing for the handset.
- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

LTE FDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	5.68	2.01	5.88	1.93		
ABM 2 (dBA/m)	-44.83	-44.28	-44.24	-43.81	۸۰۰:-۱	DO / 20M / 40000
Signal Quality (dB)	50.51	46.29	50.12	45.74	Axial	B2 / 20M / 18900
Freq. Response	PASS	PASS	PASS	PASS		

Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	2.33	2.1	2.13	2.35	2.42	2.95		
ABM 2 (dBA/m)	-43.77	-43.99	-44.47	-43.75	-44.62	-43.13	Axial	B2 / 20M /
Signal Quality (dB)	46.1	46.09	46.6	46.1	47.04	46.08	Axiai	18900
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is WB AMR 23.85Kbps

TEL: 886-3-327-3456 Page: 16 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

SPORTON LAB. HAC T-COIL TEST REPORT

LTE TDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	5.55	2.73	5.61	2.64		
ABM 2 (dBA/m)	-32.28	-31.44	-32.1	-31.16	Axial	B41 / 20M / 40620
Signal Quality (dB)	37.83	34.17	37.71	33.8	Axiai	D41 / 20W / 40020
Freq. Response	PASS	PASS	PASS	PASS		

Report No.: HA852405B

Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	2.71	2.59	2.66	2.69	2.58	2.73		
ABM 2 (dBA/m)	-31.61	-31.6	-31.56	-31.48	-31.73	-31.38	Axial	B41 / 20M /
Signal Quality (dB)	34.32	34.19	34.22	34.17	34.31	34.11	Axiai	40620
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is WB AMR 23.85Kbps

<Air Interface Investigation>

	Air Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B2	20	QPSK	1	0	18900	-	2.11	-43.54	45.65
	LTE B2	20	QPSK	50	0	18900	-	2.23	-43.69	45.92
	LTE B2	20	QPSK	100	0	18900	-	2.17	-43.66	45.83
	LTE B2	20	16QAM	1	0	18900	-	2.22	-43.55	45.77
FDD	LTE B2	20	64QAM	1	0	18900	-	2.22	-43.64	45.86
FDD	LTE B2	15	QPSK	1	0	18900	-	2.19	-43.70	45.89
	LTE B2	10	QPSK	1	0	18900	-	2.27	-43.53	45.80
	LTE B2	5	QPSK	1	0	18900	-	2.21	-43.63	45.84
	LTE B2	3	QPSK	1	0	18900	-	2.13	-43.56	45.69
	LTE B2	1.4	QPSK	1	0	18900	-	2.20	-43.48	45.68
	LTE B41	20	QPSK	1	0	40620	0	2.64	-31.16	33.80
	LTE B41	20	QPSK	50	0	40620	0	2.79	-31.33	34.12
	LTE B41	20	QPSK	100	0	40620	0	2.84	-31.13	33.97
	LTE B41	20	16QAM	1	0	40620	0	2.76	-31.30	34.06
	LTE B41	20	64QAM	1	0	40620	0	2.74	-31.35	34.09
	LTE B41	15	QPSK	1	0	40620	0	2.68	-31.24	33.92
	LTE B41	10	QPSK	1	0	40620	0	2.79	-31.14	33.93
TDD	LTE B41	5	QPSK	1	0	40620	0	2.84	-31.10	33.94
וטט	LTE B41	3	QPSK	1	0	40620	0	2.77	-31.40	34.17
	LTE B41	1.4	QPSK	1	0	40620	0	2.66	-31.47	34.13
	LTE B41	20	QPSK	1	0	40620	1	2.88	-31.17	34.05
	LTE B41	20	QPSK	1	0	40620	2	2.83	-31.14	33.97
	LTE B41	20	QPSK	1	0	40620	3	2.82	-31.13	33.95
	LTE B41	20	QPSK	1	0	40620	4	2.85	-31.12	33.97
	LTE B41	20	QPSK	1	0	40620	5	2.87	-31.10	33.97
	LTE B41	20	QPSK	1	0	40620	6	2.85	-31.10	33.95

TEL: 886-3-327-3456 Page: 17 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018



C T-COIL TEST REPORT Report No. : HA852405B

Plot No.	Air Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)		Frequency Response
6	LTE Band 2	20M	QPSK	1	0	18900	Axial (Z)	1.93	-43.81	45.74	T4	-50.38	2	PASS
	LIL Dana 2	20101	QI OIX		0	10300	Transversal (Y)	-6.74	-46.66	39.92	T4	-50.26		1 700
7	LTE Band 4	20M	QPSK	1	0	20175	Axial (Z)	2.37	-43.00	45.37	T4	-50.35	2	PASS
'	LIE Dallu 4	ZUIVI	QFSK	'	U	20175	Transversal (Y)	-6.09	-46.25	40.16	T4	-50.22	2	PASS
	LTE Danid 7	0014	ODCK	4	0	04400	Axial (Z)	2.42	-42.71	45.13	T4	-50.36	0	DACC
8	LTE Band 7	20M	QPSK	1	0	21100	Transversal (Y)	-6.29	-47.02	40.73	T4	-50.21	2	PASS
9	LTE Band 12	10M	QPSK	1	0	23095	Axial (Z)	2.12	-43.88	46.00	T4	-50.32	2	PASS
9	LIE Dallu 12	TOW	QFSK	'	U	23095	Transversal (Y)	-6.07	-46.47	40.40	T4	-50.21	2	FASS
10	LTE Band 13	10M	QPSK	1	0	23230	Axial (Z)	2.37	-40.53	42.90	T4	-50.29	2	PASS
10	LIE Danu 13	TOW	QPSK	'	U	23230	Transversal (Y)	-6.35	-45.42	39.07	T4	-50.18	2	PASS
11	LTE Dand OF	1511	QPSK	1	0	26965	Axial (Z)	2.19	-41.97	44.16	T4	-50.24	2	PASS
' '	LTE Band 26	15M	QPSK	'	U	26865	Transversal (Y)	-6.03	-46.17	40.14	T4	-50.18	2	PASS
10	LTE Dand 44	2014	ODCK	4	0	40620	Axial (Z)	2.64	-31.16	33.80	T4	-50.31	2	DACC
12	LTE Band 41	20M	QPSK	1	0	40620	Transversal (Y)	-9.56	-44.13	34.57	T4	-50.23	2	PASS

TEL: 886-3-327-3456 Page: 18 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

11. T-Coil testing for OTT VoIP Application

General Notes:

- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.
- 2. The google Duo VoIP application are pre-installed on this device. According to KDB 285076 D02, all air interfaces via a data connection with VoIP application need to be considered HAC testing.

Report No.: HA852405B

- 3. The Google Duo only support OPUS audio codec and support 6Kbpa to 75Kbps bitrate.
- 4. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 5. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 6. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration, the observed variation is very little to be within 1 dB which is much less than the margin from the rating threshold.
 - c. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VoLTE and VoWiFi test results of air interface investigation, the worst configuration and frequency band of air interface was used for OTT T-Coil testing.
 - -LTE FDD worst configuration and band: LTE Band 13/10MHz/QPSK/1RB Size
 - -LTE TDD worst configuration and band: LTE Band 41/20MHz/QPSK/1RB Size

<Codec Investigation>

EDGE

	Google Du	uo Codec Inv	estigation		SIP Callir	ng Codec Inv	estigation			
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s		PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	Band / Channel
ABM 1 (dBA/m)	6.77	7.63	6.88	6.39	6.73	6.65	6.21	6.08		
ABM 2 (dBA/m)	-22.55	-22.41	-22.71	-22.75	-23.33	-23.49	-23.13	-23.18		GSM1900 /
Signal Quality (dB)	29.32	30.04	29.59	29.14	30.06	30.14	29.34	29.26	Axial	661
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec GSM 13Kbit/s.

HSPA

	Google Di	uo Codec Inv	estigation/		SIP Callir	ng Codec Inv	estigation			
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s		PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	Band / Channel
ABM 1 (dBA/m)	7.36	8.65	7.09	4.21	5.91	5.85	5.98	6.07		
ABM 2 (dBA/m)	-33.07	-33.08	-35.81	-35.24	-35.33	-35.48	-33.75	-33.66		UMTS B2 /
Signal Quality (dB)	40.43	41.73	42.9	39.45	41.24	41.33	39.73	39.73	Axial	9400
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec GSM 13Kbit/s.

TEL: 886-3-327-3456 Page: 19 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

SPORTON LAB. HAC T-COIL TEST REPORT

LTE FDD

	Google Di	uo Codec Inv	estigation		SIP Callir	ig Codec Inv	estigation			
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	AMR NB 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	Band / Channel
ABM 1 (dBA/m)	7.36	11.22	9.5	5	5.44	5.4	5.07	6.03		
ABM 2 (dBA/m)	-35.67	-32.16	-34.23	-35.13	-35.59	-35.62	-35.26	-34.33		LTE B13 /
Signal Quality (dB)	43.03	43.38	43.73	40.13	41.03	41.02	40.33	40.36	Axial	23230
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Report No.: HA852405B

Remark: According to codec investigation, the worst codec GSM 13Kbit/s.

LTE TDD

	Google Du	uo Codec Inv	estigation/		SIP Callir					
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	AMR NB 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	Band / Channel
ABM 1 (dBA/m)	7.56	11.56	10.72	6.24	6.74	6.73	6.71	6.75	-	LTE B41 /
ABM 2 (dBA/m)	-30.26	-28.91	-28.72	-29.82	-29.68	-29.68	-29.56	-29.44		
Signal Quality (dB)	37.82	40.47	39.44	36.06	36.42	36.41	36.27	36.19	Axial	40620
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec GSM 13Kbit/s.

WLAN

	Google Du	uo Codec Inv	estigation/		SIP Callin					
Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	AMR NB 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	Band / Channel
ABM 1 (dBA/m)	5.65	6.74	6.49	6.62	3.88	4.12	4.01	4.03		WLAN2.4GHz / 6
ABM 2 (dBA/m)	-29.24	-28.52	-28.71	-28.21	-31.63	-31.52	-31.75	-31.69		
Signal Quality (dB)	34.89	35.26	35.2	34.83	35.51	35.64	35.76	35.72	Axial	
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec GSM 13Kbit/s.

TEL: 886-3-327-3456 Page: 20 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

<Air Interface Investigation>

Frequency Bands	BW (MHz)	Data Rate	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
802.11b	20	1M	6	6.76	-27.69	34.45
802.11b	20	11M	6	6.73	-28.33	35.06
802.11g	20	6M	6	7.08	-28.41	35.49
802.11g	20	54M	6	6.82	-28.21	35.03
802.11n-HT20	20	MCS0	6	7.30	-28.55	35.85
802.11n-HT20	20	MCS7	6	7.09	-28.92	36.01
802.11a	20	6M	40	4.56	-33.09	37.65
802.11a	20	54M	40	4.53	-33.40	37.93
802.11an-HT20	20	MCS0	40	4.61	-33.49	38.10
802.11an-HT20	20	MCS7	40	4.58	-33.08	37.66
802.11an-HT40	40	MCS0	38	4.62	-33.53	38.15
802.11an-HT40	40	MCS7	38	4.61	-33.49	38.10
802.11ac-VHT20	20	MCS0	40	4.51	-33.16	37.67
802.11ac-VHT20	20	MCS8	40	4.64	-33.35	37.99
802.11ac-VHT40	40	MCS0	38	4.62	-33.45	38.07
802.11ac-VHT40	40	MCS8	38	4.62	-33.40	38.02
802.11ac-VHT80	80	MCS0	50	4.65	-33.55	38.20
802.11ac-VHT80	80	MCS8	50	4.62	-33.27	37.89

Report No.: HA852405B

TEL: 886-3-327-3456 Page: 21 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

Plot No.	Air Interface	Mode	Channel	Ant Status	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	_	Ambient Noise dB (A/m)		Frequency Response
12	CCMOEO	EDCE 2 Ty elete	100		Axial (Z)	7.96	-21.21	29.17	T3	-50.34	0.74	DACC
13	GSM850	EDGE 2 Tx slots	189	-	Transversal (Y)	-7.06	-36.60	29.54	T3	-50.24	0.74	PASS
11	CCM4000	EDCE 2 Ty clote	661		Axial (Z)	6.39	-22.75	29.14	T3	-50.36	1	DACC
14	GSM1900	EDGE 2 Tx slots	661	-	Transversal (Y)	-7.07	-38.19	31.12	T4	-50.26	Response Variation	PASS
15	WCDMA II	HSPA	0400		Axial (Z)	4.21	-35.24	39.45	T4	-50.32	1 17	PASS
15	VVCDIVIA II	пора	9400	-	Transversal (Y)	-4.70	-44.05	39.35	T4	-50.22	1.17	PASS
16	MCDMA IV	LICDA	1410		Axial (Z)	4.53	-35.81	40.34	T4	-50.33	1.1	DACC
16	WCDMA IV	HSPA	1413	-	Transversal (Y)	-4.01	-43.49	39.48	T4	-50.21	Response Variation dB - 0.74 - 1 - 1.17 - 1.1 - 1.36 - 0.9 - 0.14 - 1.13 - 0.69 - 0.77 - 0.27 - 0.71 - 0.15 - 0.81 - 1.06	PASS
17	WCDMA V	LICDA	4400		Axial (Z)	4.51	-35.84	40.35	T4	-50.38	1.26	DACC
17	WCDMA V	HSPA	4182	-	Transversal (Y)	-3.87	-43.51	39.64	T4	-50.27	1.36	PASS
40	LTC Daniel 40	40M ODOK 4 0	00000		Axial (Z)	5.00	-35.13	40.13	T4	-50.25	0.0	DACC
18	LIE Band 13	10M_QPSK_1_0	23230	-	Transversal (Y)	-3.53	-42.46	38.93	T4	-50.26	0.9	PASS
40	1.75.5	0014 00014 4 0	40000		Axial (Z)	6.24	-29.82	36.06	T4	-50.31	0.44	PASS
19	LIE Band 41	20M_QPSK_1_0	40620	-	Transversal (Y)	-5.84	-41.26	35.42	T4	-50.28	0.14	
00	M/I AND 4011-	000 445 4845 -			Axial (Z)	6.62	-28.21	34.83	T4	-50.31	4.40	PASS
20	WLAN2.4GHZ	802.11b 1Mbps	6	Ant 1	Transversal (Y)	-4.82	-41.23	36.41	T4	-50.29	1.13	
04	M/I ANIO 401 I-	000 445 4105 -		A :: 1 O	Axial (Z)	6.04	-29.35	35.39	T4	-50.23	3	D4.00
21	WLAN2.4GHZ	802.11b 1Mbps	6	Ant 2	Transversal (Y)	-4.24	-39.87	35.63	T4	-50.28	0.69	PASS
00	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	000 44 - 014	40	A (4	Axial (Z)	5.04	-27.37	32.41	T4	-50.32	0.77	DA 00
22	WLAN5GHz	802.11a 6Mbps	40	Ant 1	Transversal (Y)	-5.57	-41.81	36.24	T4	-50.29	- 0.74 - 1 - 1.17 - 1.1 - 1.36 - 0.9 - 0.14 - 1.13 - 0.69 - 0.77 - 0.27 - 0.71 - 0.15 - 0.81 - 1.06	PASS
00	MU ANISOLI-	000 44 - 0046	00	A 1 - 4	Axial (Z)	4.67	-33.14	37.81	T4	-50.30	0.07	DA 00
23	WLAN5GHz	802.11a 6Mbps	60	Ant 1	Transversal (Y)	-4.34	-37.85	33.51	T4	-50.26	0.27	PASS
	14/1 41/15011	000 44 014	404		Axial (Z)	-0.17	-33.43	33.26	T4	-50.25	0.74	D400
24	WLAN5GHz	802.11a 6Mbps	124	Ant 1	Transversal (Y)	-11.93	-45.33	33.40	T4	-50.15	0.71	PASS
	14/1 ANISOLI	000 44 014	457		Axial (Z)	4.71	-33.61	38.32	T4	-50.34		PASS
25	WLAN5GHz	802.11a 6Mbps	157	Ant 1	Transversal (Y)	-4.25	-41.67	37.42	T4	-50.28	0.15	
00					Axial (Z)	3.37	-33.57	36.94	T4	-50.31	0.81	PASS
26	WLAN5GHz	802.11a 6Mbps	40	Ant 2	Transversal (Y)	-3.13	-39.25	36.12	T4	-50.25		
07	14/1 41/15011	000 44 014	00		Axial (Z)	6.89	-28.43	35.32	T4	-50.30		D4.00
27	WLAN5GHz	802.11a 6Mbps	60	Ant 2	Transversal (Y)	-5.65	-42.72	37.07	T4	-50.28	1.06	PASS
	14/1 AN:=0::	000 44 51 "	46.1		Axial (Z)	4.37	-32.72	37.09	T4	-50.31	0.00	D400
28	WI AN5GHz	802.11a 6Mbps	124	Ant 2		l			1		0.23	PASS

Report No.: HA852405B

PASS

PASS

0.23

0.79

Remark:

WLAN5GHz

WLAN5GHz

29

1. Phone Condition: Mute on; Backlight off; Max Volume

124

157

2. The detail frequency response results please refer to appendix A.

Ant 2

Ant 2

Transversal (Y)

Axial (Z)

Transversal (Y)

-6.20

0.80

-42.81

-29.80

-5.33 -43.01

36.61

30.60

37.68

T4

T4

T4

-50.29

-50.28

-50.19

3. Test Engineer: Tom Jiang

802.11a 6Mbps

802.11a 6Mbps

TEL: 886-3-327-3456 Page: 22 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

12. <u>Uncertainty Assessment</u>

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA852405B

Error Description	Uncertainty Error Description Value (±%)		Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)		
		Probe Sen	sitivity						
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %		
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %		
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %		
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %		
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %		
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %		
		Probe Sy	stem						
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %		
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %		
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %		
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %		
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %		
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %		
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %		
		Test Siç	gnal						
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %		
		Position	ing						
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %		
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %		
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %		
External Contributions									
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %		
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %		
		± 4.1 %	± 6.1 %						
	K = 2								
		± 8.1 %	± 12.3 %						

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 23 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018

13. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA852405B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 24 of 24
FAX: 886-3-328-4978 Issued Date: Jul. 24, 2018