FCC RF Test Report

APPLICANT: Lenovo (Shanghai) Electronics Technology Co., Ltd.

EQUIPMENT : Portable Tablet Computer

BRAND NAME : Lenovo

MODEL NAME : Lenovo TB-8505XS

FCC ID : 057TB8505X

STANDARD : FCC Part 15 Subpart C § 15.247

CLASSIFICATION: (DSS) Spread Spectrum Transmitter

TEST DATE(S) : Mar. 10, 2022

We, Sporton International Inc. (Kunshan), would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. (Kunshan), the test report shall not be reproduced except in full.

Reviewed by: Jason Jia / Supervisor

JasonJia

Approved by: Alex Wang / Manager

Sporton International Inc. (Kunshan)

No. 1098, Pengxi North Road, Kunshan Economic Development Zone Jiangsu Province 215300 People's Republic of China

Cert #5145.02

Report No.: FR981204-19A

TABLE OF CONTENTS

RE\	/ISIOI	N HISTORY	3
SUI	MMAR	Y OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Modification of EUT	5
	1.5	Testing Location	6
	1.6	Test Software	
	1.7	Applicable Standards	
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	7
	2.1	Carrier Frequency Channel	7
	2.2	Test Mode	8
	2.3	Connection Diagram of Test System	
	2.4	Support Unit used in test configuration and system	
	2.5	EUT Operation Test Setup	9
3	TEST	RESULT	
	3.1	Radiated Band Edges and Spurious Emission Measurement	
	3.2	Antenna Requirements	
4	_	OF MEASURING EQUIPMENT	_
5	UNCE	ERTAINTY OF EVALUATION	16
		X A. RADIATED SPURIOUS EMISSION	
APF	PENDI	X B. DUTY CYCLE PLOTS	
ΔDI	DENIDI	Y C SETUP PHOTOGRAPHS	

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Report No. : FR981204-19A

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR981204-19A	Rev. 01	Initial issue of report	Mar. 23, 2022

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 3 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No. : FR981204-19A

SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result	Remark
-	15.247(a)(1)	Number of Channels	≥ 15Chs	Not Applicable	-
-	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Not Applicable	-
	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Not Applicable	-
-	15.247(a)(1)	20dB Bandwidth	-	Not Applicable	-
-	15.247(b)(1) Peak Output Power		≤ 125 mW	Not Applicable	-
-	15.247(d)	Conducted Band Edges	≤ 20dBc	Not Applicable	-
-	- 15.247(d) Conducted Spuriou		≤ 20dBc	Not Applicable	-
		Radiated Band Edges			Under limit
3.1	15.247(d)	and Radiated Spurious	15.209(a) & 15.247(d)	Pass	14.41 dB at
		Emission			880.690 MHz
-	- 15.207 AC Conducted Emission		15.207(a)	Not Applicable	-
3.2 15.203 & Antenna Requirement 15.247(b)		15.203 & 15.247(b)	Pass	-	
Remark: No	ot Applicable mea	ns after assessing, test	items are not necess	ary to carry out	

Declaration of Conformity:

The test results with all measurement uncertainty excluded are presented in accordance with the regulation limits or requirements declared by manufacturers.

Comments and Explanations:

The declared of product specification for EUT presented in the report are provided by the manufacturer, and the manufacturer takes all the responsibilities for the accuracy of product specification.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 4 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

1 General Description

1.1 Applicant

Lenovo (Shanghai) Electronics Technology Co., Ltd.

Section 304-305, Building No. 4, # 222, Meiyue Road, China (Shanghai) Pilot Free Trade Zone

Report No.: FR981204-19A

1.2 Manufacturer

Lenovo PC HK Limited

23/F, Lincoln House, Taikoo Place 979 King's Road, Quarry Bay, Hong Kong, CHINA

1.3 Product Feature of Equipment Under Test

Product Feature				
Equipment Portable Tablet Computer				
Brand Name	Lenovo			
Model Name Lenovo TB-8505XS				
FCC ID O57TB8505X				
HW Version Lenovo TB-8505XS				
SW Version TB-8505XS_RF01_220317				
EUT Stage	Identical Prototype			

Remark:

- 1. The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.
- 2. This is a variant report for Lenovo TB-8505XS. The change note could be referred to the Lenovo TB-8505XS_Class II Permissive Change letter which is exhibit separately. Based on the similarity between current and previous project, only the related test cases from original test report (Sporton Report Number FR981204-01A) were verified for the differences.

1.4 Modification of EUT

No modifications are made to the EUT during all test items.

 Sporton International Inc. (Kunshan)
 Page Number
 : 5 of 16

 TEL: +86-512-57900158
 Report Issued Date
 : Mar. 23, 2022

 FAX: +86-512-57900958
 Report Version
 : Rev. 01

FCC ID: O57TB8505X Report Template No.: BU5-FR15CBT Version 2.0

1.5 Testing Location

Sporton International Inc. (Kunshan) is accredited to ISO/IEC 17025:2017 by American Association for Laboratory Accreditation with Certificate Number 5145.02.

Test Firm	Sporton International Inc. (Kunshan)				
	No. 1098, Pengxi North Road, Kunshan Economic Development Zone				
Test Site Location	Jiangsu Province 215300 People's Republic of China				
lest Site Location	TEL: +86-512-57900158				
	FAX: +86-512-57900958				
	Sporton Site No.	FCC Designation No.	FCC Test Firm		
Test Site No.	Sporton Site No.	rcc besignation No.	Registration No.		
	03CH07-KS	CN1257	314309		

1.6 Test Software

Item	Site	Manufacturer	Name	Version
1.	03CH07-KS	AUDIX	E3	6.2009-8-24al

1.7 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 15 Subpart C §15.247
- FCC KDB 558074 D01 15.247 Meas Guidance v05r02
- ANSI C63.10-2013

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

Sporton International Inc. (Kunshan)
TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 6 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 7 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR981204-19A

2.2 Test Mode

a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (X plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 1Mbps mode, and recorded in this report.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

	Summary table of Test Cases							
	Data Rate / Modulation							
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps					
	GFSK	π/4-DQPSK	8-DPSK					
Radiated	Bluetooth BR 1Mbps GFSK							
Test Cases	Mode 1: CH78_2480 MHz							

Remark:


- 1. For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and no other significantly frequencies found in conducted spurious emission.
- 2. For Radiated Test Cases, The tests were performed with Adapter 1, Earphone and USB cable 1.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 8 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

2.3 Connection Diagram of Test System

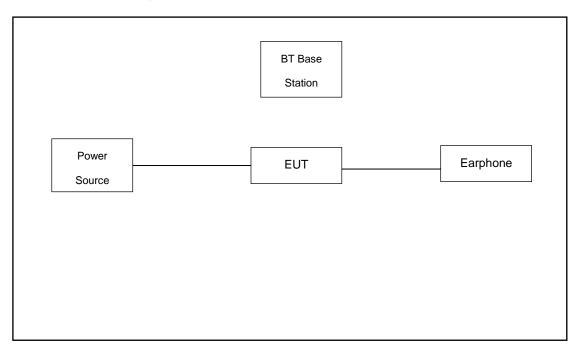

2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	BT Base station	R&S	CBT	N/A	N/A	Unshielded,1.8m
2.	Earphone	Lenovo	P121	N/A	Unshielded,1.2m	N/A

2.5 EUT Operation Test Setup

For Bluetooth function, the engineering test program was provided and enabled to make EUT connect with Bluetooth base station to continuous transmit.

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 9 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

3 Test Result

3.1 Radiated Band Edges and Spurious Emission Measurement

3.1.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 10 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

3.1.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 1. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 2. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$

Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20*log(Duty cycle)

- 5. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level
- For testing below 1GHz, if the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the CISPR quasi-peak method and reported.
- 7. For testing above 1GHz, the emission level of the EUT in peak mode was 20dB lower than peak limit (that means the emission level in average mode also complies with the limit in average mode), then peak values of EUT will be reported, otherwise, the emissions will be measured in average mode again and reported.


Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.82dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

Report Template No.: BU5-FR15CBT Version 2.0


Report No.: FR981204-19A

3.1.4 Test Setup


For radiated emissions below 30MHz

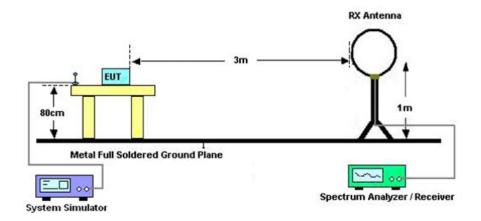

For radiated emissions from 30MHz to 1GHz

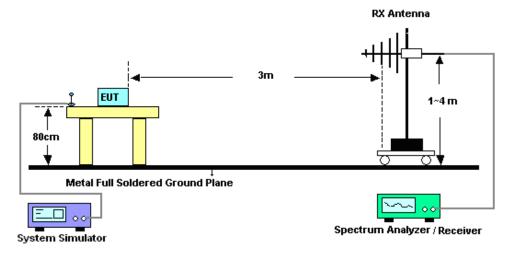

For radiated emissions above 1GHz

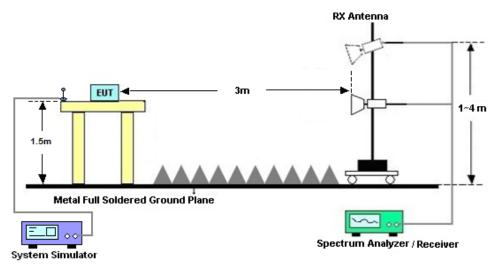

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 12 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

3.1.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line was not reported.

There is a comparison data of both open-field test site and semi-Anechoic chamber, and the result came out very similar.

3.1.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix A.

3.1.7 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic or 40GHz, whichever is lower)

Please refer to Appendix A.

3.1.8 Duty cycle correction factor for average measurement

Please refer to Appendix B.

Sporton International Inc. (Kunshan) TEL: +86-512-57900158

FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 13 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

3.2 Antenna Requirements

3.2.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

3.2.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.2.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 14 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR981204-19A

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
EMI Test Receiver	R&S	ESR7	101403	9kHz~7GHz;Max 30dBm	Oct. 16, 2021	Mar. 10, 2022	Oct. 15, 2022	Radiation (03CH07-KS)
EXA Spectrum Analyzer	Keysight	N9010A	MY553705 28	10Hz-44G,MAX 30dB	Oct. 16, 2021	Mar. 10, 2022	Oct. 15, 2022	Radiation (03CH07-KS)
Loop Antenna	R&S	HFH2-Z2	100321	9kHz~30MHz	Oct. 30, 2021	Mar. 10, 2022	Oct. 29, 2022	Radiation (03CH07-KS)
Bilog Antenna	TeseQ	CBL6111D	44483	30MHz-1GHz	Dec. 22, 2021	Mar. 10, 2022	Dec. 21, 2022	Radiation (03CH07-KS)
Double Ridge Horn Antenna	ETS-Lindgren	3117	75957	1GHz~18GHz	Oct. 30, 2021	Mar. 10, 2022	Oct. 29, 2022	Radiation (03CH07-KS)
high gain Amplifier	MITEQ	AMF-7D-001 01800-30-10 P	2025788	1Ghz-18Ghz	Jul. 30, 2021	Mar. 10, 2022	Jul. 29, 2022	Radiation (03CH07-KS)
SHF-EHF Horn	Com-power	AH-840	101070	18GHz~40GHz	Jan. 05, 2022	Mar. 10, 2022	Jan. 04, 2023	Radiation (03CH07-KS)
Amplifier	SONOMA	310N	187289	9KHz-1GHz	Apr. 13, 2021	Mar. 10, 2022	Apr. 12, 2022	Radiation (03CH07-KS)
Amplifier	Keysight	83017A	MY532703 16	500MHz~26.5GH z	Oct. 16, 2021	Mar. 10, 2022	Oct. 15, 2022	Radiation (03CH07-KS)
Amplifier	MITEQ	EM18G40GG A	060728	18~40GHz	Jan. 05, 2022	Mar. 10, 2022	Jan. 04, 2023	Radiation (03CH07-KS)
AC Power Source	Chroma	61601	616010002 473	N/A	NCR	Mar. 10, 2022	NCR	Radiation (03CH07-KS)
Turn Table	MF	MF7802	N/A	0~360 degree	NCR	Mar. 10, 2022	NCR	Radiation (03CH07-KS)
Antenna Mast	MF	MF7802	N/A	1 m~4 m	NCR	Mar. 10, 2022	NCR	Radiation (03CH07-KS)

NCR: No Calibration Required

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 15 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No. : FR981204-19A

5 Uncertainty of Evaluation

The measurement uncertainties shown below were calculated in accordance with the requirements of ANSI 63.10-2013. All the measurement uncertainty value were shown with a coverage K=2 to indicate 95% level of confidence. The measurement data show herein meets or exceeds the CISPR measurement uncertainty values specified in CISPR 16-4-2 and can be compared directly to specified limit to determine compliance.

03CH05 / 03CH07:

<u>Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)</u>

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	5.UGB

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	J.00B

<u>Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)</u>

Measuring Uncertainty for a Level of Confidence	5.0dB
of 95% (U = 2Uc(y))	3.0 0 B

----- THE END -----

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : 16 of 16
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No.: FR981204-19A

Appendix A. Radiated Spurious Emission

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		2483.98	51.66	-22.34	74	48.25	32.98	7.25	36.82	302	123	Р	Н
		2483.98	26.84	-27.16	54	-	-	-	-	-	-	Α	Н
DT		2480	105.72	-	-	102.31	32.98	7.25	36.82	302	123	Р	Н
BT CH 78		2480	80.90	-	-	-	-	-	-	-	-	Α	Н
2480MHz		2488.96	50.89	-23.11	74	47.45	33	7.25	36.81	344	33	Р	V
240011112		2488.96	26.07	-27.93	54	-	-	-	-	-	-	Α	V
		2480	105.75	-	-	102.34	32.98	7.25	36.82	344	33	Р	V
		2480	80.93	-	-	-	-	-	-	-	-	Α	V
Remark		o other spurious		Peak and	Average lim	it line.							

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dB _µ V)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		4965	50.84	-23.16	74	71.62	34.28	10.41	65.47	300	0	Р	Н
BT		7440	42.65	-31.35	74	60.28	35.89	12.79	66.31	300	0	Р	Н
CH 78 2480MHz		4965	46.74	-27.26	74	67.52	34.28	10.41	65.47	100	0	Р	٧
240UNITZ		7440	42.26	-31.74	74	59.89	35.89	12.79	66.31	100	0	Р	٧
Remark		o other spurious		Peak and	Average lim	it line.							,

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : A1 of A3
Report Issued Date : Mar. 23, 2022

Report No. : FR981204-19A

Report Version : Rev. 01

Emission below 1GHz

2.4GHz BT (LF)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
		(MHz)	(dBµV/m)	Limit (dB)	Line (dBµV/m)	Level (dBµV)	Factor (dB/m)	Loss (dB)	Factor (dB)	Pos (cm)		Avg. (P/A)	(H/V)
		130.88	16.42	-27.08	43.5	29.79	17.73	1.74	32.84	-	-	Р	Н
		182.29	18.72	-24.78	43.5	32.94	16.72	2.05	32.99	-	-	Р	Н
		241.46	20.87	-25.13	46	32.74	18.86	2.37	33.1	-	-	Р	Н
		272.5	23.48	-22.52	46	34.21	19.76	2.52	33.01	-	-	Р	Н
		400.54	21.06	-24.94	46	28.09	22.72	3.05	32.8	-	-	Р	Н
2.4GHz		647.89	25.53	-20.47	46	28.46	25.88	3.88	32.69	-	-	Р	Н
BT LF		37.76	22.51	-17.49	40	33.32	21.1	0.85	32.76	-	-	Р	V
LF		177.44	22.3	-21.2	43.5	36.4	16.84	2.02	32.96	-	-	Р	٧
		272.5	21.81	-24.19	46	32.54	19.76	2.52	33.01	-	-	Р	V
		400.54	23.07	-22.93	46	30.1	22.72	3.05	32.8	-	-	Р	V
		511.12	23.65	-22.35	46	28.16	24.8	3.45	32.76	-	-	Р	٧
		880.69	31.59	-14.41	46	32.27	27.32	4.54	32.54	-	-	Р	V
Remark		other spurious		mit line.									

Note symbol

*	Fundamental Frequency which can be ignored. However, the level of any
	unwanted emissions shall not exceed the level of the fundamental frequency.
!	Test result is over limit line.
P/A	Peak or Average
H/V	Horizontal or Vertical

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X Page Number : A2 of A3
Report Issued Date : Mar. 23, 2022
Report Version : Rev. 01

Report No. : FR981204-19A

A calculation example for radiated spurious emission is shown as below:

Report No.: FR981204-19A

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Path	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
вт		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 00													
2402MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

- 1. Path Loss(dB) = Cable loss(dB) + Filter loss(dB) + Attenuator loss(dB)
- 2. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

3. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Path Loss(dB) + Read Level(dBμV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

 Sporton International Inc. (Kunshan)
 Page Number
 : A3 of A3


 TEL: +86-512-57900158
 Report Issued Date
 : Mar. 23, 2022

 FAX: +86-512-57900958
 Report Version
 : Rev. 01


FCC ID: O57TB8505X

Appendix B. Duty Cycle Plots

3DH5 on time (One Pulse) Plot on Channel 78

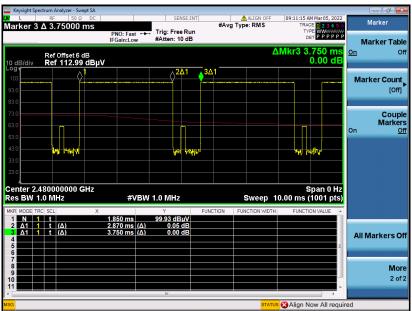

3DH5 on time (Count Pulses) Plot on Channel 78

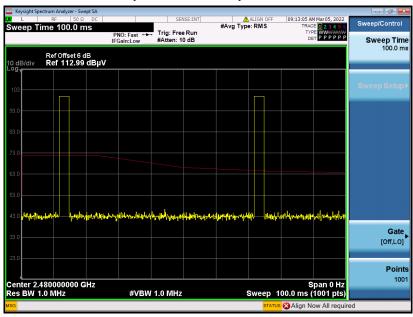

Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = $2 \times 2.87 / 100 = 5.74 \%$
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.82 dB
- 3DH5 has the highest duty cycle worst case and is reported.

Sporton International Inc. (Kunshan)

TEL: +86-512-57900158 FAX: +86-512-57900958 FCC ID: O57TB8505X

Page Number : B1 of B1 Report Issued Date : Mar. 23, 2022

Report No.: FR981204-19A

Report Version : Rev. 01